


Automation, Production Systems, and Computer-Integrated Manufacturing

Fourth Edition

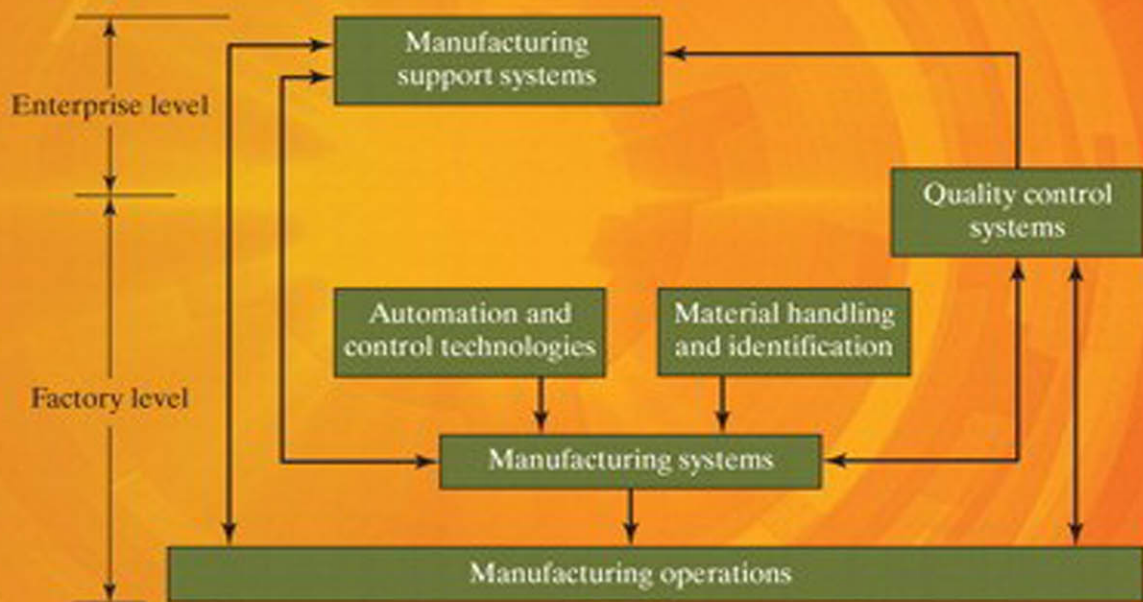

Mikell P. Groover

Abbreviations Used in This Book

Abbreviation	Unabbreviated Unit(s)
A	amps
C	Celsius, Centigrade
cm	centimeters
F	Fahrenheit
hp	horsepower
hr	hour, hours
Hz	hertz (sec) ⁻¹
in	inch, inches
lbf	pounds force
m	meters
min	minute, minutes
mm	millimeters
MPa	megapascals (N/mm ²)
mV	millivolts
N	newtons
ops	operations
Pa	pascals (N/m ²)
pc	pieces, parts
rad	Radians
rev	revolutions
sec	second, seconds
V	volts
W	watts
wk	week, weeks
yr	year, years
μ -in	microinches
μ m	microns, micrometers
μ -sec	microseconds
μ V	microvolts
Ω	ohms

Automation, Production Systems, and Computer-Integrated Manufacturing

This page intentionally left blank

Automation, Production Systems, and Computer-Integrated Manufacturing

Fourth Edition

Mikell P. Groover

*Professor Emeritus of Industrial
and Systems Engineering
Lehigh University*

PEARSON

Boston Columbus Indianapolis New York San Francisco Upper Saddle River
Amsterdam Cape Town Dubai London Madrid Milan Munich Paris Montréal Toronto
Delhi Mexico City São Paulo Sydney Hong Kong Seoul Singapore Taipei Tokyo

Vice President and Editorial Director, ECS:
Marcia J. Horton

Executive Editor: *Holly Stark*

Editorial Assistant: *Sandra Rodriguez*

Product Marketing Manager: *Bram Van Kempen*

Marketing Assistant: *Jon Bryant*

Senior Managing Editor: *Scott Disanno*

Production Program Manager: *Clare Romeo*

Production Project Manager: *Greg Dulles*

Director of Operations: *Nick Sklitsis*

Operations Specialist: *Maura Zaldivar-Garcia*

Cover Designer: *Dayanithi/Integra Software Services Pvt. Ltd.*

Manager, Rights and Permissions: *Rachel Youdelman*

Full-service Project Management: *George Jacob, Integra Software Services Pvt. Ltd.*

Composition: *Integra Software Services Pvt. Ltd.*

Printer/Binder: *Edwards Bros. Malloy Jackson Road*

Cover Printer: *Phoenix Color/Hagerstown*

Typeface: *10/12 Times Ten LT Std Roman*

Copyright © 2015 by Pearson Higher Education, Inc., Upper Saddle River, NJ 07458. All rights reserved. Manufactured in the United States of America. This publication is protected by Copyright and permissions should be obtained from the publisher prior to any prohibited reproduction, storage in a retrieval system, or transmission in any form or by any means, electronic, mechanical, photocopying, recording, or likewise. To obtain permission(s) to use materials from this work, please submit a written request to Pearson Higher Education, Permissions Department, One Lake Street, Upper Saddle River, NJ 07458.

The author and publisher of this book have used their best efforts in preparing this book. These efforts include the development, research, and testing of theories and programs to determine their effectiveness. The author and publisher make no warranty of any kind, expressed or implied, with regard to these programs or the documentation contained in this book. The author and publisher shall not be liable in any event for incidental or consequential damages with, or arising out of, the furnishing, performance, or use of these programs.

Pearson Education Ltd., *London*

Pearson Education Singapore, Pte. Ltd

Pearson Education Canada, Inc.

Pearson Education—Japan

Pearson Education Australia PTY, Limited

Pearson Education North Asia, Ltd., *Hong Kong*

Pearson Educación de Mexico, S.A. de C.V.

Pearson Education Malaysia, Pte. Ltd.

Pearson Education, Inc., *Upper Saddle River, New Jersey*

Library of Congress Cataloging-in-Publication Data

Groover, Mikell P.

Automation production systems and computer-integrated manufacturing/Mikell P. Groover, professor emeritus of Industrial and Systems Engineering, Lehigh University.—Fourth edition.

pages cm

ISBN 13: 978-0-13-349961-2

ISBN 10: 0-13-349961-8

1. Manufacturing processes—Automation. 2. Production control. 3. CAD/CAM systems.

4. Computer integrated manufacturing systems. 5. Robots, Industrial. I. Title.

TS183.G76 2015

670.285—dc23

2014002906

Printed in the United States of America

10 9 8 7 6 5 4 3 2 1

PEARSON

www.pearsonhighered.com

ISBN 10: 0-13-349961-8

ISBN 13: 978-0-13-349961-2

Contents

Preface xi

Chapter 1	INTRODUCTION	1
	1.1 Production Systems	2
	1.2 Automation in Production Systems	6
	1.3 Manual Labor in Production Systems	11
	1.4 Automation Principles and Strategies	13
	1.5 About This Book	18
PART I:	OVERVIEW OF MANUFACTURING	21
Chapter 2	MANUFACTURING OPERATIONS	21
	2.1 Manufacturing Industries and Products	25
	2.2 Manufacturing Operations	28
	2.3 Production Facilities	32
	2.4 Product/Production Relationships	37
Chapter 3	MANUFACTURING METRICS AND ECONOMICS	46
	3.1 Production Performance Metrics	47
	3.2 Manufacturing Costs	59
	APPENDIX 3A: Averaging Formulas for Equation (3.20)	73
PART II:	AUTOMATION AND CONTROL TECHNOLOGIES	75
Chapter 4	INTRODUCTION TO AUTOMATION	75
	4.1 Basic Elements of an Automated System	78
	4.2 Advanced Automation Functions	86
	4.3 Levels of Automation	91
Chapter 5	INDUSTRIAL CONTROL SYSTEMS	95
	5.1 Process Industries versus Discrete Manufacturing Industries	96
	5.2 Continuous versus Discrete Control	98
	5.3 Computer Process Control	104

Chapter 6	HARDWARE COMPONENTS FOR AUTOMATION AND PROCESS CONTROL	121
6.1	Sensors	122
6.2	Actuators	126
6.3	Analog–Digital Conversions	138
6.4	Input/Output Devices for Discrete Data	143
Chapter 7	COMPUTER NUMERICAL CONTROL	149
7.1	Fundamentals of NC Technology	152
7.2	Computers and Numerical Control	158
7.3	Applications of NC	163
7.4	Analysis of Positioning Systems	170
7.5	NC Part Programming	178
	APPENDIX 7A: Coding for Manual Part Programming	196
Chapter 8	INDUSTRIAL ROBOTICS	204
8.1	Robot Anatomy and Related Attributes	206
8.2	Robot Control Systems	214
8.3	End Effectors	216
8.4	Applications of Industrial Robots	217
8.5	Robot Programming	226
8.6	Robot Accuracy and Repeatability	234
Chapter 9	DISCRETE CONTROL AND PROGRAMMABLE LOGIC CONTROLLERS	244
9.1	Discrete Process Control	244
9.2	Ladder Logic Diagrams	252
9.3	Programmable Logic Controllers	256
9.4	Personal Computers and Programmable Automation Controllers	263
PART III:	MATERIAL HANDLING AND IDENTIFICATION	269
Chapter 10	MATERIAL TRANSPORT SYSTEMS	269
10.1	Overview of Material Handling	270
10.2	Material Transport Equipment	275
10.3	Analysis of Material Transport Systems	291
Chapter 11	STORAGE SYSTEMS	309
11.1	Introduction to Storage Systems	310
11.2	Conventional Storage Methods and Equipment	314
11.3	Automated Storage Systems	317
11.4	Analysis of Storage Systems	325
Chapter 12	AUTOMATIC IDENTIFICATION AND DATA CAPTURE	337
12.1	Overview of Automatic Identification Methods	338
12.2	Bar Code Technology	340
12.3	Radio Frequency Identification	347
12.4	Other AIDC Technologies	349

PART IV: MANUFACTURING SYSTEMS	353
Chapter 13 OVERVIEW OF MANUFACTURING SYSTEMS	353
13.1 Components of a Manufacturing System	354
13.2 Types of Manufacturing Systems	359
Chapter 14 SINGLE-STATION MANUFACTURING CELLS	366
14.1 Single-Station Manned Cells	367
14.2 Single-Station Automated Cells	368
14.3 Applications of Single-Station Cells	377
14.4 Analysis of Single-Station Cells	377
Chapter 15 MANUAL ASSEMBLY LINES	390
15.1 Fundamentals of Manual Assembly Lines	392
15.2 Analysis of Single-Model Assembly Lines	398
15.3 Line Balancing Algorithms	405
15.4 Workstation Details	411
15.5 Other Considerations in Assembly Line Design	413
15.6 Alternative Assembly Systems	416
APPENDIX 15A: Batch-Model and Mixed-Model Lines	426
Chapter 16 AUTOMATED PRODUCTION LINES	441
16.1 Fundamentals of Automated Production Lines	442
16.2 Applications of Automated Production Lines	450
16.3 Analysis of Transfer Lines	454
APPENDIX 16A: Transfer Lines with Internal Storage	464
Chapter 17 AUTOMATED ASSEMBLY SYSTEMS	472
17.1 Fundamentals of Automated Assembly Systems	473
17.2 Analysis of Automated Assembly Systems	479
Chapter 18 GROUP TECHNOLOGY AND CELLULAR MANUFACTURING	497
18.1 Part Families and Machine Groups	499
18.2 Cellular Manufacturing	506
18.3 Applications of Group Technology	511
18.4 Analysis of Cellular Manufacturing	513
APPENDIX 18A: Opitz Parts Classification and Coding System	528
Chapter 19 FLEXIBLE MANUFACTURING CELLS AND SYSTEMS	531
19.1 What Is a Flexible Manufacturing System?	533
19.2 FMC/FMS Components	538
19.3 FMS Application Considerations	545
19.4 Analysis of Flexible Manufacturing Systems	549
19.5 Alternative Approaches to Flexible Manufacturing	561

PART V:	QUALITY CONTROL SYSTEMS	575
Chapter 20	QUALITY PROGRAMS FOR MANUFACTURING	575
	20.1 Quality in Design and Manufacturing 576	
	20.2 Traditional and Modern Quality Control 577	
	20.3 Process Variability and Process Capability 580	
	20.4 Statistical Process Control 583	
	20.5 Six Sigma 596	
	20.6 Taguchi Methods in Quality Engineering 600	
	20.7 ISO 9000 605	
	APPENDIX 20A: The Six Sigma DMAIC Procedure 612	
Chapter 21	INSPECTION PRINCIPLES AND PRACTICES	618
	21.1 Inspection Fundamentals 619	
	21.2 Sampling versus 100% Inspection 624	
	21.3 Automated Inspection 628	
	21.4 When and Where to Inspect 630	
	21.5 Analysis of Inspection Systems 634	
Chapter 22	INSPECTION TECHNOLOGIES	647
	22.1 Inspection Metrology 648	
	22.2 Conventional Measuring and Gaging Techniques 653	
	22.3 Coordinate Measuring Machines 653	
	22.4 Surface Measurement 665	
	22.5 Machine Vision 667	
	22.6 Other Optical Inspection Methods 674	
	22.7 Noncontact Nonoptical Inspection Techniques 677	
	APPENDIX 22A: Geometric Feature Construction 682	
PART VI:	MANUFACTURING SUPPORT SYSTEMS	685
Chapter 23	PRODUCT DESIGN AND CAD/CAM IN THE PRODUCTION SYSTEM	685
	23.1 Product Design and CAD 686	
	23.2 CAM, CAD/CAM, and CIM 693	
	23.3 Quality Function Deployment 697	
Chapter 24	PROCESS PLANNING AND CONCURRENT ENGINEERING	703
	24.1 Process Planning 704	
	24.2 Computer-Aided Process Planning 709	
	24.3 Concurrent Engineering and Design for Manufacturing 712	
	24.4 Advanced Manufacturing Planning 716	

Chapter 25	PRODUCTION PLANNING AND CONTROL SYSTEMS	721
25.1	Aggregate Production Planning and the Master Production Schedule	723
25.2	Material Requirements Planning	725
25.3	Capacity Planning	731
25.4	Shop Floor Control	733
25.5	Inventory Control	739
25.6	Manufacturing Resource Planning (MRP II)	743
25.7	Enterprise Resource Planning (ERP)	744
Chapter 26	JUST-IN-TIME AND LEAN PRODUCTION	750
26.1	Lean Production and Waste in Manufacturing	751
26.2	Just-In-Time Production Systems	755
26.3	Autonomation	762
26.4	Worker Involvement	766
Appendix: Answers to Selected Problems		776
Index		782

This page intentionally left blank

Preface

This book has a history. It was originally published in 1980 as *Automation, Production Systems, and Computer-Aided Manufacturing*. Topics included automated flow lines, assembly line balancing, numerical control, CAD/CAM, control theory, process control, production planning, group technology, and flexible manufacturing systems. A revised edition was published in 1986 with a change in title to *Automation, Production Systems, and Computer-Integrated Manufacturing*. Additional topics included industrial robotics, programmable logic controllers, automated assembly systems, material handling and storage, automatic identification techniques, shop floor control, and the future automated factory. The second edition of the new title was released in 2000 with a 2001 copyright. Many of the topics remained the same as in the 1986 edition, but much of the material on control theory was eliminated. The book was reorganized substantially, and most of the chapters were rewritten to bring the technical subject matter up to date. The third edition was released in 2007 with a 2008 copyright. It contained expanded coverage of new and emerging technologies (e.g., radio frequency identification, Six Sigma, lean production, enterprise resource planning).

The basic objective of this new edition remains the same as in the previous editions: to provide up-to-date coverage of production systems, how they are sometimes automated and computerized, and how they can be mathematically analyzed to obtain performance metrics. The textbook is designed primarily for engineering students at the advanced undergraduate or beginning graduate levels in industrial, mechanical, and manufacturing engineering. It has all the features of an engineering textbook: equations, example problems, diagrams, quantitative end-of-chapter exercises, and technical descriptions that seem designed to baffle college students. The book should also be useful for practicing engineers and managers who wish to learn about automation and production systems technologies in modern manufacturing.

NEW TO THIS EDITION

In this fourth edition of the current title (fifth edition of the original 1980 book), I have consolidated and reorganized many of the topics and eliminated material that I felt is no longer relevant. Among the new topics and other changes in the book are those listed below. Items marked with an asterisk (*) relate to recommendations made by the reviewers (see Acknowledgments).

- In Chapter 3 (Manufacturing Metrics and Economics), many of the equations have been revised to make them more robust. A new section on cost of a manufactured part has been added.

- In Chapter 6 (Hardware Components for Automation and Process Control), new content has been added on electric motors, including linear motors and the conversion of rotary motion to linear motion.* Several new figures have been added in support of the new content.*
- In Chapter 7 (Computer Numerical Control), the appendix on APT has been removed because this method of programming has been largely replaced in industry by CAD/CAM part programming, coverage of which has been expanded in this new edition. In addition, the mathematical models of positioning control have been improved.
- In Chapter 8 (Industrial Robotics), two new robot configurations have been added and two configurations have been eliminated because they are no longer relevant.
- In Chapter 9 (Discrete Control and Programmable Logic Controllers), corrections and improvements have been made in the ladder logic examples.* A section on programmable automation controllers has been added.
- In Chapter 10 (Material Transport Systems), the section on AGVS technologies has been updated.
- In Chapter 11 (Storage Systems), the section on automated storage/retrieval systems has been updated and shortened.*
- In Chapter 12 (Automatic Identification and Data Capture), the section on radio frequency identification (RFID) has been expanded and updated.*
- In Chapter 14 (Single-Station Manufacturing Cells), coverage of CNC machining centers and related machine tools has been expanded.
- In Chapter 15 (Manual Assembly Lines), coverage of mixed-model assembly lines has been moved to an appendix, on the assumption that some instructors may not want to include this topic in their courses. A new section on batch-model assembly lines has been included in the appendix.
- In Chapter 16 (Automated Production Lines), coverage of transfer lines with internal parts storage has been moved to an appendix, on the assumption that some instructors may not want to include this topic in their courses.
- In Chapter 18 (Group Technology and Cellular Manufacturing), the organization of the text has been substantially revised. A new section on performance metrics in cell operations has been added. Coverage of parts classification and coding has been reduced, and the Opitz system has been relocated to an appendix.
- In Chapter 19 (Flexible Manufacturing Cells and Systems), sections on mass customization, reconfigurable manufacturing systems, and agile manufacturing have been added.
- In Chapter 20 (Quality Programs for Manufacturing), the DMAIC procedure in Six Sigma has been relocated to an appendix, on the assumption that some instructors may not want to cover the detailed methodology of Six Sigma. If they do, those details are in the appendix.
- In Chapter 22 (Inspection Technologies), the mathematical details of coordinate metrology have been relocated to an appendix. The section on machine vision has been updated to include recent advances in camera technology.

- In Chapter 23 (Product Design and CAD/CAM in the Production System), the section on CAD has been updated to be consistent with modern industrial practice.*
- In Chapter 25 (Production Planning and Control Systems), the section on work-in-process inventory costs has been eliminated, and the sections on MRP II and ERP have been upgraded.
- More than 50% of the end-of-chapter problems are new or revised. The total number of problems is increased from 393 in the third edition to 416 in this edition.
- An appendix has been added listing answers to selected end-of-chapter problems (answers to a total of 88 problems, or 21% of the end-of-chapter problems).*
- A total of 36 new or revised figures are included in this new edition, for a total of 278 figures. By comparison, the third edition has 293 figures, so the net change is a reduction of 15 figures. This is due to the removal of outdated and extraneous figures throughout the book and the elimination of the appendix on APT in Chapter 7.
- A list of abbreviations used in the book, located in the inside front cover, has been added for readers' reference.

SUPPORT MATERIALS FOR INSTRUCTORS

For instructors who adopt the book for their courses, the following support materials are available at the Pearson website, www.pearsonhighered.com. Evidence that the book has been adopted as the main textbook for the course must be verified.

- A **Solutions Manual** covering all review questions and problems
- A complete set of **PowerPoint** slides for all chapters

Individual questions or comments may be directed to the author at Mikell.Groover@Lehigh.edu or mpg0@Lehigh.edu.

ACKNOWLEDGMENTS

A number of changes in the book were motivated by responses to a survey that was conducted by the publisher. Some very worthwhile suggestions were offered by the reviewers, and I have attempted to incorporate them into the text where appropriate and feasible. In any case, I appreciate the thoughtful efforts that they contributed to the project, and I am sure that the book is better as a result of their efforts than it otherwise would have been. Participants in the survey were T. S. Bukkapatnam, Oklahoma State University; Joseph Domblesky, Marquette University; Brent Donham, Texas A&M University; John Jackman, Iowa State University; Matthew Kuttolamadom, Texas A&M University; Frank Peters, Iowa State University; and Tony Schmitz, University of North Carolina-Charlotte.

I also acknowledge the following individuals at Pearson Education Inc. for their support during this project: Holly Stark, Executive Editor; Clare Romeo, Program

Manager; and Sandra Rodriguez, Editorial Assistant. In addition, I am grateful for the fine job done by George Jacob at Integra Software Services who served as Program Manager for the project. He and the copy editors working with him were thorough and meticulous in their review of the manuscript (I take back all of the bad things I have ever said about copy editors throughout the nearly 40 years I have been writing textbooks).

Also, I am in gratitude to all of the faculty who have adopted the previous editions of the book for their courses, thus making those projects commercially successful for Pearson Education Inc., so that I would be allowed to prepare this new edition.

Finally, I wish to thank Marcia Hamm Groover, my wife, my PowerPoint slide expert, my computer specialist (I write books about computer-related technologies, but she is the one who fixes my computer when it has problems), and my supporter on this and other textbook projects.

ABOUT THE AUTHOR

Mikell P. Groover is Professor Emeritus of Industrial and Systems Engineering at Lehigh University, where he taught and did research for 44 years. He received his B.A. in Arts and Science (1961), B.S. in Mechanical Engineering (1962), M.S. in Industrial Engineering (1966), and Ph.D. (1969), all from Lehigh. His industrial experience includes several years as a manufacturing engineer before embarking on graduate studies at Lehigh.

His teaching and research areas include manufacturing processes, production systems, automation, material handling, facilities planning, and work systems. He has received a number of teaching awards at Lehigh University, as well as the Albert G. Holzman Outstanding Educator Award from the Institute of Industrial Engineers (1995) and the SME Education Award from the Society of Manufacturing Engineers (2001). His publications include over 75 technical articles and 12 books (listed below). His books are used throughout the world and have been translated into French, German, Spanish, Portuguese, Russian, Japanese, Korean, and Chinese. The first edition of *Fundamentals of Modern Manufacturing* received the IIE Joint Publishers Award (1996) and the M. Eugene Merchant Manufacturing Textbook Award from the Society of Manufacturing Engineers (1996).

Dr. Groover is a member of the Institute of Industrial Engineers (IIE) and the Society of Manufacturing Engineers (SME). He is a Fellow of IIE and SME.

PREVIOUS BOOKS BY THE AUTHOR

Automation, Production Systems, and Computer-Aided Manufacturing, Prentice Hall, 1980.
CAD/CAM: Computer-Aided Design and Manufacturing, Prentice Hall, 1984 (co-authored with E. W. Zimmers, Jr.).

Industrial Robotics: Technology, Programming, and Applications, McGraw-Hill Book Company, 1986 (co-authored with M. Weiss, R. Nagel, and N. Odrey).

Automation, Production Systems, and Computer-Integrated Manufacturing, Prentice Hall, 1987.

Fundamentals of Modern Manufacturing: Materials, Processes, and Systems, originally published by Prentice Hall in 1996, and subsequently published by John Wiley & Sons, Inc., 1999.

Automation, Production Systems, and Computer-Integrated Manufacturing, Second Edition, Prentice Hall, 2001.

Fundamentals of Modern Manufacturing: Materials, Processes, and Systems, Second Edition, John Wiley & Sons, Inc., 2002.

Fundamentals of Modern Manufacturing: Materials, Processes, and Systems, Third Edition, John Wiley & Sons, Inc., 2007.

Work Systems and the Methods, Measurement, and Management of Work, Pearson Prentice Hall, 2007.

Fundamentals of Modern Manufacturing: Materials, Processes, and Systems, Fourth Edition, John Wiley & Sons, Inc., 2010.

Introduction to Manufacturing Processes, John Wiley & Sons, Inc., 2012.

Fundamentals of Modern Manufacturing: Materials, Processes, and Systems, Fifth Edition, John Wiley & Sons, Inc., 2013.

This page intentionally left blank

Introduction

CHAPTER CONTENTS

- 1.1 Production Systems
 - 1.1.1 Facilities
 - 1.1.2 Manufacturing Support Systems
- 1.2 Automation in Production Systems
 - 1.2.1 Automated Manufacturing Systems
 - 1.2.2 Computerized Manufacturing Support Systems
 - 1.2.3 Reasons for Automating
- 1.3 Manual Labor in Production Systems
 - 1.3.1 Manual Labor in Factory Operations
 - 1.3.2 Labor in Manufacturing Support Systems
- 1.4 Automation Principles and Strategies
 - 1.4.1 The USA Principle
 - 1.4.2 Ten Strategies for Automation and Process Improvement
 - 1.4.3 Automation Migration Strategy
- 1.5 About This Book

The word *manufacturing* derives from two Latin words, *manus* (hand) and *factus* (make), so that the combination means *made by hand*. This was the way manufacturing was accomplished when the word first appeared in the English language around 1567. Commercial goods of those times were made by hand. The methods were handicraft, accomplished in small shops, and the goods were relatively simple, at least by today's standards. As many years passed, factories came into being, with many workers at a single site, and the work had to be organized using machines rather than handicraft techniques. The products

became more complex, and so did the processes to make them. Workers had to specialize in their tasks. Rather than overseeing the fabrication of the entire product, they were responsible for only a small part of the total work. More up-front planning was required, and more coordination of the operations was needed to keep track of the work flow in the factories. Slowly but surely, the systems of production were being developed.

The systems of production are essential in modern manufacturing. This book is all about these production systems and how they are sometimes automated and computerized.

1.1 PRODUCTION SYSTEMS

A production system is a collection of people, equipment, and procedures organized to perform the manufacturing operations of a company. It consists of two major components as indicated in Figure 1.1:

1. *Facilities.* The physical facilities of the production system include the equipment, the way the equipment is laid out, and the factory in which the equipment is located.
2. *Manufacturing support systems.* These are the procedures used by the company to manage production and to solve the technical and logistics problems encountered in ordering materials, moving the work through the factory, and ensuring that products meet quality standards. Product design and certain business functions are included in the manufacturing support systems.

In modern manufacturing operations, portions of the production system are automated and/or computerized. In addition, production systems include people. People make these systems work. In general, direct labor people (blue-collar workers)

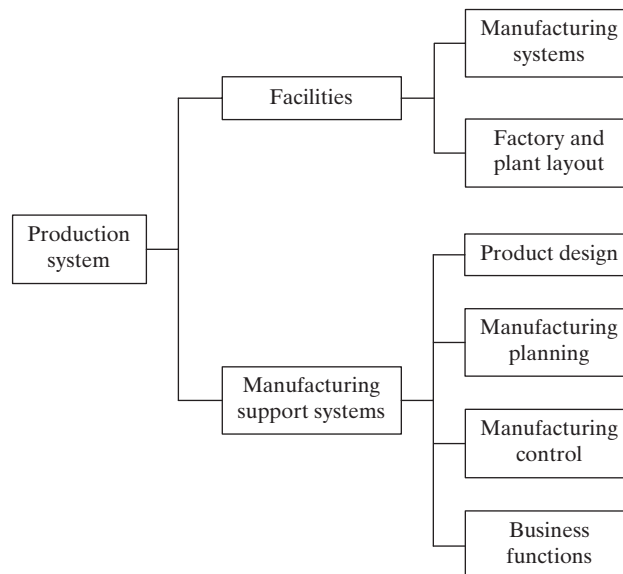


Figure 1.1 The production system consists of facilities and manufacturing support systems.

are responsible for operating the facilities, and professional staff people (white-collar workers) are responsible for the manufacturing support systems.

1.1.1 Facilities

The facilities in the production system consist of the factory, production machines and tooling, material handling equipment, inspection equipment, and computer systems that control the manufacturing operations. Facilities also include the *plant layout*, which is the way the equipment is physically arranged in the factory. The equipment is usually organized into *manufacturing systems*, which are the logical groupings of equipment and workers that accomplish the processing and assembly operations on parts and products made by the factory. Manufacturing systems can be individual work cells consisting of a single production machine and a worker assigned to that machine. More complex manufacturing systems consist of collections of machines and workers, for example, a production line. The manufacturing systems come in direct physical contact with the parts and/or assemblies being made. They “touch” the product.

In terms of human participation in the processes performed by the manufacturing systems, three basic categories can be distinguished, as portrayed in Figure 1.2: (a) manual work systems, (b) worker-machine systems, and (c) automated systems.

Manual Work Systems. A manual work system consists of one or more workers performing one or more tasks without the aid of powered tools. Manual material handling tasks are common activities in manual work systems. Production tasks commonly require the use of hand tools, such as screwdrivers and hammers. When using hand tools, a workholder is often employed to grasp the work part and position it securely for processing. Examples of production-related manual tasks involving the use of hand tools include

- A machinist using a file to round the edges of a rectangular part that has just been milled
- A quality control inspector using a micrometer to measure the diameter of a shaft
- A material handling worker using a dolly to move cartons in a warehouse
- A team of assembly workers putting together a piece of machinery using hand tools.

Worker-Machine Systems. In a worker-machine system, a human worker operates powered equipment, such as a machine tool or other production machine. This is one of the most widely used manufacturing systems. Worker-machine systems include

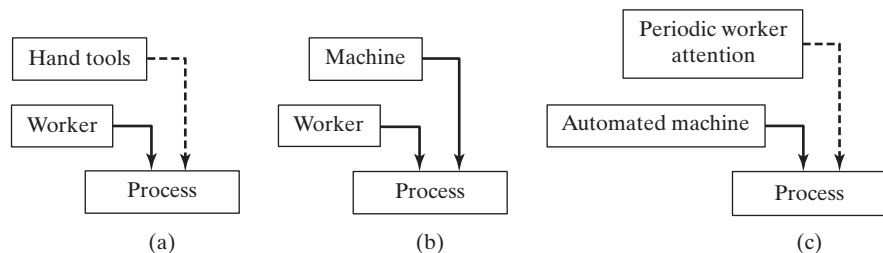


Figure 1.2 Three categories of manufacturing systems: (a) manual work system, (b) worker-machine system, and (c) fully automated system.

combinations of one or more workers and one or more pieces of equipment. The workers and machines are combined to take advantage of their relative strengths and attributes, which are listed in Table 1.1. Examples of worker-machine systems include the following:

- A machinist operating an engine lathe to fabricate a part for a product
- A fitter and an industrial robot working together in an arc-welding work cell
- A crew of workers operating a rolling mill that converts hot steel slabs into flat plates
- A production line in which the products are moved by mechanized conveyor and the workers at some of the stations use power tools to accomplish their processing or assembly tasks.

Automated Systems. An automated system is one in which a process is performed by a machine without the direct participation of a human worker. Automation is implemented using a program of instructions combined with a control system that executes the instructions. Power is required to drive the process and to operate the program and control system (these terms are defined more completely in Chapter 4).

There is not always a clear distinction between worker-machine systems and automated systems, because many worker-machine systems operate with some degree of automation. Two levels of automation can be identified: semiautomated and fully automated. A *semiautomated machine* performs a portion of the work cycle under some form of program control, and a human worker tends to the machine for the remainder of the cycle, by loading and unloading it, or by performing some other task each cycle. A *fully automated machine* is distinguished from its semiautomated counterpart by its capacity to operate for an extended period of time with no human attention. Extended period of time means longer than one work cycle; a worker is not required to be present during each cycle. Instead, the worker may need to tend the machine every tenth cycle, or every hundredth cycle. An example of this type of operation is found in many injection molding plants, where the molding machines run on automatic cycles, but periodically the molded parts at the machine must be collected by a worker. Figure 1.2(c) depicts a fully automated system. The semiautomated system is best portrayed by Figure 1.2(b).

In certain fully automated processes, one or more workers are required to be present to continuously monitor the operation, and make sure that it performs according to the intended specifications. Examples of these kinds of automated processes include complex

TABLE 1.1 Relative Strengths and Attributes of Humans and Machines

Humans	Machines
Sense unexpected stimuli	Perform repetitive tasks consistently
Develop new solutions to problems	Store large amounts of data
Cope with abstract problems	Retrieve data from memory reliably
Adapt to change	Perform multiple tasks simultaneously
Generalize from observations	Apply high forces and power
Learn from experience	Perform simple computations quickly
Make decisions based on incomplete data	Make routine decisions quickly

chemical processes, oil refineries, and nuclear power plants. The workers do not actively participate in the process except to make occasional adjustments in the equipment settings, perform periodic maintenance, and spring into action if something goes wrong.

1.1.2 Manufacturing Support Systems

To operate the production facilities efficiently, a company must organize itself to design the processes and equipment, plan and control the production orders, and satisfy product quality requirements. These functions are accomplished by manufacturing support systems—people and procedures by which a company manages its production operations. Most of these support systems do not directly contact the product, but they plan and control its progress through the factory.

Manufacturing support involves a sequence of activities, as depicted in Figure 1.3. The activities consist of four functions that include much information flow and data processing: (1) business functions, (2) product design, (3) manufacturing planning, and (4) manufacturing control.

Business Functions. The business functions are the principal means by which the company communicates with the customer. They are, therefore, the beginning and the end of the information-processing sequence. Included in this category are sales and marketing, sales forecasting, order entry, and customer billing.

The order to produce a product typically originates from the customer and proceeds into the company through the sales department of the firm. The production order will be in one of the following forms: (1) an order to manufacture an item to the customer's specifications, (2) a customer order to buy one or more of the manufacturer's proprietary products, or (3) an internal company order based on a forecast of future demand for a proprietary product.

Product Design. If the product is manufactured to customer design, the design has been provided by the customer, and the manufacturer's product design department is not involved. If the product is to be produced to customer specifications, the manufacturer's product design department may be contracted to do the design work for the product as well as to manufacture it.

If the product is proprietary, the manufacturing firm is responsible for its development and design. The sequence of events that initiates a new product design often originates in the sales department; the direction of information flow is indicated in Figure 1.3. The departments of the firm that are organized to accomplish product design might include research and development, design engineering, and perhaps a prototype shop.

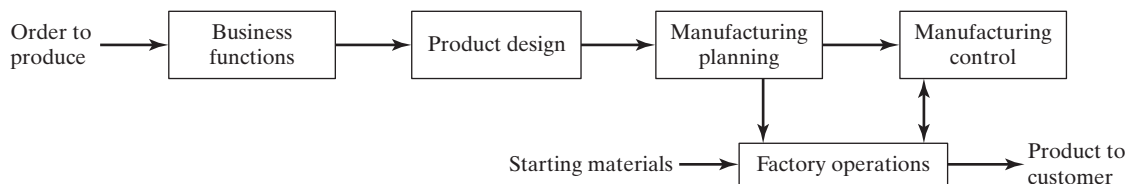


Figure 1.3 Sequence of information-processing activities in a typical manufacturing firm.

Manufacturing Planning. The information and documentation that constitute the product design flows into the manufacturing planning function. The information-processing activities in manufacturing planning include process planning, master scheduling, material requirements planning, and capacity planning.

Process planning consists of determining the sequence of individual processing and assembly operations needed to produce the part. The manufacturing engineering department is responsible for planning the processes and related technical details such as tooling. Manufacturing planning includes logistics issues, commonly known as production planning. The authorization to produce the product must be translated into the **master production schedule**, which is a listing of the products to be made, the dates on which they are to be delivered, and the quantities of each. Based on this master schedule, the individual components and subassemblies that make up each product must be scheduled. Raw materials must be purchased or requisitioned from storage, parts must be ordered from suppliers, and all of these items must be planned so they are available when needed. The computations for this planning are made by **material requirements planning**. In addition, the master schedule must not list more quantities of products than the factory is capable of producing each month with its given number of machines and manpower. **Capacity planning** is concerned with determining the human and equipment resources of the firm and checking to make sure that the production plan is feasible.

Manufacturing Control. Manufacturing control is concerned with managing and controlling the physical operations in the factory to implement the manufacturing plans. The flow of information is from planning to control as indicated in Figure 1.3. Information also flows back and forth between manufacturing control and the factory operations. Included in this function are shop floor control, inventory control, and quality control.

Shop floor control deals with the problem of monitoring the progress of the product as it is being processed, assembled, moved, and inspected in the factory. Shop floor control is concerned with inventory in the sense that the materials being processed in the factory are work-in-process inventory. Thus, shop floor control and inventory control overlap to some extent. **Inventory control** attempts to strike a proper balance between the risk of too little inventory (with possible stock-outs of materials) and the carrying cost of too much inventory. It deals with such issues as deciding the right quantities of materials to order and when to reorder a given item when stock is low. The function of **quality control** is to ensure that the quality of the product and its components meet the standards specified by the product designer. To accomplish its mission, quality control depends on inspection activities performed in the factory at various times during the manufacture of the product. Also, raw materials and component parts from outside sources are sometimes inspected when they are received, and final inspection and testing of the finished product is performed to ensure functional quality and appearance. Quality control also includes data collection and problem-solving approaches to address process problems related to quality, such as statistical process control (SPC) and Six Sigma.

1.2 AUTOMATION IN PRODUCTION SYSTEMS

Some components of the firm's production system are likely to be automated, whereas others will be operated manually or clerically. The automated elements of the production system can be separated into two categories: (1) automation of the manufacturing

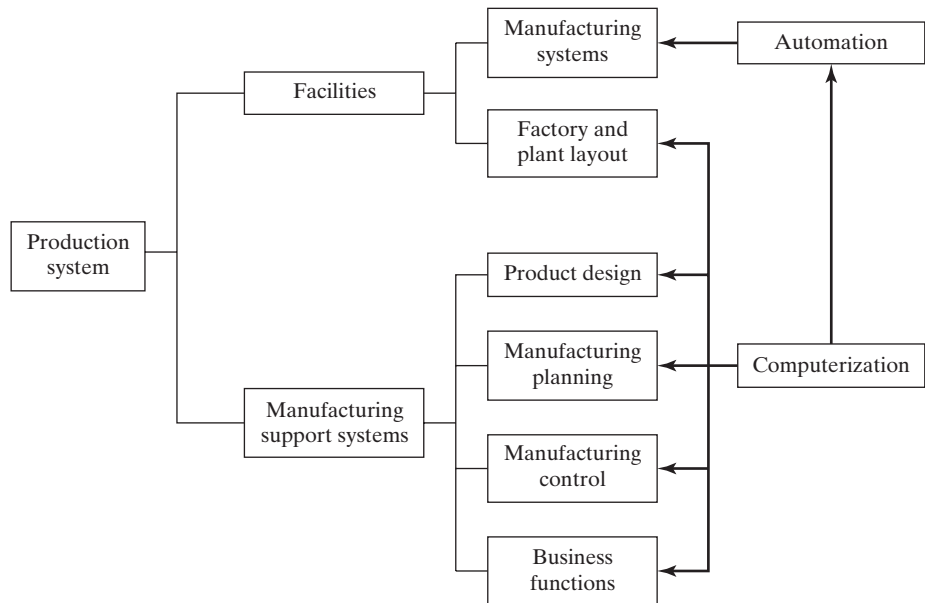


Figure 1.4 Opportunities for automation and computerization in a production system.

systems in the factory, and (2) computerization of the manufacturing support systems. In modern production systems, the two categories are closely related, because the automated manufacturing systems on the factory floor are themselves usually implemented by computer systems that are integrated with the manufacturing support systems and management information system operating at the plant and enterprise levels. The two categories of automation are shown in Figure 1.4 as an overlay on Figure 1.1.

1.2.1 Automated Manufacturing Systems

Automated manufacturing systems operate in the factory on the physical product. They perform operations such as processing, assembly, inspection, and material handling, in many cases accomplishing more than one of these operations in the same system. They are called automated because they perform their operations with a reduced level of human participation compared with the corresponding manual process. In some highly automated systems, there is virtually no human participation. Examples of automated manufacturing systems include:

- Automated machine tools that process parts
- Transfer lines that perform a series of machining operations
- Automated assembly systems
- Manufacturing systems that use industrial robots to perform processing or assembly operations
- Automatic material handling and storage systems to integrate manufacturing operations
- Automatic inspection systems for quality control.

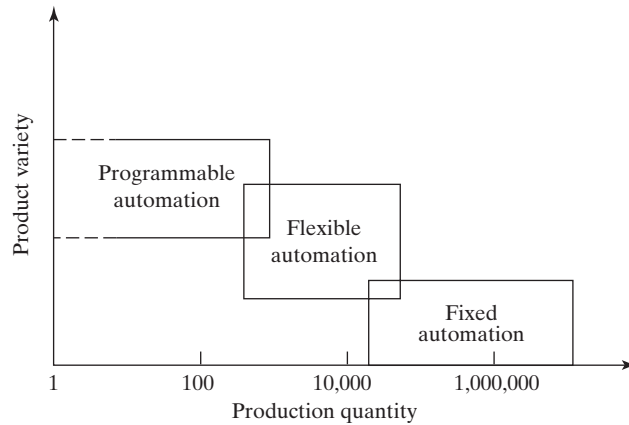


Figure 1.5 Three types of automation relative to production quantity and product variety.

Automated manufacturing systems can be classified into three basic types: (1) fixed automation, (2) programmable automation, and (3) flexible automation. They generally operate as fully automated systems although semiautomated systems are common in programmable automation. The relative positions of the three types of automation for different production volumes and product varieties are depicted in Figure 1.5.

Fixed Automation. Fixed automation is a system in which the sequence of processing (or assembly) operations is fixed by the equipment configuration. Each operation in the sequence is usually simple, involving perhaps a plain linear or rotational motion or an uncomplicated combination of the two, such as feeding a rotating spindle. It is the integration and coordination of many such operations in one piece of equipment that makes the system complex. Typical features of fixed automation are (1) high initial investment for custom-engineered equipment, (2) high production rates, and (3) inflexibility of the equipment to accommodate product variety.

The economic justification for fixed automation is found in products that are made in very large quantities and at high production rates. The high initial cost of the equipment can be spread over a very large number of units, thus minimizing the unit cost relative to alternative methods of production. Examples of fixed automation include machining transfer lines and automated assembly machines.

Programmable Automation. In programmable automation, the production equipment is designed with the capability to change the sequence of operations to accommodate different product configurations. The operation sequence is controlled by a *program*, which is a set of instructions coded so that they can be read and interpreted by the system. New programs can be prepared and entered into the equipment to produce new products. Some of the features that characterize programmable automation include (1) high investment in general-purpose equipment, (2) lower production rates than fixed automation, (3) flexibility to deal with variations and changes in product configuration, and (4) high suitability for batch production.

Programmable automated systems are used in low- and medium-volume production. The parts or products are typically made in batches. To produce each new batch of a different item, the system must be reprogrammed with the set of machine instructions that correspond to the new item. The physical setup of the machine must also be changed: Tools must be loaded, fixtures must be attached to the machine table, and any required machine settings must be entered. This changeover takes time. Consequently, the typical cycle for a given batch includes a period during which the setup and reprogramming take place, followed by a period in which the parts are produced. Examples of programmable automation include numerically controlled (NC) machine tools, industrial robots, and programmable logic controllers.

Flexible Automation. Flexible automation is an extension of programmable automation. A flexible automated system is capable of producing a variety of parts or products with virtually no time lost for changeovers from one design to the next. There is no lost production time while reprogramming the system and altering the physical setup (tooling, fixtures, machine settings). Accordingly, the system can produce various mixes and schedules of parts or products instead of requiring that they be made in batches. What makes flexible automation possible is that the differences between parts processed by the system are not significant, so the amount of changeover between designs is minimal. Features of flexible automation include (1) high investment for a custom-engineered system, (2) continuous production of variable mixtures of parts or products, (3) medium production rates, and (4) flexibility to deal with product design variations. Examples of flexible automation are flexible manufacturing systems that perform machining processes.

1.2.2 Computerized Manufacturing Support Systems

Automation of the manufacturing support systems is aimed at reducing the amount of manual and clerical effort in product design, manufacturing planning and control, and the business functions of the firm. Nearly all modern manufacturing support systems are implemented using computers. Indeed, computer technology is used to implement automation of the manufacturing systems in the factory as well. **Computer-integrated manufacturing** (CIM) denotes the pervasive use of computer systems to design the products, plan the production, control the operations, and perform the various information-processing functions needed in a manufacturing firm. True CIM involves integrating all of these functions in one system that operates throughout the enterprise. Other terms are used to identify specific elements of the CIM system; for example, *computer-aided design* (CAD) supports the product design function. *Computer-aided manufacturing* (CAM) is used for functions related to manufacturing engineering, such as process planning and numerical control part programming. Some computer systems perform both CAD and CAM, and so the term *CAD/CAM* is used to indicate the integration of the two into one system.

Computer-integrated manufacturing involves the information-processing activities that provide the data and knowledge required to successfully produce the product. These activities are accomplished to implement the four basic manufacturing support functions identified earlier: (1) business functions, (2) product design, (3) manufacturing planning, and (4) manufacturing control.

1.2.3 Reasons for Automating

Companies undertake projects in automation and computer-integrated manufacturing for good reasons, some of which are the following:

1. *Increase labor productivity.* Automating a manufacturing operation invariably increases production rate and labor productivity. This means greater output per hour of labor input.
2. *Reduce labor cost.* Increasing labor cost has been, and continues to be, the trend in the world's industrialized societies. Consequently, higher investment in automation has become economically justifiable to replace manual operations. Machines are increasingly being substituted for human labor to reduce unit product cost.
3. *Mitigate the effects of labor shortages.* There is a general shortage of labor in many advanced nations, and this has stimulated the development of automated operations as a substitute for labor.
4. *Reduce or eliminate routine manual and clerical tasks.* An argument can be put forth that there is social value in automating operations that are routine, boring, fatiguing, and possibly irksome. Automating such tasks improves the general level of working conditions.
5. *Improve worker safety.* Automating a given operation and transferring the worker from active participation in the process to a monitoring role, or removing the worker from the operation altogether, makes the work safer. The safety and physical well-being of the worker has become a national objective with the enactment of the Occupational Safety and Health Act (OSHA) in 1970. This has provided an impetus for automation.
6. *Improve product quality.* Automation not only results in higher production rates than manual operation, it also performs the manufacturing process with greater consistency and conformity to quality specifications.
7. *Reduce manufacturing lead time.* Automation helps reduce the elapsed time between customer order and product delivery, providing a competitive advantage to the manufacturer for future orders. By reducing manufacturing lead time, the manufacturer also reduces work-in-process inventory.
8. *Accomplish processes that cannot be done manually.* Certain operations cannot be accomplished without the aid of a machine. These processes require precision, miniaturization, or complexity of geometry that cannot be achieved manually. Examples include certain integrated circuit fabrication operations, rapid prototyping processes based on computer graphics (CAD) models, and the machining of complex, mathematically defined surfaces using computer numerical control. These processes can only be realized by computer-controlled systems.
9. *Avoid the high cost of not automating.* There is a significant competitive advantage gained in automating a manufacturing plant. The advantage cannot always be demonstrated on a company's project authorization form. The benefits of automation often show up in unexpected and intangible ways, such as in improved quality, higher sales, better labor relations, and better company image. Companies that do not automate are likely to find themselves at a competitive disadvantage with their customers, their employees, and the general public.

1.3 MANUAL LABOR IN PRODUCTION SYSTEMS

Is there a place for manual labor in the modern production system? The answer is yes. Even in a highly automated production system, humans are still a necessary component of the manufacturing enterprise. For the foreseeable future, people will be required to manage and maintain the plant, even in those cases where they do not participate directly in its manufacturing operations. The discussion of the labor issue is separated into two parts, corresponding to the previous distinction between facilities and manufacturing support: (1) manual labor in factory operations and (2) labor in manufacturing support systems.

1.3.1 Manual Labor in Factory Operations

There is no denying that the long-term trend in manufacturing is toward greater use of automated machines to substitute for manual labor. This has been true throughout human history, and there is every reason to believe the trend will continue. It has been made possible by applying advances in technology to factory operations. In parallel and sometimes in conflict with this technologically driven trend are issues of economics that continue to find reasons for employing manual labor in manufacturing.

Certainly one of the current economic realities in the world is that there are countries whose average hourly wage rates are so low that most automation projects are difficult to justify strictly on the basis of cost reduction. These countries include China, India, Mexico, and many countries in Eastern Europe, Southeast Asia, and Latin America. With the passage of the North American Free Trade Agreement (NAFTA), the North American continent has become one large labor pool. Within this pool, Mexico's labor rate is an order of magnitude less than that in the United States. U.S. corporate executives who make decisions on factory locations and the outsourcing of work must reckon with this reality.

In addition to the labor cost issue, there are other reasons, ultimately based on economics, that make the use of manual labor a feasible alternative to automation. Humans possess certain attributes that give them an advantage over machines in certain situations and certain kinds of tasks (Table 1.1). A number of situations can be listed in which manual labor is preferred over automation:

- *Task is technologically too difficult to automate.* Certain tasks are very difficult (either technologically or economically) to automate. Reasons for the difficulty include (1) problems with physical access to the work location, (2) adjustments required in the task, (3) manual dexterity requirements, and (4) demands on hand-eye coordination. Manual labor is used to perform the tasks in these cases. Examples include automobile final assembly lines where many final trim operations are accomplished by human workers, inspection tasks that require judgment to assess quality, and material handling tasks that involve flexible or fragile materials.
- *Short product life cycle.* If a product must be designed and introduced in a short period of time to meet a near-term window of opportunity in the marketplace, or if the product is anticipated to be on the market for a relatively short period, then a manufacturing method designed around manual labor allows for a much sooner product launch than does an automated method. Tooling for manual production can be fabricated in much less time and at much lower cost than comparable automation tooling.

- *Customized product.* If the customer requires a one-of-a-kind item with unique features, manual labor has the advantage as the appropriate production resource because of its versatility and adaptability. Humans are more flexible than any automated machine.
- *Ups and downs in demand.* Changes in demand for a product necessitate changes in production output levels. Such changes are more easily made when manual labor is used as the means of production. An automated manufacturing system has a fixed cost associated with its investment. If output is reduced, that fixed cost must be spread over fewer units, driving up the unit cost of the product. On the other hand, an automated system has an ultimate upper limit on its output capacity. It cannot produce more than its rated capacity. By contrast, manual labor can be added or reduced as needed to meet demand, and the associated cost of the resource is in direct proportion to its employment. Manual labor can be used to augment the output of an existing automated system during those periods when demand exceeds the capacity of the automated system.
- *Need to reduce risk of product failure.* A company introducing a new product to the market never knows for sure what the ultimate success of that product will be. Some products will have long life cycles, while others will be on the market for relatively short periods. The use of manual labor as the productive resource at the beginning of the product's life reduces the company's risk of losing a significant investment in automation if the product fails to achieve a long market life. Section 1.4.3 discusses an automation migration strategy that is suitable for introducing a new product.
- *Lack of capital.* Companies are sometimes forced to use manual labor in their production operations when they lack the capital to invest in automated equipment.

1.3.2 Labor in Manufacturing Support Systems

In manufacturing support functions, many of the routine manual and clerical tasks can be automated using computer systems. Certain production planning activities are better accomplished by computers than by clerks. Material requirements planning (MRP, Section 25.2) is an example. In material requirements planning, order releases are generated for component parts and raw materials based on the master production schedule for final products. This requires a massive amount of data processing that is best suited to computer automation. Many commercial software packages are available to perform MRP. With few exceptions, companies that use MRP rely on computers to perform the computations. Humans are still required to interpret and implement the MRP output and to manage the production planning function.

In modern production systems, the computer is used as an aid in performing virtually all manufacturing support activities. Computer-aided design systems are used in product design. The human designer is still required to do the creative work. The CAD system is a tool that augments the designer's creative talents. Computer-aided process planning systems are used by manufacturing engineers to plan the production methods and routings. In these examples, humans are integral components in the operation of the manufacturing support functions, and the computer-aided systems are tools to increase productivity and improve quality. CAD and CAM systems rarely operate completely in automatic mode.

Humans will continue to be needed in manufacturing support systems, even as the level of automation in these systems increases. People will be needed to do the decision making, learning, engineering, evaluating, managing, and other functions for which

humans are much better suited than machines, according to Table 1.1. Even if all of the manufacturing systems in the factory are automated, there is still a need for the following kinds of work to be performed by humans:

- *Equipment maintenance.* Skilled technicians are required to maintain and repair the automated systems in the factory when these systems break down. To improve the reliability of the automated systems, preventive maintenance programs are implemented.
- *Programming and computer operation.* There will be a continual demand to upgrade software, install new versions of software packages, and execute the programs. It is anticipated that much of the routine process planning, numerical control part programming, and robot programming may be highly automated using artificial intelligence (AI) in the future. But the AI programs must be developed and operated by people.
- *Engineering project work.* The computer-automated and integrated factory is likely never to be finished. There will be a continual need to upgrade production machines, design tooling, solve technical problems, and undertake continuous improvement projects. These activities require the skills of engineers working in the factory.
- *Plant management.* Someone must be responsible for running the factory. There will be a staff of professional managers and engineers who are responsible for plant operations. There is likely to be an increased emphasis on managers' technical skills compared with traditional factory management positions, where the emphasis is on personnel skills.

1.4 AUTOMATION PRINCIPLES AND STRATEGIES

The preceding section leads one to conclude that automation is not always the right answer for a given production situation. A certain caution and respect must be observed in applying automation technologies. This section offers three approaches for dealing with automation projects:¹ (1) the USA Principle, (2) Ten Strategies for Automation and Process Improvement, and (3) an Automation Migration Strategy.

1.4.1 The USA Principle

The USA Principle is a commonsense approach to automation and process improvement projects. Similar procedures have been suggested in the manufacturing and automation trade literature, but none has a more captivating title than this one. USA stands for (1) understand the existing process, (2) simplify the process, and (3) automate the process. A statement of the USA Principle appeared in an article published by the American Production and Inventory Control Society [5]. The article is concerned with implementing enterprise resource planning (ERP, Section 25.7), but the USA approach is so general that it is applicable to nearly any automation project. Going through each step of the procedure for an automation project may in fact reveal that simplifying the process is sufficient and automation is not necessary.

¹There are additional approaches not discussed here, but in which the reader may be interested—for example, the ten steps to integrated manufacturing production systems discussed in J. Black's book *The Design of the Factory with a Future* [1]. Much of Black's book deals with lean production and the Toyota Production System, which is covered in Chapter 26 of the present book.

Understand the Existing Process. The first step in the USA approach is to comprehend the current process in all of its details. What are the inputs? What are the outputs? What exactly happens to the work unit² between input and output? What is the function of the process? How does it add value to the product? What are the upstream and downstream operations in the production sequence, and can they be combined with the process under consideration?

Some of the traditional industrial engineering charting tools used in methods analysis are useful in this regard, such as the operation chart and the flow process chart [3]. Application of these tools to the existing process provides a model of the process that can be analyzed and searched for weaknesses (and strengths). The number of steps in the process, the number and placement of inspections, the number of moves and delays experienced by the work unit, and the time spent in storage can be ascertained by these charting techniques.

Mathematical models of the process may also be useful to indicate relationships between input parameters and output variables. What are the important output variables? How are these output variables affected by inputs to the process, such as raw material properties, process settings, operating parameters, and environmental conditions? This information may be valuable in identifying what output variables need to be measured for feedback purposes and in formulating algorithms for automatic process control.

Simplify the Process. Once the existing process is understood, then the search begins for ways to simplify. This often involves a checklist of questions about the existing process. What is the purpose of this step or this transport? Is the step necessary? Can it be eliminated? Does it use the most appropriate technology? How can it be simplified? Are there unnecessary steps in the process that might be eliminated without detracting from function?

Some of the ten strategies for automation and process improvement (Section 1.4.2) can help simplify the process. Can steps be combined? Can steps be performed simultaneously? Can steps be integrated into a manually operated production line?

Automate the Process. Once the process has been reduced to its simplest form, then automation can be considered. The possible forms of automation include those listed in the ten strategies discussed in the following section. An automation migration strategy (such as the one in Section 1.4.3) might be implemented for a new product that has not yet proven itself.

1.4.2 Ten Strategies for Automation and Process Improvement

Applying the USA Principle is a good approach in any automation project. As suggested previously, it may turn out that automation of the process is unnecessary or cannot be cost justified after the process has been simplified.

If automation seems a feasible solution to improving productivity, quality, or other measure of performance, then the following ten strategies provide a road map to search for these improvements. These ten strategies were originally published in the author's first book.³ They seem as relevant and appropriate today as they did in 1980. They

²The *work unit* is the part or product being processed or assembled.

³M. P. Groover, *Automation, Production Systems, and Computer-Aided Manufacturing*, Prentice Hall, Englewood Cliffs, NJ, 1980.

are referred to as strategies for automation and process improvement because some of them are applicable whether the process is a candidate for automation or just for simplification.

1. *Specialization of operations.* The first strategy involves the use of special-purpose equipment designed to perform one operation with the greatest possible efficiency. This is analogous to the specialization of labor, which is employed to improve labor productivity.
2. *Combined operations.* Production occurs as a sequence of operations. Complex parts may require dozens or even hundreds of processing steps. The strategy of combined operations involves reducing the number of distinct production machines or workstations through which the part must be routed. This is accomplished by performing more than one operation at a given machine, thereby reducing the number of separate machines needed. Since each machine typically involves a setup, setup time can usually be saved by this strategy. Material handling effort, nonoperation time, waiting time, and manufacturing lead time are all reduced.
3. *Simultaneous operations.* A logical extension of the combined operations strategy is to simultaneously perform the operations that are combined at one workstation. In effect, two or more processing (or assembly) operations are being performed simultaneously on the same work part, thus reducing total processing time.
4. *Integration of operations.* This strategy involves linking several workstations together into a single integrated mechanism, using automated work handling devices to transfer parts between stations. In effect, this reduces the number of separate work centers through which the product must be scheduled. With more than one workstation, several parts can be processed simultaneously, thereby increasing the overall output of the system.
5. *Increased flexibility.* This strategy attempts to achieve maximum utilization of equipment for job shop and medium-volume situations by using the same equipment for a variety of parts or products. It involves the use of programmable or flexible automation (Section 1.2.1). Prime objectives are to reduce setup time and programming time for the production machine. This normally translates into lower manufacturing lead time and less work-in-process.
6. *Improved material handling and storage.* A great opportunity for reducing non-productive time exists in the use of automated material handling and storage systems. Typical benefits include reduced work-in-process, shorter manufacturing lead times, and lower labor costs.
7. *On-line inspection.* Inspection for quality of work is traditionally performed after the process is completed. This means that any poor-quality product has already been produced by the time it is inspected. Incorporating inspection into the manufacturing process permits corrections to the process as the product is being made. This reduces scrap and brings the overall quality of the product closer to the nominal specifications intended by the designer.
8. *Process control and optimization.* This includes a wide range of control schemes intended to operate the individual processes and associated equipment more efficiently. By this strategy, the individual process times can be reduced and product quality can be improved.

9. *Plant operations control*. Whereas the previous strategy is concerned with the control of individual manufacturing processes, this strategy is concerned with control at the plant level. It attempts to manage and coordinate the aggregate operations in the plant more efficiently. Its implementation involves a high level of computer networking within the factory.
10. *Computer-integrated manufacturing (CIM)*. Taking the previous strategy one level higher, CIM involves extensive use of computer systems, databases, and networks throughout the enterprise to integrate the factory operations and business functions.

The ten strategies constitute a checklist of possibilities for improving the production system through automation or simplification. They should not be considered mutually exclusive. For most situations, multiple strategies can be implemented in one improvement project. The reader will see these strategies implemented in the many systems discussed throughout the book.

1.4.3 Automation Migration Strategy

Owing to competitive pressures in the marketplace, a company often needs to introduce a new product in the shortest possible time. As mentioned previously, the easiest and least expensive way to accomplish this objective is to design a manual production method, using a sequence of workstations operating independently. The tooling for a manual method can be fabricated quickly and at low cost. If more than a single set of workstations is required to make the product in sufficient quantities, as is often the case, then the manual cell is replicated as many times as needed to meet demand. If the product turns out to be successful, and high future demand is anticipated, then it makes sense for the company to automate production. The improvements are often carried out in phases. Many companies have an automation migration strategy, that is, a formalized plan for evolving the manufacturing systems used to produce new products as demand grows. A typical automation migration strategy is the following:

- Phase 1: *Manual production* using single-station manned cells operating independently. This is used for introduction of the new product for reasons already mentioned: quick and low-cost tooling to get started.
- Phase 2: *Automated production* using single-station automated cells operating independently. As demand for the product grows, and it becomes clear that automation can be justified, then the single stations are automated to reduce labor and increase production rate. Work units are still moved between workstations manually.
- Phase 3: *Automated integrated production* using a multi-station automated system with serial operations and automated transfer of work units between stations. When the company is certain that the product will be produced in mass quantities and for several years, then integration of the single-station automated cells is warranted to further reduce labor and increase production rate.

This strategy is illustrated in Figure 1.6. Details of the automation migration strategy vary from company to company, depending on the types of products they make and the manufacturing processes they perform. But well-managed manufacturing companies

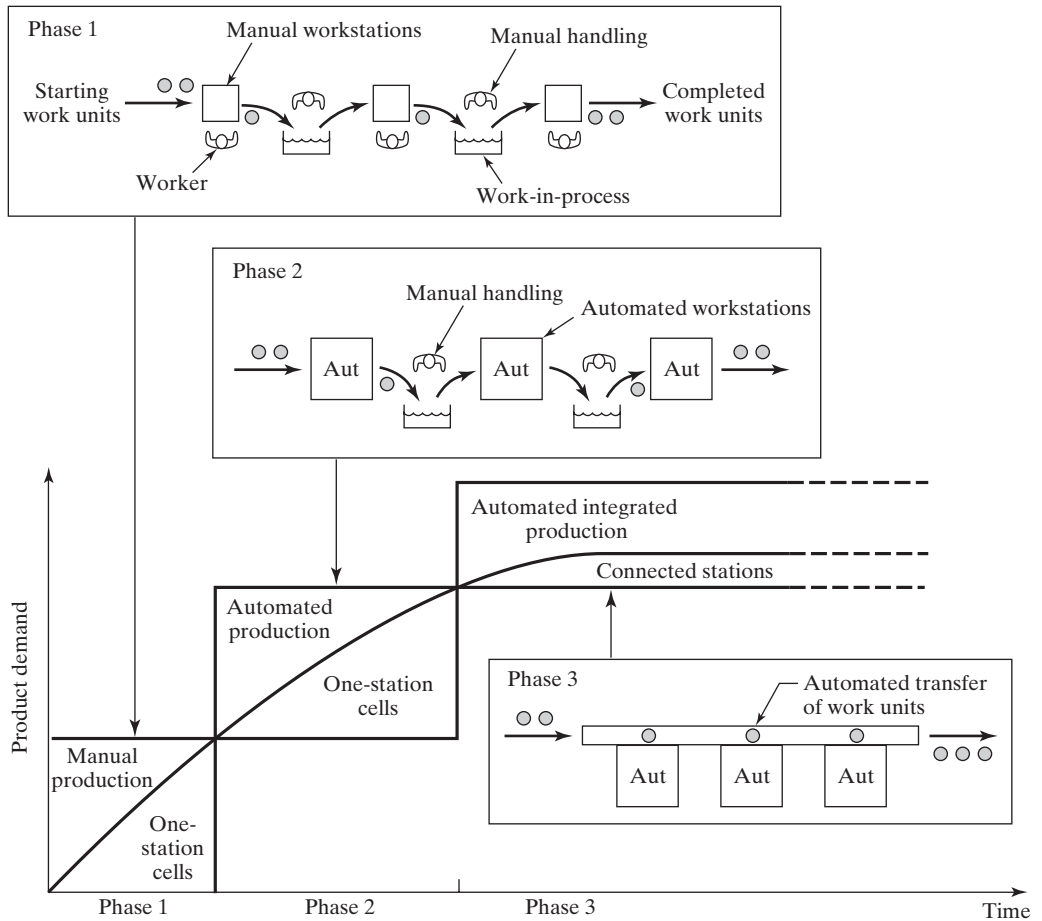


Figure 1.6 A typical automation migration strategy. Phase 1: manual production with single independent workstations. Phase 2: automated production stations with manual handling between stations. Phase 3: automated integrated production with automated handling between stations. Key: Aut = automated workstation.

have policies like the automation migration strategy. There are several advantages of such a strategy:

- It allows introduction of the new product in the shortest possible time, since production cells based on manual workstations are the easiest to design and implement.
- It allows automation to be introduced gradually (in planned phases), as demand for the product grows, engineering changes in the product are made, and time is provided to do a thorough design job on the automated manufacturing system.
- It avoids the commitment to a high level of automation from the start, because there is always a risk that demand for the product will not justify it.

1.5 ABOUT THIS BOOK

The title of this book gives a good indication of its contents, as any textbook title should. This chapter has provided an overview of production systems, their components, and how they are sometimes automated and computerized. This overview is summarized in Figure 1.4. An alternative perspective of production systems is presented in Figure 1.7, which shows six major categories of technical topics related to production systems. The figure is also a diagram of the book and how it is organized into six parts corresponding to these categories.

Part I consists of two chapters that survey manufacturing operations and develop mathematical models to measure performance and costs in manufacturing.

Part II covers automation and control technologies. Whereas this Introduction discusses automation in general terms, Part II describes the technologies, which include industrial control systems, numerical control, industrial robotics, and programmable logic controllers.

Part III is concerned with material handling and identification used in factories and warehouses. The technologies involve equipment for transporting materials, storing them, and automatically identifying them for tracking purposes.

Part IV emphasizes the integration of automation and material handling technologies into manufacturing systems that operate in the factory. Some of these systems are highly automated, while others rely largely on manual labor. Chapters include coverage of single-station work cells, production lines, assembly systems, cellular manufacturing, and flexible manufacturing systems.

The importance of quality control must not be overlooked in modern production systems. Part V covers this topic, dealing with statistical process control and inspection issues. Some of the significant inspection technologies are discussed here, such as machine vision and coordinate measuring machines. As suggested in Figure 1.7, quality

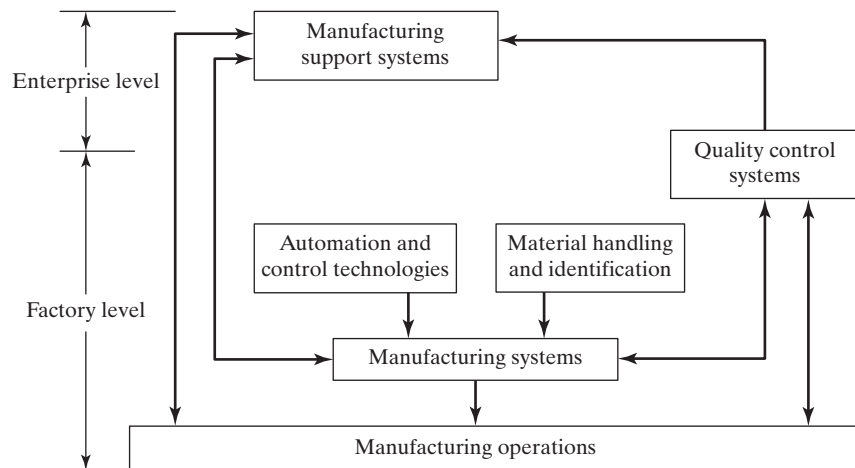


Figure 1.7 The six major categories of technical topics related to production systems, corresponding to the six parts of this book.

control (QC) systems are connected to both facilities and manufacturing support systems. QC is an enterprise-level function, but it has equipment and procedures that work in the factory.

Finally, Part VI addresses the remaining manufacturing support functions in the production system. Included is a chapter on product design and how it is supported by CAD. Other chapters include process planning and design for manufacturing, production planning and control, including topics such as material requirements planning (MRP, mentioned earlier), manufacturing resource planning (MRP II), and enterprise resource planning (ERP). The book concludes with a chapter on just-in-time and lean production—approaches that modern manufacturing companies are using to run their businesses.

REFERENCES

- [1] BLACK, J. T., *The Design of the Factory with a Future*, McGraw-Hill, Inc., New York, NY, 1991.
- [2] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [3] GROOVER, M. P., *Work Systems and the Methods, Measurement, and Management of Work*, Pearson/Prentice Hall, Upper Saddle River, NJ, 2007.
- [4] HARRINGTON, J., *Computer Integrated Manufacturing*, Industrial Press, Inc., New York, NY, 1973.
- [5] KAPP, K. M., “The USA Principle,” *APICS—The Performance Advantage*, June 1997, pp. 62–66.
- [6] SPANGLER, T., R. MAHAJAN, S. PUCKETT, and D. STAKEM, “Manual Labor—Advantages, When and Where?” *MSE 427 Term Paper*, Lehigh University, 1998.

REVIEW QUESTIONS

- 1.1 What is a production system?
- 1.2 Production systems consist of two major components. Name and briefly define them.
- 1.3 What are manufacturing systems, and how are they distinguished from production systems?
- 1.4 Manufacturing systems are divided into three categories, according to worker participation. Name them.
- 1.5 What are the four functions included within the scope of manufacturing support systems?
- 1.6 Three basic types of automation are defined in the text. What is fixed automation and what are some of its features?
- 1.7 What is programmable automation and what are some of its features?
- 1.8 What is flexible automation and what are some of its features?
- 1.9 What is computer-integrated manufacturing?
- 1.10 What are some of the reasons why companies automate their operations?
- 1.11 Identify three situations in which manual labor is preferred over automation.
- 1.12 Human workers will be needed in factory operations, even in the most highly automated systems. The text identifies at least four types of work for which humans will be needed. Name them.

- 1.13** What is the USA Principle? What does each of the letters stand for?
- 1.14** The text lists ten strategies for automation and process improvement. Identify five of these strategies.
- 1.15** What is an automation migration strategy?
- 1.16** What are the three phases of a typical automation migration strategy?

Manufacturing Operations¹

CHAPTER CONTENTS

- 2.1 Manufacturing Industries and Products
- 2.2 Manufacturing Operations
 - 2.2.1 Processing and Assembly Operations
 - 2.2.2 Other Factory Operations
- 2.3 Production Facilities
 - 2.3.1 Low Production
 - 2.3.2 Medium Production
 - 2.3.3 High Production
- 2.4 Product/Production Relationships
 - 2.4.1 Production Quantity and Product Variety
 - 2.4.2 Product and Part Complexity
 - 2.4.3 Limitations and Capabilities of a Manufacturing Plant

Manufacturing can be defined as the application of physical and/or chemical processes to alter the geometry, properties, and/or appearance of a given starting material to make parts or products. Manufacturing also includes the joining of multiple parts to make assembled products. The processes that accomplish manufacturing involve a combination of machinery, tools, power, and manual labor, as depicted in Figure 2.1(a). Manufacturing is almost always carried out as a sequence of unit operations.² Each successive operation brings the material closer to the desired final state.

¹The chapter introduction and Sections 2.1 and 2.2 are based on [2], Chapter 1.

²A **unit operation** is a single step in the sequence of steps used to transform a starting material into a final part or product.

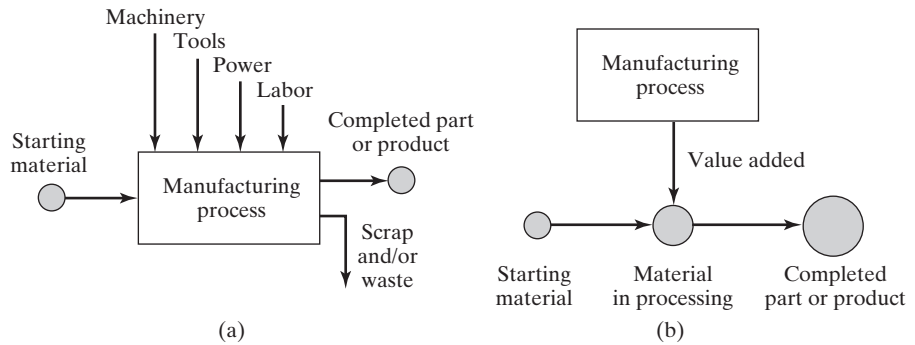


Figure 2.1 Alternative definitions of manufacturing: (a) as a technological process and (b) as an economic process.

From an economic viewpoint, manufacturing is concerned with the transformation of materials into items of greater value by means of one or more processing and/or assembly operations, as depicted in Figure 2.1(b). The key point is that manufacturing *adds value* to the material by changing its shape or properties or by combining it with other materials that also have been altered. When iron ore is converted into steel, value is added. When sand is transformed into glass, value is added. When petroleum is refined into plastic, value is added. And when plastic is molded into the complex geometry of a patio chair, it is made even more valuable.

This chapter provides a survey of manufacturing operations, beginning with the industries that are engaged in manufacturing and the types of products they produce. Then the fabrication and assembly processes used in manufacturing are briefly described, as well as the activities that support these processes, such as material handling and inspection. Next, several product parameters are introduced, such as production quantity and product variety, and the influence that these parameters have on production operations and facilities is examined.

The history of manufacturing includes both the development of manufacturing processes, some of which date back thousands of years, and the evolution of the production systems required to apply these processes (see Historical Note 2.1). The emphasis in this book is on the systems.

Historical Note 2.1 History of Manufacturing

The history of manufacturing includes two related topics: (1) the discovery and invention of materials and processes to make things and (2) the development of systems of production. The materials and processes pre-date the systems by several millennia. Systems of production refer to the ways of organizing people and equipment so that production can be performed more efficiently. Some of the basic processes date as far back as the Neolithic period (circa 8000–3000 B.C.), when operations such as the following were developed: *woodworking*, *forming* and *firing* of clay pottery, *grinding* and *polishing* of stone, *spinning* of fiber and *weaving* of textiles, and *dyeing* of cloth. Metallurgy and metalworking also began during the Neolithic, in Mesopotamia and other areas around the Mediterranean. It either spread to or developed independently in regions of Europe and Asia. Gold was found by early humans in relatively

pure form in nature; it could be *hammered* into shape. Copper was probably the first metal to be extracted from ores, thus requiring *smelting* as a processing technique. Copper could not be readily hammered because it strain-hardened; instead, it was shaped by *casting*. Other metals used during this period were silver and tin. It was discovered that copper alloyed with tin produced a more workable metal than copper alone (casting and hammering could both be used). This heralded the important period known as the *Bronze Age* (circa 3500–1500 B.C.).

Iron was also first smelted during the Bronze Age. Meteorites may have been one source of the metal, but iron ore was also mined. The temperatures required to reduce iron ore to metal are significantly higher than for copper, which made furnace operations more difficult. Early blacksmiths learned that when certain irons (those containing small amounts of carbon) were sufficiently heated and then *quenched* (thrust into water to cool), they became very hard. This permitted the grinding of very sharp cutting edges on knives and weapons, but it also made the metal brittle. Toughness could be increased by reheating at a lower temperature, a process known as *tempering*. What has been described here is, of course, the *heat treatment* of steel. The superior properties of steel caused it to succeed bronze in many applications (weaponry, agriculture, and mechanical devices). The period of its use has subsequently been named the *Iron Age* (starting around 1000 B.C.). It was not until much later, well into the nineteenth century, that the demand for steel grew significantly and more modern steelmaking techniques were developed.

The early fabrication of implements and weapons was accomplished more as crafts and trades than by manufacturing as it is known today. The ancient Romans had what might be called factories to produce weapons, scrolls, pottery, glassware, and other products of the time, but the procedures were largely based on handicraft. It was not until the *Industrial Revolution* (circa 1760–1830) that major changes began to affect the systems for making things. This period marked the beginning of the change from an economy based on agriculture and handicraft to one based on industry and manufacturing. The change began in England, where a series of important machines was invented, and steam power began to replace water, wind, and animal power. Initially, these advances gave British industry significant advantages over other nations, but eventually the revolution spread to other European countries and to the United States. The Industrial Revolution contributed to the development of manufacturing in the following ways: (1) *Watt's steam engine*, a new power-generating technology; (2) development of *machine tools*, starting with John Wilkinson's boring machine around 1775, which was used to bore the cylinder on Watt's steam engine; (3) invention of the *spinning jenny*, *power loom*, and other machinery for the textile industry, which permitted significant increases in productivity; and (4) the *factory system*, a new way of organizing large numbers of production workers based on the division of labor.

Wilkinson's boring machine is generally recognized as the beginning of machine tool technology. It was powered by waterwheel. During the period 1775–1850, other machine tools were developed for most of the conventional *machining processes*, such as *boring*, *turning*, *drilling*, *milling*, *shaping*, and *planing*. As steam power became more prevalent, it gradually became the preferred power source for most of these machine tools. It is of interest to note that many of the individual processes pre-date the machine tools by centuries; for example, drilling, sawing, and turning (of wood) date from ancient times.

Assembly methods were used in ancient cultures to make ships, weapons, tools, farm implements, machinery, chariots and carts, furniture, and garments. The processes included *binding* with twine and rope, *riveting* and *nailing*, and *soldering*. By around the time of Christ, *forge welding* and *adhesive bonding* had been developed. Widespread use of screws, bolts, and nuts—so common in today's assembly—required the development of machine tools, in particular, Maudsley's screw cutting lathe (1800), which could accurately form the helical threads. It was not until around 1900 that *fusion welding* processes started to be developed as assembly techniques.

While England was leading the Industrial Revolution, an important concept related to assembly technology was being introduced in the United States: *interchangeable parts* manufacture. Much credit for this concept is given to Eli Whitney (1765–1825), although its importance had been recognized by others [3]. In 1797, Whitney negotiated a contract to produce 10,000 muskets for the U.S. government. The traditional way of making guns at the time was to custom-fabricate each part for a particular gun and then hand-fit the parts together by filing. Each musket was therefore unique, and the time to make it was considerable. Whitney believed that the components could be made accurately enough to permit parts assembly without fitting. After several years of development in his Connecticut factory, he traveled to Washington in 1801 to demonstrate the principle. Before government officials, including Thomas Jefferson, he laid out components for 10 muskets and proceeded to select parts randomly to assemble the guns. No special filing or fitting was required, and all of the guns worked perfectly. The secret behind his achievement was the collection of special machines, fixtures, and gages that he had developed in his factory. Interchangeable parts manufacture required many years of development and refinement before becoming a practical reality, but it revolutionized methods of manufacturing. It is a prerequisite for mass production of assembled products. Because its origins were in the United States, interchangeable parts production came to be known as the *American System* of manufacture.

The mid and late 1800s witnessed the expansion of railroads, steam-powered ships, and other machines that created a growing need for iron and steel. New methods for producing steel were developed to meet this demand. Also during this period, several consumer products were developed, including the sewing machine, bicycle, and automobile. To meet the mass demand for these products, more efficient production methods were required. Some historians identify developments during this period as the *Second Industrial Revolution*, characterized in terms of its effects on production systems by the following: (1) mass production, (2) assembly lines, (3) the scientific management movement, and (4) electrification of factories.

Mass production was primarily an American phenomenon. Its motivation was the mass market that existed in the United States. Population in the United States in 1900 was 76 million and growing. By 1920, it exceeded 106 million. Such a large population, larger than any western European country, created a demand for large numbers of products. Mass production provided those products. Certainly one of the important technologies of mass production was the *assembly line*, introduced by Henry Ford (1863–1947) in 1913 at his Highland Park plant (Historical Note 15.1). The assembly line made mass production of complex consumer products possible. Use of assembly-line methods permitted Ford to sell a Model T automobile for less than \$500 in 1916, thus making ownership of cars feasible for a large segment of the American population.

The *scientific management* movement started in the late 1800s in the United States in response to the need to plan and control the activities of growing numbers of production workers. The movement was led by Frederick W. Taylor (1856–1915), Frank Gilbreath (1868–1924) and his wife Lillian (1878–1972), and others. Scientific management included (1) *motion study*, aimed at finding the best method to perform a given task; (2) *time study*, to establish work standards for a job; (3) extensive use of *standards* in industry; (4) the *piece rate system* and similar labor incentive plans; and (5) use of data collection, record keeping, and cost accounting in factory operations.

In 1881, *electrification* began with the first electric power generating station being built in New York City, and soon electric motors were being used as the power source to operate factory machinery. This was a far more convenient power delivery system than the steam engine, which required overhead belts to mechanically distribute power to the machines. By 1920, electricity had overtaken steam as the principal power source in U.S. factories. Electrification also motivated many new inventions that have affected manufacturing operations and production systems. The twentieth century was a time of more technological advances than all previous centuries combined. Many of these developments have resulted in the *automation* of manufacturing. Historical notes on some of these advances in automation are included in this book.

2.1 MANUFACTURING INDUSTRIES AND PRODUCTS

Manufacturing is an important commercial activity, carried out by companies that sell products to customers. The type of manufacturing performed by a company depends on the kinds of products it makes.

Manufacturing Industries. Industry consists of enterprises and organizations that produce and/or supply goods and/or services. Industries can be classified as primary, secondary, and tertiary. *Primary industries* are those that cultivate and exploit natural resources, such as agriculture and mining. *Secondary industries* convert the outputs of the primary industries into products. Manufacturing is the principal activity in this category, but the secondary industries also include construction and power utilities. *Tertiary industries* constitute the service sector of the economy. A list of specific industries in these categories is presented in Table 2.1.

This book is concerned with the secondary industries (middle column in Table 2.1), which are composed of the companies engaged in manufacturing. It is useful to

TABLE 2.1 Specific Industries in the Primary, Secondary, and Tertiary Categories, Based Roughly on the International Standard Industrial Classification (ISIC) Used by the United Nations

Primary	Secondary	Tertiary (Service)
Agriculture	Aerospace	Banking
Forestry	Apparel	Communications
Fishing	Automotive	Education
Livestock	Basic metals	Entertainment
Quarrying	Beverages	Financial services
Mining	Building materials	Government
Petroleum	Chemicals	Health and medical services
	Computers	Hotels
	Construction	Information
	Consumer appliances	Insurance
	Electronics	Legal services
	Equipment	Real estate
	Fabricated metals	Repair and maintenance
	Food processing	Restaurants
	Glass, ceramics	Retail trade
	Heavy machinery	Tourism
	Paper	Transportation
	Petroleum refining	Wholesale trade
	Pharmaceuticals	
	Plastics (shaping)	
	Power utilities	
	Publishing	
	Textiles	
	Tire and rubber	
	Wood and furniture	

TABLE 2.2 International Standard Industrial Classification Codes for Various Industries in the Manufacturing Sector

Basic Code	Products Manufactured
31	Food, beverages (alcoholic and nonalcoholic), tobacco
32	Textiles, clothing, leather goods, fur products
33	Wood and wood products (e.g., furniture), cork products
34	Paper, paper products, printing, publishing, bookbinding
35	Chemicals, coal, petroleum, plastic, rubber, products made from these materials, pharmaceuticals
36	Ceramics (including glass), nonmetallic mineral products (e.g., cement)
37	Basic metals (steel, aluminum, etc.)
38	Fabricated metal products, machinery, equipment (e.g., aircraft, cameras, computers and other office equipment, machinery, motor vehicles, tools, televisions)
39	Other manufactured goods (e.g., jewelry, musical instruments, sporting goods, toys)

distinguish the process industries from the industries that make discrete parts and products. The process industries include chemicals, pharmaceuticals, petroleum, basic metals, food, beverages, and electric power generation. The discrete product industries include automobiles, aircraft, appliances, computers, machinery, and the component parts from which these products are assembled. The International Standard Industrial Classification (ISIC) of industries according to types of products manufactured is listed in Table 2.2. In general, the process industries are included within ISIC codes 31–37, and the discrete product manufacturing industries are included in ISIC codes 38 and 39. However, it must be acknowledged that many of the products made by the process industries are finally sold to the consumer in discrete units. For example, beverages are sold in bottles and cans. Pharmaceuticals are often purchased as pills and capsules.

Production operations in the process industries and the discrete product industries can be divided into continuous production and batch production. The differences are shown in Figure 2.2.

Continuous production occurs when the production equipment is used exclusively for the given product, and the output of the product is uninterrupted. In the process industries, continuous production means that the process is carried out on a continuous stream of material, with no interruptions in the output flow, as suggested by Figure 2.2(a). The material being processed is likely to be in the form of a liquid, gas, powder, or similar physical state. In the discrete manufacturing industries, continuous production means 100% dedication of the production equipment to the part or product, with no breaks for product changeovers. The individual units of production are identifiable, as in Figure 2.2(b).

Batch production occurs when the materials are processed in finite amounts or quantities. The finite amount or quantity of material is called a *batch* in both the process and discrete manufacturing industries. Batch production is discontinuous because there are interruptions in production between batches. Reasons for using batch production include (1) differences in work units between batches necessitate changes in methods, tooling, and equipment to accommodate the part differences; (2) the capacity of the

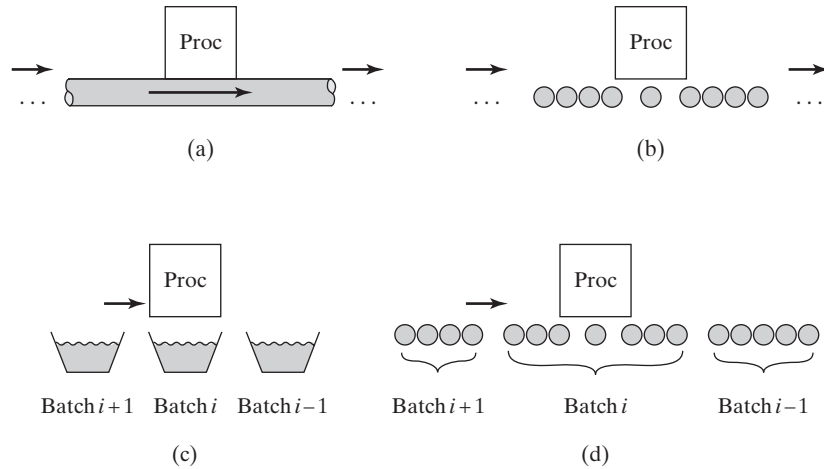


Figure 2.2 Continuous and batch production in the process and discrete manufacturing industries, including (a) continuous production in the process industries, (b) continuous production in the discrete manufacturing industries, (c) batch production in the process industries, and (d) batch production in the discrete manufacturing industries. Key: Proc = process.

equipment limits the amount or quantity of material that can be processed at one time; and (3) the production rate of the equipment is greater than the demand rate for the parts or products, and it therefore makes sense to share the equipment among multiple parts or products. The differences in batch production between the process and discrete manufacturing industries are portrayed in Figure 2.2(c) and (d). Batch production in the process industries generally means that the starting materials are in liquid or bulk form, and they are processed altogether as a unit. By contrast, in the discrete manufacturing industries, a batch is a certain quantity of work units, and the work units are usually processed one at a time rather than all together at once. The number of parts in a batch can range from as few as one to as many as thousands of units.

Manufactured Products. As indicated in Table 2.2, the secondary industries include food, beverages, textiles, wood, paper, publishing, chemicals, and basic metals (ISIC codes 31–37). The scope of this book is primarily directed at the industries that produce discrete products. Table 2.3 lists the manufacturing industries and corresponding products for which the production systems in this book are most applicable.

Final products made by the industries listed in Table 2.3 can be divided into two major classes: consumer goods and capital goods. *Consumer goods* are products purchased directly by consumers, such as cars, personal computers, TVs, tires, toys, and tennis rackets. *Capital goods* are products purchased by other companies to produce goods and supply services. Examples of capital goods include commercial aircraft, process control computers, machine tools, railroad equipment, and construction machinery.

In addition to final products, which are usually assembled, there are companies in industry whose business is primarily to produce materials, components, and supplies for the companies that make the final products. Examples of these items include sheet steel, bar

TABLE 2.3 Manufacturing Industries Whose Products Are Likely to Be Produced by the Production Systems Discussed in This Book

Industry	Typical Products
Aerospace	Commercial and military aircraft
Automotive	Cars, trucks, buses, motorcycles
Computers	Mainframe and personal computers
Consumer appliances	Large and small household appliances
Electronics	TVs, DVD players, audio equipment, video game consoles
Equipment	Industrial machinery, railroad equipment
Fabricated metals	Machined parts, metal stampings, tools
Glass, ceramics	Glass products, ceramic tools, pottery
Heavy machinery	Machine tools, construction equipment
Plastics (shaping)	Plastic moldings, extrusions
Tire and rubber	Tires, shoe soles, tennis balls

stock, metal stampings, machined parts, plastic moldings, cutting tools, dies, molds, and lubricants. Thus, the manufacturing industries consist of a complex infrastructure with various categories and layers of intermediate suppliers with whom the final consumer never deals.

2.2 MANUFACTURING OPERATIONS

There are certain basic activities that must be carried out in a factory to convert raw materials into finished products. For a plant engaged in making discrete products, the factory activities are (1) processing and assembly operations, (2) material handling, (3) inspection and test, and (4) coordination and control.

The first three activities are the physical activities that “touch” the product as it is being made. Processing and assembly operations alter the geometry, properties, and/or appearance of the work unit. They add value to the product. The product must be moved from one operation to the next in the manufacturing sequence, and it must be inspected and/or tested to ensure high quality. It is sometimes argued that material handling and inspection activities do not add value to the product. However, material handling and inspection may be required to accomplish the necessary processing and assembly operations, for example, loading parts into a production machine and assuring that a starting work unit is of acceptable quality before processing begins.

2.2.1 Processing and Assembly Operations

Manufacturing processes can be divided into two basic types: (1) processing operations and (2) assembly operations. A *processing operation* transforms a work material from one state of completion to a more advanced state that is closer to the final desired part or product. It adds value by changing the geometry, properties, or appearance of the starting material. In general, processing operations are performed on discrete work parts, but some processing operations are also applicable to assembled items, for example, painting a welded sheet metal car body. An *assembly operation* joins two or more components to create a new entity, which is called an assembly, subassembly, or some other term that

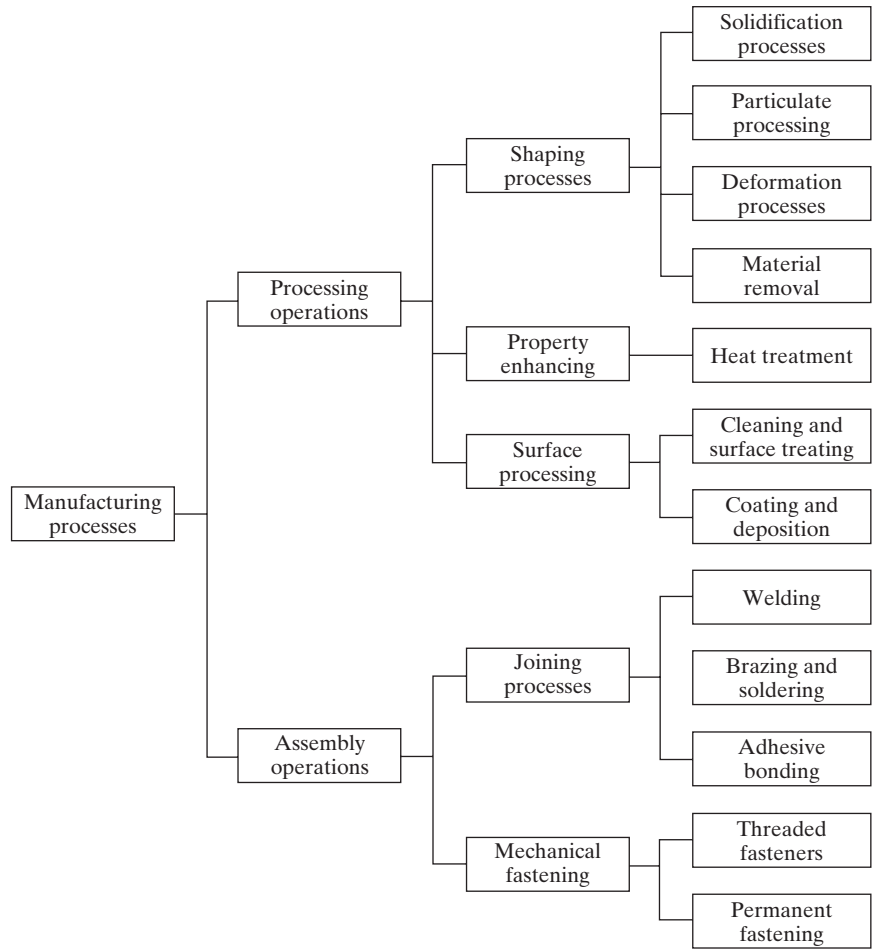


Figure 2.3 Classification of manufacturing processes.

refers to the specific joining process. Figure 2.3 shows a classification of manufacturing processes and how they divide into various categories.

Processing Operations. A processing operation uses energy to alter a work part’s shape, physical properties, or appearance to add value to the material. The energy is applied in a controlled way by means of machinery and tooling. Human energy may also be required, but human workers are generally employed to control the machines, to oversee the operations, and to load and unload parts before and after each cycle of operation. A general model of a processing operation is illustrated in Figure 2.1(a). Material is fed into the process, energy is applied by the machinery and tooling to transform the material, and the completed work part exits the process. As shown in the model, most production operations produce waste or scrap, either as a natural by-product of the process (e.g., removing material as in machining) or in the form of occasional defective pieces. A desirable objective in manufacturing is to reduce waste in either of these forms.

More than one processing operation is usually required to transform the starting material into final form. The operations are performed in the particular sequence to achieve the geometry and/or condition defined by the design specification.

Three categories of processing operations are distinguished: (1) shaping operations, (2) property-enhancing operations, and (3) surface processing operations. **Part-shaping operations** apply mechanical force and/or heat or other forms and combinations of energy to change the geometry of the work material. There are various ways to classify these processes. The classification used here is based on the state of the starting material. There are four categories:

1. *Solidification processes.* The important processes in this category are casting (for metals) and molding (for plastics and glasses), in which the starting material is a heated liquid or semifluid, and it can be poured or otherwise forced to flow into a mold cavity where it cools and solidifies, taking a solid shape that is the same as the cavity.
2. *Particulate processing.* The starting material is a powder. The common technique involves pressing the powders in a die cavity under high pressure to cause the powders to take the shape of the cavity. However, the compacted work part lacks sufficient strength for any useful application. To increase strength, the part is then sintered—heated to a temperature below the melting point, which causes the individual particles to bond together. Both metals (powder metallurgy) and ceramics (e.g., clay products) can be formed by particulate processing.
3. *Deformation processes.* In most cases, the starting material is a ductile metal that is shaped by applying stresses that exceed the metal's yield strength. To increase ductility, the metal is often heated prior to forming. Deformation processes include forging, extrusion, and rolling. Also included in this category are sheet metal processes such as drawing, forming, and bending.
4. *Material removal processes.* The starting material is solid (commonly a metal, ductile or brittle), from which excess material is removed from the starting workpiece so that the resulting part has the desired geometry. Most important in this category are *machining* operations such as turning, drilling, and milling, accomplished using sharp cutting tools that are harder and stronger than the work metal. Grinding is another common process in this category, in which an abrasive grinding wheel is used to remove material. Other material removal processes are known as nontraditional processes because they do not use traditional cutting and grinding tools. Instead, they are based on lasers, electron beams, chemical erosion, electric discharge, or electrochemical energy.

In addition to these four categories based on starting material, there is also a family of part fabrication technologies called *additive manufacturing*. Also known as *rapid prototyping* (Section 23.1.2), these technologies operate on a variety of material types by building the part as a sequence of thin layers each on top of the previous until the entire solid geometry has been completed.

Property-enhancing operations are designed to improve mechanical or physical properties of the work material. The most important property-enhancing operations involve heat treatments, which include various temperature-induced strengthening and/or toughening processes for metals and glasses. Sintering of powdered metals and ceramics, mentioned previously, is also a heat treatment, which strengthens a pressed powder work part. Property-enhancing operations do not alter part shape, except unintentionally in

some cases, for example, warping of a metal part during heat treatment or shrinkage of a ceramic part during sintering.

Surface processing operations include (1) cleaning, (2) surface treatments, and (3) coating and thin film deposition processes. Cleaning includes both chemical and mechanical processes to remove dirt, oil, and other contaminants from the surface. Surface treatments include mechanical working, such as shot peening and sand blasting, and physical processes like diffusion and ion implantation. Coating and thin film deposition processes apply a coating of material to the exterior surface of the work part. Common coating processes include electroplating, anodizing of aluminum, and organic coating (call it painting). Thin film deposition processes include physical vapor deposition and chemical vapor deposition to form extremely thin coatings of various substances. Several surface processing operations have been adapted to fabricate semiconductor materials (most commonly silicon) into integrated circuits for microelectronics. These processes include chemical vapor deposition, physical vapor deposition, and oxidation. They are applied to very localized regions on the surface of a thin wafer of silicon (or other semiconductor material) to create the microscopic circuit.

Assembly Operations. The second basic type of manufacturing operation is assembly, in which two or more separate parts are joined to form a new entity. Components of the new entity are connected together either permanently or semipermanently. Permanent joining processes include welding, brazing, soldering, and adhesive bonding. They combine parts by forming a joint that cannot be easily disconnected. Mechanical assembly methods are available to fasten two or more parts together in a joint that can be conveniently disassembled. The use of threaded fasteners (e.g., screws, bolts, nuts) are important traditional methods in this category. Other mechanical assembly techniques that form a permanent connection include rivets, press fitting, and expansion fits. Special assembly methods are used in electronics. Some of the methods are identical to or adaptations of the above techniques. For example, soldering is widely used in electronics assembly. Electronics assembly is concerned primarily with the assembly of components (e.g., integrated circuit packages) to printed circuit boards to produce the complex circuits used in so many of today's products.

2.2.2 Other Factory Operations

Other activities that must be performed in the factory include material handling and storage, inspection and testing, and coordination and control.

Material Handling and Storage. Moving and storing materials between processing and/or assembly operations are usually required. In most manufacturing plants, materials spend more time being moved and stored than being processed. In some cases, the majority of the labor cost in the factory is consumed in handling, moving, and storing materials. It is important that this function be carried out as efficiently as possible. Part III of this book considers the material handling and storage technologies that are used in factory operations.

Eugene Merchant, an advocate and spokesman for the machine tool industry for many years, observed that materials in a typical metal machining batch factory or job shop spend more time waiting or being moved than being processed [4]. His observation is illustrated in Figure 2.4. About 95% of a part's time is spent either moving or waiting (temporary storage). Only 5% of its time is spent on the machine tool. Of this 5%, less

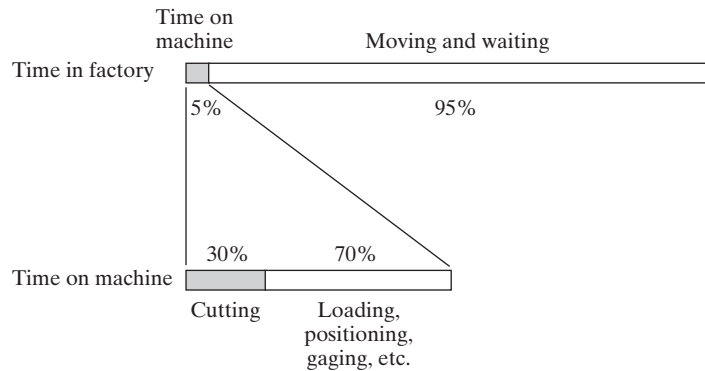


Figure 2.4 How time is spent by a typical part in a batch production machine shop [4].

than 30% of the time on the machine (1.5% of the total time of the part) is time during which actual cutting is taking place. The remaining 70% (3.5% of the total) is required for loading and unloading, part handling and positioning, tool positioning, gaging, and other elements of nonprocessing time. These time proportions indicate the significance of material handling and storage in a typical factory.

Inspection and Testing. Inspection and testing are quality control activities. The purpose of inspection is to determine whether the manufactured product meets the established design standards and specifications. For example, inspection examines whether the actual dimensions of a mechanical part are within the tolerances indicated on the engineering drawing for the part. Testing is generally concerned with the functional specifications of the final product rather than with the individual parts that go into the product. For example, final testing of the product ensures that it functions and operates in the manner specified by the product designer. Part V of the text examines inspection and testing.

Coordination and Control. Coordination and control in manufacturing include both the regulation of individual processing and assembly operations and the management of plant-level activities. Control at the process level involves the achievement of certain performance objectives by properly manipulating the inputs and other parameters of the process. Control at the process level is discussed in Part II of the book.

Control at the plant level includes effective use of labor, maintenance of the equipment, moving materials in the factory, controlling inventory, shipping products of good quality on schedule, and keeping plant operating costs to a minimum. The manufacturing control function at the plant level represents the major point of intersection between the physical operations in the factory and the information-processing activities that occur in production. Many of these plant- and enterprise-level control functions are discussed in Parts V and VI.

2.3 PRODUCTION FACILITIES

A manufacturing company attempts to organize its facilities in the most efficient way to serve the particular mission of each plant. Over the years, certain types of production facilities have come to be recognized as the most appropriate way to organize for a given

type of manufacturing. Of course, one of the most important factors that determine the type of manufacturing is the type of products that are made. As mentioned previously, this book is concerned primarily with the production of discrete parts and products. The quantity of parts and/or products made by a factory has a very significant influence on its facilities and the way manufacturing is organized. **Production quantity** refers to the number of units of a given part or product produced annually by the plant. The annual part or product quantities produced in a given factory can be classified into three ranges:

1. *Low production*: Quantities in the range of 1 to 100 units
2. *Medium production*: Quantities in the range of 100 to 10,000 units
3. *High production*: Production quantities are 10,000 to millions of units.

The boundaries between the three ranges are somewhat arbitrary (author's judgment). Depending on the types of products, these boundaries may shift by an order of magnitude or so.

Some plants produce a variety of different product types, each type being made in low or medium quantities. Other plants specialize in high production of only one product type. It is instructive to identify product variety as a parameter distinct from production quantity. **Product variety** refers to the different product designs or types that are produced in a plant. Different products have different shapes and sizes and styles, they perform different functions, they are sometimes intended for different markets, some have more components than others, and so forth. The number of different product types made each year can be counted. When the number of product types made in a factory is high, this indicates high product variety.

There is an inverse correlation between product variety and production quantity in terms of factory operations. When product variety is high, production quantity tends to be low, and vice versa. This relationship is depicted in Figure 2.5. Manufacturing plants tend to specialize in a combination of production quantity and product variety that lies somewhere inside the diagonal band in Figure 2.5. In general, a given factory tends to be limited to the product variety value that is correlated with that production quantity.

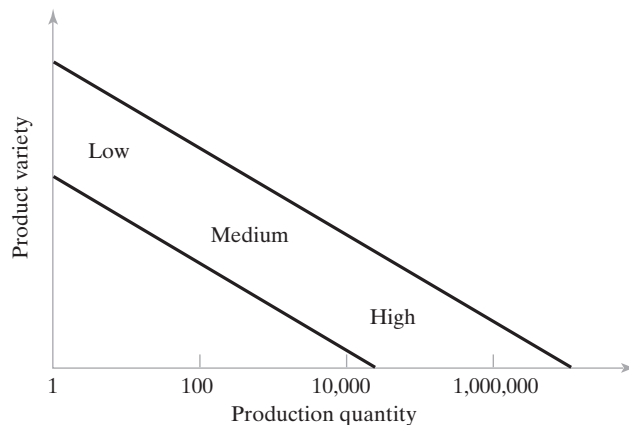


Figure 2.5 Relationship between product variety and production quantity in discrete product manufacturing.

Although product variety has been identified as a quantitative parameter (the number of different product types made by the plant or company), this parameter is much less exact than production quantity, because details on how much the designs differ are not captured simply by the number of different designs. The differences between an automobile and an air conditioner are far greater than between an air conditioner and a heat pump. Products can be different, but the extent of the differences may be small or great. The automotive industry provides some examples to illustrate this point. Each of the U.S. automotive companies produces cars with two or three different nameplates in the same assembly plant, although the body styles and other design features are nearly the same. In different plants, the same company builds trucks. Let the terms “hard” and “soft” be used to describe these differences in product variety. **Hard product variety** is when the products differ substantially. In an assembled product, hard variety is characterized by a low proportion of common parts among the products; in many cases, there are no common parts. The difference between a car and a truck is hard. **Soft product variety** is when there are only small differences between products, such as the differences between car models made on the same production line. There is a high proportion of common parts among assembled products whose variety is soft. The variety between different product categories tends to be hard; the variety between different models within the same product category tends to be soft.

The three production quantity ranges can be used to identify three basic categories of production plants. Although there are variations in the work organization within each category, usually depending on the amount of product variety, this is nevertheless a reasonable way to classify factories for the purpose of this discussion.

2.3.1 Low Production

The type of production facility usually associated with the quantity range of 1–100 units/year is the **job shop**, which makes low quantities of specialized and customized products. The products are typically complex, such as experimental aircraft and special machinery. Job shop production can also include fabricating the component parts for the products. Customer orders for these kinds of items are often special, and repeat orders may never occur. Equipment in a job shop is general purpose and the labor force is highly skilled.

A job shop must be designed for maximum flexibility to deal with the wide part and product variations encountered (hard product variety). If the product is large and heavy, and therefore difficult to move in the factory, it typically remains in a single location, at least during its final assembly. Workers and processing equipment are brought to the product, rather than moving the product to the equipment. This type of layout is a **fixed-position layout**, shown in Figure 2.6(a), in which the product remains in a single location during its entire fabrication. Examples of such products include ships, aircraft, railway locomotives, and heavy machinery. In actual practice, these items are usually built in large modules at single locations, and then the completed modules are brought together for final assembly using large-capacity cranes.

The individual parts that comprise these large products are often made in factories that have a **process layout**, in which the equipment is arranged according to function or type. The lathes are in one department, the milling machines are in another department, and so on, as in Figure 2.6(b). Different parts, each requiring a different operation sequence, are routed through the departments in the particular order needed for their processing, usually in batches. The process layout is noted for its flexibility; it can accommodate a great variety of alternative operation sequences for different part configurations. Its disadvantage is that the machinery and methods to produce a part are not

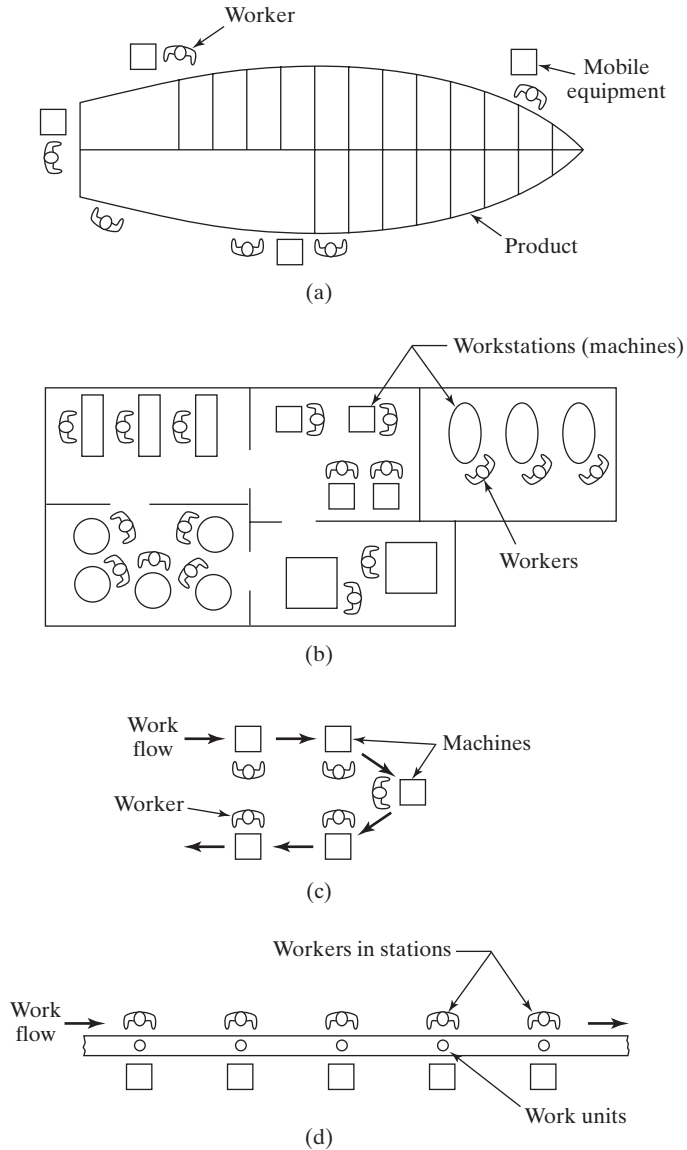


Figure 2.6 Various types of plant layout: (a) fixed-position layout, (b) process layout, (c) cellular layout, and (d) product layout.

designed for high efficiency. Much material handling is required to move parts between departments, so in-process inventory tends to be high.

2.3.2 Medium Production

In the medium quantity range (100–10,000 units annually), two different types of facility can be distinguished, depending on product variety. When product variety is hard, the traditional approach is **batch production**, in which a batch of one product is made,

after which the facility is changed over to produce a batch of the next product, and so on. Orders for each product are frequently repeated. The production rate of the equipment is greater than the demand rate for any single product type, and so the same equipment can be shared among multiple products. The changeover between production runs takes time. Called the *setup time* or *changeover time*, it is the time to change tooling and to set up and reprogram the machinery. This is lost production time, which is a disadvantage of batch manufacturing. Batch production is commonly used in make-to-stock situations, in which items are manufactured to replenish inventory that has been gradually depleted by demand. The equipment for batch production is usually arranged in a process layout Figure 2.6(b).

An alternative approach to medium range production is possible if product variety is soft. In this case, extensive changeovers between one product style and the next may not be required. It is often possible to configure the equipment so that groups of similar parts or products can be made on the same equipment without significant lost time for changeovers. The processing or assembly of different parts or products is accomplished in cells consisting of several workstations or machines. The term *cellular manufacturing* is often associated with this type of production. Each cell is designed to produce a limited variety of part configurations; that is, the cell specializes in the production of a given set of similar parts or products, according to the principles of group technology (Chapter 18). The layout is called a *cellular layout*, depicted in Figure 2.6(c).

2.3.3 High Production

The high quantity range (10,000 to millions of units per year) is often referred to as *mass production*. The situation is characterized by a high demand rate for the product, and the production facility is dedicated to the manufacture of that product. Two categories of mass production can be distinguished: (1) quantity production and (2) flow-line production. **Quantity production** involves the mass production of single parts on single pieces of equipment. The method of production typically involves standard machines (such as stamping presses) equipped with special tooling (e.g., dies and material handling devices), in effect dedicating the equipment to the production of one part type. The typical layout used in quantity production is the process layout [Figure 2.6(b)].

Flow-line production involves multiple workstations arranged in sequence, and the parts or assemblies are physically moved through the sequence to complete the product. The workstations consist of production machines and/or workers equipped with specialized tools. The collection of stations is designed specifically for the product to maximize efficiency. This is a **product layout**, in which the workstations are arranged into one long line, as depicted in Figure 2.6(d), or into a series of connected line segments. The work is usually moved between stations by powered conveyor. At each station, a small amount of the total work is completed on each unit of product.

The most familiar example of flow-line production is the assembly line, associated with products such as cars and household appliances. The pure case of flow-line production is where there is no variation in the products made on the line. Every product is identical, and the line is referred to as a *single-model production line*. However, to successfully market a given product, it is often necessary to introduce model variations so that individual customers can choose the exact style and options that appeal to them. From a production viewpoint, the model differences represent a case of soft product variety. The term *mixed-model production line* applies to those situations where there is soft

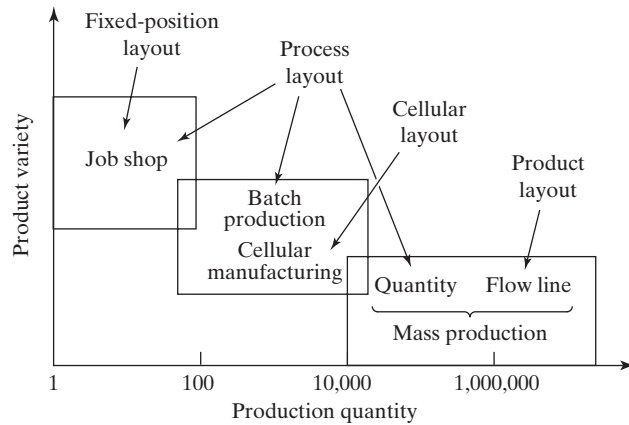


Figure 2.7 Types of facilities and layouts used for different levels of production quantity and product variety.

variety in the products made on the line. Modern automobile assembly is an example. Cars coming off the assembly line have variations in options and trim representing different models (and, in many cases, different nameplates) of the same basic car design. Other examples include small and major appliances. The Boeing Commercial Airplane Company uses production line techniques to assemble its 737 model.

Much of the discussion of the types of production facilities is summarized in Figure 2.7, which adds detail to Figure 2.5 by identifying the types of production facilities and plant layouts used. As Figure 2.7 shows, some overlap exists among the different facility types. Also note the comparison with earlier Figure 1.5, which indicates the type of automation that would be used in each facility type if the facility were automated.

2.4 PRODUCT/PRODUCTION RELATIONSHIPS

As noted in the preceding section, companies organize their production facilities and manufacturing systems in the most efficient manner for the particular products they make. It is instructive to recognize that there are certain product parameters that are influential in determining how the products are manufactured. Consider the following parameters: (1) production quantity, (2) product variety, (3) product complexity (of assembled products), and (4) part complexity.

2.4.1 Production Quantity and Product Variety

Production quantity and product variety were previously discussed in Section 2.3. The symbols Q and P can be used to represent these important parameters, respectively. Q refers to the number of units of a given part or product that are produced annually by a plant, both the quantities of each individual part or product style and the total quantity of all styles. Let each part or product style be identified using the subscript j , so that

Q_j = annual quantity of style j . Then let Q_f = total quantity of all parts or products made in the factory (the subscript f refers to factory). Q_j and Q_f are related as

$$Q_f = \sum_{j=1}^P Q_j \quad (2.1)$$

where P = total number of different part or product styles, and j is a subscript to identify products, $j = 1, 2, \dots, P$.

P refers to the different product designs or types that are produced in a plant. It is a parameter that can be counted, and yet it must be recognized that the difference between products can be great or small, for example, the difference between hard product variety and soft product variety discussed in Section 2.3. Hard product variety is when the products differ substantially. Soft product variety is when there are only small differences between products. The parameter P can be divided into two levels, as in a tree structure. Call them P_1 and P_2 . P_1 refers to the number of distinct product lines produced by the factory, and P_2 refers to the number of models in a product line. P_1 represents hard product variety and P_2 soft variety. The total number of product models is given by

$$P = \sum_{j=1}^{P_1} P_{2j} \quad (2.2)$$

where the subscript j identifies the product line: $j = 1, 2, \dots, P_1$.

EXAMPLE 2.1 Product Lines and Product Models

A company specializes in home entertainment products. It produces only TVs and audio systems. Thus $P_1 = 2$. In its TV line it offers 15 different models, and in its audio line it offers 5 models. Thus for TVs, $P_2 = 15$, and for audio systems, $P_2 = 5$. The totality of product models offered is given by Equation (2.2):

$$P = \sum_{j=1}^2 P_{2j} = 15 + 5 = 20$$

2.4.2 Product and Part Complexity

How complex is each product made in the plant? Product complexity is a complicated issue. It has both qualitative and quantitative aspects. For an assembled product, one possible quantitative indicator of product complexity is its number of components—the more parts, the more complex the product is. This is easily demonstrated by comparing the numbers of components in various assembled products, as in Table 2.4. The list demonstrates that the more components a product has, the more complex it tends to be.

For a manufactured component, a possible measure of part complexity is the number of processing steps required to produce it. An integrated circuit, which is technically a monolithic silicon chip with localized alterations in its surface chemistry, requires hundreds of processing steps in its fabrication. Although it may measure only 12 mm (0.5 in) on a side and 0.5-mm (0.020 in) thick, its complexity is orders of magnitude greater than a round

TABLE 2.4 Typical Number of Separate Components in Various Assembled Products (Compiled from [1], [3], and Other Sources)

Product (Approx. Date or Circa)	Approx. Number of Components
Mechanical pencil (modern)	10
Ball bearing (modern)	20
Rifle (1800)	50
Sewing machine (1875)	150
Bicycle chain	300
Bicycle (modern)	750
Early automobile (1910)	2,000
Automobile (modern)	10,000
Commercial airplane (1930)	100,000
Commercial airplane (modern)	4,000,000

TABLE 2.5 Typical Number of Processing Operations Required to Fabricate Various Parts

Part	Approx. Number of Processing Operations	Typical Processing Operations Used
Plastic molded part	1	Injection molding
Washer (stainless steel)	1	Stamping
Washer (plated steel)	2	Stamping, electroplating
Forged part	3	Heating, forging, trimming
Pump shaft	10	Machining (from bar stock)
Coated carbide cutting tool	15	Pressing, sintering, coating, grinding
Pump housing, machined	20	Casting, machining
V-6 engine block	50	Casting, machining
Integrated circuit chip	Hundreds	Photolithography, various thermal and chemical processes

washer of 12-mm (1/2-in) outside diameter, stamped out of 0.8-mm (1/32-in) thick stainless steel in one step. Table 2.5 is a list of manufactured parts with the typical number of processing operations required for each.

So, complexity of an assembled product can be defined as the number of distinct components; let n_p = the number of parts per product. And processing complexity of each part can be defined as the number of operations required to make it; let n_o = the number of operations or processing steps to make a part. As defined in Figure 2.8, three different types of production plant can be identified on the basis of n_p and n_o : parts producers, pure assembly plants, and vertically integrated plants.

Several relationships can be developed among the parameters P , Q , n_p , and n_o that indicate the level of activity in a manufacturing plant. Ignore the differences between P_1 and P_2 here, although Equation (2.2) could be used to convert these parameters into the corresponding P value. The total number of products made annually in a plant is the sum of the quantities of the individual product designs, as expressed in Equation (2.1). Assuming that the products are all assembled and that all component parts used in these

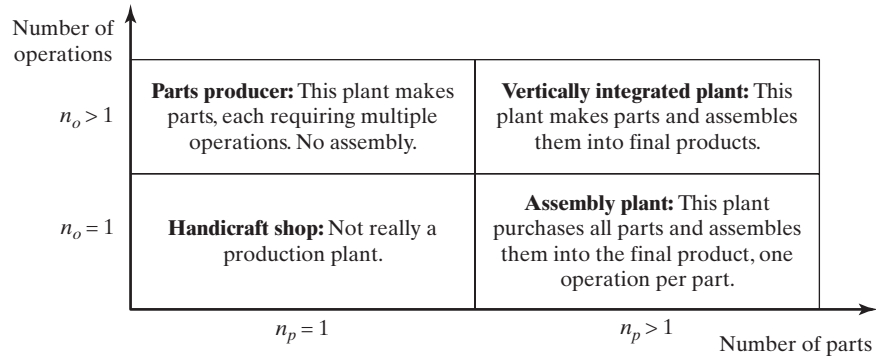


Figure 2.8 Production plants distinguished by number of parts n_p (for assembled products) and number of operations n_o (for manufactured parts).

products are made in the plant (no purchased components), the total number of parts manufactured by the plant per year is given by

$$n_{pf} = \sum_{j=1}^P Q_j n_{pj} \quad (2.3)$$

where n_{pf} = total number of parts made in the factory, pc/yr; Q_j = annual quantity of product style j , products/yr; and n_{pj} = number of parts in product j , pc/product.

Finally, if all parts are manufactured in the plant, then the total number of processing operations performed by the plant is given by

$$n_{of} = \sum_{j=1}^P Q_j \sum_{k=1}^{n_{pj}} n_{ojk} \quad (2.4)$$

where n_{of} = total number of operation cycles performed in the factory, ops/yr; and n_{ojk} = number of processing operations for each part k , summed over the number of parts in product j , n_{pj} . Parameter n_{of} provides a numerical value for the total level of part processing activity in the factory.

Average values of the four parameters P , Q , n_p , and n_o might be used to simplify and better conceptualize the factory model represented by Equations (2.1), (2.3), and (2.4). In this case, the total number of product units produced by the factory is given by

$$Q_f = PQ \quad (2.5)$$

where P = total number of product styles, Q_f = total quantity of products made in the factory and the average Q value is given by the following:

$$Q = \frac{\sum_{j=1}^P Q_j}{P} \quad (2.6)$$

The total number of parts produced by the factory is given by

$$n_{pf} = PQn_p \quad (2.7)$$

where the average n_p value is given by the following:

$$n_p = \frac{\sum_{j=1}^P Q_j n_{pj}}{PQ} \quad (2.8)$$

The total number of manufacturing operations performed by the factory is given by

$$n_{of} = PQn_p n_o \quad (2.9)$$

where the average n_o value is given by the following:

$$n_o = \frac{\sum_{j=1}^P Q_j \sum_{k=1}^{n_{pj}} n_{ojk}}{PQn_{pf}} \quad (2.10)$$

Using the simplified equations based on average values of the parameters, consider the following example.

EXAMPLE 2.2 A Production System Problem

Suppose a company has designed a new product line and is planning to build a new plant to manufacture this product line. The new line consists of 100 different product types, and for each product type the company wants to produce 10,000 units annually. The products average 1,000 components each, and the average number of processing steps required for each component is 10. All parts will be made in the factory. Each processing step takes an average of 1 min. Determine (a) how many products, (b) how many parts, and (c) how many production operations will be required each year, and (d) how many workers will be needed in the plant, if each worker works 8 hr per shift for 250 days/yr (2,000 hr/yr)?

Solution: (a) The total number of units to be produced by the factory annually is given by

$$Q = PQ = 100 \times 10,000 = \mathbf{1,000,000 \text{ products}}$$

(b) The total number of parts produced annually is

$$n_{pf} = PQn_p = 1,000,000 \times 1,000 = \mathbf{1,000,000,000 \text{ parts}}$$

(c) The number of distinct production operations is

$$n_{of} = PQn_p n_o = 1,000,000,000 \times 10 = \mathbf{10,000,000,000 \text{ operations}}$$

(d) First consider the total time TT to perform these operations. If each operation takes 1 min (1/60 hr),

$$TT = 10,000,000,000 \times 1/60 = \mathbf{166,666,667 \text{ hr}}$$

If each worker works 2,000 hr/yr, then the total number of workers required is

$$w = \frac{166,666,667}{2000} = \mathbf{83,333 \text{ workers}}$$



The factory in this example is a parts producer. If product assembly were accomplished in addition to parts production, then it would be a vertically integrated plant. In either case, it would be a big factory. The calculated number of workers only includes direct labor for parts production. Add indirect labor, staff, and management, and the number increases to well over 100,000 employees. Imagine the parking lot. And inside the factory, the logistics problems of dealing with all of the products, parts, and operations would be overwhelming. No organization in its right mind would consider building or operating such a plant today—not even the federal government.

2.4.3 Limitations and Capabilities of a Manufacturing Plant

Companies do not attempt the kind of factory in Example 2.2. Instead, today's factories are designed with much more specific missions. Referred to as *focused factories*, they are plants that concentrate “on a limited, concise, manageable set of products, technologies, volumes, and markets” [5]. It is a recognition that a manufacturing plant cannot do everything. It must limit its mission to a certain scope of products and activities in which it can best compete. Its size is typically about 500 workers or fewer, although the number may vary for different types of products and manufacturing operations.

Consider how a plant, or its parent company, limits the scope of its manufacturing operations and production systems. In limiting its scope, the plant in effect makes a set of deliberate decisions about what it will not try to do. Certainly one way to limit a plant's scope is to avoid being a fully integrated factory. Instead, the plant specializes in being either a parts producer or an assembly plant. Just as it decides what it will not do, the plant must also decide on the specific technologies, products, and volumes in which it will specialize. These decisions determine the plant's intended *manufacturing capability*, which refers to the technical and physical limitations of a manufacturing firm and each of its plants. Several dimensions of this capability can be identified: (1) technological processing capability, (2) physical size and weight of product, and (3) production capacity.

Technological Processing Capability. The technological processing capability of a plant (or company) is its available set of manufacturing processes. Certain plants perform machining operations, others roll steel billets into sheet stock, and others build automobiles. A machine shop cannot roll steel, and a rolling mill cannot build cars. The underlying feature that distinguishes these plants is the set of processes they can perform. Technological processing capability is closely related to the material being processed. Certain manufacturing processes are suited to certain materials, while other processes are suited to other materials. By specializing in a certain process or group of processes, the plant is simultaneously specializing in a certain material type or range of materials.

Technological processing capability includes not only the physical processes, but also the expertise possessed by plant personnel in these processing technologies. Companies are limited by their available processes. They must focus on designing and manufacturing products for which their technological processing capability provides a competitive advantage.

Physical Product Limitations. A second aspect of manufacturing capability is imposed by the physical product. Given a plant with a certain set of processes, there are size and weight limitations on the products that can be accommodated in the plant. Big, heavy products are difficult to move. To move such products, the plant must be equipped with cranes of large load capacity. Smaller parts and products made in large quantities can be

moved by conveyor or fork lift truck. The limitation on product size and weight extends to the physical capacity of the manufacturing equipment as well. Production machines come in different sizes. Larger machines can be used to process larger parts. Smaller machines limit the size of the work that can be processed. The set of production equipment, material handling, storage capability, and plant size must be planned for products that lie within a certain size and weight range.

Production Capacity. A third limitation on a plant's manufacturing capability is the production quantity that can be produced in a given time period (e.g., month or year). Production capacity is defined as the maximum rate of production per period that a plant can achieve under assumed operating conditions. The operating conditions refer to the number of shifts per week, hours per shift, direct labor manning levels in the plant, and similar conditions under which the plant has been designed to operate. These factors represent inputs to the manufacturing plant. Given these inputs, how much output can the factory produce?

Plant capacity is often measured in terms of output units, such as annual tons of steel produced by a steel mill, or number of cars produced by a final assembly plant. In these cases, the outputs are homogeneous, more or less. In cases where the output units are not homogeneous, other factors may be more appropriate measures, such as available labor hours of productive capacity in a machine shop that produces a variety of parts.

REFERENCES

- [1] BLACK, J. T., *The Design of the Factory with a Future*, McGraw-Hill, Inc., New York, NY, 1991.
- [2] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [3] HOUNSHELL, D. A., *From the American System to Mass Production, 1800–1932*, The Johns Hopkins University Press, Baltimore, MD, 1984.
- [4] MERCHANT, M. E., "The Inexorable Push for Automated Production," *Production Engineering*, January 1977, pp. 45–46.
- [5] SKINNER, W., "The Focused Factory," *Harvard Business Review*, May–June 1974, pp. 113–121.

REVIEW QUESTIONS

- 2.1 What is manufacturing?
- 2.2 What are the three basic industry categories?
- 2.3 What is the difference between consumer goods and capital goods?
- 2.4 What is the difference between a processing operation and an assembly operation?
- 2.5 Name the four categories of part-shaping operations, based on the state of the starting work material.
- 2.6 Assembly operations can be classified as permanent joining methods and mechanical assembly. What are the four types of permanent joining methods?
- 2.7 What is the difference between hard product variety and soft product variety?
- 2.8 What type of production does a job shop perform?

- 2.9 Flow-line production is associated with which one of the following layout types: (a) cellular layout, (b) fixed-position layout, (c) process layout, or (d) product layout?
- 2.10 What is the difference between a single-model production line and a mixed-model production line?
- 2.11 What is meant by the term *technological processing capability*?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

- 2.1 **(A)** A manufacturing plant produces three product lines in one of its plants: A, B, and C. Each product line has multiple models: 3 models within product line A, 5 models within B, and 7 within C. Average annual production quantities of model A is 400 units, 800 units for model B, and 500 units for model C. Determine the number of (a) different product models and (b) total quantity of products produced annually in this plant.
- 2.2 Consider product line A in Problem 2.1. Its three models have an average of 46 components each, and the average number of operations needed to produce each component is 3.5. All components are made in the same plant. Determine the total number of (a) components produced and (b) operations performed in the plant annually.
- 2.3 A company produces two products in one of its plants: A and B. Annual production of Product A is 3,600 units and of Product B is 2,500 units. Product A has 47 components and Product B has 52 components. For Product A, 40% of the components are made in the plant, while 60% are purchased parts. For Product B, 30% of the components are made in the plant, while 70% are purchased. For these two products taken together, what is the total number of (a) components made in the plant and (b) components purchased?
- 2.4 **(A)** A product line has two models: X and Y. Model X consists of 4 components: a, b, c, and d. The number of processing operations required to produce these four components are 2, 3, 4, and 5, respectively. Model Y consists of 3 components: e, f, and g. The number of processing operations required to produce these three components are, 6, 7, and 8 respectively. The annual quantity of Model X is 1,000 units and of Model Y is 1,500 units. Determine the total number of (a) components and (b) processing operations associated with these two models.
- 2.5 The ABC Company is planning a new product line and a new plant to produce the parts for the line. The product line will include 8 different models. Annual production of each model is expected to be 900 units. Each product will be assembled of 180 components. All processing of parts will be accomplished in the new plant. On average, 6 processing operations are required to produce each component, and each operation takes an average of 1 min (including an allowance for setup time and part handling). All processing operations are performed at workstations, each of which includes a production machine and a human worker. The plant operates one shift. Determine the number of (a) components, (b) processing operations, and (c) workers that will be needed to accomplish the processing operations if each worker works 2,000 hr/yr.
- 2.6 The XYZ Company is planning a new product line and a new factory to produce the parts and assemble the final products. The product line will include 10 different models. Annual production of each model is expected to be 1,000 units. Each product will be assembled of 300 components, but 65% of these will be purchased parts (not made in the new factory). There is an average of 8 processing operations required to produce each component, and each processing step takes 30 sec (including an allowance for setup time and part handling). Each final unit of product takes 48 min to assemble. All processing operations are performed at work cells that include a production machine and a human worker. Products are

assembled at single workstations consisting of one worker each plus assembly fixtures and tooling. Each work cell and each workstation require 25 m^2 of floor space and an additional allowance of 45% must be added to the total production area for aisles, work-in-process storage, shipping and receiving, rest rooms, and other utility space. The factory will operate one shift (the day shift, 2,000 hr/yr). Determine (a) how many processing and assembly operations, (b) how many workers (direct labor only), and (c) how much total floor space will be required in the plant.

- 2.7** Suppose the company in Problem 2.6 were to operate two shifts (a day shift and an evening shift, a total of 4,000 hr/yr) instead of one shift to accomplish the processing operations. The assembly of the product would still be accomplished on the day shift. Determine (a) how many processing and assembly operations, (b) how many workers on each shift (direct labor only), and (c) how much total floor space will be required in the plant.

Chapter 3

Manufacturing Metrics and Economics

CHAPTER CONTENTS

- 3.1 Production Performance Metrics
 - 3.1.1 Cycle Time and Production Rate
 - 3.1.2 Production Capacity and Utilization
 - 3.1.3 Manufacturing Lead Time and Work-in-Process
 - 3.2 Manufacturing Costs
 - 3.2.1 Fixed and Variable Costs
 - 3.2.2 Direct Labor, Material, and Overhead
 - 3.2.3 Cost of Equipment Usage
 - 3.2.4 Cost of a Manufactured Part
- Appendix 3A: Averaging Formulas for Equation (3.20)

In the previous chapter, manufacturing was defined as a transformation process that adds value to a starting material. The current chapter expands on this definition by considering several metrics. Successful manufacturing companies use metrics to manage their operations. Quantitative metrics allow a company to estimate part and product costs, track performance in successive periods (e.g., months and years), identify problems with performance, and compare alternative methods. Manufacturing metrics can be divided into two basic categories: (1) production performance measures and (2) manufacturing costs. Metrics that indicate production performance include production rate, plant capacity,

equipment availability (a reliability measure), and manufacturing lead time. Manufacturing costs that are important to a company include labor and material costs, overhead costs, the cost of operating a given piece of equipment, and unit part and product costs.

3.1 PRODUCTION PERFORMANCE METRICS

In this section, various metrics of production performance are defined. The logical starting point is the cycle time for a unit operation, from which the production rate for the operation is derived. These unit operation metrics can be used to develop measures of performance at the factory level: production capacity, utilization, manufacturing lead time, and work-in-process.

3.1.1 Cycle Time and Production Rate

As described in the introduction to Chapter 2, manufacturing is almost always carried out as a sequence of unit operations, each of which transforms the part or product closer to its final form as defined by the engineering specifications. Unit operations are usually performed by production machines that are tended by workers, either full time or periodically in the case of automated equipment. In flow-line production (e.g., production lines), unit operations are performed at the workstations that comprise the line.

Cycle Time Analysis. For a unit operation, the cycle time T_c is the time that one work unit¹ spends being processed or assembled. It is the time interval between when one work unit begins processing (or assembly) and when the next unit begins. T_c is the time an individual part spends at the machine, but not all of this is processing time. In a typical processing operation, such as machining, T_c consists of (1) actual processing time, (2) work part handling time, and (3) tool handling time per workpiece. As an equation, this can be expressed as:

$$T_c = T_o + T_h + T_t \quad (3.1)$$

where T_c = cycle time, min/pc; T_o = time of the actual processing or assembly operation, min/pc; T_h = handling time, min/pc; and T_t = average tool handling time, min/pc, if such an activity is applicable. In a machining operation, tool handling time consists of time spent changing tools when they wear out, time changing from one tool to the next, tool indexing time for indexable inserts or for tools on a turret lathe or turret drill, tool repositioning for a next pass, and so on. Some of these tool handling activities do not occur every cycle; therefore, they must be apportioned over the number of parts between their occurrences to obtain an average time per workpiece.

Each of the terms, T_o , T_h , and T_t , has its counterpart in other types of discrete-item production. There is a portion of the cycle when the part is actually being processed (T_o); there is a portion of the cycle when the part is being handled (T_h); and there is, on average, a portion when the tooling is being adjusted or changed (T_t). Accordingly, Equation (3.1) can be generalized to cover most processing operations in manufacturing.

Production Rate. The production rate for a unit production operation is usually expressed as an hourly rate, that is, work units completed per hour (pc/hr). Consider

¹As defined in Chapter 1, the *work unit* is the part or product being processed or assembled.

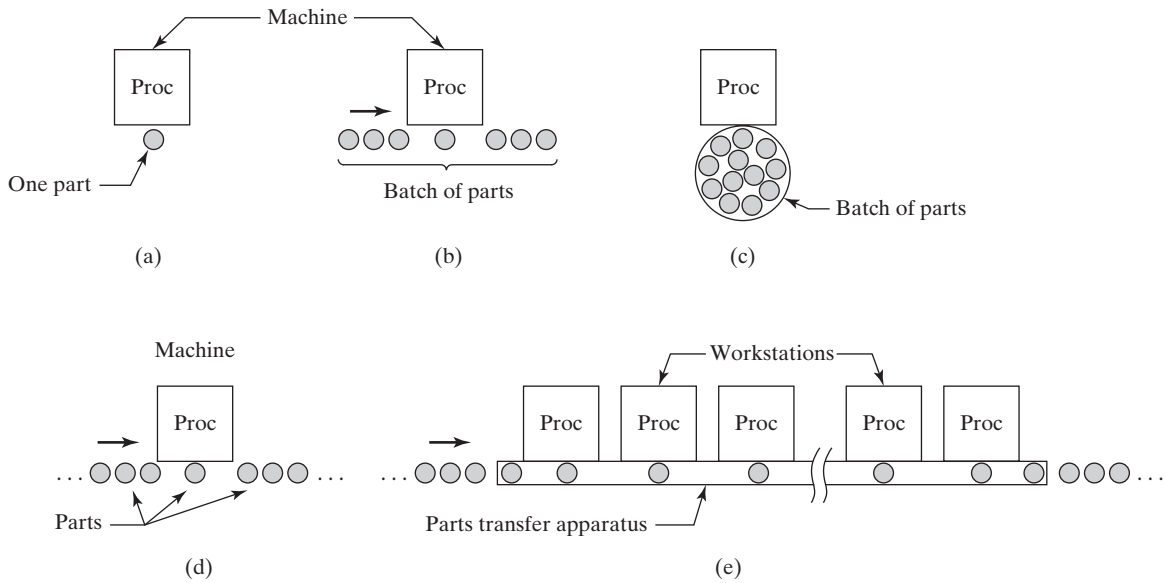


Figure 3.1 Types of production operations: (a) job shop with production quantity $Q = 1$, (b) sequential batch production, (c) simultaneous batch production, (d) quantity mass production, and (e) flow-line mass production. Key: Proc = process.

how the production rate is determined based on the operation cycle time for the three types of production: job shop production, batch production, and mass production. The various categories of production operations are depicted in Figure 3.1.

In job shop production, quantities are low ($1 \leq Q \leq 100$). At the extreme low end of the range, when quantity $Q = 1$, the production time per work unit is the sum of setup and cycle times:

$$T_p = T_{su} + T_c \quad (3.2)$$

where T_p = average production time, min/pc; T_{su} = setup time to prepare the machine to produce the part, min/pc; and T_c = cycle time from Equation (3.1). The production rate for the unit operation is simply the reciprocal of production time, usually expressed as an hourly rate:

$$R_p = \frac{60}{T_p} \quad (3.3)$$

where R_p = hourly production rate, pc/hr; T_p = production time from Equation (3.2), and the constant 60 converts minutes to hours. When the production quantity is greater than one, the analysis is the same as in batch production.

As noted in Section 2.1, batch production usually involves work units that are processed one at a time, referred to as sequential batch processing. Examples include machining, sheet metal stamping, and plastic injection molding. However, some batch production involves all work units in the batch being processed together, called simultaneous batch processing. Examples include most heat-treating and electroplating operations, in which all of the parts in the batch are processed at once.

In sequential batch processing, the time to process one batch consisting of Q work units is the sum of the setup time and processing time, where the processing time is the batch quantity multiplied by the cycle time; that is,

$$T_b = T_{su} + QT_c \quad (3.4a)$$

where T_b = batch processing time, min/batch; T_{su} = setup time to prepare the machine for the batch, min/batch; Q = batch quantity, pc/batch; and T_c = cycle time per work unit, min/cycle. If one work unit is completed each cycle, then T_c has units of min/pc. If more than one part is produced each cycle, then Equation (3.4) must be adjusted accordingly. An example of this situation is when the mold in a plastic injection molding operation contains two cavities, so that two moldings are produced each cycle.

In simultaneous batch processing, the time to process a batch consisting of Q work units is the sum of the setup time and processing time, where the processing time is the time to simultaneously process all of the parts in the batch; that is,

$$T_b = T_{su} + T_c \quad (3.4b)$$

where T_b = batch processing time, min/batch; T_{su} = setup time, min/batch; and T_c = cycle time per batch, min/cycle.

To obtain the average production time per work unit T_p for the unit operation, the batch time in Equation (3.4a) or (3.4b) is divided by the batch quantity:

$$T_p = \frac{T_b}{Q} \quad (3.5)$$

and production rate is calculated using Equation (3.3).

For quantity-type mass production, the production rate equals the cycle rate of the machine (reciprocal of operation cycle time) after production is underway and the effects of setup time become insignificant. That is, as Q becomes very large, $(T_{su}/Q) \rightarrow 0$ and

$$R_p \rightarrow R_c = \frac{60}{T_c} \quad (3.6)$$

where R_c = operation cycle rate of the machine, pc/hr, and T_c = operation cycle time, min/pc.

For flow-line mass production, the production rate approximates the cycle rate of the production line, again neglecting setup time. However, the operation of production lines is complicated by the interdependence of the workstations on the line. One complication is that it is usually impossible to divide the total work equally among all of the workstations on the line; therefore, one station ends up with the longest operation time, and this station sets the pace for the entire line. The term *bottleneck station* is sometimes used to refer to this station. Also included in the cycle time is the time to move parts from one station to the next at the end of each operation. In many production lines, all work units on the line are moved synchronously, each to its respective next station. Taking these factors into account, the cycle time of a production line is the longest processing (or assembly) time plus the time to transfer work units between stations. This can be expressed as

$$T_c = \text{Max } T_o + T_r \quad (3.7)$$

where T_c = cycle time of the production line, min/cycle; $\text{Max } T_o$ = the operation time at the bottleneck station (the maximum of the operation times for all stations on the

line, min/cycle); and T_r = time to transfer work units between stations each cycle, min/cycle. T_r is analogous to T_h in Equation (3.1). The tool handling time T_t is usually accomplished as a maintenance function and is not included in the calculation of cycle time. Theoretically, the production rate can be determined by taking the reciprocal of T_c as

$$R_c = \frac{60}{T_c} \quad (3.8)$$

where R_c = theoretical or ideal production rate, but call it the cycle rate to be more precise, cycles/hr, and T_c = cycle time from Equation (3.7).

The preceding equations for cycle time and production rate ignore the issue of defective parts and products made in the operation. Although perfect quality is an ideal goal in manufacturing, the reality is that some processes produce defects. The issue of scrap rates and their effects on production quantities and costs in both unit operations and sequences of unit operations is considered in Chapter 21 on inspection principles and practices.

Equipment Reliability. Lost production time due to equipment reliability problems reduces the production rates determined by the previous equations. The most useful measure of reliability is **availability**, defined as the uptime proportion of the equipment; that is, the proportion of time that the equipment is capable of operating (not broken down) relative to the scheduled hours of production. The measure is especially appropriate for automated production equipment.

Availability can also be defined using two other reliability terms, *mean time between failures (MTBF)* and *mean time to repair (MTTR)*. As depicted in Figure 3.2, *MTBF* is the average length of time the piece of equipment runs between breakdowns, and *MTTR* is the average time required to service the equipment and put it back into operation when a breakdown occurs. In equation form,

$$A = \frac{MTBF - MTTR}{MTBF} \quad (3.9)$$

where A = availability (proportion); $MTBF$ = mean time between failures, hr; and $MTTR$ = mean time to repair, hr. The mean time to repair may include waiting time of the broken-down equipment before repairs begin. Availability is typically expressed as

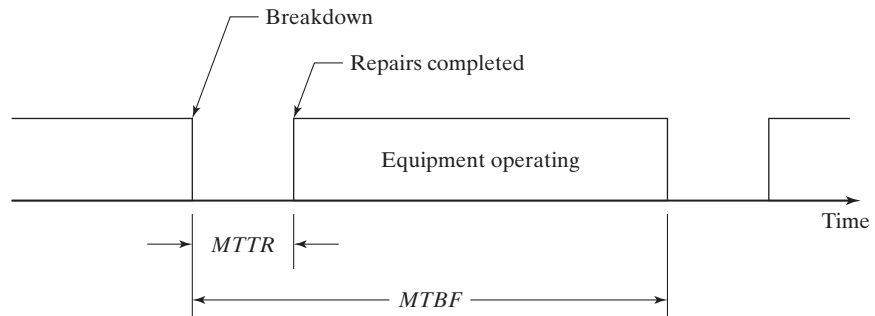


Figure 3.2 Time scale showing *MTBF* and *MTTR* used to define availability A .

a percentage. When a piece of equipment is brand new (and being debugged), and later when it begins to age, its availability tends to be lower.

Taking availability into account, the actual average production rate of the equipment is its availability multiplied by R_p from any of the preceding production rate equations (i.e., average production rate = AR_p), based on the assumption that setup time is also affected by the availability.

Reliability is particularly bothersome in the operation of automated production lines. This is because of the interdependence of workstations in an automated line, in which the entire line is forced to stop when one station breaks down. The actual average production rate R_p is reduced to a value that is often substantially below the ideal R_c given by Equation (3.8). The effect of reliability on manual and automated production lines and automated assembly systems is examined in Chapters 15 through 17.

3.1.2 Production Capacity and Utilization

Production capacity was discussed in the context of manufacturing capabilities in Section 2.4.3. It is defined as the maximum rate of output that a production facility (or production line, or group of machines) is able to produce under a given set of assumed operating conditions. The production facility usually refers to a plant or factory, and so the term *plant capacity* is often used for this measure. One might say that plant capacity is to the aggregate plant operation as production rate is to the unit operation. As mentioned before, the assumed operating conditions refer to the number of shifts per day (one, two, or three), number of days in the week that the plant operates, employment levels, and so forth.

The number of hours of plant operation per week is a critical issue in defining plant capacity. For continuous chemical production in which the reactions occur at elevated temperatures, the plant is usually operated 24 hours per day, seven days per week (168 hours per week). On the other hand, many discrete product plants operate one shift per day, five days per week. For an automobile final assembly plant, capacity is typically defined as one or two shifts, depending on the demand for the cars made in the plant. In situations when demand is very high, three production shifts may be used. A trend in manufacturing is to define plant capacity for the full 7-day week, 24 hours per day. This is the maximum time available, and if the plant operates fewer hours, then it is operating at less than its full capacity.

Determining Plant Capacity. Quantitative measures of plant capacity can be developed based on the production rate models derived earlier. Let PC = the production capacity of a given facility, where the measure of capacity is the number of units produced per time period (e.g., week, month, year). The simplest case is where there are n production machines in the plant and they all produce the same part or product, which implies quantity-type mass production. Each machine is capable of producing at the same rate of R_p units per hour, as defined by Equation (3.6). Each machine operates for the number of hours in the period. These parameters can be combined to calculate the weekly production capacity of the facility,

$$PC = nH_{pc}R_p \quad (3.10)$$

where PC = production capacity, pc/period; n = number of machines; and H_{pc} = the number of hours in the period being used to measure production capacity (or plant capacity).

TABLE 3.1 Number of Hours of Plant Operation for Various Periods and Operating Conditions.

Operating Conditions	Period		
	Week	Month	Year
One 8-hr shift, 5 days/week, 50 weeks/year	40	167	2000
Two 8-hr shifts, 5 days/week, 50 weeks/year	80	333	4000
Three 8-hr shifts, 5 days/week, 50 weeks/year	120	500	6000
One 8-hr shift, 7 days/week, 50 weeks/year	56	233	2800
Two 8-hr shifts, 7 days/week, 50 weeks/year	112	467	5600
Three 8-hr shifts, 7 days/week, 50 weeks/year	168	700	8400
24 hr/day, 7 days/week, 52 weeks/year (24/7)	168	728	8736

Table 3.1 lists the number of hours of plant operation for various periods and operating conditions. Consistent with the definition of production capacity given earlier, Equation (3.10) assumes that all machines are operating full time during the entire period defined by H_{pc} .

EXAMPLE 3.1 Production Capacity

The automatic lathe department has five machines, all devoted to the production of the same product. The machines operate two 8-hr shifts, 5 days/week, 50 weeks/year. Production rate of each machine is 15 unit/hr. Determine the weekly production capacity of the automatic lathe department.

Solution: From Equation (3.10) and Table 3.1,

$$PC = 5(80)(15) = \mathbf{6,000 \text{ pc/wk}}$$

In cases in which different machines produce different parts at different production rates, the following equation applies for quantity-type mass production:

$$PC = H_{pc} \sum_{i=1}^n R_{pi} \quad (3.11)$$

where n = number of machines in the plant, and R_{pi} = hourly production rate of machine i , and all machines are operating full time during the entire period defined by H_{pc} .

In job shop and batch production, each machine may be used to produce more than one batch, where each batch is made up of a different part style j . Let f_{ij} = the fraction of time during the period that machine i is processing part style j . Under normal operating conditions, it follows that for each machine i ,

$$0 \leq \sum_j f_{ij} \leq 1 \text{ where } 0 \leq f_{ij} \leq 1 \text{ for all } i \quad (3.12)$$

The lower limit in Equation (3.12) indicates that the machine is idle during the entire week. Values between 0 and 1 mean that the machine experiences idle time during the week. The upper limit means that the machine is utilized 100% of the time during

the week. If the upper limit is exceeded ($\sum f_{ij} > 1$), then this can be interpreted as the machine being used on an overtime basis beyond the number of hours H_{pc} in the definition of plant capacity.

The production output of the plant must include the effect of operation sequence for part or product j . This is accomplished by dividing the production rate for each machine that participates in the production of part j by the number of operations in the operation sequence for that part, n_{oj} . The resulting average hourly production output for the plant is given by:

$$R_{pph} = \sum_{i=1}^n \sum_j f_{ij} R_{pij} / n_{oj} \quad (3.13)$$

where R_{pph} = average hourly plant production rate, pc/hr; R_{pij} = production rate of machine i when processing part j , pc/hr; n_{oj} = the number of operations required to produce part j , and f_{ij} is defined earlier. The individual values of R_{pij} are determined based on Equations (3.3) and (3.5), specifically:

$$R_{pij} = \frac{60}{T_{pij}} \text{ where } T_{pij} = \frac{T_{suij} + Q_j T_{cij}}{Q_j}$$

where T_{pij} = average production time for part j on machine i , min/pc; T_{suij} = setup time for part j on machine i , min/batch; and Q_j = batch quantity of part j , pc/batch.

The plant output for a given period of interest (e.g., week, month, year) can be determined based on the average hourly production rate given by Equation (3.13). For example, weekly plant output is given by the following:

$$R_{ppw} = H_{pw} R_{pph} \quad (3.14)$$

where R_{ppw} = weekly plant production rate for the plant, pc/wk; R_{pph} = average hourly production rate for the plant, pc/hr, from Equation (3.13); and H_{pw} = number of hours in the week from Table 3.1. If the period of interest is a month, then $R_{ppm} = H_{pm} R_{pph}$, and if the period is a year, then $R_{ppy} = H_{py} R_{pph}$.

Most manufacturing is accomplished in batches, and most manufactured products require a sequence of processing steps on multiple machines. Just as there is a bottleneck station in flow-line production, it is not unusual for certain machines in a given plant to limit the production output of the plant. They determine the plant capacity. These machines operate at 100% utilization while other machines in the sequence have lower utilizations. The net result is that the average equipment utilization in the plant is less than 100%, but the plant is still operating at its maximum capacity due to the limitations of these bottleneck operations. If this is the situation, then weekly production capacity is given by Equation (3.14), that is, $PC = R_{ppw}$.

EXAMPLE 3.2 Weekly Production Rate

A small machine shop has two machines and works 40 hr/wk. During a week of interest, four batches of parts were processed through these machines. Batch quantities, batch times, and operation sequences for the parts are given in the table below. Determine (a) weekly production output of the shop and (b) whether this represents the weekly plant capacity.

Part	Machine 1		Machine 2	
	R_p	Duration	R_p	Duration
A	25 pc/hr	12 hr	30 pc/hr	10 hr
B	10 pc/hr	20 hr		
C			7.5 pc/hr	24 hr
D			20 pc/hr	6 hr

Solution: (a) To determine the weekly production output, the f_{ij} values are determined as follows, given 40 hr per week: $f_{1A} = 12/40 = 0.30$, $f_{1B} = 20/40 = 0.50$, $f_{2A} = 10/40 = 0.25$, $f_{2C} = 24/40 = 0.60$, and $f_{2D} = 6/40 = 0.15$. The fraction of idle time on machine 1 is $= 8/40 = 0.20$. Noting that part A has 2 operations in its operation sequence and the other parts have 1, the hourly production rate of parts completed in the plant is given by Equation (3.13):

$$R_{pph} = \frac{0.3(25)}{2} + 0.5(10) + \frac{0.25(30)}{2} + 0.6(7.5) + 0.15(20) = 20 \text{ pc/hr}$$

Weekly production output $R_{ppw} = 40(20) = \mathbf{800 \text{ pc/wk}}$

(b) Machine 2 is operating the full 40 hr/wk. Given the part mix in the problem, machine 2 is the bottleneck in the plant, and so the 800 pc/wk represents plant capacity: $PC_w = \mathbf{800 \text{ pc/wk}}$.

Comment: Machine 1 is only operating 32 hr/wk, so it might be inferred from the situation that the production of part B could be increased by 80 units ($8 \text{ hr} \times 10 \text{ pc/hr}$) to achieve a plant capacity of 880 pc/wk. The question is whether there would be a demand for those 80 additional units of part B. □

Utilization. Utilization is the proportion of time that a productive resource (e.g., a production machine) is used relative to the time available under the definition of plant capacity. Expressing this as an equation,

$$U_i = \sum_j f_{ij} \quad (3.15)$$

where U_i = utilization of machine i , and f_{ij} = the fraction of time during the available hours that machine i is processing part style j . An overall utilization for the plant is determined by averaging the U_i values over the number of machines:

$$U = \frac{\sum_{i=1}^n \sum_j f_{ij}}{n} = \frac{\sum_j U_i}{n} \quad (3.16)$$

The trouble with Equation (3.13) is that weekly production rate is the sum of the outputs of a mixture of part or product styles. The mixture is likely to change from week to week, so that parts with different production rates are produced in different weeks.

During one week, output might be higher than average simply because the production rates of the parts produced that week were high. To deal with this possible inconsistency, plant capacity is sometimes reported as the workload corresponding to the output produced during the period. **Workload** is defined as the total hours required to produce a given number of units during a given week or other period of interest. That is,

$$WL = \sum_i \sum_j Q_{ij} T_{pij} \quad (3.17)$$

where WL = workload, hr; Q_{ij} = number of work units produced of part style j on machine i during the period of interest; and T_{pij} = average production time of part style j on machine i . In Example 3.2, the workload is the sum of the duration hours listed for machines 1 and 2, a total of 72 hr. When used as the definition of plant capacity, workload refers to the maximum number of hours of work that the plant is capable of completing in the period of interest, which is 80 hr in Example 3.2.

Adjusting Plant Capacity. The preceding equations and examples indicate the operating parameters that affect plant capacity. Changes that can be made to increase or decrease plant capacity over the short term are listed below:

- Increase or decrease the number of machines n in the plant. It is easier to remove machines from operation than to add machines if adding them means purchasing equipment that may require long lead times to procure. Adding workers in the short term may be easier than adding equipment.
- Increase or decrease the number of shifts per week. For example, Saturday shifts might be authorized to temporarily increase capacity, or the plant might operate two shifts per day instead of one.
- Increase or decrease the number of hours worked per shift. For example, overtime on each regular shift might be authorized to increase capacity.

Over the intermediate and longer terms, the following changes can be made to increase plant capacity:

- Increase the number of machines n in the shop. This might be done by using equipment that was formerly not in use, acquiring new machines, and hiring new workers.
- Increase the production rate R_p by making improvements in methods and/or processing technology.
- Reduce the number of operations n_o in the operation sequence of parts by using combined operations, simultaneous operations, and/or integration of operations (Section 1.4.2, strategies 2, 3, and 4).

Other adjustments that can be considered to affect plant capacity in the short term or long term include the following:

- Identify the bottleneck operations in the plant and somehow increase the output rates of these operations, using the USA Principle and other approaches outlined in Section 1.4. Bottleneck operations in a batch manufacturing plant usually reveal themselves in one or both of the following ways: (1) These machines are always busy; they operate at 100% utilization; and (2) they have large queues of work waiting in front of them.

- Stockpile inventory to maintain level employment during slow periods, trusting (and betting) that the goods can later be sold when demand increases.
- Backlogging orders, which means delaying deliveries to customers during busy periods to avoid temporary and potentially costly increases in production capacity.
- Subcontracting work to outside vendors during busy periods or taking in extra work from other firms during slack periods.

3.1.3 Manufacturing Lead Time and Work-In-Process

In the competitive environment of global commerce, the ability of a manufacturing firm to deliver a product to the customer in the shortest possible time often wins the order. This section examines this performance measure, called manufacturing lead time (*MLT*). Closely correlated with *MLT* is the amount of inventory located in the plant as partially completed product, called work-in-process (*WIP*). When there is too much work-in-process, manufacturing lead time tends to be long.

Manufacturing Lead Time. *MLT* is defined as the total time required to process a given part or product through the plant, including any time due to delays, parts being moved between operations, time spent in queues, and so on. As noted previously, production usually consists of a sequence of unit processing operations. Between the unit operations are these nonproductive elements, which typically consume large blocks of time (recall the Merchant study, Section 2.2.2). Thus, production activities can be divided into two categories, unit operations and nonoperation times.

The reader may be wondering: Why do these nonoperation times occur? Why not just take the parts straightaway from one operation to the next without these delays? Some of the reasons why nonoperation time occurs between unit operations are the following: (1) time spent transporting batches of parts between operations, (2) buildup of queues of parts waiting before each operation, (3) buildup of queues of parts after each operation waiting to be transported to the next operation, (4) less than optimal scheduling of batches, (5) part inspections before and/or after unit operations, (6) equipment breakdowns resulting in lost production time, and (7) workload imbalances among the machines that perform the operations required for a given part or product style, with some machines being 100% utilized while others spend much of the time waiting for work.

Let T_c = the operation cycle time at a given machine, and T_{no} = the nonoperation time associated with each operation. Further, suppose that the number of separate operations (machines) through which the work unit must be routed = n_o . In batch production, there are Q work units in the batch. A setup is generally required to prepare each machine for the particular product, which requires a time = T_{su} . Given these terms, manufacturing lead time for a given batch is defined as

$$MLT_j = \sum_{i=1}^{n_{oj}} (T_{suij} + Q_j T_{cij} + T_{noij}) \quad (3.18)$$

where MLT_j = manufacturing lead time for a batch of part or product j , min; T_{suij} = setup time for operation i on part or product j , min; Q_j = quantity of part or product j in the batch being processed, pc; T_{cij} = cycle time for operation i on part or product j , min/pc; T_{noij} = nonoperation time associated with operation i , min; and i indicates the operation sequence in the processing, $i = 1, 2, \dots, n_{oj}$. The *MLT* equation does not include the

time the raw work part spends in storage before its turn in the production schedule begins. Neither does it take into account availability (reliability) of equipment. The effect of equipment availability is assumed to be factored into the nonoperation time between operations.

The average manufacturing lead time over the number of batches to be averaged is given by the following:

$$MLT = \frac{\sum_{j=1}^{n_b} MLT_j}{n_b} \quad (3.19)$$

where MLT = average manufacturing lead time, min, for the n_b batches (parts or products) over which the averaging procedure is carried out, and MLT_j = lead time for batch j from Equation 3.18. In the extreme case in which all of the parts or products are included in the averaging procedure, $n_b = P$, where P = the number of different part or product styles made by the factory.

To simplify matters and enhance conceptualization of this aspect of factory operations, properly weighted average values of batch quantity, number of operations per batch, setup time, operation cycle time, and nonoperation time can be used for the n_b batches being considered. With these simplifications, Equations (3.18) and (3.19) reduce to the following:

$$MLT = n_o(T_{su} + QT_c + T_{no}) \quad (3.20)$$

where MLT = average manufacturing lead time for all parts or products in the plant, min; and the terms Q , n_o , T_{su} , T_c , and T_{no} are all average values for these parameters. Formulas to determine these average values are presented in Appendix 3A.

EXAMPLE 3.3 Manufacturing Lead Time

A certain part is produced in batch sizes of 100 units. The batches must be routed through five operations to complete the processing of the parts. Average setup time is 3.0 hr/batch, and average operation time is 6.0 min/pc. Average nonoperation time is 7.5 hr for each operation. Determine the manufacturing lead time to complete one batch, assuming the plant runs 8 hr/day, 5 days/wk.

Solution: Given $T_{su} = 3.0$ hr and $T_{no} = 7.5$ hr, the manufacturing lead time for this batch is computed from Equation (3.20), where the symbol j refers to the fact that only one part style is being considered.

$$MLT_j = 5(3.0 + 100(6.0/60) + 7.5) = 5(20.5) = \mathbf{102.5 \text{ hr}}$$

At 8 hr/day, this amounts to $102.5/8 = 12.81$ days

Equation (3.20) can be adapted for job shop production and mass production by making adjustments in the parameter values. For a job shop in which the batch size is one ($Q = 1$), Equation (3.20) becomes

$$MLT = n_o(T_{su} + T_c + T_{no}) \quad (3.21)$$

For mass production, the Q term in Equation (3.20) is very large and dominates the other terms. In the case of quantity-type mass production in which a large number of units are made on a single machine ($n_o = 1$), MLT is the operation cycle time for the machine plus the nonoperation time. In this case, T_{no} consists of the time parts spend in queues before and after processing. The transportation of parts into and out of the machine is likely to be accomplished in batches. This definition assumes steady-state operation after the setup has been completed and production begins.

For flow-line mass production, the entire production line is set up in advance. If the workstations are integrated so that all stations are processing their own respective work units, then the time to accomplish all of the operations is the time it takes each work unit to progress through all of the stations on the line plus the nonoperation time. Again, T_{no} consists of the time parts spend in queues before and after processing on the line. The station with the longest operation time sets the pace for all stations:

$$MLT = n_o(\text{Max } T_o + T_r) + T_{no} = n_o T_c + T_{no} \quad (3.22)$$

where MLT = time between start and completion of a given work unit on the line, min; n_o = number of operations on the line; T_r = transfer time, min; $\text{Max } T_o$ = operation time at the bottleneck station, min; and T_c = cycle time of the production line, min/pc, $T_c = \text{Max } T_o + T_r$ from Equation (3.7). Because the number of stations on the line is equal to the number of operations ($n = n_o$), Equation (3.22) can also be stated as

$$MLT = n(\text{Max } T_o + T_r) + T_{no} = n T_c + T_{no} \quad (3.23)$$

where the symbols have the same meaning as above, and n (number of workstations) has been substituted for number of operations n_o .

Work-in-Process. A plant's work-in-process (WIP , also known as *work-in-progress*) is the quantity of parts or products currently located in the factory that either are being processed or are between processing operations. WIP is inventory that is in the state of being transformed from raw material to finished part or product. An approximate measure of work-in-process can be obtained from the following formula, based on Little's formula,² using terms previously defined:

$$WIP = R_{pph}(MLT) \quad (3.24)$$

where WIP = work-in-process in the plant, pc; R_{pph} = hourly plant production rate, pc/hr, from Equation (3.13); and MLT = average manufacturing lead time, hr. Equation (3.24) states that the level of WIP equals the rate at which parts flow through the factory multiplied by the length of time the parts spend in the factory. Effects of part queues, equipment availability, and other delays are accounted for in the nonoperation time, which is a component of MLT .

Work-in-process represents an investment by the firm, but one that cannot be turned into revenue until all processing has been completed. Many manufacturing companies sustain major costs because work remains in-process in the factory too long.

²This is an equation in queuing theory developed by John D. C. Little that is usually stated as $L = \lambda W$, where L = the expected number of units in the system, λ = processing rate of units in the system, and W = expected time that a unit spends in the system. In Equation (3.24), L becomes WIP , λ becomes R_{pph} , and W becomes MLT . Little's formula assumes that the system being modeled is operating under steady-state conditions.

EXAMPLE 3.4 Work-In-Process

Assume that the part style in Example 3.3 is representative of other parts produced in the factory. Average batch quantity = 100 units, average setup time = 3.0 hr per batch, number of operations per batch = 5, and average operation time is 6.0 min per piece for the population of parts made in the plant. Nonoperation time = 7.5 hr. The plant has 20 production machines that are 100% utilized (setup and run time), and it operates 40 hr/wk. Determine (a) weekly plant production rate and (b) work-in-process for the plant.

Solution: (a) Production rate for the average part can be determined from Equations (3.4) and (3.5):

$$T_p = \frac{3.0(60) + 100(6.0)}{100} = 7.8 \text{ min}$$

Average hourly production rate $R_p = 60/7.8 = 7.69$ pc/hr for each machine. Weekly production rate for the plant can be determined by using this average value of production rate per machine and adapting Equation (3.13) as follows:

$$R_{pph} = n \left(\frac{R_p}{n_o} \right) = 20 \left(\frac{7.69}{5} \right) = 30.77 \text{ pc/hr}$$

$$R_{ppw} = 40(30.77) = \mathbf{1,231 \text{ pc/wk}}$$

(b) Given $U = 100\% = 1.0$, $WIP = R_{pph}(MLT) = 30.77(102.5) = \mathbf{3,154 \text{ pc}}$

Comment: Three observations cry out for attention in this example and the previous one. (1) In part (a), given that the equipment is 100% utilized, the calculated weekly production rate of 1,230 pc/wk must be the plant capacity. Unless the 40 hr of plant operation is increased, the plant cannot produce any more parts than it is currently producing. (2) In part (b), with 20 machines each processing one part at a time, it means that $3,154 - 20 = 3,134$ parts are in a nonoperation mode. At any given moment, 3,134 parts in the plant are waiting or being moved. (3) With five operations required for each part, each operation taking 6 min, the total operation time for each part is 30 min. From the previous example, the average total time each part spends in the plant is 102.5 hr or 6,150 min. Thus, each part spends $(6,150 - 30)/6,150 = 0.995$ or 99.5% of its time in the plant waiting or being moved. □

3.2 MANUFACTURING COSTS

Decisions on automation and production systems are usually based on the relative costs of alternatives. This section examines how these costs and cost factors are determined.

3.2.1 Fixed and Variable Costs

Manufacturing costs can be classified into two major categories: (1) fixed costs and (2) variable costs. A **fixed cost** is one that remains constant for any level of production output. Examples include the cost of the factory building and production equipment, insurance, and property taxes. All of the fixed costs can be expressed as annual amounts. Expenses such as insurance and property taxes occur naturally as annual costs. Capital investments such as building and equipment can be converted to their equivalent uniform annual costs using interest rate factors.

A **variable cost** is one that varies in proportion to production output. As output increases, variable cost increases. Examples include direct labor, raw materials, and electric power to operate the production equipment. The ideal concept of variable cost is that it is directly proportional to output level. Adding fixed and variable costs results in the following total cost equation:

$$TC = C_f + C_v Q \quad (3.25)$$

where TC = total annual cost, \$/yr; C_f = fixed annual cost, \$/yr; C_v = variable cost, \$/pc; and Q = annual quantity produced, pc/yr.

When comparing automated and manual production methods, it is typical that the fixed cost of the automated method is high relative to the manual method, and the variable cost of automation is low relative to the manual method, as pictured in Figure 3.3. Consequently, the manual method has a cost advantage in the low quantity range, while

EXAMPLE 3.5 Manual versus Automated Production

Two production methods are being compared, one manual and the other automated. The manual method produces 10 pc/hr and requires one worker at \$15.00/hr. Fixed cost of the manual method is \$5,000/yr. The automated method produces 25 pc/hr, has a fixed cost of \$55,000/yr, and a variable cost of \$4.50/hr. Determine the break-even point for the two methods; that is, determine the annual production quantity at which the two methods have the same annual cost. Ignore the costs of materials used in the two methods.

Solution: The variable cost of the manual method is $C_v = (\$15.00/\text{hr}) / (10 \text{ pc/hr}) = \$1.50/\text{pc}$

Annual cost of the manual method is $TC_m = 5,000 + 1.50Q$

The variable cost of the automated method is $C_v = (\$4.50/\text{hr}) / (25 \text{ pc/hr}) = \$0.18/\text{pc}$

Annual cost of the automated method is $TC_a = 55,000 + 0.18Q$

At the break-even point $TC_m = TC_a$:

$$5,000 + 1.50Q = 55,000 + 0.18Q$$

$$1.50Q - 0.18Q = 1.32Q = 55,000 - 5,000 = 50,000$$

$$1.32Q = 50,000Q = 50,000/1.32 = \mathbf{37,879 \text{ pc}}$$

Comment: It is of interest to note that the manual method operating one shift (8 hr), 250 days per year would produce $8(250)(10) = 20,000$ pc/yr, which is less than the break-even quantity of 37,879 pc. On the other hand, the automated method, operating under the same conditions, would produce $8(250)(25) = 50,000$ pc, well above the break-even point.

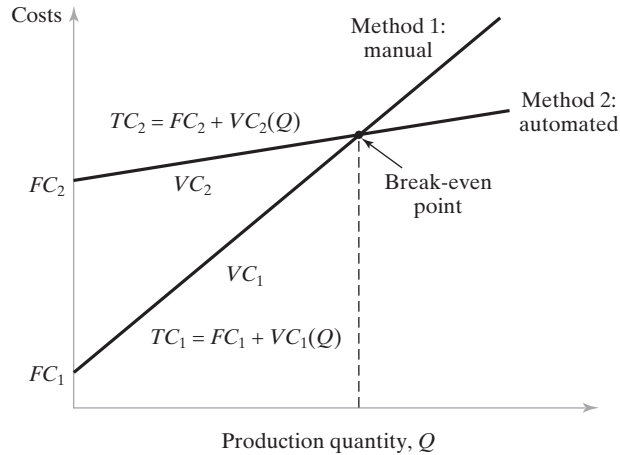


Figure 3.3 Fixed and variable costs as a function of production output for manual and automated production methods.

automation has an advantage for high quantities. This reinforces the arguments presented in Section 1.3.1 on the appropriateness of manual labor for certain production situations.

3.2.2 Direct Labor, Material, and Overhead

Fixed versus variable are not the only possible classifications of costs in manufacturing. An alternative classification separates costs into (1) direct labor, (2) material, and (3) overhead. This is often a more convenient way to analyze costs in production. **Direct labor cost** is the sum of the wages and benefits paid to the workers who operate the production equipment and perform the processing and assembly tasks. **Material cost** is the cost of all raw materials used to make the product. In the case of a stamping plant, the raw material consists of the sheet stock used to make stampings. For the rolling mill that made the sheet stock, the raw material is the starting slab of metal out of which the sheet is rolled. In the case of an assembled product, materials are the component parts, some of which are produced by supplier firms. Thus, the definition of “raw material” depends on the company and the type of production operations in which it is engaged. The final product of one company can be the raw material for another company. In terms of fixed and variable costs, direct labor and material must be considered as variable costs.

Overhead costs are all of the other expenses associated with running the manufacturing firm. Overhead divides into two categories: (1) factory overhead and (2) corporate overhead. **Factory overhead** consists of the costs of operating the factory other than direct labor and materials, such as the factory expenses listed in Table 3.2. Factory overhead is treated as fixed cost, although some of the items in the list could be correlated

TABLE 3.2 Typical Factory Overhead Expenses

Plant supervision	Applicable taxes	Factory depreciation
Line foreman	Insurance	Equipment depreciation
Maintenance crew	Heat and air conditioning	Fringe benefits
Custodial services	Light	Material handling
Security personnel	Power for machinery	Shipping and receiving
Tool crib attendant	Payroll services	Clerical support

TABLE 3.3 Typical Corporate Overhead Expenses


Corporate executives	Engineering	Applicable taxes
Sales and marketing	Research and development	Office space
Accounting department	Other support personnel	Security personnel
Finance department	Insurance	Heat and air conditioning
Legal counsel	Fringe benefits	Lighting

with the output level of the plant. **Corporate overhead** is the cost not related to the company's manufacturing activities, such as the corporate expenses in Table 3.3. Many companies operate more than one factory, and this is one of the reasons for dividing overhead into factory and corporate categories. Different factories may have significantly different factory overhead expenses.

J Black [1] provides some typical percentages for the different types of manufacturing and corporate expenses. These are presented in Figure 3.4. Several observations can be made about these data. First, total manufacturing cost represents only about 40% of the product's selling price. Corporate overhead expenses and total manufacturing cost are about equal. Second, materials (including purchased parts) make up the largest percentage of total manufacturing cost, at around 50%. And third, direct labor is a relatively small proportion of total manufacturing cost: 12% of manufacturing cost and only about 5% of final selling price.

Overhead costs can be allocated according to a number of different bases, including direct labor cost, material cost, direct labor hours, and space. Most common in industry is direct labor cost, which will be used here to illustrate how overheads are allocated and subsequently used to compute factors such as selling price of the product.

The allocation procedure (simplified) is as follows. For the most recent year (or several recent years), all costs are compiled and classified into four categories: (1) direct labor, (2) material, (3) factory overhead, and (4) corporate overhead. The objective is to determine an **overhead rate** that can be used in the following year to allocate overhead costs to a process or product as a function of the direct labor costs associated with that process or product. Separate overhead rates will be developed for factory and corporate overheads. The **factory overhead rate** is calculated as the

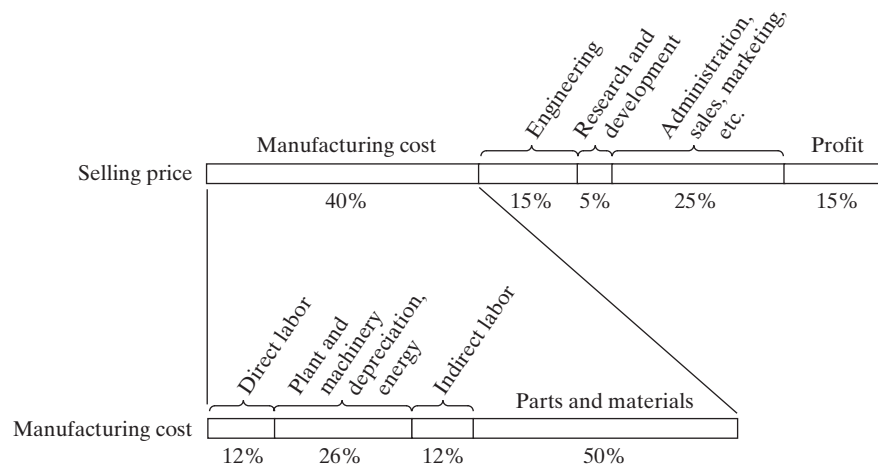**Figure 3.4** Breakdown of costs for a manufactured product [1].

ratio of factory overhead expenses (category 3) to direct labor expenses (category 1); that is,

$$FOHR = \frac{FOHC}{DLC} \quad (3.26)$$

where $FOHR$ = factory overhead rate, $FOHC$ = annual factory overhead costs, \$/yr; and DLC = annual direct labor costs, \$/yr.

The **corporate overhead rate** is the ratio of corporate overhead expenses (category 4) to direct labor expenses:

$$COHR = \frac{COHC}{DLC} \quad (3.27)$$

where $COHR$ = corporate overhead rate, $COHC$ = annual corporate overhead costs, \$/yr; and DLC = annual direct labor costs, \$/yr. Both rates are often expressed as percentages. If material cost were used as the allocation basis, then material cost would be used as the denominator in both ratios. The following two examples are presented to illustrate (1) how overhead rates are determined and (2) how they are used to estimate manufacturing cost and establish selling price.

EXAMPLE 3.6 Determining Overhead Rates

Suppose that all costs have been compiled for a certain manufacturing firm for last year. The summary is shown in the table below. The company operates two different manufacturing plants plus a corporate headquarters. Determine (a) the factory overhead rate for each plant, and (b) the corporate overhead rate. These rates will be used by the firm to predict the following year's expenses.

Expense Category	Plant 1 (\$)	Plant 2 (\$)	Headquarters (\$)	Totals (\$)
Direct labor	800,000	400,000		1,200,000
Materials	2,500,000	1,500,000		4,000,000
Factory expense	2,000,000	1,100,000		3,100,000
Corporate expense			7,200,000	7,200,000
Totals	5,300,000	3,000,000	7,200,000	15,500,000

Solution: (a) A separate factory overhead rate must be determined for each plant. For plant 1,

$$FOHR_1 = \frac{\$2,000,000}{\$800,000} = 2.5 = \mathbf{250\%}$$

For plant 2,

$$FOHR_2 = \frac{\$1,100,000}{\$400,000} = 2.75 = \mathbf{275\%}$$

(b) The corporate overhead rate is based on the total labor cost at both plants.

$$COHR = \frac{\$7,200,000}{\$1,200,000} = 6.0 = \mathbf{600\%}$$

EXAMPLE 3.7 Estimating Manufacturing Costs and Establishing Selling Price

A customer order of 50 parts is to be processed through plant 1 of the previous example. Raw materials and tooling are supplied by the customer. The total time for processing the parts (including setup and other direct labor) is 100 hr. Direct labor cost is \$15.00/hr. The factory overhead rate is 250% and the corporate overhead rate is 600%. (a) Compute the cost of the job. (b) What price should be quoted to the customer if the company uses a 10% markup?

Solution: (a) The direct labor cost for the job is $(100 \text{ hr})(\$15.00/\text{hr}) = \$1,500$. The allocated factory overhead charge, at 250% of direct labor, is $(\$1,500)(2.50) = \$3,750$. The total factory cost of the job, including allocated factory overhead = $\$1,500 + \$3,750 = \$5,250$. The allocated corporate overhead charge, at 600% of direct labor, is $(\$1,500)(6.00) = \$9,000$. The total cost of the job including corporate overhead = $\$5,250 + \$9,000 = \mathbf{\$14,250}$

(b) If the company uses a 10% markup, the price quoted to the customer would be $(1.10)(\$14,250) = \mathbf{\$15,675}$

3.2.3 Cost of Equipment Usage

The trouble with overhead rates as they have been developed here is that they are based on labor cost alone. A machine operator who runs an old, small engine lathe whose book value is zero will be costed at the same overhead rate as an operator running a new automated lathe just purchased for \$500,000. Obviously, the time on the machining center is more productive and should be valued at a higher rate. If differences in rates of different production machines are not recognized, manufacturing costs will not be accurately measured by the overhead rate structure.

To deal with this difficulty, it is appropriate to divide the cost of a worker running a machine into two components: (1) direct labor cost and (2) machine cost. Associated with each is an applicable overhead rate. These overhead costs apply not to the entire factory operations, but to individual machines.

The direct labor cost consists of the wages and benefits paid to operate the machine. Applicable factory overhead expenses allocated to direct labor cost might include taxes paid by the employer, certain fringe benefits, and line supervision. The machine annual cost is the initial cost of the machine apportioned over the life of the asset at the appropriate rate of return used by the firm. This is done using the capital recovery factor, as

$$UAC = IC(A/P, i, N) \quad (3.28)$$

where UAC = equivalent uniform annual cost, \$/yr; IC = initial cost of the machine, \$; and $(A/P, i, N)$ = capital recovery factor that converts initial cost at year 0 into a series of equivalent uniform annual year-end values, where i = annual interest rate and N = number of years in the service life of the equipment. For given values of i and N , $(A/P, i, N)$ can be computed as follows:

$$(A/P, i, N) = \frac{i(1+i)^N}{(1+i)^N - 1} \quad (3.29)$$

Values of $(A/P, i, N)$ can also be found in interest tables that are widely available.

The uniform annual cost can be expressed as an hourly rate by dividing the annual cost by the number of annual hours of equipment use. The machine overhead rate is based on those factory expenses that are directly assignable to the machine. These include power to drive the machine, floor space, maintenance and repair expenses, and so on. In separating the factory overhead items in Table 3.2 between labor and machine, judgment must be used; admittedly, the judgment is sometimes arbitrary. The total cost rate for the machine is the sum of labor and machine costs. This can be summarized for a machine consisting of one worker and one machine as follows:

$$C_o = C_L(1 + FOHR_L) + C_m(1 + FOHR_m) \quad (3.30)$$

where C_o = hourly rate to operate the machine, \$/hr; C_L = direct labor wage rate, \$/hr; $FOHR_L$ = factory overhead rate for labor; C_m = machine hourly rate, \$/hr; and $FOHR_m$ = factory overhead rate applicable to the machine.

It is the author's opinion that corporate overhead expenses should not be included in the analysis when comparing production methods. Including them serves no purpose other than to dramatically inflate the costs of the alternatives. The fact is that these corporate overhead expenses are present whether or not any of the alternatives is selected. On the other hand, when analyzing costs for pricing decisions, corporate overhead must be included because over the long run, these costs must be recovered through revenues generated from selling products.

EXAMPLE 3.8 Hourly Cost of a Machine

The following data are given for a production machine consisting of one worker and one piece of equipment: direct labor rate = \$15.00/hr, applicable factory overhead rate on labor = 60%, capital investment in machine = \$100,000, service life of the machine = 4 yr, rate of return = 10%, salvage value in 4 yr = 0, and applicable factory overhead rate on machine = 50%. The machine will be operated one 8-hr shift, 250 day/yr. Determine the appropriate hourly rate for the machine.

Solution: Labor cost per hour = $C_L(1 + FOHR_L) = \$15.00(1 + 0.60) = \$24.00/\text{hr}$. The investment cost of the machine must be annualized, using a 4-yr service life and a rate of return = 10%. First, compute the capital recovery factor:

$$(A/P, 10\%, 4) = \frac{0.10(1 + 0.10)^4}{(1 + 0.10)^4 - 1} = 0.3155$$

Now the uniform annual cost for the \$100,000 initial cost can be determined:

$$UAC = \$100,000(A/P, 10\%, 4) = 100,000(0.3155) = \$31,550/\text{yr}$$

The number of hours per year = (8 hr/day)(250 day/yr) = 2,000 hr/yr. Dividing this into UAC gives $31,550/2,000 = \$15.77/\text{hr}$. Applying the factory overhead rate,

$$C_m(1 + FOHR_m) = \$15.77(1 + 0.50) = 23.66/\text{hr}$$

Total cost rate for the machine is

$$C_o = 24.00 + 23.66 = \mathbf{\$47.66/\text{hr}}$$

3.2.4 Cost of a Manufactured Part

The unit cost of a manufactured part or product is the sum of the production cost, material cost, and tooling cost. As indicated in Example 3.7, overhead costs and profit markup must be added to the unit cost to arrive at a selling price for the product. The unit production cost for each unit operation in the sequence of operations to produce the part or product is given by:

$$C_{oi}T_{pi} + C_{ti}$$

where C_{oi} = cost rate to perform unit operation i , \$/min, defined by Equation (3.30); T_{pi} = production time of operation i , min/pc, as defined by the equations in Section 3.1.1; and C_{ti} = cost of any tooling used in operation i , \$/pc. It should be noted that the cost of tooling is in addition to any tool handling time defined in Equation (3.1), which is included in the value of T_p . Tooling cost is a material cost, whereas tool handling is a time cost at the cost rate of the machine, C_{oi} .

The total unit cost of the part is the sum of the costs of all unit operations plus the cost of raw materials. Summarizing,

$$C_{pc} = C_m + \sum_{i=1}^{n_o} (C_{oi}T_{pi} + C_{ti}) \quad (3.31)$$

where C_{pc} = cost per piece, \$/pc; C_m = cost of starting material, \$/pc; and the summation includes all of the costs of the n_o unit operations in the sequence.

EXAMPLE 3.9 Unit Cost of a Manufactured Part

The machine in Example 3.8 is the first of two machines used to produce a certain part. The starting material cost of the part is \$8.50/pc. As determined in the previous example, the cost rate to operate the first machine is \$47.66/hr, or \$0.794/min. The production time on the first machine is 4.20 min/pc, and there is no tooling cost. The cost rate of the second machine in the process sequence is \$35.80/hr, or \$0.597/min. The production time on the second machine is 2.75 min/pc, and the tooling cost is \$0.20/pc. Determine the unit part cost.

Solution: Using Equation (3.31), the part cost is calculated as follows:

$$C_{pc} = 8.50 + 0.794(4.20) + 0.597(2.75) + 0.20 = \mathbf{\$13.68/pc}$$

REFERENCES

- [1] BLACK, J. T., *The Design of the Factory with a Future*, McGraw-Hill, Inc., New York, NY, 1991.
- [2] BLANK, L. T., and A. J. TARQUIN, *Engineering Economy*, 7th ed., McGraw-Hill, New York, 2011.
- [3] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [4] GROOVER, M. P., *Work Systems and the Methods, Measurement, and Management of Work*, Pearson Prentice Hall, Upper Saddle River, NJ, 2007.

REVIEW QUESTIONS

- 3.1 What is the cycle time in a manufacturing operation?
- 3.2 What is a bottleneck station?
- 3.3 What is production capacity?
- 3.4 How can plant capacity be increased or decreased in the short term?
- 3.5 How can plant capacity be increased or decreased in the intermediate or long term?
- 3.6 What is utilization in a manufacturing plant? Provide a definition.
- 3.7 What is availability and how is it defined?
- 3.8 What is manufacturing lead time?
- 3.9 What is work-in-process?
- 3.10 How are fixed costs distinguished from variable costs in manufacturing?
- 3.11 Name five typical factory overhead expenses.
- 3.12 Name five typical corporate overhead expenses.
- 3.13 Why should factory overhead expenses be separated from corporate overhead expenses?
- 3.14 What is the capital recovery factor in cost analysis?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Cycle Time and Production Rate

- 3.1 **(A)** A batch of parts is produced on a semiautomated production machine. Batch size is 200 units. Setup requires 55 min. A worker loads and unloads the machine each cycle, which takes 0.44 min. Machine processing time is 2.86 min/cycle, and tool handling time is negligible. One part is produced each cycle. Determine (a) average cycle time, (b) time to complete the batch, and (c) average production rate.
- 3.2 In a batch machining operation, setup time is 1.5 hr and batch size is 80 units. The cycle time consists of part handling time of 30 sec and processing time of 1.37 min. One part is produced each cycle. Tool changes must be performed every 10 parts and this takes 2.0 min. Determine (a) average cycle time, (b) time to complete the batch, and (c) average production rate.
- 3.3 A batch production operation has a machine setup time of 3.0 hr and a processing time of 1.60 min per cycle. Two parts are produced each cycle. No tool handling time is included in the cycle. Part handling time each cycle is 45 sec. It consists of the worker obtaining two starting work units from a parts tray, loading them into the machine, and then after processing, unloading the completed units and placing them into the same tray. Each tray holds 24 work units. When all of the starting work units have been replaced with completed units, the tray of completed parts is moved aside and a new tray of starting parts is moved into position at the machine. This irregular work element takes 3.0 min. Batch quantity is 2,400 units. Determine (a) average cycle time, (b) time to complete the batch, and (c) average production rate.
- 3.4 A flow-line mass production operation consists of eight manual workstations. Work units are moved synchronously and automatically between stations, with a transfer time of 15 sec. The manual processing operations performed at the eight stations take 40 sec, 52 sec, 43 sec, 48 sec, 30 sec, 57 sec, 53 sec, and 49 sec, respectively. Determine (a) cycle time

for the line, (b) time to process one work unit through the eight workstations, (c) average production rate, and (d) time to produce 10,000 units.

- 3.5 Average setup time on a certain production machine is 4.0 hr. Average batch size is 48 parts, and average operation cycle time is 4.2 min. The reliability of this machine is characterized by mean time between failures of 37 hr and a mean time to repair of 55 min. (a) If availability is ignored, what is the average hourly production rate of the machine. (b) Taking into account the availability of the machine, determine its average hourly production rate. (c) Suppose that availability only applied during the actual run time of the machine and not the setup time. Determine the average hourly production rate of the machine under this scenario.

Plant Capacity and Utilization

- 3.6 (A) A mass-production plant has six machines and currently operates one 8-hr shift per day, 5 days per week, 50 weeks per year. The six machines produce the same part each at a rate of 12 pc/hr. (a) Determine the annual production capacity of this plant. (b) If the plant were to operate three 8-hr shifts per day, 7 days per week, 52 weeks per year, determine the annual percentage increase in plant capacity?
- 3.7 One million units of a certain product are to be manufactured annually on dedicated production machines that run 16 hr per day, 5 days per week, 50 weeks per year. (a) If the cycle time of a machine to produce one part is 1.2 min, how many of the dedicated machines will be required to keep up with demand? Assume that availability and utilization are 100%, and that setup time can be neglected. (b) Solve part (a) except that availability = 90%.
- 3.8 A job shop has four machines and operates 40 hr/wk. During the most recent week, machine 1 processed part A for 25 hr at a production rate of 10 pc/hr, and part B for 12 hr at a rate of 7 pc/hr. Machine 2 processed part C for 37 hr at a rate of 14 pc/hr, and was idle 3 hr. Machine 3 processed part D for 15 hr at a rate of 20 pc/hr, and part E for 25 hr at a rate of 15 pc/hr. Machine 4 processed part F for 13 hr at a rate of 9 pc/hr, part G for 12 hr at a rate of 18 pc/hr, and was idle the rest of the week. Determine (a) weekly production output of the shop and (b) average utilization of equipment.
- 3.9 A batch production plant works 40 hr/wk and has three machines. In a typical week, five batches of parts are processed through these machines. Production rates (pc/hr), batch times, and operation sequences for the parts are given in the table below for one week. (a) Determine the weekly production rate for the shop. (b) Is this weekly production rate equal to the plant capacity? If not, determine what the output would be if all three machines could be operated up to 40 hr/wk, given the constraint that no reductions in weekly production rates are allowed for any part. Use of a spreadsheet calculator is recommended for this problem.

Part	Machine 1		Machine 2		Machine 3	
	R_{p1}	T_{b1} (hr)	R_{p2}	T_{b2} (hr)	R_{p3}	T_{b3} (hr)
A	10	15	15	10	18.75	8
B	15	14			10	21
C			8	21		
D	20	5	25	4		
E			16	5	10	8

- 3.10** There are 10 machines in the automatic lathe section of a certain machine shop. The setup time on an automatic lathe averages 5 hr. Average batch size for parts processed through the section is 100. Average operation time = 9.0 min. Under shop rules, an operator can be assigned to run one or two machines. Accordingly, there are five operators in the section for the 10 lathes. In addition to the lathe operators, there are two setup workers who perform only machine setups. These setup workers are busy the full shift. The section runs one 8-hr shift per day, 5 days per week. Scrap losses are negligible and availability = 100%. The production control manager claims that the capacity of the section should be 2,000 parts per week. However, the actual output averages only 1,600 units per week. What is the problem? Recommend a solution.

Manufacturing Lead Time and Work-In-Process

- 3.11 (A)** A certain batch of parts is routed through six machines in a batch production plant. The setup and operation times for each machine are given in the table below. Batch size is 100 and the average nonoperation time per machine is 12 hr. Determine (a) manufacturing lead time and (b) hourly production rate for operation 3.

Machine	1	2	3	4	5	6
Setup time (hr)	4	2	8	3	3	4
Operation time (min)	5.0	3.5	6.2	1.9	4.1	2.5

- 3.12** Suppose the part in the previous problem is made in very large quantities on a production line in which an automated work handling system is used to transfer parts between machines. Transfer time between stations is 15 sec. Total time required to set up the entire line is 150 hr. Assume that the operation times at the individual machines remain the same as in the previous problem. Determine (a) manufacturing lead time for a part coming off the line, (b) production rate for operation 3, (c) theoretical production rate for the entire production line. (d) How long would it take to produce 10,000 parts after the setup has been completed?
- 3.13** A batch production plant processes an average of 35 batches of parts per week. Five of those part styles have been selected as a sample for analysis to assess the production performance of the plant. The five parts are considered to be representative of the population of parts processed by the plant. Any machine in the plant can be set up for any type of batch processed in the plant. Batch quantities, numbers of operations in the processing sequence, setup times, and cycle times for the parts are listed in the table below. The average nonoperation time per batch per operation is 11.5 hr. The plant operates 40 hr/wk. Use this sample to determine the following measures of plant performance: (a) manufacturing lead time for an average part, (b) plant capacity if all machines could be operated at 100% utilization, and (c) work-in-process (number of parts-in-process). Use of a spreadsheet calculator is recommended for this problem.

Part j	Q_j	n_{oj}	T_{suj} (hr)	T_{cij} (min)	T_{no} (hr)
A	100	6	5.0	9.3	11.5
B	240	3	3.8	8.4	11.5
C	85	4	4.0	12.0	11.5
D	250	8	6.1	5.7	11.5
E	140	7	3.5	3.2	11.5

- 3.14** The table below presents production data for three batches of parts processed through a batch production plant. Production rates (R_p) are given in parts per hour. Utilization fractions (f) are the fractions of time during the 40-hr week that the machine is devoted to the production of these parts. The parts do not proceed through the machines in the same order. Determine (a) weekly production rate, (b) workload, and (c) average utilization of this set of equipment. A spreadsheet calculator is recommended for this problem.

	Machine 1		Machine 2		Machine 3		Machine 4	
Part	R_{p1}	f_1	R_{p2}	f_2	R_{p3}	f_3	R_{p4}	f_4
A	15	0.3	22.5	0.2	30	0.15	7.5	0.6
B	10	0.5	12.5	0.4	8	0.625		
C	30	0.2	15	0.4			20	0.3

- 3.15** The table below shows production data for five batches of parts processed through a batch production plant. Setup times (T_{su}) are given in hours. Operation cycle times (T_c) are given in min per cycle. Utilization fractions (f) are the fractions of time during the 40-hr week that the machine is devoted to the production of these parts. The parts do not proceed through the machines in the same order. Determine (a) weekly production rate, (b) workload, and (c) average utilization of this set of equipment. A spreadsheet calculator is recommended for this problem.

	Machine 1			Machine 2			Machine 3		
Part	T_{su}	T_c	f	T_{su}	T_c	f	T_{su}	T_c	f
A	2.50	1.50	0.125	2.25	2.01	0.140	5.00	1.56	0.190
B	3.00	0.78	0.140	2.90	1.53	0.200	1.25	2.39	0.230
C	1.50	1.50	0.150	1.80	4.00	0.345	2.30	1.50	0.170
D	4.00	7.20	0.250	1.75	5.10	0.150	1.60	2.88	0.100
E	2.00	3.20	0.150	2.55	1.80	0.120	2.55	1.80	0.120

- 3.16** The average part produced in a certain batch manufacturing plant must be processed sequentially through an average of eight operations. Twenty new batches of parts are launched each week. Average operation time is 6 min, average setup time is 5 hr, average batch size is 25 parts, and average nonoperation time per batch is 10 hr per machine. There are 18 machines in the plant. Any machine can be set up for any type of batch processed in the plant. The plant operates 75 production hr/wk. Determine (a) manufacturing lead time for an average part, (b) plant capacity if all machines could be operated at 100% utilization, (c) plant utilization, and (d) work-in-process (number of parts-in-process). (e) How would you expect the nonoperation time to be affected by plant utilization?
- 3.17** On average, 16 new batches of parts are started through a certain plant each week. Average batch quantity is 50 parts that are processed through a sequence of seven machines. Setup time per machine per batch averages 4 hr, and average operation time per machine for each part is 12 min. Nonoperation time per batch at each machine averages 8 hr. There are 37 machines in the factory. Any machine can be set up for any type of batch processed in the plant. The plant operates 40 hr/wk. The plant manager complains that almost 65 hr of overtime must be authorized each week to keep up with the production schedule. Determine (a) manufacturing lead time for an average order, (b) weekly production capacity of the plant if all machines were operated at 100% utilization, (c) current utilization of

the plant, and (d) average work-in-process (number of parts) in the plant. (e) Why must overtime be authorized to achieve the desired output?

- 3.18** A certain job shop specializes in one-of-a-kind orders dealing with parts of medium-to-high complexity. A typical part is processed sequentially through 10 machines in batch sizes of 1. The shop contains a total of eight conventional machine tools and operates 40 hr/wk of production time. Average time values on each part per machine are: machining time = 0.5 hr, work handling time = 0.3 hr, tool change time = 0.2 hr, setup time = 3 hr, and non-operation time = 12 hr. A new programmable machine is being considered that can perform all 10 operations in a single setup. The programming of the machine for this part will require 20 hr; however, the programming can be done off-line, without tying up the machine. Setup time will be just 2 hr because simpler fixtures will be used. Total machining time will be reduced to 80% of its previous value due to advanced tool control algorithms; work handling time will be the same as for one machine; and total tool change time will be reduced by 50% because tools will be changed automatically under program control. For the one machine, nonoperation time is expected to be 12 hr, same as for each conventional machine. (a) Determine the manufacturing lead time for the conventional machines and for the new programmable machine. (b) Compute the plant capacity for the following alternatives: (i) a job shop containing the eight traditional machines, and (ii) a job shop containing two of the new programmable machines. Assume the typical jobs are represented by the data given above. (c) Determine the average level of work-in-process for the two alternatives in part (b), if the alternative shops operate at full capacity.
- 3.19** A factory produces cardboard boxes. The production sequence consists of three operations: (1) cutting, (2) indenting, and (3) printing. There are three machines in the factory, one for each operation. The machines are 100% reliable and operate as follows when operating at 100% utilization: (1) In cutting, large rolls of cardboard are fed into the cutting machine and cut into blanks. Each large roll contains enough material for 4,000 blanks. Production cycle time = 0.03 min per blank during a production run, but it takes 35 min to change rolls between runs. (2) In indenting, indentation lines are pressed into the blanks to allow the blanks to later be bent into boxes. The blanks from the previous cutting operation are divided and consolidated into batches whose starting quantity = 2,000 blanks. Indenting is performed at 4.5 min per 100 blanks. Time to change dies on the indentation machine = 30 min. (3) In printing, the indented blanks are printed with labels for a particular customer. The blanks from the previous indenting operation are divided and consolidated into batches whose starting quantity = 1,000 blanks. Printing cycle rate = 30 blanks per min. Between batches, changeover of the printing plates is required, which takes 20 min. In-process inventory is allowed to build up between machines 1 and 2, and between machines 2 and 3, so that the machines can operate independently as much as possible. Determine the maximum possible output of this factory during a 40-hr week, in completed blanks per week (completed blanks have been cut, indented, and printed)? Assume steady-state operation, not startup.

Manufacturing Costs

- 3.20 (A)** The break-even point is to be determined for two production methods, one manual and the other automated. The manual method requires two workers at \$16.50/hr each. Together, their production rate is 30 units per hour. The automated method has an initial cost of \$125,000, a 4-year service life, no salvage value, and annual maintenance costs = \$3,000. No labor (except for maintenance) is required for the machine, but the power to operate it is 50 kW (when running). Cost of electric power is \$0.05 per kWh. The production rate for the automated machine is 55 units per hour. (a) Determine the break-even point for the two methods, using a rate of return = 25%. (b) How many hours of operation per year would be required for each method to reach the break-even point?

- 3.21** Theoretically, any given production plant has an optimum output level. Suppose a certain production plant has annual fixed costs = \$2,000,000. Variable cost is functionally related to annual output Q in a manner that can be described by the function $C_v = \$12 + \$0.005Q$. Total annual cost is given by $TC = C_f + C_vQ$. The unit sales price for one production unit $P = \$250$. (a) Determine the value of Q that minimizes unit cost UC , where $UC = TC/Q$; and compute the annual profit earned by the plant at this quantity. (b) Determine the value of Q that maximizes the annual profit earned by the plant; and compute the annual profit earned by the plant at this quantity.
- 3.22** Costs have been compiled for a certain manufacturing company for the most recent year. The summary is shown in the table below. The company operates two different manufacturing plants, plus a corporate headquarters. Determine (a) the factory overhead rate for each plant, and (b) the corporate overhead rate. The firm will use these rates in the following year.

Expense Category	Plant 1	Plant 2	Corporate Headquarters
Direct labor	\$1,000,000	\$1,750,000	
Materials	\$3,500,000	\$4,000,000	
Factory expense	\$1,300,000	\$2,300,000	
Corporate expense			\$5,000,000

- 3.23 (A)** The hourly rate for a certain work center is to be determined based on the following data: direct labor rate = \$15.00/hr; applicable factory overhead rate on labor = 35%; capital investment in machine = \$200,000; service life of the machine = 5 years; rate of return = 15%; salvage value in 5 years = zero; and the applicable factory overhead rate on the machine = 40%. The work center will be operated two 8-hr shifts, 250 days per year. (a) Determine the appropriate hourly rate for the work center. (b) If the workload for the cell can only justify a one shift operation, determine the appropriate hourly rate for the work center.
- 3.24** In the operation of a certain production machine, one worker is required at a direct labor rate = \$10/hr. Applicable labor factory overhead rate = 50%. Capital investment in the machine = \$250,000, expected service life = 10 years, with no salvage value at the end of that period. Applicable machine factory overhead rate = 30%. The work cell will operate 2,000 hr/yr. Rate of return is 25%. (a) Determine the appropriate hourly rate for this work cell. (b) Suppose that the machine were operated three shifts, or 6,000 hr/yr, instead of 2,000 hr/yr. Determine the effect of increased machine utilization on the hourly rate compared to the rate determined in (a).
- 3.25** A customer has requested a quotation for a machining job consisting of 80 parts. The starting work part is a casting that will cost \$17.00 per casting. The average production time of the job is 13.80 min on an automatic machine whose equipment cost rate is \$66.00/hr. This rate does not include any overhead costs. Tooling cost is \$0.35 per part. The factory overhead rate is 128% and the corporate overhead rate is 230%. These rates are applied only to time and tooling costs, not starting material costs. The company uses a 15% markup on total cost for its price quotes. What is the quoted price for this job?
- 3.26** A part is processed through six operations in a batch production plant. Cost of the starting material for each unit is \$5.85. Batch quantity = 40 parts. The following table presents time and cost data for the six operations: T_{su} = setup time, T_h = part handling time, T_o = operation processing time, T_t = tool handling time where applicable, T_{no} = nonoperation time, C_o = operating cost of the work center, and C_t = tool costs

where applicable. Determine the total production cost for this part. A spreadsheet calculator is recommended for this problem.

Operation	T_{su} (hr)	T_h (min/pc)	T_o (min/pc)	T_t (min/pc)	T_{no} (hr)	C_o (\$/hr)	C_t (\$/pc)
1	2.5	0.25	1.25	0	10	32.88	0
2	1.3	0.22	2.50	0.25	10	65.50	0.22
3	4.1	0.30	1.75	0	10	48.25	0
4	1.7	0.25	0.85	0.10	10	72.15	0.16
5	1.4	0.18	1.67	0	10	45.50	0
6	0.8	0.33	0.95	0.15	10	29.75	0.18

APPENDIX 3A: AVERAGING FORMULAS FOR EQUATION (3.20)

The following formulas are used for computing Q , n_o , T_{su} , T_c , and T_{no} in Equation (3.20).

Average Batch Size

$$Q = \frac{\sum_{j=1}^{n_b} Q_j}{n_b} \quad (3A.1)$$

where Q = average batch size, pc; Q_j = batch size for product j , pc; and n_b = the number of batches (parts or products) over which the averaging procedure is carried out.

Average Number of Sequential Operations per Batch

$$n_o = \frac{\sum_{j=1}^{n_b} n_{oj}}{n_b} \quad (3A.2)$$

where n_o = average number of sequential operations per batch; n_{oj} = number of operations for part or product j ; and the other terms are defined earlier.

Average Setup Time

$$T_{su} = \frac{\sum_{j=1}^{n_b} \sum_{i=1}^{n_{oj}} T_{suij}}{n_b n_o} \quad (3A.3)$$

where T_{su} = average setup time, min; T_{suij} = setup time for operation i and product j , min; and the other terms are defined earlier.

Average Cycle Time

$$T_c = \frac{\sum_{j=1}^{n_b} \sum_{i=1}^{n_{oj}} Q_{ij} T_{cij}}{Q n_b n_o} \quad (3A.4)$$

where T_c = average cycle time, min; T_{cij} = cycle time for operation i and product j , min; and the other terms are defined earlier.

Average Nonoperation Time

$$T_{no} = \frac{\sum_{j=1}^{n_b} \sum_{i=1}^{n_{oj}} T_{noij}}{n_b n_o} \quad (3A.5)$$

where T_{no} = average nonoperation time, min; T_{noij} = nonoperation time for operation i and product j , min; and the other terms are defined earlier.

Introduction to Automation

CHAPTER CONTENTS

- 4.1 Basic Elements of an Automated System
 - 4.1.1 Power to Accomplish the Automated Process
 - 4.1.2 Program of Instructions
 - 4.1.3 Control System
- 4.2 Advanced Automation Functions
 - 4.2.1 Safety Monitoring
 - 4.2.2 Maintenance and Repair Diagnostics
 - 4.2.3 Error Detection and Recovery
- 4.3 Levels of Automation

Automation can be defined as the technology by which a process or procedure is accomplished without human assistance. It is implemented using a program of instructions combined with a control system that executes the instructions. To automate a process, power is required, both to drive the process itself and to operate the program and control system. Although automation is applied in a wide variety of areas, it is most closely associated with the manufacturing industries. It was in the context of manufacturing that the term was originally coined by an engineering manager at Ford Motor Company in 1946 to describe the variety of automatic transfer devices and feed mechanisms that had been installed in Ford's production plants (Historical Note 4.1). It is ironic that nearly all modern applications of automation are controlled by computer technologies that were not available in 1946.

Historical Note 4.1 History of Automation

The history of automation can be traced to the development of basic mechanical devices, such as the wheel (circa 3200 B.C.), lever, winch (circa 600 B.C.), cam (circa 1000), screw (1405), and gear in ancient and medieval times. These basic devices were refined and used to construct the mechanisms in waterwheels, windmills (circa 650), and steam engines (1765). These machines generated the power to operate other machinery of various kinds, such as flour mills (circa 85 B.C.), weaving machines (flying shuttle, 1733), machine tools (boring mill, 1775), steamboats (1787), and railroad locomotives (1803). Power, and the capacity to generate it and transmit it to operate a process, is one of the three basic elements of an automated system.

After his first steam engine in 1765, James Watt and his partner, Matthew Boulton, made several improvements in the design. One of the improvements was the flying-ball governor (around 1785), which provided feedback to control the throttle of the engine. The governor consisted of a ball on the end of a hinged lever attached to the rotating shaft. The lever was connected to the throttle valve. As the speed of the rotating shaft increased, the ball was forced to move outward by centrifugal force; this in turn caused the lever to reduce the valve opening and slow the motor speed. As rotational speed decreased, the ball and lever relaxed, thus allowing the valve to open. The flying-ball governor was one of the first examples of feedback control—an important type of control system, which is the second basic element of an automated system.

The third basic element of an automated system is the program of instructions that directs the actions of the system or machine. One of the first examples of machine programming was the Jacquard loom, invented around 1800. This loom was a machine for weaving cloth from yarn. The program of instructions that determined the weaving pattern of the cloth consisted of a metal plate containing holes. The hole pattern in the plate directed the shuttle motions of the loom, which in turn determined the weaving pattern. Different hole patterns yielded different cloth patterns. Thus, the Jacquard loom was a programmable machine, one of the first of its kind.

By the early 1800s, the three basic elements of automated systems—power source, controls, and programmable machines—had been developed, although these elements were primitive by today's standards. It took many years of refinement and many new inventions and developments, both in these basic elements and in the enabling infrastructure of the manufacturing industries, before fully automated systems became a common reality. Important examples of these inventions and developments include interchangeable parts (circa 1800, Historical Note 1.1); electrification (starting in 1881); the moving assembly line (1913, Historical Note 15.1); mechanized transfer lines for mass production, whose programs were fixed by their hardware configuration (1924, Historical Note 16.1); a mathematical theory of control systems (1930s and 1940s); and the MARK I electromechanical computer at Harvard University (1944). These inventions and developments had all been realized by the end of World War II.

Since 1945, many new inventions and developments have contributed significantly to automation technology. Del Harder coined the word *automation* around 1946 in reference to the many automatic devices that the Ford Motor Company had developed for its production lines. The first electronic digital computer was developed at the University of Pennsylvania in 1946. The first numerical control machine tool was developed and demonstrated in 1952 at the Massachusetts Institute of Technology based on a concept proposed by John Parsons and Frank Stulen (Historical Note 7.1). By the late 1960s and early 1970s, digital computers were being connected to machine tools. In 1954, the first industrial robot was designed and in 1961 it was patented by George Devol (Historical Note 8.1). The first commercial robot was installed to unload parts in a die casting operation in 1961. In the late 1960s, the first flexible manufacturing system in the United States was installed at Ingersoll Rand Company to

perform machining operations on a variety of parts (Historical Note 19.1). Around 1969, the first programmable logic controller was introduced (Historical Note 9.1). In 1978, the first commercial personal computer (PC) was introduced by Apple Computer, although a similar product had been introduced in kit form as early as 1975.

Developments in computer technology were made possible by advances in electronics, including the transistor (1948), hard disk for computer memory (1956), integrated circuits (1960), the microprocessor (1971), random access memory (1984), megabyte capacity memory chips (circa 1990), and the Pentium microprocessors (1993). Software developments related to automation have been equally important, including the *FORTRAN* computer programming language (1955), the *APT* programming language for numerical control (NC) machine tools (1961), the *UNIX* operating system (1969), the *VAL* language for robot programming (1979), Microsoft *Windows* (1985), and the *JAVA* programming language (1995). Advances and enhancements in these technologies continue.

The terms *automation* and *mechanization* are often compared and sometimes confused. **Mechanization** refers to the use of machinery (usually powered) to assist or replace human workers in performing physical tasks, but human workers are still required to accomplish the cognitive and sensory elements of the tasks. By contrast, **automation** refers to the use of mechanized equipment that performs the physical tasks without the need for oversight by a human worker.

Part II examines the technologies that have been developed to automate manufacturing operations. The position of automation and control technologies in the larger production system is shown in Figure 4.1. The present chapter provides an overview of automation: What are the basic elements of an automated system? What are some of the advanced features beyond the basic elements? And what are the levels in an enterprise where automation can be applied? The following two chapters discuss industrial control systems and the hardware components of these systems. These chapters serve as a foundation for the remaining chapters on automation and control technologies: computer numerical control (Chapter 7), industrial robotics (Chapter 8), and programmable controllers (Chapter 9).

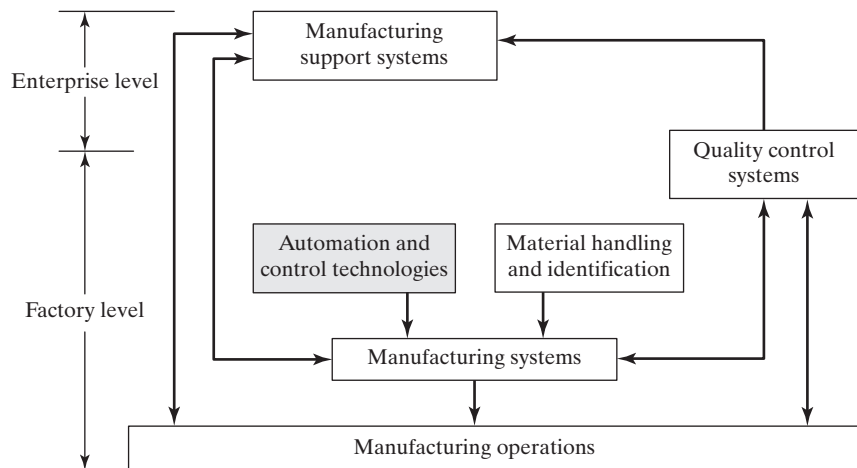


Figure 4.1 Automation and control technologies in the production system.

4.1 BASIC ELEMENTS OF AN AUTOMATED SYSTEM

An automated system consists of three basic elements: (1) power to accomplish the process and operate the system, (2) a program of instructions to direct the process, and (3) a control system to actuate the instructions. The relationship among these elements is illustrated in Figure 4.2. All systems that qualify as being automated include these three basic elements in one form or another. They are present in the three basic types of automated manufacturing systems: fixed automation, programmable automation, and flexible automation (Section 1.2.1).

4.1.1 Power to Accomplish the Automated Process

An automated system is used to operate some process, and power is required to drive the process as well as the controls. The principal source of power in automated systems is electricity. Electric power has many advantages in automated as well as nonautomated processes:

- Electric power is widely available at moderate cost. It is an important part of the industrial infrastructure.
- Electric power can be readily converted to alternative energy forms: mechanical, thermal, light, acoustic, hydraulic, and pneumatic.
- Electric power at low levels can be used to accomplish functions such as signal transmission, information processing, and data storage and communication.
- Electric energy can be stored in long-life batteries for use in locations where an external source of electrical power is not conveniently available.

Alternative power sources include fossil fuels, atomic, solar, water, and wind. However, their exclusive use is rare in automated systems. In many cases when alternative power sources are used to drive the process itself, electrical power is used for the controls that automate the operation. For example, in casting or heat treatment, the furnace may be heated by fossil fuels, but the control system to regulate temperature and time cycle is electrical. In other cases, the energy from these alternative sources is converted to electric power to operate both the process and its automation. When solar energy is used as a power source for an automated system, it is generally converted in this way.

Power for the Process. In production, the term *process* refers to the manufacturing operation that is performed on a work unit. In Table 4.1, a list of common

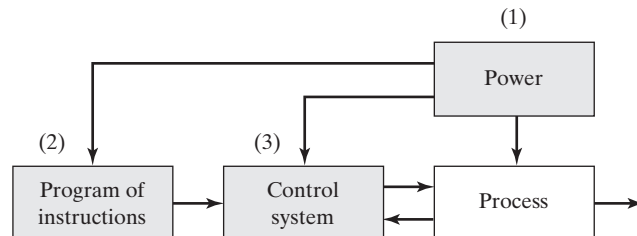


Figure 4.2 Elements of an automated system: (1) power, (2) program of instructions, and (3) control systems.

TABLE 4.1 Common Manufacturing Processes and Their Power Requirements

Process	Power Form	Action Accomplished
Casting	Thermal	Melting the metal before pouring into a mold cavity where solidification occurs.
Electric discharge machining	Electrical	Metal removal is accomplished by a series of discrete electrical discharges between electrode (tool) and workpiece. The electric discharges cause very high localized temperatures that melt the metal.
Forging	Mechanical	Metal work part is deformed by opposing dies. Work parts are often heated in advance of deformation, thus thermal power is also required.
Heat-treating	Thermal	Metallic work unit is heated to temperature below melting point to effect microstructural changes.
Injection molding	Thermal and mechanical	Heat is used to raise temperature of polymer to highly plastic consistency, and mechanical force is used to inject the polymer melt into a mold cavity.
Laser beam cutting	Light and thermal	A highly coherent light beam is used to cut material by vaporization and melting.
Machining	Mechanical	Cutting of metal is accomplished by relative motion between tool and workpiece.
Sheet metal punching and blanking	Mechanical	Mechanical power is used to shear metal sheets and plates.
Welding	Thermal (maybe mechanical)	Most welding processes use heat to cause fusion and coalescence of two (or more) metal parts at their contacting surfaces. Some welding processes also apply mechanical pressure.

manufacturing processes is compiled along with the form of power required and the resulting action on the work unit. Most of the power in manufacturing plants is consumed by these kinds of operations. The “power form” indicated in the middle column of the table refers to the energy that is applied directly to the process. As indicated earlier, the power source for each operation is often converted from electricity.

In addition to driving the manufacturing process itself, power is also required for the following material handling functions:

- *Loading and unloading the work unit.* All of the processes listed in Table 4.1 are accomplished on discrete parts. These parts must be moved into the proper position and orientation for the process to be performed, and power is required for this transport and placement function. At the conclusion of the process, the work unit must be removed. If the process is completely automated, then some form of mechanized power is used. If the process is manually operated or semiautomated, then human power may be used to position and locate the work unit.
- *Material transport between operations.* In addition to loading and unloading at a given operation, the work units must be moved between operations. The material handling technologies associated with this transport function are covered in Chapter 10.

Power for Automation. Above and beyond the basic power requirements for the manufacturing operation, additional power is required for automation. The additional power is used for the following functions:

- *Controller unit.* Modern industrial controllers are based on digital computers, which require electrical power to read the program of instructions, perform the control calculations, and execute the instructions by transmitting the proper commands to actuating devices.
- *Power to actuate the control signals.* The commands sent by the controller unit are carried out by means of electromechanical devices, such as switches and motors, called *actuators* (Section 6.2). The commands are generally transmitted by means of low-voltage control signals. To accomplish the commands, the actuators require more power, and so the control signals must be amplified to provide the proper power level for the actuating device.
- *Data acquisition and information processing.* In most control systems, data must be collected from the process and used as input to the control algorithms. In addition, for some processes, it is a legal requirement that records be kept of process performance and/or product quality. These data acquisition and record-keeping functions require power, although in modest amounts.

4.1.2 Program of Instructions

The actions performed by an automated process are defined by a program of instructions. Whether the manufacturing operation involves low, medium, or high production, each part or product requires one or more processing steps that are unique to that part or product. These processing steps are performed during a work cycle. A new part is completed at the end of each work cycle (in some manufacturing operations, more than one part is produced during the work cycle: for example, a plastic injection molding operation may produce multiple parts each cycle using a multiple cavity mold). The particular processing steps for the work cycle are specified in a work cycle program, called *part programs* in numerical control (Chapter 7). Other process control applications use different names for this type of program.

Work Cycle Programs. In the simplest automated processes, the work cycle consists of essentially one step, which is to maintain a single process parameter at a defined level, for example, maintain the temperature of a furnace at a designated value for the duration of a heat-treatment cycle. (It is assumed that loading and unloading of the work units into and from the furnace is performed manually and is therefore not part of the automatic cycle, so technically this is not a fully automated process.) In this case, programming simply involves setting the temperature dial on the furnace. This type of program is *set-point control*, in which the set point is the value of the process parameter or desired value of the controlled variable in the process (furnace temperature in this example). A *process parameter* is an input to the process, such as the temperature dial setting, whereas a *process variable* is the corresponding output of the process, which is the actual temperature of the furnace.¹

¹Other examples of process parameters include desired coordinate axis value in a positioning system, valve open or closed in a fluid flow system, and motor on or off. Examples of corresponding process variables include the actual position of the coordinate axis, flow rate of fluid in the pipe, and rotational speed of the motor.

To change the program, the operator simply changes the dial setting. In an extension of this simple case, the one-step process is defined by more than one process parameter, for example, a furnace in which both temperature and atmosphere are controlled. Because of dynamics in the way the process operates, the process variable is not always equal to the process parameter. For example, if the temperature setting suddenly were to be increased or decreased, it would take time for the furnace temperature to reach the new set-point value. (This is getting into control system issues, which is the topic of Section 4.1.3.)

Work cycle programs are usually much more complicated than in the furnace example described. Following are five categories of work cycle programs, arranged in approximate order of increasing complexity and allowing for more than one process parameter in the program:

- *Set-point control*, in which the process parameter value is constant during the work cycle (as in the furnace example).
- *Logic control*, in which the process parameter value depends on the values of other variables in the process. Logic control is described in Section 9.1.1.
- *Sequence control*, in which the value of the process parameter changes as a function of time. The process parameter values can be either discrete (a sequence of step values) or continuously variable. Sequence control, also called *sequencing*, is discussed in Section 9.1.2.
- *Interactive program*, in which interaction occurs between a human operator and the control system during the work cycle.
- *Intelligent program*, in which the control system exhibits aspects of human intelligence (e.g., logic, decision making, cognition, learning) as a result of the work cycle program. Some capabilities of intelligent programs are discussed in Section 4.2.

Most processes involve a work cycle consisting of multiple steps that are repeated with no deviation from one cycle to the next. Most discrete part manufacturing operations are in this category. A typical sequence of steps (simplified) is the following: (1) load the part into the production machine, (2) perform the process, and (3) unload the part. During each step, there are one or more activities that involve changes in one or more process parameters.

EXAMPLE 4.1 An Automated Turning Operation

Consider an automated turning operation that generates a cone-shaped product. The system is automated and a robot loads and unloads the work units. The work cycle consists of the following steps: (1) load starting workpiece, (2) position cutting tool prior to turning, (3) turn, (4) reposition tool to a safe location at end of turning, and (5) unload finished workpiece. Identify the activities and process parameters for each step of the operation.

Solution: In step (1), the activities consist of the robot manipulator reaching for the raw work part, lifting and positioning the part into the chuck jaws of the lathe, then retreating to a safe position to await unloading. The process parameters for these activities are the axis values of the robot manipulator (which change continuously), the gripper value (open or closed), and the chuck jaw value (open or closed).

In step (2), the activity is the movement of the cutting tool to a “ready” position. The process parameters associated with this activity are the x - and z -axis position of the tool.

Step (3) is the turning operation. It requires the simultaneous control of three process parameters: rotational speed of the workpiece (rev/min), feed (mm/rev), and radial distance of the cutting tool from the axis of rotation. To cut the conical shape, radial distance must be changed continuously at a constant rate for each revolution of the workpiece. For a consistent finish on the surface, the rotational speed must be continuously adjusted to maintain a constant surface speed (m/min); and for equal feed marks on the surface, the feed must be set at a constant value. Depending on the angle of the cone, multiple turning passes may be required to gradually generate the desired contour. Each pass represents an additional step in the sequence.

Steps (4) and (5) are the reverse of steps (2) and (1), respectively, and the process parameters are the same.

Many production operations consist of multiple steps, sometimes more complicated than in the turning example. Examples of these operations include automatic screw machine cycles, sheet metal stamping, plastic injection molding, and die casting. Each of these manufacturing processes has been used for many decades. In earlier versions of these operations, work cycles were controlled by hardware components, such as limit switches, timers, cams, and electromechanical relays. In effect, the assemblage of hardware components served as the program of instructions that directed the sequence of steps in the processing cycle. Although these devices were quite adequate in performing their logic and sequencing functions, they suffered from the following disadvantages: (1) They often required considerable time to design and fabricate, forcing the production equipment to be used for batch production only; (2) making even minor changes in the program was difficult and time consuming; and (3) the program was in a physical form that was not readily compatible with computer data processing and communication.

Modern controllers used in automated systems are based on digital computers. Instead of cams, timers, relays, and other hardware components, the programs for computer-controlled equipment are contained in compact disks (CD-ROMs), computer memory, and other modern storage technologies. Virtually all modern production equipment is designed with some form of computer controller to execute its respective processing cycles. The use of digital computers as the process controller allows improvements and upgrades to be made in the control programs, such as the addition of control functions not foreseen during initial equipment design. These kinds of control changes are often difficult to make with the hardware components mentioned earlier.

A work cycle may include manual steps, in which the operator performs certain activities during the work cycle, and the automated system performs the rest. These are referred to as *semiautomated* work cycles. A common example is the loading and unloading of parts by an operator into and from a numerical control machine between machining cycles, while the machine performs the cutting operation under part program control. Initiation of the cutting operation in each cycle is triggered by the operator activating a “start” button after the part has been loaded.

Decision Making in the Programmed Work Cycle. In Example 4.1, the only two features of the work cycle were (1) the number and sequence of processing steps and (2) the process parameter changes in each step. Each work cycle consisted of the same steps and associated process parameter changes with no variation from one cycle to the next. The program of instructions is repeated each work cycle without deviation. In fact, many automated manufacturing operations require decisions to be made during the programmed work cycle to cope with variations in the cycle. In many cases, the variations are routine elements of the cycle, and the corresponding instructions for dealing with them are incorporated into the regular part program. These cases include:

- *Operator interaction.* Although the program of instructions is intended to be carried out without human interaction, the controller unit may require input data from a human operator in order to function. For example, in an automated engraving operation, the operator may have to enter the alphanumeric characters that are to be engraved on the work unit (e.g., plaque, trophy, belt buckle). After the characters are entered, the system accomplishes the engraving automatically. (An everyday example of operator interaction with an automated system is a bank customer using an automated teller machine. The customer must enter the codes indicating what transaction the teller machine must accomplish.)
- *Different part or product styles processed by the system.* In this instance, the automated system is programmed to perform different work cycles on different part or product styles. An example is an industrial robot that performs a series of spot welding operations on car bodies in a final assembly plant. These plants are often designed to build different body styles on the same automated assembly line, such as two-door and four-door sedans. As each car body enters a given welding station on the line, sensors identify which style it is, and the robot performs the correct series of welds for that style.
- *Variations in the starting work units.* In some manufacturing operations, the starting work units are not consistent. A good example is a sand casting as the starting work unit in a machining operation. The dimensional variations in the raw castings sometimes necessitate an extra machining pass to bring the machined dimension to the specified value. The part program must be coded to allow for the additional pass when necessary.

In all of these examples, the routine variations can be accommodated in the regular work cycle program. The program can be designed to respond to sensor or operator inputs by executing the appropriate subroutine corresponding to the input. In other cases, the variations in the work cycle are not routine at all. They are infrequent and unexpected, such as the failure of an equipment component. In these instances, the program must include contingency procedures or modifications in the sequence to cope with

conditions that lie outside the normal routine. These measures are discussed later in the chapter in the context of advanced automation functions (Section 4.2).

Various production situations and work cycle programs have been discussed here. The following summarizes the features of work cycle programs (part programs) used to direct the operations of an automated system:

- *Process parameters.* How many process parameters must be controlled during each step? Are the process parameters continuous or discrete? Do they change during the step, for example, a positioning system whose axis values change during the processing step?
- *Number of steps in work cycle.* How many distinct steps or work elements are included in the work cycle? A general sequence in discrete production operations is (1) load, (2), process, (3) unload, but the process may include multiple steps.
- *Manual participation in the work cycle.* Is a human worker required to perform certain steps in the work cycle, such as loading and unloading a production machine, or is the work cycle fully automated?
- *Operator interaction.* For example, is the operator required to enter processing data for each work cycle?
- *Variations in part or product styles.* Are the work units identical each cycle, as in mass production (fixed automation) or batch production (programmable automation), or are different part or product styles processed each cycle (flexible automation)?
- *Variations in starting work units.* Variations can occur in starting dimensions or materials. If the variations are significant, some adjustments may be required during the work cycle.

4.1.3 Control System

The control element of the automated system executes the program of instructions. The control system causes the process to accomplish its defined function, which is to perform some manufacturing operation. A brief introduction to control systems is provided here. The following chapter describes this technology in more detail.

The controls in an automated system can be either closed loop or open loop. A **closed-loop control system**, also known as a *feedback control system*, is one in which the output variable is compared with an input parameter, and any difference between the two is used to drive the output into agreement with the input. As shown in Figure 4.3, a closed-loop control system consists of six basic elements: (1) input parameter, (2) process, (3) output

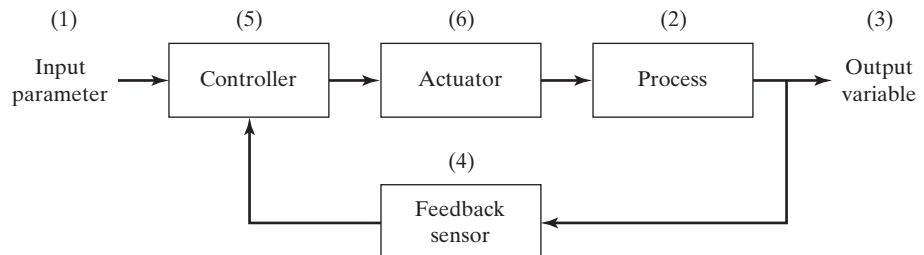


Figure 4.3 A feedback control system.

 


Figure 4.4 An open-loop control system.

variable, (4) feedback sensor, (5) controller, and (6) actuator. The input parameter (i.e., set point) represents the desired value of the output. In a home temperature control system, the set point is the desired thermostat setting. The process is the operation or function being controlled. In particular, it is the output variable that is being controlled in the loop. In the present discussion, the process of interest is usually a manufacturing operation, and the output variable is some process variable, perhaps a critical performance measure in the process, such as temperature or force or flow rate. A sensor is used to measure the output variable and close the loop between input and output. Sensors perform the feedback function in a closed-loop control system. The controller compares the output with the input and makes the required adjustment in the process to reduce the difference between them. The adjustment is accomplished using one or more actuators, which are the hardware devices that physically carry out the control actions, such as electric motors or flow valves. It should be mentioned that Figure 4.3 shows only one loop. Most industrial processes require multiple loops, one for each process variable that must be controlled.

In contrast to a closed-loop control system, an *open-loop control system* operates without the feedback loop, as in Figure 4.4. In this case, the controls operate without measuring the output variable, so no comparison is made between the actual value of the output and the desired input parameter. The controller relies on an accurate model of the effect of its actuator on the process variable. With an open-loop system, there is always the risk that the actuator will not have the intended effect on the process, and that is the disadvantage of an open-loop system. Its advantage is that it is generally simpler and less expensive than a closed-loop system. Open-loop systems are usually appropriate when the following conditions apply: (1) the actions performed by the control system are simple, (2) the actuating function is very reliable, and (3) any reaction forces opposing the actuator are small enough to have no effect on the actuation. If these characteristics are not applicable, then a closed-loop control system may be more appropriate.

Consider the difference between a closed-loop and open-loop system for the case of a positioning system. Positioning systems are common in manufacturing to locate a work part relative to a tool or work head. Figure 4.5 illustrates the case of a closed-loop positioning system. In operation, the system is directed to move the worktable to a specified location as defined by a coordinate value in a Cartesian (or other) coordinate system. Most positioning systems have at least two axes (e.g., an x - y positioning table) with a

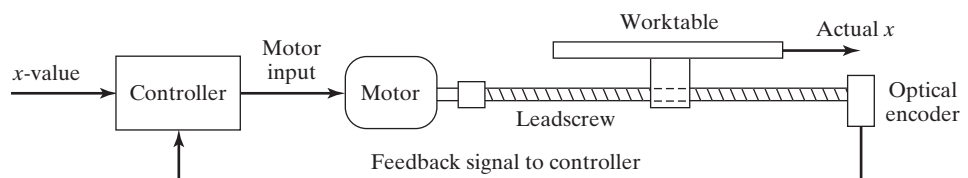


Figure 4.5 A (one-axis) positioning system consisting of a leadscrew driven by a dc servomotor.

control system for each axis, but the diagram only illustrates one of these axes. A dc servomotor connected to a leadscrew is a common actuator for each axis. A signal indicating the coordinate value (e.g., x -value) is sent from the controller to the motor that drives the leadscrew, whose rotation is converted into linear motion of the positioning table. The actual x -position is measured by a feedback sensor (e.g., an optical encoder). As the table moves closer to the desired x -coordinate value, the difference between the actual x -position and the input x -value decreases. The controller continues to drive the motor until the actual table position corresponds to the input position value.

For the open-loop case, the diagram for the positioning system would be similar to the preceding, except that no feedback loop is present and a stepper motor would be used in place of the dc servomotor. A stepper motor is designed to rotate a precise fraction of a turn for each pulse received from the controller. Since the motor shaft is connected to the leadscrew, and the leadscrew drives the worktable, each pulse converts into a small constant linear movement of the table. To move the table a desired distance, the number of pulses corresponding to that distance is sent to the motor. Given the proper application, whose characteristics match the preceding list of operating conditions, an open-loop positioning system works with high reliability.

The engineering analysis of closed-loop and open-loop positioning systems is discussed in the context of numerical control in Section 7.4.

4.2 ADVANCED AUTOMATION FUNCTIONS

In addition to executing work cycle programs, an automated system may be capable of executing advanced functions that are not specific to a particular work unit. In general, the functions are concerned with enhancing the safety and performance of the equipment. Advanced automation functions include the following: (1) safety monitoring, (2) maintenance and repair diagnostics, and (3) error detection and recovery.

Advanced automation functions are made possible by special subroutines included in the program of instructions. In some cases, the functions provide information only and do not involve any physical actions by the control system, for example, reporting a list of preventive maintenance tasks that should be accomplished. Any actions taken on the basis of this report are decided by the human operators and managers of the system and not by the system itself. In other cases, the program of instructions must be physically executed by the control system using available actuators. A simple example of this case is a safety monitoring system that sounds an alarm when a human worker gets dangerously close to the automated equipment.

4.2.1 Safety Monitoring

One of the significant reasons for automating a manufacturing operation is to remove workers from a hazardous working environment. An automated system is often installed to perform a potentially dangerous operation that would otherwise be accomplished manually by human workers. However, even in automated systems, workers are still needed to service the system, at periodic intervals if not full time. Accordingly, it is important that the automated system be designed to operate safely when workers are in attendance. In addition, it is essential that the automated system carry out its process in a way that is not self-destructive. Thus, there are two reasons for providing an automated system with a

safety monitoring capability: (1) to protect human workers in the vicinity of the system, and (2) to protect the equipment comprising the system.

Safety monitoring means more than the conventional safety measures taken in a manufacturing operation, such as protective shields around the operation or the kinds of manual devices that might be utilized by human workers, such as emergency stop buttons. Safety monitoring in an automated system involves the use of sensors to track the system's operation and identify conditions and events that are unsafe or potentially unsafe. The safety monitoring system is programmed to respond to unsafe conditions in some appropriate way. Possible responses to various hazards include one or more of the following: (1) completely stopping the automated system, (2) sounding an alarm, (3) reducing the operating speed of the process, and (4) taking corrective actions to recover from the safety violation. This last response is the most sophisticated and is suggestive of an intelligent machine performing some advanced strategy. This kind of response is applicable to a variety of possible mishaps, not necessarily confined to safety issues, and is called error detection and recovery (Section 4.2.3).

Sensors for safety monitoring range from very simple devices to highly sophisticated systems. Sensors are discussed in Section 6.1. The following list suggests some of the possible sensors and their applications for safety monitoring:

- Limit switches to detect proper positioning of a part in a workholding device so that the processing cycle can begin.
- Photoelectric sensors triggered by the interruption of a light beam; this could be used to indicate that a part is in the proper position or to detect the presence of a human intruder in the work cell.
- Temperature sensors to indicate that a metal work part is hot enough to proceed with a hot forging operation. If the work part is not sufficiently heated, then the metal's ductility might be too low, and the forging dies might be damaged during the operation.
- Heat or smoke detectors to sense fire hazards.
- Pressure-sensitive floor pads to detect human intruders in the work cell.
- Machine vision systems to perform surveillance of the automated system and its surroundings.

It should be mentioned that a given safety monitoring system is limited in its ability to respond to hazardous conditions by the possible irregularities that have been foreseen by the system designer. If the designer has not anticipated a particular hazard, and consequently has not provided the system with the sensing capability to detect that hazard, then the safety monitoring system cannot recognize the event if and when it occurs.

4.2.2 Maintenance and Repair Diagnostics

Modern automated production systems are becoming increasingly complex and sophisticated, complicating the problem of maintaining and repairing them. Maintenance and repair diagnostics refers to the capabilities of an automated system to assist in identifying the source of potential or actual malfunctions and failures of

the system. Three modes of operation are typical of a modern maintenance and repair diagnostics subsystem:

1. *Status monitoring.* In the status monitoring mode, the diagnostic subsystem monitors and records the status of key sensors and parameters of the system during normal operation. On request, the diagnostics subsystem can display any of these values and provide an interpretation of current system status, perhaps warning of an imminent failure.
2. *Failure diagnostics.* The failure diagnostics mode is invoked when a malfunction or failure occurs. Its purpose is to interpret the current values of the monitored variables and to analyze the recorded values preceding the failure so that its cause can be identified.
3. *Recommendation of repair procedure.* In the third mode of operation, the subsystem recommends to the repair crew the steps that should be taken to effect repairs. Methods for developing the recommendations are sometimes based on the use of expert systems in which the collective judgments of many repair experts are pooled and incorporated into a computer program that uses artificial intelligence techniques.

Status monitoring serves two important functions in machine diagnostics: (1) providing information for diagnosing a current failure and (2) providing data to predict a future malfunction or failure. First, when a failure of the equipment has occurred, it is usually difficult for the repair crew to determine the reason for the failure and what steps should be taken to make repairs. It is often helpful to reconstruct the events leading up to the failure. The computer is programmed to monitor and record the variables and to draw logical inferences from their values about the reason for the malfunction. This diagnosis helps the repair personnel make the necessary repairs and replace the appropriate components. This is especially helpful in electronic repairs where it is often difficult to determine on the basis of visual inspection which components have failed.

The second function of status monitoring is to identify signs of an impending failure, so that the affected components can be replaced before failure actually causes the system to go down. These part replacements can be made during the night shift or another time when the process is not operating, so the system experiences no loss of regular operation.

4.2.3 Error Detection and Recovery

In the operation of any automated system, there are hardware malfunctions and unexpected events. These events can result in costly delays and loss of production until the problem has been corrected and regular operation is restored. Traditionally, equipment malfunctions are corrected by human workers, perhaps with the aid of a maintenance and repair diagnostics subroutine. With the increased use of computer control for manufacturing processes, there is a trend toward using the control computer not only to diagnose the malfunctions but also to automatically take the necessary corrective action to restore the system to normal operation. The term *error detection and recovery* is used when the computer performs these functions.

Error Detection. The error detection step uses the automated system's available sensors to determine when a deviation or malfunction has occurred, interpret the sensor signal(s), and classify the error. Design of the error detection subsystem must begin with a systematic enumeration of all possible errors that can occur during system operation. The errors in a manufacturing process tend to be very application-specific. They must be anticipated in advance in order to select sensors that will enable their detection.

In analyzing a given production operation, the possible errors can be classified into one of three general categories: (1) random errors, (2) systematic errors, and (3) aberrations. Random errors occur as a result of the normal stochastic nature of the process. These errors occur when the process is in statistical control (Section 20.4). Large variations in part dimensions, even when the production process is in statistical control, can cause problems in downstream operations. By detecting these deviations on a part-by-part basis, corrective action can be taken in subsequent operations. Systematic errors are those that result from some assignable cause such as a change in raw material or drift in an equipment setting. These errors usually cause the product to deviate from specifications so as to be of unacceptable quality. Finally, the third type of error, aberrations, results from either an equipment failure or a human mistake. Examples of equipment failures include fracture of a mechanical shear pin, burst in a hydraulic line, rupture of a pressure vessel, and sudden failure of a cutting tool. Examples of human mistakes include errors in the control program, improper fixture setups, and substitution of the wrong raw materials.

The two main design problems in error detection are (1) anticipating all of the possible errors that can occur in a given process, and (2) specifying the appropriate sensor systems and associated interpretive software so that the system is capable of recognizing each error. Solving the first problem requires a systematic evaluation of the possibilities under each of the three error classifications. If the error has not been anticipated, then the error detection subsystem cannot detect and identify it.

EXAMPLE 4.2 Error Detection in an Automated Machining Cell

Consider an automated cell consisting of a CNC (computer numerical control) machine tool, a parts storage unit, and a robot for loading and unloading the parts between the machine and the storage unit. Possible errors that might affect this system can be divided into the following categories: (1) machine and process, (2) cutting tools, (3) workholding fixture, (4) part storage unit, and (5) load/unload robot. Develop a list of possible errors (deviations and malfunctions) that might be included in each of these five categories.

Solution: Table 4.2 provides a list of the possible errors in the machining cell for each of the five categories.

TABLE 4.2 Possible Errors in the Automated Machining Cell

Category	Possible Errors
Machine and process	Loss of power, power overload, thermal deflection, cutting temperature too high, vibration, no coolant, chip fouling, wrong part program, defective part
Cutting tools	Tool breakage, tool wear-out, vibration, tool not present, wrong tool
Workholding fixture	Part not in fixture, clamps not actuated, part dislodged during machining, part deflection during machining, part breakage, chips causing location problems
Part storage unit	Work part not present, wrong work part, oversized or undersized work part
Load/unload robot	Improper grasping of work part, dropping of work part, no part present at pickup

Error Recovery. Error recovery is concerned with applying the necessary corrective action to overcome the error and bring the system back to normal operation. The problem of designing an error recovery system focuses on devising appropriate strategies and procedures that will either correct or compensate for the errors that can occur in the process. Generally, a specific recovery strategy and procedure must be designed for each different error. The types of strategies can be classified as follows:

1. *Make adjustments at the end of the current work cycle.* When the current work cycle is completed, the part program branches to a corrective action subroutine specifically designed for the detected error, executes the subroutine, and then returns to the work cycle program. This action reflects a low level of urgency and is most commonly associated with random errors in the process.
2. *Make adjustments during the current cycle.* This generally indicates a higher level of urgency than the preceding type. In this case, the action to correct or compensate for the detected error is initiated as soon as it is detected. However, the designated corrective action must be possible to accomplish while the work cycle is still being executed. If that is not possible, then the process must be stopped.
3. *Stop the process to invoke corrective action.* In this case, the deviation or malfunction requires that the work cycle be suspended during corrective action. It is assumed that the system is capable of automatically recovering from the error without human assistance. At the end of the corrective action, the regular work cycle is continued.
4. *Stop the process and call for help.* In this case, the error cannot be resolved through automated recovery procedures. This situation arises because (1) the automated cell is not enabled to correct the problem or (2) the error cannot be classified into the predefined list of errors. In either case, human assistance is required to correct the problem and restore the system to fully automated operation.

Error detection and recovery requires an interrupt system (Section 5.3.2). When an error in the process is sensed and identified, an interrupt in the current program execution is invoked to branch to the appropriate recovery subroutine. This is done either at the end of the current cycle (type 1 above) or immediately (types 2, 3, and 4). At the completion of the recovery procedure, program execution reverts back to normal operation.

EXAMPLE 4.3 Error Recovery in an Automated Machining Cell

For the automated cell of Example 4.2, develop a list of possible corrective actions that might be taken by the system to address some of the errors.

Solution: A list of possible corrective actions is presented in Table 4.3.

TABLE 4.3 Error Recovery in an Automated Machining Cell: Possible Corrective Actions That Might Be Taken in Response to Errors Detected During the Operation

Error Detected	Possible Corrective Action to Recover
Part dimensions deviating due to thermal deflection of machine tool	Adjust coordinates in part program to compensate (category 1 corrective action)
Part dropped by robot during pickup	Reach for another part (category 2 corrective action)
Starting work part is oversized	Adjust part program to take a preliminary machining pass across the work surface (category 2 corrective action)
Chatter (tool vibration)	Increase or decrease cutting speed to change harmonic frequency (category 2 corrective action)
Cutting temperature too high	Reduce cutting speed (category 2 corrective action)
Cutting tool failed	Replace cutting tool with another sharp tool (category 3 corrective action).
No more parts in parts storage unit	Call operator to resupply starting work parts (category 4 corrective action)
Chips fouling machining operation	Call operator to clear chips from work area (category 4 corrective action)

4.3 LEVELS OF AUTOMATION

Automated systems can be applied to various levels of factory operations. One normally associates automation with the individual production machines. However, the production machine itself is made up of subsystems that may themselves be automated. For example, one of the important automation technologies discussed in this part of the book is computer numerical control (CNC, Chapter 7). A modern CNC machine tool is a highly automated system that is composed of multiple control systems. Any CNC machine has at least two axes of motion, and some machines have more than five axes. Each of these axes operates as a positioning system, as described in Section 4.1.3., and is, in effect, an automated system. Similarly, a CNC machine is often part of a larger manufacturing system, and the larger system may be automated. For example, two or three machine tools may be connected by an automated part handling system operating under computer control. The machine tools also receive instructions (e.g., part programs) from the computer. Thus three levels of automation and control are included here (the positioning system level, the machine tool level, and the manufacturing system level). For the purposes of this text, five levels of automation can be identified, and their hierarchy is depicted in Figure 4.6:

1. *Device level.* This is the lowest level in the automation hierarchy. It includes the actuators, sensors, and other hardware components that comprise the machine level. The devices are combined into the individual control loops of the machine, for example, the feedback control loop for one axis of a CNC machine or one joint of an industrial robot.

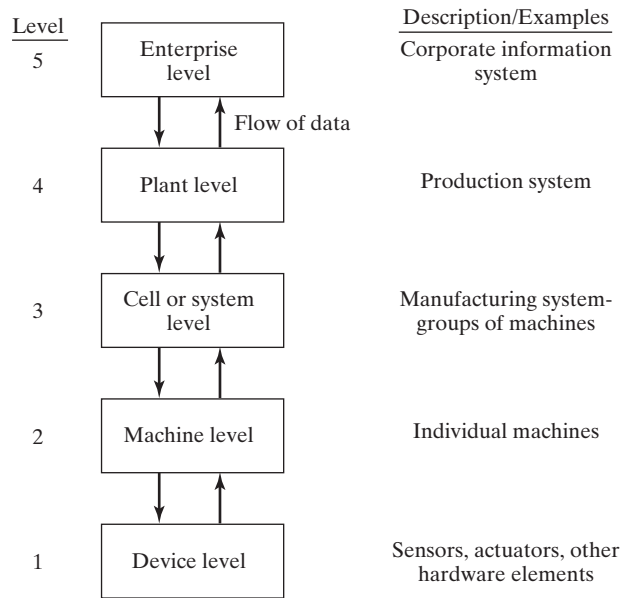


Figure 4.6 Five levels of automation and control in manufacturing.

2. *Machine level.* Hardware at the device level is assembled into individual machines. Examples include CNC machine tools and similar production equipment, industrial robots, powered conveyors, and automated guided vehicles. Control functions at this level include performing the sequence of steps in the program of instructions in the correct order and making sure that each step is properly executed.
3. *Cell or system level.* This is the manufacturing cell or system level, which operates under instructions from the plant level. A manufacturing cell or system is a group of machines or workstations connected and supported by a material handling system, computer, and other equipment appropriate to the manufacturing process. Production lines are included in this level. Functions include part dispatching and machine loading, coordination among machines and material handling system, and collecting and evaluating inspection data.
4. *Plant level.* This is the factory or production systems level. It receives instructions from the corporate information system and translates them into operational plans for production. Likely functions include order processing, process planning, inventory control, purchasing, material requirements planning, shop floor control, and quality control.
5. *Enterprise level.* This is the highest level, consisting of the corporate information system. It is concerned with all of the functions necessary to manage the company: marketing and sales, accounting, design, research, aggregate planning, and master production scheduling. The corporate information system is usually managed using Enterprise Resource Planning (Section 25.7).

Most of the technologies discussed in this part of the book are at levels 2 and 3 (machine level and cell level), although level 1 automation technologies (the devices that make up a control system) are discussed in Chapter 6. Level 2 technologies include the individual controllers (e.g., programmable logic controllers and digital computer controllers), numerical control machines, and industrial robots. The material handling equipment discussed in Part III also represent technologies at level 2, although some pieces of handling equipment are themselves sophisticated automated systems. The automation and control issues at level 2 are concerned with the basic operation of the equipment and the physical processes they perform.

Controllers, machines, and material handling equipment are combined into manufacturing cells, production lines, or similar systems, which make up level 3, considered in Part IV. A **manufacturing system** is defined in this book as a collection of integrated equipment designed for some special mission, such as machining a defined part family or assembling a certain product. Manufacturing systems include people. Certain highly automated manufacturing systems can operate for extended periods of time without humans present to attend to their needs. But most manufacturing systems include workers as important participants in the system, for example, assembly workers on a conveyORIZED production line or part loaders/unloaders in a machining cell. Thus, manufacturing systems are designed with varying degrees of automation; some are highly automated, others are completely manual, and there is a wide range between the two.

The manufacturing systems in a factory are components of a larger **production system**, which is defined as the people, equipment, and procedures that are organized for the combination of materials and processes that comprise a company's manufacturing operations. Production systems are at level 4, the plant level, while manufacturing systems are at level 3 in the automation hierarchy. Production systems include not only the groups of machines and workstations in the factory but also the support procedures that make them work. These procedures include process planning, production control, inventory control, material requirements planning, shop floor control, and quality control, all of which are discussed in Parts V and VI. They are implemented not only at the plant level but also at the corporate level (level 5).

REFERENCES

- [1] BOUCHER, T. O., *Computer Automation in Manufacturing*, Chapman & Hall, London, UK, 1996.
- [2] GROOVER, M. P., "Automation," *Encyclopaedia Britannica, Macropaedia*, 15th ed., Chicago, IL, 1992. Vol. 14, pp. 548–557.
- [3] GROOVER, M. P., "Automation," *Handbook of Design, Manufacturing, and Automation*, R. C. Dorf and A. Kusiak (eds.), John Wiley & Sons, Inc., New York, 1994, pp. 3–21.
- [4] GROOVER, M. P., "Industrial Control Systems," *Maynard's Industrial Engineering Handbook*, 5th ed., K. Zandin (ed.), McGraw-Hill Book Company, New York, 2001.
- [5] PLATT, R., *Smithsonian Visual Timeline of Inventions*, Dorling Kindersley Ltd., London, UK, 1994.
- [6] "The Power of Invention," *Newsweek Special Issue*, Winter 1997–98, pp. 6–79.
- [7] www.wikipedia.org/wiki/Automation

REVIEW QUESTIONS

- 4.1 What is automation?
- 4.2 Name the three basic elements of an automated system.
- 4.3 What is the difference between a process parameter and a process variable?
- 4.4 What are the five categories of work cycle programs, as listed in the text? Briefly describe each.
- 4.5 What are three reasons why decision making is required in a programmed work cycle?
- 4.6 What is the difference between a closed-loop control system and an open-loop control system?
- 4.7 What is safety monitoring in an automated system?
- 4.8 What is error detection and recovery in an automated system?
- 4.9 Name three of the four possible strategies in error recovery.
- 4.10 Identify the five levels of automation in a production plant.

Industrial Control Systems

CHAPTER CONTENTS

- 5.1 Process Industries Versus Discrete Manufacturing Industries
 - 5.1.1 Levels of Automation in the Two Industries
 - 5.1.2 Variables and Parameters in the Two Industries
- 5.2 Continuous Versus Discrete Control
 - 5.2.1 Continuous Control Systems
 - 5.2.2 Discrete Control Systems
- 5.3 Computer Process Control
 - 5.3.1 Control Requirements
 - 5.3.2 Capabilities of Computer Control
 - 5.3.3 Forms of Computer Process Control

The control system is one of the three basic components of an automated system (Section 4.1). This chapter focuses on industrial control systems, in particular how digital computers are used to implement the control function in production. ***Industrial control*** is defined here as the automatic regulation of unit operations and their associated equipment, as well as the integration and coordination of the unit operations in the larger production system. In the context of this book, the term *unit operations* usually refers to manufacturing processes; however, the term can also be applied to material handling and other industrial equipment. The chapter begins by comparing the application of industrial control in the processing industries with its application in the discrete manufacturing industries.

5.1 PROCESS INDUSTRIES VERSUS DISCRETE MANUFACTURING INDUSTRIES

In the discussion of industry types in Chapter 2, industries and their production operations were divided into two basic categories: (1) process industries and (2) discrete manufacturing industries. Process industries perform their production operations on amounts of materials, because the materials tend to be liquids, gases, powders, and similar materials, whereas discrete manufacturing industries perform their operations on quantities of materials, because the materials tend to be discrete parts and products. The kinds of unit operations performed on the materials are different in the two industry categories. Some of the typical unit operations in each category are listed in Table 5.1.

5.1.1 Levels of Automation in the Two Industries

The levels of automation (Section 4.3) in the two industries are compared in Table 5.2. Significant differences are seen in the low and intermediate levels. At the device level, there are differences in the types of actuators and sensors used in the two industry categories, simply because the processes and equipment are different. In the process industries, the devices are used mostly for the control loops in chemical, thermal, or similar processing operations, whereas in discrete manufacturing, the devices control the mechanical actions of machines. At level 2, the difference is that unit operations are controlled in the process industries, and machines are controlled in discrete manufacturing operations. At level 3, the difference is between control of interconnected unit processing operations and interconnected machines. At the upper levels (plant and enterprise), the control issues are similar, allowing for the fact that the products and processes are different.

5.1.2 Variables and Parameters in the Two Industries

The distinction between process industries and discrete manufacturing industries extends to the variables and parameters that characterize their respective production operations. The reader will recall from the previous chapter (Section 4.1.2) that variables are defined as outputs of the process and parameters are defined as inputs to the process. In the process industries, the variables and parameters of interest tend to be continuous, whereas in discrete manufacturing, they tend to be discrete. The differences are explained with reference to Figure 5.1.

A *continuous variable* (or parameter) is one that is uninterrupted as time proceeds, at least during the manufacturing operation. A continuous variable is generally

TABLE 5.1 Typical Unit Operations in the Process Industries and Discrete Manufacturing Industries

Process Industries	Discrete Manufacturing Industries
Chemical reactions	Casting
Comminution	Forging
Chemical vapor deposition	Extrusion
Distillation	Machining
Mixing and blending of ingredients	Plastic molding
Separation of ingredients	Sheet metal stamping

TABLE 5.2 Levels of Automation in the Process Industries and Discrete Manufacturing Industries

Level	Process Industries	Discrete Manufacturing Industries
5	Enterprise level—management information system, strategic planning, high-level management of enterprise	Enterprise level—management information system, strategic planning, high-level management of enterprise
4	Plant level—scheduling, tracking materials, equipment monitoring	Plant or factory level—scheduling, tracking work-in-process, routing parts through machines, machine utilization
3	Supervisory control level—control and coordination of several interconnected unit operations that make up the total process	Manufacturing cell or system level—control and coordination of groups of machines and supporting equipment working in coordination, including material handling equipment
2	Regulatory control level—control of unit operations	Machine level—production machines and workstations for discrete product manufacture
1	Device level—sensors and actuators comprising the basic control loops for unit operations	Device level—sensors and actuators to accomplish control of machine actions

considered to be *analog*, which means it can take on any value within a certain range. The variable is not restricted to a discrete set of values. Production operations in both the process industries and discrete parts manufacturing are characterized by continuous variables. Examples include force, temperature, flow rate, pressure, and velocity. All of these variables (whichever ones apply to a given production process) are continuous over time during the process, and they can take on any of an infinite number of possible values within a certain practical range.

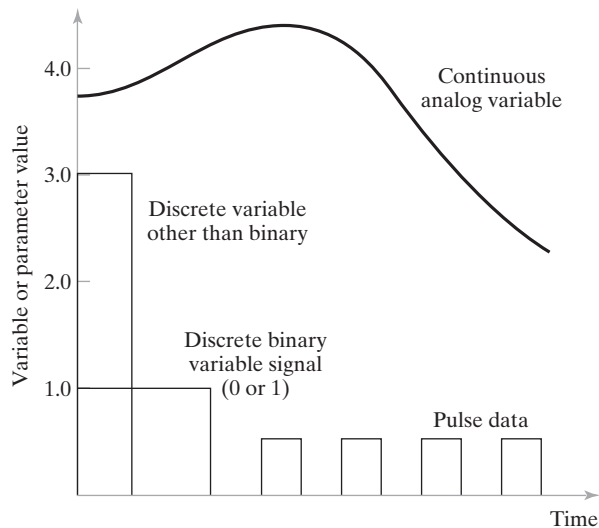


Figure 5.1 Continuous and discrete variables and parameters in manufacturing operations.

A **discrete variable** (or parameter) is one that can take on only certain values within a given range. The most common type of discrete variable is **binary**, meaning it can take on either of two possible values, ON or OFF, open or closed, and so on. Examples of discrete binary variables and parameters in manufacturing include limit switch open or closed, motor on or off, and work part present or not present in a fixture. Not all discrete variables (and parameters) are binary. Other possibilities are variables that can take on more than two possible values but less than an infinite number, that is, **discrete other than binary**. Examples include daily piece counts in a production operation and the display of a digital tachometer. A special form of discrete variable is **pulse data**, which consist of a series of pulses (called a *pulse train*) as shown in Figure 5.1. As a discrete variable, a pulse train might be used to indicate piece counts, for example, parts passing on a conveyor activate a photocell to produce a pulse for each part detected. As a process parameter, a pulse train might be used to drive a stepper motor.

5.2 CONTINUOUS VERSUS DISCRETE CONTROL

Industrial control systems used in the process industries tend to emphasize the control of continuous variables and parameters. By contrast, the manufacturing industries produce discrete parts and products, and their controllers tend to emphasize discrete variables and parameters. Just as there are two basic types of variables and parameters that characterize production operations, there are also two basic types of control: (1) **continuous control**, in which the variables and parameters are continuous and analog; and (2) **discrete control**, in which the variables and parameters are discrete, mostly binary discrete. Some of the differences between continuous control and discrete control are summarized in Table 5.3.

In reality, most operations in the process and discrete manufacturing industries include both continuous and discrete variables and parameters. Consequently, many industrial controllers are designed with the capability to receive, operate on, and transmit both types of signals and data. Chapter 6 covers the various types of signals and data in industrial control systems and how the data are converted for use by digital computers.

TABLE 5.3 Comparison Between Continuous Control and Discrete Control

Comparison Factor	Continuous Control in Process Industries	Discrete Control in Discrete Manufacturing Industries
Typical measures of product output	Weight measures, liquid volume measures, solid volume measures	Number of parts, number of products
Typical quality measures	Consistency, concentration of solution, absence of contaminants, conformance to specification	Dimensions, surface finish, appearance, absence of defects, product reliability
Typical variables and parameters	Temperature, volume flow rate, pressure	Position, velocity, acceleration, force
Typical sensors	Flow meters, thermocouples, pressure sensors	Limit switches, photoelectric sensors, strain gages, piezoelectric sensors
Typical actuators	Valves, heaters, pumps	Switches, motors, pistons
Typical process time constants	Seconds, minutes, hours	Less than a second

To complicate matters, because digital computers began replacing analog controllers in continuous process-control applications around 1960, continuous process variables are no longer measured continuously. Instead, they are sampled periodically, in effect creating a discrete sampled-data system that approximates the actual continuous system. Similarly, the control signals sent to the process are typically stepwise functions that approximate the continuous control signals that are transmitted by analog controllers. Hence, in digital computer process control, even continuous variables and parameters possess characteristics of discrete data, and these characteristics must be considered in the design of the computer–process interface and the control algorithms used by the controller.

5.2.1 Continuous Control Systems

In continuous control, the usual objective is to maintain the value of an output variable at a desired level, similar to the operation of a feedback control system (Section 4.1.3). However, most continuous processes in the practical world consist of many separate feedback loops, all of which have to be controlled and coordinated to maintain the output variable at the desired value. There are several ways to achieve the control objective in a continuous process-control system. In the following paragraphs, the most prominent categories are surveyed.

Regulatory Control. In regulatory control, the objective is to maintain process performance at a certain level or within a given tolerance band of that level. This is appropriate, for example, when the performance attribute is some measure of product quality, and it is important to keep the quality at the specified level or within a specified range. In many applications, the performance measure of the process, sometimes called the *index of performance*, must be calculated based on several output variables of the process. Except for this feature, regulatory control is to the overall process what feedback control is to an individual control loop in the process, as suggested by Figure 5.2.

The trouble with regulatory control (and also with a simple feedback control loop) is that compensating action is taken only after a disturbance has affected the process output. An error must be present for any control action to be taken. The presence of an error means that the output of the process is different from the desired value. The following control mode, feedforward control, addresses this issue.

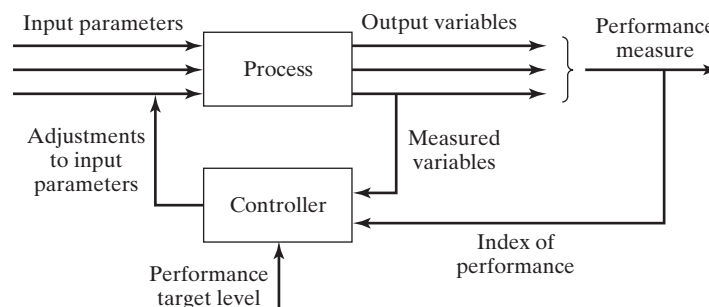


Figure 5.2 Regulatory control.

Feedforward Control. The strategy in feedforward control is to anticipate the effect of disturbances that will upset the process by sensing them and compensating for them before they affect the process. As shown in Figure 5.3, the feedforward control elements sense the presence of a disturbance and take corrective action by adjusting a process parameter that compensates for any effect the disturbance will have on the process. In the ideal case, the compensation is completely effective. However, complete compensation is unlikely because of delays and/or imperfections in the feedback measurements, actuator operations, and control algorithms, so feedforward control is usually combined with feedback control, as shown in the figure. Regulatory and feedforward control are more closely associated with the process industries than with discrete product manufacturing.

Steady-State Optimization. This term refers to a class of optimization techniques in which the process exhibits the following characteristics: (1) there is a well-defined index of performance, such as product cost, production rate, or process yield; (2) the relationship between the process variables and the index of performance is known; and (3) the values of the system parameters that optimize the index of performance can be determined mathematically. When these characteristics apply, the control algorithm is designed to make adjustments in the process parameters to drive the process toward the optimal state. The control system is open loop, as seen in Figure 5.4. Several mathematical techniques are available for solving steady-state optimal control problems, including differential calculus, calculus of variations, and various mathematical programming methods.

Adaptive Control. Steady-state optimal control operates as an open-loop system. It works successfully when there are no disturbances that invalidate the known relationship between process parameters and process performance. When such disturbances are present in the application, a self-correcting form of optimal control can be used, called *adaptive control*. Adaptive control combines feedback control and optimal control by measuring the relevant process variables during operation (as in feedback control) and using a control algorithm that attempts to optimize some index of performance (as in optimal control).

Adaptive control is distinguished from feedback control and steady-state optimal control by its unique capability to cope with a time-varying environment. It is not unusual

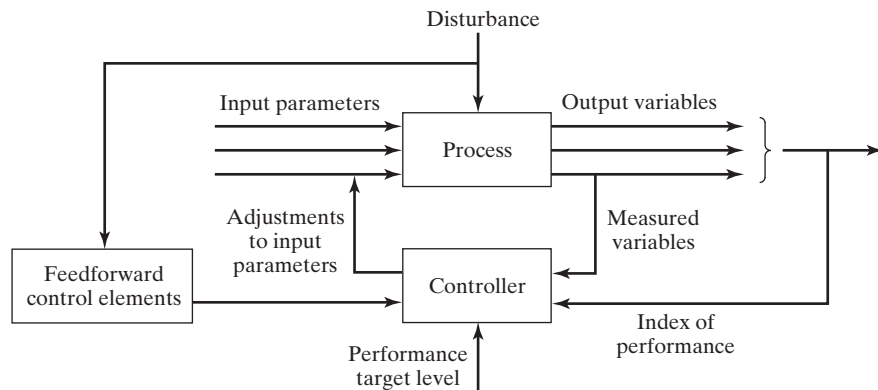


Figure 5.3 Feedforward control, combined with feedback control.

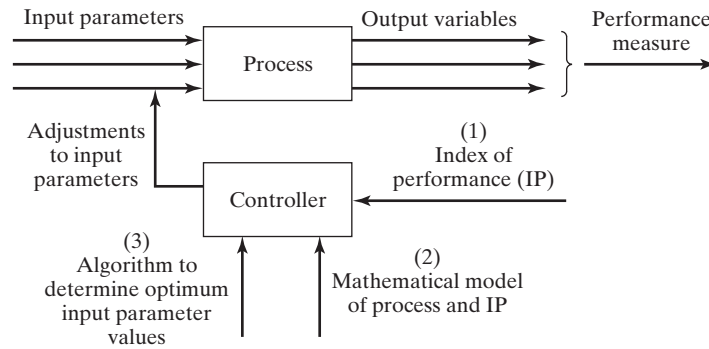


Figure 5.4 Steady-state (open loop) optimal control.

for a system to operate in an environment that changes over time and for the changes to have a potential effect on system performance. If the internal parameters or mechanisms of the system are fixed, as in feedback control or optimal control, the system may perform quite differently in one type of environment than in another. An adaptive control system is designed to compensate for its changing environment by monitoring its own performance and altering some aspect of its control mechanism to achieve optimal or near-optimal performance. In a production process, the “time-varying environment” consists of the variations in processing variables, raw materials, tooling, atmospheric conditions, and the like, any of which may affect performance.

The general configuration of an adaptive control system is illustrated in Figure 5.5. To evaluate its performance and respond accordingly, an adaptive control system performs three functions, as shown in the figure:

1. *Identification.* In this function, the current value of the index of performance of the system is determined, based on measurements collected from the process. Because the environment changes over time, system performance also changes. Accordingly, the identification function must be accomplished more or less continuously over time during system operation.
2. *Decision.* Once system performance is determined, the next function decides what changes should be made to improve performance. The decision function is implemented by means of the adaptive system’s programmed algorithm. Depending on this algorithm, the decision may be to change one or more input parameters, alter some of the internal parameters of the controller, or make other changes.
3. *Modification.* The third function is to implement the decision. Whereas decision is a logic function, modification is concerned with physical changes in the system. It involves hardware rather than software. In modification, the system parameters or process inputs are altered using available actuators to drive the system toward a more optimal state.

Adaptive control is most applicable at levels 2 and 3 in the automation hierarchy (Table 5.2). One notable example is *adaptive control machining*, in which changes in process variables such as cutting force, power, and vibration are used to effect control over process parameters such as cutting speed and feed rate.

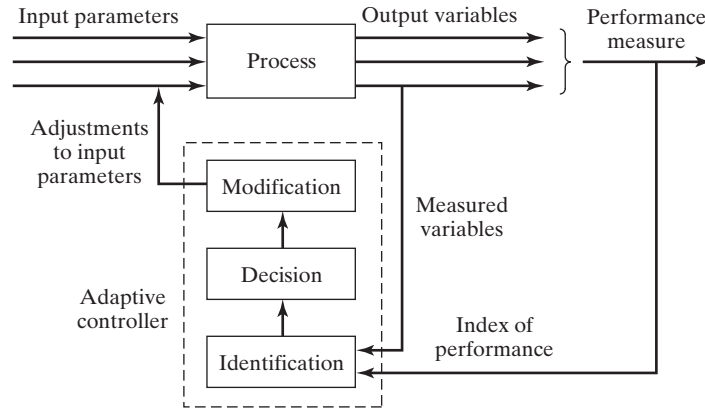


Figure 5.5 Configuration of an adaptive control system.

On-Line Search Strategies. On-line search strategies can be used to address a special class of adaptive control problem in which the decision function cannot be sufficiently defined; that is, the relationship between the input parameters and the index of performance is not known, or not known well enough to use adaptive control as previously described. Therefore, it is not possible to decide on the changes in the internal parameters of the system to produce the desired performance improvement. Instead, experiments must be performed on the process. Small systematic changes are made in the input parameters of the process to observe the effect of these changes on the output variables. Based on the results of these experiments, larger changes are made in the input parameters to drive the process toward improved performance.

On-line search strategies include a variety of schemes to explore the effects of changes in process parameters, ranging from trial-and-error techniques to gradient methods. All of the schemes attempt to determine which input parameters cause the greatest positive effect on the index of performance and then move the process in that direction. There is little evidence that on-line search techniques are used much in discrete parts manufacturing. Their applications are more common in the continuous process industries.

Other Specialized Techniques. Other specialized techniques include strategies that are currently evolving in control theory and computer science. Examples include learning systems, expert systems, neural networks, and other artificial intelligence methods for process control.

5.2.2 Discrete Control Systems

In discrete control, the parameters and variables of the system are changed at discrete moments in time, and the changes involve variables and parameters that are also discrete, typically binary (ON/OFF). The changes are defined in advance by means of a program of instructions, for example, a work cycle program (Section 4.1.2). The changes are executed either because the state of the system has changed or because a certain amount of time has elapsed. These two cases can be distinguished as (1) event-driven changes or (2) time-driven changes [2].

An event-driven change is executed by the controller in response to some event that has caused the state of the system to be altered. The change can be to initiate an operation or terminate an operation, start a motor or stop it, open a valve or close it, and so forth. Examples of event-driven changes are the following:

- A robot loads a work part into the fixture, and the part is sensed by a limit switch. Sensing the part's presence is the event that alters the system state. The event-driven change is that the automatic machining cycle can now commence.
- The diminishing level of plastic molding compound in the hopper of an injection molding machine triggers a low-level switch, which in turn opens a valve to start the flow of new plastic into the hopper. When the level of plastic reaches the high-level switch, this triggers the valve to close, thus stopping the flow into the hopper.
- Counting parts moving along a conveyor past an optical sensor is an event-driven system. Each part moving past the sensor is an event that drives the counter.

A time-driven change is executed by the control system either at a specific point in time or after a certain time lapse has occurred. As before, the change usually consists of starting something or stopping something, and the time when the change occurs is important. Examples of time-driven changes include:

- In factories with specific starting times and ending times for the shift and uniform break periods for all workers, the "shop clock" is set to sound a bell at specific moments during the day to indicate these start and stop times.
- Heat-treating operations must be carried out for a certain length of time. An automated heat-treating cycle consists of automatic loading of parts into the furnace (perhaps by a robot) and then unloading after the parts have been heated for the specified length of time.
- In the operation of a washing machine, once the laundry tub has been filled to the preset level, the agitation cycle continues for a length of time set on the controls. When this time is up, the timer stops the agitation and initiates draining of the tub. (By comparison with the agitation cycle, filling the laundry tub with water is event-driven. Filling continues until the proper level is sensed, which causes the inlet valve to close.)

The two types of change correspond to two different types of discrete control: logic control and sequence control. **Logic control** is used to control the execution of event-driven changes, and **sequence control** is used to manage time-driven changes. These types of control are discussed in the expanded coverage of discrete control in Chapter 9.

Discrete control is widely used in discrete manufacturing as well as the process industries. In discrete manufacturing, it is used to control the operation of conveyors and other material transport systems (Chapter 10), automated storage systems (Chapter 11), stand-alone production machines (Chapter 14), automated transfer lines (Chapter 16), automated assembly systems (Chapter 17), and flexible manufacturing systems (Chapter 19). All of these systems operate by following a well-defined sequence of start-and-stop actions, such as powered feed motions, parts transfers between workstations, and on-line automated inspections.

In the process industries, discrete control is associated more with batch processing than with continuous processes. In a typical batch processing operation, each batch of starting ingredients is subjected to a cycle of processing steps that involves changes in process parameters (e.g., temperature and pressure changes), possible flow from one container to another during the cycle, and finally packaging. The packaging step differs depending on the product. For foods, packaging may involve canning or boxing. For chemicals, it means filling containers with the liquid product. And for pharmaceuticals, it may involve filling bottles with medicine tablets. In batch process control, the objective is to manage the sequence and timing of processing steps as well as to regulate the process parameters in each step. Accordingly, batch process control typically includes both continuous control and discrete control.

5.3 COMPUTER PROCESS CONTROL

The use of digital computers to control industrial processes had its origins in the continuous process industries in the late 1950s (Historical Note 5.1). Prior to that time, analog controllers were used to implement continuous control, and relay systems were used to implement discrete control. At that time, computer technology was in its infancy, and the only computers available for process control were large, expensive mainframes. Compared with today's technology, digital computers of the 1950s were slow, unreliable, and not well suited to process-control applications. The computers that were installed sometimes cost more than the processes they controlled. Advances in integrated circuit technology have resulted in the development of the microprocessor. Today, virtually all industrial processes, certainly new installations, are controlled by digital computers based on microprocessor technology.

Historical Note 5.1 Computer Process Control [1], [7].

Control of industrial processes by digital computers can be traced to the process industries in the late 1950s and early 1960s. These industries, such as oil refineries and chemical plants, use high-volume continuous production processes characterized by many variables and associated control loops. The processes had traditionally been controlled by analog devices, each loop having its own set-point value and in most instances operating independently of other loops. Any coordination of the process was accomplished in a central control room, where workers adjusted the individual settings, attempting to achieve stability and economy in the process. The cost of the analog devices for all of the control loops was considerable, and the human coordination of the process was less than optimal. The commercial development of the digital computers in the 1950s offered the opportunity to replace some of the analog control devices with the computer.

The first known attempt to use a digital computer for process control was at a Texaco refinery in Port Arthur, Texas, in the late 1950s. Texaco had been contacted in 1956 by a computer manufacturer Thomson Ramo Woodridge (TRW), and a feasibility study was conducted on a polymerization unit at the refinery. The computer-control system went on line in March 1959. The control application involved 26 flows, 72 temperatures, three pressures, and three compositions. This pioneering work did not escape the notice of other companies in the process industries as well as other computer companies. The process industries saw

computer process control as a means of automation, and the computer companies saw a potential market for their products.

The available computers in the late 1950s were not reliable, and most of the subsequent process-control installations operated either by printing out instructions for the operator or by making adjustments in the set points of analog controllers, thereby reducing the risk of process downtime due to computer problems. The latter mode of operation was called *set-point control*. By March 1961, a total of 37 computer process-control systems had been installed. Much experience was gained from these early installations. The *interrupt feature* (Section 5.3.2), by which the computer suspends current program execution to quickly respond to a process need, was developed during this period.

The first *direct digital control* (DDC) system (Section 5.3.3), in which certain analog devices are replaced by the computer, was installed by Imperial Chemical Industries in England in 1962. In this implementation, 224 process variables were measured, and 129 actuators (valves) were controlled. Improvements in DDC technology were made, and additional systems were installed during the 1960s. Advantages of DDC noted during this time included (1) cost savings by eliminating analog instrumentation, (2) simplified operator display panels, and (3) flexibility due to reprogramming capability.

Computer technology was advancing, leading to the development of the *minicomputer* in the late 1960s. Process-control applications were easier to justify using these smaller, less expensive computers. Development of the microcomputer in the early 1970s continued this trend. Lower cost process-control hardware and interface equipment (such as analog-to-digital converters) were becoming available due to the larger markets made possible by low-cost computer controllers.

Most of the developments in computer process control up to this time were biased toward the process industries rather than discrete part and product manufacturing. Just as analog devices had been used to automate process industry operations, relay banks were widely used to satisfy the discrete process-control (ON/OFF) requirements in manufacturing automation. The programmable logic controller (PLC), a control computer designed for discrete process control, was developed in the early 1970s (Historical Note 9.1). Also, numerical control (NC) machine tools (Historical Note 7.1) and industrial robots (Historical Note 8.1), technologies that preceded computer control, started to be designed with digital computers as their controllers.

The availability of low-cost microcomputers and programmable logic controllers resulted in a growing number of installations in which a process was controlled by multiple computers networked together. The term *distributed control* was used for this kind of system, the first of which was a product offered by Honeywell in 1975. In the early 1990s, personal computers (PCs) began to be utilized on the factory floor, sometimes to provide scheduling and engineering data to shop floor personnel, in other cases as the operator interface to processes controlled by PLCs. Today, PCs are sometimes used to directly control manufacturing operations.

In this section, the requirements placed on the computer in industrial control applications are covered, followed by the capabilities that have been incorporated into the control computer to address these requirements, and finally the various forms of computer control used in industry are surveyed.

5.3.1 Control Requirements

Whether the application involves continuous control, discrete control, or both, there are certain basic requirements that tend to be common to nearly all process-control applications. By and large, they are concerned with the need to communicate and interact with the process on a real-time basis. A *real-time controller* is a controller that

is able to respond to the process within a short enough time period that process performance is not degraded. Real-time control usually requires the controller to be capable of **multitasking**, which means coping with multiple tasks concurrently without the tasks interfering with one another.

There are two basic requirements that must be managed by the controller to achieve real-time control:

1. *Process-initiated interrupts.* The controller must be able to respond to incoming signals from the process. Depending on the relative importance of the signals, the computer may need to interrupt execution of a current program to service a higher-priority need of the process. A process-initiated interrupt is often triggered by abnormal operating conditions, indicating that some corrective action must be taken promptly.
2. *Timer-initiated actions.* The controller must be capable of executing certain actions at specified points in time. Timer-initiated actions can be generated at regular time intervals, ranging from very low values (e.g., $100\mu\text{s}$) to several minutes, or they can be generated at distinct points in time. Typical timer-initiated actions in process control include (1) scanning sensor values from the process at regular sampling intervals, (2) turning on and off switches, motors, and other binary devices associated with the process at discrete points in time during the work cycle, (3) displaying performance data on the operator's console at regular times during a production run, and (4) recomputing optimal process parameter values at specified times.

These two requirements correspond to the two types of changes mentioned previously in the context of discrete control systems: (1) event-driven changes and (2) time-driven changes.

In addition to these basic requirements, the control computer must also deal with other types of interruptions and events. These include the following:

3. *Computer commands to process.* In addition to receiving incoming signals from the process, the control computer must send control signals to the process to accomplish a corrective action. These output signals may actuate a certain hardware device or readjust a set point in a control loop.
4. *System- and program-initiated events.* These are events related to the computer system itself. They are similar to the kinds of computer operations associated with business and engineering applications of computers. A system-initiated event involves communications among computers and peripheral devices linked together in a network. In these multiple computer networks, feedback signals, control commands, and other data must be transferred back and forth among the computers in the overall control of the process. A program-initiated event occurs when the program calls for some non-process-related action, such as the printing or display of reports on a printer or monitor. In process control, system- and program-initiated events generally occupy a low level of priority compared with process interrupts, commands to the process, and timer-initiated events.
5. *Operator-initiated events.* Finally, the control computer must be able to accept input from operating personnel. Operator-initiated events include (1) entering new programs; (2) editing existing programs; (3) entering customer data, order number, or startup instructions for the next production run; (4) requesting process data; and (5) calling for emergency stops.

5.3.2 Capabilities of Computer Control

The above requirements can be satisfied by providing the controller with certain capabilities that allow it to interact on a real-time basis with the process and the operator. These capabilities are (1) polling, (2) interlocks, (3) interrupt system, and (4) exception handling.

Polling. In computer process control, polling refers to the periodic sampling of data that indicates the status of the process. When the data consist of a continuous analog signal, sampling means that the continuous signal is substituted with a series of numerical values that represent the continuous signal at discrete moments in time. The same kind of substitution holds for discrete data, except that the number of possible values the data can take on is more limited—certainly the case with binary data. The techniques by which continuous and discrete data are entered into and transmitted from the computer are discussed in Chapter 6. Other names for polling include *sampling* and *scanning*.

In some systems, the polling procedure simply requests whether any changes have occurred in the data since the last polling cycle and then collects only the new data from the process. This tends to shorten the cycle time required for polling. Issues related to polling include (1) polling frequency, which is the reciprocal of the time interval between data collections; (2) polling order, which is the sequence of sampling the different data collection points of the process; and (3) polling format, which refers to the manner in which the sampling procedure is designed.

The alternatives in polling format include (a) entering all new data from all sensors and other devices every polling cycle; (b) updating the control system only with data that have changed since the last polling cycle; or (c) using high-level and low-level scanning, in which only certain key data are collected each polling cycle (high-level scanning), but if the data indicates some irregularity in the process, a low-level scan is undertaken to collect more complete data to ascertain the source of the irregularity.

These issues become increasingly critical with very dynamic processes in which changes in process status occur rapidly.

Interlocks. An interlock is a safeguard mechanism for coordinating the activities of two or more devices and preventing one device from interfering with the other(s). In process control, interlocks provide a means by which the controller is able to sequence the activities in a work cell, ensuring that the actions of one piece of equipment are completed before the next piece of equipment begins its activity. Interlocks work by regulating the flow of control signals back and forth between the controller and the external devices.

There are two types of interlocks, input interlocks and output interlocks, where input and output are defined relative to the controller. An *input interlock* is a signal that originates from an external device (e.g., a limit switch, sensor, or production machine) that is sent to the controller. Input interlocks are used for either of the following functions:

1. To proceed with the execution of the work cycle program. For example, the production machine communicates a signal to the controller that it has completed its processing of the part. This signal constitutes an input interlock indicating that the controller can now proceed to the next step in the work cycle, which is to unload the part.
2. To interrupt the execution of the work cycle program. For example, while unloading the part from the machine, the robot accidentally drops the part. The sensor in its gripper transmits an interlock signal to the controller indicating that the regular work cycle sequence should be interrupted until corrective action is taken.

An **output interlock** is a signal sent from the controller to some external device. It is used to control the activities of each external device and to coordinate their operation with that of the other equipment in the cell. For example, an output interlock can be used to send a control signal to a production machine to begin its automatic cycle after the work part has been loaded into it.

Interrupt System. Closely related to interlocks is the interrupt system. There are occasions when it becomes necessary for the process or operator to interrupt the regular controller operation to deal with more pressing matters. All computer systems are capable of being interrupted, if nothing else, by turning off the power. A more sophisticated interrupt system is required for process-control applications. An **interrupt system** is a computer-control feature that permits the execution of the current program to be temporarily suspended to execute another program or subroutine in response to an incoming signal indicating a higher priority event. Upon receipt of an interrupt signal, the computer system transfers to a predetermined subroutine designed to deal with the specific interrupt. The status of the current program is remembered so that its execution can be resumed when servicing of the interrupt has been completed.

Interrupt conditions can be classified as internal or external. Internal interrupts are generated by the computer system itself. These include timer-initiated events, such as polling of data from sensors connected to the process, or sending commands to the process at specific points in clock time. System- and program-initiated interrupts are also classified as internal because they are generated within the system. External interrupts are external to the computer system; they include process-initiated interrupts and operator inputs.

An interrupt system is required in process control because it is essential that more important programs (ones with higher priority) be executed before less important programs (ones with lower priorities). The system designer must decide what level of priority should be attached to each control function. A higher priority function can interrupt a lower priority function. A function at a given priority level cannot interrupt a function at the same priority level. The number of priority levels and the relative importance of the functions depend on the requirements of the individual process-control situation. For example, emergency shut-down of a process because of safety hazards would occupy a very high priority level, even if it is an operator-initiated interrupt. Most operator inputs would have low priorities.

One possible organization of priority rankings for process-control functions is shown in Table 5.4. Of course, the priority system may have more or fewer than the number of levels shown here, depending on the control situation. For example, some process interrupts may be more important than others, and some system interrupts may take precedence over certain process interrupts, thus requiring more than the six levels indicated in the table.

To respond to the various levels of priority defined for a given control application, an interrupt system can have one or more interrupt levels. A **single-level interrupt system** has only two modes of operation: normal mode and interrupt mode. The normal mode can be interrupted, but the interrupt mode cannot. This means that overlapping interrupts are serviced on a first-come, first-served basis, which could have potentially hazardous consequences if an important process interrupt was forced to wait its turn while a series of less important operator and system interrupts were serviced. A **multilevel interrupt system** has a normal operating mode plus more than one interrupt level as in Table 5.4; the normal mode can be interrupted by any interrupt level, but the interrupt levels have relative priorities that determine which functions can interrupt others. Example 5.1 illustrates the difference between the single-level and multilevel interrupt systems.

TABLE 5.4 Possible Priority Levels in an Interrupt System

Priority Level	Computer Function
1 (lowest priority)	Most operator inputs
2	System and program interrupts
3	Timer interrupts
4	Commands to process
5	Process interrupts
6 (highest priority)	Emergency stop (operator input)

EXAMPLE 5.1 Single-Level versus Multilevel Interrupt Systems

Three interrupts representing tasks of three different priority levels arrive for service in the reverse order of their respective priorities. Task 1 with the lowest priority arrives first. Soon after, higher priority Task 2 arrives. And soon after that, highest priority Task 3 arrives. How would the computer-control system respond under (a) a single-level interrupt system and (b) a multilevel interrupt system?

Solution: The response of the system for the two interrupt systems is shown in Figure 5.6.

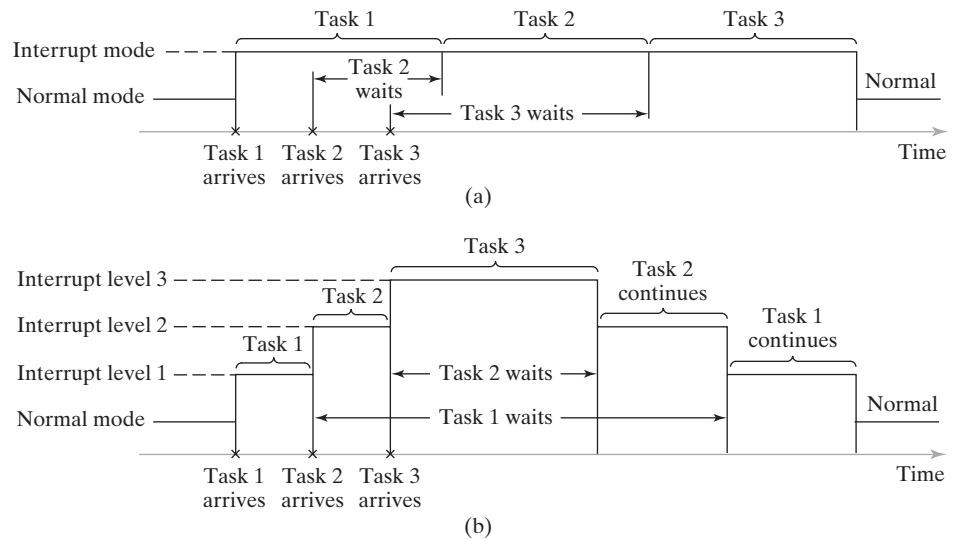


Figure 5.6 Response of the computer-control system in Example 5.1 to three priority interrupts for (a) a single-level interrupt system and (b) a multilevel interrupt system. Task 3 is the highest level priority. Task 1 is the lowest level. Tasks arrive for servicing in the order 1, then 2, then 3. In (a), Task 3 must wait until Tasks 1 and 2 have been completed. In (b), Task 3 interrupts execution of Task 2, whose priority level allowed it to interrupt Task 1.



Exception Handling. In process control, an exception is an event that is outside the normal or desired operation of the process or control system. Dealing with the exception is an essential function in industrial control and generally occupies a major portion of the control algorithm. The need for exception handling may be indicated through the normal polling procedure or by the interrupt system. Examples of events that may invoke exception handling routines include product quality problems, process variables operating outside their normal ranges, shortage of raw materials or supplies necessary to sustain the process, hazardous conditions such as a fire, and controller malfunction. In effect, exception handling is a form of error detection and recovery, discussed in the context of advanced automation capabilities (Section 4.2.3).

5.3.3 Forms of Computer Process Control

There are various ways in which computers can be used to control a process. First, the distinction between process monitoring and process control is illustrated in Figure 5.7. In process monitoring, the computer is used to simply collect data from the process, while in process control, the computer regulates the process. In some process-control implementations, the computer executes certain actions that do not require feedback data to be collected from the process. This is open-loop control. However, in most cases, some form of feedback or interlocking is required to ensure that the control instructions have been properly carried out. This more common situation is closed-loop control.

This section surveys the various forms of computer process monitoring and control, all but one of which are commonly used in industry today. The exception is direct digital control (DDC), which represents a transitory phase in the evolution of computer process-control technology. In its pure form, it is no longer used today. However, DDC is briefly described to reveal the opportunities it contributed.

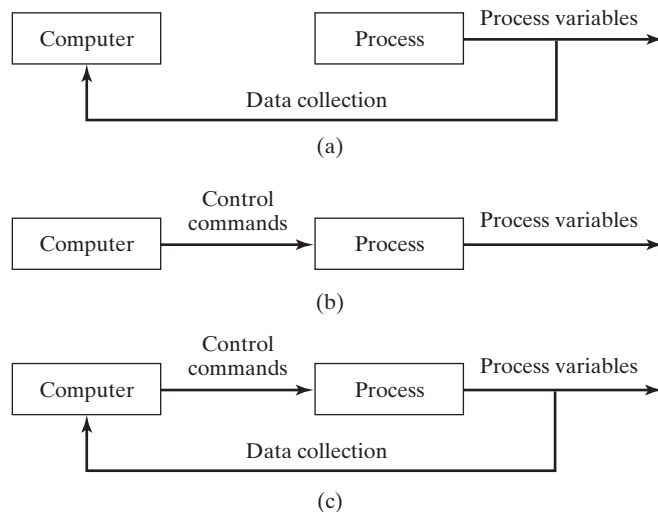


Figure 5.7 Forms of Computer Process Control: (a) process monitoring, (b) open-loop process control, and (c) closed-loop process control.

Computer Process Monitoring. Computer process monitoring is one of the ways in which the computer can be interfaced with a process. It involves the use of the computer to observe the process and associated equipment and to collect and record data from the operation. The computer is not used to directly control the process. Control remains in the hands of humans who use the data to guide them in managing and operating the process. The data collected by the computer in computer process monitoring can generally be classified into three categories:

1. *Process data.* These are measured values of input parameters and output variables that indicate process performance. When the values are found to indicate a problem, the human operator takes corrective action.
2. *Equipment data.* These data indicate the status of the equipment in the process. The data are used to monitor machine utilization, schedule tool changes, avoid machine breakdowns, diagnose equipment malfunctions, and plan preventive maintenance.
3. *Product data.* Government regulations require certain manufacturing industries to collect and preserve production data on their products. The pharmaceutical and medical supply industries are prime examples. Computer monitoring is the most convenient means of satisfying these regulations. A firm may also want to collect product data for its own use.

Collecting data from factory operations can be accomplished by any of several means. Shop data can be entered by workers through manual terminals located throughout the plant or can be collected automatically by means of limit switches, sensor systems, bar code readers, or other devices. Sensors are described in Chapter 6. Automatic identification and data collection technologies are discussed in Chapter 12. The collection and use of production data in factory operations for scheduling and tracking purposes is called *shop floor control*, covered in Chapter 25.

Direct Digital Control. DDC was certainly one of the important steps in the development of computer process control. This computer-control mode had its limitations, which motivated improvements leading to modern computer-control technology. DDC is a computer process-control system in which certain components in a conventional analog control system are replaced by the digital computer. The regulation of the process is accomplished by the digital computer on a time-shared, sampled-data basis rather than by the many individual analog components working in a dedicated continuous manner. With DDC, the computer calculates the desired values of the input parameters and set points, and these values are applied through a direct link to the process, hence the name “direct digital” control.

The difference between direct digital control and analog control can be seen by comparing Figures 5.8 and 5.9. Figure 5.8 shows the instrumentation for a typical analog control loop. The entire process would have many individual control loops, but only one is shown here. Typical hardware components of the analog control loop include the sensor and transducer, an instrument for displaying the output variable, some means for establishing the set point of the loop (shown as a dial in the figure, suggesting that the setting is determined by a human operator), a comparator (to compare set point with measured output variable), the analog controller, an amplifier, and the actuator that determines the input parameter to the process.

In the DDC system (Figure 5.9), some of the control loop components remain unchanged, including (probably) the sensor and transducer as well as the amplifier and

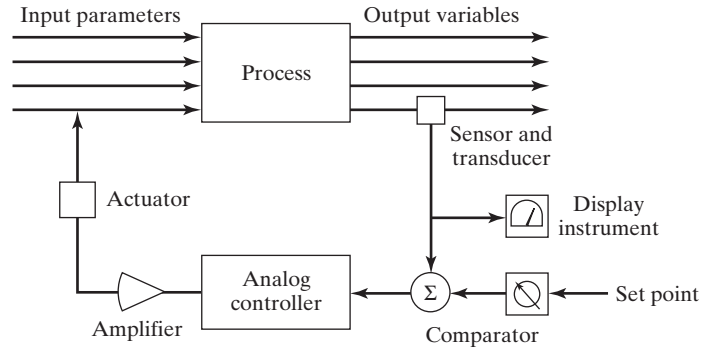


Figure 5.8 A typical analog control loop.

actuator. Components likely to be replaced in DDC include the analog controller, recording and display instruments, set-point dials, and comparator. New components in the loop include the digital computer, analog-to-digital and digital-to-analog converters (ADCs and DACs), and multiplexers to share data from different control loops with the same computer.

DDC was originally conceived as a more efficient means of performing the same kinds of control actions as the analog components it replaced. However, the practice of simply using the digital computer to imitate the operation of analog controllers was a transitional phase in computer process control. Additional opportunities for the control computer were soon recognized, including:

- *More control options than traditional analog.* With digital computer control, more complex control algorithms can be performed than with the conventional control modes used by analog controllers; for example, on/off control or nonlinearities in the control functions can be implemented.
- *Integration and optimization of multiple loops.* This is the ability to integrate feedback measurements from multiple loops and to implement optimizing strategies to improve overall process performance.

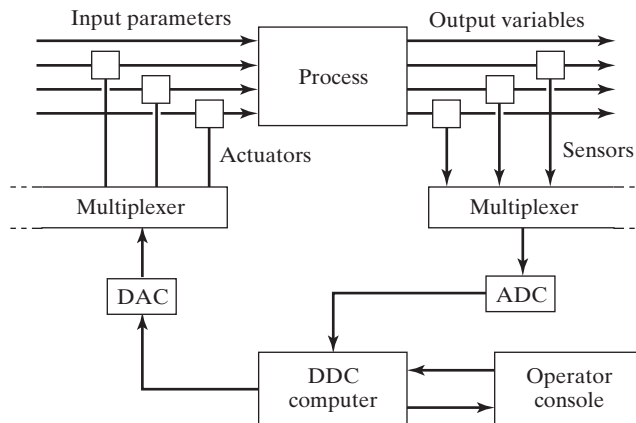


Figure 5.9 Components of a DDC system.

- *Ability to edit the control programs.* Using a digital computer makes it relatively easy to change the control algorithm when necessary by simply reprogramming the computer. Reprogramming an analog control loop is likely to require hardware changes that are more costly and less convenient.

These enhancements have rendered the original concept of direct digital control more or less obsolete. In addition, computer technology itself has progressed dramatically so that much smaller and less expensive yet more powerful computers are available for process control than the large mainframes available in the 1960s. This has allowed computer process control to be economically justified for much smaller scale processes and equipment. It has also motivated the use of distributed control systems, in which a network of microcomputers is utilized to control a complex process consisting of multiple unit operations and/or machines.

Computer Numerical Control and Robotics. Computer numerical control (CNC) is another form of industrial computer control. It involves the use of the computer (again, a microcomputer) to direct a machine tool through a sequence of processing steps defined by a program of instructions specifying the details of each step and their sequence. The distinctive feature of CNC is control of the relative position of a tool with respect to the object (work part) being processed. Computations must be made to determine the trajectory that will be followed by the cutting tool to shape the part geometry. Hence, CNC requires the controller to execute not only sequence control but geometric calculations as well. Because of its importance in manufacturing automation and industrial control, CNC is covered in detail in Chapter 7.

Closely related to CNC is industrial robotics, in which the joints of a manipulator (robot arm) are controlled to move the end of the arm through a sequence of positions during the work cycle. As in CNC, the controller must perform calculations during the work cycle to implement motion interpolation, feedback control, and other functions. In addition, a robotic work cell usually includes other equipment besides the robot, and the activities of the other equipment in the work cell must be coordinated with those of the robot. This coordination is achieved using interlocks. Industrial robotics is covered in Chapter 8.

Programmable Logic Controllers and Related Equipment. Programmable logic controllers (PLCs) were introduced around 1970 as an improvement on the electromechanical relay controllers used at the time to implement discrete control in discrete manufacturing. The evolution of PLCs has been facilitated by advances in computer technology, and present-day PLCs are capable of much more than the 1970s controllers. A ***programmable logic controller*** can be defined as a microprocessor-based controller that uses stored instructions in programmable memory to implement logic, sequencing, timing, counting, and arithmetic control functions for controlling machines and processes. Today's PLCs are used for both continuous control and discrete control applications in both the process industries and discrete manufacturing.

As PLC technology has advanced and the available equipment has become differentiated to address the variety of applications, the terms *programmable automation controller* (PAC) and *remote terminal unit* (RTU) have been coined to distinguish among the types of control devices. A ***programmable automation controller*** can be thought of as a digital controller that combines the capabilities of a personal computer with those of a conventional PLC; specifically, the input/output capabilities of a PLC are combined with

the data processing, network connectivity, and enterprise data integration features of a PC. A **remote terminal unit** is a microprocessor-based device that is connected to the process, receiving electrical signals from sensors and converting them into digital data for use by a central control computer; in some cases it also performs a control function for local sections of the process. RTUs often use wireless communications to transmit data, whereas PLCs use hardwired connections. PLCs and PACs are discussed in more detail in Chapter 9.

Supervisory Control and Data Acquisition. The term *supervisory control* is usually associated with the process industries, but the concept applies equally well to discrete manufacturing, where it corresponds to cell- or system-level control. Supervisory control represents a higher level of control than CNC, PLCs, and other automated processing equipment. In general, these other control systems are interfaced directly to the process (level 2 in Table 5.2). By contrast, supervisory control is superimposed on these process-level control systems (levels 3 and 4 in Table 5.2). The relationship between supervisory control and process-level control is illustrated in Figure 5.10.

The term *supervisory control and data acquisition (SCADA)* emphasizes the fact that such control systems also collect data from the process, which often includes multiple sites distributed over large distances. A typical SCADA system consists of the following components: (1) a central supervisory computer system capable of collecting data from the process and transmitting command signals to the process, (2) a human-machine interface (HMI) that presents the collected data to the system operator(s) and enables them to send command signals, (3) distributed PLCs and RTUs that are connected directly to the process for data acquisition and control, and (4) a communications network that connects the central computer to the remote PLCs and RTUs. The general mode of operation in SCADA is for the remote devices to directly control the various control loops in the system, but these devices can be overridden by the operator at the HMI if that becomes necessary for some reason. For example, the operator might change the value of a set point in one of the control loops.

In the context of the process industries, SCADA denotes a control system that manages the activities of a number of integrated unit operations to achieve certain economic

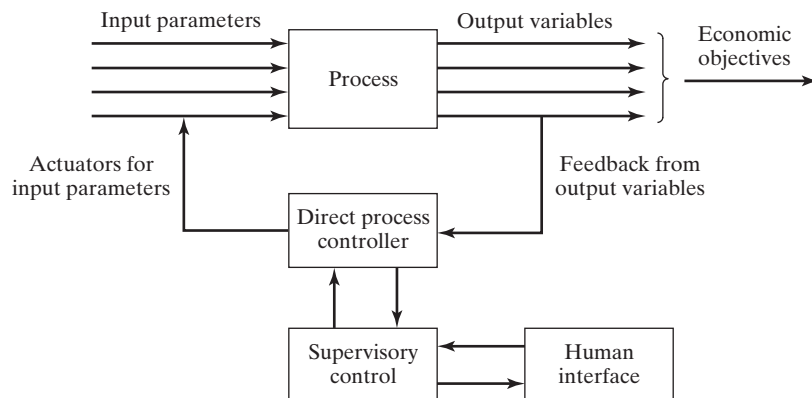


Figure 5.10 Supervisory control superimposed on other process-level control systems.

objectives for the process. In some applications, supervisory control is not much more than regulatory control or feedforward control. In other applications, the supervisory control system is designed to implement optimal or adaptive control. It seeks to optimize some well-defined objective function, which is usually based on economic criteria such as yield, production rate, cost, quality, or other objectives that pertain to process performance.

In the context of discrete manufacturing, SCADA is the control system that directs and coordinates the activities of several interacting pieces of equipment in a manufacturing cell or system, such as a group of machines interconnected by a material handling system. Again, the objectives of supervisory control are motivated by economic considerations. The control objectives might include minimizing part or product costs by determining optimum operating conditions, maximizing machine utilization through efficient scheduling, or minimizing tooling costs by tracking tool lives and scheduling tool changes.

Distributed Control Systems. As the previous description indicates, SCADA is implemented as a distributed system, in which a central computer communicates with multiple remote devices (e.g., PLCs and RTUs). The term *distributed control system* (DCS) is used to describe a configuration consisting of multiple microcomputers connected together to share and distribute the process-control workload. A DCS consists of the following components and features:

- Multiple process-control stations located throughout the plant to control the individual loops and devices of the process. PCs, PACs, PLCs, and RTUs are used at these stations.
- A central control room equipped with operator stations, where supervisory control of the plant occurs.
- Local operator stations distributed throughout the plant. This provides the DCS with redundancy. If a control failure occurs in the central control room, the local operator stations take over the central control functions. If a local operator station fails, the other local operator stations assume the functions of the failed station.
- All process and operator stations interact with each other by means of a communications network, or *data highway*, as it is often called.

These components are illustrated in a typical configuration of distributed process control in Figure 5.11. The distinction between DCS and SCADA is not always clear. Both terms can often be applied to the same system. The term *distributed system* emphasizes an interconnected collection of computers, whereas *supervisory control* emphasizes the use of a central computer to manage an interconnected collection of remote controller and data acquisition devices.

There are a number of benefits and advantages of distributed control: (1) A DCS can be installed for a given application in a very basic configuration, then enhanced and expanded as needed in the future; (2) because the system consists of multiple computers, this facilitates parallel multitasking; (3) because of its multiple computers, a DCS has built-in redundancy; (4) control cabling is reduced compared with a central computer-control configuration; and (5) networking provides process information throughout the enterprise for more efficient plant and process management.

The first DCS applications were in the process industries starting around 1970. In the discrete manufacturing industries, programmable logic controllers were introduced

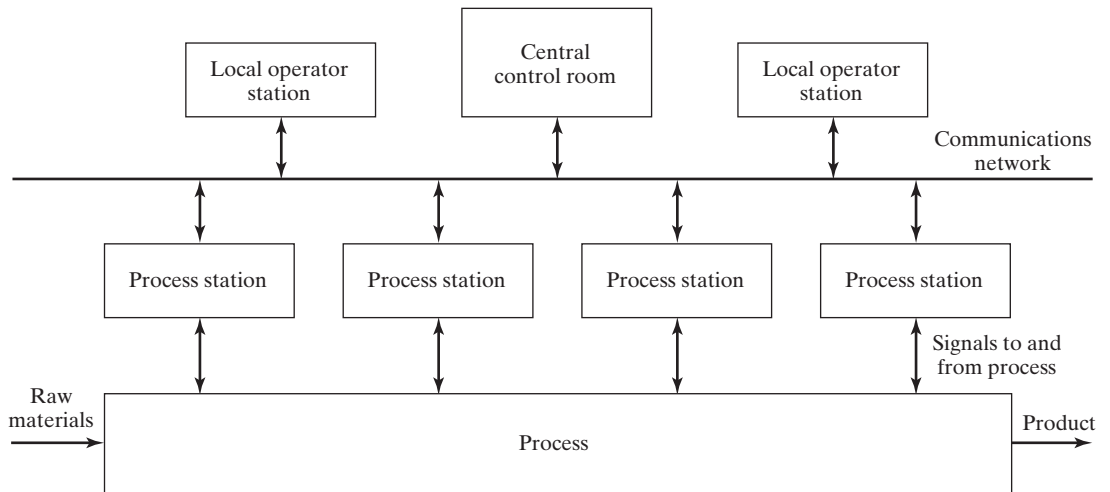


Figure 5.11 Distributed control system.

about the same time. The concept of distributed control applies equally well to PLCs: multiple PLCs located throughout a factory to control individual pieces of equipment but integrated by means of a common communications network. Introduction of personal computers shortly after the PLC and their subsequent increase in computing power and reduction in cost over the years have stimulated a significant growth in the adoption of PC-based DCSs for process-control applications.

PCs in Process Control. Today, personal computers have become one of the standard tools by which business is conducted, whether in manufacturing or in the service sector. Thus, it is no surprise that PCs are being used in growing numbers in process-control applications. Two basic categories of PC implementations in process control can be distinguished: (1) operator interface and (2) direct control. Whether used as the operator interface or for direct control, PCs are likely to be networked with other computers to create distributed control systems.

When used as the operator interface, the PC is interfaced to one or more PLCs or other devices (possibly other microcomputers) that directly control the process. Personal computers have been used to perform the operator interface function since the early 1980s. In this function, the computer performs certain monitoring and supervisory control functions, but it does not directly control the process. Some advantages of using a PC only as the operator interface are that (1) the PC provides a user-friendly interface for the operator; (2) the PC can be used for all of the conventional computing and data-processing functions that PCs traditionally perform; (3) the PLC or other device that is directly controlling the process is isolated from the PC, so a PC failure will not disrupt control of the process; and (4) the computer can be easily upgraded as PC technology advances and capabilities improve, while the PLC control software and connections with the process remain in place.

The second way of implementing PCs in process control is direct control, which means that the PC is interfaced directly to the process and controls its operations in real

time. Traditional thinking has been that it is too risky to permit the PC to directly control the production operation. If the computer fails, the uncontrolled operation might stop working, produce defective product, or become unsafe. Another factor is that conventional PCs, equipped with the usual business-oriented operating system and applications software, are designed for computing and data-processing functions, not for process control. They are not intended to be interfaced with an external process in the manner necessary for real-time process control. Finally, most PCs are designed to be used in an office environment, not in a harsh factory atmosphere.

Advances in both PC technology and available software have challenged this traditional thinking. Starting in the early 1990s, PCs have been installed at an accelerating pace for direct control of industrial processes. Several factors have enabled this trend:

- Widespread familiarity with PCs. User-friendly software for the home and business has certainly contributed to the popularity of PCs. There is an expectation among workers that they be provided with a computer in their workplace, even if that workplace is in a factory.
- Availability of high performance PCs, capable of satisfying the demanding requirements of process control.
- Trend toward *open architecture* in control systems design, in which vendors of control hardware and software agree to comply with published standards that allow their products to be interoperable. This means that components from different vendors can be interconnected in the same system. The traditional philosophy had been for each vendor to design proprietary systems, requiring the user to purchase a complete hardware and software package from one supplier. Open architecture allows the user a wider choice of products in the design of a given process-control application.
- Availability of PC operating systems that facilitate real-time control, multitasking, and networking. At the same time, these systems provide the user-friendliness of the desktop PC and most of the power of an engineering workstation. Installed in the factory, a PC equipped with the appropriate software can perform multiple functions simultaneously, such as data logging, trend analysis, and displaying an animated view of the process as it proceeds, all while reserving a portion of its CPU capacity for direct control of the process.

Regarding the harsh factory environment, this can be addressed by using industrial-grade PCs equipped with enclosures designed for the plant environment. Compared with the previously discussed PC/PLC configuration, in which the PC is used only as an operator interface, there is a cost savings from installing one PC for direct control rather than a PC plus a PLC. A related issue is data integration: Setting up a data link between a PC and a PLC is more complex than when the data are all in one PC. The advent of programmable automation controllers, which combine features of PCs and PLCs, has broadened the range of choices available for industrial process control.

Enterprise-Wide Integration of Factory Data. The most recent progression in PC-based distributed control is enterprise-wide integration of factory operations data, as depicted in Figure 5.12. This trend is consistent with modern information management and worker empowerment philosophies. These philosophies assume fewer levels of

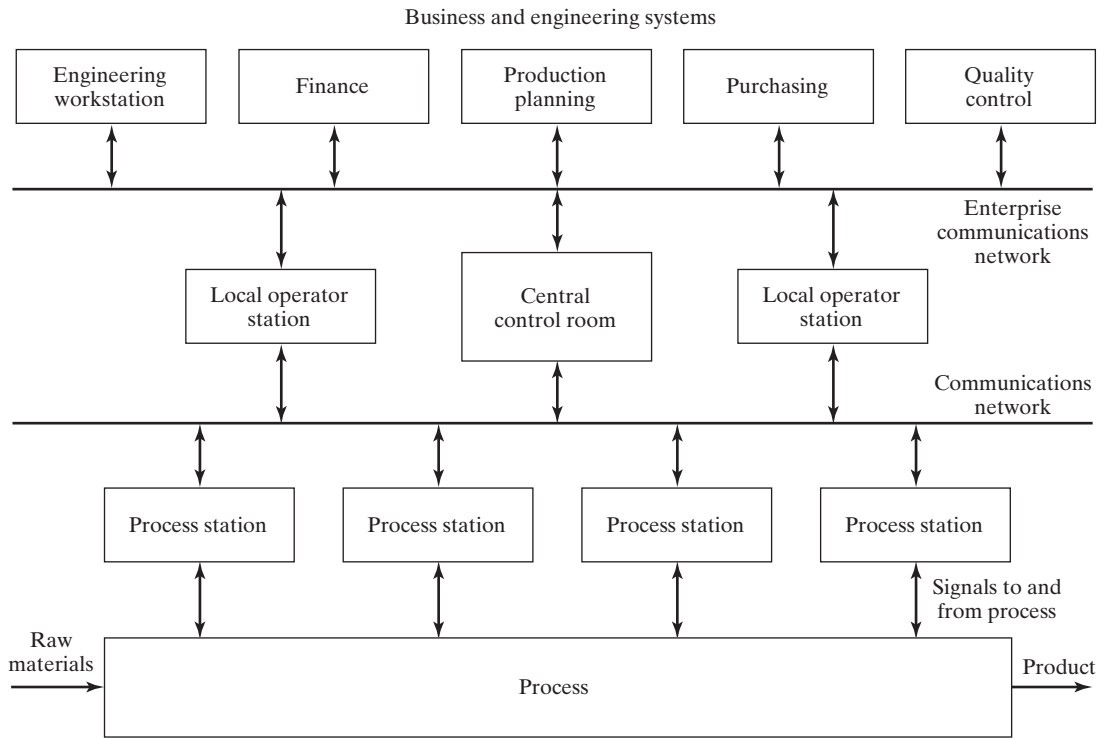


Figure 5.12 Enterprise-wide PC-based DCS.

company management and greater responsibilities for front-line workers in sales, order scheduling, and production. The networking technologies that allow such integration are available. The latest PC operating systems provide a number of built-in and optional features for connecting the industrial control system in the factory to enterprise-wide business systems and supporting data exchange between various applications (e.g., allowing data collected in the plant to be used in analysis packages, such as spreadsheets). The term *enterprise resource planning* (ERP) refers to a computer software system that achieves company-wide integration of not only factory data but all the other data required to execute the business functions of the organization. A key feature of ERP is the use of a single central database that can be accessed from anywhere in the company. Some of the details of ERP are discussed in Section 25.7.

Following are some of the capabilities that are enabled by making process data available throughout the enterprise: (1) managers can have more direct access to factory floor operations, (2) production planners can use the most current data on times and production rates in scheduling future orders, (3) sales personnel can provide realistic estimates on delivery dates based on current shop loading, (4) customers are able to obtain current status information on their orders, (5) quality control personnel are made aware of real or potential quality problems on current orders based on access to quality performance histories from previous orders, (6) cost accounting has access to the most recent production cost data, and (7) production personnel can access part and product design details to clarify ambiguities and do their jobs more effectively.

REFERENCES

- [1] ASTROM, K. J., and B. WITTENMARK, *Computer-Controlled Systems—Theory and Design*, 3rd ed., Dover Publishing, Mineola, New York, NY, 2011.
- [2] BATESON, R. N., *Introduction to Control System Technology*, 7th ed., Prentice Hall, Upper Saddle River, NJ, 2002.
- [3] BOUCHER, T. O., *Computer Automation in Manufacturing*, Chapman & Hall, London, UK, 1996.
- [4] CAWLFIELD, D., “PC-Based Direct Control Flattens Control Hierarchy, Opens Information Flow,” *Instrumentation & Control Systems*, September 1997, pp. 61–67.
- [5] GROOVER, M. P., “Industrial Control Systems,” *Maynard’s Industrial Engineering Handbook*, 5th ed., K. Zandin (ed.), McGraw-Hill Book Company, New York, NY, 2001.
- [6] HIRSH, D., “Acquiring and Sharing Data Seamlessly,” *Instrumentation and Control Systems*, October 1997, pp. 25–35.
- [7] OLSSON, G., and G. PIANI, *Computer Systems for Automation and Control*, Prentice Hall, London, UK, 1992.
- [8] PLATT, G., *Process Control: A Primer for the Nonspecialist and the Newcomer*, 2nd ed., Instrument Society of America, Research Triangle Park, NC, 1998.
- [9] RULLAN, A., “Programmable Logic Controllers versus Personal Computers for Process Control,” *Computers and Industrial Engineering*, Vol. 33, Nos. 1–2, 1997, pp. 421–424.
- [10] STENERSON, J., *Fundamentals of Programmable Logic Controllers, Sensors, and Communications*, 3rd ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2004.
- [11] www.optp22.com/site/fd_whatispac.aspx
- [12] www.wikipedia.org/wiki/Distributed_Control_System
- [13] www.wikipedia.org/wiki/Industrial_Control_System
- [14] www.wikipedia.org/wiki/Programmable_Logic_Controller
- [15] www.wikipedia.org/wiki/Remote_Terminal_Unit
- [16] www.wikipedia.org/wiki/SCADA

REVIEW QUESTIONS

- 5.1 What is industrial control?
- 5.2 What is the difference between a continuous variable and a discrete variable?
- 5.3 Name and briefly define each of the three types of discrete variables.
- 5.4 What is the difference between a continuous control system and a discrete control system?
- 5.5 What is feedforward control?
- 5.6 What is adaptive control?
- 5.7 What are the three functions of adaptive control?
- 5.8 What is the difference between an event-driven change and a time-driven change in discrete control?
- 5.9 What are the two basic requirements that must be managed by a computer controller to achieve real-time control?
- 5.10 What is polling in computer process control?
- 5.11 What is an interlock?
- 5.12 What are the two types of interlocks in industrial control?

- 5.13 What is an interrupt system in computer process control?
- 5.14 What is computer process monitoring?
- 5.15 What is direct digital control (DDC), and why is it no longer used in industrial process-control applications?
- 5.16 What is a programmable logic controller (PLC)?
- 5.17 Are programmable logic controllers more closely associated with the process industries or the discrete manufacturing industries?
- 5.18 What is a programmable automation controller (PAC)?
- 5.19 What is a remote terminal unit?
- 5.20 What does SCADA stand for, and what is it?
- 5.21 What is a distributed control system?
- 5.22 What does open architecture mean in control systems design?

Hardware Components for Automation and Process Control

CHAPTER CONTENTS

- 6.1 Sensors
- 6.2 Actuators
 - 6.2.1 Electric Motors
 - 6.2.2 Other Types of Actuators
- 6.3 Analog–Digital Conversions
 - 6.3.1 Analog-to-Digital Converters
 - 6.3.2 Digital-to-Analog Converters
- 6.4 Input/Output Devices for Discrete Data
 - 6.4.1 Contact Input/Output Interfaces
 - 6.4.2 Pulse Counters and Generators

To implement automation and process control, the control computer must collect data from and transmit signals to the process. In Section 5.1.2, process variables and parameters were classified as continuous or discrete, with several subcategories in the discrete class. The digital computer operates on digital (binary) data, whereas at least some of the data from the physical process are continuous and analog. Accommodations for this difference must be made in the computer–process interface. The components required to implement this interface are the following:

1. Sensors to measure continuous and discrete process variables.
2. Actuators to drive continuous and discrete process parameters.
3. Devices to convert continuous analog signals into digital data and digital data into analog signals.
4. Input/output devices for discrete data.

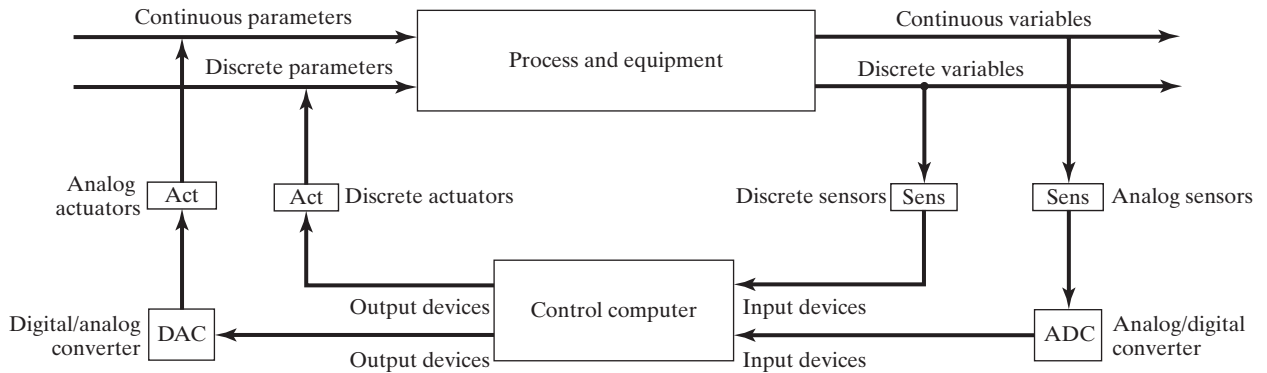


Figure 6.1 The computer process control system, showing the various types of components required to interface the process with the computer.

Figure 6.1 shows the overall configuration of the process control system and how these four categories are used to interface the process with the computer. This model represents the general arrangement of the control systems in CNC machine tools, industrial robots, and PLC systems described in Chapters 7 through 9, as well as most of the material handling systems and manufacturing systems described in Chapters 10 through 19. The present chapter is organized around the four component categories.

6.1 SENSORS

A wide variety of sensors are available for collecting data from the manufacturing process for use in feedback control. A sensor is a *transducer*, which is a device that converts a physical variable of one form into another form that is more useful for the given application. In particular, a *sensor* is a device that converts a physical stimulus or variable of interest (such as temperature, force, pressure, or displacement) into a more convenient form (usually an electrical quantity such as voltage) for the purpose of measuring the stimulus. The conversion process quantifies the variable, so that it can be interpreted as a numerical value.

Sensors can be classified in various ways, the most relevant of which for this discussion is by the category of stimulus or physical variable measured, as presented in Table 6.1. For each category, there may be multiple variables that can be measured, as indicated in the right-hand column. These variables are typical of those found in industrial processes.

In addition to the type of stimulus, sensors are also classified as analog or discrete, consistent with the classification of process variables in Chapter 5. An *analog sensor* produces a continuous analog signal such as electrical voltage, whose value varies in an analogous manner with the variable being measured. Examples are thermocouples, strain gages, and potentiometers. The output signal from an analog measuring device must be converted to digital data by an analog-to-digital converter (Section 6.3.1) in order to be used by a digital computer.

A *discrete sensor* produces an output that can have only certain values. Discrete sensors are often divided into two categories: binary and digital. A *binary sensor* produces an on/off signal. The most common devices operate by closing an electrical contact from a normally open position. Limit switches operate in this manner. Other binary sensors include photoelectric sensors and proximity switches. A *digital sensor* produces a

TABLE 6.1 Stimulus Categories and Associated Physical Variables

Category	Examples of Physical Variables
Mechanical	Position (displacement, linear and angular), velocity, acceleration, force, torque, pressure, stress, strain, mass, density
Electrical	Voltage, current, charge, resistance, conductivity, capacitance
Thermal	Temperature, heat, heat flow, thermal conductivity, specific heat
Radiation	Type of radiation (e.g., gamma rays, X-rays, visible light), intensity, wavelength
Magnetic	Magnetic field, flux, conductivity, permeability
Chemical	Component identities, concentration, pH levels, presence of toxic ingredients, pollutants

Sources: Based on similar tables in [6] and [7].

digital output signal, either in the form of a set of parallel status bits (e.g., a photoelectric sensor array) or as a series of pulses that can be counted (e.g., an optical encoder). In either case, the digital signal represents the quantity that is measured. Digital transducers are becoming increasingly common because they are easy to read when used as stand-alone measuring instruments and because they are compatible with digital computer systems. Many of the common sensors and measuring devices used in industrial control systems are listed alphabetically in Table 6.2. A significant trend in sensor technology has been the development of very small sensors. The term *microsensor* refers to measuring devices whose physical features have dimensions in the micron range, where 1 micron ($1 \mu\text{m}$) = 10^{-6} m. Microsensors are usually fabricated out of silicon using processing techniques associated with integrated circuit manufacture.

Sensors are distinguished as active or passive. An **active sensor** responds to the stimulus without the need for any external power. An example is a thermocouple, which responds to an increase in temperature by generating a small voltage (millivolt range) that is functionally related to temperature (in the ideal, its voltage is directly proportional to temperature). A **passive sensor** requires an external source of power in order to operate. A thermistor illustrates this case. It also measures temperature, but its operation requires an electric current to be passed through it. As the temperature increases, the thermistor's electrical resistance is altered. The resistance can be measured and related back to temperature.

For each sensor, there is a **transfer function**, which is the relationship between the value of the physical stimulus and the value of the signal produced by the sensor in response to the stimulus. The transfer function is the input/output relationship. The stimulus is the input, and the signal generated by the device is the output. The transfer function can be expressed simply as:

$$S = f(s) \quad (6.1)$$

where S = the output signal, usually voltage; s = the stimulus; and $f(s)$ is the functional relationship between them.

Limit switches and other binary sensors have functional relationships that are binary, defined by the following expressions:

$$S = 1 \text{ if } s > 0 \text{ and } S = 0 \text{ if } s \leq 0 \quad (6.2)$$

The ideal functional form for an analog measuring device is a simple proportional relationship, such as

$$S = C + ms \quad (6.3)$$

TABLE 6.2 Common Measuring Devices Used in Automation

Measuring Device	Description
Accelerometer	Analog device used to measure vibration and shock. Can be based on various physical phenomena (e.g., capacitive, piezoresistive, piezoelectric).
Ammeter	Analog device that measures the strength of an electrical current.
Bimetallic switch	Binary switch that uses a bimetallic coil to open and close electrical contact as a result of temperature change. A bimetallic coil consists of two metal strips of different thermal expansion coefficients bonded together.
Bimetallic thermometer	Analog temperature-measuring device consisting of bimetallic coil (see previous definition) that changes shape in response to temperature change. Shape change of coil can be calibrated to indicate temperature.
Dynamometer	Analog device used to measure force, power, or torque. Can be based on various physical phenomena (e.g., strain gage, piezoelectric effect).
Float transducer	Float attached to lever arm. Pivoting movement of lever arm can be used to measure liquid level in vessel (analog device) or to activate contact switch (binary device).
Fluid flow sensor	Analog measurement of liquid flow rate, usually based on pressure difference between flow in two pipes of different diameter.
Fluid flow switch	Binary switch similar to limit switch but activated by increase in fluid pressure rather than by contacting object.
Limit switch (mechanical)	Binary contact sensor in which lever arm or pushbutton closes (or opens) an electrical contact.
Linear encoder	Digital device used to measure linear position and/or speed using a transducer that reads a stationary linear scale indicating position. Speed can be measured as position divided by time lapse. Transducer technologies include optical, magnetic, and capacitive.
Linear variable differential transformer	Analog position sensor consisting of primary coil opposite two secondary coils separated by a magnetic core. When primary coil is energized, induced voltage in secondary coil is function of core position. Can also be adapted to measure force or pressure.
Manometer	Analog device used to measure pressure of gas or liquid. It is based on comparison of known and unknown pressure forces. A barometer is a specific type of manometer used to measure atmospheric pressure.
Ohmmeter	Analog device that measures electrical resistance.
Photoelectric sensor array	Digital sensor consisting of linear series of photoelectric switches. Array is designed to indicate height or size of object interrupting some but not all of the light beams.
Photoelectric switch	Binary noncontact sensor (switch) consisting of emitter (light source) and receiver (photocell) triggered by interruption of light beam. Two common types are: (1) transmitted type, in which object blocks light beam between emitter and receiver; and (2) retroreflective type, in which emitter and receiver are located in one device and beam is reflected off remote reflector except when object breaks the reflected light beam.
Photometer	Analog sensor that measures illumination and light intensity. Can be based on various photodetector devices, including photodiodes, phototransistors, and photoresistors.
Piezoelectric transducer	Analog device based on piezoelectric effect of certain materials (e.g., quartz) in which an electrical charge is produced when the material is deformed. Charge can be measured and is proportional to deformation. Can be used to measure force, pressure, and acceleration.
Potentiometer	Analog position sensor consisting of resistor and contact slider. Position of slider on resistor determines measured resistance. Available for both linear and rotational (angular) measurements.

(continued)

TABLE 6.2 (continued)

Measuring Device	Description
Proximity switch	Binary noncontact sensor is triggered when nearby object induces changes in electromagnetic field. Can be based on any of several physical principles, including inductance, capacitance, ultrasonics, and optics.
Radiation pyrometer	Analog temperature-measuring device that senses electromagnetic radiation in the visible and infrared range of spectrum.
Resistance-temperature detector	Analog temperature-measuring device based on increase in electrical resistance of a metallic material as temperature is increased.
Rotary encoder	Digital device used to measure angular position and/or speed, using a transducer that converts location on a circular scale into rotational position. Rotational speed can be measured as position divided by time lapse. Transducer technologies include optical, magnetic, and capacitive. The optical encoder is described in more detail in Section 7.4.2 on numerical control positioning systems.
Strain gage	Widely used analog sensor to measure force, torque, or pressure. It is based on change in electrical resistance resulting from strain of a conducting material.
Tachometer	Analog device consisting of DC generator that produces an electrical voltage proportional to rotational speed.
Tactile sensor	Measuring device that indicates physical contact between two objects. Can be based on any of several physical devices such as electrical contact (for conducting materials) and piezoelectric effect.
Thermistor	Contraction of <i>thermal</i> and <i>resistor</i> . Analog temperature-measuring device based on change in electrical resistance of a semiconductor material as temperature is increased.
Thermocouple	Analog temperature-measuring device based on thermoelectric effect, in which the junction of two dissimilar metal wires emits a small voltage that is a function of the temperature of the junction. Common standard thermocouples include chromel-alumel, iron-constantan, and chromel-constantan.
Ultrasonic range sensor	Time lapse between emission and reflection (from object) of high-frequency sound pulses is measured. Can be used to measure distance or simply to indicate presence of object.

where C is the output value at a stimulus value of zero, and m is the constant of proportionality between s and S . The constant m can be thought of as the sensitivity of the sensor. It is a measure of how much the output or response of the sensor is affected by the stimulus. For example, the sensitivity of a standard chromel/alumel thermocouple generates 40.6 microvolts (μV) per degree Celsius ($^{\circ}\text{C}$). Other transfer functions have more complex mathematical forms, including differential equations that include time dynamics, which means that there is a time delay between when the stimulus occurs and when the output signal accurately indicates the value of the stimulus.

Before using any measuring device, the operator must calibrate it to determine the transfer function, or the inverse of the transfer function, which converts the output S into the value of the stimulus or measured variable s . The ease with which the calibration procedure can be accomplished is one criterion by which a measuring device can be evaluated. A list of desirable features of sensors for process control is presented in Table 6.3. Few sensors achieve perfect scores in all of these criteria, and the control system engineer must decide which features are the most important in selecting among the variety of available sensors and transducers for a given application.

TABLE 6.3 Desirable Features for Selecting Sensors Used in Automated Systems

Desirable Feature	Definition and Comments
High accuracy	The measurement contains small systematic errors about the true value.
High precision	The random variability or noise in the measured value is low.
Wide operating range	The sensor possesses high accuracy and precision over a wide range of values of the physical variable being measured.
High speed of response	The device responds quickly to changes in the physical variable being measured. Ideally, the time lag would be zero.
Ease of calibration	Calibration of the device is quick and easy.
Minimum drift	Drift refers to the gradual loss in accuracy over time. High drift requires frequent recalibration of the sensor.
High reliability	The device is not subject to frequent malfunctions or failures during service. It is capable of operating in the potentially harsh environment of the manufacturing process where it will be applied.
Low cost	The cost to purchase (or fabricate) and install the device is low relative to the value of the data provided by the sensor.

6.2 ACTUATORS

In industrial control systems, an actuator is a hardware device that converts a controller command signal into a change in a physical parameter. The change in the physical parameter is usually mechanical, such as a position or velocity change. An actuator is a transducer, because it changes one type of physical quantity, such as electric current, into another type of physical quantity, such as rotational speed of an electric motor. The controller command signal is usually low level, and so an actuator may also require an amplifier to strengthen the signal sufficiently to drive the actuator.

Most actuators can be classified into one of three categories, according to the type of amplifier: (1) electric, (2) hydraulic, and (3) pneumatic. Electric actuators are most common; they include electric motors of various kinds, solenoids, and electromechanical relays. Electric actuators can be either linear (output is linear displacement) or rotational (output is angular displacement). Hydraulic actuators use hydraulic fluid to amplify the controller command signal. The available devices provide either linear or rotational motion. Hydraulic actuators are often specified when large forces are required. Pneumatic actuators use compressed air (typically “shop air” in the factory) as the driving power. Again, both linear and rotational pneumatic actuators are available. Because of the relatively low air pressures involved, these actuators are usually limited to relatively low-force applications compared with hydraulic actuators.

This section is organized into two topics: (1) electric motors, and (2) other types of actuators, including some that are powered electrically. The coverage is not comprehensive. Its purpose is to provide an introductory treatment of the different types of actuators available to implement automation and process control. More complete coverage can be found in several of the references, including [2], [3], [11], [13], [15], [16], [17], and [20].

6.2.1 Electric Motors

An electric motor converts electrical power into mechanical power. Most electric motors are rotational. They are available in many different styles and sizes, one of which is depicted in Figure 6.2(a). Their operation can be explained with reference to Figure 6.2(b). The motor consists of two basic components, a stator and a rotor. The *stator* is the ring-shaped stationary component, and the *rotor* is the cylindrical part that rotates inside the stator. The rotor is assembled around a shaft that is supported by bearings, and the shaft can be coupled to machinery components such as gears, pulleys, leadscrews, or spindles. Electric current supplied to the motor generates a continuously switching magnetic field that causes the rotor to develop torque and rotate in its attempt to align its poles with the opposite poles of the stator. The details relating to type of current (alternating or direct), how the continuously switching magnetic field is created, and other aspects of the motor's construction give rise to a great variety of electric motors. The simplest and most common classification is between direct current (DC) motors and alternating current (AC) motors. Within each category, there are several subcategories. Four types that are used in automation and industrial control are discussed here: (1) DC motors, (2) AC motors, (3) stepper motors, and (4) linear motors.

DC Motors. DC motors are powered by a constant current and voltage. The continuously switching magnetic field is achieved by means of a rotary switching device, called a *commutator*, which rotates with the rotor and picks up current from a set of carbon brushes that are components of the stator assembly. Its function is to continually change the relative polarity between the rotor and the stator, so that the magnetic field produces a torque to continuously turn the rotor. Use of a commutator is the traditional construction of a DC motor. This is a disadvantage because it results in arcing, worn brushes, and maintenance problems. A special type of DC motor avoids the use of the commutator and brushes. Called a *brushless DC motor*, it uses solid-state circuitry to replace the brushes and commutator components. Elimination of these parts has the added benefit of reducing the inertia of the rotor assembly, allowing higher speed operation.

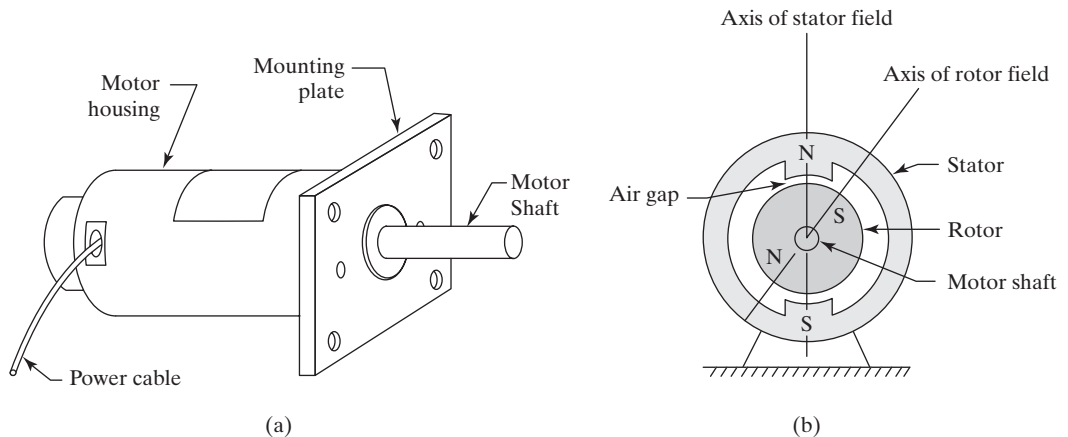


Figure 6.2 A rotary electric motor: (a) typical configuration and (b) diagram showing its operation.

DC motors are widely used for two reasons. The first is the convenience of using direct current as the power source. For example, the small electric motors in automobiles are DC because the car's battery supplies direct current. The second reason for the popularity of DC motors is that their torque–speed relationships are attractive in many applications compared to AC motors.

DC servomotors are a common type of DC motor used in mechanized and automated systems, and it will be used to represent this class of electric motors. The term *servomotor* simply means that a feedback loop is used to regulate speed. In a DC servomotor, the stator typically consists of two permanent magnets on opposite sides of the rotor. The rotor, called the *armature* in a DC motor, consists of copper wire windings around a ferrous metal core. Input current is provided to the windings through the commutator and interacts with the magnetic field of the stator to produce the torque that drives the rotor. The magnitude of the rotor torque is a function of the current passing through the windings, and the relationship can be modeled by the following equation:

$$T = K_t I_a \quad (6.4)$$

where T = motor torque, N-m; I_a = current flowing through the armature, A; and K_t = the motor's torque constant, N-m/A. When current is first applied to the motor, torque is at its maximum value. This is called the *stall torque*, and the corresponding current is also a maximum value. As the armature begins to rotate, both torque and current decrease because rotating the armature in the magnetic field of the stator produces a voltage across the armature terminals, called the *back-emf*. In effect, the motor acts like a generator, and the back-emf increases with rotational speed as follows:

$$E_b = K_v \omega \quad (6.5)$$

where E_b = back-emf, V; ω = angular velocity, rad/sec; and K_v = the voltage constant of the motor, V/(rad/sec). The effect of the back-emf is to reduce the current flowing through the armature windings. The angular velocity in rad/sec can be converted to the more familiar rotational speed as follows:

$$N = \frac{60\omega}{2\pi} \quad (6.6)$$

where N = rotational speed, rev/min.

Given the resistance of the armature R_a and an input voltage V_{in} supplied to the motor terminals, the starting armature current is given by the following:

$$I_a = \frac{V_{in}}{R_a} \quad (6.7)$$

This starting current produces a starting torque as given by Equation (6.4). But as the armature begins to rotate, it generates the back-emf E_b , which reduces the available voltage. Thus, the actual armature current depends on the rotational speed of the rotor,

$$I_a = \frac{V_{in} - E_b}{R_a} = \frac{V_{in} - K_v \omega}{R_a} \quad (6.8)$$

where all of the terms are defined earlier. Combining Equations (6.4) and (6.8), the torque produced by the DC servomotor at a speed ω is

$$T = K_t \left(\frac{V_{in} - K_v \omega}{R_a} \right) \quad (6.9)$$

The mechanical power delivered by the motor is the product of torque and velocity, as defined in the following equation:

$$P = T\omega \quad (6.10)$$

where P = power in N-m/sec (Watts); T = motor torque, N-m; and ω = angular velocity, rad/sec. The corresponding horsepower is given by

$$HP = \frac{T\omega}{745.7} \quad (6.11)$$

where the constant 745.7 is the conversion factor $745.7 \text{ W} = 1 \text{ hp}$.

The servomotor is connected either directly or through a gear reduction to a piece of machinery. The machinery may be a fan, pump, spindle, table drive, or similar mechanical apparatus. The apparatus represents the load that is driven by the motor. The load requires a certain torque to operate, and the torque is usually related to rotational speed in some way. In general, the torque increases with speed. In the simplest case, the relationship is proportional:

$$T_L = K_L\omega \quad (6.12)$$

where T_L = load torque, N-m; and K_L = the constant of proportionality between torque and angular velocity, N-m/(rad/sec). The functionality between K_L and T_L may be other than proportional, such that K_L itself depends on the angular velocity. For example, the torque required to drive a fan increases approximately as the square of the rotational speed, that is, $T_L \propto \omega^2$.

The torque developed by the motor and the torque required by the load must be balanced. That is, $T = T_L$ in steady-state operation and this torque is called the *operating point*. The motor torque relationship with angular velocity can be plotted as shown in Figure 6.3, called the *torque-speed curve*. Also shown in the figure is the load torque relationship. The intersection of the two plots is the operating point, which is defined by the values of torque and angular velocity.

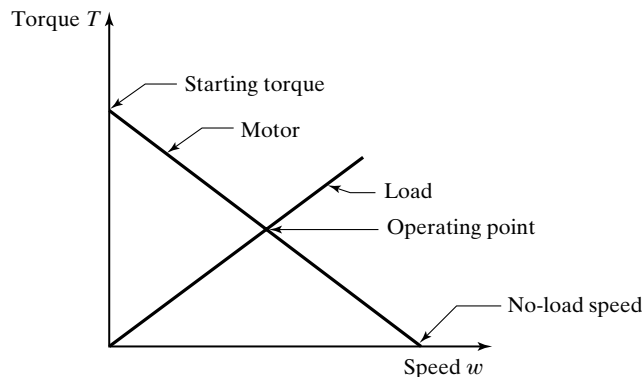


Figure 6.3 Torque-speed curve of a DC servomotor (idealized), and typical load torque relationship. The intersection of the two plots is the operating point.

EXAMPLE 6.1 DC Servomotor Operation

A DC servomotor has a torque constant $K_t = 0.095$ N-m/A. Its voltage constant is $K_v = 0.11$ V/(rad/sec). The armature resistance is $R_a = 1.6$ ohms. A terminal voltage of 24 V is used to operate the motor. Determine (a) the starting torque generated by the motor just as the voltage is first applied, (b) the maximum speed at a torque of zero, and (c) the operating point of the motor when it is connected to a load whose torque characteristic is given by $T_L = K_L\omega$ and $K_L = 0.007$ N-m/(rad/sec). Express the rotational speed as rev/min.

Solution: (a) At $\omega = 0$, the armature current is

$$I_a = V_{in}/R_a = 24/1.6 = 15 \text{ A.}$$

The corresponding torque is therefore $T = K_t I_a = 0.095(15) = \mathbf{1.425 \text{ N-m}}$

(b) The maximum speed is achieved when the back-emf E_b equals the terminal voltage V_{in} .

$$E_b = K_v\omega = 0.11\omega = 24 \text{ V}$$

$$\omega = 24/0.11 = 218.2 \text{ rad/sec}$$

$$N = 60(218.2)/2\pi = \mathbf{2,084 \text{ rev/min}}$$

(c) The load torque is given by the equation $T_L = 0.007\omega$

The motor torque equation is given by Equation (6.9). Using the given data,

$$T = 0.095(24 - 0.11\omega)/1.6 = 1.425 - 0.00653\omega$$

Setting $T = T_L$ and solving for ω results in $\omega = 105.3$ rad/sec

Converting this to rotation speed, $N = 60(105.3)/2\pi = \mathbf{1,006 \text{ rev/min}}$

EXAMPLE 6.2 DC Servomotor Power

In the previous example, what is the power delivered by the motor at the operating point? Express the answer as (a) Watts and (b) horsepower.

Solution: At $\omega = 105.3$ rad/sec, and using the load torque equation,

$$T_L = 0.007(105.3) = 0.737 \text{ N-m}$$

(a) Power $P = T\omega = 0.737(105.3) = \mathbf{776 \text{ W}}$

(b) Horsepower $HP = 77.6/745.7 = \mathbf{0.104 \text{ hp}}$

The preceding model of DC servomotor operation neglects certain losses and inefficiencies that occur in these motors (similar losses occur in all electric motors). These losses include brush contact losses at the commutator, armature losses, windage (air drag

losses at high rotational speeds of the rotor), and mechanical friction losses at the bearings. The model also neglects the dynamics of motor operation. In fact, the inertial characteristics of the motor itself and the load that is driven by it, as well as any transmission mechanisms (e.g., gearbox), would play an important role in determining how the motor operates as a function of time. Despite their limitations, the equations do illustrate one of the significant advantages of a DC servomotor: its ability to deliver a very high torque at a starting velocity of zero. In addition, it is a variable-speed motor, and its direction of rotation can be readily reversed. These are important considerations in many automation applications where the motor is called upon to frequently start and stop its rotation or to reverse direction.

AC Motors. Although DC motors have several attractive features, they have two important disadvantages: (1) the commutator and brushes used to conduct current from the stator assembly to the rotor result in maintenance problems with these motors,¹ and (2) the most common electrical power source in industry is alternating current, not direct current. In order to use AC power to drive a DC motor, a rectifier must be added to convert the alternating current to direct current. For these reasons, AC motors are widely used in many industrial applications. They do not use brushes, and they are compatible with the predominant type of electrical power.

Alternating current motors operate by generating a rotating magnetic field in the stator, and the rotational speed of the rotor depends on the frequency of the input electrical power. The rotor is forced to turn at a speed that depends on the rotating magnetic field. AC motors can be classified into two broad categories: synchronous motors and induction motors.

Synchronous motors operate by energizing the rotor with alternating current, which generates a magnetic field in the gap separating the rotor and the stator. This magnetic field creates a torque that turns the rotor at the same rotational speed as the magnetic forces in the stator. The term *synchronous* derives from the fact that the rotor rotation is synchronized with the AC frequency in steady-state operation. Synchronous motors cannot start by themselves from zero speed; they require a device, sometimes called an *exciter*, to initiate rotation of the rotor when power is first supplied to the motor. The exciter, which may be an electric motor itself, accelerates the rotational speed of the rotor so that it can be synchronized with that of the stator's rotating magnetic field.

Induction motors are probably the most widely used motors in the world, due to their relatively simple construction and low manufacturing cost. In the operation of this motor type, a magnetic field is induced (hence the term *induction*) in the rotor from the stator. Because of this feature, the rotor in most induction motors does not need electrical current from an external power supply. Thus, no brushes or other means of connection are required for the rotating component of an induction motor. Unlike synchronous motors, induction motors operate at speeds that are slower than the synchronous speed. The steady-state rotational speed depends on the load that the motor is driving. In fact, if the rotor speed were equal to the synchronous speed of the stator magnetic field, then no induced voltage and no torque would be generated in the rotor. By the same reasoning, when AC power is first applied to an induction motor, the induced magnetic field and torque are maximum, so no exciter is needed to start the motor turning.

¹This disadvantage is eliminated by the use of brushless DC motors.

Both synchronous motors and induction motors operate at constant speeds. Most of their applications are those in which running at a fixed speed is required. This is a disadvantage in many automation applications because frequent speed changes are often necessary with much starting and stopping. The speed issue is sometimes addressed by using adjustable-frequency drives (called *inverters*) that control the cycle rate of the AC power to the motor. Motor speed is proportional to frequency, so changing the frequency changes the motor speed. Advances in solid-state electronics have also improved speed control for AC motors, and they are now competitive in some applications traditionally reserved for DC motors.

Stepper Motors. Also called *step motors* and *stepping motors*, this motor type provides rotation in the form of discrete angular displacements, called step angles. Each angular step is actuated by a discrete electrical pulse. The total angular rotation is controlled by the number of pulses received by the motor, and rotational speed is controlled by the frequency of the pulses. The step angle is related to the number of steps for the motor according to the relationship

$$\alpha = \frac{360}{n_s} \quad (6.13)$$

where α = the step angle, degrees, °; and n_s = the number of steps for the stepper motor, which must be an integer value. Typical values for the step angle in commercially available stepper motors are 7.5°, 3.6°, and 1.8°, corresponding to 48, 100, and 200 steps (pulses) per revolution of the motor. The total angle through which the motor rotates A_m is given by

$$A_m = n_p \alpha \quad (6.14)$$

where A_m is measured in degrees, °; n_p = the number of pulses received by the motor; and α = the step angle. The angular velocity ω (rad/sec) and speed of rotation N (rev/min) are given by the expressions

$$\omega = \frac{2\pi f_p}{n_s} \quad (6.15)$$

$$N = \frac{60f_p}{n_s} \quad (6.16)$$

where f_p = pulse frequency, pulses/sec or Hz; and n_s = the number of steps in the motor, steps/rev or pulses/rev.

The typical torque–speed relationships for a stepper motor are shown in Figure 6.4. As in the DC servomotor, torque decreases with increased rotational speeds. And because rotational speed is related to pulse frequency in the stepper motor, torque is lower at higher pulse rates. As indicated in the figure, there are two operating modes, locked-step and slewing. In the locked-step mode, each pulse received by the motor causes a discrete angular step to be taken; the motor starts and stops (at least approximately) with each pulse. In this mode the motor can be started and stopped, and its direction of rotation can be reversed. In the slewing mode, usually associated with higher speeds, the motor's rotation is more or less continuous and does not allow for stopping or reversing with each subsequent step. Nevertheless, the rotor does respond to each individual pulse; that is, the relationship between rotating speed and pulse frequency is retained in the slewing mode.

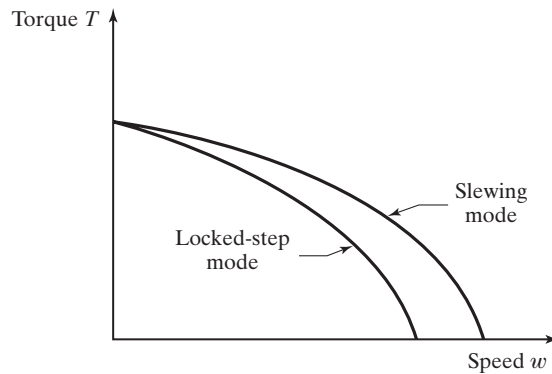


Figure 6.4 Typical torque–speed curve of a stepper motor.

Stepper motors are used in open-loop control systems for applications in which torque and power requirements are low to modest. They are widely used in machine tools and other production machines, industrial robots, x - y plotters, medical and scientific instruments, and computer peripherals. Probably the most common application is to drive the hands of analog quartz watches.

Rotary-to-Linear Motion Conversion. The motor types discussed above all produce rotary motion and apply torque. Many actuator applications require linear motion and the application of force. A rotating motor can be used in these applications by converting its rotary motion into linear or translational motion. The following are some of the common conversion mechanisms used for this purpose:

- *Leadscrews and ball screws.* The motor shaft is connected to a leadscrew or ball screw, which have helical threads throughout their lengths. A lead nut or ball nut is threaded onto the screw and prevented from rotating when the screw rotates; thus, the nut is moved linearly along the screw. Direction of linear motion depends on the direction of rotation of the screw.
- *Pulley systems.* The motor shaft is connected to the driver wheel in a pulley system, around which a belt, chain, or other flexible material forms a loop with an idler wheel. As the motor shaft rotates, the flexible material is pulled linearly between the pulley wheels.
- *Rack and pinion.* The motor shaft is connected to a pinion gear that is mated with a rack, which is a straight gear with tooth spacings that match those of the gear. As the gear is rotated, the rack is moved linearly.

These arrangements are depicted in Figure 6.5. Of the three categories, the use of leadscrews and ball screws is most common in machine tools, industrial robots, and other automation applications. A gear reduction box is often inserted between the motor shaft and the screw to reduce speed and increase torque and precision. Ball screws are to leadscrews as ball bearings are to conventional sliding bearings. The use of screws is discussed in the context of numerical control positioning systems in Section 7.4. Pulley systems are common in material transport equipment such as belt and chain conveyors and hoists.

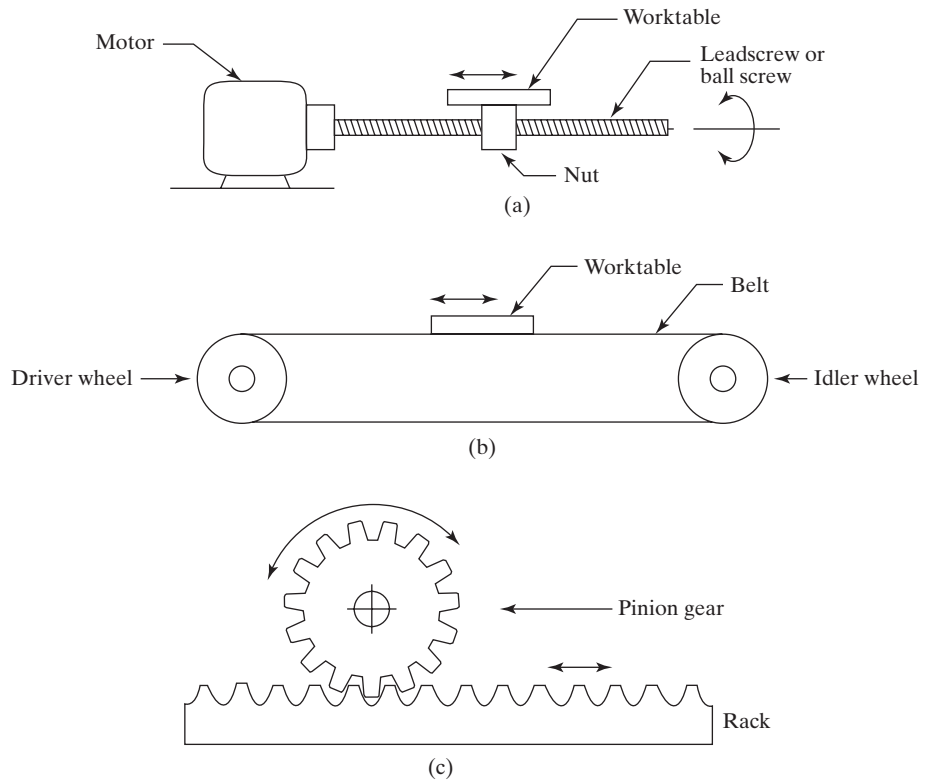


Figure 6.5 Mechanisms to convert rotary motion into linear motion: (a) leadscrew or ball screw, (b) pulley system, and (c) rack and pinion.

Belt-driven pulley systems can also be used for positioning. Rack-and-pinion mechanisms are found in gear systems, for example, rack-and-pinion steering in automobiles.

Linear Motors. A linear electric motor provides a linear motion directly; it does not require a rotary-to-linear conversion. Its operation is similar to that of rotary electric motors, except that the ring-shaped stator and cylindrical-shaped rotor are straight rather than circular. The rotor, known as the *forcer* in linear motor terminology, consists of wire windings encased in a non-conducting material such as epoxy, and the magnetic field that drives the forcer consists of a series of magnets contained in a straight track, which corresponds to the stator. Just as a rotary motor requires bearings to align the rotor inside the stator, creating a small air gap between them, a linear motor requires straight guideways that support the forcer and maintain a gap between it and the magnetic track. Linear encoders can be used to indicate the position and speed of the forcer along the track, just as rotary encoders are used to determine angular position and speed of a rotary motor.

Unlike a rotary motor, in which the rotor rotates inside a stationary stator, a linear motor can be designed so that either the forcer or the track moves. The usual application in positioning systems is for the forcer to move relative to a stationary track, because the mass

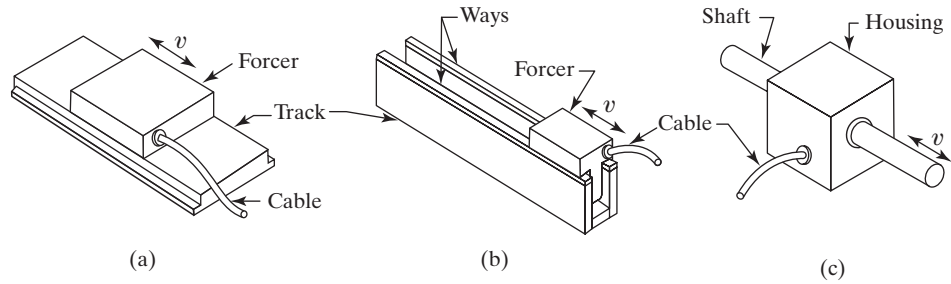


Figure 6.6 Three styles of linear motor: (a) flat, (b) U-channel, and (c) cylindrical.

of the forcer is less than the mass of the track. The disadvantage of this arrangement is that a flexible cable apparatus must be connected to the moving forcer. This flexible cable apparatus is not required in linear motors that move the track relative to a fixed forcer.

Linear motors are available in three styles [13]: flat, U-channel, and cylindrical, pictured in Figure 6.6. The flat style consists of a straight, flat track, along which the forcer moves. The U-channel design has a track whose cross section consists of two parallel rails connected at the base to form a “U.” The forcer moves inside the two rails and is supported mechanically by two straight ways at the top of the rails. In the cylindrical style, the forcer is a round shaft that moves linearly inside a housing containing the magnets. The housing serves the purpose of the track in this design.

Applications of linear motors include mechanical and electronic assembly, metrology, and laser positioning. They are sometimes used as alternatives to rotary motors with linear motion converters, where they often compare favorably in terms of accuracy, repeatability, acceleration, speed, and ease of installation [14]. One limitation is that they should not be used where vertical lifting is required, because if power to the motor is lost, gravity would cause any load that had been lifted to fall.

6.2.2 Other Types of Actuators

There are other types of electrical actuators in addition to motors. These include solenoids and relays, which are electromagnetic devices like electric motors, but they operate differently. There are also actuators that operate using hydraulic and pneumatic power.

Electrical Actuators Other Than Motors. A *solenoid* consists of a movable plunger inside a stationary wire coil, as pictured in Figure 6.7. When a current is applied to the coil, it acts as a magnet, drawing the plunger into the coil. When current is switched off, a spring returns the plunger to its previous position. Linear solenoids of the type described here are often used to open and close valves in fluid flow systems, such as chemical processing equipment. In these applications, the solenoid provides a linear push or pull action. Rotary solenoids are also available to provide rotary motion, usually over a limited angular range (e.g., neutral position to between 25° and 90°).

An *electromechanical relay* is an on–off electrical switch consisting of two main components, a stationary coil and a movable arm that can be made to open or close an electrical contact by means of a magnetic field that is generated when current is passed through the coil. The reason for using a relay is that it can be operated with relatively low current levels,

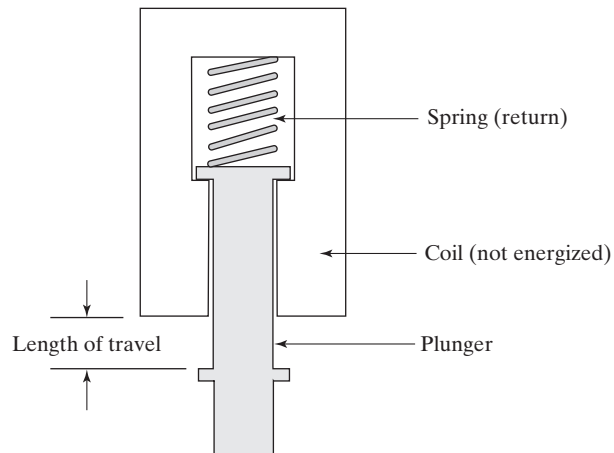


Figure 6.7 Solenoid.

but it opens and closes circuits that carry high currents and/or voltages. Thus, relays are a safe way to remotely switch on and off equipment that requires high electrical power.

Hydraulic and Pneumatic Actuators. These two categories of actuators are powered by pressurized fluids. Oil is used in hydraulic systems, and compressed air is used in pneumatic systems. The devices in both categories are similar in operation but different in construction due to the differences in fluid properties between oil and air. Some of the differences in properties, and their effects on the characteristics and applications of the two types of actuators, are listed in Table 6.4.

Hydraulic and pneumatic actuators that provide either linear or rotary motion are available. The cylinder, illustrated in Figure 6.8, is a common linear-motion device. The cylinder is basically a tube, and a piston is forced to slide inside the cylinder due to fluid pressure. Two types are shown in the figure: (a) single acting with spring return and (b) double acting. Although these cylinders operate in a similar way for both types of fluid power, it is more difficult to predict the speed and force characteristics of pneumatic cylinders because of the compressibility of air in these devices. For hydraulic cylinders, the

TABLE 6.4 Comparison of Hydraulic and Pneumatic Systems

System Characteristic	Hydraulic System	Pneumatic System
Pressurized fluid	Oil (or water–oil emulsion)	Compressed air
Compressibility	Incompressible	Compressible
Typical fluid pressure level	20 MPa (3,000 lb/in ²)	0.7 MPa (100 lb/in ²)
Forces applied by devices	High	Low
Actuation speeds of devices	Low	High
Speed control	Accurate speed control	Difficult to control accurately
Problem with fluid leaks	Yes, potential safety hazard	No problem when air leaks
Relative cost of devices	High (factor of 5–10 times)	Low
Automation applications	Preferred when high forces and accurate control are required	Preferred when low cost and high-speed actuation are required

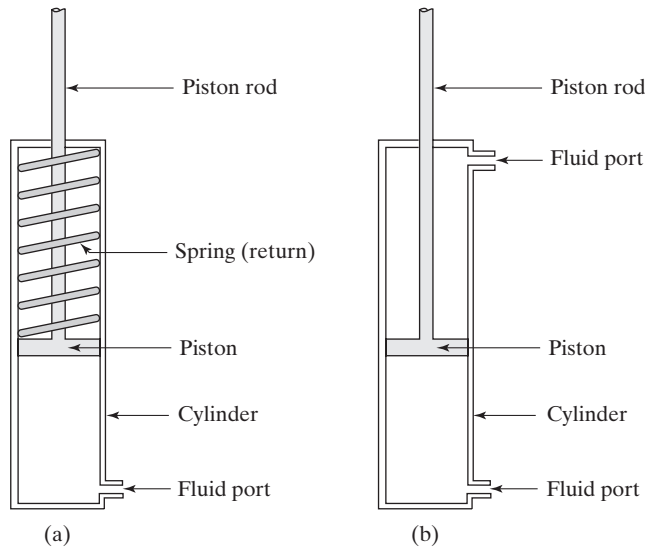


Figure 6.8 Cylinder and piston: (a) single acting with spring return and (b) double acting.

fluid is incompressible, and the speed and force of the piston depend on the fluid flow rate and pressure inside the cylinder, respectively, as given by the expressions

$$v = \frac{Q}{A} \quad (6.17)$$

$$F = pA \quad (6.18)$$

where v = velocity of the piston, m/sec (in/sec); Q = volumetric flow rate, m³/sec (in³/sec); A = area of the cylinder cross section, m² (in²); F = applied force, N (lbf); and p = fluid pressure, N/m² or Pa (lb/in²). It should be noted that in a double-acting cylinder, the area is different in the two directions due to the presence of the piston rod. When the piston is retracted into the cylinder, the cross-sectional area of the piston rod must be subtracted from the cylinder area. This means that the piston speed will be slightly greater and the applied force will be slightly less when the piston is retracting (reverse stroke) than when it is extending (forward stroke).

Fluid-powered rotary motors are also available to provide a continuous rotational motion. Hydraulic motors are noted for developing high torques, and pneumatic motors can be used for high-speed applications. There are several different mechanisms by which these motors operate, including the use of pistons, vanes, and turbine blades. The performance characteristics of the air-driven rotary motors are more difficult to analyze, just like the operation of the pneumatic cylinder. On the other hand, hydraulic motors have well-behaved characteristics. In general, the rotation speed of a hydraulic motor is directly proportional to the fluid flow rate, as defined in the equation

$$\omega = KQ \quad (6.19)$$

where ω = angular velocity, rad/sec; Q = volumetric fluid flow rate, m³/sec (in³/sec); and K is a constant of proportionality with units of rad/m³ (rad/in³). Angular velocity (rad/sec) can be converted to revolutions per minute (rev/min) by multiplying by $60/2\pi$.

6.3 ANALOG-DIGITAL CONVERSIONS

Continuous analog signals from a process must be converted into digital values to be used by the computer, and digital data generated by the computer must be converted to analog signals to be used by analog actuators. The two conversion procedures are discussed in this section.

6.3.1 Analog-to-Digital Converters

The procedure for converting an analog signal from the process into digital form typically consists of the following steps and hardware devices, as illustrated in Figure 6.9:

1. *Sensor and transducer.* This is the measuring device that generates the analog signal (Section 6.1).
2. *Signal conditioning.* The continuous analog signal from the transducer may require conditioning to render it into more suitable form. Common signal conditioning steps include (1) filtering to remove random noise and (2) conversion from one signal form to another, for example, converting a current into a voltage.
3. *Multiplexer.* The multiplexer is a switching device connected in series with each input channel from the process; it is used to time-share the analog-to-digital converter (ADC) among the input channels. The alternative is to have a separate ADC for each input channel, which would be costly for a large application with many input channels. Because the process variables need only be sampled periodically, using a multiplexer provides a cost-effective alternative to dedicated ADCs for each channel.
4. *Amplifier.* Amplifiers are used to scale the incoming signal up or down to be compatible with the range of the analog-to-digital converter.
5. *Analog-to-digital converter.* As its name indicates, the function of the ADC is to convert the incoming analog signal into its digital counterpart.

Consider the operation of the ADC, which is the heart of the conversion process. Analog-to-digital conversion occurs in three steps: (1) sampling, (2) quantization, and (3) encoding. Sampling consists of converting the continuous signal into a series of discrete analog signals at periodic intervals, as shown in Figure 6.10. In quantization, each discrete analog signal is assigned to one of a finite number of previously defined amplitude levels. The amplitude levels are discrete values of voltage ranging over the full scale of the ADC.

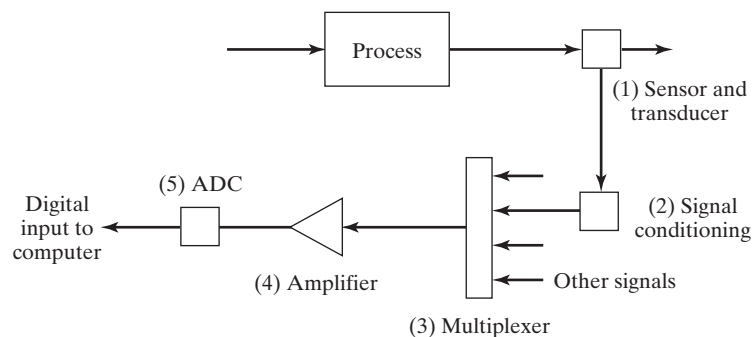


Figure 6.9 Steps in analog-to-digital conversion of continuous analog signals from process.

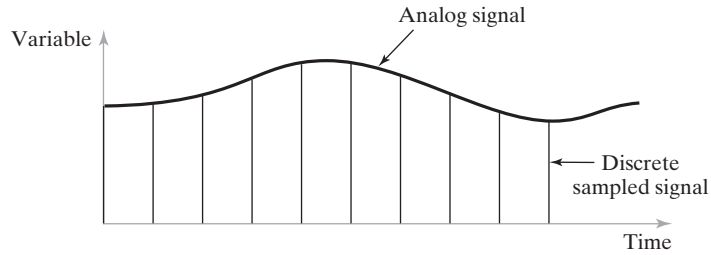


Figure 6.10 Analog signal converted into series of discrete sampled data by analog-to-digital converter.

In the encoding step, the discrete amplitude levels obtained during quantization are converted into digital code, representing the amplitude level as a sequence of binary digits.

In selecting an analog-to-digital converter for a given application, the following factors are relevant: (1) sampling rate, (2) conversion time, (3) resolution, and (4) conversion method.

The sampling rate is the rate at which the continuous analog signals are sampled or polled. A higher sampling rate means that the continuous waveform of the analog signal can be more closely approximated. When the incoming signals are multiplexed, the maximum possible sampling rate for each signal is the maximum sampling rate of the ADC divided by the number of channels that are processed through the multiplexer. For example, if the maximum sampling rate of the ADC is 1,000 samples/sec, and there are 10 input channels through the multiplexer, then the maximum sampling rate for each input line is $1,000/10 = 100$ sample/sec. (This ignores time losses due to multiplexer switching.)

The maximum possible sampling rate of an ADC is limited by the ADC conversion time. Conversion time of an ADC is the time interval between the application of an incoming signal and the determination of the digital value by the quantization and encoding steps of the conversion procedure. Conversion time depends on (1) the type of conversion procedure used by the ADC and (2) the number of bits n used to define the converted digital value. As n is increased, conversion time increases (bad news), but resolution of the ADC improves (good news).

The resolution of an ADC is the precision with which the analog signal is evaluated. Because the signal is represented in binary form, precision is determined by the number of quantization levels, which in turn is determined by the bit capacity of the ADC and the computer. The number of quantization levels is defined as

$$N_q = 2^n \tag{6.20}$$

where N_q = number of quantization levels; and n = number of bits. Resolution can be defined in equation form as

$$R_{\text{ADC}} = \frac{L}{N_q - 1} = \frac{L}{2^n - 1} \tag{6.21}$$

where R_{ADC} = resolution of the ADC, also called the *quantization-level spacing*, which is the length of each quantization level; L = full-scale range of the ADC, usually 0–10 V (the incoming signal must typically be amplified, either up or down, to this range); and N_q = the number of quantization levels, defined in Equation (6.20).

Quantization generates an error, because the quantized digital value is likely to be different from the true value of the analog signal. The maximum possible error occurs when the true value of the analog signal is on the borderline between two adjacent

quantization levels; in this case, the error is one-half the quantization-level spacing. By this reasoning, the quantization error is defined

$$\text{Quantization error} = \pm \frac{1}{2} R_{\text{ADC}} \quad (6.22)$$

Various conversion methods are available by which to encode an analog signal into its digital equivalent. The most commonly used technique, called the *successive approximation method*, is discussed here. In this method, a series of known trial voltages are successively compared to the input signal whose value is unknown. The number of trial voltages corresponds to the number of bits used to encode the signal. The first trial voltage is half the full-scale range of the ADC, and each successive trial voltage is half the preceding value. Comparing the remainder of the input voltage with each trial voltage yields a bit value of “1” if the input exceeds the trial value and “0” if the input is less than the trial voltage. The successive bit values, multiplied by their corresponding trial voltage values, provide the encoded value of the input signal.

EXAMPLE 6.3 Successive Approximation Method

Suppose the input signal is 6.8 V. Use the successive approximation method to encode the signal for a 6-bit register for an ADC with a full-scale range of 10 V.

Solution: The encoding procedure for the input of 6.8 V is illustrated in Figure 6.11. In the first trial, 6.8 V is compared with 5.0 V. Because $6.8 > 5.0$, the first bit value is 1. Comparing the remainder $(6.8 - 5.0) = 1.8$ V with the second trial voltage of 2.5 V yields a 0, because $1.8 < 2.5$. The third trial voltage = 1.25 V. Because $1.8 > 1.25$, the third bit value is 1. The rest of the 6 bits are evaluated in the figure to yield an encoded value = **6.718 V**.

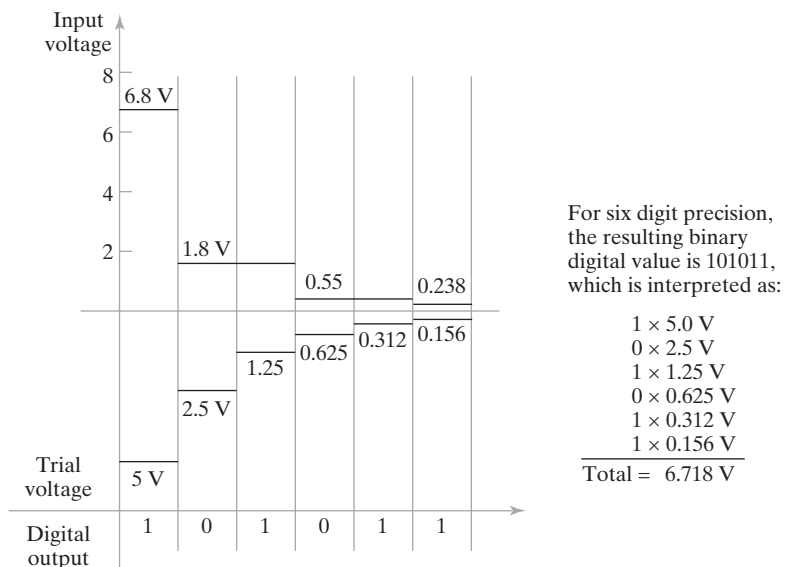


Figure 6.11 Successive approximation method applied to Example 6.3.

6.3.2 Digital-to-Analog Converters

The process performed by a digital-to-analog converter (DAC) is the reverse of the ADC process. The DAC transforms the digital output of the computer into a continuous signal to drive an analog actuator or other analog device. Digital-to-analog conversion consists of two steps: (1) decoding, in which the digital output of the computer is converted into a series of analog values at discrete moments in time, and (2) data holding, in which each successive value is changed into a continuous signal (usually electrical voltage) used to drive the analog actuator during the sampling interval.

Decoding is accomplished by transferring the digital value from the computer to a binary register that controls a reference voltage source. Each successive bit in the register controls half the voltage of the preceding bit, so that the level of the output voltage is determined by the status of the bits in the register. Thus, the output voltage is given by

$$E_o = E_{\text{ref}}\{0.5B_1 + 0.25B_2 + 0.125B_3 + \dots + (2^n)^{-1} B_n\} \quad (6.23)$$

where E_o = output voltage of the decoding step, V; E_{ref} = reference voltage, V; B_1, B_2, \dots, B_n = status of successive bits in the register, 0 or 1; and n = number of bits in the binary register.

The objective in the data holding step is to approximate the envelope formed by the data series, as illustrated in Figure 6.12. Data holding devices are classified according to the order of the extrapolation calculation used to determine the voltage output during sampling intervals. The most common extrapolator is a zero-order hold, in which the output voltage is a sequence of step signals, as in Figure 6.12(a). The voltage function during the sampling interval is constant and can be expressed simply as

$$E(t) = E_o \quad (6.24)$$

where $E(t)$ = voltage as a function of time t during the sampling interval, V; and E_o = voltage output from the decoding step, Equation (6.23).

The first-order data hold is less common than the zero-order hold, but it usually approximates the envelope of the sampled data values more closely. With the first-order hold, the voltage function $E(t)$ during the sampling interval changes with a constant slope determined by the two preceding E_o values. Expressing this mathematically,

$$E(t) = E_o + \alpha t \quad (6.25)$$

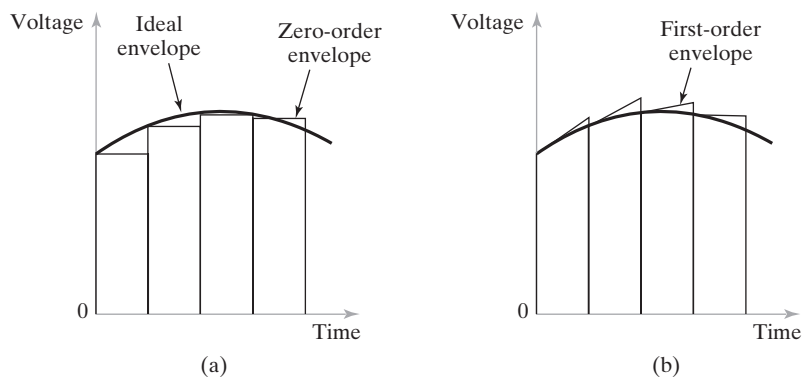


Figure 6.12 Data holding step using (a) zero-order hold and (b) first-order hold.

where α = rate of change of $E(t)$; E_o = output voltage from Equation (6.24) at the start of the sampling interval, V; and t = time, sec. The value of α is computed each sampling interval as

$$\alpha = \frac{E_o - E_o(-\tau)}{\tau} \quad (6.26)$$

where E_o = output voltage from Equation (6.23) at the start of the sampling interval, V; τ = time interval between sampling instants, sec; and $E_o(-\tau)$ = value of E_o from Equation (6.23) from the preceding sampling instant (removed backward in time by τ), V. The result of the first-order hold is illustrated in Figure 6.12(b).

EXAMPLE 6.4 Zero-Order and First-Order Data Holds

A digital-to-analog converter uses a reference voltage of 100 V and has 6-bit precision. In three successive sampling instants, 0.5 sec apart, the data contained in the binary register are the following:

Instant	Binary Data
1	101000
2	101010
3	101101

Determine (a) the decoder output values for the three sampling instants, (b) the voltage signals between instants 2 and 3 for a zero-order hold, and (c) the voltage signals between instants 2 and 3 for a first-order hold.

Solution: (a) The decoder output values for the three sampling instants are computed according to Equation (6.23) as follows:

$$\begin{aligned} \text{Instant 1, } E_o &= 100\{0.5(1) + 0.25(0) + 0.125(1) + 0.0625(0) + 0.03125(0) + 0.015625(0)\} \\ &= \mathbf{62.50 \text{ V}} \end{aligned}$$

$$\begin{aligned} \text{Instant 2, } E_o &= 100\{0.5(1) + 0.25(0) + 0.125(1) + 0.0625(0) + 0.03125(1) + 0.015625(0)\} \\ &= \mathbf{65.63 \text{ V}} \end{aligned}$$

$$\begin{aligned} \text{Instant 3, } E_o &= 100\{0.5(1) + 0.25(0) + 0.125(1) + 0.0625(1) + 0.03125(0) + 0.015625(1)\} \\ &= \mathbf{70.31 \text{ V}} \end{aligned}$$

(b) The zero-order hold between sampling instants 2 and 3 is a constant voltage $E(t) = \mathbf{65.63 \text{ V}}$ according to Equation (6.24).

(c) The first-order hold yields a steadily increasing voltage. The slope α is given by Equation (6.26):

$$\alpha = \frac{65.63 - 62.5}{0.5} = 6.25$$

and from Equation (6.25), the voltage function between instants 2 and 3 is

$$E(t) = 65.63 + 6.25t$$

These values and functions are plotted in Figure 6.13. Note that the first-order hold more accurately anticipates the value of E_o at sampling instant 3 than does the zero-order hold.

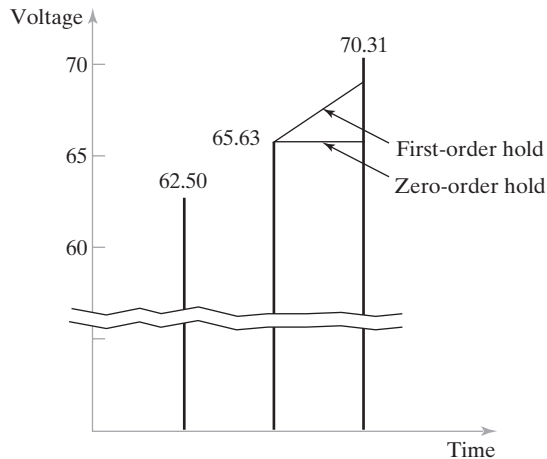


Figure 6.13 Solution to Example 6.4.

6.4 INPUT/OUTPUT DEVICES FOR DISCRETE DATA

Discrete data can be processed by a digital computer without the kinds of conversion procedures required for continuous analog signals. As indicated earlier, discrete data divide into three categories: (a) binary data, (b) discrete data other than binary, and (c) pulse data.

6.4.1 Contact Input/Output Interfaces

Contact interfaces are of two types, input and output. These interfaces read binary data from the process into the computer and send binary signals from the computer to the process, respectively. The terms *input* and *output* are relative to the computer.

A **contact input interface** is a device by which binary data are read into the computer from some external source (e.g., a process). It consists of a series of simple contacts that can be either closed or open (on or off) to indicate the status of binary devices connected to the process such as limit switches (contact or no contact), valves (open or closed), or motor pushbuttons (on or off). The computer periodically scans the actual status of the contacts to update the values stored in memory.

The contact input interface can also be used to enter discrete data other than binary. This type of data is generated by devices such as a photoelectric sensor array (Table 6.2)

and can be stored in a binary register consisting of multiple bits. The individual bit values (0 or 1) can be entered through the contact input interface. In effect, a certain number of contacts in the input interface are assigned to the binary register, the number of contacts being equal to the number of bits in the register. The binary number can be converted to a conventional base 10 number as needed in the application.

The **contact output interface** is a device that communicates on/off signals from the computer to the process. The contact positions are set either on or off. These positions are maintained until changed by the computer, perhaps in response to events in the process. In computer process-control applications, hardware controlled by the contact output interface include alarms, indicator lights (on control panels), solenoids, and constant-speed motors. The computer controls the sequence of on/off activities in a work cycle through this contact output interface.

The contact output interface can be used to transmit a discrete data value other than binary by assigning an array of contacts in the interface for that purpose. The 0 and 1 values of the contacts in the array are evaluated as a group to determine the corresponding discrete number. In effect, this procedure is the reverse of that used by the contact input interface for discrete data other than binary.

6.4.2 Pulse Counters and Generators

Discrete data can also exist in the form of a series of pulses. Such data is generated by digital transducers such as optical encoders. Pulse data are also used to control certain devices such as stepper motors.

A **pulse counter** is a device that converts a series of pulses (pulse train, as shown in Figure 5.1) into a digital value. The value is then entered into the computer through its input channel. The most common type of pulse counter is one that counts electrical pulses. It is constructed using sequential logic gates, called *flip-flops*, which are electronic devices that possess memory capability and that can be used to store the results of the counting procedure.

Pulse counters can be used for both counting and measurement applications. A typical counting application might add up the number of packages moving past a photoelectric sensor along a conveyor in a distribution center. A typical measurement application might indicate the rotational speed of a shaft. One possible method to accomplish the measurement is to connect the shaft to a rotary encoder (Table 6.2), which generates a certain number of electrical pulses for each rotation. To determine rotational speed, the pulse counter measures the number of pulses received during a certain time period and divides this by the duration of the time period and by the number of pulses in each revolution of the encoder. Counters are discussed in the context of digital control in Section 9.1.2.

A **pulse generator** is a device that produces a series of electrical pulses whose total number and frequency are determined and sent by the control computer. The total number of pulses might be used to drive a stepper motor in a positioning system. The frequency of the pulse train, or pulse rate, could be used to control the rotational speed of a stepper motor. A pulse generator operates by repeatedly closing and opening an electrical contact, thus producing a sequence of discrete electrical pulses. The amplitude (voltage level) and frequency are designed to be compatible with the device being controlled.

REFERENCES

- [1] ASTROM, K. J., and B. WITTENMARK, *Computer-Controlled Systems—Theory and Design*, 3rd ed., Dover Publishing, Mineola, NY, 2011.
- [2] BATESON, R. N., *Introduction to Control System Technology*, 7th ed., Prentice Hall, Upper Saddle River, NJ, 2002.
- [3] BEATY, H. W., and J. L. KIRTLEY, Jr., *Electric Motor Handbook*, McGraw-Hill Book Company, New York, 1998.
- [4] BOUCHER, T. O., *Computer Automation in Manufacturing*, Chapman & Hall, London, UK, 1996.
- [5] DOEBLIN, E. O., *Measurement Systems: Applications and Design*, 4th ed., McGraw-Hill, Inc., New York, 1990.
- [6] FRADEN, J., *Handbook of Modern Sensors*, 3rd ed., Springer-Verlag, New York, 2003.
- [7] GARDNER, J. W., *Microsensors: Principles and Applications*, John Wiley & Sons, New York, 1994.
- [8] GROOVER, M. P., M. WEISS, R. N. NAGEL, N. G. ODREY, and S. B. MORRIS, *Industrial Automation and Robotics*, McGraw-Hill (Primus Custom Publishing), New York, 1998.
- [9] OLSSON, G., and G. PIANI, *Computer Systems for Automation and Control*, Prentice Hall, London, UK, 1992.
- [10] PESSEN, D. W., *Industrial Automation: Circuit Design and Components*, John Wiley & Sons, New York, 1989.
- [11] RIZZONI, G., *Principles and Applications of Electrical Engineering*, 5th ed., McGraw-Hill, New York, 2007.
- [12] STENERSON, J., *Fundamentals of Programmable Logic Controllers, Sensors, and Communications*, 3rd ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2004.
- [13] www.aerotech.com/media/117516/Linear-motors-application-en.pdf
- [14] www.baldor.com/products/linear_motors.asp
- [15] www.wikipedia.org/wiki/Electric_motor
- [16] www.wikipedia.org/wiki/Induction_motor
- [17] www.wikipedia.org/wiki/Linear_actuator
- [18] www.wikipedia.org/wiki/Linear_encoder
- [19] www.wikipedia.org/wiki/Rotary_encoder
- [20] www.wikipedia.org/wiki/Synchronous_motor

REVIEW QUESTIONS

- 6.1 What is a sensor?
- 6.2 What is the difference between an analog sensor and a discrete sensor?
- 6.3 What is the difference between an active sensor and a passive sensor?
- 6.4 What is the transfer function of a sensor?
- 6.5 What is an actuator?
- 6.6 Nearly all actuators can be classified into one of three categories, according to type of drive power. Name the three categories.
- 6.7 Name the two main components of an electric motor.

- 6.8 In a DC motor, what is a commutator?
- 6.9 What are the two important disadvantages of DC electric motors that make the AC motor relatively attractive?
- 6.10 How is the operation of a stepper motor different from the operation of conventional DC or AC motors?
- 6.11 What are three mechanical ways to convert a rotary motion into a linear motion?
- 6.12 What is a linear electric motor?
- 6.13 What is a solenoid?
- 6.14 What is the difference between a hydraulic actuator and a pneumatic actuator?
- 6.15 Briefly describe the three steps of the analog-to-digital conversion process?
- 6.16 What is the resolution of an analog-to-digital converter?
- 6.17 Briefly describe the two steps in the digital-to-analog conversion process?
- 6.18 What is the difference between a contact input interface and a contact output interface?
- 6.19 What is a pulse counter?
- 6.20 What is a pulse generator?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Sensors

- 6.1 **(A)** During calibration, an iron/constantan thermocouple emits a voltage of 1.02 mV at 20°C and 27.39 mv at 500°C. The reference temperature is to be set to emit a zero voltage at 0°C. Assume the transfer function is a linear relationship between 0°C and 500°C. Determine (a) the transfer function of the thermocouple and (b) the temperature corresponding to a voltage output of 24.0 mV.
- 6.2 A digital tachometer will be used to determine the surface speed of a rotating workpiece in surface meters per sec. The tachometer is designed to read rotational speed in rev/sec, but in this case the shaft of the tachometer is directly coupled to a wheel whose outside rim is made of rubber. When the wheel rim is pressed against the surface of the rotating workpiece, the tachometer should provide a direct reading of surface speed in m/sec. What is the diameter of the wheel rim that will provide a direct reading of surface speed in m/sec?
- 6.3 A rotary encoder is connected directly to the spindle of a machine tool to measure its rotational speed. The encoder generates 72 pulses for each revolution of the spindle. In one reading, the encoder generated 237 pulses in a period of 0.25 sec. What was the rotational speed of the spindle in (a) rev/min and (b) rad/sec?
- 6.4 A digital flow meter operates by emitting a pulse for each unit volume of fluid flowing through it. The particular flow meter of interest has a unit volume of 50 cm³ per pulse. In a certain process control application, the flow meter emitted 3,688 pulses during a period of 2.5 min. Determine (a) the total volume of fluid that flowed through the meter and (b) the flow rate of fluid flow. (c) What is the pulse frequency (Hz) corresponding to a flow rate of 60,000 cm³/min?
- 6.5 A tool-chip thermocouple is used to measure cutting temperature in a turning operation. The two dissimilar metals in a tool-chip thermocouple are the tool material and the workpiece metal. During the turning operation, the chip from the work metal forms a junction with the rake face of the tool to create the thermocouple at exactly the location where it is desired to measure temperature: the interface between the tool and the chip. A separate

calibration procedure must be performed for each combination of tool material and work metal. In the combination of interest here, the calibration curve (inverse transfer function) for a particular grade of cemented carbide tool when used to turn C1040 steel is the following: $T = 48.94E_{tc} - 53$, where T = temperature, °C; and E_{tc} = the emf output of the thermocouple, mV. (a) Revise the temperature equation so that it is in the form of a transfer function similar to that given in Equation (6.3). What is the sensitivity of this tool-chip thermocouple? (b) During a straight turning operation, the emf output of the thermocouple was 9.25 mV. What was the corresponding cutting temperature?

Actuators

- 6.6 (A)** A DC servomotor has a torque constant of 0.075 N-m/A and a voltage constant of 0.12 V/(rad/sec). The armature resistance is 2.5 Ω . A terminal voltage of 24 V is used to operate the motor. Determine (a) the starting torque generated by the motor just as the voltage is applied, (b) the maximum speed at a torque of zero, and (c) the operating point of the motor when it is connected to a load whose torque characteristic is proportional to speed with a constant of proportionality = 0.0125 N-m/(rad/sec).
- 6.7** In the previous problem, what is the power delivered by the motor at the operating point in units of (a) Watts and (b) horsepower?
- 6.8** A DC servomotor is used to actuate one of the axes of an x - y positioner. The motor has a torque constant of 10.0 in-lb/A and a voltage constant of 12.0 V/(1,000 rev/min). The armature resistance is 3.0 Ω . At a given moment, the positioning table is not moving and a voltage of 48 V is applied to the motor terminals. Determine the torque (a) immediately after the voltage is applied and (b) at a rotational speed of 500 rev/min. (c) What is the maximum theoretical speed of the motor?
- 6.9** A DC servomotor generates 50 W of mechanical power in an application in which the constant of proportionality between the load and angular velocity = 0.022 N-m/(rad/sec). The motor has a torque constant of 0.10 N-m/A and a voltage constant of 0.15 V/(rad/sec). A voltage of 36 V is applied to the motor terminals. Determine the armature resistance of the motor.
- 6.10** A voltage of 24 V is applied to a DC motor whose torque constant = 0.115 N-m/A and voltage constant = 0.097 V/(rad/sec). Armature resistance = 1.9 Ω . The motor is directly coupled to a blower shaft for an industrial process. (a) What is the stall torque of the motor? (b) Determine the operating point of the motor if the torque-speed characteristic of the blower is given by the following equation: $T_L = K_{L1}\omega + K_{L2}\omega^2$, where T_L = load torque, N-m; ω = angular velocity, rad/sec; K_{L1} = 0.005 N-m/(rad/sec), and K_{L2} = 0.00033 N-m/(rad/sec)². (c) What horsepower is being generated by the motor at the operating point?
- 6.11** The input voltage to a DC motor is 12 V. The motor rotates at 2,200 rev/min at no load (maximum speed). Stall torque is 0.44 N-m, and the corresponding current is 9.0 A. Operating at 1,600 rev/min, the torque is 0.12 N-m, and the current is 2.7 A. Based on these values, determine (a) the torque constant, (b) voltage constant, and (c) armature resistance of the motor. (d) How much current does the motor draw operating at 1,600 rev/min?
- 6.12** The step angle of a stepper motor = 1.8°. The motor shaft is to rotate through 15 complete revolutions at an angular velocity of 7.5 rad/sec. Determine (a) the required number of pulses and (b) the pulse frequency to achieve the specified rotation. (c) How much time is required to complete the 15 revolutions?
- 6.13 (A)** A stepper motor has a step angle = 3.6°. (a) How many pulses are required for the motor to rotate through five complete revolutions? (b) What pulse frequency is required for the motor to rotate at a speed of 180 rev/min?

- 6.14** The shaft of a stepper motor is directly connected to a leadscrew that drives a worktable in an x - y positioning system. The motor has a step angle = 5° . The pitch of the leadscrew is 6 mm, which means that the worktable moves in the direction of the leadscrew axis by a distance of 6 mm for each complete revolution of the screw. It is desired to move the worktable a distance of 275 mm at a top speed of 20 mm/sec. Determine (a) the number of pulses and (b) the pulse frequency required to achieve this movement. (c) How much time is required to move the table the desired distance at the desired speed, assuming there are no delays due to inertia?
- 6.15** A single-acting hydraulic cylinder with spring return has an inside diameter of 95 mm. Its application is to push pallets off of a conveyor into a storage area. The hydraulic power source can generate up to 2.5 MPa of pressure at a flow rate of 100,000 mm³/sec to drive the piston. Determine (a) the maximum possible velocity of the piston and (b) the maximum force that can be applied by the apparatus. (c) Is this a good application for a hydraulic cylinder, or would a pneumatic cylinder be better?
- 6.16** (A) A double-acting hydraulic cylinder has an inside diameter of 80 mm. The piston rod has a diameter of 15 mm. The hydraulic power source can generate up to 4.0 MPa of pressure at a flow rate of 125,000 mm³/sec to drive the piston. (a) What are the maximum possible velocity of the piston and the maximum force that can be applied in the forward stroke? (b) What are the maximum possible velocity of the piston and the maximum force that can be applied in the reverse stroke?
- 6.17** A double-acting hydraulic cylinder is used to actuate a linear joint of an industrial robot. The inside diameter of the cylinder is 3.5 in. The piston rod has a diameter of 0.5 in. The hydraulic power source can generate up to 500 lb/in² of pressure at a flow rate of 1,200 in³/min to drive the piston. (a) Determine the maximum velocity of the piston and the maximum force that can be applied in the forward stroke. (b) Determine the maximum velocity of the piston and the maximum force that can be applied in the reverse stroke.

Analog-Digital Conversion

- 6.18** (A) A continuous voltage signal is to be converted into its digital counterpart using an analog-to-digital converter. The maximum voltage range is ± 30 V. The ADC has a 12-bit capacity. Determine (a) number of quantization levels, (b) resolution, and (c) the quantization error for this ADC.
- 6.19** A voltage signal with a range of 0 to 115 V is to be converted by means of an ADC. Determine the minimum number of bits required to obtain a quantization error of (a) ± 5 V maximum, (b) ± 1 V maximum, (c) ± 0.1 V maximum.
- 6.20** A digital-to-analog converter uses a reference voltage of 120 V DC and has eight binary digit precision. In one of the sampling instants, the data contained in the binary register = 01010101. If a zero-order hold is used to generate the output signal, determine the voltage level of that signal.
- 6.21** A DAC uses a reference voltage of 80 V and has 6-bit precision. In four successive sampling periods, each 1 sec long, the binary data contained in the output register were 100000, 011111, 011101, and 011010. Determine the equation for the voltage as a function of time between sampling instants 3 and 4 using (a) a zero-order hold and (b) a first-order hold.
- 6.22** In the previous problem, suppose that a second-order hold were to be used to generate the output signal. The equation for the second-order hold is the following: $E(t) = E_0 + \alpha t + \beta t^2$, where E_0 = starting voltage at the beginning of the time interval. (a) For the binary data given in the previous problem, determine the values of α and β that would be used in the equation for the time interval between sampling instants 3 and 4. (b) Compare the first-order and second-order holds in anticipating the voltage at the 4th instant.

Computer Numerical Control

CHAPTER CONTENTS

- 7.1 Fundamentals of NC Technology
 - 7.1.1 Basic Components of an NC System
 - 7.1.2 NC Coordinate Systems
 - 7.1.3 Motion Control Systems
 - 7.2 Computers and Numerical Control
 - 7.2.1 The CNC Machine Control Unit
 - 7.2.2 CNC Software
 - 7.2.3 Distributed Numerical Control
 - 7.3 Applications of NC
 - 7.3.1 Machine Tool Applications
 - 7.3.2 Other NC Applications
 - 7.3.3 Advantages and Disadvantages of NC
 - 7.4 Analysis of Positioning Systems
 - 7.4.1 Open-Loop Positioning Systems
 - 7.4.2 Closed-Loop Positioning Systems
 - 7.4.3 Precision in Positioning Systems
 - 7.5 NC Part Programming
 - 7.5.1 Manual Part Programming
 - 7.5.2 Computer-Assisted Part Programming
 - 7.5.3 CAD/CAM Part Programming
 - 7.5.4 Manual Data Input
- Appendix 7A: Coding for Manual Part Programming

Numerical control (NC) is a form of programmable automation in which the mechanical actions of a machine tool or other equipment are controlled by a program containing coded alphanumeric data. The alphanumeric data represent relative positions between a work head and a work part as well as other instructions needed to operate the machine. The work head is a cutting tool or other processing apparatus, and the work part is the object being processed. When the current job is completed, the program of instructions can be changed to process a new job. The capability to change the program makes NC suitable for low and medium production. It is much easier to write new programs than to make major alterations in the processing equipment.

Numerical control can be applied to a wide variety of processes. The applications divide into two categories: (1) machine tool applications, such as drilling, milling, turning, and other metal working; and (2) other applications, such as assembly, rapid prototyping, and inspection. The common operating feature of NC in all of these applications is control of the work head movement relative to the work part. The concept for NC dates from the late 1940s. The first NC machine was developed in 1952 (Historical Note 7.1).

Historical Note 7.1 The First NC Machines [1], [4], [7], [9]

The development of NC owes much to the U.S. Air Force and the early aerospace industry. The first work in the area of NC is attributed to John Parsons and his associate Frank Stulen at Parsons Corporation in Traverse City, Michigan. Parsons was a contractor for the Air Force during the 1940s and had experimented with the concept of using coordinate position data contained on punched cards to define and machine the surface contours of airfoil shapes. He had named his system the *Cardamatic* milling machine, since the numerical data was stored on punched cards. Parsons and his colleagues presented the idea to the Wright-Patterson Air Force Base in 1948. The initial Air Force contract was awarded to Parsons in June 1949. A subcontract was awarded by Parsons in July 1949 to the Servomechanism Laboratories at the Massachusetts Institute of Technology to (1) perform a systems engineering study on machine tool controls and (2) develop a prototype machine tool based on the Cardamatic principle. Research commenced on the basis of this subcontract, which continued until April 1951, when a contract was signed by MIT and the Air Force to complete the development work.

Early in the project, it became clear that the required data transfer rates between the controller and the machine tool could not be achieved using punched cards, so it was proposed to use either punched paper tape or magnetic tape to store the numerical data. These and other technical details of the control system for machine tool control had been defined by June 1950. The name *numerical control* was adopted in March 1951 based on a contest sponsored by John Parsons among “MIT personnel working on the project.” The first NC machine was developed by retrofitting a Cincinnati Milling Machine Company vertical Hydro-Tel milling machine (a 24-in \times 60-in conventional tracer mill) that had been donated by the Air Force from surplus equipment. The controller combined analog and digital components, consisted of 292 vacuum tubes, and occupied a floor area greater than the machine tool itself. The prototype successfully performed simultaneous control of three-axis motion based on coordinate-axis data on punched binary tape. This experimental machine was in operation by March 1952.

A patent for the machine tool system entitled *Numerical Control Servo System* was filed in August 1952, and awarded in December 1962. Inventors were listed as Jay Forrester, William Pease, James McDonough, and Alfred Susskind, all Servomechanisms Lab staff

during the project. It is of interest to note that a patent was also filed by John Parsons and Frank Stulen in May 1952 for a *Motor Controlled Apparatus for Positioning Machine Tool* based on the idea of using punched cards and a mechanical rather than electronic controller. This patent was issued in January 1958. In hindsight, it is clear that the MIT research provided the prototype for subsequent developments in NC technology. As far as is known, no commercial machines were ever introduced using the Parsons–Stulen configuration.

Once the NC machine was operational in March 1952, trial parts were solicited from aircraft companies across the country to learn about the operating features and economics of NC. Several potential advantages of NC were apparent from these trials. These included good accuracy and repeatability, reduction of noncutting time in the machining cycle, and the capability to machine complex geometries. Part programming was recognized as a difficulty with the new technology. A public demonstration of the machine was held in September 1952 for machine tool builders (anticipated to be the companies that would subsequently develop products in the new technology), aircraft component producers (expected to be the principal users of NC), and other interested parties.

Reactions of the machine tool companies following the demonstrations “ranged from guarded optimism to outright negativism” [9, p. 61]. Most of the companies were concerned about a system that relied on vacuum tubes, not realizing that tubes would soon be displaced by transistors and integrated circuits. They were also worried about their staff’s qualifications to maintain such equipment and were generally skeptical of the NC concept. Anticipating this reaction, the Air Force sponsored two additional tasks: (1) information dissemination to industry and (2) an economic study. The information dissemination task included many visits by Servo Lab personnel to companies in the machine tool industry as well as visits to the Lab by industry personnel to observe demonstrations of the prototype machine. The economic study showed clearly that the applications of general-purpose NC machine tools were in low- and medium-quantity production, as opposed to Detroit-type transfer lines, which could be justified only for very large quantities.

In 1956, the Air Force decided to sponsor the development of NC machine tools at several aircraft companies, and these machines were placed in operation between 1958 and 1960. The advantages of NC soon became apparent, and the aerospace companies began placing orders for new NC machines. In some cases, they even built their own units. This served as a stimulus to the remaining machine tool companies that had not yet embraced NC. Advances in computer technology also stimulated further development. The first application of the digital computer for NC was part programming. In 1956, MIT demonstrated the feasibility of a computer-aided part programming system using an early digital computer prototype that had been developed at MIT. Based on this demonstration, the Air Force sponsored development of a part programming language. This research resulted in the development of the APT language in 1958.

The automatically programmed tool system (APT) was the brainchild of mathematician Douglas Ross, who worked in the MIT Servomechanisms Lab at the time. Recall that this project was started in the 1950s, a time when digital computer technology was in its infancy, as were the associated computer programming languages and methods. The APT project was a pioneering effort, not only in the development of NC technology, but also in computer programming concepts, computer graphics, and computer-aided design (CAD). Ross envisioned a part programming system in which (1) the user would prepare instructions for operating the machine tool using English-like words, (2) the digital computer would translate these instructions into a language that the computer could understand and process, (3) the computer would carry out the arithmetic and geometric calculations needed to execute the instructions, and (4) the computer would further process (post-process) the instructions so that they could be interpreted by the machine tool controller. He further recognized that the programming system should be expandable for applications beyond those considered in the immediate research at MIT (milling applications).

Ross's work at MIT became a focal point for NC programming, and a project was initiated to develop a two-dimensional version of APT, with nine aircraft companies plus IBM Corporation participating in the joint effort and MIT as project coordinator. The 2D-APT system was ready for field evaluation at plants of participating companies in April 1958. Testing, debugging, and refining the programming system took approximately three years. In 1961, the Illinois Institute of Technology Research Institute (IITRI) was selected to become responsible for long-range maintenance and upgrading of APT. In 1962, IITRI announced the completion of APT-III, a commercial version of APT for three-dimensional part programming. In 1974, APT was accepted as the U.S. standard for programming NC metal cutting machine tools. In 1978, it was accepted by the ISO as the international standard.

Numerical control technology was in its second decade before computers were employed to actually control machine tool motions. In the mid-1960s, the concept of *direct numerical control* (DNC) was developed, in which individual machine tools were controlled by a mainframe computer located remotely from the machines. The computer bypassed the punched tape reader, instead transmitting instructions to the machine control unit (MCU) in real time, one block at a time. The first prototype system was demonstrated in 1966 [4]. Two companies that pioneered the development of DNC were General Electric Company and Cincinnati Milling Machine Company (which changed its name to Cincinnati Milacron in 1970). Several DNC systems were demonstrated at the National Machine Tool Show in 1970.

Mainframe computers represented the state of the technology in the mid-1960s. There were no personal computers or microcomputers at that time. But the trend in computer technology was toward the use of integrated circuits of increasing levels of integration, which resulted in dramatic increases in computational performance at the same time that the size and cost of the computer were reduced. At the beginning of the 1970s, the economics were right for using a dedicated computer as the MCU. This application came to be known as *computer numerical control* (CNC). At first, minicomputers were used as the controllers; subsequently, microcomputers were used as the performance/size trend continued.

7.1 FUNDAMENTALS OF NC TECHNOLOGY

This section identifies the basic components of an NC system. Then, NC coordinate systems in common use and types of motion controls are described.

7.1.1 Basic Components of an NC System

An NC system consists of three basic components: (1) a part program of instructions, (2) a machine control unit, and (3) processing equipment. The general relationship among the three components is illustrated in Figure 7.1.

The *part program* is the set of detailed step-by-step commands that direct the actions of the processing equipment. In machine tool applications, the person who prepares the program is called a *part programmer*. In these applications, the individual commands refer to positions of a cutting tool relative to the worktable on which the work part is fixtured. Additional instructions are usually included, such as spindle speed, feed rate, cutting tool selection, and other functions. The program is coded on a suitable medium for submission to the machine control unit. For many years, the common medium was 1-in wide punched tape, using a standard format that could be interpreted by the machine control unit. Today, punched tape has largely been replaced by newer storage technologies in modern machine shops. These technologies include magnetic tape, diskettes, and electronic transfer of part programs from a computer.

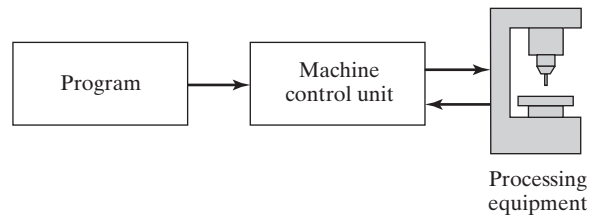


Figure 7.1 Basic components of an NC system.

In modern NC technology, the *machine control unit* (MCU) is a microcomputer and related control hardware that stores the program of instructions and executes it by converting each command into mechanical actions of the processing equipment, one command at a time. The related hardware of the MCU includes components to interface with the processing equipment and feedback control elements. The MCU also includes one or more reading devices for entering part programs into memory. Software residing in the MCU includes control system software, calculation algorithms, and translation software to convert the NC part program into a usable format for the MCU. Because the MCU is a computer, the term *computer numerical control* (CNC) is used to distinguish this type of NC from its technological ancestors that were based entirely on hardwired electronics. Today, virtually all new MCUs are based on computer technology.

The third basic component of an NC system is the processing equipment that performs the actual productive work (e.g., machining). It accomplishes the processing steps to transform the starting workpiece into a completed part. Its operation is directed by the MCU, which in turn is driven by instructions contained in the part program. In the most common example of NC, machining, the processing equipment consists of the worktable and spindle as well as the motors and controls to drive them.

7.1.2 NC Coordinate Systems

To program the NC processing equipment, a part programmer must define a standard axis system by which the position of the work head relative to the work part can be specified. There are two axis systems used in NC, one for flat and prismatic work parts and the other for rotational parts. Both systems are based on the Cartesian coordinates.

The axis system for flat and block-like parts consists of the three linear axes (x , y , z) in the Cartesian coordinate system, plus three rotational axes (a , b , c), as shown in Figure 7.2(a). In most machine tool applications, the x - and y -axes are used to move and position the worktable to which the part is attached, and the z -axis is used to control the vertical position of the cutting tool. Such a positioning scheme is adequate for simple NC applications such as drilling and punching of flat sheet metal. Programming these machine tools consists of little more than specifying a sequence of x - y coordinates.

The a -, b -, and c -rotational axes specify angular positions about the x -, y -, and z -axes, respectively. To distinguish positive from negative angles, the *right-hand rule* is used: Using the right hand with the thumb pointing in the positive linear axis direction ($+x$, $+y$, or $+z$), the fingers of the hand are curled in the positive rotational direction. The rotational axes can be used for one or both of the following: (1) orientation of the work part to present different surfaces for machining or (2) orientation of the tool or work head at some angle relative to the part. These additional axes permit machining of

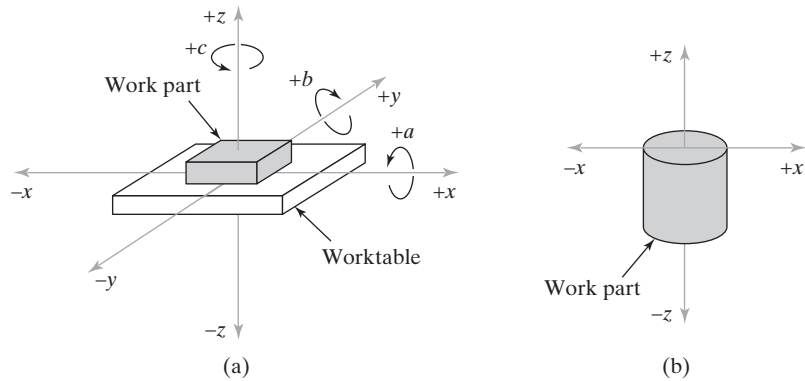


Figure 7.2 Coordinate systems used in NC (a) for flat and prismatic work and (b) for rotational work. (On most turning machines, the z -axis is horizontal rather than vertical as shown here.)

complex work part geometries. Machine tools with rotational axis capability generally have either four or five axes: three linear axes plus one or two rotational axes.

The coordinate axes for a rotational NC system are illustrated in Figure 7.2(b). These systems are associated with NC lathes and turning machines. Although the workpiece rotates, this is not one of the controlled axes on most turning machines. Consequently, the y -axis is not used. The path of the cutting tool relative to the rotating workpiece is defined in the x - z plane, where the x -axis is the radial location of the tool and the z -axis is parallel to the axis of rotation of the part.

Some machine tools are equipped with more than the number of axes described above. The additional axes are usually included to control more than one tool or spindle. Examples of these machine tools are mill-turn centers and multitasking machines (Section 14.2.3).

The part programmer must decide where the origin of the coordinate axis system should be located. This decision is usually based on programming convenience. For example, the origin might be located at one of the corners of the part. If the work part is symmetrical, the zero point might be most conveniently defined at the center of symmetry. Wherever the location, this zero point is communicated to the machine tool operator. At the beginning of the job, the operator must move the cutting tool under manual control to some *target point* on the worktable, where the tool can be easily and accurately positioned. The target point has been previously referenced to the origin of the coordinate axis system by the part programmer. When the tool has been accurately positioned at the target point, the operator indicates to the MCU where the origin is located for subsequent tool movements.

7.1.3 Motion Control Systems

Some NC processes are performed at discrete locations on the work part (e.g., drilling and spot welding). Others are carried out while the work head is moving (e.g., turning, milling, and continuous arc welding). If the work head is moving, it may be necessary to follow a straight line path or a circular or other curvilinear path. These different types of movement are accomplished by the motion control system, whose features are explained below.

Point-to-Point Versus Continuous Path Control. Motion control systems for NC (and robotics, Chapter 8) can be divided into two types: (1) point-to-point and

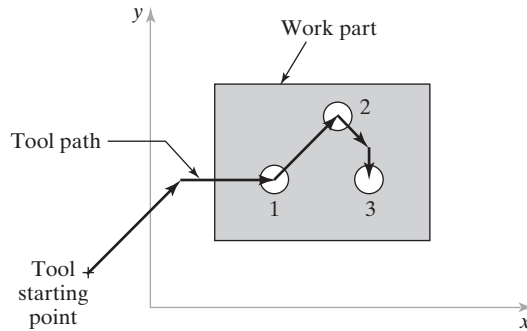


Figure 7.3 Point-to-point (positioning) control in NC. At each x - y position, table movement stops to perform the hole-drilling operation.

(2) continuous path. **Point-to-point** systems, also called *positioning systems*, move the worktable to a programmed location without regard for the path taken to get to that location. Once the move has been completed, some processing action is accomplished by the work head at the location, such as drilling or punching a hole. Thus, the program consists of a series of point locations at which operations are performed, as depicted in Figure 7.3.

Continuous path systems are capable of continuous simultaneous control of two or more axes. This provides control of the tool trajectory relative to the work part. In this case, the tool performs the process while the worktable is moving, thus enabling the system to generate angular surfaces, two-dimensional curves, or three-dimensional contours in the work part. This control mode is required in many milling and turning operations. A simple two-dimensional profile milling operation is shown in Figure 7.4 to illustrate continuous path control. When continuous path control is utilized to move the tool parallel to only one of the major axes of the machine tool worktable, this is called *straight-cut NC*. When continuous path control is used for simultaneous control of two or more axes in machining operations, the term *contouring* is used.

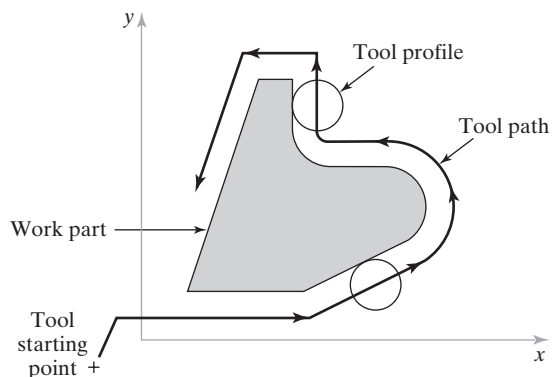


Figure 7.4 Continuous path (contouring) control in NC (x - y plane only). Note that cutting tool path must be offset from the part outline by a distance equal to its radius.

Interpolation Methods. One of the important aspects of contouring is interpolation. The paths that a contouring-type NC system is required to generate often consist of circular arcs and other smooth nonlinear shapes. Some of these shapes can be defined mathematically by relatively simple geometric formulas (e.g., the equation for a circle is $x^2 + y^2 = R^2$, where R = the radius of the circle and the center of the circle is at the origin), whereas others cannot be mathematically defined except by approximation. In any case, a fundamental problem in generating these shapes using NC equipment is that they are continuous, whereas NC is digital. To cut along a circular path, the circle must be divided into a series of straight line segments that approximate the curve. The tool is commanded to machine each line segment in succession so that the machined surface closely matches the desired shape. The maximum error between the nominal (desired) surface and the actual (machined) surface can be controlled by the lengths of the individual line segments, as shown in Figure 7.5.

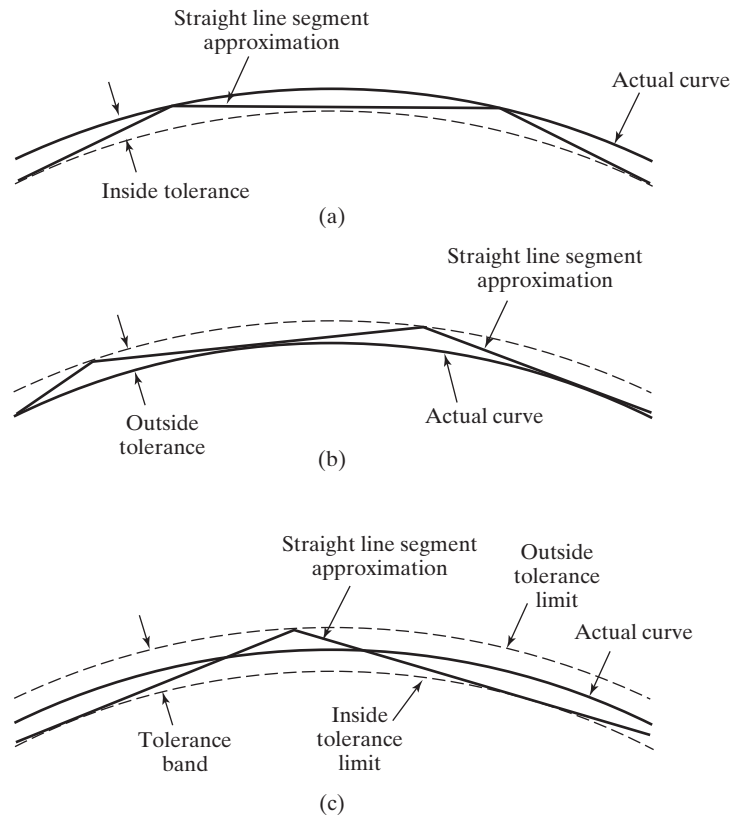


Figure 7.5 Approximation of a curved path in NC by a series of straight line segments. The accuracy of the approximation is controlled by the maximum deviation (called the tolerance) between the nominal (desired) curve and the straight line segments that are machined by the NC system. In (a), the tolerance is defined on only the inside of the nominal curve. In (b), the tolerance is defined on only the outside of the desired curve. In (c), the tolerance is defined on both the inside and outside of the desired curve.

TABLE 7.1 Numerical Control Interpolation Methods for Continuous Path Control

Linear interpolation. This is the most basic method and is used when a straight line path is to be generated in continuous path NC. Two-axis and three-axis linear interpolation routines are sometimes distinguished in practice, but conceptually they are the same. The programmer specifies the beginning point and endpoint of the straight line and the feed rate to be used along the straight line. The interpolator computes the feed rates for each of the two (or three) axes to achieve the specified feed rate.

Circular interpolation. This method permits programming of a circular arc by specifying the following parameters: (1) the coordinates of the starting point, (2) the coordinates of the endpoint, (3) either the center or radius of the arc, and (4) the direction of the cutter along the arc. The generated tool path consists of a series of small straight line segments (see Figure 7.5) calculated by the interpolation module. The cutter is directed to move along each line segment one by one to generate the smooth circular path. A limitation of circular interpolation is that the plane in which the circular arc exists must be a plane defined by two axes of the NC system ($x - y$, $x - z$, or $y - z$).

Helical interpolation. This method combines the circular interpolation scheme for two axes with linear movement of a third axis. This permits the definition of a helical path in three-dimensional space. Applications include the machining of large internal threads, either straight or tapered.

Parabolic and cubic interpolations. These routines provide approximations of free-form curves using higher order equations. They generally require considerable computational power and are not as common as linear and circular interpolation. Most applications are in the aerospace and automotive industries for free-form designs that cannot accurately and conveniently be approximated by combining linear and circular interpolations.

If the programmer were required to specify the endpoints for each of the line segments, the programming task would be extremely arduous and fraught with errors. Also, the part program would be extremely long because of the large number of points. To ease the burden, interpolation routines have been developed that calculate the intermediate points to be followed by the cutter to generate a particular mathematically defined or approximated path.

A number of interpolation methods are available to deal with the problems encountered in generating a smooth continuous path in contouring. They include (1) linear interpolation, (2) circular interpolation, (3) helical interpolation, (4) parabolic interpolation, and (5) cubic interpolation. Each of these procedures, briefly described in Table 7.1, permits the programmer to generate machine instructions for linear or curvilinear paths using relatively few input parameters. The interpolation module in the MCU performs the calculations and directs the tool along the path. In CNC systems, the interpolator is generally accomplished by software. Linear and circular interpolators are almost always included in modern CNC systems, whereas helical interpolation is a common option. Parabolic and cubic interpolations are less common because they are only needed by machine shops that produce complex surface contours.

Absolute Versus Incremental Positioning. Another aspect of motion control is concerned with whether positions are defined relative to the origin of the coordinate system (absolute positioning) or relative to the previous location of the tool (incremental positioning). In absolute positioning, the work head locations are always defined with respect to the origin of the axis system. In incremental positioning, the next work head position is defined relative to the present location. The difference is illustrated in Figure 7.6.

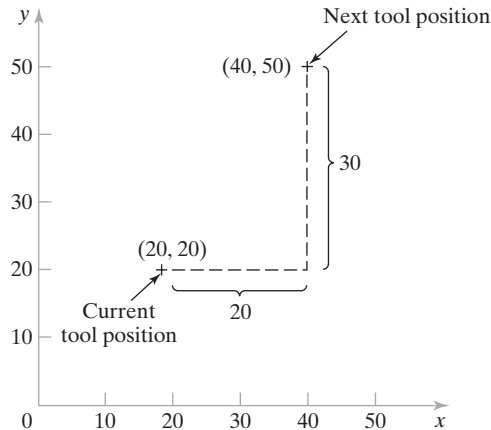


Figure 7.6 Absolute versus incremental positioning. The work head is presently at point $(20, 20)$ and is to be moved to point $(40, 50)$. In absolute positioning, the move is specified by $x = 40, y = 50$; whereas in incremental positioning, the move is specified by $x = 20, y = 30$.

7.2 COMPUTERS AND NUMERICAL CONTROL

Since the introduction of NC in 1952, there have been dramatic advances in digital computer technology. The physical size and cost of a digital computer have been significantly reduced at the same time that its computational capabilities have been substantially increased. The makers of NC equipment incorporated these advances in computer technology into their products, starting with large mainframe computers in the 1960s and followed by minicomputers in the 1970s and microcomputers in the 1980s. Today, NC means *computer numerical control (CNC)*, which is defined as an NC system whose MCU consists of a dedicated microcomputer rather than a hardwired controller. The latest computer controllers for CNC feature high-speed processors, large memories, solid-state memory, improved servos, and bus architectures [12].


Computer NC systems include additional features beyond what is feasible with conventional hardwired NC. A list of many of these features is compiled in Table 7.2.

7.2.1 The CNC Machine Control Unit

The MCU is the hardware that distinguishes CNC from conventional NC. The general configuration of the MCU in a CNC system is illustrated in Figure 7.7. The MCU consists of the following components and subsystems: (1) central processing unit, (2) memory, (3) I/O interface, (4) controls for machine tool axes and spindle speed, and (5) sequence controls for other machine tool functions. These subsystems are interconnected by means of a system bus, which communicates data and signals among the components of the network.

TABLE 7.2 Features of Computer Numerical Control that Distinguish It from Conventional NC

- Storage of more than one part program.* With improvements in storage technology, newer CNC controllers have sufficient capacity to store multiple programs. Controller manufacturers generally offer one or more memory expansions as options to the MCU.
- Program editing at the machine tool.* CNC permits a part program to be edited while it resides in the MCU computer memory. Hence, a program can be tested and corrected entirely at the machine site. Editing also permits cutting conditions in the machining cycle to be optimized. After the program has been corrected and optimized, the revised version can be stored for future use.
- Fixed cycles and programming subroutines.* The increased memory capacity and the ability to program the control computer provide the opportunity to store frequently used machining cycles as *macros* that can be called by the part program. Instead of writing the full instructions for the particular cycle into every program, a programmer includes a call statement in the part program to indicate that the macro cycle should be executed. These cycles often require that certain parameters be defined, for example, a bolt hole circle, in which the diameter of the bolt circle, the spacing of the bolt holes, and other parameters must be specified.
- Adaptive control.* In this feature, the MCU measures and analyzes machining variables, such as spindle torque, power, and tool-tip temperature, and adjusts cutting speed and/or feed rate to maximize machining performance. Benefits include reduced cycle time and improved surface finish.
- Interpolation.* Some of the interpolation schemes described in Table 7.1 are normally executed on a CNC system because of the computational requirements. Linear and circular interpolations are sometimes hardwired into the control unit, but helical, parabolic, and cubic interpolations are usually executed by a stored program algorithm.
- Positioning features for setup.* Setting up the machine tool for a given work part involves installing and aligning a fixture on the machine tool table. This must be accomplished so that the machine axes are established with respect to the work part. The alignment task can be facilitated using certain features made possible by software options in a CNC system, such as *position set*. With position set, the operator is not required to locate the fixture on the machine table with extreme accuracy. Instead, the machine tool axes are referenced to the location of the fixture using a target point or set of target points on the work or fixture.
- Acceleration and deceleration calculations.* This feature is applicable when the cutter moves at high feed rates. It is designed to avoid tool marks on the work surface that would be generated due to machine tool dynamics when the cutter path changes abruptly. Instead, the feed rate is smoothly decelerated in anticipation of a tool path change and then accelerated back up to the programmed feed rate after the direction change.
- Communications interface.* With the trend toward interfacing and networking in plants today, modern CNC controllers are equipped with a standard communications interface to link the machine to other computers and computer-driven devices. This is useful for applications such as (1) downloading part programs from a central data file; (2) collecting operational data such as workpiece counts, cycle times, and machine utilization; and (3) interfacing with peripheral equipment, such as robots that load and unload parts.
- Diagnostics.* Many modern CNC systems possess a diagnostics capability that monitors certain aspects of the machine tool to detect malfunctions or signs of impending malfunctions or to diagnose system breakdowns.

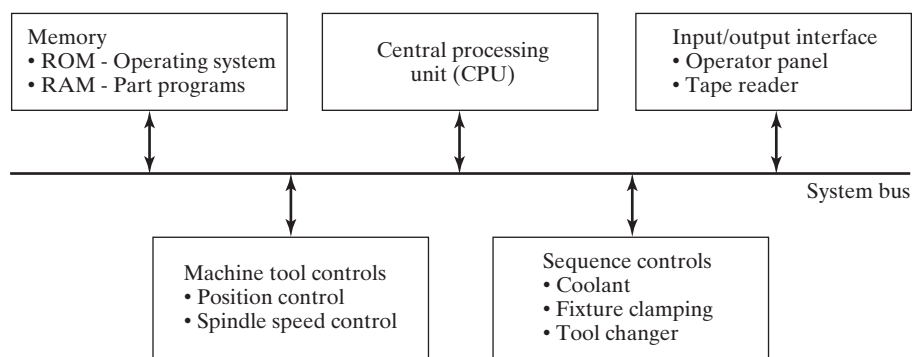**Figure 7.7** Configuration of CNC machine control unit.

Central Processing Unit. The central processing unit (CPU) is the brain of the MCU. It manages the other components in the MCU based on software contained in main memory. The CPU can be divided into three sections: (1) control section, (2) arithmetic-logic unit, and (3) immediate access memory. The control section retrieves commands and data from memory and generates signals to activate other components in the MCU. In short, it sequences, coordinates, and regulates the activities of the MCU computer. The arithmetic-logic unit (ALU) consists of the circuitry to perform various calculations (addition, subtraction, multiplication), counting, and logical functions required by software residing in memory. The immediate access memory provides a temporary storage for data being processed by the CPU. It is connected to main memory by means of the system data bus.

Memory. The immediate access memory in the CPU is not intended for storing CNC software. A much greater storage capacity is required for the various programs and data needed to operate the CNC system. As with most other computer systems, CNC memory can be divided into two categories: (1) main memory and (2) secondary memory. Main memory consists of ROM (read-only memory) and RAM (random access memory) devices. Operating system software and machine interface programs (Section 7.2.2) are generally stored in ROM. These programs are usually installed by the manufacturer of the MCU. NC part programs are stored in RAM devices. Current programs in RAM can be erased and replaced by new programs as jobs are changed.

High-capacity secondary memory devices are used to store large programs and data files, which are transferred to main memory as needed. Common among the secondary memory devices are hard disks and solid-state memory devices to store part programs, macros, and other software. These high-capacity storage devices are permanently installed in the CNC machine control unit and have replaced most of the punched paper tape traditionally used to store part programs.

Input/Output Interface. The I/O interface provides communication between the various components of the CNC system, other computer systems, and the machine operator. As its name suggests, the I/O interface transmits and receives data and signals to and from external devices, several of which are indicated in Figure 7.7. The operator control panel is the basic interface by which the machine operator communicates to the CNC system. This is used to enter commands related to part program editing, MCU operating mode (e.g., program control vs. manual control), speeds and feeds, cutting fluid pump on/off, and similar functions. Either an alphanumeric keypad or keyboard is usually included in the operator control panel. The I/O interface also includes a display to communicate data and information from the MCU to the machine operator. The display is used to indicate current status of the program as it is being executed and to warn the operator of any malfunctions in the system.

Also included in the I/O interface are one or more means of entering part programs into storage. Programs can be entered manually by the machine operator or stored at a central computer site and transmitted via local area network (LAN) to the CNC system. Whichever means is employed by the plant, a suitable device must be included in the I/O interface to allow input of the programs into MCU memory.

Controls for Machine Tool Axes and Spindle Speed. These are hardware components that control the position and velocity (feed rate) of each machine axis as well as the rotational speed of the machine tool spindle. Control signals generated by the MCU

must be converted to a form and power level suited to the particular position control systems used to drive the machine axes. Positioning systems can be classified as open loop or closed loop, and different hardware components are required in each case. A more detailed discussion of these hardware elements is presented in Section 7.4, together with an analysis of how they operate to achieve position and feed rate control. Some of the hardware components are resident in the MCU.

Depending on the type of machine tool, the spindle is used to drive either (1) the workpiece, as in turning, or (2) a rotating cutter, as in milling and drilling. Spindle speed is a programmed parameter. Components for spindle speed control in the MCU usually consist of a drive control circuit and a feedback sensor interface.

Sequence Controls for Other Machine Tool Functions. In addition to control of table position, feed rate, and spindle speed, several additional functions are accomplished under part program control. These auxiliary functions generally involve on/off (binary) actuations, interlocks, and discrete numerical data. The functions include cutting fluid control, fixture clamping, emergency warnings, and interlock communications for robot loading and unloading of the machine tool.

7.2.2 CNC Software

The NC computer operates by means of software. There are three types of software programs used in CNC systems: (1) operating system software, (2) machine interface software, and (3) application software.

The principal function of the operating system software is to interpret the NC part programs and generate the corresponding control signals to drive the machine tool axes. It is installed by the controller manufacturer and is stored in ROM in the MCU. The operating system software consists of the following: (1) an editor, which permits the machine operator to input and edit NC part programs and perform other file management functions; (2) a control program, which decodes the part program instructions, performs interpolation and acceleration/deceleration calculations, and accomplishes other related functions to produce the coordinate control signals for each axis; and (3) an executive program, which manages the execution of the CNC software as well as the I/O operations of the MCU. The operating system software also includes any diagnostic routines that are available in the CNC system.

Machine interface software is used to operate the communication link between the CPU and the machine tool to accomplish the CNC auxiliary functions. The I/O signals associated with the auxiliary functions are sometimes implemented by means of a programmable logic controller interfaced to the MCU, so the machine interface software is often written in the form of ladder logic diagrams (Section 9.2).

Finally, the application software consists of the NC part programs that are written for machining (or other) applications in the user's plant. The topic of part programming is postponed to Section 7.5.

7.2.3 Distributed Numerical Control

Historical Note 7.1 describes several ways in which digital computers have been used to implement NC. This section describes two approaches: (1) direct numerical control and (2) distributed numerical control.

Direct numerical control (DNC) was the first attempt to use a digital computer to control NC machines. It was in the late 1960s, before the advent of CNC. As initially implemented, direct numerical control involved the control of a number of machine tools by a single (mainframe) computer through direct connection and in real time. Instead of using a punched tape reader to enter the part program into the MCU, the program was transmitted to the MCU directly from the computer, one block of instructions at a time. An instruction block provides the commands for one complete move of the machine tool, including location coordinates, speeds, feeds, and other data (Section 7.5.1). This mode of operation was referred to by the term *behind the tape reader* (BTR). The DNC computer provided instruction blocks to the machine tool on demand; when a machine needed control commands, they were communicated to it immediately. As each block was executed by the machine, the next block was transmitted. As far as the machine tool was concerned, the operation was no different from that of a conventional NC controller. In theory, DNC relieved the NC system of its least reliable components: the punched tape and tape reader.

The general configuration of a DNC system is depicted in Figure 7.8. The system consisted of four components: (1) central computer, (2) bulk memory at the central computer site, (3) set of controlled machines, and (4) telecommunications lines to connect the machines to the central computer. In operation, the computer called the required part program from bulk memory and sent it (one block at a time) to the designated machine tool. This procedure was replicated for all machine tools under direct control of the computer.

In addition to transmitting data to the machines, the central computer also received data back from the machines to indicate operating performance in the shop (e.g., number of machining cycles completed, machine utilization, and breakdowns). A central objective of DNC was to achieve two-way communication between the machines and the central computer.

As the installed base of CNC machines grew during the 1970s and 1980s, a new form of DNC emerged, called *distributed numerical control* (DNC). The configuration of the new DNC is very similar to that shown in Figure 7.8 except that the central computer is connected to MCUs, which are themselves computers; basically this is a distributed control system (Section 5.3.3). Complete part programs are sent to the machine tools, not

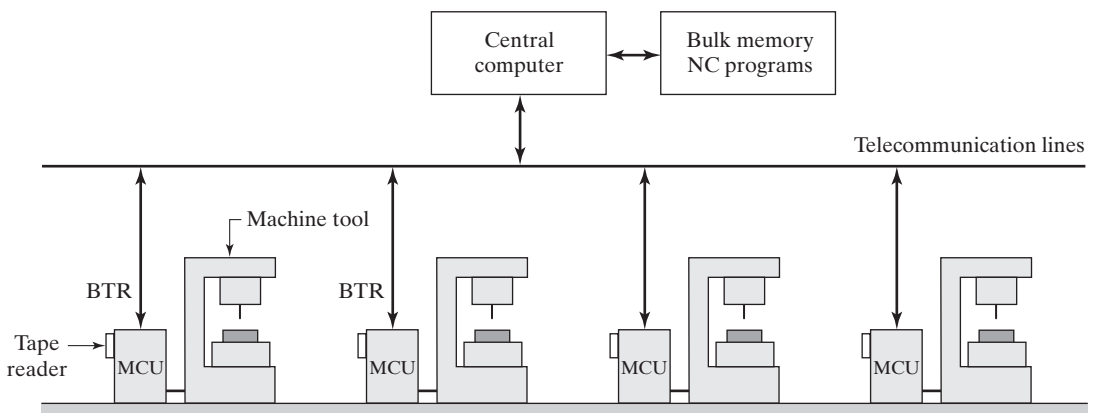


Figure 7.8 General configuration of a DNC system. Connection to MCU is behind the tape reader. Key: BTR = behind the tape reader, MCU = machine control unit.

TABLE 7.3 Flow of Data and Information Between Central Computer and Machine Tools in DNC

Data and Information Downloaded from the Central Computer to the Machine Tools	Data and Information Uploaded from the Machine Tools to the Central Computer
NC part programs	Piece counts
List of tools needed for job	Actual machining cycle times
Machine tool setup instructions	Tool life statistics
Machine operator instructions	Machine uptime and downtime statistics
Machining cycle time for part program	Product quality data
Data about when program was last used	Machine utilization
Production schedule information	

one block at a time. The distributed NC approach permits easier and less costly installation of the overall system, because the individual CNC machines can be put into service and distributed NC can be added later. Redundant computers improve system reliability compared with the original DNC. The new DNC permits two-way communication of data between the shop floor and the central computer, which was one of the important features included in the old DNC. However, improvements in data collection devices as well as advances in computer and communications technologies have expanded the range and flexibility of the information that can be gathered and disseminated. Some of the data and information sets included in the two-way communication flow are itemized in Table 7.3. This flow of information in DNC is similar to the information flow in shop floor control, discussed in Chapter 25.

7.3 APPLICATIONS OF NC

The operating principle of NC has many applications. There are many industrial operations in which the position of a work head must be controlled relative to a part or product being processed. The applications divide into two categories: (1) machine tool applications and (2) other applications. Most machine tool applications are associated with the metalworking industry. The other applications comprise a diverse group of operations in other industries. It should be noted that the applications are not always identified by the name “numerical control”; this term is used principally in the machine tool industry.

7.3.1 Machine Tool Applications

The most common applications of NC are in machine tool control. Machining was the first application of NC, and it is still one of the most important commercially.

Machining Operations and NC Machine Tools. Machining is a manufacturing process in which the geometry of the work is produced by removing excess material (Section 2.2.1). Control of the relative motion between a cutting tool and the workpiece creates the desired geometry. Machining is considered one of the most versatile processes because it can be used to create a wide variety of shapes and surface finishes. It can be performed at relatively high production rates to yield highly accurate parts at relatively low cost.

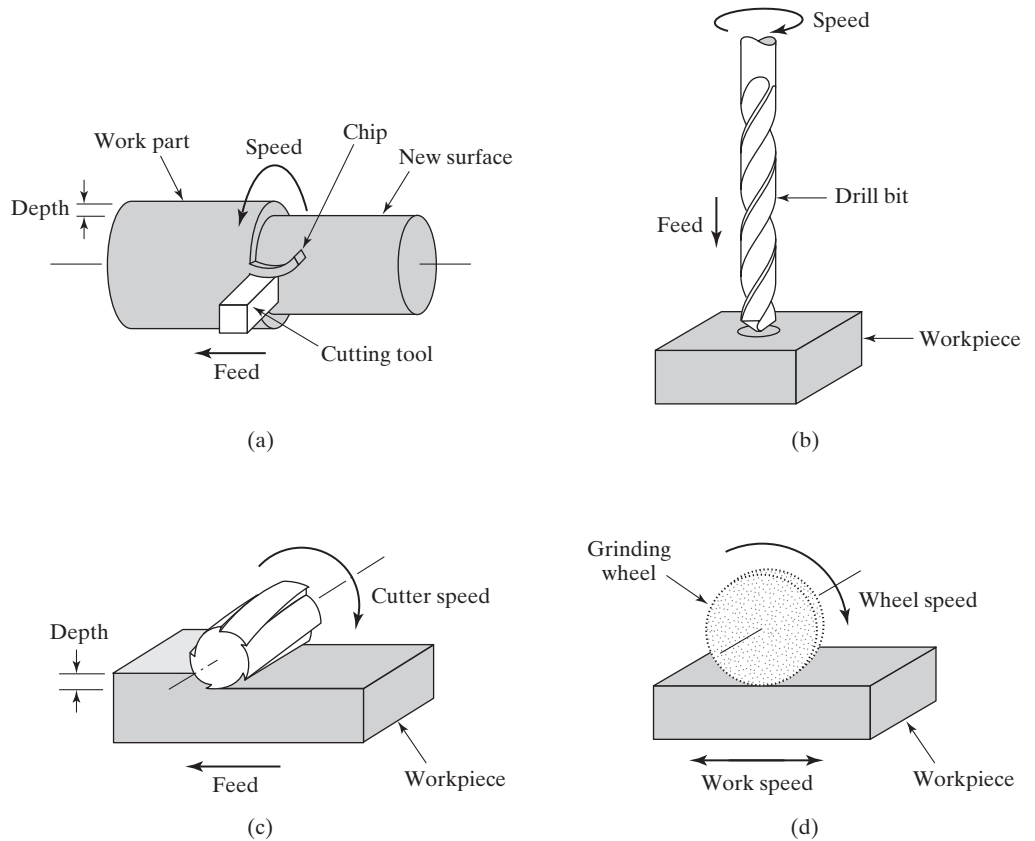


Figure 7.9 The four common machining operations are (a) turning, (b) drilling, (c) peripheral milling, and (d) surface grinding.

There are four common types of machining operations: (a) turning, (b) drilling, (c) milling, and (d) grinding, shown in Figure 7.9. Each of the machining operations is carried out at a certain combination of speed, feed, and depth of cut, collectively called the *cutting conditions*. The terminology varies somewhat for grinding. These cutting conditions are illustrated in Figure 7.9 for turning, drilling, and milling. Consider milling. The **cutting speed** is the velocity of the milling cutter relative to the work surface, m/min (ft/min). This is usually programmed into the machine as a spindle rotation speed, rev/min. Cutting speed can be converted into spindle rotation speed by means of the equation

$$N = \frac{v}{\pi D} \quad (7.1)$$

where N = spindle rotation speed, rev/min; v = cutting speed, m/min (ft/min); and D = milling cutter diameter, m (ft). In milling, the **feed** usually means the size of the chip formed by each tooth in the milling cutter, often referred to as the *chip load* per tooth. This must normally be programmed into the NC machine as the feed rate (the travel rate of the machine tool table). Therefore, feed must be converted to feed rate as

$$f_r = Nn_t f \quad (7.2)$$

where f_r = feed rate, mm/min (in/min); N = spindle rotational speed, rev/min; n_t = number of teeth on the milling cutter; and f = feed, mm/tooth (in/tooth). For a turning operation, feed is defined as the lateral movement of the cutting tool per revolution of the workpiece, mm/rev (in/rev). **Depth of cut** is the distance the tool penetrates below the original surface of the work, mm (in). For drilling, depth of cut refers to the depth of the hole. These are the parameters that must be controlled during the operation of an NC machine through motion or position commands in the part program.

Each of the four machining processes is traditionally carried out on a machine tool designed to perform that process. Turning is performed on a lathe, drilling is done on a drill press, milling on a milling machine, and so on. The following is a list of the common material-removal CNC machine tools along with their typical features:

- *NC lathe*, either horizontal or vertical axis. Turning requires two-axis, continuous path control, either to produce a straight cylindrical geometry (straight turning) or to create a profile (contour turning).
- *NC boring mill*, horizontal or vertical spindle. Boring is similar to turning, except that an internal cylinder is created instead of an external cylinder. The operation requires continuous path, two-axis control.
- *NC drill press*. This machine uses point-to-point control of a work head (spindle containing the drill bit) and two axis (x - y) control of a worktable. Some NC drill presses have turrets containing six or eight drill bits. The turret position is programmed under NC control, allowing different drill bits to be applied to the same work part during the machine cycle without requiring the machine operator to manually change the tool.
- *NC milling machine*. A milling machine requires continuous path control to perform straight cut or contouring operations. Figure 7.10 illustrates the features of a CNC four-axis milling machine.
- *NC cylindrical grinder*. This machine operates like a turning machine, except that the tool is a grinding wheel. It has continuous path two-axis control, similar to an NC lathe.

Numerical control has had a profound influence on the design and operation of machine tools. One of the effects is that the proportion of time spent by the machine cutting metal is significantly greater than with manually operated machines. This causes certain components such as the spindle, drive gears, and feed screws to wear more rapidly. These components must be designed to last longer on NC machines. Secondly, the addition of the electronic control unit has increased the cost of the machine, requiring higher equipment utilization. Instead of running the machine during only one shift, which is the typical schedule with manually operated machines, NC machines are often operated during two or even three shifts to obtain the required economic payback. Third, the increasing cost of labor has altered the relative roles of the human operator and the machine tool. Instead of being the highly skilled worker who controlled every aspect of part production, the NC machine operator performs only part loading and unloading, tool-changing, chip clearing, and the like. With these reduced responsibilities, one operator can often run two or three NC machines.

The functions performed by the machine tool have also changed. NC machines are designed to be highly automatic and capable of combining several operations in one setup that formerly required several different machines. They are also designed to reduce the time consumed by the noncutting elements in the operation cycle, such as changing tools

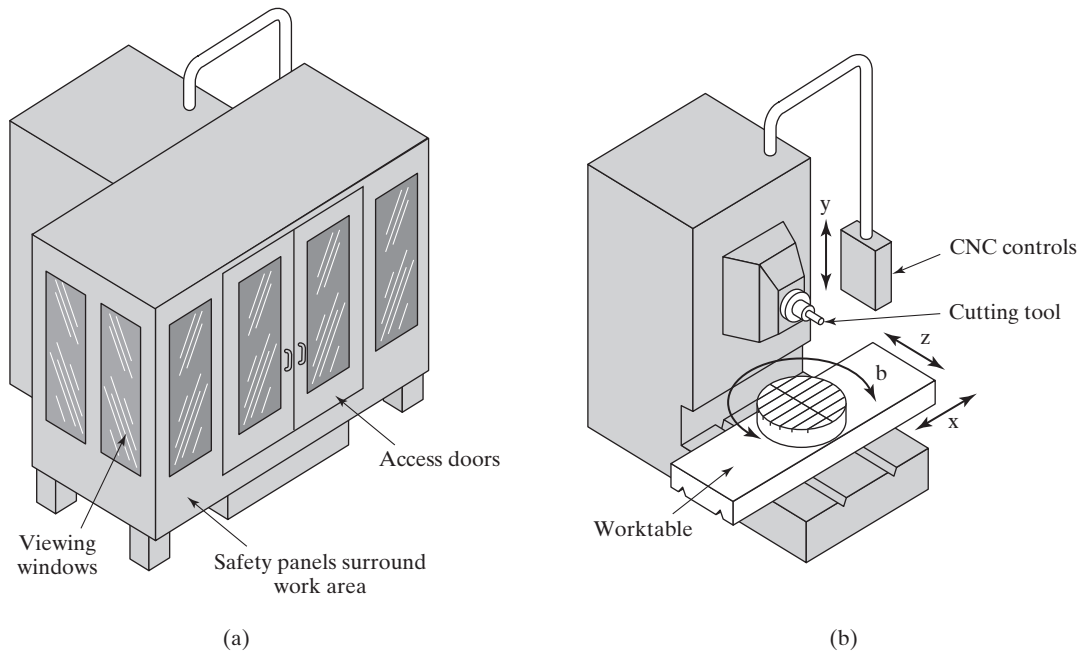


Figure 7.10 (a) Four-axis CNC horizontal milling machine with safety panels installed and (b) with safety panels removed to show typical axis configuration for the horizontal spindle.

and loading and unloading the work part. These changes are best exemplified by a new type of machine that did not exist prior to the development of NC: the ***machining center***, which is a machine tool capable of performing multiple machining operations on a single workpiece in one setup. The operations involve rotating cutters, such as milling and drilling, and the feature that enables more than one operation to be performed in one setup is automatic tool-changing. Machining centers and related machine tools are discussed in Chapter 14 on single-station manufacturing cells (Section 14.2.3).

NC Application Characteristics. In general, NC technology is appropriate for low-to-medium production of medium-to-high variety product. Using the terminology of Section 2.4.1, the product is low-to-medium Q , medium-to-high P . Over many years of machine shop practice, the following part characteristics have been identified as most suited to the application of NC:

1. **Batch production.** NC is most appropriate for parts produced in small or medium lot sizes (batch sizes ranging from one unit up to several hundred units). Dedicated automation would not be economical for these quantities because of the high fixed cost. Manual production would require many separate machine setups and would result in higher labor cost, longer lead time, and higher scrap rate.
2. **Repeat orders.** Batches of the same parts are produced at random or periodic intervals. Once the NC part program has been prepared, parts can be economically produced in subsequent batches using the same part program.

3. *Complex part geometry.* The part geometry includes complex curved surfaces such as those found on airfoils and turbine blades. Mathematically defined surfaces such as circles and helices can also be accomplished with NC. Some of these geometries would be difficult if not impossible to achieve accurately using conventional machine tools.
4. *Much metal needs to be removed from the work part.* This condition is often associated with a complex part geometry. The volume and weight of the final machined part is a relatively small fraction of the starting block. Such parts are common in the aircraft industry to fabricate large structural sections with low weights.
5. *Many separate machining operations on the part.* This applies to parts consisting of many machined features requiring different cutting tools, such as drilled and/or tapped holes, slots, flats, and so on. If these operations were machined by a series of manual operations, many setups would be needed. The number of setups can be reduced significantly using NC.
6. *The part is expensive.* This factor is often a consequence of one or more of preceding factors 3, 4, and 5. It can also result from using a high-cost starting work material. When the part is expensive, and mistakes in processing would be costly, the use of NC helps to reduce rework and scrap losses.

Although these characteristics pertain mainly to machining, they are adaptable to other production applications as well.

NC for Other Metalworking Processes. NC machine tools have been developed for other metalworking processes besides machining. These machines include the following:

- *Punch presses* for sheet metal hole punching. The two-axis NC operation is similar to that of a drill press except that holes are produced by punching rather than drilling. Different hole sizes and shapes are implemented using a tool turret.
- *Presses* for sheet metal bending. Instead of cutting sheet metal, these systems bend sheet metal according to programmed commands.
- *Welding machines.* Both spot welding and continuous arc welding machines are available with automatic controls based on NC.
- *Thermal cutting machines,* such as oxy-fuel cutting, laser cutting, and plasma arc cutting. The stock is usually flat; thus, two-axis control is adequate. Some laser cutting machines can cut holes in preformed sheet metal stock, requiring four- or five-axis control.
- *Tube bending and wire bending machines.* Automatic tube and wire bending machines are programmed to control the location (along the length of the stock) and the angle of the bend. Important tube bending applications include frames for bicycles and motorcycles. Wire bending applications include springs and paper clips.
- *Wire EDM.* Electric discharge wire cutting operates in a manner similar to a band saw, except that the saw is a small diameter wire that uses sparks to cut metal stock that is positioned by an x - y positioning table.

7.3.2 Other NC Applications

The operating principle of NC has a host of other applications besides metalworking. Some of the machines with NC-type controls that position a work head relative to an object being processed are the following:

- *Rapid prototyping and additive manufacturing.* These include a number of processes that add material, one thin layer at a time, to construct a part. Many of them operate by means of a work head that is manipulated by NC over the partially constructed part. Some processes use lasers to cure photosensitive liquid polymers (stereolithography) or fuse solid powders (selective laser sintering); others use extruder heads that add material (fused deposition modeling).
- *Water jet cutters and abrasive water jet cutters.* These machines are used to cut various materials, including metals and nonmetals (e.g., plastic, cloth), by means of a fine, high-pressure, high-velocity stream of water. Abrasive particles are added to the stream in the case of abrasive water jet cutting to facilitate cutting of more difficult materials (e.g., metals). The work head is manipulated relative to the work material by means of numerical control.
- *Component placement machines.* This equipment is used to position components on an x - y plane, usually a printed circuit board. The program specifies the x - and y -axis positions in the plane where the components are to be located. Component placement machines find extensive applications for placing electronic components on printed circuit boards. Machines are available for either through-hole or surface-mount applications as well as similar insertion-type mechanical assembly operations.
- *Coordinate measuring machines.* A coordinate measuring machine (CMM) is an inspection machine used for measuring or checking dimensions of a part. A CMM has a probe that can be manipulated in three axes and that identifies when contact is made against a part surface. The location of the probe tip is determined by the CMM control unit, thereby indicating some dimension on the part. Many coordinate measuring machines are programmed to perform automated inspections under NC. Coordinate measuring machines are discussed in Section 22.3.
- *Wood routers and granite cutters.* These machines perform operations similar to NC milling for metal machining, except the work materials are not metals. Many wood cutting lathes are also NC machines.
- *Tape laying machines for polymer composites.* The work head of this machine is a dispenser of uncured polymer matrix composite tape. The machine is programmed to lay the tape onto the surface of a contoured mold, following a back-and-forth and crisscross pattern to build up a required thickness. The result is a multilayered panel of the same shape as the mold.
- *Filament winding machines for polymer composites.* These are similar to the preceding machine except that a filament is dipped in uncured polymer and wrapped around a rotating pattern of roughly cylindrical shape.

7.3.3 Advantages and Disadvantages of NC

When the production application satisfies the characteristics identified in Section 7.3.1, NC yields many advantages over manual production methods. These advantages translate into economic savings for the user company. However, NC involves more sophisticated technology than conventional methods, and there are costs that must be considered to apply the technology effectively. This section examines the advantages and disadvantages of NC.

Advantages of NC. The advantages generally attributed to NC, with emphasis on machine tool applications, are the following:

- *Nonproductive time is reduced.* NC reduces the proportion of time the machine is not cutting metal. This is achieved through fewer setups, less setup time, reduced workpiece handling time, and automatic tool changes on some NC machines, all of which translate into labor cost savings and lower elapsed times to produce parts.
- *Greater accuracy and repeatability.* Compared with manual production methods, NC reduces or eliminates variations due to operator skill differences, fatigue, and other factors attributed to inherent human variabilities. Parts are made closer to nominal dimensions, and there is less dimensional variation among parts in the batch.
- *Lower scrap rates.* Because greater accuracy and repeatability are achieved, and because human errors are reduced, more parts are produced within tolerance. The ultimate goal in NC is zero defects.
- *Inspection requirements are reduced.* Less inspection is needed when NC is used because parts produced from the same NC part program are virtually identical. Once the program has been verified, there is no need for the high level of sampling inspection that is required when parts are produced by conventional manual methods. Except for tool wear and equipment malfunctions, NC produces exact replicates of the part each cycle.
- *More complex part geometries are possible.* NC technology has extended the range of possible part geometries beyond what is practical with manual machining methods. This is an advantage for product design in several ways: (1) More functional features can be designed into a single part, thus reducing the total number of parts in the product and the associated cost of assembly, (2) mathematically defined surfaces can be fabricated with high precision, and (3) the limits within which the designer's imagination can wander to create new part and product geometries are expanded.
- *Engineering changes can be accommodated more gracefully.* Instead of making alterations in a complex fixture so that the part can be machined to the engineering change, revisions are made in the NC part program to accomplish the change.
- *Simpler fixtures.* NC requires simpler fixtures because accurate positioning of the tool is accomplished by the NC machine tool. Tool positioning does not have to be designed into the jig.
- *Shorter manufacturing lead times.* Jobs can be set up more quickly and fewer setups are required per part when NC is used. This results in shorter elapsed time between order release and completion.
- *Reduced parts inventory.* Because fewer setups are required and job changeovers are easier and faster, NC permits production of parts in smaller lot sizes. The economic lot size is lower in NC than in conventional batch production. Average parts inventory is therefore reduced.
- *Less floor space.* This results from the fact that fewer NC machines are required to perform the same amount of work compared to the number of conventional machine tools needed. Reduced parts inventory also contributes to less floor space requirements.
- *Operator skill requirements are reduced.* Workers need fewer skills to operate an NC machine than to operate a conventional machine tool. Tending an NC machine tool usually consists only of loading and unloading parts and periodically changing tools. The machining cycle is carried out under program control. Performing a comparable machining cycle on a conventional machine requires much more participation by the operator and a higher level of training and skill.

Disadvantages of NC. There are certain commitments to NC technology that must be made by the machine shop that installs NC equipment, and these commitments, most of which involve additional cost to the company, might be seen as disadvantages. These include the following:

- *Higher investment cost.* An NC machine tool has a higher first cost than a comparable conventional machine tool. There are several reasons why: (1) NC machines include CNC controls and electronics hardware; (2) software development costs of the CNC controls manufacturer must be included in the cost of the machine; (3) more reliable mechanical components are generally used in NC machines; and (4) NC machine tools often possess additional features not included on conventional machines, such as automatic tool changers and part changers (Section 14.2.3).
- *Higher maintenance effort.* In general, NC equipment requires more maintenance than conventional equipment, which translates to higher maintenance and repair costs. This is due largely to the computer and other electronics that are included in a modern NC system. The maintenance staff must include personnel who are trained in maintaining and repairing this type of equipment.
- *Part programming.* NC equipment must be programmed. To be fair, it should be mentioned that process planning must be accomplished for any part, whether or not it is produced by NC. However, NC part programming is a special preparation step in batch production that is absent in conventional machine shop operations.
- *Higher utilization of NC equipment.* To maximize the economic benefits of NC, some companies operate multiple shifts. This might mean adding one or two extra shifts to the plant's normal operations, with the requirement for supervision and other staff support.

7.4 ANALYSIS OF POSITIONING SYSTEMS

An NC positioning system converts the coordinate axis values in the NC part program into relative positions of the tool and work part during processing. Consider the simple positioning system shown in Figure 7.11. The system consists of a cutting tool and a worktable on which a work part is fixtured. The table is designed to move the part relative to the tool. The worktable moves linearly by means of a rotating leadscrew or ball screw, which is driven by a stepper motor or servomotor (Section 6.2.1). For simplicity, only one

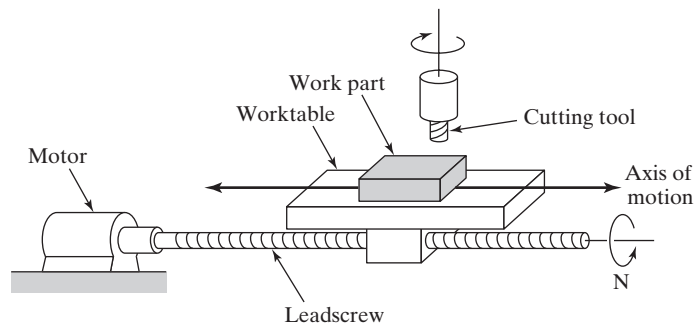


Figure 7.11 Motor and leadscrew arrangement in an NC positioning system.

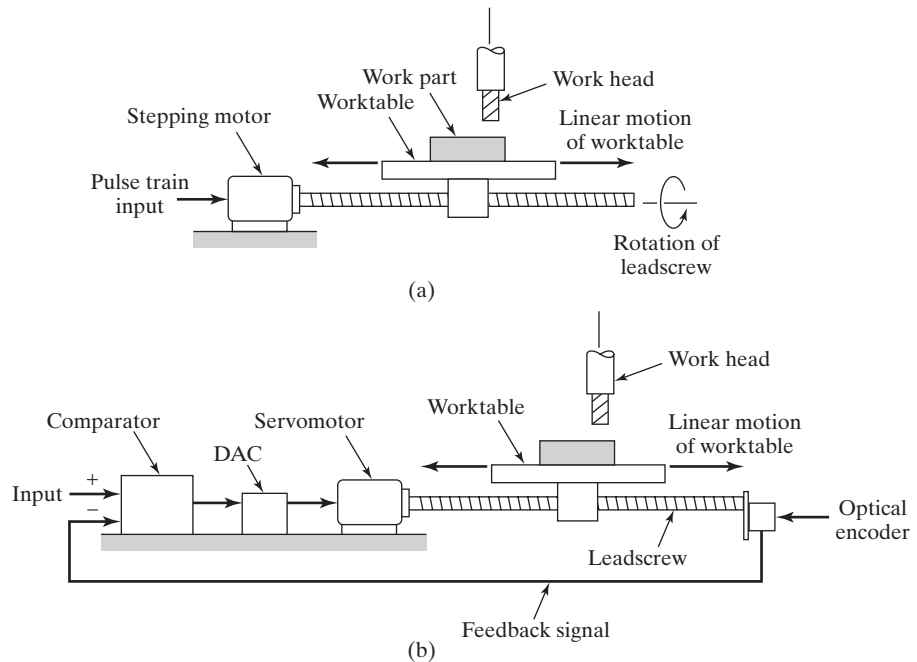


Figure 7.12 Two types of motion control in NC: (a) open loop and (b) closed loop.

axis is shown in the sketch. To provide x - y capability, the system shown would be piggy-backed on top of a second axis perpendicular to the first. The screw has a certain pitch p , mm/thread (in/thread). Thus, the table moves a distance equal to the pitch for each revolution. The velocity of the worktable, which corresponds to the feed rate in a machining operation, is determined by the rotational speed of the screw.

Two types of control systems are used in positioning systems: (a) open loop and (b) closed loop, as shown in Figure 7.12. An open-loop system operates without verifying that the actual position achieved in the move is the same as the desired position. A closed-loop system uses feedback measurements to confirm that the final position of the worktable is the location specified in the program. Open-loop systems cost less than closed-loop systems and are appropriate when the force resisting the actuating motion is minimal. Closed-loop systems are normally specified for machines that perform continuous path operations such as milling or turning, in which there are significant forces resisting the forward motion of the cutting tool.

7.4.1 Open-Loop Positioning Systems

An open-loop positioning system typically uses a stepper motor to rotate the leadscrew or ball screw. A stepper motor is driven by a series of electrical pulses, which are generated by the MCU in an NC system. Each pulse causes the motor to rotate a fraction of one revolution, called the step angle. The possible step angles must be consistent with the relationship

$$\alpha = \frac{360}{n_s} \tag{7.3}$$

where α = step angle, °; and n_s = the number of step angles for the motor, which must be an integer. The angle through which the motor shaft rotates is given by

$$A_m = n_p \alpha \quad (7.4)$$

where A_m = angle of motor shaft rotation, °; n_p = number of pulses received by the motor; and α = step angle, °/pulse. The motor shaft is generally connected to the screw through a gearbox, which reduces the angular rotation of the screw. The angle of the screw rotation must take the gear ratio into account as

$$A_s = \frac{A_m}{r_g} = \frac{n_p \alpha}{r_g} \quad (7.5)$$

where A_s = angle of screw rotation, °; and r_g = gear ratio, defined as the number of turns of the motor for each single turn of the screw. That is,

$$r_g = \frac{A_m}{A_s} = \frac{N_m}{N_s} \quad (7.6)$$

where N_m = rotational speed of the motor, rev/min; and N_s = rotational speed of the screw, rev/min.

The linear movement of the worktable is given by the number of full and partial rotations of the screw multiplied by its pitch,

$$x = \frac{p A_s}{360} \quad (7.7)$$

where x = x -axis position relative to the starting position, mm (in); p = pitch of the screw mm/rev (in/rev); and $A_s/360$ = number of screw revolutions. The number of pulses required to achieve a specified x -position increment in a point-to-point system can be found using combinations of Equations (7.3), (7.5), and (7.7):

$$n_p = \frac{360 x r_g}{p \alpha} = \frac{n_s x r_g}{p} \quad (7.8)$$

Control pulses are transmitted from the pulse generator at a certain frequency, which drives the worktable at a corresponding velocity or feed rate in the direction of the screw axis. The rotational speed of the screw depends on the frequency of the pulse train as

$$N_s = \frac{60 f_p}{n_s r_g} \quad (7.9)$$

where N_s = screw rotational speed, rev/min; f_p = pulse train frequency, Hz; and n_s = steps per revolution or pulses per revolution. For a two-axis table with continuous path control, the relative velocities of the axes are coordinated to achieve the desired travel direction.

The table travel speed in the direction of screw axis is determined by the rotational speed as

$$v_t = f_r = N_s p \quad (7.10)$$

where v_t = table travel speed, mm/min (in/min); f_r = table feed rate, mm/min (in/min); N_s = screw rotational speed, rev/min; and p = screw pitch, mm/rev (in/rev).

The required pulse train frequency to drive the table at a specified linear travel rate can be obtained by combining Equations (7.9) and (7.10) and rearranging to solve for f_p :

$$f_p = \frac{v_t n_s r_g}{60p} = \frac{f_r n_s r_g}{60p} = \frac{N_m n_s}{60} = \frac{N_s n_s r_g}{60} \quad (7.11)$$

EXAMPLE 7.1 NC Open-Loop Positioning

The worktable of a positioning system is driven by a ball screw whose pitch = 6.0 mm. The screw is connected to the output shaft of a stepper motor through a gearbox whose ratio is 5:1 (five turns of the motor to one turn of the screw). The stepper motor has 48 step angles. The table must move a distance of 250 mm from its present position at a linear velocity = 500 mm/min. Determine (a) how many pulses are required to move the table the specified distance and (b) the required motor speed and pulse rate to achieve the desired table velocity.

Solution: (a) Rearranging Equation (7.7) to find the screw rotation angle A_s corresponding to a distance $x = 250$ mm,

$$A_s = \frac{360x}{p} = \frac{360(250)}{6.0} = 15,000^\circ$$

With 48 step angles, each step angle is

$$\alpha = \frac{360}{48} = 7.5^\circ$$

Thus, the number of pulses to move the table 250 mm is

$$n_p = \frac{360x r_g}{p\alpha} = \frac{A_s r_g}{\alpha} = \frac{15,000(5)}{7.5} = \mathbf{10,000 \text{ pulses}}$$

(b) The rotational speed of the screw corresponding to a table speed of 500 mm/min is determined from Equation (7.10):

$$N_s = \frac{v_t}{p} = \frac{500}{6} = \mathbf{83.333 \text{ rev/min}}$$

Equation (7.6) is used to find the motor speed:

$$N_m = r_g N_s = 5(83.333) = \mathbf{416.667 \text{ rev/min}}$$

The applied pulse rate to drive the table is given by Equation (7.11):

$$f_p = \frac{v_t n_s r_g}{60p} = \frac{500(48)(5)}{60(6)} = \mathbf{333.333 \text{ Hz}}$$



7.4.2 Closed-Loop Positioning Systems

A closed-loop NC system, illustrated in Figure 7.12(b), uses servomotors and feedback measurements to ensure that the worktable is moved to the desired position. A common feedback sensor used for NC (and also for industrial robots) is an optical encoder, depicted in Figure 7.13. An **optical encoder** is a device for measuring rotational speed that consists of a light source and a photodetector on either side of a disk. The disk contains slots uniformly spaced around the outside of its face. These slots allow the light source to shine through and energize the photodetector. The disk is connected to a rotating shaft whose angular position and velocity are to be measured. As the shaft rotates, the slots cause the light source to be seen by the photocell as a series of flashes. The flashes are converted into an equal number of electrical pulses. The optical encoder is connected directly to the lead-screw or ball screw, which drives the worktable. By counting the pulses and computing the frequency of the pulse train, the worktable position and velocity can be determined. There is usually a gear reduction between the servomotor and the screw driving the worktable.

The equations that define the operation of a closed-loop NC positioning system are similar to those for an open-loop system. In the basic optical encoder, the angle between slots in the disk must satisfy the following requirement:

$$\alpha = \frac{360}{n_s} \quad (7.12)$$

where α = angle between slots, °/slot; and n_s = number of slots in the disk, slots/rev. For a certain angular rotation of the encoder shaft, the number of pulses sensed by the encoder is given by

$$n_p = \frac{A_s}{\alpha} = \frac{A_s n_s}{360} \quad (7.13)$$

where n_p = pulse count emitted by the encoder; A_s = angle of rotation of the encoder shaft, °; and α = angle between slots, which converts to °/pulse. The pulse count can be used to determine the distance moved by the worktable along the x -axis (or y -axis):

$$\Delta x = \frac{p n_p}{n_s} = \frac{p A_s}{n_s \alpha} = \frac{p A_s}{360} \quad (7.14)$$

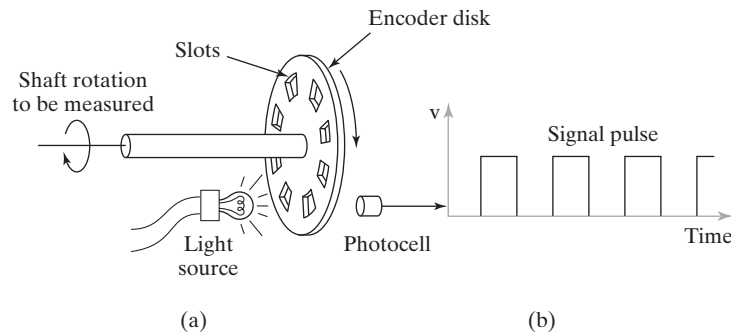


Figure 7.13 Optical encoder: (a) apparatus and (b) series of pulses emitted to measure rotation of disk.

where Δx = distance moved along the axis, mm (in); n_p and n_s are defined above; and p = screw pitch, mm/rev (in/rev).

The velocity of the worktable, which is normally the feed rate in a machining operation, is determined by the rotational speed of the screw, which in turn is driven by the servomotor:

$$v_t = f_r = N_s p = \frac{N_m P}{r_g} \quad (7.15)$$

where v_t = worktable velocity, mm/min (in/min); and f_r = feed rate, mm/min (in/min); N_s = screw rotational speed, rev/min; N_m = motor rotational speed, rev/min; r_g = gear reduction ratio.

At the worktable velocity or feed rate given by Equation (7.15), the pulse frequency emitted by the encoder is the following:

$$f_p = \frac{v_t n_s}{60p} = \frac{f_r n_s}{60p} \quad (7.16)$$

where f_p = frequency of the pulse train, Hz; and the constant 60 converts worktable velocity or feed rate from mm/sec (in/sec) to mm/min (in/min).

The pulse train generated by the encoder is compared with the coordinate position and feed rate specified in the part program, and the difference is used by the MCU to drive a servomotor, which in turn drives the worktable. A digital-to-analog converter (Section 6.3.2) is used to convert the digital signals used by the MCU into a continuous analog current that powers the drive motor. Closed-loop NC systems of the type described here are appropriate when a reactionary force resists the movement of the table. Metal cutting machine tools that perform continuous path cutting operations, such as milling and turning, fall into this category.

EXAMPLE 7.2 NC Closed-Loop Positioning

An NC worktable operates by closed-loop positioning. The system consists of a servomotor, ball screw, and optical encoder. The screw has a pitch of 6.0 mm and is coupled to the motor shaft with a gear ratio of 5:1 (five turns of the drive motor for each turn of the screw). The optical encoder generates 48 pulses/rev of its output shaft. The table has been programmed to move a distance of 250 mm at a feed rate = 500 mm/min. Determine (a) how many pulses should be received by the control system to verify that the table has moved exactly 250 mm, (b) the pulse rate of the encoder, and (c) the drive motor speed that corresponds to the specified feed rate.

Solution: (a) Rearranging Equation (7.14) to find n_p ,

$$n_p = \frac{\Delta x n_s}{p} = \frac{250(48)}{6.0} = \mathbf{2,000 \text{ pulses}}$$

(b) The pulse rate corresponding to 500 mm/min is obtained by Equation (7.16):

$$f_p = \frac{f_r n_s}{60p} = \frac{500(48)}{60(6.0)} = \mathbf{66.667 \text{ Hz}}$$

(c) Motor speed = table velocity (feed rate) divided by screw pitch, corrected for gear ratio:

$$N_m = \frac{r_g f_r}{p} = \frac{5(500)}{6.0} = \mathbf{416.667 \text{ rev/min}}$$

Comment: Note that motor speed has the same numerical value as in Example 7.1 because the table velocity and motor gear ratio are the same.

7.4.3 Precision in Positioning Systems

To accurately machine or otherwise process a work part, an NC positioning system must possess a high degree of precision. Three measures of precision can be defined for an NC positioning system: (1) control resolution, (2) accuracy, and (3) repeatability. These terms are most readily explained by considering a single axis of the positioning system, as depicted in Figure 7.14. Control resolution refers to the control system's ability to divide the total range of the axis movement into closely spaced points that can be distinguished by the MCU. **Control resolution** is defined as the distance separating two adjacent addressable points in the axis movement. **Addressable points** are locations along the axis to which the worktable can be specifically directed to go. It is desirable for control resolution to be as small as possible. This depends on limitations imposed by (1) the electromechanical components of the positioning system and/or (2) the number of bits used by the controller to define the axis coordinate location.

A number of electromechanical factors affect control resolution, including screw pitch, gear ratio in the drive system, and the step angle in a stepper motor for an open-loop system or the angle between slots in an encoder disk for a closed-loop system. For an open-loop positioning system driven by a stepper motor, these factors can be combined into an expression that defines control resolution as

$$CR_1 = \frac{P}{n_s r_g} \quad (7.17)$$

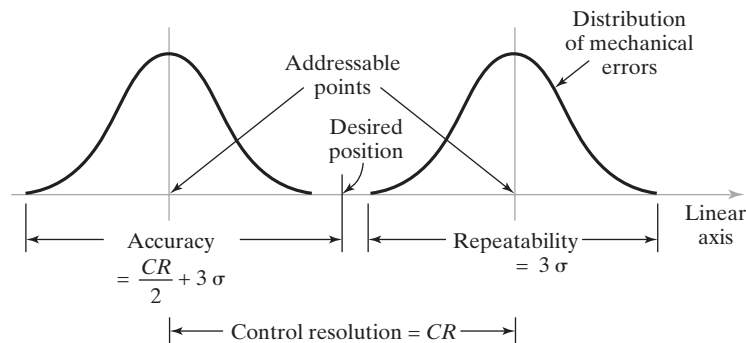


Figure 7.14 A portion of a linear positioning system axis, with definition of control resolution, accuracy, and repeatability.

where CR_1 = control resolution of the electromechanical components, mm (in); p = leadscrew pitch, mm/rev (in/rev); n_s = number of steps per revolution; and r_g = gear ratio between the motor shaft and the screw as defined in Equation (7.6). The same expression can be used for a closed-loop positioning system.

The second factor that limits control resolution is the number of bits used by the MCU to specify the axis coordinate value. For example, this limitation may be imposed by the bit storage capacity of the controller. If B = the number of bits in the storage register for the axis, then the number of control points into which the axis range can be divided = 2^B . Assuming that the control points are separated equally within the range, then

$$CR_2 = \frac{L}{2^B - 1} \quad (7.18)$$

where CR_2 = control resolution of the computer control system, mm (in); and L = axis range, mm (in). The control resolution of the positioning system is the maximum of the two values; that is,

$$CR = \text{Max} \{ CR_1, CR_2 \} \quad (7.19)$$

A desirable criterion is $CR_2 \leq CR_1$, meaning that the electromechanical system is the limiting factor that determines control resolution. The bit storage capacity of a modern computer controller is sufficient to satisfy this criterion except in unusual situations. Resolutions of 0.0025 mm (0.0001 in) are within the current state of CNC technology.

The ability of a positioning system to move the worktable to the exact location defined by a given addressable point is limited by mechanical errors that are due to various imperfections in the mechanical system. These imperfections include play between the screw and the worktable, backlash in the gears, and deflection of machine components. The mechanical errors are assumed to form an unbiased normal statistical distribution about the control point whose mean $\mu = 0$. It is further assumed that the standard deviation σ of the distribution is constant over the range of the axis under consideration. Given these assumptions, nearly all of the mechanical errors (99.73%) are contained within $\pm 3\sigma$ of the control point. This is pictured in Figure 7.14 for a portion of the axis range that includes two control points.

These definitions of control resolution and mechanical error distribution can now be used to define accuracy and repeatability of a positioning system. Accuracy is defined under worst case conditions in which the desired target point lies in the middle between two adjacent addressable points. Since the table can only be moved to one or the other of the addressable points, there will be an error in the final position of the worktable. This is the maximum possible positioning error, because if the target were closer to either one of the addressable points, then the table would be moved to the closer point and the error would be smaller. It is appropriate to define accuracy under this worst-case scenario. The **accuracy** of any given axis of a positioning system is the maximum possible error that can occur between the desired target point and the actual position taken by the system. In equation form,

$$Ac = \frac{CR}{2} + 3\sigma \quad (7.20)$$

where Ac = accuracy, mm (in); CR = control resolution, mm (in); and σ = standard deviation of the error distribution. Accuracies in machine tools are generally expressed for a certain range of table travel, for example, ± 0.01 mm for 250 mm (± 0.0004 in. for 10 in) of table travel.

Repeatability refers to the ability of the positioning system to return to a given addressable point that has been previously programmed. This capability can be measured in terms of the location errors encountered when the system attempts to position itself at the addressable point. Location errors are a manifestation of the mechanical errors of the positioning system, which follow a normal distribution, as assumed previously. Thus, the **repeatability** of any given axis of a positioning system is ± 3 standard deviations of the mechanical error distribution associated with the axis. This can be written as

$$Re = \pm 3\sigma \quad (7.21)$$

where Re = repeatability, mm (in).

EXAMPLE 7.3 Control Resolution, Accuracy, and Repeatability in NC

Suppose the mechanical inaccuracies in the open-loop positioning system of Example 7.1 are described by a normal distribution with standard deviation = 0.005 mm. The range of the worktable axis is 1,000 mm, and there are 16 bits in the binary register used by the digital controller to store the programmed position. Other relevant parameters from Example 7.1 are the following: pitch = 6.0 mm, gear ratio between motor shaft and screw = 5.0, and number of step angles in the stepper motor = 48. Determine the (a) control resolution, (b) accuracy, and (c) repeatability of the positioning system.

Solution: (a) Control resolution is the greater of CR_1 and CR_2 as defined by Equations (7.17) and (7.18).

$$CR_1 = \frac{p}{n_s r_g} = \frac{6.0}{48(5.0)} = 0.025 \text{ mm}$$

$$CR_2 = \frac{1,000}{2^{16} - 1} = \frac{1,000}{65,535} = 0.01526 \text{ mm}$$

$$CR = \text{Max}\{0.025, 0.01526\} = \mathbf{0.025 \text{ mm}}$$

(b) Accuracy is given by Equation (7.20):

$$Ac = 0.5(0.025) + 3(0.005) = \mathbf{0.0275 \text{ mm}}$$

(c) Repeatability $Re = \pm 3(0.005) = \pm \mathbf{0.015 \text{ mm}}$

7.5 NC PART PROGRAMMING

NC part programming consists of planning and documenting the sequence of processing steps to be performed by an NC machine. The part programmer must have a knowledge of machining (or other processing technology for which the NC machine is designed), as well as geometry and trigonometry. The documentation portion of part programming involves the input medium used to transmit the program of instructions to the NC machine control unit. The traditional input medium dating back to the first NC machines in the 1950s is 1-in wide punched tape. More recently, magnetic tape, floppy disks, and portable solid-state memory

devices have been used for NC due to their much higher data density. Distributed numerical control is also commonly used to transmit part programs from a central storage unit.

Part programming can be accomplished using a variety of procedures ranging from highly manual to highly automated methods. The methods are (1) manual part programming, (2) computer-assisted part programming, (3) CAD/CAM part programming, and (4) manual data input.

7.5.1 Manual Part Programming

In manual part programming, the programmer prepares the NC code using a low-level machine language that is described briefly in this section and more thoroughly in Appendix 7A. The coding system is based on binary numbers. This coding is the low-level machine language that can be understood by the MCU. When higher level languages are used, such as APT (Section 7.5.2) and CAD/CAM (Section 7.5.3), the statements in these respective programs are converted to this basic code. NC uses a combination of the binary and decimal number systems, called the *binary-coded decimal* (BCD) system. In this coding scheme, each of the ten digits (0–9) in the decimal system is coded as a four-digit binary number, and these binary numbers are added in sequence as in the decimal number system. Conversion of the ten digits in the decimal number system into binary numbers is shown in Table 7.4. Example 7.4 illustrates the conversion process.

In addition to numerical values, the NC coding system must also provide for alphabetical characters and other symbols. Eight binary digits are used to represent all of the characters required for NC part programming. Out of a sequence of characters, a word

EXAMPLE 7.4 Binary Coded Decimal

Convert the decimal value 1,258 to binary coded decimal.

Solution: The conversion of the four digits is shown in the following table:

Number Sequence	Binary Number	Decimal Value
First	0001	1,000
Second	0010	200
Third	0101	50
Fourth	0000	8
Sum		1,258

TABLE 7.4 Comparison of Binary and Decimal Numbers

Binary	Decimal	Binary	Decimal
0000	0	0101	5
0001	1	0110	6
0010	2	0111	7
0011	3	1000	8
0100	4	1001	9

is formed. A **word** specifies a detail about the operation, such as x -position, y -position, feed rate, or spindle speed. Out of a collection of words, a block is formed. A **block** is one complete NC instruction. It specifies the destination for the move, the speed and feed of the cutting operation, and other commands that determine explicitly what the machine tool will do. For example, an instruction block for a two-axis NC milling machine would likely include the x - and y -coordinates to which the machine table should be moved, the type of motion to be performed (linear or circular interpolation), the rotational speed of the milling cutter, and the feed rate at which the milling operation should be performed.

The organization of words within a block is known as a *block format*. Although a number of different block formats have been developed over the years, all modern controllers use the word address format, which uses a letter prefix to identify each type of word, and spaces to separate words within the block. This format also allows for variations in the order of words within the block, and omission of words from the block if their values do not change from the previous block. For example, the two commands in word address format to perform the two drilling operations illustrated in Figure 7.15 are

```
N001 G00 X07000 Y03000 M03
N002 Y06000
```

where N is the sequence number prefix, and X and Y are the prefixes for the x - and y -axes, respectively. G-words and M-words require some elaboration. G-words are called preparatory words. They consist of two numerical digits (following the “G” prefix) that prepare the MCU for the instructions and data contained in the block. For example, G00 prepares the controller for a point-to-point rapid traverse move between the present location and the endpoint defined in the current command. M-words are used to specify miscellaneous or auxiliary functions that are available on the machine tool. The M03 in the example is used to start the spindle rotation. Other examples include stopping the spindle for a tool change, and turning the cutting fluid on or off. Of course, the particular machine tool must possess the function that is being called.

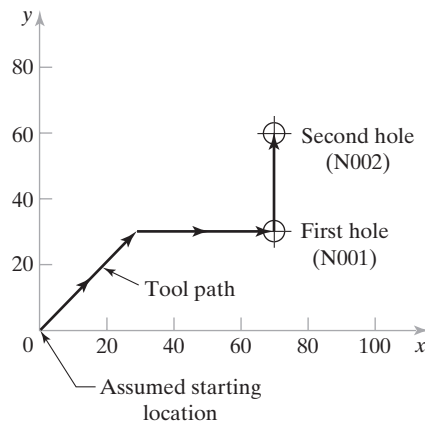


Figure 7.15 Drilling sequence for word address format example. Dimensions are in millimeters.

Words in an instruction block are intended to convey all of the commands and data needed for the machine tool to execute the move defined in the block. The words required for one machine tool type may differ from those required for a different type; for example, turning requires a different set of commands than milling. The words in a block are usually given in the following order (although the word address format allows variations in the order):

- sequence number (N-word)
- preparatory word (G-word)
- coordinates (X-, Y-, Z-words for linear axes, A-, B-, C-words for rotational axes)
- feed rate (F-word)
- spindle speed (S-word)
- tool selection (T-word)
- miscellaneous command (M-word)

For the interested reader, Appendix 7A has been prepared. This describes the details of the coding system used in manual part program. Examples of programming commands are provided and the various G-words and M-words are defined.

Manual part programming can be used for both point-to-point and contouring jobs. It is most suited for point-to-point machining operations such as drilling. It can also be used for simple contouring jobs, such as milling and turning when only two axes are involved. However, for complex three-dimensional machining operations, there is an advantage in using a more powerful part programming technique such as CAD/CAM.

7.5.2 Computer-Assisted Part Programming

Manual part programming can be time consuming, tedious, and subject to errors for parts possessing complex geometries or requiring many machining operations. A number of NC part programming language systems have been developed to accomplish many of the calculations that the programmer would otherwise have to do. The program is written in English-like statements that are subsequently converted to the low-level machine language described in Section 7.5.1 and Appendix 7A. Using this programming arrangement, the various tasks are divided between the human part programmer and the computer.

The Part Programmer's Job. In computer-assisted part programming, the machining instructions are written in English-like statements that are subsequently translated by the computer into the low-level machine code that can be interpreted and executed by the machine tool controller. The two main tasks of the programmer are (1) defining the geometry of the part and (2) specifying the tool path and operation sequence.

No matter how complicated the work part may appear, it is composed of basic geometric elements and mathematically defined surfaces. Consider the sample part in Figure 7.16. Although its appearance is somewhat irregular, the outline of the part consists of intersecting straight lines and a partial circle. The hole locations in the part can be defined in terms of the x - and y -coordinates of their centers. Nearly any component that can be conceived by a designer can be described by points, straight lines, planes, circles, cylinders, and other mathematically defined surfaces. It is the part programmer's task in computer-assisted part programming to identify and enumerate the geometric elements

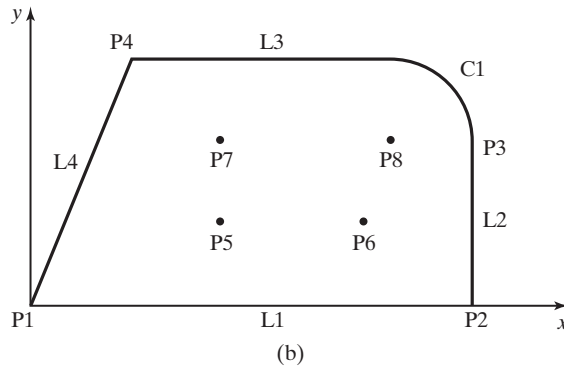
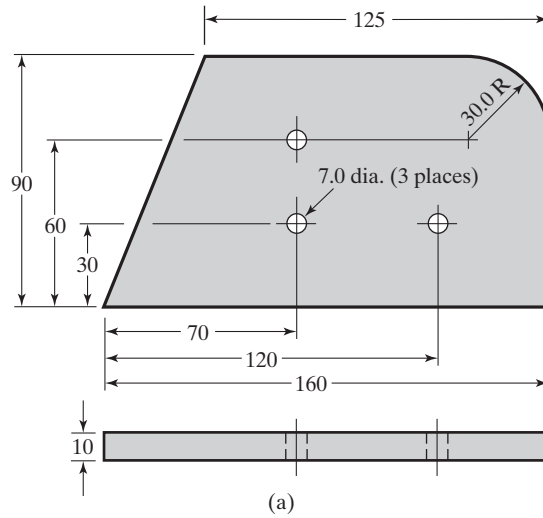


Figure 7.16 Sample part with geometry elements (points, lines, and circle) labeled for computer-assisted part programming.

of which the part is constructed. Each element must be defined in terms of its dimensions and location relative to other elements. A few examples will be instructive here to show how geometric elements are defined. The sample part will be used to illustrate, with labels of geometry elements added in Figure 7.16(b). The statements are taken from APT, which stands for *automatically programmed tooling*.¹

The simplest geometric element is a point, and the simplest way to define a point is by means of its coordinates; for example,

$$P4 = \text{POINT}/35, 90, 0$$

¹Readers familiar with previous editions of this book will note that the appendix on APT is no longer included in the current edition. The author's impression is that APT is not widely used, especially in the United States, because it has largely been replaced by CAD/CAM part programming (Section 7.5.3). In addition to CAD/CAM part programming, manual part programming (G-codes and M-codes, Section 7.5.1 and Appendix 7A) and manual data input (Section 7.5.4) are also common in machine shops.

where the point is identified by a symbol (P4), and its coordinates are given in the order x, y, z in millimeters ($x = 35$ mm, $y = 90$ mm, and $z = 0$). A line can be defined by two points, as in the following:

$$L1 = \text{LINE}/P1, P2$$

where L1 is the line defined in the statement, and P1 and P2 are two previously defined points. And finally, a circle can be defined by its center location and radius,

$$C1 = \text{CIRCLE}/\text{CENTER}, P8, \text{RADIUS}, 30$$

where C1 is the newly defined circle, with center at previously defined point P8 and radius = 30 mm. The APT language offers many alternative ways to define points, lines, circles, and other geometric elements.

After the part geometry has been defined, the part programmer must next specify the tool path that the cutter will follow to machine the part. The tool path consists of a sequence of connected line and arc segments, using the previously defined geometry elements to guide the cutter. Consider how the outline of the sample part in Figure 7.16 would be machined in a profile milling operation (contouring). A cut has just been finished along surface L1 in a counterclockwise direction around the part, and the tool is presently located at the intersection of surfaces L1 and L2. The following APT statement could be used to command the tool to make a left turn from L1 onto L2 and to cut along L2:

$$\text{GOLFT}/L2, \text{TANTO}, C1$$

The tool proceeds along surface L2 until it is tangent to (TANTO) circle C1. This is a continuous path motion command. Point-to-point commands tend to be simpler; for example, the following statement directs the tool to go to a previously defined point P5:

$$\text{GOTO}/P5$$

In addition to defining part geometry and specifying tool path, the programmer must enter other programming functions, such as naming the program, identifying the machine tool on which the job will be performed, specifying cutting speeds and feed rates, designating the cutter size (cutter radius, tool length, etc.), and specifying tolerances in circular interpolation.

Computer Tasks in Computer-Assisted Part Programming. The computer's role in computer-assisted part programming consists of the following steps, performed more or less in the sequence given: (1) input translation, (2) arithmetic and cutter offset computations, (3) editing, and (4) post-processing. The first three steps are carried out under the supervision of the language processing program. For example, the APT language uses a processor designed to interpret and process the words, symbols, and numbers written in APT. Other high-level languages require their own processors, but they work similarly to APT. The fourth step, post-processing, requires a separate computer program. The sequence and relationship of the steps of the part programmer and the computer are portrayed in Figure 7.17.

The part programmer enters the program using APT or some other high-level part programming language. The input translation module converts the coded instructions contained in the program into computer-usable form, preparatory to further processing. In APT, input translation accomplishes the following tasks: (1) syntax check of the input code to identify errors in format, punctuation, spelling, and statement sequence; (2) assigning

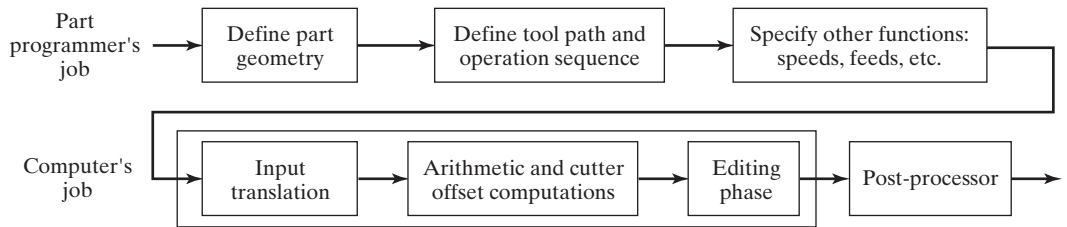


Figure 7.17 Steps in computer-assisted part programming.

a sequence number to each APT statement in the program; (3) converting geometry elements into a suitable form for computer processing; and (4) generating an intermediate file called PROFIL that is utilized in subsequent arithmetic calculations.

The arithmetic module consists of a set of subroutines to perform the mathematical computations required to define the part surface and generate the tool path, including compensation for cutter offset. The individual subroutines are called by the various statements used in the part programming language. The arithmetic computations are performed on the PROFIL file. The arithmetic module frees the programmer from the time-consuming and error-prone geometry and trigonometry calculations to concentrate on issues related to work part processing. The output of this module is a file called CLFILE, which stands for “cutter location file.” As its name suggests, this file consists mainly of tool path data.

During the editing stage, the computer edits the CLFILE and generates a new file called CLDATA. When printed, CLDATA provides readable data on cutter locations and machine tool operating commands. The machine tool commands can be converted to specific instructions during post-processing. The output of the editing phase is a part program in a format that can be post-processed for the given machine tool on which the job will be accomplished.

NC machine tool systems are different. They have different features and capabilities. High-level part programming languages, such as APT, are generally not intended for only one machine tool type. They are designed to be general purpose. Accordingly, the final task of the computer in computer-assisted part programming is **post-processing**, in which the cutter location data and machining commands in the CLDATA file are converted into low-level code that can be interpreted by the NC controller for a specific machine tool. The output of post-processing is a part program consisting of G-codes, x -, y -, and z -coordinates, S, F, M, and other functions in word address format. The post-processor is separate from the high-level part programming language. A unique post-processor must be written for each machine tool system.

7.5.3 CAD/CAM² Part Programming

A CAD/CAM system is a computer interactive graphics system equipped with software to accomplish certain tasks in design and manufacturing and to integrate the design and manufacturing functions. CAD/CAM is discussed in Chapter 23. One of the important tasks performed on a CAD/CAM system is NC part programming. In this method of part programming, portions of the procedure usually done by the part programmer are

²CAD/CAM stands for computer-aided design/computer-aided manufacturing.

 


Figure 7.18 Steps in CAD/CAM part programming.

instead done by the computer. Advantages of NC part programming using CAD/CAM include the following [11]: (1) the part program can be simulated off-line on the CAD/CAM system to verify its accuracy; (2) the time and cost of the machining operation can be determined by the CAD/CAM system; (3) the most appropriate tooling can be automatically selected for the operation; and (4) the CAD/CAM system can automatically insert the optimum values for speeds and feeds for the work material and operations.

Other advantages are described below. Recall that the two main tasks of the part programmer in computer-assisted part programming are defining the part geometry and specifying the tool path. CAD/CAM systems automate portions of both of these tasks. The procedure in CAD/CAM part programming can be summarized in three steps, illustrated in Figure 7.18: (1) CAD: create geometric model of part; (2) CAM: define tool paths, select cutting tools, and simulate tool paths; and (3) post-processing to generate a part program in word address format.

CAD/CAM Part Geometry Definition. A fundamental objective of CAD/CAM is to integrate the design engineering and manufacturing engineering functions. Certainly one of the important design functions is to design the individual components of the product. If a CAD/CAM system is used, a computer graphics model of each part is developed by the designer and stored in the CAD/CAM database. That model contains all the geometric, dimensional, and material specifications for the part.

When the same CAD/CAM system is used to perform NC part programming, the programmer can retrieve the part geometry model from the CAD database and use that model to construct the appropriate cutter path. The significant advantage of using CAD/CAM in this way is that it eliminates one of the time-consuming steps in computer-assisted part programming: geometry definition. After the part geometry has been retrieved, the usual procedure is to label the geometric elements that will be used during part programming. These labels are the variable names (symbols) given to the lines, circles, and surfaces that comprise the part. CAM systems automatically label the geometry elements of the part and display the labels on the monitor. The programmer can then refer to those labeled elements during tool path construction.

An NC programmer who does not have access to the database must define the geometry of the part, using similar interactive graphics techniques that the product designer would use to design the part. Points are defined in a coordinate system using the computer graphics system, lines and circles are defined from the points, surfaces are defined, and so forth, to construct a geometric model of the part. The advantage of the interactive graphics system over conventional computer-assisted part programming is that the programmer receives immediate visual verification of the geometric elements being created. This tends to improve the speed and accuracy of the geometry definition process.

CAD/CAM Tool Path Generation and Simulation. The second task of the NC programmer in CAD/CAM part programming is tool path specification for the various operations to be performed. For each operation, the programmer selects a cutting tool

from a tool library listing the tools available in the tool crib. The programmer must decide which of the available tools is most appropriate for the operation under consideration and then specify it for the tool path. This permits the tool diameter and other dimensions to be entered automatically for tool offset calculations. If the desired cutting tool is not available in the library, the programmer can specify an appropriate tool. It then becomes part of the library for future use.

The next step is tool path definition. There are differences among CAM systems that result in different approaches for generating the tool path. The most basic approach involves the use of the interactive graphics system to enter the motion commands one by one, similar to computer-assisted part programming. Individual statements in APT or other part programming language are entered, and the CAD/CAM system provides an immediate graphic display of the action resulting from the command, thereby validating the statement.

A more advanced approach for generating tool path commands is to use one of the automatic software modules available on the CAD/CAM system. This can most readily be done for certain NC processes that involve well-defined, relatively simple part geometries. Examples are point-to-point operations such as NC drilling and electronic component assembly machines. In these processes, the program consists basically of a series of locations in an x - y coordinate system where work is to be performed (e.g., holes are to be drilled or components are to be inserted). These locations are defined by data generated during product design. Special algorithms are used to process the design data and generate the NC statements.

Additional modules have been developed to accomplish a number of common machining cycles for milling and turning. They are subroutines in the NC programming package that can be called and the required parameters entered to execute the machining cycle. Several of these modules are identified in Table 7.5 and Figure 7.19. NC contouring systems are capable of a similar level of automation.

When the complete part program has been developed, the CAD/CAM system can provide an animated simulation of the program for validation purposes. Any corrections to the tool path are made at this time.

TABLE 7.5 Some Common NC Modules for Automatic Programming of Machining Cycles

Module Type	Brief Description
Profile milling	Generates cutter path around the periphery of a part, usually a two-dimensional contour where depth remains constant.
Pocket milling	Generates the tool path to machine a cavity, as in Figure 7.19(a). A series of cuts is usually required to complete the bottom of the cavity to the desired depth.
Engraving	Generates tool path to engrave (mill) alphanumeric characters and other symbols to specified font and size.
Contour turning	Generates tool path for a series of turning cuts to provide a defined contour on a rotational part, as in Figure 7.19(b).
Facing	Generates tool path for a series of facing cuts to remove excess stock from the end of a rotational part or to create a shoulder on the part by a series of facing operations, as in Figure 7.19(c).
Threading	Generates tool path for a series of threading cuts to cut external, internal, or tapered threads on a rotational part, as in Figure 7.19(d) for external threads.

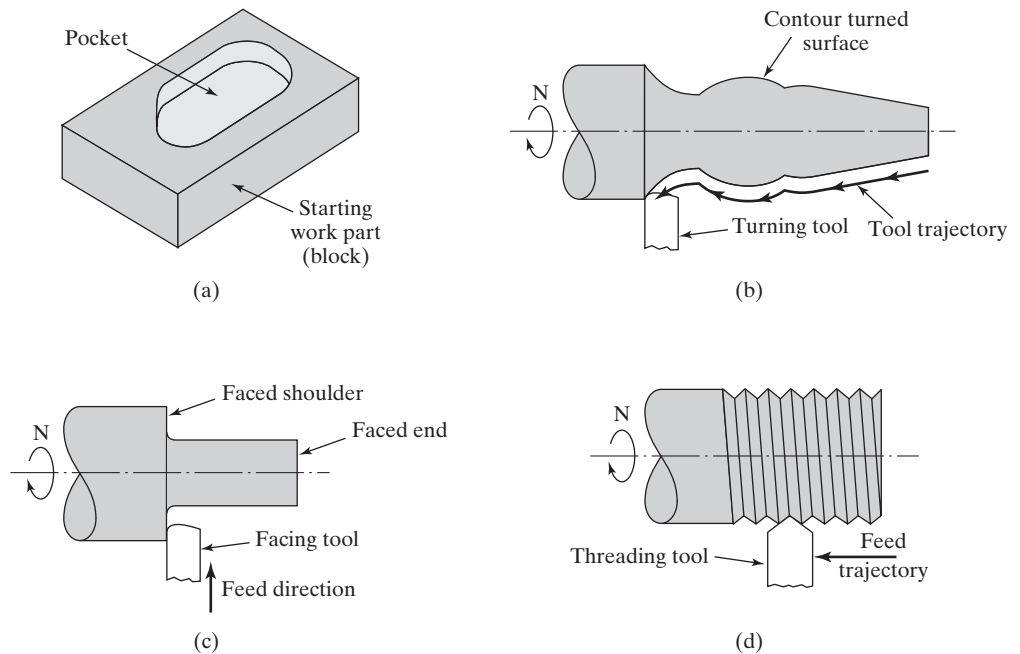


Figure 7.19 Examples of machining cycles available in automatic programming modules. (a) pocket milling, (b) contour turning, (c) facing and shoulder facing, and (d) threading (external).

Finally, the part program that has been developed and verified using CAD/CAM is post-processed to create the machine-language part program in word address format for the particular machine tool that will be used for the job.

Mastercam. Mastercam is the leading commercial CAD/CAM software package for CNC part programming. It is available from CNC Software, Inc. [16]. The package includes a CAD capability for designing parts in addition to its CAM features for part programming. If an alternative computer-aided design package is used for design, files from these other packages can be translated for use within Mastercam. Processes to which Mastercam can be applied include milling and drilling, turning, plasma cutting, and laser cutting. The typical steps that a programmer uses in Mastercam to accomplish a part-programming job are listed in Table 7.6. The output of the Mastercam program is a part program in word address format.

STEP-NC. In CAD/CAM part programming, several aspects of the procedure are automated, as indicated above. Given the geometric model of a part that has been defined during product design on a CAD system, a future CAM system would possess sufficient logic and decision-making capability to accomplish NC part programming for the entire part without human assistance. Research and development is proceeding on a new machine tool control language that would eliminate the need for machine-level part programming using G-codes and M-codes. In effect, it would result in the automatic generation of NC part programs without the participation of human part programmers.

TABLE 7.6 Typical Sequence of Steps in CNC Part Programming Using Mastercam for a Sequence of Milling and Drilling Operations

Step	Description
1	Develop a CAD model of the part to be machined using Mastercam, or import the CAD model from a compatible CAD package.
2	Orient the starting workpiece relative to the axis system of the machine.
3	Identify the workpiece material and specified grade (e.g., Aluminum 2024, for selection of cutting conditions).
4	Select the operation to be performed (e.g., drilling, pocket milling, contouring) and the surface to be machined.
5	Select the cutting tool (e.g., 0.250-in drill) from the tool library.
6	Enter applicable cutting parameters such as hole depth.
7	Repeat steps 4 through 6 for each additional machining operation to be performed on the part.
8	Select appropriate post-processor to generate the part program in word address format for the machine tool on which the machining job will be accomplished.
9	Verify the part program by animated simulation of the sequence of machining operations to be performed on the part.

Called STEP-NC, the research is part of a larger international project to develop standards to define and exchange product data in a format that can be interpreted by the computer. The larger project is called STEP, which is an acronym for *Standard for the Exchange of Product Model Data*. The international standard is ISO 10303 [18], and the application protocol that deals with NC part programming is ISO 10303-238 (also known as AP 238), which is titled *Application Interpreted Model for Computer Numeric Controllers*.

The limitation of part programs based on G-codes and M-codes is that they consist of instructions that only direct the actions of the cutting tool, without any related information content about the part being machined. STEP-NC would replace G-codes and M-codes with a more advanced language that directly associates the CNC processing instructions to the geometric model contained in the CAD database. The CNC machine control unit would receive a STEP-NC file and be capable of converting that file into tooling and machining commands to the machine tool without any additional part programming.

7.5.4 Manual Data Input

Manual and computer-assisted part programming require a high degree of formal documentation. There is lead time required to write and validate the programs. CAD/CAM part programming automates a substantial portion of the procedure, but a significant commitment in equipment, software, and training is required. One method of simplifying the procedure is to have the machine operator perform the part-programming task at the machine tool. This is called *manual data input* (MDI) because the operator manually enters the part geometry data and motion commands directly into the MCU prior to running the job. Also known as *conversational programming* [5], [10], MDI was conceived as a way for the small machine shop to introduce NC into its operations without needing to acquire special NC part-programming equipment and hiring a part programmer. MDI

permits the shop to make a minimal initial investment to begin the transition to modern CNC technology. The limitation of manual data input is the risk of programming errors as jobs become more complicated. For this reason, MDI is usually applied for relatively simple parts.

Communication between the machine operator-programmer and the MDI system is accomplished using a graphical user interface (GUI), consisting of a display monitor and alphanumeric keyboard. Entering the programming commands into the controller is typically done using a menu-driven procedure in which the operator responds to prompts and questions posed by the NC system about the job to be machined. The sequence of questions is designed so that the operator inputs the part geometry and machining commands in a logical and consistent manner. A computer graphics capability is included in modern MDI programming systems to permit the operator to visualize the machining operations and verify the program. Typical verification features include tool path display and animation of the tool path sequence.

A minimum of training in NC part programming is required of the machine operator. The operator must have the ability to read an engineering drawing of the part and must be familiar with the machining process. An important caveat in the use of MDI is to make certain that the NC system does not become an expensive toy that stands idle while the operator is entering the programming instructions. Efficient use of the system requires that programming for the next part be accomplished while the current part is being machined. Most MDI systems permit these two functions to be performed simultaneously to reduce changeover time between jobs.

REFERENCES

- [1] CHANG, C. H., and M. MELKANOFF, *NC Machine Programming and Software Design*, Prentice Hall, Englewood Cliffs, NJ, 1989.
- [2] GROOVER, M. P., and E. W. ZIMMERS, Jr., *CAD/CAM: Computer-Aided Design and Manufacturing*, Prentice Hall, Englewood Cliffs, NJ, 1984.
- [3] Illinois Institute of Technology Research Institute, *APT Part Programming*, McGraw-Hill Book Company, New York, 1967.
- [4] LIN, S. C., *Computer Numerical Control: Essentials of Programming and Networking*, Delmar Publishers Inc., Albany, NY, 1994.
- [5] LYNCH, M., *Computer Numerical Control for Machining*, McGraw-Hill, New York, 1992.
- [6] MATTSON, M., *CNC Programming: Principles and Applications*, Delmar, Thomson Learning, Albany, NY, 2002.
- [7] NOBLE, D. F., *Forces of Production*, Alfred A. Knopf, New York, 1984.
- [8] QUESADA, R., *Computer Numerical Control, Machining and Turning Centers*, Pearson/Prentice Hall, Upper Saddle River, NJ, 2005.
- [9] REINTJES, J. F., *Numerical Control: Making a New Technology*, Oxford University Press, New York, 1991.
- [10] STENERSON, J., and K. CURRAN, *Computer Numerical Control: Operation and Programming*, 3rd ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2007.
- [11] VALENTINO, J. V., and J. GOLDENBERG, *Introduction to Computer Numerical Control*, 5th ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2012.
- [12] WAURZYNIAK, P., "Machine Controllers: Smarter and Faster," *Manufacturing Engineering*, June 2005, pp. 61–73.

- [13] WAURZYNIAK, P., “Software Controls Productivity,” *Manufacturing Engineering*, August 2005, pp. 67–73.
- [14] WAURZYNIAK, P., “Under Control,” *Manufacturing Engineering*, June 2006, pp. 51–58.
- [15] WAURZYNIAK, P., “Machine Controls, CAD/CAM Optimize Machining Tasks,” *Manufacturing Engineering*, August 2012, pp. 133–147.
- [16] www.mastercam.com (Website of CNC Software, Inc.)
- [17] www.wikipedia.org/wiki/CNC_Software/Mastercam
- [18] www.wikipedia.org/wiki/ISO_10303
- [19] www.wikipedia.org/wiki/Numerical_control
- [20] www.wikipedia.org/wiki/STEP-NC
- [21] www.wikipedia.org/wiki/steptools.com

REVIEW QUESTIONS

- 7.1 What is numerical control?
- 7.2 What are the three basic components of an NC system?
- 7.3 What is the right-hand rule in NC and where is it used?
- 7.4 What is the difference between point-to-point and continuous path control in a motion control system?
- 7.5 What is linear interpolation, and why is it important in NC?
- 7.6 What is the difference between absolute positioning and incremental positioning?
- 7.7 How is computer numerical control (CNC) distinguished from conventional NC?
- 7.8 Name five of the features of a computer numerical control that distinguish it from conventional NC.
- 7.9 What is distributed numerical control (DNC)?
- 7.10 What are some of the machine tool types to which numerical control has been applied?
- 7.11 What is a machining center?
- 7.12 Name six part characteristics that are most suited to the application of numerical control.
- 7.13 Although CNC technology is most closely associated with machine tool applications, it has been applied to other processes also. Name three examples.
- 7.14 What are four advantages of numerical control when properly applied in machine tool operations?
- 7.15 What are three disadvantages of implementing NC technology?
- 7.16 Briefly describe the differences between the two basic types of positioning control systems used in NC?
- 7.17 What is an optical encoder, and how does it work?
- 7.18 With reference to precision in a positioning system, what is control resolution?
- 7.19 What is the difference between manual part programming and computer-assisted part programming?
- 7.20 What is post-processing in computer-assisted part programming and CAD/CAM part programming?
- 7.21 What are some of the advantages of CAD/CAM-based NC part programming compared to computer-assisted part programming?
- 7.22 What is manual data input of the NC part program?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

CNC Machining Applications

- 7.1 (A)** A machinable grade of aluminum is to be milled on a CNC milling machine with a 25-mm diameter four-tooth end mill. Cutting speed is 100 m/min and feed is 0.075 mm/tooth. To program the machine tool, convert these values to (a) rev/min and (b) mm/min, respectively.
- 7.2** A cast-iron workpiece is to be face milled on a CNC machine using cemented carbide inserts. The cutter has 12 teeth and its diameter is 100 mm. Cutting speed is 180 m/min and feed is 0.08 mm/tooth. To program the machine tool, convert these values to (a) rev/min and (b) mm/min, respectively.
- 7.3** An end milling operation is performed on a CNC machining center. The total length of travel is 800 mm along a straight path. Cutting speed is 1.5 m/sec and chip load is 0.09 mm. The end mill has two teeth and its diameter = 12.5 mm. Determine (a) feed rate in rev/min and (b) time to complete the cut.
- 7.4** A turning operation is to be performed on a CNC lathe. Cutting speed = 2.2 m/sec, feed = 0.25 mm/rev, and depth of cut = 3.0 mm. Workpiece diameter = 90 mm and length = 550 mm. Determine (a) rotational speed of the workpiece, (b) feed rate, and (c) time to travel from one end of the part to the other.
- 7.5** A CNC drill press drills four 10.0 mm diameter holes at four locations on a flat aluminum plate in a production work cycle. Although the plate is only 12 mm thick, the drill must travel a full 20 mm vertically at each hole location to allow for clearance above the plate and breakthrough of the drill on the underside of the plate. Time to retract the drill from each hole is one-half the feeding time. Cutting speed = 0.5 m/sec and feed = 0.10 mm/rev. Coordinates of the hole locations are: hole 1 at $x = 25$ mm, $y = 25$ mm; hole 2 at $x = 25$ mm, $y = 150$ mm; hole 3 at $x = 150$ mm, $y = 150$ mm; and hole 4 at $x = 150$, $y = 25$ mm. The drill starts out at point (0, 0) and returns to the same position after the work cycle is completed. Travel rate of the table in moving from one coordinate position to another is 600 mm/min. Owing to acceleration and deceleration, and time required for the control system to achieve final positioning, a time loss of 3 sec is experienced at each stop of the table. All moves are made so as to minimize total cycle time. If loading and unloading the plate take 20 sec (total handling time), determine the time required for the work cycle.

Analysis of Open-Loop Positioning Systems

- 7.6 (A)** One axis of the worktable in a CNC positioning system is driven by a ball screw with a 7.5-mm pitch. The screw is powered by a stepper motor which has 200 step angles using a 3:1 gear reduction (three turns of the motor for each turn of the ball screw). The worktable is programmed to move a distance of 400 mm from its present position at a travel speed of 1,200 mm/min. (a) How many pulses are required to move the table the specified distance? (b) What is the required motor rotational speed and (c) pulse rate to achieve the desired table speed?
- 7.7** One axis of an open-loop positioning system is driven by a stepper motor, which is connected to a ball screw with a gear reduction of 2:1 (two turns of the motor for each turn of the screw). The ball screw drives the positioning table. Step angle of the motor is 3.6° , and pitch of the ball screw is 6.0 mm. The table is required to move along this axis a distance of 600 mm from its current position in exactly 25 sec. Determine (a) the number of pulses required to move the specified distance, (b) pulse frequency, and (c) rotational speed of the motor to make the move.

- 7.8** A stepper motor with 50 step angles is coupled to a leadscrew through a gear reduction of 5:1 (five rotations of the motor for each rotation of the leadscrew). The leadscrew has 1.25 threads/cm. The worktable driven by the leadscrew must move a distance = 40.0 cm at a feed rate = 90 cm/min. Determine (a) the number of pulses required to move the table, (b) required motor speed, and (c) pulse rate to achieve the desired table speed.
- 7.9** A component placement machine takes 0.5 sec to position a component onto a printed circuit (PC) board, once the board has been positioned under the placement head. The x - y table that positions the PC board uses a stepper motor directly linked to a ball screw for each axis (no gear reduction). Screw pitch = 5.0 mm. The motor step angle = 7.2° , and the pulse frequency = 400 Hz. Two components are placed on the PC board, one each at positions (25, 25) and (50, 150), where coordinates are mm. The sequence of positions is (0, 0), (25, 25), (50, 150), (0, 0). Time required to unload the completed board and load the next blank onto the machine table = 3.0 sec. Assume that 0.25 sec is lost due to acceleration and deceleration on each move. What is the hourly production rate for this PC board?
- 7.10** Two stepper motors are used in an open-loop system to drive the leadscrews for x - y positioning. The range of each axis is 550 mm. The shafts of the motors are connected directly to the leadscrews (no gear reduction). The leadscrew pitch is 5.0 mm, and the number of step angles on each motor is 120. (a) How closely can the position of the table be controlled, assuming there are no mechanical errors in the positioning system? (b) What are the required rotational speeds of each stepper motor and corresponding pulse train frequencies to drive the table at 300 mm/min in a straight line from point ($x = 0, y = 0$) to point ($x = 330$ mm, $y = 220$ mm)?
- 7.11 (A)** The two axes of an x - y positioning table are each driven by stepper motors connected to ball screws with a 4:1 gear reduction (four turns of the motor for each turn of the ball screw). The number of step angles on each stepper motor is 100. Each screw has a pitch = 7.5 mm and provides an axis range = 600.0 mm. There are 16 bits in each binary register used by the controller to store position data for the two axes. (a) What is the control resolution of each axis? (b) What are the required rotational speeds of each stepper motor and corresponding pulse frequencies to drive the table at 800 mm/min in a straight line from point (20, 20) to point (350, 450)?

Analysis of Closed-Loop Positioning Systems

- 7.12** In a CNC milling machine, the axis corresponding to the feed rate uses a DC servomotor as the drive unit and a rotary encoder as the feedback sensing device. The motor is geared to a leadscrew with a 10:1 reduction (10 turns of the motor for each turn of the leadscrew). If the leadscrew pitch is 6 mm, and the encoder emits 60 pulses per revolution, determine (a) the rotational speed of the motor and (b) pulse rate of the encoder to achieve a feed rate of 300 mm/min.
- 7.13** A DC servomotor is used to drive one of the table axes of a CNC milling machine. The motor is coupled to a ball screw for the axis using a gear reduction of 8:1 (eight turns of the motor for each turn of the screw). The ball screw pitch is 7.5 mm. An optical encoder attached to the screw emits 120 pulses per revolution of the screw. The motor rotates at a top speed of 1,000 rev/min. Determine (a) control resolution of the system, based on mechanical limits of each axis, (b) frequency of the pulse train emitted by the optical encoder when the servomotor operates at full speed, and (c) travel rate of the table at the top speed of the motor.
- 7.14 (A)** The worktable of a CNC machine tool is driven by a closed-loop positioning system which consists of a servomotor, leadscrew, and rotary encoder. The leadscrew pitch = 8 mm and is coupled directly to the motor shaft (gear ratio = 1:1). The encoder generates 200 pulses per leadscrew revolution. The table has been programmed to move a distance of 350 mm at a feed rate = 450 mm/min. (a) How many pulses are received by

the control system to verify that the table has moved the programmed distance? What are (b) the pulse rate and (c) motor speed that correspond to the specified feed rate?

- 7.15** A CNC machine tool table is powered by a servomotor, ball screw, and optical encoder. The ball screw has a pitch = 6.0 mm and is connected to the motor shaft with a gear ratio of 16:1 (16 turns of the motor for each turn of the screw). The optical encoder is connected to the ball screw and generates 120 pulses/rev of the screw. The table must move a distance of 250 mm at a feed rate = 300 mm/min. (a) Determine the pulse count received by the control system to verify that the table has moved exactly 250 mm. Also, what are (b) the pulse rate and (c) motor speed that correspond to the specified feed rate?
- 7.16** A DC servomotor coupled to a leadscrew with a 4:1 gear reduction is used to drive one of the table axes of a CNC milling machine. The leadscrew has 1.5 threads/cm. An optical encoder attached to the leadscrew emits 100 pulses/rev. The motor rotates at a maximum speed of 800 rev/min. Determine (a) the control resolution of the system, expressed in linear travel distance of the table axis and (b) the frequency of the pulse train emitted by the optical encoder when the servomotor operates at maximum speed.
- 7.17** A milling operation is performed on a CNC machining center. Total travel distance = 430 mm in a direction parallel to one of the axes of the worktable. Cutting speed = 1.25 m/sec and chip load = 0.05 mm. The end milling cutter has four teeth and its diameter = 20.0 mm. The axis uses a DC servomotor whose output shaft is coupled to a leadscrew with a 5:1 gear reduction (five turns of the motor for each turn of the leadscrew). The leadscrew pitch is 6.0 mm. An optical encoder which emits 80 pulses per revolution is attached to the leadscrew. Determine (a) feed rate and time to complete the cut, (b) rotational speed of the motor, and (c) pulse rate of the encoder at the feed rate indicated.
- 7.18** A DC servomotor drives the x -axis of a CNC milling machine table. The motor is coupled to a ball screw, whose pitch = 7.5 mm, using a gear reduction of 8:1 (eight turns of the motor to one turn of the ball screw). An optical encoder is connected to the ball screw. The optical encoder emits 75 pulses per revolution. To execute a certain programmed instruction, the table must move from point ($x = 202.5$ mm, $y = 35.0$ mm) to point ($x = 25.0$ mm, $y = 250.0$ mm) in a straight line path at a feed rate = 300 mm/min. For the x -axis, determine (a) the control resolution of the system, (b) rotational speed of the motor, and (c) frequency of the pulse train emitted by the optical encoder at the desired feed rate. (d) How many pulses are emitted by the x -axis encoder during the move?

Precision of Positioning Systems

- 7.19 (A)** A two-axis positioning system uses a bit storage capacity of 16 bits in its control memory for each axis. To position the worktable, a stepper motor with step angle = 3.6° is connected to a leadscrew with a 6:1 gear reduction (six turns of the motor for each turn of the leadscrew). The leadscrew pitch is 7.5 mm. The range of the x -axis is 600 mm and the range of the y -axis is 500 mm. Mechanical accuracy of the worktable can be represented by a normal distribution with standard deviation = 0.002 mm for both axes. For each axis of the positioning system, determine (a) the control resolution, (b) accuracy, and (c) repeatability.
- 7.20** Stepper motors are used to drive the two axes of a component placement machine used for electronic assembly. A printed circuit board is mounted on the table and must be positioned accurately for reliable insertion of components into the board. Range of each axis = 700 mm. The leadscrew used to drive each of the two axes has a pitch of 3.0 mm. The inherent mechanical errors in table positioning can be characterized by a normal distribution with standard deviation = 0.005 mm. If the required accuracy for the table is 0.04 mm, determine (a) the number of step angles that the stepper motor must have, and (b) how many bits are required in the control memory for each axis to uniquely identify each control position.

- 7.21** An open-loop positioning system uses a stepper motor connected to a ball screw with a 4:1 gear reduction (four turns of the motor for each turn of the ball screw). The stepper motor has a step angle of 7.2° . The ball screw pitch is 5 mm. Mechanical inaccuracies can be described by a normal distribution whose standard deviation = 0.005 mm. The range of the worktable axis is 500 mm. What is the minimum number of bits that the binary register must have so that the mechanical drive system becomes the limiting component on control resolution?
- 7.22** The positioning table for a component placement machine uses a stepper motor and lead-screw mechanism. The design specifications call for a table speed of 0.3 m/sec and an accuracy of 0.05 mm. The pitch of the leadscrew is 8.0 mm, and there is no gear reduction. Mechanical errors in the motor, gearbox, leadscrew, and table connection are characterized by a normal distribution with standard deviation = 0.00333 mm. Determine (a) the minimum number of step angles in the stepper motor and (b) the frequency of the pulse train required to drive the table at the desired maximum speed.
- 7.23** The two axes of an x - y positioning table are each driven by a stepper motor connected to a leadscrew with a 10:1 gear reduction. The number of step angles on each stepper motor is 60. Each leadscrew has a pitch = 6 mm and provides an axis range = 300 mm. There are 16 bits in each binary register used by the controller to store position data for the two axes. (a) What is the control resolution of each axis? (b) What are the required rotational speeds and corresponding pulse train frequencies of each stepper motor in order to drive the table at 500 mm/min in a straight line from point (30, 30) to point (100, 200)?

NC Manual Part Programming (Appendix 7A)

- 7.24** Write the part program to drill the holes in the part in Figure P7.24. The part is 12.0 mm thick. Cutting speed = 100 m/min and feed = 0.06 mm/rev. Use the lower-left corner of the part as the origin in the x - y axis system. Write the part program in the word address format using absolute positioning. The program style should be similar to Example 7A.1.

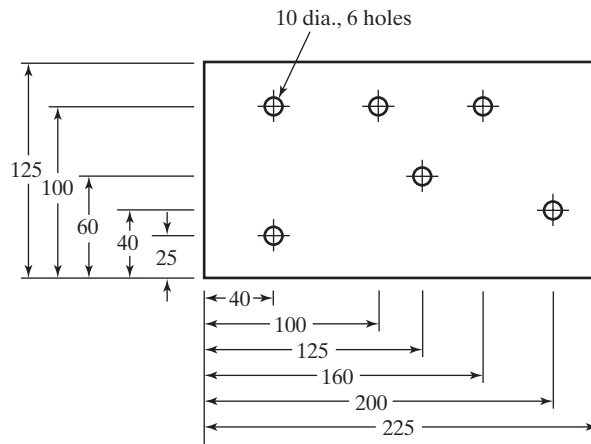


Figure P7.24 Part drawing for Problem 7.24. Dimensions are in millimeters.

- 7.25** The part in Figure P7.25 is to be drilled on a turret-type drill press. The part is 15.0 mm thick. Three drill sizes will be used: 8 mm, 10 mm, and 12 mm, which are to be specified in the part program by tool turret positions T01, T02, and T03. All tooling is high speed steel. Cutting speed = 75 mm/min and feed = 0.08 mm/rev. Use the lower-left corner of the part as the origin in the x - y axis system. Write the part program in the word address format using absolute positioning. The program style should be similar to Example 7A.1.

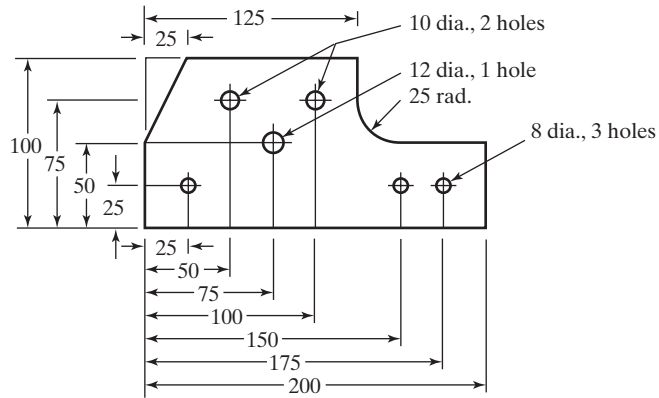


Figure P7.25 Part drawing for Problem 7.25.
Dimensions are in millimeters.

- 7.26** The outline of the part in the previous problem is to be profile milled using a 30 mm diameter end mill with four teeth. The part is 15 mm thick. Cutting speed = 150 mm/min and feed = 0.085 mm/tooth. Use the lower-left corner of the part as the origin in the x - y axis system. Two of the holes in the part have already been drilled and will be used for clamping the part during profile milling. Write the part program in the word address format. Use absolute positioning. The program style should be similar to Example 7A.2.
- 7.27** The outline of the part in Figure P7.27 is to be profile milled, using a 20 mm diameter end mill with two teeth. The part is 10 mm thick. Cutting speed = 125 mm/min and feed = 0.10 mm/tooth. Use the lower-left corner of the part as the origin in the x - y axis system. The two holes in the part have already been drilled and will be used for clamping the part during milling. Write the part program in the word address format. Use absolute positioning. The program style should be similar to Example 7A.2.

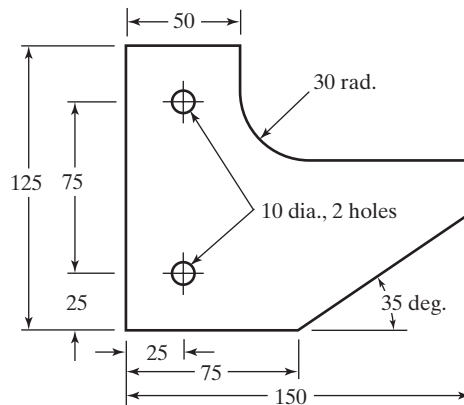


Figure P7.27 Part drawing for Problem 7.27.
Dimensions are in millimeters.

APPENDIX 7A: CODING FOR MANUAL PART PROGRAMMING

Instruction blocks in word address format consist of a series of words, each identified by a prefix label. The common prefixes are listed in Table 7A.1 together with examples. As indicated in the text, the usual sequence of words in a block is (1) N-word, or sequence number, (2) G-word, or preparatory word, (3) X, Y, Z coordinates, (4) F-word, or feed rate, (5) S-word, or spindle speed, (6) T-word, for tool selection, if applicable, and (7) M-word, or miscellaneous command. Tables 7A.2 and 7A.3 list the common G-words and M-words, respectively.

TABLE 7A.1 Common Word Prefixes Used in Word Address Format

Word Prefix	Example	Function
N	N01	Sequence number; identifies block of instruction. One to four digits can be used.
G	G21	Preparatory word; prepares controller for instructions given in the block. See Table 7A.2. There may be more than one G-word in a block. (Example specifies that numerical values are in millimeters.)
X, Y, Z	X75.0	Coordinate data for three linear axes. Can be specified in either inches or millimeters. (Example defines x-axis value as 75 mm.)
U, W	U25.0	Coordinate data for incremental moves in turning in the x- and z-directions, respectively. (Example specifies an incremental move of 25 mm in the x-direction.)
A, B, C	A90.0	Coordinate data for three rotational axes. A is the rotational axis about x-axis; B rotates about y-axis; and C rotates about z-axis. Specified in degrees of rotation. (Example defines 90° of rotation about x-axis.)
R	R100.0	Radius of arc; used in circular interpolation. (Example defines radius = 100 mm for circular interpolation.) The R-code can also be used to enter cutter radius data for defining the tool path offset distance from the part edge.
I, J, K	I32 J67	Coordinate values of arc center, corresponding to x-, y-, and z-axes, respectively; used in circular interpolation. (Example defines center of arc for circular interpolation to be at x = 32 mm and y = 67 mm.)
F	G94 F40	Feed rate per minute or per revolution in either inches or millimeters, as specified by G-words in Table 7A.2. (Example specifies feed rate = 40 mm/min in milling or drilling operation.)
S	S0800	Spindle rotation speed in rev/min, expressed in four digits. For some machines, spindle rotation speed is expressed as a percentage of maximum speed available on machine, expressed in two digits.
T	T14	Tool selection, used for machine tools with automatic tool changers or tool turrets. (Example specifies that the cutting tool to be used in the present instruction block is in position 14 in the tool drum.)
D	D05	Tool diameter word used in contouring moves for offsetting the tool from the work part by a distance stored in the indicated register; usually the distance is the cutter radius. (Example indicates that the radius offset distance is stored in offset register number 05 in the controller.)
P	P05 R15.0	Used to store cutter radius data in offset register number 05. (Example indicates that a cutter radius value of 15.0 mm is to be stored in offset register 05.)
M	M03	Miscellaneous command. See Table 7A.3. (Example commands the machine to start spindle rotation in clockwise direction.)

Note: Dimensional values in the examples are specified in mm.

TABLE 7A.2 Common G-words (Preparatory Word)

G-word	Function
G00	Point-to-point movement (rapid traverse) between previous point and end-point defined in current block. Block must include x - y - z coordinates of end position.
G01	Linear interpolation movement. Block must include x - y - z coordinates of end position. Feed rate must also be specified.
G02	Circular interpolation, clockwise. Block must include either arc radius or arc center; coordinates of end position must also be specified.
G03	Circular interpolation, counterclockwise. Block must include either arc radius or arc center; coordinates of end position must also be specified.
G04	Dwell for a specified time.
G10	Input of cutter offset data, followed by a P-code and an R-code.
G17	Selection of x - y plane in milling.
G18	Selection of x - z plane in milling.
G19	Selection of y - z plane in milling.
G20	Input values specified in inches.
G21	Input values specified in millimeters.
G28	Return to reference point.
G32	Thread cutting in turning.
G40	Cancel offset compensation for cutter radius (nose radius in turning).
G41	Cutter offset compensation, left of part surface. Cutter radius (nose radius in turning) must be specified in block.
G42	Cutter offset compensation, right of part surface. Cutter radius (nose radius in turning) must be specified in block.
G50	Specify location of coordinate axis system origin relative to starting location of cutting tool. Used in some lathes. Milling and drilling machines use G92.
G90	Programming in absolute coordinates.
G91	Programming in incremental coordinates.
G92	Specify location of coordinate axis system origin relative to starting location of cutting tool. Used in milling and drilling machines and some lathes. Other lathes use G50.
G94	Specify feed per minute in milling and drilling.
G95	Specify feed per revolution in milling and drilling.
G98	Specify feed per minute in turning.
G99	Specify feed per revolution in turning.

Note: Some G-words apply to milling and/or drilling only, whereas others apply to turning only.

In the coverage here, dimensions are given in millimeters. The values are expressed in four digits including one decimal place. For example, X020.0 means $x = 20.0$ mm. It should be noted that many CNC machines use different formats, and so the instruction manual for each particular machine tool must be consulted to determine its own proper format.

In preparing the NC part program, the part programmer must initially define the origin of the coordinate axes and then reference the succeeding motion commands to this axis system. This is accomplished in the first statement of the part program. The directions of the x -, y -, and/or z -axes are predetermined by the machine tool configuration, but the origin of the coordinate system can be located at any desired position.

TABLE 7A.3 Common M-words Used in Word Address Format

M-Word	Function
M00	Program stop; used in middle of program. Operator must restart machine.
M01	Optional program stop; active only when optional stop button on control panel has been depressed.
M02	End of program. Machine stop.
M03	Start spindle in clockwise direction for milling machine (forward for turning machine).
M04	Start spindle in counterclockwise direction for milling machine (reverse for turning machine).
M05	Spindle stop.
M06	Execute tool change, either manually or automatically. If manually, operator must restart machine. Does not include selection of tool, which is done by T-word if automatic, by operator if manual.
M07	Turn cutting fluid on flood.
M08	Turn cutting fluid on mist.
M09	Turn cutting fluid off.
M10	Automatic clamping of fixture, machine slides, etc.
M11	Automatic unclamping.
M13	Start spindle in clockwise direction for milling machine (forward for turning machine) and turn on cutting fluid.
M14	Start spindle in counterclockwise direction for milling machine (reverse for turning machine) and turn on cutting fluid.
M17	Spindle and cutting fluid off.
M19	Turn spindle off at oriented position.
M30	End of program. Machine stop. Rewind tape (on tape-controlled machines).

The part programmer defines this position relative to some part feature that can be readily recognized by the machine operator. The operator is instructed to move the tool to this position at the beginning of the job. With the tool in position, the G92 code is used by the programmer to define the origin as

$$G92 X0 Y-050.0 Z10.0$$

where the x , y , and z values specify the coordinates of the tool location in the coordinate system; in effect, this defines the location of the origin. In some CNC lathes and turning centers, the code G50 is used instead of G92. The x , y , and z values are specified in millimeters, and this must be explicitly stated. Thus, a more complete instruction block would be

$$G21 G92 X0 Y-050.0 Z10.0$$

where the G21 code indicates that the subsequent coordinate values are in millimeters.

Motions are programmed by the codes G00, G01, G02, and G03. G00 is used for a point-to-point rapid traverse movement of the tool to the coordinates specified in the command; for example,

$$G00 X050.0 Y086.5 Z100.0$$

specifies a rapid traverse motion from the current location to the location defined by the coordinates $x = 50.0$ mm, $y = 86.5$ mm, and $z = 100.0$ mm. This command would be

appropriate for NC drilling machines in which a rapid move is desired to the next hole location, with no specification on the tool path. The velocity with which the move is achieved in rapid traverse mode is set by parameters in the MCU and is not specified numerically in the instruction block. The G00 code is not intended for contouring operations.

Linear interpolation is accomplished by the G01 code. This is used when it is desired for the tool to execute a contour cutting operation along a straight line path. For example, the command

```
G01 G94 X050.0 Y086.5 Z100.0 F40 S800
```

specifies that the tool is to move in a straight line from its current position to the location defined by $x = 50.0$ mm, $y = 86.5$ mm, and $z = 100.0$ mm, at a feed rate of 40 mm/min and spindle speed of 800 rev/min.

The G02 and G03 codes are used for circular interpolation, clockwise and counterclockwise, respectively. As indicated in Table 7.1, circular interpolation on a milling machine is limited to one of three planes, x - y , x - z , or y - z . The distinction between clockwise and counterclockwise is established by viewing the plane from the front view. Selection of the desired plane is accomplished by entering one of the codes, G17, G18, or G19, respectively. Thus, the instruction

```
G02 G17 X088.0 Y040.0 R028.0 F30
```

moves the tool along a clockwise circular trajectory in the $x - y$ plane to the final coordinates defined by $x = 88$ mm and $y = 40$ mm at a feed rate of 30 mm/min. The radius of the circular arc is 28 mm. The path taken by the cutter from an assumed starting point ($x = 40$, $y = 60$) is illustrated in Figure P7A.1.

In a point-to-point motion statement (G00), it is usually desirable to position the tool so that its center is located at the specified coordinates. This is appropriate for operations such as drilling, in which a hole is to be positioned at the coordinates indicated in the statement. But in contouring motions, it is almost always desirable to separate the path followed by the center of the tool from the actual surface of the part by a distance equal to

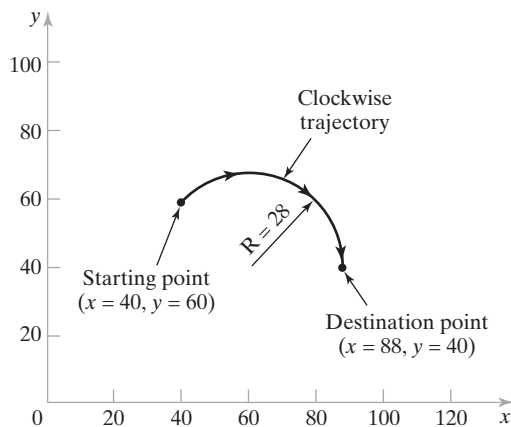


Figure P7A.1 Tool path in circular interpolation for the statement: G02 G17 X088.0 Y040.0 R028.0. Units are in millimeters.

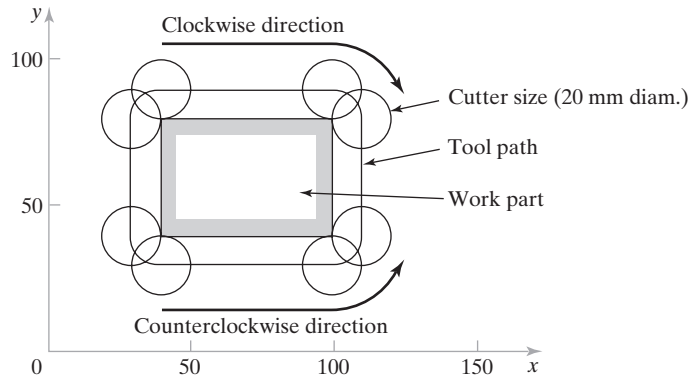


Figure P7A.2 Cutter offset for a sample rectangular part. The tool path is separated from the part perimeter by a distance equal to the cutter radius. To invoke cutter offset compensation, the G41 code is used to follow the clockwise path, which keeps the tool on the left-hand side of the part. G42 is used to follow the counterclockwise path, which keeps the tool on the right-hand side of the part.

the cutter radius. This is shown in Figure P7A.2 for profile milling the outside edges of a rectangular part in two dimensions. For a three-dimensional surface, the shape of the end of the cutter would also have to be considered in the offset computation. This tool path compensation is called the *cutter offset*, and the calculation of the correct coordinates of the endpoints of each move can be time consuming and tedious for the part programmer. Modern CNC machine tool controllers perform these cutter offset calculations automatically when the programmer uses the G40, G41, and G42 codes. The G40 code is used to cancel the cutter offset compensation. The G41 and G42 codes invoke the cutter offset compensation of the tool path on the left- or right-hand side of the part, respectively. The left- and right-hand sides are defined according to the tool path direction. To illustrate, in the rectangular part in Figure P7A.2, a clockwise tool path around the part would always position the tool on the left-hand side of the edge being cut, so a G41 code would be used to compute the cutter offset compensation. By contrast, a counterclockwise tool path would keep the tool on the right-hand side of the part, so G42 would be used. Accordingly, the instruction for profile milling the bottom edge of the part, assuming the cutter begins along the bottom-left corner, would read

```
G42 G01 X100.0 Y040.0 D05
```

where D05 refers to the cutter radius value stored in MCU memory. Certain registers are reserved in the control unit for these cutter offset values. The D-code references the value contained in the identified register. D05 indicates that the radius offset distance is stored in the number 5 offset register in the controller. This data can be entered into the controller as either a manual input or an instruction in the part program. Manual input is more flexible because the tooling used to machine the part may change from one setup to the next. At the time the job is run, the operator knows which tool will be used, and the data can be loaded into the proper register as one of the steps in the setup. When the offset data is entered as a part program instruction, the statement has the form

```
G10 P05 R10.0
```

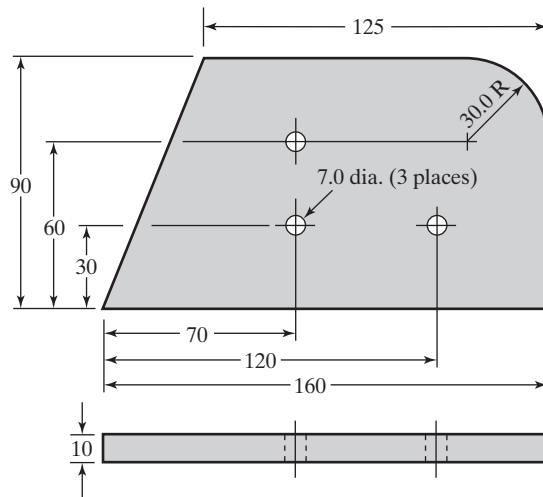


Figure P7A.3 Sample part to illustrate NC part programming. Dimensions are in millimeters. General tolerance = ± 0.1 mm. Work material is a machinable grade of aluminum.

where G10 is a preparatory word indicating that cutter offset data will be entered, P05 indicates that the data will be entered into offset register number 05, and R10.0 is the radius value, here 10.0 mm.

To demonstrate manual part programming, two examples are presented using the sample part shown in Figure P7A.3. The first example is a point-to-point program to drill the three holes in the part. The second example is a two-axis contouring program to accomplish profile milling around the periphery of the part.

EXAMPLE 7A.1 Point-to-Point Drilling

This example presents the NC part program in word address format for drilling the three holes in the sample part shown in Figure P7A.3. The outside edges of the starting work part have been rough cut (by jig sawing) and are slightly oversized for subsequent profile milling. The three holes to be drilled in this example will be used to locate and fixture the part for profile milling in the following example. For the present drilling sequence, the part is gripped in place so that its top surface is 40 mm above the surface of the machine tool table to provide ample clearance beneath the part for hole drilling. The x -, y -, and z -axes are defined as shown in Figure P7A.4. A 7.0-mm diameter drill, corresponding to the specified hole size, has been chucked in the CNC drill press. The drill will be operated at a feed of 0.05 mm/rev and a spindle speed of 1,000 rev/min (corresponding to a surface speed of about 0.37 m/sec, which is slow for the aluminum work material). At the beginning of the job, the drill point will be positioned at a target point located at $x = 0$, $y = -50$, and $z = +10$ (axis units are in millimeters). The program begins with the tool positioned at this target point.

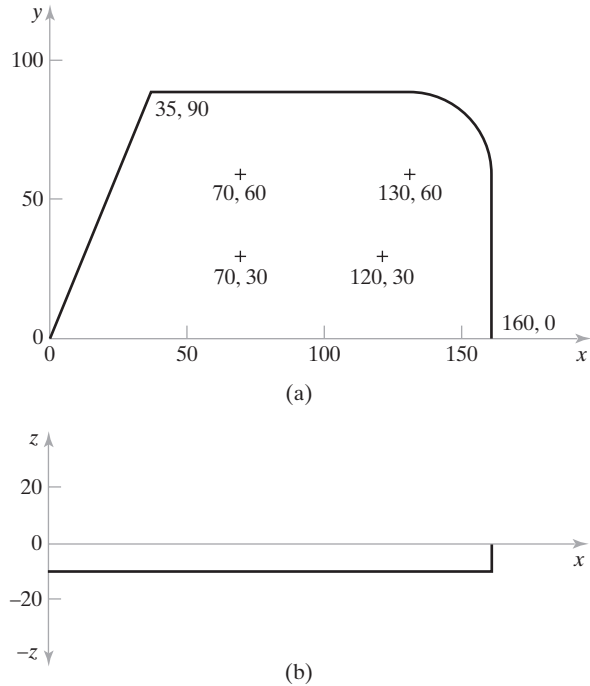


Figure P7A.4 Sample part aligned relative to (a) x - and y -axes and (b) z -axis. Coordinates are given for significant part features in

NC Part Program Code	Comments
N001 G21 G90 G92 X0Y0Z0.0 Z10.0;	Define origin of axes.
N002 G00 X070.0Y030.0;	Rapid move to first hole location.
N003 G01 G95 Z-15.0 F0.05 S1000 M03;	Drill first hole.
N004 G01 Z0.0;	Retract drill from hole.
N005 G00Y060.0;	Rapid move to second hole location.
N006 G01 G95 Z-15.0 F0.05;	Drill second hole.
N007 G01 Z0.0;	Retract drill from hole.
N008 G00 X120.0Y030.0;	Rapid move to third hole location.
N009 G01 G95 Z-15.0 F0.05;	Drill third hole.
N010 G01 Z0.0;	Retract drill from hole.
N011 G00 X0Y050.0 M05;	Rapid move to target point.
N012 M30;	End of program, stop machine.

EXAMPLE 7A.2 Two-Axis Milling

The three holes drilled in the previous example can be used for locating and holding the work part to completely mill the outside edges without re-fixturing. The axis coordinates are shown in Figure P7A.4 (same coordinates as in the previous drilling sequence). The part is fixtured so that its top surface is 40 mm above the surface of the machine tool table. Thus, the origin of the axis system

will be 40 mm above the table surface. A 20-mm diameter end mill with four teeth will be used. The cutter has a side tooth engagement length of 40 mm. Throughout the machining sequence, the bottom tip of the cutter will be positioned 25 mm below the part top surface, which corresponds to $z = -25$ mm. Since the part is 10 mm thick, this z -position will allow the side cutting edges of the milling cutter to cut the full thickness of the part during profile milling. The cutter will be operated at a spindle speed = 1,000 rev/min (which corresponds to a surface speed of about 1.0 m/sec) and a feed rate = 50 mm/min (which corresponds to 0.20 mm/tooth). The tool path to be followed by the cutter is shown in Figure P7A.5, with numbering that corresponds to the sequence number in the program. Cutter diameter data has been manually entered into offset register 05. At the beginning of the job, the cutter will be positioned so that its center tip is at a target point located at $x = 0$, $y = -50$, and $z = +10$. The program begins with the tool positioned at this location.

NC Part Program Code	Comments
N001 G21 G90 G92 X0Y-050.0 Z10.0;	Define origin of axes.
N002 G00 Z-025.0 S1000 M03;	Rapid move to cutter depth, turn spindle on.
N003 G01 G94 G42Y0 D05 F40;	Engage part, start cutter offset.
N004 G01 X160.0;	Mill lower part edge.
N005 G01 Y060.0;	Mill right straight edge.
N006 G17 G03 X130.0Y090.0 R030.0;	Circular interpolation around arc.
N007 G01 X035.0;	Mill upper part edge.
N008 G01 X0Y0;	Mill left part edge.
N009 G40 G00 X-040.0 M05;	Rapid exit from part, cancel offset.
N010 G00 X0Y-050.0;	Rapid move to target point.
N011 M30;	End of program, stop machine.

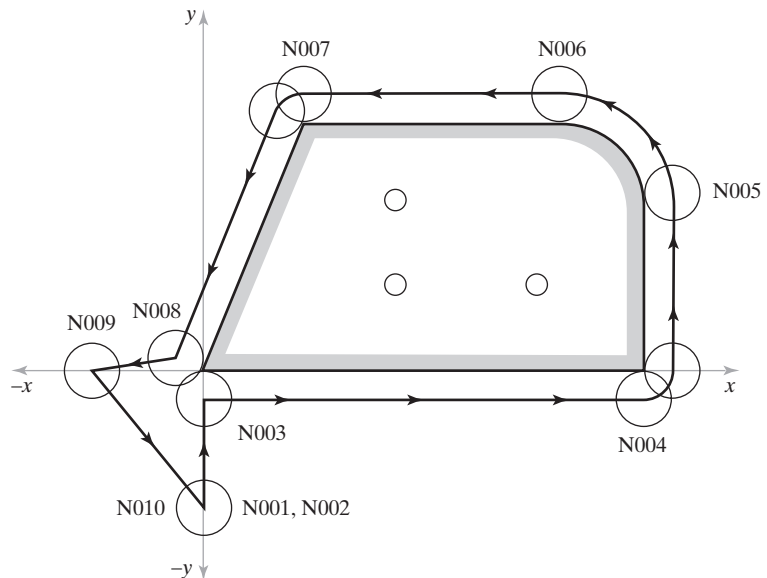


Figure P7A.5 Cutter path for profile milling outside perimeter of sample part.

Chapter 8

Industrial Robotics

CHAPTER CONTENTS

- 8.1 Robot Anatomy and Related Attributes
 - 8.1.1 Joints and Links
 - 8.1.2 Common Robot Configurations
 - 8.1.3 Joint Drive Systems
 - 8.1.4 Sensors in Robotics
- 8.2 Robot Control Systems
- 8.3 End Effectors
 - 8.3.1 Grippers
 - 8.3.2 Tools
- 8.4 Applications of Industrial Robots
 - 8.4.1 Material Handling Applications
 - 8.4.2 Processing Operations
 - 8.4.3 Assembly and Inspection
 - 8.4.4 Economic Justification of Industrial Robots
- 8.5 Robot Programming
 - 8.5.1 Leadthrough Programming
 - 8.5.2 Robot Programming Languages
 - 8.5.3 Simulation and Off-Line Programming
- 8.6 Robot Accuracy and Repeatability

An *industrial robot* is defined as “an automatically controlled, reprogrammable, multi-purpose manipulator programmable in three or more axes, which may be either fixed in

place or mobile for use in industrial automation applications.”¹ It is a general-purpose machine possessing certain anthropomorphic characteristics, the most obvious of which is its mechanical arm. Other human-like characteristics are the robot’s capabilities to respond to sensory inputs, communicate with other machines, and make decisions. These capabilities permit robots to perform a variety of industrial tasks. The development of robotics technology followed the development of numerical control (Historical Note 8.1), and the two technologies are quite similar. They both involve coordinated control of multiple axes (the axes are called *joints* in robotics), and they both use dedicated digital computers as controllers. Whereas NC (numerical control) machines are designed to perform specific processes (e.g., machining, sheet metal hole punching, and thermal cutting), robots are designed for a wider variety of tasks. Typical production applications of industrial robots include spot welding, material transfer, machine loading, spray painting, and assembly.

Some of the qualities that make industrial robots commercially and technologically important are the following:

- Robots can be substituted for humans in hazardous or uncomfortable work environments.
- A robot performs its work cycle with a consistency and repeatability that cannot be attained by humans.
- Robots can be reprogrammed. When the production run of the current task is completed, a robot can be reprogrammed and equipped with the necessary tooling to perform an altogether different task.
- Robots are controlled by computers and can therefore be connected to other computer systems to achieve computer integrated manufacturing.

Historical Note 8.1 A Short History of Industrial Robots [5] [12]

The word “robot” entered the English language through a Czechoslovakian play titled *Rossum’s Universal Robots*, written by Karel Capek in the early 1920s. The Czech word *robota* means forced worker. In the English translation, the word was converted to “robot.” The story line of the play centers around a scientist named Rossum who invents a chemical substance similar to protoplasm and uses it to produce robots. The scientist’s goal is for robots to serve humans and perform physical labor. Rossum continues to make improvements in his invention, ultimately perfecting it. These “perfect beings” begin to resent their subservient role in society and turn against their masters, killing off all human life.

Capek’s play was pure science fiction. This brief history must include two real inventors who made original contributions to the technology of industrial robotics. The first was Cyril W. Kenward, a British inventor who devised a manipulator that moved on an x - y - z axis system. In 1954, Kenward applied for a British patent for his robotic device, and in 1957 the patent was issued.

The second inventor was an American named George C. Devol. Devol is credited with two inventions related to robotics. The first was a device for magnetically recording

¹Industrial robot as defined in the ISO 8373 standard [16].

electrical signals so that the signals could be played back to control the operation of machinery. This device was invented around 1946, and a U.S. patent was issued in 1952. The second invention was a robotic device developed in the 1950s, which Devol called “programmed article transfer.” This device was intended for parts handling. The U.S. patent was finally issued in 1961. It was a prototype for the hydraulically driven robots that were later built by Unimation, Inc.

Although Kenward’s robot was chronologically the first (at least in terms of patent date), Devol’s proved ultimately to be far more important in the development and commercialization of robotics technology. The reason for this was a catalyst in the person of Joseph Engelberger. Engelberger had graduated from Columbia University with degrees in physics in 1946 and 1949. As a student, he had read science fiction novels about robots. By the mid-1950s, he was working for a company that made control systems for jet engines. Hence, by the time a chance meeting occurred between Engelberger and Devol in 1956, Engelberger was “predisposed by education, avocation, and occupation toward the notion of robotics.”² The meeting took place at a cocktail party in Fairfield, Connecticut. Devol described his programmed article transfer invention to Engelberger, and they subsequently began considering how to develop the device as a commercial product for industry. In 1962, Unimation, Inc., was founded, with Engelberger as president. The name of the company’s first product was “Unimate,” a polar configuration robot. The first application of a Unimate robot was unloading a die casting machine at a General Motors plant in New Jersey in 1961.

8.1 ROBOT ANATOMY AND RELATED ATTRIBUTES

The arm or manipulator of an industrial robot consists of a series of joints and links. Robot anatomy is concerned with the types and sizes of these joints and links and other aspects of the manipulator’s physical construction. The robot’s anatomy affects its capabilities and the tasks for which it is best suited.

8.1.1 Joints and Links

A robot’s joint, or *axis* as it is also called in robotics, is similar to a joint in the human body: It provides relative motion between two parts of the body. Robots are often classified according to the total number of axes they possess. Connected to each joint are two links, an input link and an output link. Links are the rigid components of the robot manipulator. The purpose of the joint is to provide controlled relative movement between the input link and the output link.

Most robots are mounted on a stationary base on the floor. Let this base and its connection to the first joint be referred to as link 0. It is the input link to joint 1, the first in the series of joints used in the construction of the robot. The output link of joint 1 is link 1. Link 1 is the input link to joint 2, whose output link is link 2, and so forth. This joint-link numbering scheme is illustrated in Figure 8.1.

Nearly all industrial robots have mechanical joints that can be classified into one of five types: two types that provide translational motion and three types that provide

²This quote was borrowed from Groover et al., *Industrial Robotics: Technology, Programming, and Applications* [5].

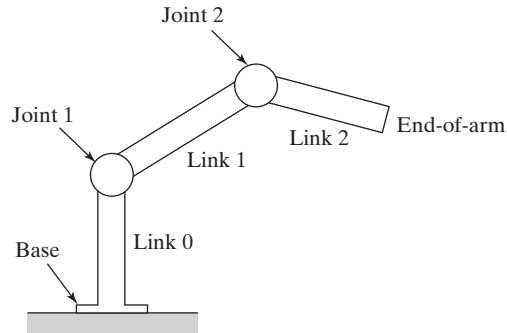


Figure 8.1 Diagram of robot construction showing how a robot is made up of a series of joint-link combinations.

rotary motion. These joint types are illustrated in Figure 8.2 and are based on a scheme described in [5]. The five joint types are

1. *Linear joint* (type L joint). The relative movement between the input link and the output link is a translational telescoping motion, with the axes of the two links being parallel.
2. *Orthogonal joint* (type O joint). This is also a translational sliding motion, but the input and output links are perpendicular to each other.
3. *Rotational joint* (type R joint). This type provides rotational relative motion, with the axis of rotation perpendicular to the axes of the input and output links.
4. *Twisting joint* (type T joint). This joint also involves rotary motion, but the axis of rotation is parallel to the axes of the two links.
5. *Revolving joint* (type V joint, V from the “v” in revolving). In this joint type, the axis of the input link is parallel to the axis of rotation of the joint, and the axis of the output link is perpendicular to the axis of rotation.

Each of these joint types has a range over which it can be moved. The range for a translational joint is usually less than a meter, but for large gantry robots, the range may be several meters. The three types of rotary joints may have a range as small as a few degrees or as large as several complete revolutions.

8.1.2 Common Robot Configurations

A robot manipulator can be divided into two sections: a body-and-arm assembly and a wrist assembly. There are usually three axes associated with the body-and-arm, and either two or three axes associated with the wrist. At the end of the manipulator’s wrist is a device related to the task that must be accomplished by the robot. The device, called an *end effector* (Section 8.3), is usually either (1) a gripper for holding a work part or (2) a tool for performing some process. The body-and-arm of the robot is used to position the end effector, and the robot’s wrist is used to orient the end effector.

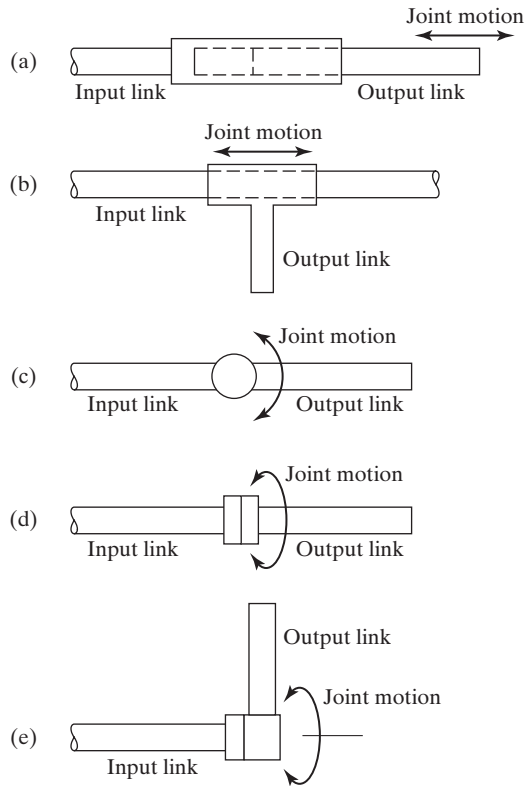


Figure 8.2 Five types of joints commonly used in industrial robot construction: (a) linear joint (type L joint), (b) orthogonal joint (type O joint), (c) rotational joint (type R joint), (d) twisting joint (type T joint), and (e) revolving joint (type V joint).

Body-and-Arm Configurations. Given the five types of joints defined earlier, there are $5 \times 5 \times 5 = 125$ possible combinations of joints that could be used to design the body-and-arm assembly for a three-axis manipulator. In addition, there are design variations within the individual joint types (e.g., physical size of the joint and range of motion). It is somewhat remarkable, therefore, that only a few configurations are commonly available in commercial industrial robots. These configurations are:

1. *Articulated robot.* Also known as a *jointed-arm robot* (Figure 8.3), it has the general configuration of a human shoulder and arm. It consists of an upright body that swivels about the base using a T joint. At the top of the body is a shoulder joint (shown as an R joint in the figure), whose output link connects to an elbow joint (another R joint).
2. *Polar configuration.* This configuration (Figure 8.4) consists of a sliding arm (L joint) actuated relative to the body, which can rotate about both a vertical axis (T joint) and a horizontal axis (R joint).³

³The polar configuration was the design used for the first commercial robot, the Unimate, produced by Unimation, Inc., in the 1960s. Once the most widely used robot configuration, for machine loading and automobile spot welding, it is no longer favored by robot designers today.

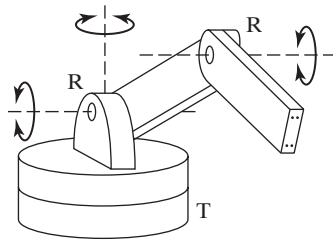


Figure 8.3 Articulated robot (jointed-arm robot).

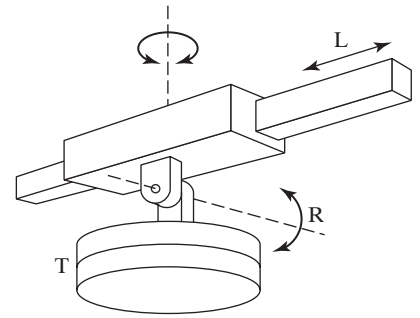


Figure 8.4 Polar configuration.

3. *SCARA*. SCARA is an acronym for *Selectively Compliant Arm for Robotic Assembly*. This configuration (Figure 8.5) is similar to the jointed-arm robot except that the shoulder and elbow rotational axes are vertical, which means that the arm is very rigid in the vertical direction, but compliant in the horizontal direction. This permits the robot to perform insertion tasks (for assembly) in a vertical direction, where some side-to-side alignment may be needed to mate the two parts properly.
4. *Cartesian coordinate robot*. Other names for this configuration include *gantry robot*, *rectilinear robot*, and *x-y-z robot*. As shown in Figure 8.6, it consists of three orthogonal joints (type O) to achieve linear motions in a three-dimensional rectangular work space. It is commonly used for overhead access to load and unload production machines.
5. *Delta robot*. This unusual design, depicted in Figure 8.7, consists of three arms attached to an overhead base. Each arm is articulated and consists of two rotational joints (type R), the first of which is powered and the second is unpowered. All three arms are connected to a small platform below, to which the end effector is attached. The platform and end effector can be manipulated in three dimensions. The delta robot is used for high-speed movement of small objects, as in product packaging.

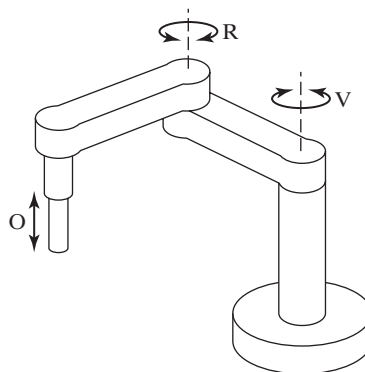


Figure 8.5 SCARA configuration.

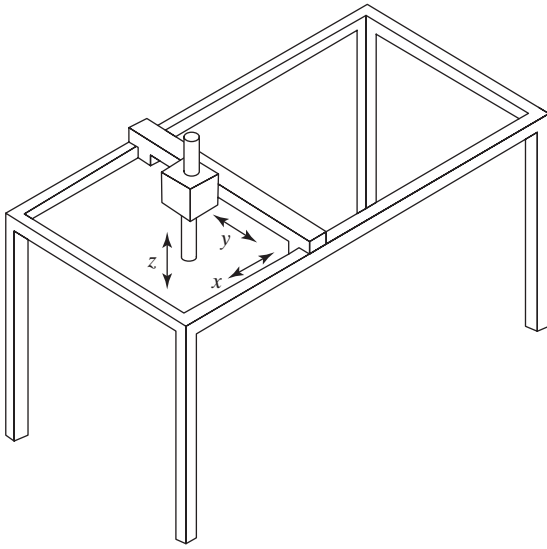


Figure 8.6 Cartesian coordinate robot.

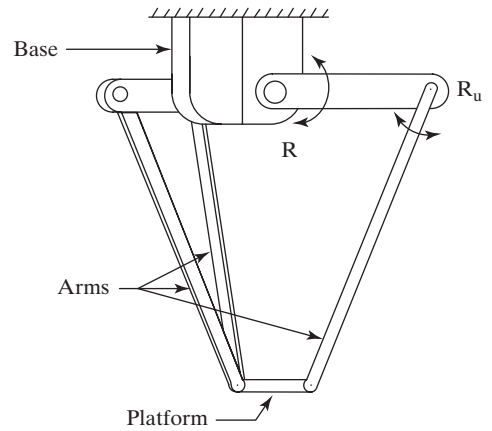


Figure 8.7 Delta robot.

The first three configurations follow the serial joint-link configuration mounted on the floor, as pictured in Figure 8.1. The Cartesian coordinate and delta configurations are exceptions to this convention. The usual Cartesian coordinate robot is suspended from a gantry structure. The first and second axes permit x - y movement over a rectangular area above the floor. The third axis permits movement in the z direction to reach downward.⁴ Depending on the application requirements, a wrist assembly can be attached to the end of the arm (link 3).

The delta robot is also suspended from an overhead base rather than floor mounted. Its most unique feature is its three articulated arms that are all connected to the platform below. Each arm has one powered joint and one follower joint. The overhead base is link 0 for all three arms. In each arm, joint 1 is rotational and powered. Its output link 1 is connected to joint 2, which is unpowered, and output link 2 is connected to the platform. By coordinating the actuations of the three powered joints, the position of the platform can be controlled in three dimensions while maintaining the orientation of the end effector. A separate wrist assembly is usually not included in the delta robot. The end effector is attached directly to the underside of the platform.

Like the delta robot, the SCARA configuration typically does not have a separate wrist assembly. As indicated in the description, it is used for insertion-type assembly operations in which the insertion is made from above. Accordingly, orientation requirements are minimal, and the wrist is not needed. Orientation of the object to be inserted is sometimes required, and an additional rotary joint added to link 3 can be provided for this purpose.

⁴A recently introduced robot from ABB Robotics combines the overhead gantry design with an articulated robot arm [14]. The gantry structure allows a large x - y work envelope, and the jointed arm provides orientation capability for equipment access.

There are more manipulator configurations than those described, and they come in many different sizes. The interested reader can peruse the websites of some of the robot manufacturers in [14], [15], and [17].

Wrist Configurations. The robot's wrist is used to establish the orientation of the end effector. Robot wrists usually consist of two or three joints that almost always consist of R and T type rotary joints. Figure 8.8 illustrates one possible configuration for a three-axis wrist assembly. The three joints are defined as follows: (1) *roll*, using a T joint to accomplish rotation about the robot's arm axis; (2) *pitch*, which involves up-and-down rotation, typically using an R joint; and (3) *yaw*, which involves right-and-left rotation, also accomplished by means of an R-joint. A two-axis wrist typically includes only roll and pitch joints (T and R joints).

To avoid confusion in the pitch and yaw definitions, the wrist roll should be assumed in its center position, as shown in the figure. To demonstrate the possible confusion, consider a two-jointed wrist assembly. With the roll joint in its center position, the second joint (R joint) provides up-and-down rotation (pitch). However, if the roll position were 90 degrees from center (either clockwise or counterclockwise), the second joint would provide a right-left rotation (yaw).

Joint Notation System. The letter symbols for the five joint types (L, O, R, T, and V) can be used in a joint notation system for the robot manipulator and wrist. In this notation system, the manipulator is described by the joint types that make up the body-and-arm assembly, followed by the joint symbols that make up the wrist. For example, the notation TLR:RT represents a five-axis manipulator whose body-and-arm is made up of a twisting joint (joint 1 = T), a linear joint (joint 2 = L), and a rotational joint (joint 3 = R). The wrist consists of two joints, a rotational joint (joint 4 = R) and a twisting joint (joint 5 = T). A colon separates the body-and-arm notation from the wrist notation. Common wrist joint notations are TRR, TR, and RT.

Typical joint notations for the five body-and-arm configurations are presented in Table 8.1. The notation for the delta robot indicates that there are three arms, and each arm has two rotational joints, the second of which is unpowered (R_u).

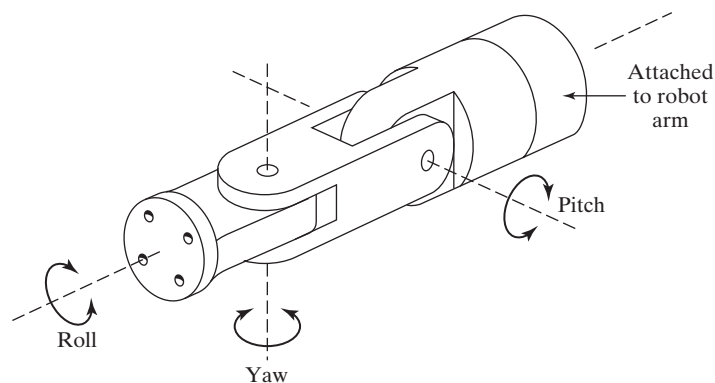


Figure 8.8 Typical configuration of a three-axis wrist assembly showing roll, pitch, and yaw.

TABLE 8.1 Joint Notations for the Five Common Robot Body-and-Arm Configurations

Body-and-Arm	Joint Notation	Work Volume
Articulated	TRR (Figure 8.3)	Partial sphere
Polar	TRL (Figure 8.4)	Partial sphere
SCARA	VRO (Figure 8.5)	Cylindrical
Cartesian coordinate	OOO (Figure 8.6)	Rectangular solid
Delta	3(RR _u) (Figure 8.7)	Hemisphere

Work Volume. The work volume (also known as *work envelope*) of the manipulator is defined as the three-dimensional space within which the robot can manipulate the end of its wrist. Work volume is determined by the number and types of joints in the manipulator (body-and-arm and wrist), the ranges of the various joints, and the physical sizes of the links. The shape of the work volume depends largely on the robot's configuration, as indicated in Table 8.1.

8.1.3 Joint Drive Systems

Robot joints are actuated using any of three types of drive systems: (1) electric, (2) hydraulic, or (3) pneumatic. Electric drive systems use electric motors as joint actuators (e.g., servomotors or stepper motors, Sections 6.2.1 and 7.4). The motors are connected to the joints either using no gear reduction (called *direct drive*) or with a gear reduction to increase torque or force. Hydraulic and pneumatic drive systems use devices such as linear pistons and rotary vane actuators (Section 6.2.2) to move the joint.

Pneumatic drive is typically limited to smaller robots used in simple part transfer applications. Electric drive and hydraulic drive are used on more sophisticated industrial robots. Electric drive has become the preferred drive system in commercially available robots, as electric motor technology has advanced in recent years. It is more readily adaptable to computer control, which is the dominant technology used today for robot controllers. Electric drive robots are relatively accurate compared with hydraulically powered robots. By contrast, hydraulic drive robots can be designed with greater lift capacity.

The drive system, position sensors (and speed sensors if used), and feedback control systems for the joints determine the dynamic response characteristics of the manipulator. The speed with which the robot can move to a programmed position and the stability of its motion are important characteristics of dynamic response in robotics. **Motion speed** refers to the absolute velocity of the manipulator at its end-of-arm. The maximum speed of a large robot is around 2 m/sec (6 ft/sec). Speed can be programmed into the work cycle so that different portions of the cycle are carried out at different velocities. What is sometimes more important than speed is the robot's capability to accelerate and decelerate in a controlled manner. In many work cycles, much of the robot's movement is performed in a confined region of the work volume, so the robot never achieves its top-rated velocity. In these cases, nearly all of the motion cycle is engaged in acceleration and deceleration rather than in constant speed. Other factors that influence speed of motion are the weight (mass) of the object that is being manipulated and the precision with which the object must be located at the end of a given move. All of these factors are included in the **speed of response**, which is the time required for the

manipulator to move from one point in space to the next. Speed of response is important because it influences the robot's cycle time, which in turn affects the production rate in the application. **Motion stability** refers to the amount of overshoot and oscillation that occurs in the robot motion at the end-of-arm as it attempts to move to the next programmed location. More oscillation in the motion is an indication of less stability. The problem is that robots with greater stability are inherently slower in their response, whereas faster robots are generally less stable.

Load carrying capacity depends on the robot's physical size and construction as well as the force and power that can be transmitted to the end of the wrist. The weight carrying capacity of commercial robots ranges from less than 1 kg up to approximately 1,200 kg (2,600 lb) [15]. Medium sized robots designed for typical industrial applications have capacities in the range of 10–60 kg (22–130 lb). One factor that should be kept in mind when considering load carrying capacity is that a robot usually works with a tool or gripper attached to its wrist. Grippers are designed to grasp and move objects about the work cell. The net load-carrying capacity of the robot is obviously reduced by the weight of the gripper. If the robot is rated at 10 kg (22 lb) and the weight of the gripper is 4 kg (9 lbs), then the net weight carrying capacity is reduced to 6 kg (13 lb).

8.1.4 Sensors in Robotics

The general topic of sensors as components in control systems is discussed in Section 6.1. The discussion here is on how sensors are applied in robotics. Sensors used in industrial robotics can be classified into two categories: (1) internal and (2) external. Internal sensors are components of the robot and are used to control the positions and velocities of the robot joints. These sensors form a feedback control loop with the robot controller. Typical sensors used to control the position of the robot arm include potentiometers and optical encoders. Tachometers of various types are used to control the speed of the robot arm.

External sensors are external to the robot and are used to coordinate the operation of the robot with other equipment in the cell. In many cases, these external sensors are relatively simple devices, such as limit switches that determine whether a part has been positioned properly in a fixture or that a part is ready to be picked up at a conveyor. Other situations require more advanced sensor technologies, including the following:

- *Tactile sensors.* These are used to determine whether contact is made between the sensor and another object. Tactile sensors can be divided into two types in robot applications: (1) touch sensors and (2) force sensors. Touch sensors indicate simply that contact has been made with the object. Force sensors indicate the magnitude of the force with the object. This might be useful in a gripper to measure and control the force being applied to grasp a delicate object.
- *Proximity sensors.* These indicate when an object is close to the sensor. When this type of sensor is used to indicate the actual distance of the object, it is called a *range sensor*.
- *Optical sensors.* Photocells and other photometric devices can be utilized to detect the presence or absence of objects and are often used for proximity detection.
- *Machine vision.* Machine vision is used in robotics for inspection, parts identification, guidance, and other uses. Section 22.5 provides a more complete discussion of machine vision in automated inspection. Improvements in programming of

vision-guided robot (VGR) systems have made implementations of this technology easier and faster [20], and machine vision is being implemented as an integral feature in more and more robot installations, especially in the automotive industry [13].

- *Other sensors.* A miscellaneous category includes other types of sensors that might be used in robotics, such as devices for measuring temperature, fluid pressure, fluid flow, electrical voltage, current, and various other physical properties (Table 6.2).

8.2 ROBOT CONTROL SYSTEMS

The actuations of the individual joints must be controlled in a coordinated fashion for the manipulator to perform a desired motion cycle. Microprocessor-based controllers are commonly used today in robotics as the control system hardware. The controller is organized in a hierarchical structure as indicated in Figure 8.9 so that each joint has its own feedback control system, and a supervisory controller coordinates the combined actuations of the joints according to the sequence of the robot program. Different types of control are required for different applications. Robot controllers can be classified into four categories [5]: (1) limited-sequence control, (2) playback with point-to-point control, (3) playback with continuous path control, and (4) intelligent control.

Limited-Sequence Control. This is the most elementary control type. It can be utilized only for simple motion cycles, such as pick-and-place operations (i.e., picking an object up at one location and placing it at another location). It is usually implemented by setting limits or mechanical stops for each joint and sequencing the actuation of the joints to accomplish the cycle. Interlocks (Section 5.3.2) are sometimes used to indicate that the particular joint actuation has been accomplished so that the next step in the sequence can be initiated. However, there is no servo-control to accomplish precise positioning of the joint. Many pneumatically driven robots are limited-sequence robots.

Playback with Point-to-Point Control. Playback robots represent a more sophisticated form of control than limited-sequence robots. Playback control means that the controller has a memory to record the sequence of motions in a given work cycle, as well as the locations and other parameters (such as speed) associated with each motion, and then to subsequently play back the work cycle during execution of the program.

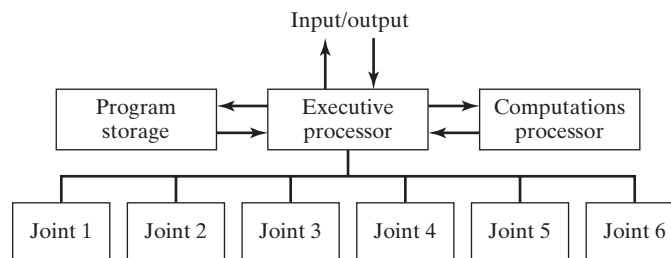


Figure 8.9 Hierarchical control structure of a robot microcomputer controller.

In point-to-point (PTP) control, individual positions of the robot arm are recorded into memory. These positions are not limited to mechanical stops for each joint as in limited-sequence robots. Instead, each position in the robot program consists of a set of values representing locations in the range of each joint of the manipulator. Thus, each “point” consists of five or six values corresponding to the positions of each of the five or six joints of the manipulator. For each position defined in the program, the joints are thus directed to actuate to their respective specified locations. Feedback control is used during the motion cycle to confirm that the individual joints achieve the specified locations in the program. Interlocks are used to coordinate the actions of the robot with the actions of other equipment in the work cell.

Playback with Continuous Path Control. Continuous path robots have the same playback capability as the previous type. The difference between continuous path and point-to-point is the same in robotics as it is in NC (Section 7.1.3). A playback robot with continuous path control is capable of one or both of the following:

1. *Greater storage capacity.* The controller has a far greater storage capacity than its point-to-point counterpart, so the number of locations that can be recorded into memory is far greater than for point-to-point. Thus, the points constituting the motion cycle can be spaced very closely together to permit the robot to accomplish a smooth continuous motion. In PTP, only the final location of the individual motion elements are controlled, so the path taken by the arm to reach the final location is not controlled. In a continuous path motion, the movement of the arm and wrist is controlled during the motion.
2. *Interpolation calculations.* The controller computes the path between the starting point and the ending point of each move using interpolation routines similar to those used in NC. These routines generally include linear and circular interpolation (Table 7.1).

The difference between PTP and continuous path control can be explained mathematically as follows. Consider a three-axis Cartesian coordinate manipulator in which the end-of-arm is moved in x - y - z space. In point-to-point systems, the x -, y -, and z -axes are controlled to achieve a specified point location within the robot’s work volume. In continuous path systems, not only are the x -, y -, and z -axes controlled, but the velocities dx/dt , dy/dt , and dz/dt are controlled simultaneously to achieve the specified linear or curvilinear path. Servo-control is used to continuously regulate the position and speed of the manipulator. It should be mentioned that a playback robot with continuous path control has the capacity for PTP control.

Intelligent Control. Industrial robots are becoming increasingly intelligent. In this context, an intelligent robot is one that exhibits behavior that makes it seem intelligent. Some of the characteristics that make a robot appear intelligent include the capacities to interact with its environment, make decisions when things go wrong during the work cycle, communicate with humans, make computations during the motion cycle, and respond to advanced sensor inputs such as machine vision.

In addition, robots with intelligent control possess playback capability for both PTP and continuous path control. All of these features require (1) a relatively high level of computer control and (2) an advanced programming language to input the decision-making logic and other “intelligence” into memory.

8.3 END EFFECTORS

As mentioned in Section 8.1.2 on robot configurations, an end effector is usually attached to the robot's wrist. The end effector enables the robot to accomplish a specific task. Because there is a wide variety of tasks performed by industrial robots, the end effector is usually custom-engineered and fabricated for each different application. The two categories of end effectors are grippers and tools.

8.3.1 Grippers

Grippers are end effectors used to grasp and manipulate objects during the work cycle. The objects are usually work parts that are moved from one location to another in the cell. Machine loading and unloading applications fall into this category. Owing to the variety of part shapes, sizes, and weights, most grippers must be custom designed. Types of grippers used in industrial robot applications include the following:

- *Mechanical grippers*, consisting of two or more fingers that can be actuated by the robot controller to open and close on the work part (Figure 8.10 shows a two-finger gripper)
- *Vacuum grippers*, in which suction cups are used to hold flat objects
- *Magnetized devices*, for holding ferrous parts
- *Adhesive devices*, which use an adhesive substance to hold a flexible material such as a fabric
- *Simple mechanical devices*, such as hooks and scoops.

Mechanical grippers are the most common gripper type. Some of the innovations and advances in mechanical gripper technology include:

- *Dual grippers*, consisting of two gripper devices in one end effector for machine loading and unloading. With a single gripper, the robot must reach into the production machine twice, once to unload the finished part and position it in a location external to the machine, and the second time to pick up the next part and load it into the machine. With a dual gripper, the robot picks up the next work part while the

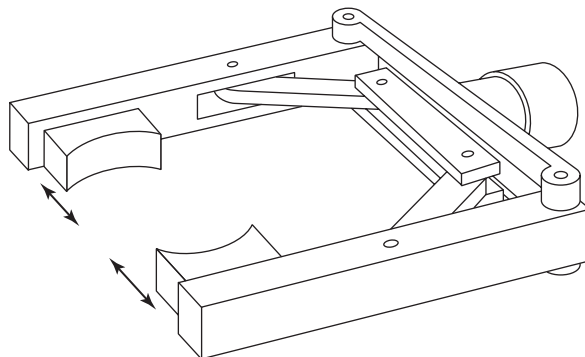


Figure 8.10 Robot mechanical gripper.

machine is still processing the previous part. When the machine cycle is finished, the robot reaches into the machine only once: to remove the finished part and load the next part. This reduces the cycle time per part.

- *Interchangeable fingers* that can be used on one gripper mechanism. To accommodate different parts, different fingers are attached to the gripper.
- *Sensory feedback* in the fingers that provide the gripper with capabilities such as (1) sensing the presence of the work part or (2) applying a specified limited force to the work part during gripping (for fragile work parts).
- *Multiple-fingered grippers* that possess the general anatomy of a human hand.
- *Standard gripper products* that are commercially available, thus reducing the need to custom-design a gripper for each separate robot application.

8.3.2 Tools

The robot uses tools to perform processing operations on the work part. The robot manipulates the tool relative to a stationary or slowly moving object (e.g., work part or subassembly). Examples of tools used as end effectors by robots to perform processing applications include spot welding gun, arc welding tool; spray painting gun; rotating spindle for drilling, routing, grinding, and similar operations; assembly tool (e.g., automatic screwdriver); heating torch; ladle (for metal die casting); and water jet cutting tool. In each case, the robot must not only control the relative position of the tool with respect to the work as a function of time, it must also control the operation of the tool. For this purpose, the robot must be able to transmit control signals to the tool for starting, stopping, and otherwise regulating its actions.

In some applications, the robot may use multiple tools during the work cycle. For example, several sizes of routing or drilling bits must be applied to the work part. Thus, the robot must have a means of rapidly changing the tools. The end effector in this case takes the form of a fast-change tool holder for quickly fastening and unfastening the various tools used during the work cycle.

8.4 APPLICATIONS OF INDUSTRIAL ROBOTS

Robots are used in a wide field of applications in industry. Most of the current applications are in manufacturing. The applications can usually be classified into one of the following categories: (1) material handling, (2) processing operations, and (3) assembly and inspection. Section 8.4.4 lists some of the work characteristics that must be present in the application to make the installation of a robot technically and economically feasible.

8.4.1 Material Handling Applications

In material handling applications, the robot moves materials or parts from one place to another. To accomplish the transfer, the robot is equipped with a gripper that must be designed to handle the specific part or parts to be moved. Included within this application category are (1) material transfer and (2) machine loading and/or unloading. In many material handling applications, the parts must be presented to the robot in a known position and orientation. This requires some form of material handling device to deliver the parts into the work cell in this position and orientation.

Material Transfer. These applications are ones in which the primary purpose of the robot is to move parts from one location to another. In many cases, reorientation of the part is accomplished during the move. The basic application in this category is called a *pick-and-place* operation, in which the robot picks up a part and deposits it at a new location. Transferring parts from one conveyor to another is an example. The requirements of the application are modest; a low-technology robot (e.g., limited-sequence type) is often sufficient. Only two or three joints are required for many of the applications, and pneumatically powered robots are often used. Also, delta robots are used for many high-speed picking and packaging operations.

A more complex example of material transfer is *palletizing*, in which the robot retrieves parts, cartons, or other objects from one location and deposits them onto a pallet or other container at multiple positions on the pallet. The problem is illustrated in Figure 8.11. Although the pickup point is the same for every cycle, the deposit location on the pallet is different for each carton. This adds to the degree of difficulty of the task. Either the robot must be taught each position on the pallet using the powered-leadthrough method (Section 8.5.1), or it must compute the location based on the dimensions of the pallet and the center distances between the cartons in both x - and y -directions, and in the z -direction if the pallet is stacked.

Other applications similar to palletizing include *depalletizing*, which consists of removing parts from an ordered arrangement in a pallet and placing them at another location (e.g., onto a moving conveyor); *stacking* operations, which involve placing flat parts on top of each other, such that the vertical location of the drop-off position is continuously changing with each cycle; and *insertion* operations, in which the robot inserts parts into the compartments of a divided carton.

Machine Loading and/or Unloading. In machine loading and/or unloading applications, the robot transfers parts into and/or from a production machine. The three possible cases are (1) machine loading, in which the robot loads parts into the production machine, but the parts are unloaded from the machine by some other means; (2) machine unloading, in which the raw materials are fed into the machine without using the robot, and

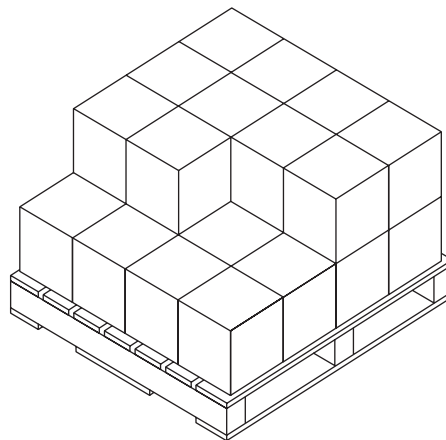


Figure 8.11 Typical part arrangement for a robot palletizing operation.

the robot unloads the finished parts; and (3) machine loading and unloading, which involves both loading of the raw work part and unloading of the finished part by the robot. Industrial robot applications of machine loading and/or unloading include the following processes:

- *Die casting.* The robot unloads parts from the die casting machine. Peripheral operations sometimes performed by the robot include dipping the parts into a water bath for cooling.
- *Plastic molding.* Plastic molding is similar to die casting. The robot unloads molded parts from the injection molding machine.
- *Metal machining operations.* The robot loads raw blanks into the machine tool and unloads finished parts from the machine. The change in shape and size of the part before and after machining often presents a problem in end effector design, and dual grippers (Section 8.3.1) are often used to deal with this issue.
- *Forging.* The robot typically loads the raw hot billet into the die, holds it during the forging strikes, and removes it from the forge hammer. The hammering action and the risk of damage to the die or end effector are significant technical problems.
- *Pressworking.* Human operators work at considerable risk in sheetmetal pressworking operations because of the action of the press. Robots are used to substitute for the workers to reduce the danger. In these applications, the robot loads the blank into the press, then the stamping operation is performed, and the part falls out of the machine into a container.
- *Heat-treating.* These are often relatively simple operations in which the robot loads and/or unloads parts from a furnace.

8.4.2 Processing Operations

In processing applications, the robot performs some operation on a work part, such as grinding or spray painting. A distinguishing feature of this category is that the robot is equipped with some type of tool as its end effector (Section 8.3.2). To perform the process, the robot must manipulate the tool relative to the part. Examples of industrial robot applications in the processing category include spot welding, arc welding, spray painting, and various machining and other rotating spindle processes.

Spot Welding. Spot welding is a metal joining process in which two sheet metal parts are fused together at localized points of contact. Two electrodes squeeze the metal parts together and then a large electrical current is applied across the contact point to cause fusion to occur. The electrodes, together with the mechanism that actuates them, constitute the welding gun in spot welding. Because of its widespread use in the automobile industry for car body fabrication, spot welding represents one of the most common applications of industrial robots today. The end effector is the spot welding gun used to pinch the car panels together and perform the resistance welding process. The welding gun used for automobile spot welding is typically heavy. Prior to the application of robots, human workers performed this operation, and the heavy welding tools were difficult for humans to manipulate accurately. As a consequence, there were many instances of missed welds, poorly located welds, and other defects, resulting in overall low quality of the finished product. The use of industrial robots in this application has dramatically improved the consistency of the welds.

Robots used for spot welding are usually large, with sufficient payload capacity to wield the heavy welding gun. Five or six axes are generally required to achieve the

required position and orientation of the welding gun. Playback robots with point-to-point control are used. Jointed-arm robots are the most common type in automobile spot-welding lines, which may consist of several dozen robots.

Arc Welding. Arc welding is used to provide continuous welds rather than individual spot welds at specific contact points. The resulting arc-welded joint is substantially stronger than in spot welding. Because the weld is continuous, it can be used in airtight pressure vessels and other weldments in which strength and continuity are required. There are various forms of arc welding, but they all follow the general description given here.

The working conditions for humans who perform arc welding are not good. The welder must wear a face helmet for eye protection against the ultraviolet light emitted by the arc welding process. The helmet window must be dark enough to mask the UV radiation. High electrical current is used in the welding process, and this creates a hazard for the welder. Finally, there is the obvious danger from the high temperatures in the process, high enough to melt the steel, aluminum, or other metal that is being welded. Significant hand-eye coordination is required by human welders to make sure that the arc follows the desired path with sufficient accuracy to make a good weld. This, together with the conditions described above, results in worker fatigue. Consequently, the welder is only accomplishing the welding process for perhaps 20–30% of the time. This *arc-on time* is defined as the proportion of time during the shift when the welding arc is on and performing the process. To assist the welder, a second worker is usually present at the work site, called a *fitter*, whose job is to set up the parts to be welded and to perform other similar chores in support of the welder.

Because of these conditions in manual arc welding, automation is used where technically and economically feasible. For welding jobs involving long continuous joints that are accomplished repetitively, mechanized welding machines have been designed to perform the process. These machines are used for long straight sections and regular round parts, such as pressure vessels, tanks, and pipes.

Industrial robots can also be used to automate the arc welding process. The cell consists of the robot, the welding apparatus (power unit, controller, welding tool, and wire feed mechanism), and a fixture that positions the components for the robot. The fixture might be mechanized with one or two axes so that it can present different portions of the work to the robot for welding (the term *positioner* is used for this type of fixture). For greater productivity, two fixtures are often used so that a human helper or another robot can unload the completed job and load the components for the next work cycle while the welding robot is simultaneously welding the present job. Figure 8.12 illustrates this kind of workplace arrangement.

The robot used in arc welding must be capable of continuous path control. Jointed-arm robots consisting of six joints are frequently used. Some robot vendors provide manipulators that have hollow upper arms, so that the cables connected to the welding torch can be contained in the arm for protection, rather than attached to the exterior. Also, programming improvements for arc welding based on CAD/CAM have made it much easier and faster to implement a robot welding cell. The weld path can be developed directly from the CAD model of the assembly [9].

Spray Coating. Spray coating directs a spray gun at the object to be coated. Fluid (e.g., paint) flows through the nozzle of the spray gun to be dispersed and applied over the surface of the object. Spray painting is the most common application in the category, but spray coating refers to a broader range of applications that includes painting.

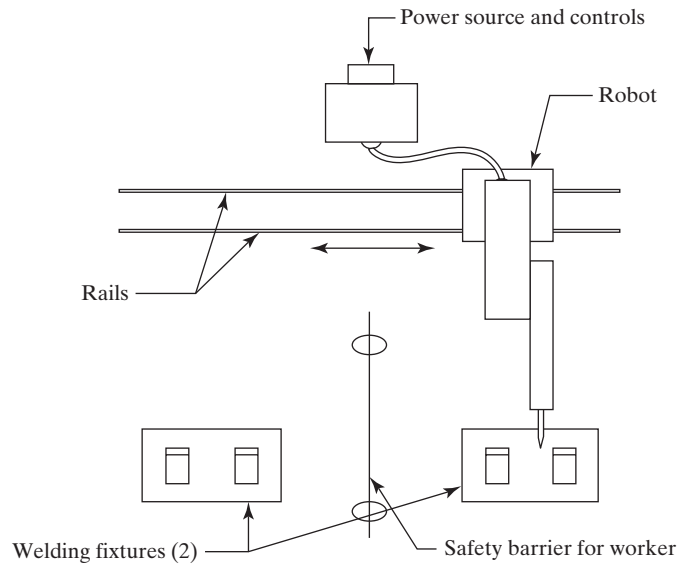


Figure 8.12 Robot arc welding cell in which the welding robot moves between welding fixtures on rails. A worker unloads the completed weldment and loads parts into one fixture while the robot performs the welding cycle at the other fixture.

The work environment for humans who perform this process is filled with health hazards. These hazards include harmful and noxious fumes in the air and noise from the spray gun nozzle. To mitigate these hazards, robots are being used more and more for spray coating tasks, particularly in high-production operations.

Robot applications include spray coating of automobile car bodies, appliances, engines, and other parts; spray staining of wood products; and spraying of porcelain coatings on bathroom fixtures. The robot must be capable of continuous path control to accomplish the smooth motion sequences required in spray painting. The most convenient programming method is manual leadthrough (Section 8.5.1). Jointed-arm robots seem to be the most common anatomy for this application. The robot must possess a work volume sufficient to access all areas of the work part to be coated in the application.

The use of industrial robots for spray coating offers a number of benefits in addition to protecting workers from a hazardous environment. These other benefits include greater uniformity in applying the coating than humans can accomplish, reduced waste of paint, lower needs for ventilating the work area because humans are not present during the process, and greater productivity.

Other Processing Applications. Spot welding, arc welding, and spray coating are common processing applications of industrial robots. The list of industrial processes that are being performed by robots is continually growing. Among these are the following:

- *Drilling, routing, and other machining processes.* These applications use a rotating spindle as the end effector. The cutting tool is mounted in the spindle chuck. One of the problems with this application is the high cutting forces encountered in machining. The robot must be strong enough to withstand these cutting forces and maintain the required accuracy of the cut.

- *Grinding, wire brushing, and similar operations.* Most of these operations use a rotating spindle as the end effector to drive a grinding wheel, wire brush, polishing wheel, or similar tool at high speed to accomplish finishing and deburring operations on the workpiece. In an alternative approach described in [13], the robot is equipped with a gripper to hold and manipulate the workpiece against a rotating deburring head.
- *Waterjet cutting.* This is a process in which a high-pressure stream of water is forced through a small nozzle at high speed to cut plastic sheets, fabrics, cardboard, and other materials with precision. The end effector is the waterjet nozzle that is directed to follow the desired cutting path by the robot.
- *Laser cutting.* The function of the robot in this application is similar to its function in waterjet cutting. Laser beam welding is a similar application. The laser gun is attached to the robot as its end effector. In an application described in [6], robots are used to trim excess sheet metal from parts produced in hot stamping operations. The hot-stamped sheet metal is too hard to trim with conventional cutting dies, so laser cutting must be used.

8.4.3 Assembly and Inspection

In some respects, assembly and inspection are hybrids of the previous two categories: material handling and processing. Assembly and inspection can involve either the handling of materials or the manipulation of a tool. For example, assembly operations typically involve the addition of components to build a product. This requires the movement of parts from a supply location in the workplace to the product being assembled, which is material handling. In some cases, the fastening of the components requires a tool to be used by the robot (e.g., driving a screw). Similarly, some robot inspection operations require that parts be manipulated, while other applications require that an inspection tool be manipulated.

Traditionally, assembly and inspection are labor-intensive activities. They are also highly repetitive and usually boring. For these reasons, they are logical candidates for robotic applications. However, assembly work typically involves diverse and sometimes difficult tasks, often requiring adjustments to be made in parts that don't quite fit together. A sense of feel is often required to achieve a close fitting of parts. Inspection work requires high precision and patience, and human judgment is often needed to determine whether a product is within quality specifications or not. Because of these complications in both types of work, the application of robots has not been easy. Nevertheless, the potential rewards are so great that substantial efforts have been made to develop the necessary technologies to achieve success in these applications.

Assembly. Assembly involves the combining of two or more parts to form a new entity, called a subassembly or assembly. The new entity is made secure by fastening the parts together using mechanical fastening techniques (e.g., screws, bolts and nuts, rivets) or joining processes (e.g., welding, brazing, soldering, or adhesive bonding). Welding applications have already been discussed.

Because of the economic importance of assembly, automated methods are often applied. Fixed automation is appropriate in mass production of relatively simple products, such as pens, mechanical pencils, cigarette lighters, and garden hose nozzles. Robots are usually at a disadvantage in these high-production situations because they cannot operate at the high speeds that fixed-automated equipment can. The most appealing application

of industrial robots for assembly involves situations in which a mix of similar models are produced in the same work cell or assembly line. Examples of these kinds of products include electric motors, small appliances, and various other small mechanical and electrical products. In these instances, the basic configuration of the different models is the same, but there are variations in size, geometry, options, and other features. Such products are often made in batches on manual assembly lines. However, the pressure to reduce inventories makes mixed-model assembly lines (Appendix 15A.2) more attractive. Robots can be used to substitute for some or all of the manual stations on these lines. What makes robots viable in mixed-model assembly is their capability to execute programmed variations in the work cycle to accommodate different product configurations.

Industrial robots used for the types of assembly operations described here are typically small, with light load capacities. The most common configurations are jointed arm, SCARA, and Cartesian coordinate. Accuracy and repeatability requirements in assembly work are often more demanding than in other robot applications, and the more precise robots in this category have repeatabilities of ± 0.05 mm (± 0.002 in). In addition, the requirements of the end effector are sometimes difficult. It may have to perform multiple functions at a single workstation to reduce the number of robots required in the cell. These functions may include handling more than one part geometry and performing both as a gripper and an assembly tool.

Inspection. There is often a need in automated production to inspect the work that is done. Inspections accomplish the following functions: (1) making sure that a given process has been completed, (2) ensuring that parts have been assembled as specified, and (3) identifying flaws in raw materials and finished parts. The topic of automated inspection is considered in more detail in Chapter 21. The purpose here is to identify the role played by industrial robots in inspection. Inspection tasks performed by robots can be divided into the following two cases:

1. The robot performs loading and unloading to support an inspection or testing machine. This case is really machine loading and unloading, where the machine is an inspection machine. The robot picks parts (or assemblies) that enter the cell, loads and unloads them to carry out the inspection process, and places them at the cell output. In some cases, the inspection may result in sorting of parts that must be accomplished by the robot. Depending on the quality level of the parts, the robot places them in different containers or on different exit conveyors.
2. The robot manipulates an inspection device, such as a mechanical probe or vision sensor, to inspect the product. This case is similar to a processing operation in which the end effector attached to the robot's wrist is the inspection probe. To perform the process, the part is delivered to the workstation in the correct position and orientation, and the robot must manipulate the inspection device as required.

8.4.4 Economic Justification of Industrial Robots

One of the earliest installations of an industrial robot was in 1961 in a die casting operation (Historical Note 8.1). The robot was used to unload castings from the die casting machine. The typical environment in die casting is not pleasant for humans due to the heat and fumes emitted by the casting process. It seemed desirable to use a robot in this type of work environment instead of a human operator.

Characteristics of Robot Applications. The general characteristics of industrial work situations that tend to promote the substitution of robots for human labor are the following:

1. *Hazardous work for humans.* When the work and the environment in which it is performed are hazardous, unsafe, unhealthful, uncomfortable, or otherwise unpleasant for humans, an industrial robot should be considered for the task. In addition to die casting, there are many other work situations that are hazardous or unpleasant for humans, including spray painting, arc welding, and spot welding. Industrial robots are applied in all of these processes.
2. *Repetitive work cycle.* A second characteristic that tends to promote the use of robotics is a repetitive work cycle. If the sequence of motion elements in the work cycle is the same, or nearly the same, a robot is usually capable of performing the cycle with greater consistency and repeatability than a human worker. Greater consistency and repeatability are manifested as higher product quality than what can be achieved in a manual operation.
3. *Difficult handling for humans.* If the task involves the handling of parts or tools that are heavy or otherwise difficult to manipulate, an industrial robot may be available that can perform the operation. Parts or tools that are too heavy for humans to handle conveniently are well within the load-carrying capacity of a large robot.
4. *Multishift operation.* In manual operations requiring second and third shifts, substitution of a robot provides a much faster financial payback than a single shift operation. Instead of replacing one worker, the robot replaces two or three workers.
5. *Infrequent changeovers.* Most batch or job shop operations require a changeover of the physical workplace between one job and the next. The time required to make the changeover is nonproductive time because parts are not being made. Consequently, robots have traditionally been easier to justify for relatively long production runs where changeovers are infrequent. Advances have been made in robot technology to reduce programming time, and shorter production runs have become more economical.
6. *Part position and orientation are established in the work cell.* Most robots in today's industrial applications do not possess vision capability. Their capacity to pick up a part or manipulate a tool during each work cycle relies on the work unit being in a known position and orientation. The work unit must be presented to the robot at the same location each cycle.⁵

Cycle Time and Cost Analysis. The cycle time and cost of a proposed robotic application can be analyzed using the methods of Chapter 3. Restating the basic cycle time equation, Equation (3.1):

$$T_c = T_o + T_h + T_t \quad (8.1)$$

where T_c = cycle time, min/pc; T_o = time of the actual processing or assembly operation, min/pc; T_h = work part handling time, min/pc; and T_t = average tool handling time,

⁵As mentioned in Section 8.1.4, many of the robots installed today are equipped with vision capability or are vision-compatible, meaning that their controllers have the software to readily integrate vision into the work cycle. Vision capability reduces the need for the work unit to be in a known position and orientation.

min/pc, if such an activity is applicable. Most robot applications involve either some form of material handling (Section 8.4.1) or a processing operation (Section 8.4.2). Assembly and inspection applications (Section 8.4.3) can be included within these two categories.

As indicated in Section 8.4.1, material handling applications include (1) material transfer, in which case Equation (8.1) reduces to $T_c = T_h$, or (2) machine loading and/or unloading, in which the robot is used to support a principal production machine performing the actual processing operation. In the second case, the robot's participation in the work cycle is T_h , and the production machine consists of T_o and possibly T_t , depending on the type of process.

If the robot application consists of a processing operation, in which the robot manipulates some tool as its end effector, then the robot is the principal production machine, and Equation (8.1) is probably a representative model for the work cycle. Work part handling is performed by support equipment, perhaps another robot or a human worker as a last resort.

The production rate of a robotic cell is based on the average production time, which must include the time to set up the cell.

$$T_p = \frac{T_{su} + QT_c}{Q} \quad (8.2)$$

where T_p = average production time per work unit, min; T_{su} = setup time, min; and Q = quantity of work units produced in the production run. The setup time must include the on-site time to program the robot in addition to the other physical setup activities prior to the actual production run. Production rate is the reciprocal of average production time:

$$R_p = \frac{60}{T_p} \quad (8.3)$$

where R_p is expressed in work units per hour, pc/hr. For long-running jobs, R_p approaches the cycle rate R_c , which is the reciprocal of T_c . That is, as Q becomes very large ($T_{su}/Q \rightarrow 0$) and

$$R_p \rightarrow R_c = \frac{60}{T_c} \quad (8.4)$$

where R_c = operation cycle rate of the machine, pc/hr; and T_c = operation cycle time, min/pc, from Equation (8.1).

EXAMPLE 8.1 Robot Cycle Time Analysis

An articulated robot loads and unloads parts in a CNC (computer numerical control) machine cell in a high production run (assume setup time can be neglected). The machine tool operates on semiautomatic cycle which is coordinated with the robot using interlocks. The programmed machining cycle takes 2.25 min. Cutting tools wear out and must be periodically changed, which takes 5.0 min every 25 cycles and is performed by a human worker. At the end of each machining cycle, the robot reaches into the machine and removes the just-completed part, places it in a tote pan, then reaches for a starting work part from another tote pan and places it in the machine tool

chuck. This sequence of handling activities takes 30 sec. Tote pans are exchanged every 20 work cycles by the same worker who changes tools, but there is no lost production time. Determine (a) the average production time and (b) production rate of the cell.

Solution: (a) Changing cutting tools involves lost production time. On a per cycle basis, $T_i = 5.0/25 = 0.20$ min.

Average production time $T_p = T_c = T_o + T_h + T_i = 2.25 + 30/60 + 0.20 = \mathbf{2.95 \text{ min/pc}}$

(b) Production rate $R_p = 60/2.95 = \mathbf{20.34 \text{ pc/hr}}$

The costs of operating a robot cell divide into fixed and variable costs, where fixed costs are associated with equipment and variable costs include labor, raw materials, and power to operate the equipment. Total cost of the cell is the sum of the two categories:

$$TC = C_f + C_v Q \quad (8.5)$$

where TC = total annual cost, \$/yr; C_f = fixed annual cost, \$/yr; C_v = variable cost, \$/pc; and Q = annual quantity produced, pc/yr. A break-even analysis can be used to compare alternatives such as a manually operated work cell versus a robotic cell, similar to Example 3.5. The cost of the robot and other equipment in the cell can be reduced to an hourly rate using the methods of Section 3.2.3.

8.5 ROBOT PROGRAMMING

To accomplish useful work, a robot must be programmed to perform a motion cycle. A **robot program** can be defined as a path in space to be followed by the manipulator, combined with peripheral actions that support the work cycle. Examples of peripheral actions include opening and closing a gripper, performing logical decision making, and communicating with other pieces of equipment in the cell. A robot is programmed by entering the programming commands into its controller memory. Different robots use different methods of entering the commands.

In the case of limited-sequence robots, programming is accomplished by setting limit switches and mechanical stops to control the endpoints of its motions. The sequence in which the motions occur is regulated by a sequencing device. This device determines the order in which each joint is actuated to form the complete motion cycle. Setting the stops and switches and wiring the sequencer is more akin to a manual setup than programming.

Today, nearly all industrial robots have digital computers as their controllers, and compatible storage devices as their memory units. For these robots, three programming methods can be distinguished: (1) leadthrough programming, (2) computer-like robot programming languages, and (3) off-line programming.

8.5.1 Leadthrough Programming

Leadthrough programming dates from the early 1960s before computer control was prevalent. The same basic methods are used today for many computer-controlled robots. In leadthrough programming, the task is taught to the robot by moving the manipulator

through the required motion cycle, simultaneously entering the program into the controller memory for subsequent playback.

Powered Leadthrough and Manual Leadthrough. There are two methods of performing the leadthrough teach procedure: (1) powered leadthrough and (2) manual leadthrough. The difference between the two is in the manner in which the manipulator is moved through the motion cycle during programming. Powered leadthrough is commonly used as the programming method for playback robots with point-to-point control. It involves the use of a teach pendant (handheld control box) that has toggle switches and/or contact buttons for controlling the movement of the manipulator joints. Using the toggle switches or buttons, the programmer power-drives the robot arm to the desired positions, in sequence, and records the positions into memory. During subsequent playback, the robot moves through the sequence of positions under its own power.

Manual leadthrough is convenient for programming playback robots with continuous path control where the continuous path is an irregular motion pattern such as in spray painting. This programming method requires the operator to physically grasp the tool attached to the end of the arm and move it through the motion sequence, recording the path into memory. Because the robot arm itself may have significant mass and would therefore be difficult to move, a special programming device often substitutes for the actual robot during the teach procedure. The programming device has the same joint configuration as the robot and is equipped with a trigger handle (or other control switch), which the operator activates when recording motions into memory. The motions are recorded as a series of closely spaced points. During playback, the path is recreated by controlling the actual robot arm through the same sequence of points.

Motion Programming. The leadthrough methods provide a very natural way to program motion commands into the robot controller. In manual leadthrough, the operator simply moves the arm through the required path to create the program. In powered leadthrough, the operator uses a handheld teach pendant to drive the manipulator. The programmer moves the various joints of the manipulator to the required positions in the work space by activating the switches or buttons of the teach pendant in a coordinated fashion.

Coordinating the individual joints with the teach pendant is an awkward and tedious way to enter motion commands to the robot. For example, it is difficult to coordinate the individual joints of an articulated robot (TRR configuration) to drive the end-of-arm in a straight-line motion. Therefore, many robots using powered leadthrough provide two alternative methods for controlling movement of the entire manipulator during programming, in addition to controls for individual joints. With these methods, the programmer can move the robot's wrist end in straight line paths. The names given to these alternatives are (1) world-coordinate system and (2) tool-coordinate system. Both systems make use of Cartesian coordinates. In a world-coordinate system, the origin and axes are defined relative to the robot base, as illustrated in Figure 8.13(a). In a tool-coordinate system, Figure 8.13(b), the alignment of the axis system is defined relative to the orientation of the wrist faceplate (to which the end effector is attached). In this way, the programmer can orient the tool in a desired way and then control the robot to make linear moves in directions parallel or perpendicular to the tool.

The world- and tool-coordinate systems are useful only if the robot has the capacity to move its wrist end in a straight line motion, parallel to one of the axes of the coordinate system. Straight line motion is quite natural for a Cartesian coordinate robot (LOO configuration) but unnatural for robots with any combination of rotational

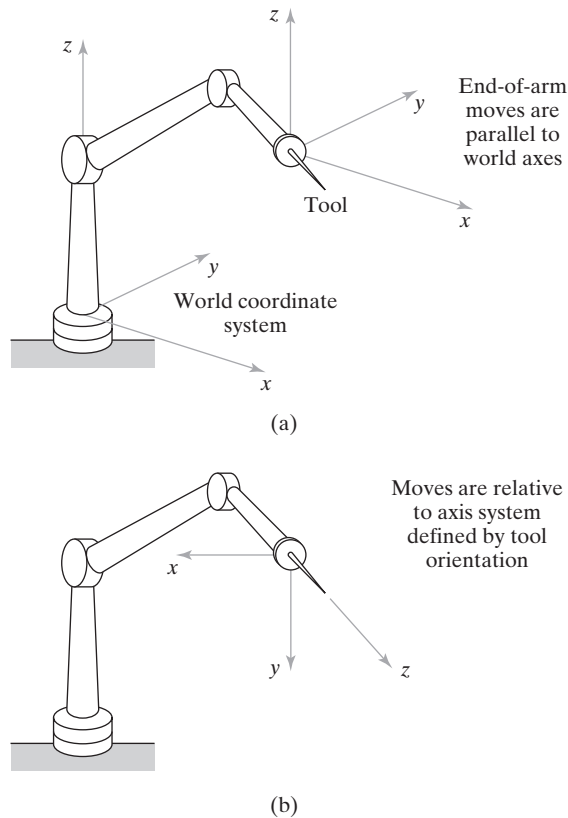


Figure 8.13 (a) World-coordinate system.
(b) Tool-coordinate system.

joints (types R, T, and V). Accomplishing straight line motion requires manipulators with these types of joints to carry out a linear interpolation process. In **straight line interpolation**, the control computer calculates the sequence of addressable points in space through which the wrist end must move to achieve a straight line path between two points.

Other types of interpolation are available. More common than straight line interpolation is joint interpolation. When a robot is commanded to move its wrist end between two points using **joint interpolation**, it actuates each of the joints simultaneously at its own constant speed such that all of the joints start and stop at the same time. The advantage of joint interpolation over straight line interpolation is that usually less total motion energy is required to make the move. This may mean that the move could be made in slightly less time. It should be noted that in the case of a Cartesian coordinate robot, joint interpolation and straight line interpolation result in the same motion path.

Still another form of interpolation is used in manual-leadthrough programming. In this case, the robot must follow the sequence of closely spaced points that are defined during the programming procedure. In effect, this is an interpolation process for a path that usually consists of irregular smooth motions, such as in spray painting.

The speed of the robot is controlled by means of a dial or other input device, located on the teach pendant and/or the main control panel. Certain motions in the work cycle should be performed at high speed (e.g., moving parts over substantial distances in the cell), while other motions require low speed (e.g., motions that require high precision in positioning the work part). Speed control also permits a given program to be tried out at a safe slow speed and then used at a higher speed during production.

Advantages and Disadvantages. The advantage offered by the leadthrough methods is that they can be readily learned by shop personnel. Programming the robot by moving its arm through the required motion path is a logical way for someone to teach the work cycle. It is not necessary for the robot programmer to possess knowledge of computer programming. The robot languages described in the next section, especially the more advanced languages, are more easily learned by someone whose background includes computer programming.

There are several inherent disadvantages of the leadthrough programming methods. First, regular production must be interrupted during the leadthrough programming procedures. In other words, leadthrough programming results in downtime of the robot cell or production line. The economic consequence of this is that the leadthrough methods are most appropriate for relatively long production runs and are less appropriate for small batch sizes.

Second, the teach pendant used with powered leadthrough and the programming devices used with manual leadthrough are limited in terms of the decision-making logic that can be incorporated into the program. It is much easier to write logical instructions using a computer-like robot language than a leadthrough method.

Third, because the leadthrough methods were developed before computer control became common for robots, these methods are not readily compatible with modern computer-based technologies such as CAD/CAM, manufacturing databases, and local communications networks. The capability to readily interface the various computer-automated subsystems in the factory for transfer of data is considered a requirement for achieving computer integrated manufacturing.

8.5.2 Robot Programming Languages

The use of textual programming languages became an appropriate programming method as digital computers took over the control function in robotics. Their use has been stimulated by the increasing complexity of the tasks that robots are called on to perform, with the concomitant need to imbed logical decisions into the robot work cycle. These computer-like programming languages are really a combination of on-line and off-line methods, because the robot must still be taught its locations using the leadthrough method. Textual programming languages for robots provide the opportunity to perform the following functions that leadthrough programming cannot readily accomplish:

- Enhanced sensor capabilities, including the use of analog as well as digital inputs and outputs
- Improved output capabilities for controlling external equipment
- Program logic that is beyond the capabilities of leadthrough methods
- Computations and data processing similar to computer programming languages
- Communications with other computer systems.

This section reviews some of the capabilities of the robot programming languages. Many of the language statements are taken from commercially available robot languages.

Motion Programming. Motion programming with robot languages usually requires a combination of textual statements and leadthrough techniques. Accordingly, this method of programming is sometimes referred to as *on-line/off-line programming*. The textual statements are used to describe the motion, and the leadthrough methods are used to define the position and orientation of the robot during and/or at the end of the motion. To illustrate, the basic motion statement is

MOVE P1

which commands the robot to move from its current position to a position and orientation defined by the variable name P1. The point P1 must be defined, and the most convenient way to define P1 is to use either powered leadthrough or manual leadthrough to place the robot at the desired point and record that point into memory. Statements such as

HERE P1

or

LEARN P1

are used in the leadthrough procedure to indicate the variable name for the point. What is recorded into the robot's control memory is the set of joint positions or coordinates used by the controller to define the point. For example, the aggregate

(236, 158, 65, 0, 0, 0)

could be utilized to represent the joint positions for a six-axis manipulator. The first three values (236, 158, 65) give the joint positions of the body-and-arm, and the last three values (0, 0, 0) define the wrist joint positions. The values are specified in millimeters or degrees, depending on the joint types.

There are variants of the MOVE statement. These include the definition of straight line interpolation motions, incremental moves, approach and depart moves, and paths. For example, the statement

MOVES P1

denotes a move that is to be made using straight line interpolation. The suffix S on MOVE designates straight line motion.

An incremental move is one whose endpoint is defined relative to the current position of the manipulator rather than to the absolute coordinate system of the robot. For example, suppose the robot is presently at a point defined by the joint coordinates (236, 158, 65, 0, 0, 0), and it is desired to move joint 4 (corresponding to a twisting motion of the wrist) from 0 to 125. The following form of statement might be used to accomplish this move:

DMOVE (4, 125)

The new joint coordinates of the robot would therefore be given by (236, 158, 65, 125, 0, 0). The prefix D is interpreted as delta, so DMOVE represents a delta move, or incremental move.

Approach and depart statements are useful in material handling operations. The APPROACH statement moves the gripper from its current position to within a certain

distance of the pickup (or drop-off) point, and then a MOVE statement positions the end effector at the pickup point. After the pickup is made, a DEPART statement moves the gripper away from the point. The following statements illustrate the sequence:

```
APPROACH P1, 40 MM
MOVE P1
(command to actuate gripper)
DEPART 40 MM
```

The destination is point P1, but the APPROACH command moves the gripper to a safe distance (40 mm) above the point. This might be useful to avoid obstacles such as other parts in a tote pan. The orientation of the gripper at the end of the APPROACH move is the same as that defined for point P1, so that the final MOVE P1 is really a spatial translation of the gripper. This permits the gripper to be moved directly to the part for grasping.

A path in a robot program is a series of points connected together in a single move. The path is given a variable name, as illustrated in the following statement:

```
DEFINE PATH123 = PATH(P1,P2,P3)
```

This is a path that consists of points P1, P2, and P3. The points are defined in the manner described above using HERE or LEARN statements. A MOVE statement is used to drive the robot through the path.

```
MOVE PATH123
```

The speed of the robot is controlled by defining either a relative velocity or an absolute velocity. The following statement represents the case of relative velocity definition:

```
SPEED 75
```

When this statement appears within the program, it is typically interpreted to mean that the manipulator should operate at 75% of the initially commanded velocity in the statements that follow in the program. The initial speed is given in a command that precedes the execution of the robot program. For example,

```
SPEED 0.5 MPS
EXECUTE PROGRAM1
```

indicates that the program named PROGRAM1 is to be executed by the robot at a speed of 0.5 m/sec.

Interlock and Sensor Commands. The two basic interlock commands (Section 5.3.2) used for industrial robots are WAIT and SIGNAL. The WAIT command is used to implement an input interlock. For example,

```
WAIT 20, ON
```

would cause program execution to stop at this statement until the input signal coming into the robot controller at port 20 was in an “on” condition. This might be used in a situation where the robot needed to wait for the completion of an automatic machine cycle in a loading and unloading application.

The SIGNAL statement is used to implement an output interlock. This is used to communicate to some external piece of equipment. For example,

SIGNAL 21, ON

would switch on the signal at output port 21, perhaps to actuate the start of an automatic machine cycle.

The above interlock commands represent situations where the execution of the statement occurs at the point in the program where the statement appears. There are other situations in which it is desirable for an external device to be continuously monitored for any change that might occur. This would be useful, for example, in safety monitoring where a sensor is set up to detect the presence of humans who might wander into the robot's work volume. The sensor reacts to the presence of the humans by signaling the robot controller. The following type of statement might be used for this case:

REACT 25, SAFESTOP

This command would be written to continuously monitor input port 25 for any changes in the incoming signal. If and when a change in the signal occurs, regular program execution is interrupted, and control is transferred to a subroutine called SAFESTOP. This subroutine would stop the robot from further motion and/or cause some other safety action to be taken.

Although end effectors are attached to the wrist of the manipulator, they are actuated very much like external devices. Special commands are usually written for controlling the end effector. In the case of grippers, the basic commands are

OPEN

and

CLOSE

which cause the gripper to actuate to fully open and fully closed positions, respectively, where fully closed is the position for grasping the object in the application. Greater control over the gripper is available in some sensed and servo-controlled hands. For grippers with force sensors that can be regulated through the robot controller, a command such as

CLOSE 2.0 N

controls the closing of the gripper until a 2.0-N force is encountered by the gripper fingers. A similar command used to close the gripper to a given opening width is

CLOSE 25 MM

A special set of statements is often required to control the operation of tool-type end effectors, such as spot welding guns, arc welding tools, spray painting guns, and powered spindles (e.g., for drilling or grinding). Spot welding and spray painting controls are typically simple binary commands (e.g., open/close and on/off), and these commands would be similar to those used for gripper control. In the case of arc welding and powered spindles, a greater variety of control statements is needed to control feed rates and other parameters of the operation.

Computations and Program Logic. Many robot languages possess capabilities for performing computations and data processing operations that are similar to

computer programming languages. Most robot applications do not require a high level of computational power. As the sophistication of applications increases in the future, the computing and data processing duties of the controller will also increase for functions such as calculating complex motion paths, decision making, and integrating with other computer systems.

Many of today's robot applications require the use of branches and subroutines in the program. Statements such as

GO TO 150

and

IF (logical expression) GO TO 150

cause the program to branch to some other statement in the program (e.g., to statement number 150 in the above illustrations).

A subroutine in a robot program is a group of statements that are to be executed separately when called from the main program. In a preceding example, the subroutine SAFESTOP was named in the REACT statement for use in safety monitoring. Other uses of subroutines include making calculations or performing repetitive motion sequences at a number of different places in the program. Using a subroutine is more efficient than writing the same steps several places in the program.

8.5.3 Simulation and Off-Line Programming

The trouble with leadthrough methods and textual programming techniques is that the robot must be taken out of production for a certain length of time to accomplish the programming. Off-line programming permits the robot program to be prepared at a remote computer terminal and downloaded to the robot controller for execution without interrupting production. In true off-line programming, there is no need to physically locate the positions in the workspace for the robot as required with present textual programming languages. Some form of graphical computer simulation is required to validate the programs developed off-line, similar to the off-line procedures used in NC part programming.

The off-line programming procedures that are commercially available use graphical simulation to construct a three-dimensional model of the robot cell for evaluation and off-line programming. The cell might consist of the robot, machine tools, conveyors, and other hardware. The simulator displays these cell components on the graphics monitor and shows the robot performing its work cycle in animated computer graphics. After the program has been developed using the simulation procedure, it is then converted into the textual language corresponding to the particular robot employed in the cell. This is a step in off-line robot programming that is equivalent to post-processing in NC part programming.

In off-line programming, some adjustment must be performed to account for geometric differences between the three-dimensional model in the computer and the actual physical cell. For example, the position of a machine tool chuck in the physical layout might be slightly different than in the model used to do the off-line programming. For the robot to reliably load and unload the machine, it must have an accurate location of the load/unload point recorded in its control memory. A calibration procedure is used to correct the three-dimensional computer model by substituting actual location data from the cell for the approximate values developed in the original model. The disadvantage of calibrating the cell is that some production time is lost in performing this procedure.

8.6 ROBOT ACCURACY AND REPEATABILITY

The capacity of a robot to position and orient the end of its wrist with accuracy and repeatability is an important control attribute in nearly all industrial applications. Some assembly applications require that objects be located within 0.05 mm (0.002 in). Other applications, such as spot welding, usually require accuracies of 0.5–1.0 mm (0.020–0.040 in). Several terms must be defined in the context of this discussion: (1) control resolution, (2) accuracy, and (3) repeatability. These terms have the same basic meanings in robotics as they have in numerical control (Section 7.4.3). In robotics, the characteristics are defined at the end of the wrist and in the absence of any end effector attached to the wrist.

Control resolution refers to the capability of the robot's positioning system to divide the range of the joint into closely spaced points, called *addressable points*, to which the joint can be moved by the controller. Recall from Section 7.4.3 that the capability to divide an axis range into addressable points depends on (1) limitations of the electromechanical components that make up each joint-link combination and (2) the controller's bit storage capacity for that joint.

If the joint is linear (type L) or orthogonal (type O) and consists of a leadscrew or ball screw drive mechanism, then the same methods used for an NC positioning system can be used to determine the control resolution for the robot's linear axis, CR_1 . However, determining CR_1 for a robot manipulator is confounded by the fact that there is a wider variety of joint types used in robotics than in NC machine tools. And it is not possible to analyze the mechanical details of all of the types here. Let it suffice to recognize that there is a mechanical limit on the capacity to divide the range of each joint-link system into addressable points, and that this limit is given by CR_1 .

The second limit on control resolution is the bit storage capacity of the controller. If B = the number of bits in the bit storage register devoted to a particular joint, then the number of addressable points in that joint's range of motion is given by 2^B . The control resolution is therefore defined as the distance between adjacent addressable points. This can be determined as

$$CR_2 = \frac{R}{2^B - 1} \quad (8.6)$$

where CR_2 = control resolution determined by the robot controller; and R = range of the joint-link combination, expressed in linear or angular units, depending on whether the joint provides a linear motion or a rotary motion. The control resolution of each joint-link mechanism will be the maximum of CR_1 and CR_2 , that is,

$$CR = \text{Max}\{CR_1, CR_2\} \quad (8.7)$$

In the discussion of NC control resolution, it was noted that it is desirable for $CR_2 \leq CR_1$, which means that the limiting factor in determining control resolution is the mechanical system, not the computer control system. Because the mechanical structure of a robot manipulator is much less rigid than that of a machine tool, the control resolution for each joint of a robot will almost certainly be determined by mechanical factors (CR_1).

Similar to the case of an NC positioning system, the ability of a robot manipulator to position any given joint-link mechanism at the exact location defined by an addressable point is limited by mechanical errors in the joint and associated links. The mechanical errors arise from factors such as gear backlash, link deflection, hydraulic fluid leaks, and various other sources that depend on the mechanical construction of the given joint-link combination. If the mechanical errors can be characterized by a normal distribution

with mean μ at the addressable point and standard deviation σ defining the magnitude of the error dispersion, then the accuracy and repeatability of the axis can be determined.

Repeatability is the easier term to define. **Repeatability** is a measure of the robot's ability to position its end-of-wrist at a previously taught point in the work volume. Each time the robot attempts to return to the programmed point it will return to a slightly different position. Repeatability variations have as their principal source the mechanical errors previously mentioned. Therefore, as in NC, for a single joint-link mechanism,

$$Re = \pm 3\sigma \quad (8.8)$$

where σ = standard deviation of the error distribution.

Accuracy is the robot's ability to position the end of its wrist at a desired location in the work volume. For a single axis, using the same reasoning as in NC,

$$Ac = \frac{CR}{2} + 3\sigma \quad (8.9)$$

where CR = control resolution from Equation (8.7). Control resolution, accuracy, and repeatability are illustrated in Figure 7.14 for one axis that is linear. For a rotary joint, these parameters can be conceptualized as either an angular value of the joint itself or an arc length at the end of the joint's output link.

EXAMPLE 8.2 Control Resolution, Accuracy, and Repeatability in Robotic Arm Joint

One of the joints of an industrial robot has a type R joint with a range of 90° . The bit storage capacity of the robot controller is 10 bits for this joint. The mechanical errors form a normally distributed random variable about a given taught point. The mean of the distribution is zero and the standard deviation is 0.05° . (a) Determine the control resolution CR_2 , accuracy, and repeatability for this robot joint. (b) Also, if the output link has a length of 0.75 m, determine the linear distance corresponding to CR_2 , accuracy, and repeatability at the end of the link.

Solution: (a) The number of addressable points in the joint range is $2^{10} = 1,024$. The control resolution is therefore

$$CR_2 = \frac{90}{1,024 - 1} = \mathbf{0.088^\circ}$$

$$Ac = \frac{0.088}{2} + 3(0.05) = \mathbf{0.194^\circ}$$

$$Re = 3 \times 0.05 = \mathbf{0.15^\circ}$$

(b) To determine the linear distances of the three precision measures, angular degrees must be converted to radians and then multiplied by the link length of 0.75 m.

$$CR_2 = 0.088(2\pi/360)(0.75 \text{ m}) = 0.00115 \text{ m} = \mathbf{1.15 \text{ mm}}$$

$$Ac = 0.194(2\pi/360)(0.75 \text{ m}) = 0.00254 \text{ m} = \mathbf{2.54 \text{ mm}}$$

$$Re = 0.15(2\pi/360)(0.75 \text{ m}) = 0.00196 \text{ m} = \mathbf{1.96 \text{ mm}}$$



The definitions of control resolution, accuracy, and repeatability have been depicted using a single joint or axis. To be of practical value, the accuracy and repeatability of a robot manipulator should include the effect of all of the joints, combined with the effect of their mechanical errors. For a multiple-axis robot, accuracy and repeatability will vary depending on where in the work volume the end-of-wrist is positioned. The reason for this is that certain joint combinations will tend to magnify the effect of the control resolution and mechanical errors. For example, for a polar configuration robot (TRL) with its linear joint fully extended, any errors in the R or T joints will be larger than when the linear joint is fully retracted.

Robots move in three-dimensional space, and the distribution of repeatability errors is therefore three-dimensional. In three dimensions, the normal distribution can be conceptualized as a sphere whose center (mean) is at the programmed point and whose radius is equal to three standard deviations of the repeatability error distribution. For conciseness, repeatability is usually expressed in terms of the radius of the sphere: for example, ± 1.0 mm (± 0.040 in). Some of today's small assembly robots have repeatability values as low as ± 0.05 mm (± 0.002 in).

In reality, the shape of the error distribution will not be a perfect sphere in three dimensions. In other words, the errors will not be isotropic. Instead, the radius will vary because the associated mechanical errors will be different in certain directions than in others. The mechanical arm of a robot is more rigid in certain directions, and this rigidity influences the errors. Also, the so-called sphere will not remain constant in size throughout the robot's work volume. As with control resolution, it will be affected by the particular combination of joint positions of the manipulator. In some regions of the work volume, the repeatability errors will be larger than in other regions.

Accuracy and repeatability have been defined earlier as static parameters of the manipulator. However, these precision parameters are affected by the dynamic operation of the robot. Characteristics such as speed, payload, and direction of approach will affect the robot's accuracy and repeatability.

REFERENCES

- [1] COLESTOCK, H., *Industrial Robotics: Selection, Design, and Maintenance*, McGraw-Hill, New York, 2004.
- [2] CRAIG, J. J., *Introduction to Robotics: Mechanics and Control*, 3rd ed., Pearson Education, Upper Saddle River, NJ, 2004.
- [3] CRAWFORD, K. R., "Designing Robot End Effectors," *Robotics Today*, October 1985, pp. 27–29.
- [4] ENGELBERGER, J. F., *Robotics in Practice*, AMACOM (American Management Association), New York, 1980.
- [5] GROOVER, M. P., M. WEISS, R. N. NAGEL, and N. G. ODREY, *Industrial Robotics: Technology, Programming, and Applications*, McGraw-Hill, New York, 1986.
- [6] HIXON, D., "Robotics Cut New Path in Hot Metals Stamping," *Manufacturing Engineering*, June 2012, pp. 69–74.
- [7] NIEVES, E., "Robots: More Capable, Still Flexible," *Manufacturing Engineering*, May 2005, pp. 131–143.
- [8] SCHREIBER, R. R., "How to Teach a Robot," *Robotics Today*, June 1984, pp. 51–56.
- [9] SPROVIERI, J., "Arc Welding with Robots," *Assembly*, July 2006, pp. 26–31.
- [10] TOEPPERWEIN, L. L., M. T. BLACKMAN, et al., "ICAM Robotics Application Guide," *Technical Report AFWAL-TR-80-4042*, Vol. II, Material Laboratory, Air Force Wright Aeronautical Laboratories, OH, April 1980.

- [11] WAURZYNIAK, P., “Robotics Evolution,” *Manufacturing Engineering*, February 1999, pp. 40–50.
- [12] WAURZYNIAK, P., “Masters of Manufacturing: Joseph F. Engelberger,” *Manufacturing Engineering*, July 2006, pp. 65–75.
- [13] WAURZYNIAK, P., “Flexible Automation for Automotive,” *Manufacturing Engineering*, September 2012, pp. 103–112.
- [14] www.abb.com/robotics
- [15] www.fanucrobotics.com
- [16] www.ifr.org/industrial-robots
- [17] www.kuka-robotics.com
- [18] www.wikipedia.org/wiki/Delta_robot
- [19] www.wikipedia.org/wiki/Industrial_robot
- [20] ZENS, R. G., Jr., “Guided by Vision,” *Assembly*, September 2005, pp. 52–58.

REVIEW QUESTIONS

- 8.1 What is an industrial robot?
- 8.2 What was the first application of an industrial robot?
- 8.3 What are the five joint types used in robotic arms and wrists?
- 8.4 Name the common body-and-arm configurations identified in the text.
- 8.5 What is the work volume of a robot manipulator?
- 8.6 Robotic sensors are classified as internal and external. What is the distinction?
- 8.7 What is a playback robot with point-to-point control?
- 8.8 What is an end effector?
- 8.9 In a machine loading and unloading application, what is the advantage of a dual gripper over a single gripper?
- 8.10 What are the general characteristics of industrial work situations that tend to promote the substitution of robots for human workers?
- 8.11 What are the three categories of robot industrial applications, as identified in the text?
- 8.12 What is a palletizing operation?
- 8.13 What is a robot program?
- 8.14 What is the difference between powered leadthrough and manual leadthrough in robot programming?
- 8.15 What is control resolution in a robot positioning system?
- 8.16 What is the difference between repeatability and accuracy in a robotic manipulator?

PROBLEMS

Answers to problems labeled (A) are listed in the appendix.

Robot Anatomy

- 8.1 Using the joint notation system for defining manipulator configurations (Section 8.1.2), sketch diagrams (similar to Figure 8.1) of the following robots: (a) TRT, (b) VVR, (c) VROT.
- 8.2 Using the joint notation system for defining manipulator configurations (Section 8.1.2), sketch diagrams (similar to Figure 8.1) of the following robots: (a) TRL, (b) OLO, (c) LVL.

- 8.3 Using the joint notation system for defining manipulator configurations (Section 8.1.2), sketch diagrams (similar to Figure 8.1) of the following robots: (a) TRT:R, (b) TVR:TR, (c) RR:T.
- 8.4 Using the robot configuration notation scheme discussed in Section 8.1, write the configuration notations for some of the robots in your laboratory or shop.
- 8.5 Describe the differences in orientation capabilities and work volumes for a TR and a RT wrist assembly. Use sketches as needed.

Cycle Time and Cost Analysis

- 8.6 (A) An articulated robot loads and unloads a CNC machine tool. The cell is scheduled to produce a batch of 300 parts. Setting up the cell for this part style takes 30 min, programming the robot takes 75 min, and programming the CNC machine tool takes 55 min. For safety reasons, these three setup activities must be done sequentially. The programmed machining cycle takes 3.75 min. Cutting tools wear out and must be periodically changed, which takes 6.0 min every 20 cycles and is performed by a human worker. At the end of each machining cycle, the robot reaches into the machine and removes the just-completed part, places it in a parts storage carousel, then reaches for a starting work part from the same carousel and places it in the machine tool fixture. This sequence of handling activities takes 45 sec. The storage carousel holds 25 parts. At the beginning of the production run, it is full of raw work parts. As each part is retrieved by the robot, the carousel indexes one position to present a new raw part. The robot is programmed to place the completed part in the empty position in the carousel and take the next raw part. Periodically, workers visit the carousel to collect finished parts and replace them with starting work parts. This is accomplished without loss of production time. Determine (a) the average production time, (b) production rate of the cell, and (c) how many hours are required to complete the production run. (d) What is the proportion of the total time that the robot is working?
- 8.7 Solve the previous problem, except that the following changes apply: (1) Setting up the cell, programming the robot, and programming the CNC machine can be performed at the same time rather than sequentially; (2) an automatic tool changer and tool storage unit are used so worn tools can be exchanged from the tool storage unit with no lost production time; and (3) a dual gripper is used rather than a single gripper, which reduces the part handling time from 45 sec to 15 sec.
- 8.8 A large overhead gantry robot loads and unloads three CNC lathes in an automated work cell. The three lathes are dedicated to the mass production of the same part style, so their semiautomatic turning cycles are the same: 3.30 min. Assume setup time can be ignored. The cell includes an automated parts storage unit from which the robot retrieves starting work units and deposits finished parts using a dual gripper. The storage unit has an indexing system that presents starting work units at one position and accepts finished parts at another position. To perform the loading and unloading sequence for each lathe requires 48 sec of the robot's time; however, only 18 sec of lost production time are experienced by each lathe. The loading and unloading sequence for the three lathes is synchronized so there is no machine interference. The tooling of each lathe must be changed once each hour, and this takes 6.0 min, which is lost production time. Determine (a) the average production time for each lathe, (b) production rate of the cell, and (c) the proportion of time that the robot is working.

- 8.9** A robot performs a loading and unloading operation for a machine tool. The work cycle consists of the following sequence of activities:

Seq.	Activity	Time
1	Robot reaches and picks part from incoming conveyor and loads into fixture on machine tool.	5.5 sec
2	Machining cycle (automatic).	33.0 sec
3	Robot reaches in, retrieves part from machine tool, and deposits it onto outgoing conveyor.	4.8 sec
4	Move back to pickup position.	1.7 sec

The activities are performed sequentially as listed. Every 30 work parts, the cutting tools in the machine must be changed. This irregular cycle takes 3.0 min to accomplish. The uptime efficiency of the robot is 97%; and the uptime efficiency of the machine tool is 98%, not including interruptions for tool changes. These two efficiencies are assumed not to overlap (i.e., if the robot breaks down, the cell will cease to operate, so the machine tool will not have the opportunity to break down, and vice versa). Downtime results from electrical and mechanical malfunctions of the robot, machine tool, and fixture. Determine the hourly production rate, taking into account the lost time due to tool changes and the uptime efficiency.

- 8.10** In the previous problem, suppose that a double gripper is used instead of a single gripper as indicated in that problem. The activities in the cycle would be changed as follows:

Seq.	Activity	Time
1	Robot reaches and picks raw part from incoming conveyor in one gripper and awaits completion of machining cycle. This activity is performed simultaneously with machining cycle.	3.3 sec
2	At completion of previous machining cycle, robot reaches in, retrieves finished part from machine, loads raw part into fixture, and moves a safe distance from machine.	5.0 sec
3	Machining cycle (automatic).	33.0 sec
4	Robot moves to outgoing conveyor and deposits part. This activity is performed simultaneously with machining cycle.	3.0 sec
5	Robot moves back to pickup position. This activity is performed simultaneously with machining cycle.	1.7 sec

Steps 1, 4, and 5 are performed simultaneously with the automatic machining cycle. Steps 2 and 3 must be performed sequentially. The same tool change statistics and uptime efficiencies are applicable. Determine the hourly production rate when the double gripper is used, taking into account the lost time due to tool changes and the uptime efficiency.

- 8.11** Because the robot's portion of the work cycle requires much less time than the machine tool in Problem 8.9, the possibility of installing a cell with two machines is being considered. The robot would load and unload both machines from the same incoming and outgoing conveyors. The machines would be arranged so that distances between the fixture and the conveyors are the same for both machines. Thus, the activity times given in Problem 8.9

are valid for the two-machine cell. The machining cycles would be coordinated so that the robot would be servicing only one machine at a time. The tool change statistics and uptime efficiencies in Problem 8.9 are applicable. Determine the hourly production rate for the two-machine cell. Assume that if one of the two machine tools is down, the other machine can continue to operate, but if the robot is down, cell operation is stopped.

- 8.12** Determine the hourly production rate for the two-machine cell in Problem 8.11, only the robot is equipped with a double gripper as in Problem 8.10. Assume the activity times from Problem 8.10.
- 8.13** Arc-on time is a measure of efficiency in an arc welding operation. Typical arc-on times in manual welding range between 20% and 30%. Suppose that a certain welding operation is currently performed using a welder and a fitter. Production requirements are steady at 500 units per week. The fitter's job is to load the component parts into the fixture and clamp them in position for the welder. The welder then welds the components in two passes, stopping to reload the welding rod between the two passes. Some time is also lost each cycle for repositioning the welding rod on the work. The fitter's and welder's activities are done sequentially, with times for the various elements as follows:

Seq.	Worker and activity	Time
1	Fitter: load and clamp parts	4.2 min
2	Welder: weld first pass	2.5 min
3	Welder: reload weld rod	1.8 min
4	Welder: weld second pass	2.4 min
5	Welder: repositioning time	2.0 min
6	Delay time between work cycles	1.1 min

Because of fatigue, the welder must take a 20 min rest at mid-morning and mid-afternoon, and a 40 min lunch break around noon. The fitter joins the welder in these rest breaks. The nominal time of the work shift is 8 hr, but the last 20 min of the shift is nonproductive time for cleanup at each workstation. A proposal has been made to install a robot welding cell to perform the operation. The cell would be set up with two fixtures, so that the robot could be welding one job while the fitter is unloading the previous job and loading the next job. In this way, the welding robot and the human fitter could be working simultaneously rather than sequentially. Also, a continuous wire feed would be used rather than individual welding rods. It has been estimated that the continuous wire feed must be changed only once every 40 weldments and the lost time will be 20 min to make the wire change. The times for the various activities in the regular work cycle are as follows:

Seq.	Fitter and robot activities	Times
1	Fitter: load and clamp parts	4.2 min
2	Robot: weld complete	4.0 min
3	Repositioning time	1.0 min
4	Delay time between work cycles	0.3 min

A 10 min break would be taken by the fitter in the morning and another in the afternoon, and 40 min would be taken for lunch. Clean-up time at the end of the shift is 20 min. In your calculations, assume that the proportion uptime of the robot will be 98%. Determine the following: (a) arc-on times (expressed as a percent, using the 8-hr shift as the base) for the manual welding operation and the robot welding station, and (b) hourly production rate on average throughout the 8-hr shift for the manual welding operation and the robot welding station.

- 8.14 (A)** A work cell is currently operated 2,000 hr/yr by a human worker who is paid an hourly rate of \$23.00, which includes applicable overhead costs. One work unit is produced in a cycle time of 4.8 min. Management would like to increase output to meet increasing demand and a robot cell is being considered as a replacement for the present manual cell. The cycle time of the proposed cell would be reduced to 4.0 min. The installed cost of the robot plus supporting equipment is \$120,000. Power and other utilities to operate the robot will be \$0.30/hr, and annual maintenance costs are \$2,500. Determine (a) the number of parts produced annually by the manually operated cell and (b) cost per part produced. (c) How does the cost per part of the robot cell compare with your answer in part (b), given a 4-year service life, 10% rate of return, and no salvage value.
- 8.15** A manual arc welding cell uses a welder and a fitter. The cell operates 2,000 hr/yr. The welder is paid \$30/hr and the fitter is paid \$25/hr. Both rates include applicable overheads. The cycle time to complete one welded assembly is 15.4 min. Of this time, the arc-on time is 25%, and the fitter's participation in the cycle is 30% of the cycle time. A robotic arc welding cell is being considered to replace this manual cell. The new cell would have one robot, one fitter, and two workstations, so that while the robot is working at the first station, the fitter is unloading the other station and loading it with new components. The fitter's rate would remain at \$25/hr. For the new cell, the production rate would be eight welded assemblies per hour. The arc-on time would increase to almost 52%, and the fitter's participation in the cycle would be about 62%. The installed cost of the robot and workstations is \$158,000. Power and other utilities to operate the robot and arc welding equipment will be \$3.80/hr, and annual maintenance costs are \$3,500. Given a 3-year service life, 15% rate of return, and no salvage value, (a) determine the annual quantity of welded assemblies that would have to be produced to reach the break-even point for the two methods. (b) What is the annual quantity of welded assemblies produced by the two methods working 2,000 hr/yr?

Robot Programming Exercises

Note: The problems in the following group are all programming exercises to be performed on robots available to students. The solutions depend on the particular programming methods or languages used. They represent suggestions for laboratory exercises to instructors using the book.

- 8.16** The setup for this exercise requires a felt-tipped pen mounted to the robot's end-of-arm (or held securely in the robot's gripper). Also required is a thick cardboard, mounted on the surface of the worktable. Pieces of plain white paper will be pinned or taped to the cardboard surface. The exercise is the following: Program the robot to write your initials on the paper with the felt-tipped pen.
- 8.17** As an enhancement of the previous programming exercise, consider the problem of programming the robot to write any letter that is entered at the alphanumeric keyboard. A textual programming language is required for this exercise.
- 8.18** Apparatus for this exercise consists of two wood or plastic blocks of two different colors that can be grasped by the robot gripper. The blocks should be placed in specific positions (call the positions A and B on either side of a center location (call it position C). The robot should be programmed to do the following: (1) pick up the block at position A and place it at position C; (2) pick up the block at position B and place it at position A; (3) pick up the block at position C and place it at position B. (4) Repeat steps (1), (2), and (3) continually.
- 8.19** Apparatus for this exercise consists of a cardboard box and a dowel about 4 inches long (any straight thin cylinder will suffice, pen, pencil, etc.). The dowel is attached to the robot's end-of-arm or held in its gripper. The dowel is intended to simulate an arc welding

torch, and the edges of the cardboard box are intended to represent the seams that are to be welded. The programming exercise is the following: With the box oriented with one of its corners pointing toward the robot, program the robot to weld the three edges that lead into the corner. The dowel (welding torch) must be continuously oriented at a 45° angle with respect to the edge being welded. See Figure P8.19.

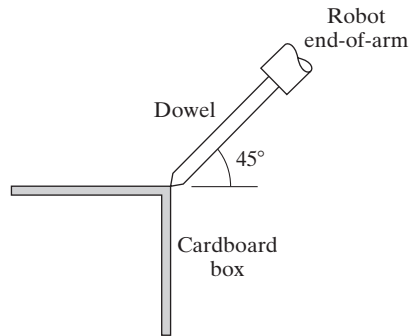


Figure P8.19 Orientation of arc welding torch for Problem 8.19.

- 8.20** This exercise is intended to simulate a palletizing operation. The apparatus includes six wooden (or plastic or metal) cylinders approximately 20 mm in diameter and 75 mm in length, and a 20 mm thick wooden block approximately 100 mm by 133 mm. The block is to have six holes of diameter 25 mm drilled in it as illustrated in Figure P8.20. The wooden cylinders represent work parts and the wooden block represents a pallet. (As an alternative to the wooden block, the layout of the pallet can be sketched on a plain piece of paper attached to the worktable.) The programming exercise is the following: Using the powered leadthrough programming method, program the robot to pick up the parts from a fixed position on the worktable and place them into the six positions in the pallet. The fixed position on the table might be a stop point on a conveyor. (The student may have to manually place the parts at the position if a real conveyor is not available.)

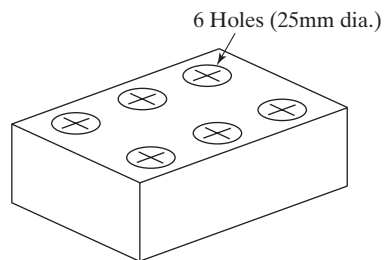


Figure P8.20 Approximate pallet dimensions for Problem 8.20.

Accuracy and Repeatability

- 8.21 (A)** The linear joint (type L) of an industrial robot is actuated by a piston. The length of the joint when fully retracted is 800 mm and when fully extended is 1,400 mm. If the robot's controller has a 10-bit storage capacity, determine the control resolution for this joint.

- 8.22 (A)** In the previous problem, the mechanical errors associated with the linear joint form a normal distribution in the direction of the joint actuation with standard deviation = 0.11 mm. Determine the accuracy and repeatability for the robot.
- 8.23** The rotational joint (type R) of an industrial robot has a range of 170° rotation. The mechanical errors in the joint and the input/output links can be described by a normal distribution with its mean at any given addressable point and a standard deviation of 0.15° . Determine the number of storage bits required in the controller memory so that the accuracy of the joint is as close as possible to, but less than, its repeatability. Use six standard deviations as the measure of repeatability.
- 8.24** An articulated robot has a T-type wrist axis that can be rotated a total of 2 rotations (each rotation is a full 360°). It is desired to be able to position the wrist with a control resolution of 0.25° between adjacent addressable points. (a) Determine the number of bits required in the binary register for that axis in the robot's control memory. (b) Using this number of bits, what is the actual control resolution of the joint?
- 8.25** One axis of an RRL robot is a linear slide with a total range of 750 mm. The robot's control memory has a 10-bit capacity. It is assumed that the mechanical errors associated with the arm are normally distributed with a mean at the given taught point and a standard deviation of 0.10 mm. Determine (a) the control resolution for the axis under consideration, (b) accuracy, and (c) repeatability.
- 8.26 (A)** Link 3 of a TRR robot has a rotational joint and its outer end is connected to a wrist assembly. Considering the design of this joint only, the link 3 is 600 mm long, and the total range of rotation of the joint is 60° . The control resolution of this joint is expressed as a linear arc measure at the wrist, and is specified to be 1.0 mm or less. It is known that the mechanical inaccuracies in the joint result in an error of $\pm 0.018^\circ$ rotation, and it is assumed that the output link is perfectly rigid so as to cause no additional errors due to deflection. (a) Determine the minimum number of bits required in the robot's control memory to achieve the control resolution specified. (b) Using this number of bits, what is the actual control resolution of the joint?

Chapter 9

Discrete Control and Programmable Logic Controllers

CHAPTER CONTENTS

- 9.1 Discrete Process Control
 - 9.1.1 Logic Control
 - 9.1.2 Sequence Control
- 9.2 Ladder Logic Diagrams
- 9.3 Programmable Logic Controllers
 - 9.3.1 Components of the PLC
 - 9.3.2 PLC Operating Cycle
 - 9.3.3 Programming the PLC
- 9.4 Personal Computers and Programmable Automation Controllers
 - 9.4.1 Personal Computers for Industrial Control
 - 9.4.2 Programmable Automation Controllers

Numerical control (Chapter 7) and industrial robotics (Chapter 8) are primarily concerned with motion control, because the applications of machine tools and robots involve the movement of a cutting tool or end effector, respectively. A more general type of control is discrete control (Section 5.2.2). The present chapter provides a more complete discussion of discrete control and the industrial controllers used to implement it.

9.1 DISCRETE PROCESS CONTROL

Discrete process control systems deal with parameters and variables that are discrete and that change values at discrete moments in time. The parameters and variables are typically binary; they can have either of two possible values, 1 or 0. The values mean ON or

OFF, true or false, object present or not present, high voltage value or low voltage value, and so on, depending on the application. The binary variables in discrete process control are associated with input signals to the controller and output signals from the controller. Input signals are typically generated by binary sensors, such as limit switches and photo-sensors, that are interfaced to the process. Output signals are generated by the controller to operate the process in response to the input signals and as a function of time. These output signals turn on and off switches, motors, valves, and other binary actuators related to the process. A list of binary sensors and actuators is compiled in Table 9.1, along with the interpretation of their 0 and 1 values. The purpose of the controller is to coordinate the various actions of the physical system, such as transferring parts into a workholder, feeding a machining work head, and so on.

Discrete process control can be divided into two categories: (1) logic control, which is concerned with event-driven changes in the system, and (2) sequence control, which is concerned with time-driven changes in the system.¹ Both control types are referred to as *switching systems* because they switch their output values on and off in response to changes in events or time.

9.1.1 Logic Control

A logic control system is a switching system whose output at any moment is determined exclusively by the values of the current inputs. It has no memory and does not consider any previous values of input signals in determining the output signal. Neither does it have any operating characteristics that perform directly as a function of time.

The following example from robotics illustrates logic control. Suppose that in a machine-loading application, the robot is programmed to pick up a raw work part from a known stopping point along a conveyor and place it in a forging press. Three conditions must be satisfied to initiate the loading cycle. First, the raw work part must be at the stopping point; second, the forge press must have completed the process on the previous part; and third, the previous part must be removed from the die. The first condition can be indicated by means of a simple limit switch that senses the presence of the part at the conveyor stop and transmits an ON signal to the robot controller. The second condition can be indicated by the forge press, which sends an ON signal after it has completed the previous cycle. The third condition might be determined by a photodetector located so as to sense the presence or absence of the part in the forging die. When the finished part

TABLE 9.1 Binary Sensors and Actuators Used in Discrete Process Control

Sensor	One/Zero Interpretation	Actuator	One/Zero Interpretation
Limit switch	Contact/no contact	Motor	On/off
Photodetector	On/off	Control relay	Contact/no contact
Push-button switch	On/off	Light	On/off
Timer	On/off	Valve	Closed/open
Control relay	Contact/no contact	Clutch	Engaged/not engaged
Circuit breaker	Contact/no contact	Solenoid	Energized/not energized

¹Event-driven changes and time-driven changes are defined in Section 5.2.2.

is removed from the die, an ON signal is transmitted by the photocell. All three of these ON signals must be received by the robot controller to initiate the next work cycle. No previous conditions or past history are needed.

Elements of Logic Control. The basic elements of logic control are the logic gates AND, OR, and NOT. In each case, the logic gate is designed to provide a specified output value based on the values of the input(s). For both inputs and outputs, the values can be either of two binary values: 0 or 1. For purposes of industrial control, 0 (zero) is defined as OFF and 1 (one) as ON.

The AND gate outputs a value of 1 if all of the inputs are 1, and 0 otherwise. Figure 9.1(a) illustrates the operation of a logical AND gate. If switches X1 and X2 (representing inputs) in the circuit are both closed, then the lamp Y (representing the output) is on. The AND gate might be used in an automated manufacturing operation to indicate that two (or more) actions have been successfully completed, therefore signaling that the next step in the process should be initiated. The interlock system in the previous robot forging example illustrates the AND gate. All three conditions must be satisfied before loading of the forge press is allowed to occur.

The OR gate outputs a value of 1 if either of the inputs has a value of 1, and 0 otherwise. Figure 9.1(b) shows how the OR gate operates. In this case, the two input signals X1 and X2 are arranged in a parallel circuit, so that if either switch is closed, the lamp Y will be on. A possible use of the OR gate in a manufacturing system is for safety monitoring. Suppose that two sensors are utilized to monitor two different safety hazards. When either hazard occurs, the respective sensor emits a positive signal that sounds an alarm buzzer.

Both the AND and OR gates can be used with two or more inputs. The NOT gate has a single input. The NOT gate reverses the input signal: If the input is 1, then the output is 0; if the input is 0, then the output is 1. The NOT gate can be used to open a circuit upon receipt of a control signal.

Boolean Algebra and Truth Tables. The logic elements form the foundation for a special algebra that was developed around 1847 by George Boole and that bears his name. Its original purpose was to provide a symbolic means of testing whether complex statements of logic were TRUE or FALSE. In fact, Boole called it *logical algebra*. It was not until about a century later that Boolean algebra was shown to be useful in digital logic systems. Some of its fundamentals are described here.

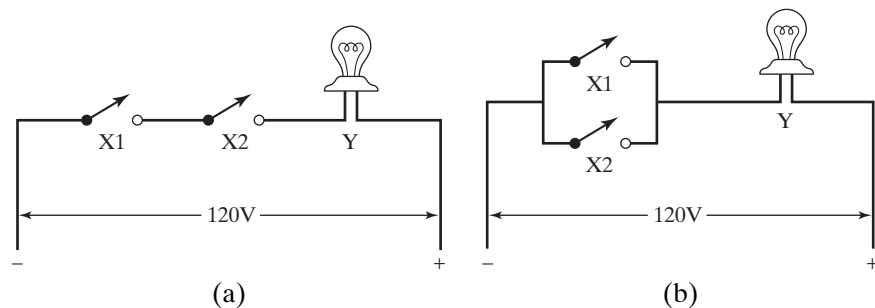


Figure 9.1 Electrical circuits illustrating the operation of logical gates (a) AND and (b) OR.

In Boolean algebra, the AND function is expressed as

$$Y = X1 \cdot X2 \tag{9.1}$$

This is called the logical product of X1 and X2. As a logic statement, it means: Y is true if both X1 and X2 are true; otherwise, Y is false. The truth table is often used to present the operation of logic systems. A **truth table** is a tabulation of all of the combinations of input values to the corresponding logical output values. The truth table for the AND gate for four possible combinations of two input binary variables is presented in Table 9.2(a).

The OR function in Boolean algebra notation is given by

$$Y = X1 + X2 \tag{9.2}$$

This is called the logical sum of X1 and X2. In logic, the statement says: Y is true if either X1 or X2 is true; otherwise, Y is false. The outputs of the OR function for four possible combinations of two input binary variables are listed in the truth table of Table 9.2(b).

The NOT function is referred to as the negation or inversion of the variable. It is indicated by placing a bar above the variable (e.g., $\overline{X1}$). The truth table for the NOT function is listed in Table 9.2(c), and the corresponding Boolean equation is as follows:

$$Y = \overline{X1} \tag{9.3}$$

In addition to the three basic elements, there are two more elements that can be used in switching circuits: the NAND and NOR gates. The logical NAND gate is formed by combining an AND gate and a NOT gate in sequence, yielding the truth table shown in Table 9.3(a). In equation form,

$$Y = \overline{X1 \cdot X2} \tag{9.4}$$

TABLE 9.2 Truth Tables for the Logical (a) AND, (b) OR, and (c) NOT Gates

(a) AND			(b) OR			(c) NOT	
Inputs		Output	Inputs		Output	Input	Output
X1	X2	$Y = X1 \cdot X2$	X1	X2	$Y = X1 + X2$	X1	$Y = \overline{X1}$
0	0	0	0	0	0	0	1
0	1	0	0	1	1	1	0
1	0	0	1	0	1		
1	1	1	1	1	1		

TABLE 9.3 Truth Tables for the Logical (a) NAND and (b) NOR Gates

(a) NAND			(b) NOR		
Inputs		Output	Inputs		Output
X1	X2	$Y = \overline{X1 \cdot X2}$	X1	X2	$Y = \overline{X1 + X2}$
0	0	1	0	0	1
0	1	1	0	1	0
1	0	1	1	0	0
1	1	0	1	1	0




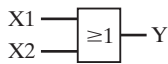

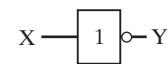



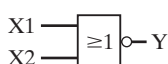
	U.S. symbol	ISO symbol
AND		
OR		
NOT		
NAND		
NOR		

Figure 9.2 Symbols used for logical gates: U.S. and ISO.

The logical NOR gate is formed by combining an OR gate followed by a NOT gate, providing the truth table in Table 9.3(b). The Boolean algebra equation for the NOR gate is written as follows:

$$Y = \overline{X1 + X2} \tag{9.5}$$

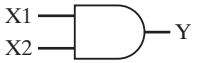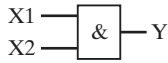Various diagramming techniques have been developed to represent the logic elements and their relationships in a given logic control system. The logic network diagram is one of the most common methods, based on symbols illustrated in Figure 9.2. Two examples are presented later in this section to demonstrate their application.

Several of the laws and theorems of Boolean algebra are cited in Table 9.4. These laws and theorems can often be applied to simplify logic circuits and reduce the number of elements required to implement the logic, with resulting savings in hardware and/or programming time.

TABLE 9.4 Laws and Theorems of Boolean Algebra

Commutative Law: $X + Y = Y + X$ $X \cdot Y = Y \cdot X$	Law of Absorption: $X \cdot (X + Y) = X + X \cdot Y = X$
Associative Law: $X + Y + Z = X + (Y + Z)$ $X + Y + Z = (X + Y) + Z$ $X \cdot Y \cdot Z = X \cdot (Y \cdot Z)$ $X \cdot Y \cdot Z = (X \cdot Y) \cdot Z$	De Morgan's Laws: $\overline{(X + Y)} = \overline{X} \cdot \overline{Y}$ $\overline{(X \cdot Y)} = \overline{X} + \overline{Y}$
Distributive Law: $X \cdot Y + X \cdot Z = X \cdot (Y + Z)$ $(X + Y) \cdot (Z + W) = X \cdot Z + X \cdot W + Y \cdot Z + Y \cdot W$	Consistency Theorem: $X \cdot Y + X \cdot \overline{Y} = X$ $(X + Y) \cdot (X + \overline{Y}) = X$ Inclusion Theorem: $X \cdot \overline{X} = 0$ $X + \overline{X} = 1$

EXAMPLE 9.1 Robot Machine Loading

The robotic machine loading example described at the beginning of Section 9.1.1 required three conditions to be satisfied before the loading sequence was initiated. Determine the Boolean algebra expression and the logic network diagram for this interlock system.

Solution: Let $X1$ = whether the raw work part is present at the conveyor stopping point ($X1 = 1$ for part present, $X1 = 0$ for part not present). Let $X2$ = whether the press cycle for the previous part has completed ($X2 = 1$ for completed, $X2 = 0$ for not completed). Let $X3$ = whether the previous part has been removed from the die ($X3 = 1$ for removed, $X3 = 0$ for not removed). Finally, let Y = whether the loading sequence can be started ($Y = 1$ for begin, $Y = 0$ for wait). All three conditions must be satisfied, so the logical AND function is used. All of the inputs $X1$, $X2$, and $X3$ must have values of 1 before $Y = 1$, initiating the start of the loading sequence. The logic network diagram for this interlock condition is presented in Figure 9.3. The Boolean algebra expression is $Y = X1 \cdot X2 \cdot X3$.


 



Figure 9.3 Logic network diagram for the robotic machine loading system in Example 9.1.

EXAMPLE 9.2 Push-Button Switch

A push-button switch used for starting and stopping electric motors and other powered devices is a common hardware component in industrial control systems. As shown in Figure 9.4(a), it consists of a box with two buttons, one for START and the other for STOP. When the START button is depressed momentarily by a human operator, power is supplied and maintained to the motor (or other load) until the STOP button is pressed momentarily, which breaks the power to the POWER-TO-MOTOR. POWER-TO-MOTOR is the output of the push-button switch, but it also serves as a contact to power the motor. (a) Define the initial values of the variables. Construct (b) the truth table for the push button and (c) the logic network diagram.

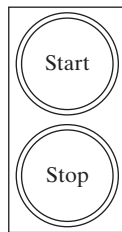

(a)

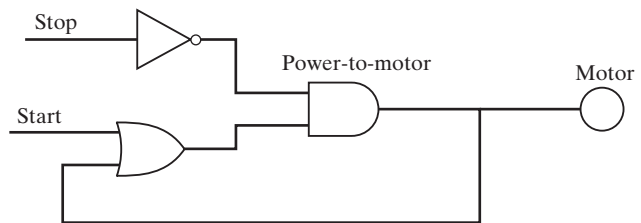

(b)

Figure 9.4 (a) Push-button switch of Example 9.2 and (b) its logic network diagram.

Solution: (a) The variables are defined as follows:

START = 0 normally open contact

START = 1 closed when the START button is pressed

STOP = 1 normally closed contact

STOP = 0 open when the STOP button is pressed to break contact

POWER-TO-MOTOR = 0 when the contacts are open

POWER-TO-MOTOR = 1 when the contacts are closed

MOTOR = 0 when off (not running)

MOTOR = 1 when on (running)

(b) The truth table for the push button is presented in Table 9.5. From an initial motor off condition ($MOTOR = 0$), the motor is started by depressing the start button ($START = 1$), which momentarily closes the contact. If the stop button is in its normally closed condition ($STOP = 1$), power is supplied to the motor ($POWER-TO-MOTOR = 1$), which turns on the motor ($MOTOR = 1$). When the motor is running ($MOTOR = 1$), it can be stopped by depressing the stop button ($STOP = 0$), which breaks the power supply to the motor.

TABLE 9.5 Truth Table for Push-Button Switch of Example 9.2

Line	START	STOP	POWER-TO-MOTOR	MOTOR
1	0	1	0	0
2	1	1	1	1
3	0	0	0	0
4	1	0	0	0
5	0	1	1	1
6	1	1	1	1
7	0	0	0	0
8	1	0	0	0

(c) The corresponding logic network diagram is shown in Figure 9.4(b). □

In a sense, the push-button switch of Example 9.2 goes slightly beyond the definition of a pure logic system because it exhibits characteristics of memory. The $MOTOR$ and $POWER-TO-MOTOR$ variables have the same value. The conditions that determine whether power will flow to the motor are different depending on the $POWER-TO-MOTOR$ ON/OFF status. Compare lines 1 and 5 of Table 9.5. If the $POWER-TO-MOTOR$ contact is open (line 1), then it remains open when the $START$ button is off. But if the $POWER-TO-MOTOR$ contact is closed (line 5), then it remains closed even though the $START$ button is off. It is as if the control logic must remember whether the motor is on or off to decide what conditions will determine the

value of the output signal. This memory feature is exhibited by the feedback loop (the lower branch) in the logic network diagram of Figure 9.4(b).

9.1.2 Sequence Control

A sequence control system uses internal timing devices to determine when to initiate changes in output variables. Washing machines, dryers, dishwashers, and similar appliances use sequence control to time the start and stop of cycle elements, and there are also many industrial applications of sequence control. For example, suppose an induction heating coil is used to heat the work part in the previous example of a robotics forging application. Rather than using a temperature sensor, the coil could be set up with a timed heating cycle so that enough energy is provided to heat the work part to the required temperature for forging. Of course, the heating process must be sufficiently reliable and predictable that the time spent in the induction coil will consistently heat up the part to the required temperature. Otherwise, a major calamity will ensue when the forging dies are closed by the press.

Many applications in industrial automation require the controller to provide a pre-scheduled set of ON/OFF values for the output variables. The outputs are often generated in an open-loop fashion, meaning that there is no feedback verification that the control function has actually been executed. Another feature that typifies this mode of control is that the sequence of output signals is usually cyclical; the signals occur in the same repeated pattern within each regular cycle. Timers and counters illustrate this type of control component.

A **timer** is a device that switches its output ON or OFF at preset time intervals. Common timers used in industry and in homes switch on when activated and remain on for a programmed length of time. Some timers are activated by depressing a start button, for example, the water pump on a whirlpool bath. Others operate on a 24-hr clock. For example, some home security systems have timing features that turn lights on and off during the evening to give the appearance of people at home.

Two additional types of timers used in discrete control systems can be distinguished: (1) delay-off timers and (2) delay-on timers. A delay-off timer switches power on immediately in response to a start signal, and then switches power off after a specified time delay. Many cars are equipped with this type of device. When you exit the car, the lights remain on for a certain length of time (e.g., 30 sec), and then automatically turn off. A delay-on timer waits a specified length of time before switching power on when it receives a start signal. To program a timer, the user must specify the length of the time delay.

A **counter** is a component used to count electrical pulses and store the results of the counting procedure (Section 6.4.2). The instantaneous contents can be displayed and/or used in a process control algorithm. Counters are classified as up counters, down counters, and up/down counters. An up counter starts at zero and increments its contents (the count total) by one in response to each pulse. When a preset value has been reached, the up counter can be reset to zero. An application of such a device is counting the number of filled beer bottles moving along a conveyor for boxing into cases. Every set of 24 bottles adds up to one case, and the counter is then reset to zero. A down counter starts with a preset value and decrements the total by one for each pulse received. It could be used for the same bottling application as above, using a starting preset value of 24. An up/down counter combines the two counting operations, and might be useful for keeping track of

the number of bottles remaining in a storage buffer that leads into the boxing operation. It adds the number of bottles entering and subtracts the number exiting the buffer to get a current tally of the buffer contents.

9.2 LADDER LOGIC DIAGRAMS

The logic network diagrams of the type shown in Figures 9.3 and 9.4(b) are useful for displaying the relationships between logic elements. Another diagramming technique that exhibits the logic as well as the timing and sequencing of the system is the ladder logic diagram. This graphical method has an important virtue in that it is analogous to the electrical circuits used to accomplish logic and sequence control. In addition, ladder logic diagrams are familiar to shop personnel who must construct, test, maintain, and repair the discrete control system.

In a ladder logic diagram, the various components are displayed along horizontal lines or rungs connected on either end to two vertical rails, as illustrated in Figure 9.5. The diagram has the general configuration of a ladder, hence its name. The components are (1) contacts, representing inputs, and (2) loads, also known as *coils*, representing outputs. Inputs include switches, relay contacts, on/off sensors (e.g., limit switches and photodetectors), timers, and other binary contact devices. Loads include motors, lamps,

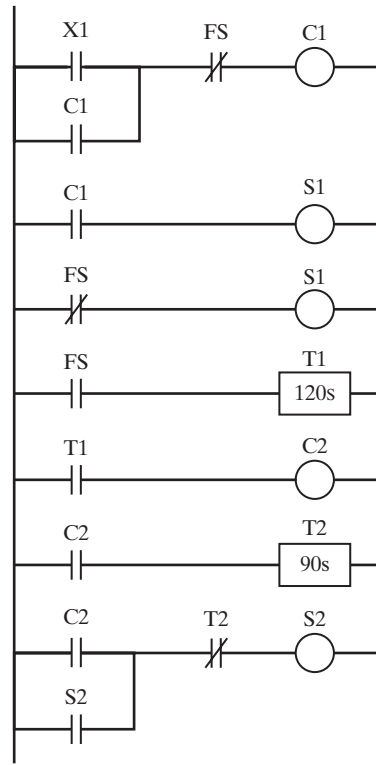


Figure 9.5 A ladder logic diagram.




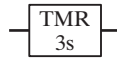

Ladder symbol	Hardware component
(a) 	Normally open contacts (switch, relay, other ON/OFF devices)
(b) 	Normally closed contacts (switch, relay, etc.)
(c) 	Output loads (motor, lamp, solenoid, alarm, etc.)
(d) 	Timer
(e) 	Counter

Figure 9.6 Symbols for common logic and sequence components used in ladder logic diagrams.

solenoids, and alarms. Power (e.g., 120 VAC) to the components is provided by the two vertical rails. In ladder diagrams, the inputs (contacts) are located to the left of each rung and the outputs (loads) are located to the right.

Symbols used in ladder diagrams for the common logic and sequence control components are presented in Figure 9.6. There are two types of contacts: normally open and normally closed. Both types of contacts are used to represent ON/OFF inputs to the logic circuit. A normally open contact remains open (OFF) until it is activated, thus turning on the current (ON). A normally closed contact remains closed (ON) so that current flows through the contact. When activated, the contacts open (OFF), turning off the flow of current. Thus, a normally closed contact performs like a NOT logic gate. Normally open contacts of a switch or similar device are symbolized by two short vertical lines along a horizontal rung of the ladder, as in Figure 9.6(a). Normally closed contacts are shown as the same vertical lines only with a diagonal line across them as in Figure 9.6(b).

Output loads that are turned on and off by the logic control system are shown as nodes (circles) as in Figure 9.6(c). Timers and counters are symbolized by rectangles with appropriate parameters to drive the device as in Figure 9.6(d) and (e). The simple timer requires the specification of the time delay and the identification of the input contact that activates the delay. When the input signal is received, the timer waits the specified delay time before switching on or off the output signal. The timer is reset (output is set back to its initial value) by turning off the input signal.

Counters require two inputs, not shown in Figure 9.6(e). The first is the pulse train (series of on/off signals) that is counted. The second is a signal to reset the counter and restart the counting procedure. Resetting the counter means zeroing the count for an up counter and setting the starting value for a down counter. The accumulated count is retained in memory for use if required for the application.

EXAMPLE 9.3 Three Lamp Circuits

Create ladder logic diagrams for the three basic logic gates AND, OR, and NOT.

Solution: The three ladder diagrams corresponding to these circuits are presented in Figure 9.7(a), (b), and (c). Note the similarity between the original circuit diagrams in Figure 9.1 and the ladder diagrams shown here in (a) and (b). Notice that the NOT symbol is the same as a normally closed contact, which is the logical inverse of a normally open contact.

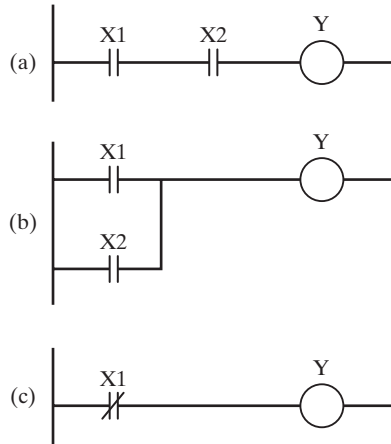


Figure 9.7 Three ladder logic diagrams for the logical gates (a) AND, (b) OR, and (c) NOT.

EXAMPLE 9.4 Push-Button Switch

The operation of the push-button switch of Example 9.2 can be depicted in a ladder logic diagram. From Figure 9.4(b), let START be represented by S1, STOP by S2, POWER-TO-MOTOR by P, and MOTOR by M, and create the diagram.

Solution: The ladder diagram is presented in Figure 9.8. S1 and S2 are input contacts, and P is a load in the diagram. Note how P also serves as an input contact in the second and third rungs.

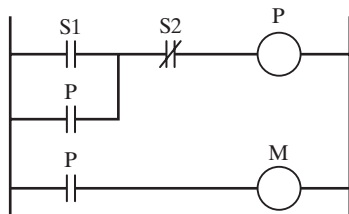


Figure 9.8 Ladder logic diagram for the push-button switch in Example 9.4.

EXAMPLE 9.5 Control Relay

A control relay can be used to control on/off actuation of a powered device at some remote location. It can also be used to define alternative decisions in logic control. Construct the ladder logic diagram of a control relay.

Solution: The ladder logic diagram demonstrating the operation of a control relay is presented in Figure 9.9. The relay is indicated by the load C (for control relay), which controls the on/off operation of two motors (or other types of output loads) Y1 and Y2. When the control switch X is open, the relay is de-energized, thereby connecting the load Y1 to the power lines. In effect, the open switch X turns on motor Y1 by means of the control relay. When the control switch is closed, the control relay becomes energized. This opens the normally closed contact on the second rung of the ladder and closes the normally open contact on the third rung. In effect, power is shut off to load Y1 and turned on to load Y2.

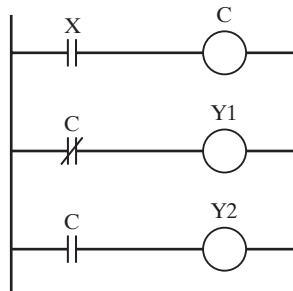


Figure 9.9 Ladder logic diagram for the control relay in Example 9.5.

Examples 9.4 and 9.5 illustrate two important features of a ladder logic diagram. First, it is possible for an output (load) on one rung of the diagram to be an input (contact) for another rung. The relay C was the output on the top rung in Figure 9.9, but that output was used as an input elsewhere in the diagram. Second, the same input can be used more than once in the diagram. In the examples, the load on the top rung was used as an input on both the second and third rungs. This feature of using a given contact in several different rungs of the ladder diagram to serve multiple logic functions provides a substantial advantage for the programmable controller over hardwired control units. With hardwired relays, separate contacts would have to be built into the controller for each logic function.

EXAMPLE 9.6 Fluid Storage Tank

Consider the fluid storage tank illustrated in Figure 9.10. When the start button X1 is depressed, this closes the control relay C1, which energizes solenoid S1, which opens a valve allowing fluid to flow into the tank. When the tank becomes full, the float switch FS closes, which opens relay C1, causing the solenoid S1 to be de-energized, thus turning off the in-flow. Switch FS also activates timer T1, which provides a 120-sec delay for a certain chemical

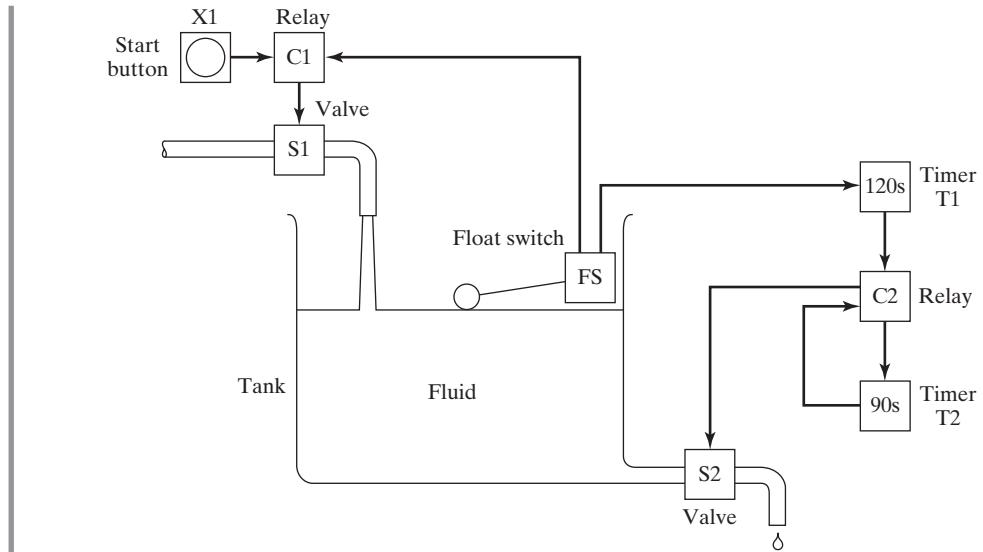


Figure 9.10 Fluid filling operation of Example 9.6.

reaction to occur in the tank. At the end of the delay time, the timer energizes a second relay C2, which controls two devices: (1) It initiates timer T2, which waits 90 sec to allow the contents of the tank to be drained, and (2) it energizes solenoid S2, which opens a valve to allow the fluid to flow out of the tank. At the end of the 90 sec, the timer breaks the current and de-energizes solenoid S2, thus closing the out-flow valve. Depressing the start button X1 resets the timers and opens their respective contacts. Construct the ladder logic diagram for the system.

Solution: The ladder logic diagram is constructed as shown in Figure 9.5.

The ladder logic diagram is an excellent way to represent the combinatorial logic control problems in which the output variables are based directly on the values of the inputs. As indicated by Example 9.6, it can also be used to display sequential control (timer) problems, although the diagram is somewhat more difficult to interpret and analyze for this purpose. The ladder diagram is the principal technique for setting up the control programs in programmable logic controllers.

9.3 PROGRAMMABLE LOGIC CONTROLLERS

A programmable logic controller (PLC) can be defined as a microcomputer-based controller that uses stored instructions in programmable memory to implement logic, sequencing, timing, counting, and arithmetic functions through digital or analog input/output (I/O) modules, for controlling machines and processes. PLC applications are found in both the process industries and discrete manufacturing. Examples of applications in process industries include chemical processing, paper mill operations, and

food production. PLCs are primarily associated with discrete manufacturing industries to control individual machines, machine cells, transfer lines, material handling equipment, and automated storage systems. Before the PLC was introduced around 1970, hardwired controllers composed of relays, coils, counters, timers, and similar components were used to implement this type of industrial control (Historical Note 9.1). Today, many older pieces of equipment have been retrofitted with PLCs to replace the original hardwired controllers, often making the equipment more productive and reliable than when it was new.

Historical Note 9.1 Programmable Logic Controllers [2], [6], [8], [9].

In the mid-1960s, Richard Morley was a partner in Bedford Associates, a New England consulting firm specializing in control systems for machine tool companies. Most of the firm's work involved replacing relays with minicomputers in machine tool controls. In January 1968, Morley devised the notion and wrote the specifications for the first programmable controller.² It would overcome some of the limitations of conventional computers used for process control at the time; namely, it would be a real-time processor (Section 5.3.1), it would be predictable and reliable, and it would be modular and rugged. Programming would be based on ladder logic, which was widely used for industrial controls. The controller that emerged was named the Modicon Model 084. MODICON was an abbreviation of MODular DIGital CONTroller. Model 084 was derived from the fact that this was the 84th product developed by Bedford Associates. Morley and his associates elected to start up a new company to produce the controllers, and Modicon was incorporated in October 1968. In 1977, Modicon was sold to Gould and became Gould's PLC division.

In the same year that Morley invented the PLC, the Hydramatic Division of General Motors Corporation developed a set of specifications for a PLC. The specifications were motivated by the high cost and lack of flexibility of electromechanical relay-based controllers used extensively in the automotive industry to control transfer lines and other mechanized and automated systems. The requirements for the device were that it must (1) be programmable and reprogrammable, (2) be designed to operate in an industrial environment, (3) accept 120 V AC signals from standard push-buttons and limit switches, (4) have outputs designed to switch and continuously operate loads such as motors and relays of 2-A rating, and (5) have a price and installation cost competitive with relay and solid-state logic devices then in use. In addition to Modicon, several other companies saw a commercial opportunity in the GM specifications and developed various versions of the PLC.

Capabilities of the first PLCs were similar to those of the relay controls they replaced. They were limited to on/off control. Within five years, product enhancements included better operator interfaces, arithmetic capability, data manipulation, and computer communications. Improvements over the next five years included larger memory, analog and positioning control, and remote I/O (permitting remote devices to be connected to a satellite I/O subsystem that was multiplexed to the PLC using twisted pair). Much of the progress was based on advancements taking place in microprocessor technology. By the mid-1980s, the micro PLC had been introduced. This was a down-sized PLC with much lower size and cost (typical size = 75 mm by 75 mm by 125 mm, and typical cost less than \$500). By the mid-1990s, the nano PLC had arrived, which was even smaller and less expensive.

²Morley used the abbreviation PC to refer to the programmable controller. This term was used for many years until IBM began to call its personal computers by the same abbreviation in the early 1980s. The term *PLC*, widely used today for programmable logic controller, was coined by Allen-Bradley, a leading PLC supplier.

There are significant advantages to using a PLC rather than conventional relays, timers, counters, and other hardwired control components. These advantages include (1) programming the PLC is easier than wiring the relay control panel; (2) the PLC can be reprogrammed, whereas conventional controls must be rewired and are often scrapped instead; (3) PLCs take less floor space than relay control panels; (4) reliability is greater, and maintenance is easier; (5) the PLC can be connected to computer systems more easily than relays; and (6) PLCs can perform a greater variety of control functions than relay-based controls.

This section describes the components, operation, and programming of the PLC. Although its principal applications are in logic and sequence control, many PLCs also perform additional functions (Section 9.4).

9.3.1 Components of the PLC

A schematic diagram of a PLC is presented in Figure 9.11. The basic components are the following: (1) processor, (2) memory unit, (3) power supply, and (4) I/O module. These components are housed in a suitable cabinet designed for the industrial environment. In addition, there is (5) a programming device that can be disconnected from the PLC when not required.

The processor is the central processing unit (CPU) of the PLC. It executes the various logic and sequence control functions by operating on the PLC inputs to determine the appropriate output signals. The typical CPU operating cycle is described in Section 9.3.2. The CPU consists of one or more microprocessors similar to those used in personal computers and other data processing equipment. The difference is that they have a real-time operating system and are designed to facilitate I/O transactions and execute ladder logic functions. In addition, PLCs are built so that the CPU and other electronic components will operate in the electrically noisy environment of the factory.

Connected to the CPU is the memory unit, which contains the programs of logic, sequencing, and I/O operations. It also holds data files associated with these programs, including I/O status bits, counter and timer constants, and other variable and parameter values. The memory unit is referred to as the user memory because its contents are

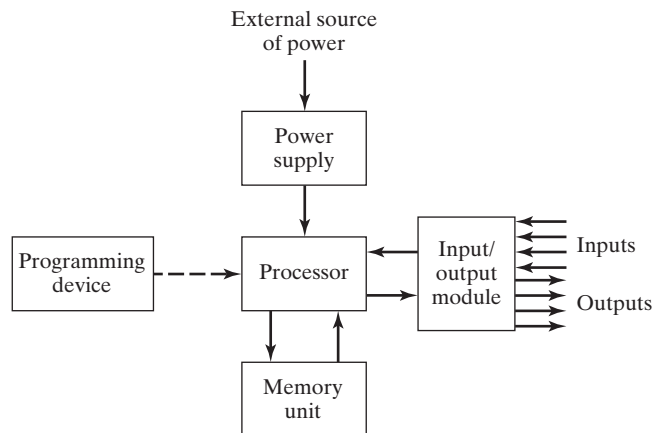


Figure 9.11 Components of a PLC.

entered by the user. In addition, the processor also contains the operating system memory, which directs the execution of the control program and coordinates I/O operations. The operating system is entered by the PLC manufacturer and cannot be accessed or altered by the user.

A power supply of 120 VAC is typically used to drive the PLC (some PLCs operate on 240 VAC). The power supply converts the 120 VAC into direct current (DC) voltages of ± 5 V. These low voltages are used to operate equipment that may have much higher voltage and power ratings than the PLC itself. The power supply often includes a battery backup that switches on automatically in the event of an external power source failure.

The input/output module provides the connections to the industrial equipment or process that is to be controlled. Inputs to the controller are signals from limit switches, push-buttons, sensors, and other on/off devices. Outputs from the controller are on/off signals to operate motors, valves, and other devices required to actuate the process. In addition, many PLCs are capable of accepting continuous signals from analog sensors and generating signals suitable for analog actuators. The size of a PLC is usually rated in terms of the number of its I/O terminals.

The PLC is programmed by means of a programming device, which is usually detachable from the PLC cabinet so that it can be shared among multiple controllers. Different PLC manufacturers provide different devices, ranging from simple teach-pendant type devices, similar to those used in robotics, to special PLC programming keyboards and displays. Personal computers can also be used to program PLCs. A PC used for this purpose sometimes remains connected to the PLC to serve a process monitoring or supervisory function and for conventional data processing applications related to the process.

9.3.2 PLC Operating Cycle

As far as the PLC user is concerned, the steps in the control program are executed simultaneously and continuously. In truth, a certain amount of time is required for the PLC processor to execute the user program during one cycle of operation. The typical operating cycle of the PLC, called a *scan*, consists of three parts: (1) input scan, (2) program scan, and (3) output scan. During the input scan, the inputs to the PLC are read by the processor and the status of each input is stored in memory. Next, the control program is executed during the program scan. The input values stored in memory are used in the control logic calculations to determine the values of the outputs. Finally, during the output scan, the outputs are updated to agree with the calculated values. The time to perform the scan is called the *scan time*, and this time depends on the number of inputs that must be read, the complexity of control functions to be performed, and the number of outputs that must be changed. Typical scan times are measured in milliseconds [20].

One of the potential problems that can occur during the scan cycle is that the value of an input can change immediately after it has been sampled. Since the program uses the input value stored in memory, any output values that are dependent on that input are determined incorrectly. There is obviously a potential risk involved in this mode of operation. However, the risk is minimized because the time between updates is so short that it is unlikely that the output value being incorrect for such a short time will have a serious effect on process operation. The risk becomes most significant in processes in which the response times are very fast and where hazards can occur during the scan time. Some PLCs have special features for making “immediate” updates of output signals when input variables are known to cycle back and forth at frequencies faster than the scan time.

9.3.3 Programming the PLC

Programming is the means by which the user enters the control instructions to the PLC through the programming device. The most basic control instructions consist of switching, logic, sequencing, counting, and timing. Virtually all PLC programming methods provide instruction sets that include these functions. Many control applications require additional instructions to accomplish analog control of continuous processes, complex control logic, data processing and reporting, and other advanced functions not readily performed by the basic instruction set. Owing to these differences in requirements, various PLC programming languages have been developed. A standard for PLC programming was published by the International Electrotechnical Commission in 1992, entitled *International Standard for Programmable Controllers* (IEC 61131–3). This standard specifies three graphical languages and two text-based languages for programming PLCs, respectively: (1) ladder logic diagrams, (2) function block diagrams, (3) sequential functions charts, (4) instruction list, and (5) structured text. Table 9.6 lists the five languages along with the most suitable application of each. IEC 61131–3 also states that the five languages must be able to interact with each other to allow for all possible levels of control sophistication in any given application.

Ladder Logic Diagram. The most widely used PLC programming language today involves ladder diagrams (LDs), examples of which are shown in several previous figures. As indicated in Section 9.2, ladder diagrams are very convenient for shop personnel who are familiar with ladder and circuit diagrams but may not be familiar with computers and computer programming. To use ladder logic diagrams, they do not need to learn an entirely new programming language.

Direct entry of the ladder logic diagram into the PLC memory requires the use of a keyboard and monitor with graphics capability to display symbols representing the components and their interrelationships in the ladder logic diagram. The symbols are similar to those presented in Figure 9.6. The PLC keyboard is often designed with keys for each of the individual symbols. Programming is accomplished by inserting the appropriate components into the rungs of the ladder diagram. The components are of two basic types: contacts and coils. Contacts represent input switches, relay contacts, and similar components. Coils represent loads such as motors, solenoids, relays, timers, and counters. In effect, the programmer inputs the ladder logic circuit diagram rung by rung into the PLC memory with the monitor displaying the results for verification.

TABLE 9.6 Features of the Five PLC Languages Specified in the IEC 61131–3 Standard

Language	Abbreviation	Type	Applications Best Suited for
Ladder logic diagram	(LD)	Graphical	Discrete control
Function block diagram	(FBD)	Graphical	Continuous control
Sequential function chart	(SFC)	Graphical	Sequence control
Instruction list	(IL)	Textual	Discrete control
Structured text	(ST)	Textual	Complex logic, computations, etc.

Function Block Diagrams. A function block diagram (FBD) provides a means of inputting high-level instructions. Instructions are composed of operational blocks. Each block has one or more inputs and one or more outputs. Within a block, certain operations take place on the inputs to transform the signals into the desired outputs. The function blocks include operations such as timers and counters, control computations using equations (e.g., proportional-integral-derivative control), data manipulation, and data transfer to other computer-based systems. Function blocks are described in Hughes [4].

Sequential Function Charts. The sequential function chart (SFC, also called the *Grafset* method) graphically displays the sequential functions of an automated system as a series of steps and transitions from one state of the system to the next. The sequential function chart is described in Boucher [1]. It has become a standard method for documenting logic control and sequencing in much of Europe. However, its use in the United States is more limited, and the reader is referred to the cited reference for more details on the method.

Instruction List. Instruction list (IL) programming also provides a way of entering the ladder logic diagram into PLC memory. In this method, the programmer uses a low-level computer language to construct the ladder logic diagram by entering statements that specify the various components and their relationships for each rung of the ladder diagram. This approach can be demonstrated by introducing a hypothetical PLC instruction set, which is a composite of various manufacturers' languages. It contains fewer features than most commercially available PLCs. The programming device typically consists of a special keyboard for entering the individual components on each rung of the ladder logic diagram. A monitor capable of displaying each ladder rung (and perhaps several rungs that precede it) is useful to verify the program. The instruction set for the PLC is presented in Table 9.7 with a concise explanation of each instruction.

TABLE 9.7 Typical Low-Level Language Instruction Set for a PLC

STR	Store a new input and start a new rung of the ladder.
AND	Logical AND referenced with the previously entered component. This is interpreted as a series circuit relative to the previously entered component.
OR	Logical OR referenced with the previously entered component. This is interpreted as a parallel circuit relative to the previously entered component.
NOT	Logical NOT or inverse of the previously entered component.
OUT	Output component for the rung of the ladder diagram.
TMR	Timer component. Requires one input signal to initiate timing sequence. Output is delayed relative to input by a duration specified by the programmer in seconds. Resetting the timer is accomplished by interrupting (stopping) the input signal.
CTR	Counter component. Requires two inputs: One is the incoming pulse train that is counted by the CTR component, the other is the reset signal indicating a restart of the counting procedure.

EXAMPLE 9.7 Language Commands for AND, OR, and NOT Circuits

Using the command set in Table 9.7, write the PLC programs for the three ladder diagrams from Figure 9.7, depicting the logic gates (a) AND, (b) OR, and (c) NOT.

Solution: Commands for the control relay are listed below, with explanatory comments.

Command	Comment
(a) AND STR X1	Store input X1
AND X2	Input X2 in series with X1
OUT Y	Output Y
(b) OR STR X1	Store input X1
OR X2	Input X2 parallel with X1
OUT Y	Output Y
(c) NOT STR NOT X1	Store inverse of X1
OUT Y	Output Y

EXAMPLE 9.8 Language Commands for Control Relay

Using the command set in Table 9.7, write the PLC program for the control relay depicted in the ladder logic diagram of Figure 9.9.

Solution: Commands for the control relay are listed below, with explanatory comments.

Command	Comment
STR X	Store input X
OUT C	Output contact relay C
STR NOT C	Store inverse of C output
OUT Y1	Output load Y1
STR C	Store C output
OUT Y2	Output load Y2

The low-level languages are generally limited to the kinds of logic and sequence control functions that can be defined in a ladder logic diagram. Although timers and counters have not been illustrated in the two preceding examples, some of the exercise problems at the end of the chapter require the reader to use them.

Structured Text. Structured text (ST) is a high-level computer-type language likely to become more common in the future to program PLCs and PCs for automation and control applications. The principal advantage of a high-level language is its capability to perform data processing and calculations on values other than binary. Ladder diagrams and low-level PLC languages are usually quite limited in their ability to operate

on signals that are other than on/off types. The capability to perform data processing and computation permits the use of more complex control algorithms, communication with other computer-based systems, display of data on a monitor, and input of data by a human operator. Another advantage is the relative ease with which a complicated control program can be interpreted by a user. Explanatory comments can be inserted into the program to facilitate interpretation.

9.4 PERSONAL COMPUTERS AND PROGRAMMABLE AUTOMATION CONTROLLERS

Programmable logic controllers were originally designed to execute the logic and sequence control functions described in Section 9.1, and these are the functions for which the PLC is best suited. However, modern industrial control applications have evolved to include requirements in addition to logic and sequence control. These additional requirements include the following:

- *Analog control.* Proportional-integral-derivative (PID) control is available on some programmable controllers for regulation of continuous variables like temperature and force. These control algorithms have traditionally been implemented using analog controllers. Today the analog control schemes are approximated using the digital computer, with either a PLC or a computer process controller.
- *Motion and servomotor control.* This function is basically the same task as performed by the machine control unit in computer numerical control. Many industrial applications require precise control of motor actuators, and PLCs are being used to implement this type of control.
- *Arithmetic functions.* Use of functions such as basic addition, subtraction, multiplication, and division permit more complex control algorithms to be developed than what is possible with conventional logic and sequence control or PID control.
- *Matrix functions.* The capability to perform matrix operations on stored values can be used to compare the actual values of a set of inputs and outputs with the values stored in memory to determine if some error has occurred.
- *Data processing and reporting.* These functions are typically associated with business applications of personal computers. Controller manufacturers have found it necessary to include these PC capabilities in some of their controller products.
- *Network connectivity and enterprise data integration.* Again, the company's business computer systems are usually associated with these functions, which have evolved to include the need for factory data to be integrated into the corporate information system.

This section considers two approaches that address the need for these additional requirements for industrial control: (1) personal computers and (2) programmable automation controllers.

9.4.1 Personal Computers for Industrial Control

In the early 1990s, personal computers began to be used in industrial control applications normally reserved for programmable logic controllers. PLCs were traditionally favored for use in factories because they were designed to operate in harsh environments, while PCs

were designed for office environments. In addition, with their built-in input/output (I/O) interfaces and real-time operating systems, PLCs could be readily connected to external equipment for process control, whereas PCs required special I/O cards and programs to enable such functions. Finally, personal computers sometimes locked up for no apparent cause, and usually lockups cannot be tolerated in industrial control applications. PLCs are not prone to such malfunctions.

These PLC advantages notwithstanding, the technological evolution of programmable logic controllers has not kept pace with the development of personal computers, new generations of which are introduced with much greater frequency than PLCs. There is much more proprietary software and architecture in PLCs than in PCs, making it difficult to mix and match components from different vendors. Programming a PLC is usually accomplished using ladder logic, but there are differences in the ladder logic coding from different PLC manufacturers, and ladder logic has its limitations for most of the industrial control requirements listed in the introduction to this section. Over time, these factors have resulted in a performance disadvantage for PLCs. PC speeds are typically doubling every 18 months or so, while improvements in PLC technology occur much more slowly and require that individual companies redesign their proprietary software and architectures for each new generation of microprocessors.

PCs can now be purchased in more sturdy enclosures for the dirty and noisy plant environment. They can be equipped with membrane-type keyboards for protection against factory moisture, oil, and dirt, as well as electrical noise. They can be ordered with I/O cards and related hardware to provide the necessary devices to connect to the plants' equipment and processes. Operating systems designed to implement real-time control applications can be installed in addition to traditional office software. And the traditional advantages of personal computers, such as graphics capability for the human-machine interface (HMI), data logging and storage for maintaining process records, and easier network connectivity, are becoming more and more relevant in industrial control applications. In addition, PCs can be readily integrated with peripheral devices such as scanners and printers for automatic identification and data capture (Chapter 12).

There are two basic approaches used in PC-based control systems [10]: soft logic and hard real-time control. In the soft logic configuration, the PC's operating system is Windows, and control algorithms are installed as high-priority programs under the operating system. However, it is possible to interrupt the control tasks in order to service certain system functions in Windows, such as network communications and disk access. When this happens, the control function is delayed, with possible negative consequences to the process. Thus, a soft logic control system cannot be considered a real-time controller in the sense of a PLC. In high-speed control applications or volatile processes, lack of real-time control is a potential hazard. In less critical processes, soft logic works well.

In a hard real-time control system, the PC operates like a PLC, using a real-time operating system, and the control software takes priority over all other software. Windows tasks are executed at a lower priority under the real-time operating system. Windows cannot interrupt the execution of the real-time controller. If Windows locks up, it does not affect the controller operation. Also, the real-time operating system resides in the PC's active memory, so a failure of the hard disk has no effect in a hard real-time control system.

9.4.2 Programmable Automation Controllers

PLC makers have responded to the PC challenge by including PC features in their controller products to distinguish them from conventional PLCs. The term *programmable automation controller* (PAC) has been coined to distinguish the new controllers from conventional programmable logic controllers. A PAC is designed to be used in an industrial environment and to interface with the sensors and actuators whose signals are typically binary, like a conventional PLC, but it also has capabilities that are usually associated with personal computer applications. These capabilities include simulated analog control, data processing, advanced mathematical functions, network connectivity, and enterprise data integration. In effect, a PAC combines the input/output and discrete control capabilities of a PLC with the advanced computational, data processing, and enterprise integration capabilities of a PC.³

Depending on controller vendor, additional features of programmable automation controllers may include motion control,⁴ robotic control, hydraulic and temperature controls, safety monitoring, and access to a local area network for equipment maintenance and diagnostics [3]. These additional features are traditionally enabled by dedicated control hardware, significantly increasing the investment cost of the control system. A PAC enables these control features using software.

An important difference between a PAC and a PLC is how they are programmed. Most PLCs are programmed using ladder logic diagrams, which are quite suitable for defining discrete logic and sequence control. However, when the application also involves analog control and significant network interfacing, these tasks are difficult to program using ladder logic. By contrast, programmable automation controllers are often programmed using more powerful and versatile programming languages such as C or C++, and some PAC suppliers have developed their own proprietary programming languages [15], [17].

To summarize, a programmable automation controller represents the evolution of PLC technology in the following five areas [3]: (1) enhanced control capabilities, increasing the power and sophistication of PLC and PC control capabilities and eliminating the need for special controllers dedicated to specific functions, (2) increased scalability and modularity, so that vendors can provide a controller that matches the requirements and scope of a given industrial control application, (3) more emphasis on information flow and data processing to achieve system integration of control applications into overall factory and enterprise operations, (4) greater concern about network security due to the greater reliance on communications in industrial commerce and the unfortunate existence of Internet malware designed to disrupt such commerce, and (5) more focus on facilitating the programming of industrial controllers so that users can concentrate on producing their products and less on programming their production systems.

³ The author's impression is that the term *programmable automation controller* has not been embraced throughout the controller industry; some vendors still refer to their products that possess the advanced features described here as PLCs.

⁴ It was mentioned at the beginning of Section 9.4 that motion control is basically the same as CNC (computer numerical) control. The motion control accomplished by a PAC does not have the powerful interpolation functions typically available on a CNC machine control unit (Table 7.1) [3].

REFERENCES

- [1] BOUCHER, T. O., *Computer Automation in Manufacturing*, Chapman & Hall, London, UK, 1996.
- [2] CLEVELAND, P., “PLCs Get Smaller, Adapt to Newest Technology,” *Instrumentation and Control Systems*, April 1997, pp 23–32.
- [3] HOGAN, B. J., and P. WAURZYNIAK, “Controlling the Process,” *Manufacturing Engineering*, January 2011, pp. 51–58.
- [4] HUGHES, T. A., *Programmable Controllers*, 4th ed., Instrument Society of America, Research Triangle Park, NC, 2005.
- [5] *International Standard for Programmable Controllers*, Standard IEC 1131-3, International Electrotechnical Commission, Geneva, Switzerland, 1993.
- [6] JONES, T., and L. A. BRYAN, *Programmable Controllers*, International Programmable Controls, Inc., An IPC/ASTEC Publication, Atlanta, GA, 1985.
- [7] LAVALEE, R., “Soft Logic’s New Challenge: Distributed Machine Control,” *Control Engineering*, August, 1996, pp 51–58.
- [8] *MICROMENTOR: Understanding and Applying Micro Programmable Controllers*, Allen-Bradley Company, Inc., Milwaukee, WI, 1995.
- [9] MORLEY, R., “The Techy History of Modicon,” manuscript submitted to *Technology* magazine, 1989.
- [10] STENERSON, J., *Fundamentals of Programmable Logic Controllers, Sensors, and Communications*, 3rd ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2004.
- [11] WEBB, J. W., and R. A. REIS, *Controllers: Principles and Applications*, 4th ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 1999.
- [12] [www.rockwellautomation.com/programmable controllers](http://www.rockwellautomation.com/programmable%20controllers)
- [13] www.ctc-control.com/products
- [14] www.ge-ip.com/products/pac-programmable-controllers
- [15] www.ni.com/pac
- [16] www.opto22.com
- [17] www.selinc.com
- [18] [www.ueidaq.com/programmable automation controller](http://www.ueidaq.com/programmable%20automation%20controller)
- [19] www.wikipedia.org/wiki/Ladder_logic
- [20] www.wikipedia.org/wiki/Programmable_logic_controller

REVIEW QUESTIONS

- 9.1 Briefly define the two categories of discrete process control.
- 9.2 What is an AND gate? How does it operate on two binary inputs?
- 9.3 What is an OR gate? How does it operate on two binary inputs?
- 9.4 What is Boolean algebra? What was its original purpose?
- 9.5 What is the difference between a delay-off timer and a delay-on timer?
- 9.6 What is the difference between an up counter and a down counter?
- 9.7 What is a ladder logic diagram?
- 9.8 The two types of components in a ladder logic diagram are contacts and coils. Give two examples of each type.

- 9.9 What is a programmable logic controller?
- 9.10 What are the advantages of using a PLC rather than conventional relays, timers, counters, and other hardwired control components?
- 9.11 What are the four basic components of a PLC?
- 9.12 The typical operating cycle of the PLC, called a *scan*, consists of three parts: (1) input scan, (2) program scan, and (3) output scan. Briefly describe what is accomplished in each part.
- 9.13 Name the five PLC programming methods identified in the International Standard for Programmable Controllers (IEC 61131-3).
- 9.14 What are the reasons and factors that explain why personal computers are being used with greater and greater frequency for industrial control applications?
- 9.15 Name the two basic approaches used in PC-based control systems.
- 9.16 Modern industrial control applications have evolved to include requirements in addition to logic and sequence control. What are these additional requirements?
- 9.17 What is a programmable automation controller?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

- 9.1 Construct the truth table for the robot interlock system in Example 9.1.
- 9.2 Construct the ladder logic diagram for the robot interlock system in Example 9.1.
- 9.3 **(A)** Write the Boolean logic expressions for the push-button switch of Example 9.2 using the following symbols: X1 = START, X2 = STOP, P = POWER-TO-MOTOR, and M = MOTOR. Hint: See Figure 9.4(b).
- 9.4 In the circuit of Figure 9.1(a), suppose a photodetector were used to determine whether the lamp worked. If the lamp does not light when both switches are closed, the photodetector causes a buzzer to sound. Construct the truth table for this system.
- 9.5 Construct the ladder logic diagram for the preceding problem.
- 9.6 In the circuit of Figure 9.1(b), suppose a photodetector were used to determine whether the lamp worked. If the lamp does not light when either X1 or X2 switch is closed, the photodetector causes a buzzer to sound. Construct the truth table for this system.
- 9.7 Construct the ladder logic diagram for the preceding problem.
- 9.8 Construct the ladder logic diagrams for (a) the NAND gate and (b) the NOR gate.
- 9.9 Draw the ladder logic diagram for the Boolean logic equation: $Y = (X1 + X2) \cdot X3$.
- 9.10 Draw the ladder logic diagram for the Boolean logic equation: $Y = (X1 + X2) \cdot (X3 + X4)$.
- 9.11 Draw the ladder logic diagram for the Boolean logic equation: $Y = (X1 \cdot X2) + X3$.
- 9.12 **(A)** Write the language statements for Problem 9.9 using the instruction set in Table 9.7.
- 9.13 Write the language statements for Problem 9.10 using the instruction set in Table 9.7.
- 9.14 Write the language statements for Problem 9.11 using the instruction set in Table 9.7.
- 9.15 Write the low-level language statements for the robot interlock system in Example 9.1 using the instruction set in Table 9.7.
- 9.16 Write the low-level language statements for the lamp and photodetector system in Problem 9.4 using the instruction set in Table 9.7.
- 9.17 An industrial furnace is controlled as follows: The contacts of a bimetallic strip inside the furnace close if the temperature falls below the set point and open when the temperature is above the set point. The contacts regulate a control relay which turns on and off the heating

elements of the furnace. If the door to the furnace is open, the heating elements are turned off until the door is closed. Let $X1$ = contacts of bimetallic strip, $X2$ = door interlock, $C1$ = relay contacts, and $Y1$ = heating elements. Construct the ladder logic diagram for the system.

- 9.18 (A)** For the previous problem, write the low-level language statements for the system using the PLC instruction set in Table 9.7.
- 9.19** In the manual operation of a sheet metal stamping press, a two-button safety interlock system is used to prevent the operator from inadvertently actuating the press while his hand is in the die. Both buttons must be depressed to actuate the stamping cycle. In this system, one press button is located on one side of the press while the other button is located on the opposite side. During the work cycle, the operator inserts the part into the die and depresses both push buttons, using both hands. (a) Write the truth table for this interlock system. (b) Write the Boolean logic expression for the system. (c) Construct the ladder logic diagram for the system.
- 9.20** An emergency stop system is to be designed for a certain automatic production machine. A single “start” button is used to turn on the power to the machine at the beginning of the day. In addition, there are two “stop” buttons located at two locations on the machine, either of which can be pressed to immediately turn off power to the machine. Let $X1$ = start button (normally open), $X2$ = stop button 1 (normally closed), $X3$ = stop button 2 (normally closed), and Y = power-to-machine. (a) Construct the truth table for this system. (b) Write the Boolean logic expression for the system. (c) Construct the ladder logic diagram for the system.
- 9.21** An industrial robot performs a machine loading and unloading operation. A PLC is used as the cell controller. The cell operates as follows: (1) a human worker places a part into a nest, (2) the robot reaches over and picks up the part and places it into an induction heating coil, (3) a time of 10 sec is allowed for the heating operation, and (4) the robot reaches into the coil, retrieves the part, and places it on an outgoing conveyor. A limit switch $X1$ (normally open) is used to indicate that the part is in the nest in step (1). This energizes output contact $Y1$ to signal the robot to execute step (2) of the work cycle (this is an output contact for the PLC, but an input interlock signal for the robot controller). A photocell $X2$ is used to indicate that the part has been placed into the induction heating coil $C1$. Timer $T1$ is used to provide the 10-sec heating cycle in step (3), at the end of which, output contact $Y2$ is used to signal the robot to execute step (4). Construct the ladder logic diagram for the system.
- 9.22** For the previous problem, write the low-level language statements for the system using the PLC instruction set in Table 9.7.
- 9.23** Write the low-level language statements for the fluid filling operation in Example 9.6 using the instruction set in Table 9.7. Hint: See Figure 9.5.
- 9.24** In the fluid filling operation of Example 9.6, suppose a sensor (e.g., a submerged float switch) is used to determine whether the contents of the tank have been evacuated, rather than rely on timer $T2$ to empty the tank. Construct the ladder logic diagram for this revised system.
- 9.25** For the previous problem, write the low-level language statements for the system using the PLC instruction set in Table 9.7.

Material Transport Systems

CHAPTER CONTENTS

- 10.1 Overview of Material Handling
 - 10.1.1 Material Handling Equipment
 - 10.1.2 Design Considerations in Material Handling
- 10.2 Material Transport Equipment
 - 10.2.1 Industrial Trucks
 - 10.2.2 Automated Guided Vehicles
 - 10.2.3 Rail-Guided Vehicles
 - 10.2.4 Conveyors
 - 10.2.5 Cranes and Hoists
- 10.3 Analysis of Material Transport Systems
 - 10.3.1 Analysis of Vehicle-Based Systems
 - 10.3.2 Conveyor Analysis

Material handling is defined by the Material Handling Industry of America¹ as “the movement, protection, storage and control of materials and products throughout the process of manufacture and distribution, consumption and disposal” [22]. The handling of materials must be performed safely, efficiently, at low cost, in a timely manner, accurately (the right materials in the right quantities to the right locations), and without damage to the materials. Material handling is an important yet often overlooked issue in production. The cost of material handling is a significant portion of total production cost, estimates

¹The Material Handling Industry of America (MHIA) is the trade association for material handling companies that do business in North America.

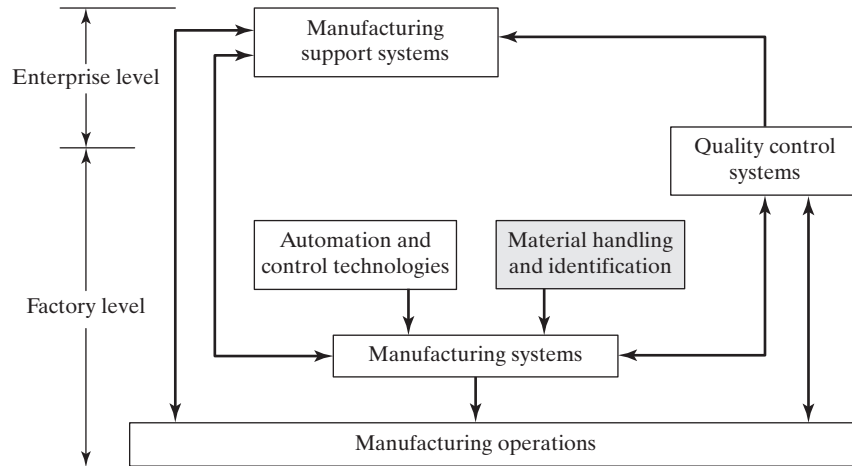


Figure 10.1 Material handling and identification in the production system.

averaging around 20–25% of total manufacturing labor cost in the United States [3]. This proportion varies, depending on type of production and degree of automation in material handling.

This part of the book covers the material handling and identification systems used in production. The position of material handling in the larger production system is shown in Figure 10.1. The coverage is divided into three major categories: (1) material transport systems, discussed in the present chapter, (2) storage systems (Chapter 11), and (3) automatic identification and data capture (Chapter 12). In addition, several material handling devices are discussed in other chapters of the text, including industrial robots (Chapter 8), pallet shuttles in NC machining centers (Chapter 14), conveyors in manual assembly lines (Chapter 15), transfer mechanisms in automated transfer lines (Chapter 16), and parts feeding devices in automated assembly (Chapter 17).

10.1 OVERVIEW OF MATERIAL HANDLING

Material handling is one of the activities in the larger distribution system by which materials, parts, and products are moved, stored, and tracked in the world's commercial infrastructure. The term commonly used for the larger system is *logistics*, which is concerned with the acquisition, movement, storage, and distribution of materials and products, as well as the planning and control of these operations in order to satisfy customer demand. Logistics operations can be divided into two basic categories: external logistics and internal logistics. **External logistics** is concerned with transportation and related activities that occur outside of a facility. In general, these activities involve the movement of materials between different geographical locations. The five traditional modes of transportation are rail, truck, air, ship, and pipeline. **Internal logistics**, more popularly known as material handling, involves the movement and storage of materials inside a given facility. The interest in this book is on internal logistics. This section describes the various types of equipment used in material handling, and then identifies several considerations in the design of material handling systems.

10.1.1 Material Handling Equipment

A great variety of material handling equipment is available commercially. The equipment can be classified into five categories [21]: (1) transport equipment, (2) positioning equipment, (3) unit load formation equipment, (4) storage equipment, and (5) identification and control equipment.

Transport Equipment. Material transport equipment is used to move materials inside a factory, warehouse, or other facility. The five main types of equipment are (1) industrial trucks, (2) automated guided vehicles, (3) rail-guided vehicles, (4) conveyors, and (5) hoists and cranes. These equipment types are described in Section 10.2.

Positioning Equipment. This category consists of equipment used to handle parts and other materials at a single location: for example, loading and unloading parts from a production machine in a work cell. Positioning is accomplished by industrial robots that perform material handling (Section 8.4.1) and parts feeders in automated assembly (Section 17.1.2). Hoists used at a single location can also be included in this category. The general role of positioning at a workstation is discussed in Section 13.1.2.

Unit Load Formation Equipment. The term *unitizing equipment* refers to (1) containers used to hold individual items during handling and (2) equipment used to load and package the containers. Containers include pallets, tote pans, boxes, baskets, barrels, and drums, some of which are shown in Figure 10.2. Although seemingly mundane, containers are very important for moving materials efficiently as a unit load, rather than as individual items. Pallets and other containers that can be handled by forklift equipment are widely used in production and distribution operations. Most factories, warehouses, and distribution centers use forklift trucks to move unit loads on pallets. A given facility must often standardize on a specific type and size of container if it utilizes automatic transport and/or storage equipment to handle the loads.

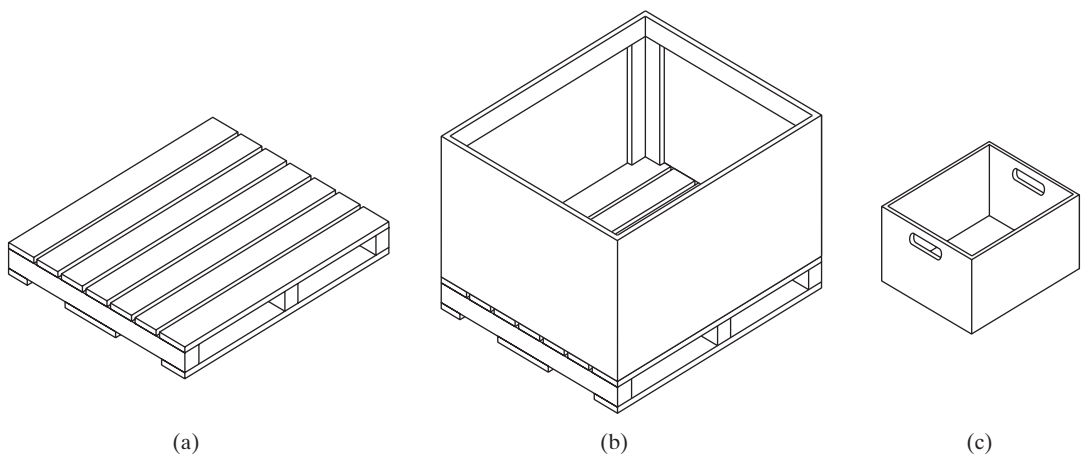


Figure 10.2 Examples of unit load containers for material handling: (a) wooden pallet, (b) pallet box, and (c) tote box.

The second category of unitizing equipment includes *palletizers*, which are designed to automatically load cartons onto pallets and shrink-wrap plastic film around them for shipping, and *depalletizers*, which are designed to unload cartons from pallets. Other wrapping and packaging machines are also included in this equipment category.

Storage Equipment. Although it is generally desirable to reduce the storage of materials in manufacturing, it seems unavoidable that raw materials and work-in-process spend some time in storage, even if only temporarily. And finished products are likely to spend time in a warehouse or distribution center before being delivered to the final customer. Accordingly, companies must give consideration to the most appropriate methods for storing materials and products prior to, during, and after manufacture.

Storage methods and equipment can be classified into two major categories: (1) conventional storage methods and (2) automated storage systems. Conventional storage methods include bulk storage (storing items in an open floor area), rack systems (for pallets), shelving and bins, and drawer storage. In general, conventional storage methods are labor-intensive. Human workers put materials into storage and retrieve them from storage. Automated storage systems are designed to reduce or eliminate the manual labor involved in these functions. Both conventional and automated storage methods are described in detail in Chapter 11. Mathematical models are developed to predict throughput and other performance characteristics of automated storage systems.

Identification and Control Equipment. The scope of material handling includes keeping track of the materials being moved and stored. This is usually done by affixing some kind of label to the item, carton, or unit load that uniquely identifies it. The most common label used today is a bar code that can be read quickly and automatically by bar code readers. This is the same basic technology used by grocery stores and retail merchandisers. An alternative identification technology that is growing in importance is RFID (for radio frequency identification). Bar codes, RFID, and other automatic identification techniques are discussed in Chapter 12.

10.1.2 Design Considerations in Material Handling

Material handling equipment is usually assembled into a system. The system must be specified and configured to satisfy the requirements of a particular application. Design of the system depends on the materials to be handled, quantities and distances to be moved, type of production facility served by the handling system, and other factors, including available budget. This section considers these factors that influence the design of the material handling system.

Material Characteristics. For handling purposes, materials can be classified by the physical characteristics presented in Table 10.1, suggested by a classification scheme of Muther and Haganas [15]. Design of the material handling system must take these factors into account. For example, if the material is a liquid that is to be moved over long distances in great volumes, then a pipeline is the appropriate transport means. But this handling method would be infeasible for moving a liquid contained in barrels or other containers. Materials in a factory usually consist of solid items: raw materials, parts, and finished or semifinished products.

TABLE 10.1 Characteristics of Materials in Material Handling

Category	Measures or Descriptors
Physical state	Solid, liquid, or gas
Size	Volume, length, width, height
Weight	Weight per piece, weight per unit volume
Shape	Long and flat, round, square, etc.
Condition	Hot, cold, wet, dirty, sticky
Risk of damage	Fragile, brittle, sturdy
Safety risk	Explosive, flammable, toxic, corrosive, etc.

Flow Rate, Routing, and Scheduling. In addition to material characteristics, other factors must be considered in determining which type of equipment is most appropriate for the application. These other factors include (1) quantities and flow rates of materials to be moved, (2) routing factors, and (3) scheduling of the moves.

The amount or quantity of material to be moved affects the type of handling system that should be installed. If large quantities of material must be handled, then a dedicated handling system is appropriate. If the quantity of a particular material type is small but there are many different material types to be moved, then the handling system must be designed to be shared by the various materials moved. The amount of material moved must be considered in the context of time, that is, how much material is moved within a given time period. The amount of material moved per unit time is referred to as the *flow rate*. Depending on the form of the material, flow rate is measured in pieces per hour, pallet loads per hour, tons per hour, or similar units. Whether the material must be moved as individual units, in batches, or continuously has an effect on the selection of handling method.

Routing factors include pickup and drop-off locations, move distances, routing variations, and conditions that exist along the routes. Given that other factors remain constant, handling cost is directly related to the distance of the move: The longer the move distance, the greater the cost. Routing variations occur because different materials follow different flow patterns in the factory or warehouse. If these differences exist, the material handling system must be flexible enough to deal with them. Conditions along the route include floor surface condition, traffic congestion, whether a portion of the move is outdoors, whether the path is straight line or involves turns and changes in elevation, and the presence or absence of people along the path. All of these factors affect the design of the material transport system.

Scheduling relates to the timing of each individual delivery. In production as well as in many other material handling applications, the material must be picked up and delivered promptly to its proper destination to maintain peak performance and efficiency of the overall system. To the extent required by the application, the handling system must be responsive to this need for timely pickup and delivery of the items. Rush jobs increase material handling cost. Scheduling urgency is often mitigated by providing space for buffer stocks of materials at pickup and drop-off points. This allows a “float” of materials to exist in the system, thus reducing the pressure on the handling system for immediate response to a delivery request.

Plant Layout. The material handling system is an important factor in plant layout design. When a new facility is being planned, the handling system should be considered

part of the layout. In this way, there is greater opportunity to create a layout that optimizes material flow in the building and utilizes the most appropriate type of handling system. In the case of an existing facility, there are more constraints on the design of the handling system. The present arrangement of departments and equipment in the building often limits the attainment of optimum flow patterns.

Section 2.3 describes the conventional plant layouts used in manufacturing: (1) process layout, (2) product layout, and (3) fixed-position layout. Different material handling systems are generally required for the three layout types. Table 10.2 summarizes the characteristics of the three conventional layout types and the kinds of material handling equipment usually associated with each layout type.

In process layouts, a variety of parts and/or products are manufactured in small or medium batch sizes. The handling system must be flexible to deal with the variations. Considerable work-in-process is usually one of the characteristics of batch production, and the material handling system must be capable of accommodating this inventory. Hand trucks and forklift trucks (for moving pallet loads of parts) are commonly used in process layouts. Factory applications of automated guided vehicle systems are growing because they represent a versatile means of handling the different load configurations in medium and low volume production. Work-in-progress is often stored on the factory floor near the next scheduled machines. More systematic ways of managing in-process inventory include automated storage systems (Section 11.3).

A product layout involves production of a standard or nearly identical types of product in relatively high quantities. Final assembly plants for cars, trucks, and appliances are usually designed as product layouts. The transport system that moves the product is typically characterized as fixed route, mechanized, and capable of large flow rates. It sometimes serves as a storage area for work-in-process to reduce effects of downtime between production areas along the line of product flow. Conveyor systems are common in product layouts. Delivery of component parts to the various assembly workstations along the flow path is accomplished by trucks and similar unit load vehicles.

Finally, in a fixed-position layout, the product is large and heavy and therefore remains in a single location during most of its fabrication. Heavy components and subassemblies must be moved to the product. Handling systems used for these moves in fixed-position layouts are large and often mobile. Cranes, hoists, and trucks are common in this situation.

Unit Load Principle. The Unit Load Principle stands as an important and widely applied principle in material handling. A *unit load* is simply the mass that is to be moved

TABLE 10.2 Types of Material Handling Equipment Associated with Three Layout Types

Layout Type	Characteristics	Typical Material Handling Equipment
Process	Variations in product and processing, low and medium production rates	Hand trucks, forklift trucks, automated guided vehicle systems
Product	Limited product variety, high production rate	Conveyors for product flow, industrial trucks and automated guided vehicles to deliver components to stations
Fixed-position	Large product size, low production rate	Cranes, hoists, industrial trucks

TABLE 10.3 Standard Pallet Sizes Commonly Used in Factories and Warehouses

Depth = x Dimension	Width = y Dimension
800 mm (32 in)	1,000 mm (40 in)
900 mm (36 in)	1,200 mm (48 in)
1,000 mm (40 in)	1,200 mm (48 in)
1,060 mm (42 in)	1,060 mm (42 in)
1,200 mm (48 in)	1,200 mm (48 in)

Sources: [6], [16].

or otherwise handled at one time. The unit load may consist of only one part, a container loaded with multiple parts, or a pallet loaded with multiple containers of parts. In general, the unit load should be designed to be as large as is practical for the material handling system that will move or store it, subject to considerations of safety, convenience, and access to the materials making up the unit load. This principle is widely applied in the truck, rail, and ship industries. Palletized unit loads are collected into truck loads, which then become larger unit loads themselves. Then these truck loads are aggregated once again on freight trains or ships, in effect becoming even larger unit loads.

There are good reasons for using unit loads in material handling [16]: (1) multiple items can be handled simultaneously, (2) the required number of trips is reduced, (3) loading and unloading times are reduced, and (4) product damage is decreased. Using unit loads results in lower cost and higher operating efficiency.

Included in the definition of unit load is the container that holds or supports the materials to be moved. To the extent possible, these containers are standardized in size and configuration to be compatible with the material handling system. Examples of containers used to form unit loads in material handling are illustrated in Figure 10.2. Of the available containers, pallets are probably the most widely used, owing to their versatility, low cost, and compatibility with various types of material handling equipment. Most factories and warehouses use forklift trucks to move materials on pallets. Table 10.3 lists some of the most popular standard pallet sizes in use today. These standard pallet sizes are used in the analysis of automated storage/retrieval systems in Chapter 11.

10.2 MATERIAL TRANSPORT EQUIPMENT

This section covers the five categories of material transport equipment commonly used to move parts and other materials in manufacturing and warehouse facilities: (1) industrial trucks, manual and powered; (2) automated guided vehicles; (3) rail-guided vehicles; (4) conveyors; and (5) cranes and hoists. Table 10.4 summarizes the principal features and kinds of applications for each equipment category. Section 10.3 considers quantitative techniques by which material transport systems consisting of this equipment can be analyzed.

10.2.1 Industrial Trucks

Industrial trucks are divided into two categories: nonpowered and powered. The nonpowered types are often referred to as hand trucks because they are pushed or pulled by human workers. Quantities of material moved and distances traveled are relatively

TABLE 10.4 Summary of Features and Applications of Five Categories of Material Handling Equipment

Handling Equipment	Features	Typical Applications
Industrial trucks, manual	Low cost Low rate of deliveries	Moving light loads in a factory
Industrial trucks, powered	Medium cost	Movement of pallet loads and palletized containers in a factory or warehouse
Automated guided vehicle systems	High cost Battery-powered vehicles Flexible routing Non-obstructive pathways	Moving pallet loads in factory or warehouse Moving work-in-process along variable routes in low and medium production
Rail-guided vehicles	High cost Flexible routing On-the-floor or overhead types	Moving assemblies, products, or pallet loads along variable routes in factory or warehouse Moving large quantities of items over fixed routes in a factory or warehouse
Conveyors, powered	Great variety of equipment In-floor, on-the-floor, or overhead Mechanical power to move loads resides in pathway	Sortation of items in a distribution center Moving products along a manual assembly line
Cranes and hoists	Lift capacities of more than 100 tons possible	Moving large, heavy items in factories, mills, warehouses, etc.

low when this type of equipment is used to transport materials. Hand trucks are classified as either two-wheel or multiple-wheel. Two-wheel hand trucks, Figure 10.3(a), are generally easier to manipulate by the worker but are limited to lighter loads. Multiple-wheeled hand trucks are available in several types and sizes. Two common types are dollies and pallet trucks. Dollies are simple frames or platforms as shown in Figure 10.3(b). Various wheel configurations are possible, including fixed wheels and caster-type wheels. Pallet trucks, shown in Figure 10.3(c), have two forks that can be inserted through the openings in a pallet. A lift mechanism is actuated by the worker to lift and lower the pallet off the ground using small diameter wheels near the end of the forks. In operation, the worker inserts the forks into the pallet, elevates the load, pulls the truck to its destination, lowers the pallet, and removes the forks.

Powered trucks are self-propelled and guided by a worker. Three common types are used in factories and warehouses: (a) walkie trucks, (b) forklift rider trucks, and

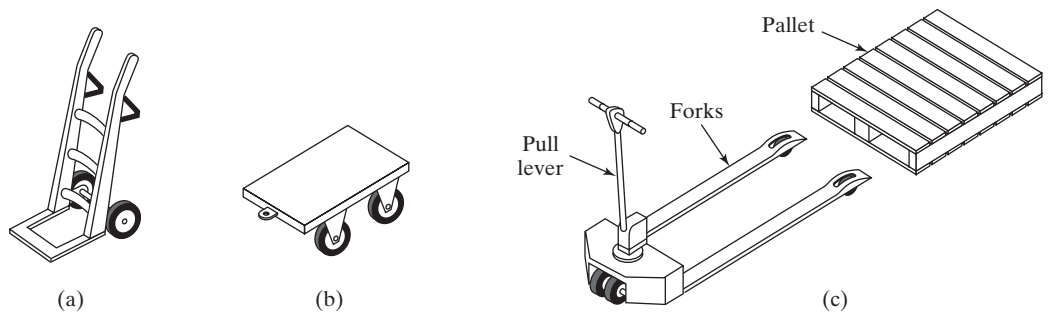


Figure 10.3 Examples of nonpowered industrial trucks (hand trucks): (a) two-wheel hand truck, (b) four-wheel dolly, and (c) hand-operated low-lift pallet truck.

(c) towing tractors. Walkie trucks, Figure 10.4(a), are battery-powered vehicles equipped with wheeled forks for insertion into pallet openings but with no provision for a worker to ride on the vehicle. The truck is steered by a worker using a control handle at the front of the vehicle. The forward speed of a walkie truck is limited to around 3 mi/hr (5 km/hr), about the normal walking speed of a human.

Forklift rider trucks, Figure 10.4(b), are distinguished from walkie trucks by the presence of a cab for the worker to sit in and drive the vehicle. Forklift trucks range in load carrying capacity from about 450 kg (1,000 lb) up to more than 4,500 kg (10,000 lb). Forklift trucks have been modified to suit various applications. Some trucks have high reach capacities for accessing pallet loads on high rack systems, while others are capable of operating in the narrow aisles of high-density storage racks. Power sources for forklift trucks are either internal combustion engines (gasoline, liquefied petroleum gas, or compressed natural gas) or electric motors (using on-board batteries).

Industrial towing tractors, Figure 10.4(c), are designed to pull one or more trailing carts over the relatively smooth surfaces found in factories and warehouses. They are generally used for moving large amounts of materials between major collection and distribution areas. The runs between origination and destination points are usually fairly long. Power is supplied either by electric motor (battery-powered) or internal combustion engine. Tow tractors also find significant applications in air transport operations for moving baggage and air freight in airports.

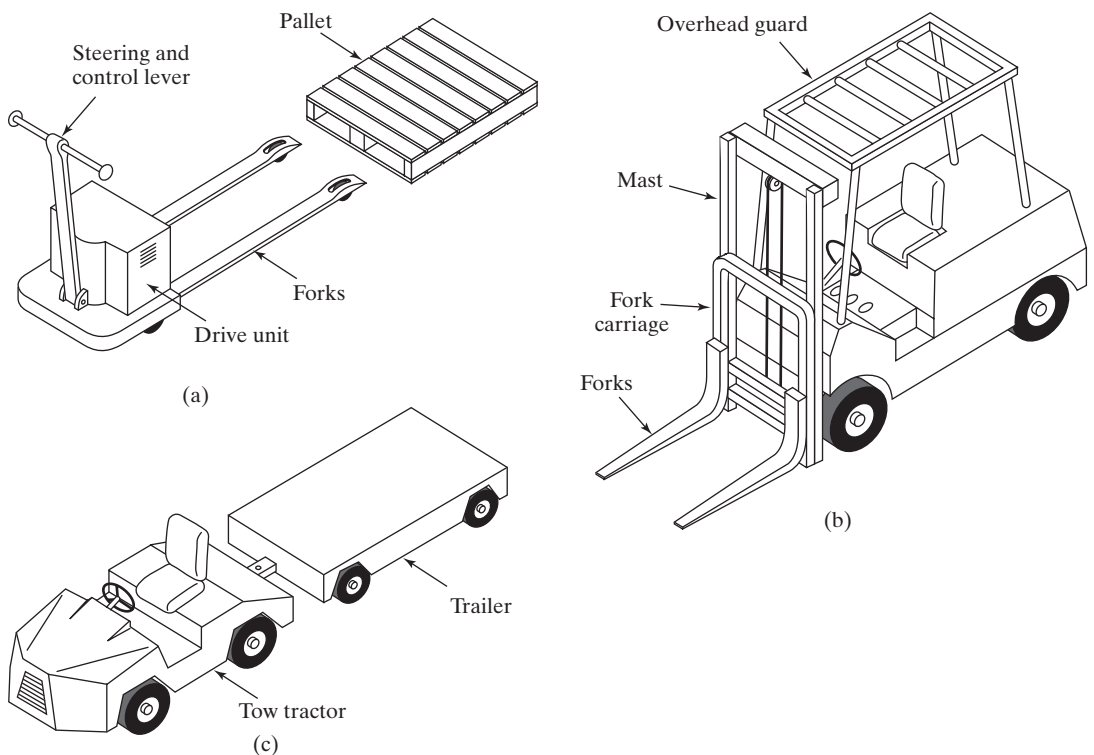


Figure 10.4 Three principal types of powered trucks: (a) walkie truck, (b) forklift truck, and (c) towing tractor.

10.2.2 Automated Guided Vehicles

An automated guided vehicle system (AGVS) is a material handling system that uses independently operated, self-propelled vehicles guided along defined pathways.² The AGVs are powered by on-board batteries that allow many hours of operation (8–16 hr is typical) before needing to be recharged. A distinguishing feature of an AGVS, compared to rail-guided vehicle systems and most conveyor systems, is that the pathways are unobtrusive.

Types of Vehicles. Automated guided vehicles can be divided into the following categories: (1) towing vehicles for driverless trains, (2) pallet trucks, and (3) unit load carriers, illustrated in Figure 10.5. A driverless train consists of a towing vehicle (the AGV) pulling one or more trailers to form a train, as in Figure 10.5(a). It was the first type of AGVS to be introduced and is still widely used today. A common application is moving heavy payloads over long distances in warehouses or factories with or without intermediate pickup and drop-off points along the route. For trains consisting of 5–10 trailers, this is an efficient transport system.

Automated guided pallet trucks, Figure 10.5(b), are used to move palletized loads along predetermined routes. In the typical application the vehicle is backed into the

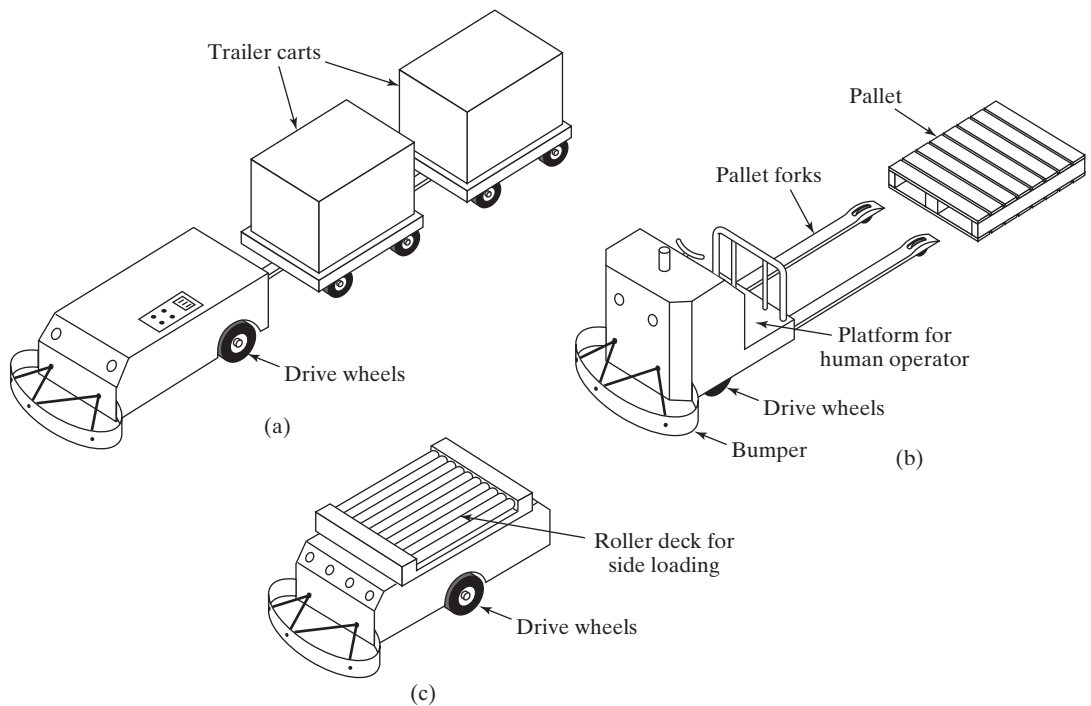


Figure 10.5 Three types of automated guided vehicles: (a) driverless automated guided train, (b) AGV pallet truck, and (c) unit load carrier.

²The term *automated guided cart* (AGC) is used by some AGV vendors to identify vehicles that are smaller and lighter weight than conventional AGVs and are available at significantly lower prices.

loaded pallet by a human worker who steers the truck and uses its forks to elevate the load slightly. Then the worker drives the pallet truck to the guide path and programs its destination, and the vehicle proceeds automatically to the destination for unloading. The load capacity of an AGVS pallet truck ranges up to several thousand kilograms, and some trucks are capable of handling two pallets rather than one. A special type of pallet truck is the forklift AGV, which uses forks that are similar to those of a forklift truck to engage pallets. This vehicle can achieve significant vertical movement of its forks to reach loads on racks and shelves.

AGV unit load carriers are used to move unit loads from one station to another. They are often equipped for automatic loading and unloading of pallets or tote pans by means of powered rollers, moving belts, mechanized lift platforms, or other devices built into the vehicle deck. A typical unit load AGV is illustrated in Figure 10.5(c).

Variations of unit load carriers include light load AGVs, assembly line AGVs, and heavy-duty AGVs. The light load AGV is a relatively small vehicle with corresponding light load capacity (typically 250 kg or less). It does not require the same large aisle width as a conventional AGV. Light load guided vehicles are designed to move small loads (single parts, small baskets, or tote pans of parts) through plants of limited size engaged in light manufacturing. An assembly line AGV is designed to carry a partially completed subassembly through a sequence of assembly workstations to build the product. Heavy-duty unit load AGVs are used for loads up to 125 tons [20]. Applications include moving large paper rolls in printing companies, heavy steel coils in stamping plants, and cargo containers in seaport docking operations.

AGVS Applications. In general, an AGVS is appropriate when different materials are moved from various load points to various unload points. The principal AGVS applications in production and logistics are (1) driverless train operations, (2) storage and distribution, (3) assembly line applications, and (4) flexible manufacturing systems. Driverless train operations have already been described; they involve the movement of large quantities of material over relatively long distances.

The second application area is storage and distribution operations. Unit load carriers and pallet trucks are typically used in these applications, which involve movement of material in unit loads. The applications often interface the AGVS with some other automated handling or storage system, such as an automated storage/retrieval system (AS/RS) in a distribution center. The AGVS delivers incoming unit loads contained on pallets from the receiving dock to the AS/RS, which places the items into storage, and the AS/RS retrieves individual pallet loads from storage and transfers them to vehicles for delivery to the shipping dock. Storage/distribution operations also include light manufacturing and assembly plants in which work-in-process is stored in a central storage area and distributed to individual workstations for processing. Electronics assembly is an example of these kinds of applications. Components are “kitted” at the storage area and delivered in tote pans or trays to the assembly workstations in the plant. Light load AGVs are the appropriate vehicles in these applications.

AGV systems are used in assembly line operations, based on a trend that began in Europe in the automotive industry. Unit load carriers and light load guided vehicles are used in these lines. Station-to-station movement of car bodies and engines in final assembly plants is a typical application. In these situations, the AGVs remain with the work units during assembly, rather than serving a pickup and drop-off function.

Another application area for AGVS technology is flexible manufacturing systems (FMSs, Chapter 19). In the typical operation, starting work parts are placed onto pallet

fixtures by human workers in a staging area, and the AGVs deliver the parts to the individual workstations in the system. When the AGV arrives at the station, the pallet is transferred from the vehicle platform to the station (such as the worktable of a machine tool) for processing. At the completion of processing, a vehicle returns to pick up the work and transport it to the next assigned station. An AGVS provides a versatile material handling system to complement the flexibility of the FMS.

AGVS technology is still developing, and the industry is continually working to design new systems to respond to new application requirements. An interesting example that combines two technologies involves the use of a robotic manipulator mounted on an automated guided vehicle to provide a mobile robot for performing complex handling tasks at various locations in a plant.

Vehicle Guidance Technologies. The guidance system is the method by which AGVS pathways are defined and vehicles are controlled to follow the pathways. The technologies used in commercial AGV systems for vehicle guidance include (1) imbedded guide wires, (2) paint strips, (3) magnetic tape, (4) laser-guided vehicles (LGVs), and (5) inertial navigation.

In the imbedded guide wire method, electrical wires are placed in a shallow channel that has been cut into the surface of the floor. After the guide wire is installed, the channel is filled with cement to eliminate the discontinuity in the floor surface. The guide wire is connected to a frequency generator, which emits a low-voltage, low-frequency signal in the range 1–15 kHz. This induces a magnetic field along the pathway that can be followed by sensors on board each vehicle. The operation of a typical system is illustrated in Figure 10.6. Two sensors are mounted on the vehicle on either side of the guide wire. When the vehicle is located such that the guide wire is directly between the two coils, the intensity of the magnetic field measured by each sensor is equal. If the vehicle strays to one side or the other, or if the guide wire path changes direction, the magnetic field intensity at the two sensors becomes unequal. This difference is used to control the steering motor, which makes the required changes in vehicle direction to equalize the two sensor signals, thereby tracking the guide wire.

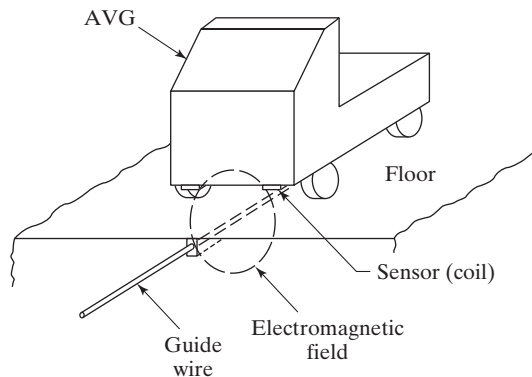


Figure 10.6 Operation of the on-board sensor system that uses two coils to track the magnetic field in the guide wire.

A typical AGVS layout contains multiple loops, branches, side tracks, and spurs, as well as pickup and drop-off stations. The most appropriate route must be selected from the alternative pathways available to a vehicle as it moves to a specified destination in the system. When a vehicle approaches a branching point where the guide path forks into two (or more) pathways, the vehicle must have a means of deciding which path to take. The two principal methods of making this decision in commercial wire-guided systems are (1) the frequency select method and (2) the path switch select method. In the frequency select method, the guide wires leading into the two separate paths at the switch have different frequencies. As the vehicle enters the switch, it reads an identification code on the floor to determine its location. Depending on its programmed destination, the vehicle selects the correct guide path by following only one of the frequencies. This method requires a separate frequency generator for each different frequency used in the guide-path layout.

The path switch select method operates with a single frequency throughout the guide-path layout. To control the path of a vehicle at a switch, the power is turned off in all other branches except the one that the vehicle is to travel on. To accomplish routing by the path switch select method, the guide-path layout is divided into blocks that are electrically insulated from each other. The blocks can be turned on and off either by the vehicles themselves or by a central control computer.

When paint strips are used to define the pathway, the vehicle uses an optical sensor capable of tracking the paint. The strips can be taped, sprayed, or painted on the floor. One system uses a 1-in-wide paint strip containing fluorescent particles that reflect an ultraviolet (UV) light source from the vehicle. The on-board sensor detects the reflected light in the strip and controls the steering mechanism to follow it. Paint strip guidance is useful in environments where electrical noise renders the guide wire system unreliable or when the installation of guide wires in the floor surface is not practical. One problem with this guidance method is that the paint strip deteriorates with time. It must be kept clean and periodically replaced.

Magnetic tape is installed on the floor surface to define the pathways. It avoids the cutting of the floor surface that is required when imbedded guide wires are used. It also allows the pathways to be conveniently redefined as the needs of the facility change over time. Unlike imbedded wire guidance, which emits an active powered signal, magnetic tape is a passive guidance technology.

Unlike the previous guidance methods, laser-guided vehicles (LGVs) operate without continuously defined pathways. Instead, they use a combination of dead reckoning and reflective beacons located throughout the plant that can be identified by on-board laser scanners. **Dead reckoning** refers to the capability of a vehicle to follow a given route in the absence of a defined pathway in the floor. Movement of the vehicle along the route is accomplished by computing the required number of wheel rotations in a sequence of specified steering angles. The computations are performed by the vehicle's on-board computer. As one would expect, positioning accuracy of dead reckoning decreases over long distances. Accordingly, the location of the laser-guided vehicle must be periodically verified by comparing the calculated position with one or more known positions. These known positions are established using the reflective beacons located strategically throughout the plant on columns, walls, and machines. These beacons can be sensed by the laser scanner on the vehicle. Based on the positions of the beacons, the on-board navigation computer uses triangulation to update the positions calculated by dead reckoning.

It should be noted that dead reckoning can be used by AGV systems that are normally guided by in-floor guide wires, paint strips, or magnetic tape. This capability allows

the vehicle to cross steel plates in the factory floor where guide wires cannot be installed or to depart from the guide path for positioning at a load/unload station. At the completion of the dead reckoning maneuver, the vehicle is programmed to return to the guide path to resume normal guidance control.

Inertial navigation, also known as *inertial guidance*, involves the use of on-board gyroscopes and/or other motion sensors to determine the position of the vehicle by detecting changes in its speed and acceleration. It is the same basic navigation technology used for guided missiles, aircraft, and submarines. When used in AGVS installations, magnetic transponders imbedded in the floor along the desired pathway are detected by the AGV to correct any errors in its position.

The advantage of laser-guided vehicle technology and inertial navigation over fixed pathways (guide wires, paint strips, and magnetic tape) is its flexibility. The LGV pathways are defined in software. The path network can be changed by entering the required data into the navigation computer. New docking points can be defined. The pathway network can be expanded by installing new beacons. These changes can be made quickly and without major alterations to the facility.

Vehicle Management. For the AGVS to operate efficiently, the vehicles must be well managed. Delivery tasks must be allocated to vehicles to minimize waiting times at load/unload stations. Traffic congestion in the guide-path network must be minimized. Two aspects of vehicle management are considered here: (1) traffic control and (2) vehicle dispatching.

The purpose of traffic control in an automated guided vehicle system is to minimize interference between vehicles and to prevent collisions. Two methods of traffic control used in commercial AGV systems are (1) on-board vehicle sensing and (2) zone control. The two techniques are often used in combination. On-board vehicle sensing, also called *forward sensing*, uses one or more sensors on each vehicle to detect the presence of other vehicles and obstacles ahead on the guide path. Sensor technologies include optical and ultrasonic devices. When the on-board sensor detects an obstacle in front of it, the vehicle stops. When the obstacle is removed, the vehicle proceeds. If the sensor system is 100% effective, collisions between vehicles are avoided. The effectiveness of forward sensing is limited by the capability of the sensor to detect obstacles that are in front of it on the guide path. These systems are most effective on straight pathways. They are less effective at turns and convergence points where forward vehicles may not be directly in front of the sensor.

In zone control, the AGVS layout is divided into separate zones, and the operating rule is that no vehicle is permitted to enter a zone that is already occupied by another vehicle. The length of a zone is at least sufficient to hold one vehicle plus allowances for safety and other considerations. Other considerations include number of vehicles in the system, size and complexity of the layout, and the objective of minimizing the number of separate zones. For these reasons, the zones are normally much longer than a vehicle length. Zone control is illustrated in Figure 10.7 in its simplest form. When one vehicle occupies a given zone, any trailing vehicle is not allowed to enter that zone. The leading vehicle must proceed into the next zone before the trailing vehicle can occupy the current zone. When the forward movement of vehicles in the separate zones is controlled, collisions are prevented, and traffic in the overall system is controlled. One method to implement zone control is to use a central computer, which monitors the location of each vehicle and attempts to optimize the movement of all vehicles in the system.

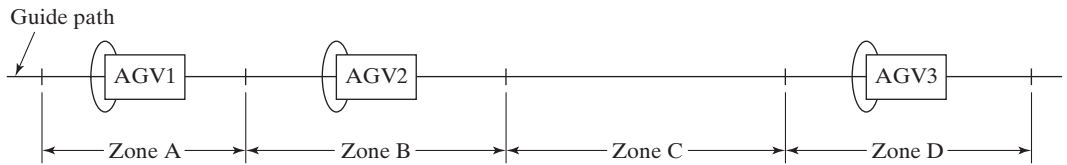


Figure 10.7 Zone control to implement blocking system. Zones A, B, and D are blocked. Zone C is free. Vehicle 2 is blocked from entering Zone A by Vehicle 1. Vehicle 3 is free to enter Zone C.

For an AGVS to serve its function, vehicles must be dispatched in a timely and efficient manner to the points in the system where they are needed. Several methods are used in AGV systems to dispatch vehicles: (1) on-board control panels, (2) remote call stations, and (3) central computer control. These dispatching methods are generally used in combination to maximize responsiveness and efficiency.

Each guided vehicle is equipped with an on-board control panel for the purpose of manual vehicle control, vehicle programming, and other functions. Most commercial vehicles can be dispatched by means of this control panel to a given station in the AGVS layout. Dispatching with an on-board control panel provides the AGVS with flexibility and timeliness to cope with changes and variations in delivery requirements.

Remote call stations represent another method for an AGVS to satisfy delivery requirements. The simplest call station is a push-button mounted at the load/unload station. This transmits a hailing signal for any available vehicle in the neighborhood to dock at the station and either pick up or drop off a load. The on-board control panel might then be used to dispatch the vehicle to the desired destination point.

In a large factory or warehouse involving a high degree of automation, the AGVS servicing the facility must also be highly automated to achieve efficient operation of the entire production-storage-handling system. Central computer control is used to dispatch vehicles according to a preplanned schedule of pickups and deliveries in the layout and/or in response to calls from the various load/unload stations. In this dispatching method, the central computer issues commands to the vehicles in the system concerning their destinations and the operations they must perform. To perform the dispatching function, the central computer must have current information on the location of each vehicle so it can make appropriate decisions about which vehicles to dispatch to what locations. Hence, the vehicles must continually communicate their whereabouts to the central controller. Radio frequency (RF) is commonly used to achieve the required communication links.

Vehicle Safety. The safety of humans located along the pathway is an important objective in AGVS operations. An inherent safety feature of an AGV is that its traveling speed is slower than the normal walking pace of a human. This minimizes the danger that it will overtake a human walking along the path in front of the vehicle.

In addition, AGVs are usually provided with several other features specifically for safety reasons. A safety feature included in most guidance systems is automatic stopping of the vehicle if it strays more than a short distance, typically 50–150 mm (2–6 in), from the guide path; the distance is referred to as the vehicle's *acquisition distance*. This automatic stopping feature prevents a vehicle from running wild in the building. Alternatively, in the event that the vehicle is off the guide path (e.g., for loading), its sensor system is capable of locking onto the guide path when the vehicle is moved to within the acquisition distance.

Another safety device is an obstacle detection sensor located on each vehicle. This is the same on-board sensor used for traffic control. The sensor can detect obstacles along the path ahead, including humans. The vehicles are programmed either to stop when an obstacle is sensed ahead or to slow down. The reason for slowing down is that the sensed object may be located off to the side of the vehicle path or directly ahead but beyond a turn in the guide path, or the obstacle may be a person who will move out of the way as the AGV approaches. In any of these cases, the vehicle is permitted to proceed at a slower (safer) speed until it has passed the obstacle. The disadvantage of programming a vehicle to stop when it encounters an obstacle is that this delays the delivery and degrades system performance.

A safety device included on virtually all commercial AGVs is an emergency bumper. The bumpers are prominent in the illustrations shown in Figure 10.5. The bumper surrounds the front of the vehicle and protrudes ahead of it by a distance of 300 mm (12 in) or more. When the bumper makes contact with an object, the vehicle is programmed to brake immediately. Depending on the speed of the vehicle, its load, and other conditions, the distance the vehicle needs to come to a complete stop will vary from several inches to several feet. Most vehicles are programmed to require manual restarting after an obstacle has been encountered by the emergency bumper. Other safety devices on a typical vehicle include warning lights (blinking or rotating lights) and/or warning bells, which alert humans that the vehicle is present.

10.2.3 Rail-Guided Vehicles

The third category of material transport equipment consists of motorized vehicles that are guided by a fixed rail system. The rail system consists of either one rail, called a *monorail*, or two parallel rails. Monorails in factories and warehouses are typically suspended overhead from the ceiling. In rail-guided vehicle systems using parallel fixed rails, the tracks generally protrude up from the floor. In either case, the presence of a fixed rail pathway distinguishes these systems from automated guided vehicle systems. As with AGVs, the vehicles operate asynchronously and are driven by an on-board electric motor. Unlike AGVs, which are powered by their own on-board batteries, rail-guided vehicles pick up electrical power from an electrified rail (similar to an urban rapid transit rail system). This relieves the vehicle from periodic recharging of its battery; however, the electrified rail system introduces a safety hazard not present in an AGVS.

Routing variations are possible in rail-guided vehicle systems through the use of switches, turntables, and other specialized track sections. This permits different loads to travel different routes, similar to an AGVS. Rail-guided systems are generally considered to be more versatile than conveyor systems but less versatile than automated guided vehicle systems. One of the original applications of nonpowered monorails was in the meat-processing industry before 1900. The slaughtered animals were hung from meat hooks attached to overhead monorail trolleys. The trolleys were moved through the different departments of the plant manually by the workers. It is likely that Henry Ford got the idea for the assembly line from observing these meat packing operations. Today, the automotive industry makes considerable use of electrified overhead monorails to move large components and subassemblies in its manufacturing operations.

10.2.4 Conveyors

A conveyor is a mechanical apparatus for moving items or bulk materials, usually inside a facility. Conveyors are generally used when material must be moved in relatively large quantities between specific locations over a fixed path, which may be in the floor, above

the floor, or overhead. Conveyors are either powered or nonpowered. In powered conveyors, the power mechanism is contained in the fixed path, using chains, belts, rotating rolls, or other devices to propel loads along the path. Powered conveyors are commonly used in automated material transport systems in manufacturing plants, warehouses, and distribution centers. In nonpowered conveyors, materials are moved either manually by human workers who push the loads along the fixed path or by gravity from one elevation to a lower elevation.

Types of Conveyors. A variety of conveyor equipment is commercially available. The primary interest here is in powered conveyors. Most of the major types of powered conveyors, organized according to the type of mechanical power provided in the fixed path, are briefly described in the following:

- **Roller conveyors.** In roller conveyors, the pathway consists of a series of tubes (rollers) that are perpendicular to the direction of travel, as in Figure 10.8(a). Loads must possess a flat bottom surface of sufficient area to span several adjacent rollers. Pallets, tote pans, or cartons serve this purpose well. The rollers are contained in a fixed frame that elevates the pathway above floor level from several inches to several feet. The loads move forward as the rollers rotate. Roller conveyors can either be powered or nonpowered. Powered roller conveyors are driven by belts or chains. Nonpowered roller conveyors are often driven by gravity so that the pathway has a

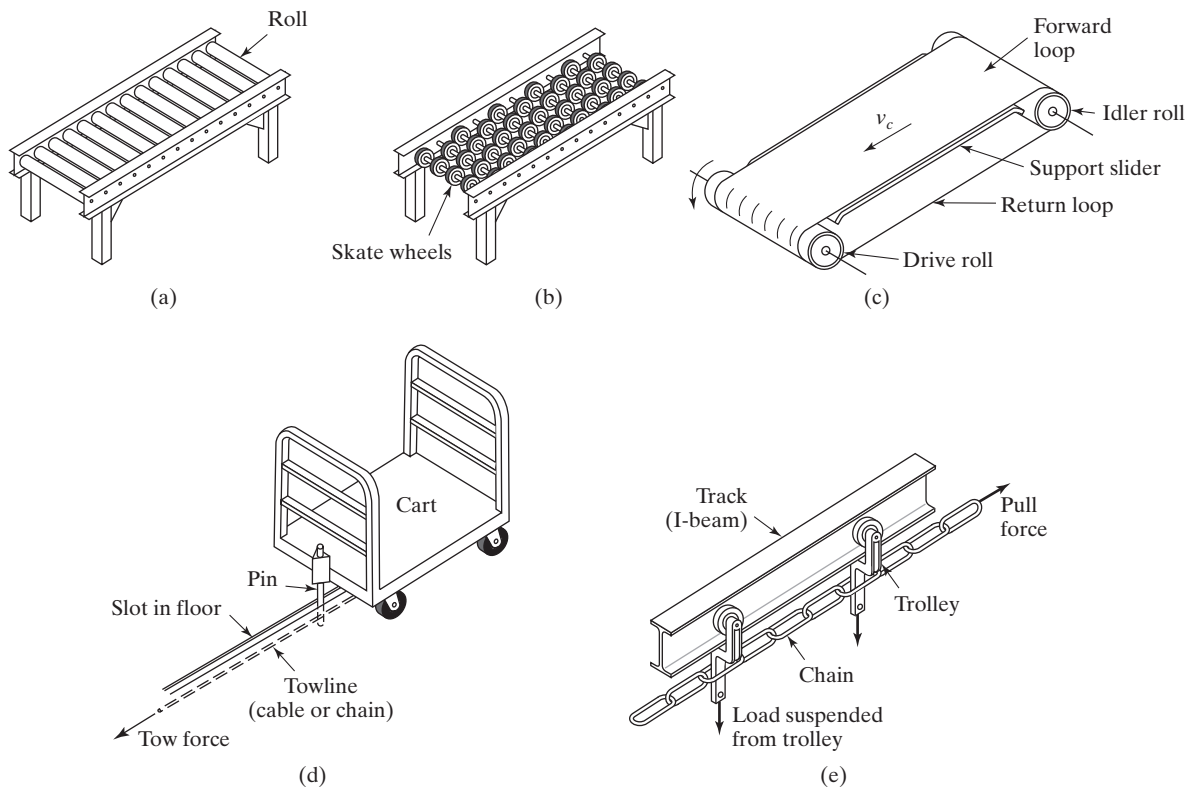


Figure 10.8 Types of Conveyors: (a) Roller conveyor, (b) skate-wheel conveyor, (c) belt (flat) conveyor (support frame not shown), (d) in-floor towline conveyor, and (e) overhead trolley conveyor.

downward slope sufficient to overcome rolling friction. Roller conveyors are used in a wide variety of applications, including manufacturing, assembly, packaging, sortation, and distribution.

- *Skate-wheel conveyors.* These are similar in operation to roller conveyors. Instead of rollers, they use skate wheels rotating on shafts connected to a frame to roll pallets, tote pans, or other containers along the pathway, as in Figure 10.8(b). Skate-wheel conveyors are lighter weight than roller conveyors. Applications of skate-wheel conveyors are similar to those of roller conveyors, except that the loads must generally be lighter since the contacts between the loads and the conveyor are much more concentrated. Because of their lightweight, skate-wheel conveyors are sometimes built as portable units that can be used for loading and unloading truck trailers at shipping and receiving docks at factories and warehouses.
- *Belt conveyors.* Belt conveyors consist of a continuous loop, with half its length used for delivering materials and the other half for the return run, as in Figure 10.8(c). The belt is made of reinforced elastomer (rubber), so that it possesses high flexibility but low extensibility. At one end of the conveyor is a drive roll that powers the belt. The flexible belt is supported by a frame that has rollers or support sliders along its forward loop. Belt conveyors are available in two common forms: (1) flat belts for pallets, cartons, and individual parts; and (2) troughed belts for bulk materials. Materials placed on the belt surface travel along the moving pathway. In the case of troughed belt conveyors, the rollers and supports give the flexible belt a V shape on the forward (delivery) loop to contain bulk materials such as coal, gravel, grain, or similar particulate materials.
- *Chain conveyors.* The typical equipment in this category consists of chain loops in an over-and-under configuration around powered sprockets at the ends of the pathway. The conveyor may consist of one or more chains operating in parallel. The chains travel along channels in the floor that provide support for the flexible chain sections. Either the chains slide along the channel or they ride on rollers in the channel. The loads are generally dragged along the pathway using bars that project up from the moving chain.
- *In-floor towline conveyor.* These conveyors use four-wheel carts powered by moving chains or cables located in trenches in the floor, as in Figure 10.8(d). The chain or cable is the towline. Pathways for the conveyor system are defined by the trench and towline, and the towline is driven as a powered pulley system. It is possible to switch between powered pathways to achieve flexibility in routing. The carts use steel pins that project below floor level into the trench to engage the chain for towing. (Gripper devices are substituted for pins when cable is used for the pulley system, as in the San Francisco trolleys.) The pin can be pulled out of the chain (or the gripper releases the cable) to disengage the cart for loading, unloading, switching, accumulating parts, and manually pushing a cart off the main pathway. Towline conveyor systems are used in manufacturing plants and warehouses.
- *Overhead trolley conveyor.* A **trolley** in material handling is a wheeled carriage running on an overhead rail from which loads can be suspended. An overhead trolley conveyor, Figure 10.8(e), consists of multiple trolleys, usually equally spaced along a fixed track. The trolleys are connected together and moved along the track by means of a chain or cable that forms a complete loop. Suspended from the trolleys are hooks, baskets, or other containers to carry loads. The chain (or cable) is attached to a drive pulley that pulls the chain at a constant velocity. The conveyor

path is determined by the configuration of the track system, which has turns and possible changes in elevation. Overhead trolley conveyors are often used in factories to move parts and assemblies between major production departments. They can be used for both delivery and storage.

- *Power-and-free overhead trolley conveyor.* This conveyor is similar to the overhead trolley conveyor, except that the trolleys can be disconnected from the drive chain, providing the conveyor with an asynchronous capability. This is usually accomplished by using two tracks, one just above the other. The upper track contains the continuously moving endless chain, and the trolleys that carry loads ride on the lower track. Each trolley includes a mechanism by which it can be connected to the drive chain and disconnected from it. When connected, the trolley is pulled along its track by the moving chain in the upper track. When disconnected, the trolley is idle.
- *Cart-on-track conveyor.* This equipment consists of individual carts riding on a track a few feet above floor level. The carts are driven by means of a spinning tube, as illustrated in Figure 10.9. A drive wheel, attached to the bottom of the cart and set at an angle to the rotating tube, rests against it and drives the cart forward. The cart speed is controlled by regulating the angle of contact between the drive wheel and the spinning tube. When the axis of the drive wheel is 45° , as in the figure, the cart is propelled forward. When the axis of the drive wheel is parallel to the tube, the cart does not move. Thus, control of the drive wheel angle on the cart allows power-and-free operation of the conveyor. One of the advantages of cart-on-track systems relative to many other conveyors is that the carts can be positioned with high accuracy. This permits their use for positioning work during production. Applications of cart-on-track systems include robotic spot welding lines in automobile body plants and mechanical assembly systems.
- *Other conveyor types.* Other powered conveyors include vibration-based systems and vertical lift conveyors. Screw conveyors are powered versions of the Archimedes screw, the water-raising device invented in ancient times, consisting of a large screw inside a tube, turned by hand to pump water uphill for irrigation purposes. Vibration-based conveyors use a flat track connected to an electromagnet that imparts an angular vibratory motion to the track to propel items in the desired direction. This same principle is used in vibratory bowl feeders to deliver components in automated assembly systems (Section 17.1.2). Vertical lift conveyors include a variety of mechanical elevators designed to provide vertical motion, such as between floors or to link floor-based conveyors with overhead conveyors. Other conveyor types include nonpowered chutes, ramps, and tubes, which are driven by gravity.

Conveyor Operations and Features. As indicated by the preceding discussion, conveyor equipment covers a wide variety of operations and features. The discussion here is limited to powered conveyors. Conveyor systems divide into two basic types in terms of the characteristic motion of the materials moved by the system: (1) continuous and (2) asynchronous. Continuous motion conveyors move at a constant velocity v_c along the path. They include belt, roller, skate-wheel, and overhead trolley.

Asynchronous conveyors operate with a stop-and-go motion in which loads move between stations and then stop and remain at the station until released. Asynchronous handling allows independent movement of each carrier in the system. Examples of this type include overhead power-and-free trolley, in-floor towline, and cart-on-track conveyors. Some roller and skate-wheel conveyors can also be operated asynchronously.

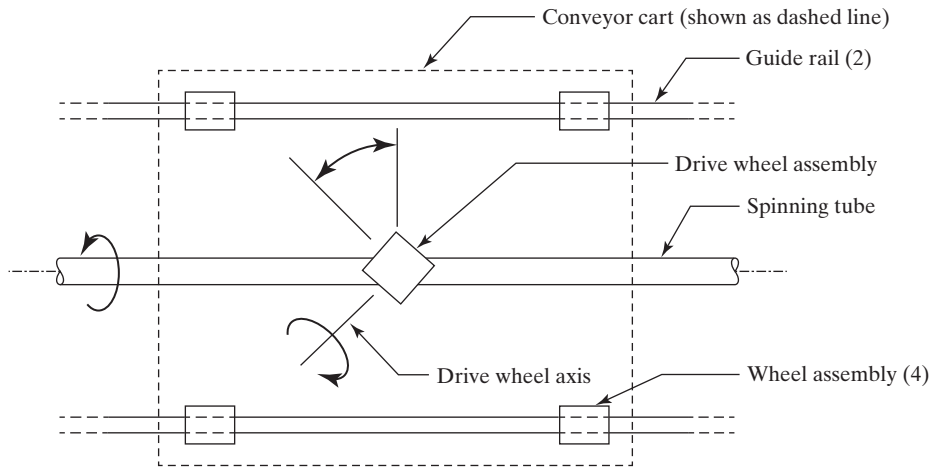


Figure 10.9 Cart-on-track conveyor. Drive wheel at 45° angle resting on spinning tube provides forward motion of cart.

Reasons for using asynchronous conveyors include (1) to accumulate loads, (2) to temporarily store items, (3) to allow for differences in production rates between adjacent processing areas, (4) to smooth production when cycle times are variable at stations along the conveyor, and (5) to accommodate different conveyor speeds along the pathway.

Conveyors can also be classified as (1) single direction, (2) continuous loop, and (3) recirculating. Section 10.3.2 presents equations and techniques for analyzing these conveyor systems. Single direction conveyors are used to transport loads one way from origination point to destination point, as depicted in Figure 10.10(a). These systems are appropriate when there is no need to move loads in both directions or to return containers or carriers from the unloading stations back to the loading stations. Single direction powered conveyors include roller, skate-wheel, belt, and chain-in-floor types. In addition, all gravity conveyors operate in one direction.

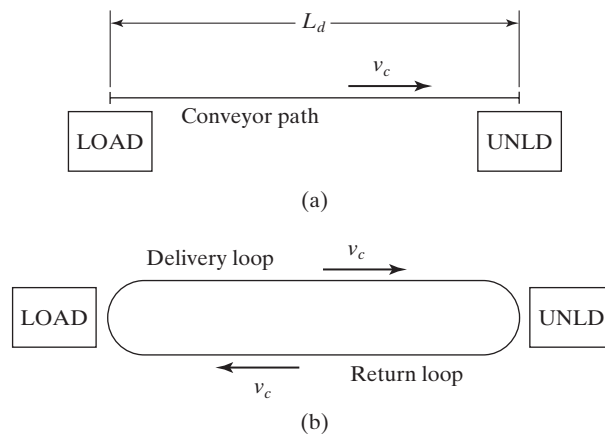


Figure 10.10 (a) Single direction conveyor and (b) continuous loop conveyor.

Continuous loop conveyors form a complete circuit, as in Figure 10.10(b). An overhead trolley conveyor is an example of this conveyor type. However, any conveyor type can be configured as a loop, even those previously identified as single direction conveyors, simply by connecting several single direction conveyor sections into a closed loop. Continuous loop conveyors are used when loads are moved in carriers (e.g., hooks, baskets) between load and unload stations and the carriers are affixed to the conveyor loop. In this design, the empty carriers are automatically returned from the unload station back to the load station.

The preceding description of a continuous loop conveyor assumes that items loaded at the load station(s) are unloaded at the unload station(s). There are no loads in the return loop; the purpose of the return loop is simply to send the empty carriers back for reloading. This method of operation overlooks an important opportunity offered by a closed-loop conveyor: to store as well as deliver items. Conveyor systems that allow parts or products to remain on the return loop for one or more revolutions are called *recirculating conveyors*. In providing a storage function, the conveyor system can be used to accumulate parts to smooth out effects of loading and unloading variations at stations in the conveyor. Two problems can plague the operation of a recirculating conveyor system. One is that there may be times during the operation of the conveyor when no empty carriers are immediately available at the loading station when needed. The other problem is that there may be times when no loaded carriers are immediately available at the unloading station when needed.

It is possible to construct branching and merging points into a conveyor track to permit different routing of different loads moving in the system. In nearly all conveyor systems, it is possible to build switches, shuttles, or other mechanisms to achieve these alternate routings. In some systems, a push-pull mechanism or lift-and-carry device is required to actively move the load from the current pathway onto the new pathway.

10.2.5 Cranes and Hoists

The fifth category of transport equipment in material handling is cranes and hoists. Cranes are used for horizontal movement of materials in a facility, and hoists are used for vertical lifting. A crane invariably includes a hoist; thus, the hoist component of the crane lifts the load, and the crane transports the load horizontally to the desired destination. This class of material handling equipment includes cranes capable of lifting and moving very heavy loads, in some cases over 100 tons.

A **hoist** is a mechanical device used to raise and lower loads. As seen in Figure 10.11, a hoist consists of one or more fixed pulleys, one or more moving pulleys, and a rope, cable, or chain strung between the pulleys. A hook or other means for attaching the load is connected to the moving pulley(s). The number of pulleys in the hoist determines its mechanical advantage, which is the ratio of the load weight to the driving force required to lift the weight. The mechanical advantage of the hoist in Figure 10.11 is 4. The driving force to operate the hoist is usually applied by electric or pneumatic motor.

Cranes include a variety of material handling equipment designed for lifting and moving heavy loads using one or more overhead beams for support. Principal types of cranes found in factories include (a) bridge cranes, (b) gantry cranes, and (c) jib cranes. In all three types, at least one hoist is mounted to a trolley that rides on the overhead beam of the crane. A bridge crane consists of one or two horizontal girders or beams suspended between fixed rails on either end which are connected to the structure of the building, as

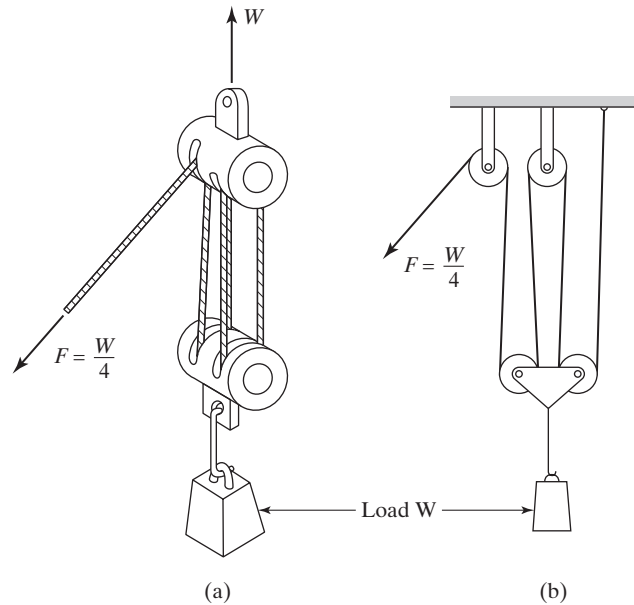


Figure 10.11 A hoist with a mechanical advantage of 4.0: (a) sketch of the hoist and (b) diagram to illustrate mechanical advantage.

shown in Figure 10.12(a). The hoist trolley can be moved along the length of the bridge, and the bridge can be moved the length of the rails in the building. These two drive capabilities provide motion in the x - and y -axes of the building, and the hoist provides motion in the z -axis direction. Thus, the bridge crane achieves vertical lifting due to its hoist and horizontal movement due to its orthogonal rail system. Large bridge cranes have girders that span up to 36.5 m (120 ft) and are capable of carrying loads up to 90,000 kg (100 tons). Large bridge cranes are controlled by operators riding in cabs on the bridge. Applications include heavy machinery fabrication, steel and other metal mills, and power-generating stations.

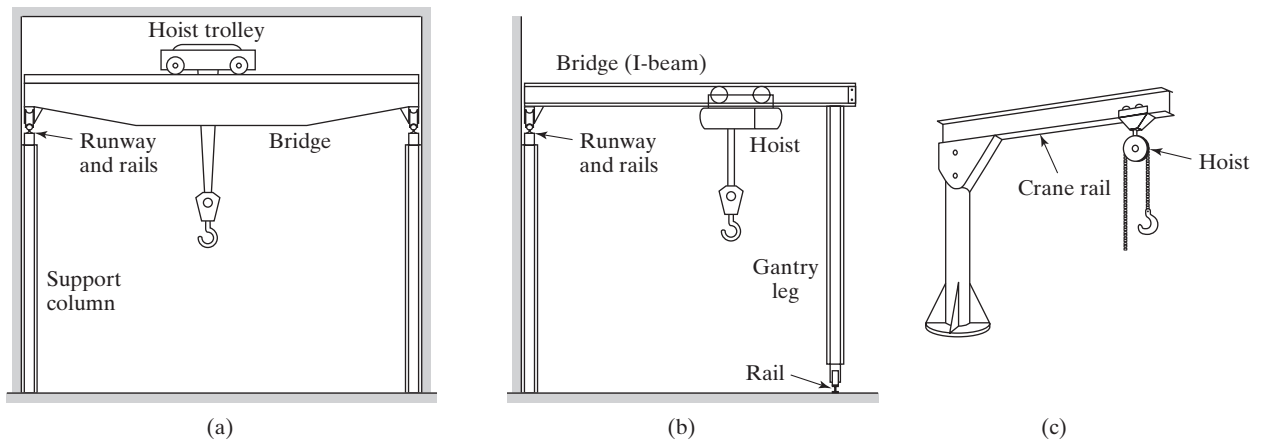


Figure 10.12 Three types of cranes: (a) bridge crane, (b) gantry crane (a half gantry crane is shown), and (c) jib crane.

A gantry crane is distinguished from a bridge crane by the presence of one or two vertical legs that support the horizontal bridge. As with the bridge crane, a gantry crane includes one or more hoists that accomplish vertical lifting. Gantries are available in a variety of sizes and capacities, the largest possessing spans of about 46 m (150 ft) and load capacities of 136,000 kg (150 tons). A double gantry crane has two legs. A half gantry crane, Figure 10.12(b), has a single leg on one end of the bridge, and the other end is supported by a rail mounted on the wall or other structural member of a building. A cantilever gantry crane has a bridge that extends beyond the span created by the support legs.

A jib crane consists of a hoist supported on a horizontal beam that is cantilevered from a vertical column or wall support, as in Figure 10.12(c). The horizontal beam pivots about the vertical axis formed by the column or wall to provide a horizontal sweep for the crane. The beam also serves as the track for the hoist trolley to provide radial travel along the length of the beam. Thus, the horizontal area included by a jib crane is circular or semicircular. As with other cranes, the hoist provides vertical lift-and-lower motions. Standard capacities of jib cranes range up to about 5,000 kg (11,000 lb). Wall-mounted jib cranes can achieve a swing of about 180°, while a floor-mounted jib crane using a column or post as its vertical support can sweep a full 360°.

10.3 ANALYSIS OF MATERIAL TRANSPORT SYSTEMS

Quantitative models are useful for analyzing material flow rates, delivery cycle times, and other aspects of system performance. The analysis may be useful in determining equipment requirements—for example, how many forklift trucks will be required to satisfy a specified flow rate. Material transport systems can be classified as vehicle-based systems or conveyor systems.³ The following coverage of the quantitative models is organized along these lines.

10.3.1 Analysis of Vehicle-Based Systems

Equipment used in vehicle-based material transport systems includes industrial trucks (both hand trucks and powered trucks), automated guided vehicles, rail-guided vehicles, and certain types of conveyor systems. These systems are commonly used to deliver individual loads between origination and destination points. Two graphical tools that are useful for displaying and analyzing data in these deliveries are the *from-to chart* and the *network diagram*. The *from-to chart* is a table that can be used to indicate material flow data and/or distances between multiple locations. Table 10.5 illustrates a from-to chart that lists flow rates and distances between five workstations in a manufacturing system. The left-hand vertical column lists the origination points (loading stations), while the horizontal row at the top identifies the destination locations (unloading stations).

Network diagrams can also be used to indicate the same type of information. A *network diagram* consists of nodes and arrows, and the arrows indicate relationships among the nodes. In material handling, the nodes represent locations (e.g., load and unload stations), and the arrows represent material flows and/or distances between the stations. Figure 10.13 shows a network diagram containing the same information as Table 10.5.

³Exceptions exist. Some conveyor systems use vehicles to carry loads. Examples include the in-floor tow line conveyor and the cart-on-track conveyor.

TABLE 10.5 From-To Chart Showing Flow Rates, loads/hr (Value Before the Slash), and Travel Distances, m (Value After the Slash), Between Stations in a Layout

	To	1	2	3	4	5
From	1	0	9/50	5/120	6/205	0
	2	0	0	0	0	9/80
	3	0	0	0	2/85	3/170
	4	0	0	0	0	8/85
	5	0	0	0	0	0

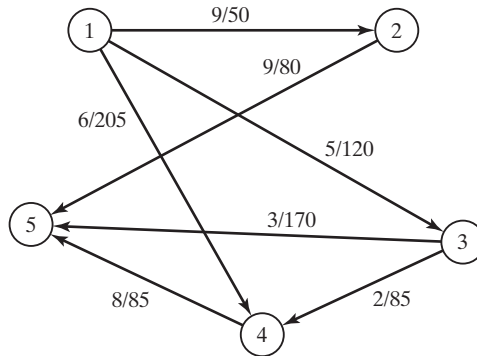


Figure 10.13 Network diagram showing material deliveries between load/unload stations. Nodes represent the load/unload stations, and arrows are labeled with flow rates, loads/hr, and distances m.

Mathematical equations can be developed to describe the operation of vehicle-based material transport systems. It is assumed that the vehicle moves at a constant velocity throughout its operation and that effects of acceleration, deceleration, and other speed differences are ignored. The time for a typical delivery cycle in the operation of a vehicle-based transport system consists of (1) loading at the pickup station, (2) travel time to the drop-off station, (3) unloading at the drop-off station, and (4) empty travel time of the vehicle between deliveries. The total cycle time per delivery per vehicle is given by

$$T_c = T_L + \frac{L_d}{v_c} + T_U + \frac{L_e}{v_c} \quad (10.1)$$

where T_c = delivery cycle time, min/del; T_L = time to load at load station, min; L_d = distance the vehicle travels between load and unload station, m (ft); v_c = carrier velocity, m/min (ft/min); T_U = time to unload at unload station, min; and L_e = distance the vehicle travels empty until the start of the next delivery cycle, m (ft).

The T_c calculated by Equation (10.1) must be considered an ideal value, because it ignores any time losses due to reliability problems, traffic congestion, and other factors that may slow down a delivery. In addition, not all delivery cycles are the same.

Originations and destinations may be different from one delivery to the next, which affect the L_d and L_e terms in the equation. Accordingly, these terms are considered to be average values for the loaded and empty distances traveled by the vehicle during a shift or other period of analysis.

The delivery cycle time T_c can be used to determine two values of interest in a vehicle-based transport system: (1) rate of deliveries per vehicle and (2) number of vehicles required to satisfy a specified total delivery requirement. The analysis is based on hourly rates and requirements, but the equations can readily be adapted for other time periods.

The hourly rate of deliveries per vehicle is 60 min divided by the delivery cycle time T_c , adjusting for any time losses during the hour. The possible time losses include (1) availability, (2) traffic congestion, and (3) efficiency of manual drivers in the case of manually operated trucks. **Availability** A is a reliability factor (Section 3.1.1) defined as the proportion of total shift time that the vehicle is operational and not broken down or being repaired.

To deal with the time losses due to traffic congestion, the **traffic factor** F_t is defined as a parameter for estimating the effect of these losses on system performance. Sources of inefficiency accounted for by the traffic factor include waiting at intersections, blocking of vehicles (as in an AGVS), and waiting in a queue at load/unload stations. If these situations do not occur, then $F_t = 1.0$. As blocking increases, the value of F_t decreases. F_t is affected by the number of vehicles in the system relative to the size of the layout. If there is only one vehicle in the system, no blocking should occur, and the traffic factor will be 1.0. For systems with many vehicles, there will be more instances of blocking and congestion, and the traffic factor will take a lower value. Typical values of traffic factor for an AGVS range between 0.85 and 1.0 [4].

For systems based on industrial trucks, including both hand trucks and powered trucks that are operated by human workers, traffic congestion is probably not the main cause of low operating performance. Instead, performance depends primarily on the work efficiency of the operators who drive the trucks. **Worker efficiency** is defined as the actual work rate of the human operator relative to the work rate expected under standard or normal performance. Let E_w symbolize worker efficiency.

With these factors defined, the available time per hour per vehicle can now be expressed as 60 min adjusted by A , F_t , and E_w . That is,

$$AT = 60AF_tE_w \quad (10.2)$$

where AT = available time, min/hr per vehicle; A = availability; F_t = traffic factor, and E_w = worker efficiency. The parameters A , F_t , and E_w do not take into account poor vehicle routing, poor guide-path layout, or poor management of the vehicles in the system. These factors should be minimized, but if present they are accounted for in the values of L_d , L_e , T_L , and T_u .

Equations for the two performance parameters of interest can now be written. The rate of deliveries per vehicle is given by

$$R_{dv} = \frac{AT}{T_c} \quad (10.3)$$

where R_{dv} = hourly delivery rate per vehicle, deliveries/hr per vehicle; T_c = delivery cycle time computed by Equation (10.1), min/del; and AT = the available time in 1 hour, adjusted for time losses, min/hr.

The total number of vehicles (trucks, AGVs, trolleys, carts, etc.) needed to satisfy a specified total delivery schedule R_f in the system can be estimated by first calculating the total workload required and then dividing by the available time per vehicle. **Workload** is defined as the total amount of work, expressed in terms of time, that must be accomplished by the material transport system in 1 hr. This can be expressed as

$$WL = R_f T_c \quad (10.4)$$

where WL = workload, min/hr; R_f = specified flow rate of total deliveries per hour for the system, deliveries/hr; and T_c = delivery cycle time, min/del. Now the number of vehicles required to accomplish this workload can be written as

$$n_c = \frac{WL}{AT} \quad (10.5)$$

where n_c = number of carriers (vehicles) required, WL = workload, min/hr; and AT = available time per vehicle, min/hr per vehicle. Substituting Equations (10.3) and (10.4) into Equation (10.5) provides an alternative way to determine n_c :

$$n_c = \frac{R_f}{R_{dv}} \quad (10.6)$$

where n_c = number of carriers required, R_f = total delivery requirements in the system, deliveries/hr; and R_{dv} = delivery rate per vehicle, deliveries/hr per vehicle. Although the traffic factor accounts for delays experienced by the vehicles, it does not include delays encountered by a load/unload station that must wait for the arrival of a vehicle. Because of the random nature of the load/unload demands, workstations are likely to experience waiting time while vehicles are busy with other deliveries. The preceding equations do not consider this idle time or its impact on operating cost. If station idle time is to be minimized, then more vehicles may be needed than the number indicated by Equations (10.5) or (10.6). Mathematical models based on queueing theory are appropriate to analyze this more complex stochastic situation.

EXAMPLE 10.1 Determining Number of Vehicles in an AGVS

Consider the AGVS layout in Figure 10.14. Vehicles travel counterclockwise around the loop to deliver loads from the load station to the unload station. Loading time at the load station = 0.75 min, and unloading time at the unload station = 0.50 min. The following performance parameters are given: vehicle speed = 50 m/min, availability = 0.95, and traffic factor = 0.90. Operator efficiency does not apply, so $E_w = 1.0$. Determine (a) travel distances loaded and empty, (b) ideal delivery cycle time, and (c) number of vehicles required to satisfy the delivery demand if a total of 40 deliveries per hour must be completed by the AGVS.

Solution: (a) Ignoring effects of slightly shorter distances around the curves at corners of the loop, the values of L_d and L_e are readily determined from the layout to be **110 m** and **80 m**, respectively.

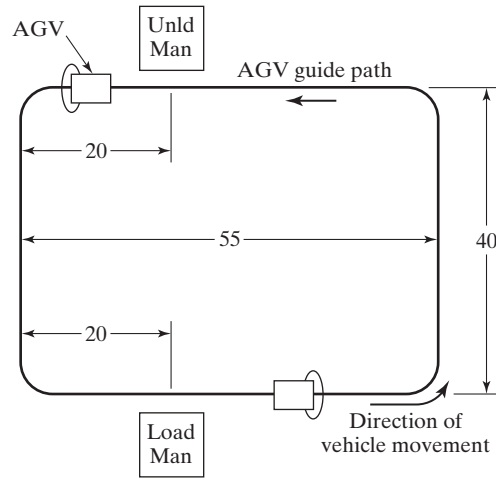


Figure 10.14 AGVS loop layout for Example 10.1.
 Key: Unld = unload, Man = manual operation,
 dimensions in meters (m).

(b) Ideal cycle time per delivery per vehicle is given by Equation (10.1):

$$T_c = 0.75 + \frac{110}{50} + 0.50 + \frac{80}{50} = \mathbf{5.05 \text{ min}}$$

(c) To determine the number of vehicles required to make 40 deliveries/hr, compute the workload of the AGVS and the available time per hour per vehicle:

$$WL = 40(5.05) = 202 \text{ min/hr}$$

$$AT = 60(0.95)(0.90)(1.0) = 51.3 \text{ min/hr per vehicle}$$

Therefore, the number of vehicles required is

$$n_c = \frac{202}{51.3} = \mathbf{3.94 \text{ vehicles}}$$

This value should be rounded up to **4 vehicles**, since the number of vehicles must be an integer.

Determining the average travel distances, L_d and L_e , requires analysis of the particular AGVS layout and how the vehicles are managed. For a simple loop layout such as Figure 10.14, determining these values is straightforward. For a complex AGVS layout, the problem is more difficult. The following example illustrates the issue.

EXAMPLE 10.2 Determining L_d for a More-Complex AGVS Layout

The layout for this example is shown in Figure 10.15, and the from-to chart is presented in Table 10.5. The AGVS includes load station 1 where raw parts enter the system for delivery to any of three production stations 2, 3, and 4. Unload station 5 receives finished parts from the production stations. Load and unload times at stations 1 and 5 are each 0.5 min. Production rates for each workstation are indicated by the delivery requirements in Table 10.5. A complicating factor is that some parts must be transshipped between stations 3 and 4. Vehicles move in the direction indicated by the arrows in the figure. Determine the average delivery distance, L_d .

Solution: Table 10.5 shows the number of deliveries and corresponding distances between the stations. The distance values are taken from the layout drawing in Figure 10.15. To determine the value of L_d , a weighted average must be calculated based on the number of trips and corresponding distances shown in the from-to chart for the problem:

$$L_d = \frac{9(50) + 5(120) + 6(205) + 9(80) + 2(85) + 3(170) + 8(85)}{9 + 5 + 6 + 9 + 2 + 3 + 8} = \frac{4,360}{42} = 103.8 \text{ m}$$

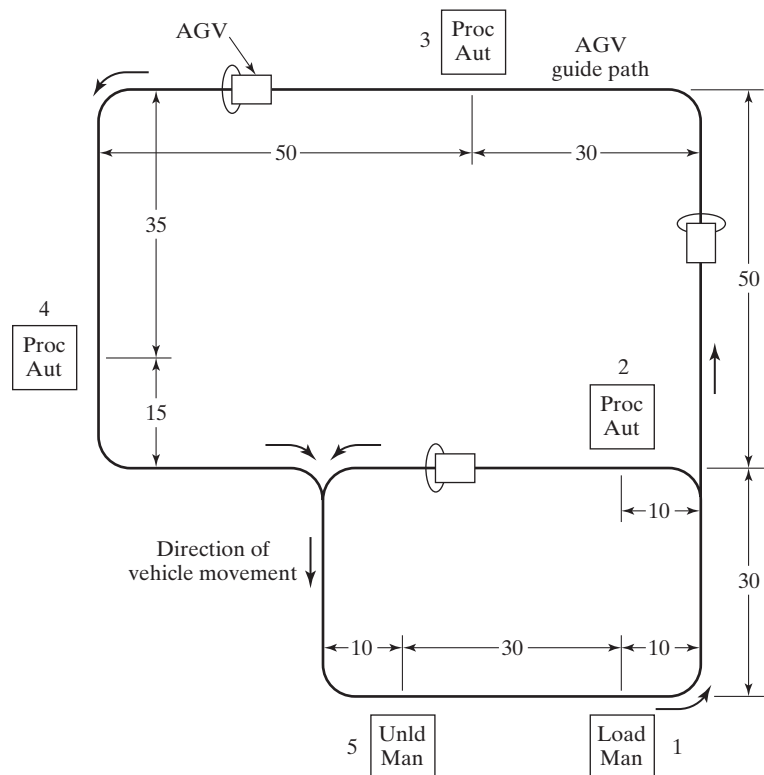


Figure 10.15 AGVS layout for production system of Example 10.2. Key: Proc = processing operation, Aut = automated, Unld = unload, Man = manual operation, dimensions in meters (m).

Determining L_e , the average distance a vehicle travels empty during a delivery cycle, is more complicated. It depends on the dispatching and scheduling methods used to decide how a vehicle should proceed from its last drop-off to its next pickup. In Figure 10.15, if each vehicle must travel back to station 1 after each drop-off at stations 2, 3, and 4, then the empty distance between pick-ups would be very long indeed. L_e would be greater than L_d . On the other hand, if a vehicle could exchange a raw work part for a finished part while stopped at a given workstation, then empty travel time for the vehicle would be minimized. However, this would require a two-position platform at each station to enable the exchange. So this issue must be considered in the initial design of the AGVS. Ideally, L_e should be reduced to zero. It is highly desirable to minimize the average distance a vehicle travels empty through good design of the AGVS and good scheduling of the vehicles. The mathematical model of vehicle-based systems indicates that the delivery cycle time will be reduced if L_e is minimized, and this will have a beneficial effect on the vehicle delivery rate and the number of vehicles required to operate the system. Two of the exercise problems at the end of the chapter ask the reader to determine L_e under different operating scenarios.

10.3.2 Conveyor Analysis

Conveyor operations have been analyzed in the research literature [8], [9], [11], [12], [13], and [14]). In the discussion here, the three basic types of conveyor operations discussed in Section 10.2.4 are considered: (1) single direction conveyors, (2) continuous loop conveyors, and (3) recirculating conveyors.

Single Direction Conveyors. Consider the case of a single direction powered conveyor with one load station at the upstream end and one unload station at the downstream end, as in Figure 10.10(a). Materials are loaded at one end and unloaded at the other. The materials may be parts, cartons, pallet loads, or other unit loads. Assuming the conveyor operates at a constant speed, the time required to move materials from load station to unload station is given by

$$T_d = \frac{L_d}{v_c} \quad (10.7)$$

where T_d = delivery time, min; L_d = length of conveyor between load and unload stations, m (ft), and v_c = conveyor velocity, m/min (ft/min).

The flow rate of materials on the conveyor is determined by the rate of loading at the load station. The loading rate is limited by the reciprocal of the time required to load the materials. Given the conveyor speed, the loading rate establishes the spacing of materials on the conveyor. Summarizing these relationships,

$$R_f = R_L = \frac{v_c}{s_c} \leq \frac{1}{T_L} \quad (10.8)$$

where R_f = material flow rate, parts/min; R_L = loading rate, parts/min; s_c = center-to-center spacing of materials on the conveyor, m/part (ft/part); and T_L = loading time, min/part. One might be tempted to think that the loading rate R_L is the reciprocal of the loading time T_L . However, R_L is set by the flow rate requirement R_f , while T_L is determined by ergonomic factors. The worker who loads the conveyor may be capable of

performing the loading task at a rate that is faster than the required flow rate. On the other hand, the flow rate requirement cannot be set faster than it is humanly possible to perform the loading task.

An additional requirement for loading and unloading is that the time required to unload the conveyor must be equal to or less than the reciprocal of material flow rate. That is,

$$T_U \leq \frac{1}{R_f} \quad (10.9)$$

where T_U = unloading time, min/part. If unloading requires more time than the time interval between arriving loads, then loads may accumulate or be dumped onto the floor at the downstream end of the conveyor.

Parts are being used as the material in Equations (10.8) and (10.9), but the relationships apply to other unit loads as well. The advantage of the Unit Load Principle (Section 10.1.2) can be demonstrated by transporting n_p parts in a container rather than a single part. Recasting Equation (10.8) to reflect this advantage,

$$R_f = \frac{n_p v_c}{s_c} \leq \frac{1}{T_L} \quad (10.10)$$

where R_f = flow rate, parts/min; n_p = number of parts per container; s_c = center-to-center spacing of containers on the conveyor, m/container (ft/container); and T_L = loading time per container, min/container. The flow rate of parts transported by the conveyor is potentially much greater in this case. However, loading time is still a limitation, and T_L may consist of not only the time to load the container onto the conveyor but also the time to load parts into the container. The preceding equations must be interpreted and perhaps adjusted for the given application.

EXAMPLE 10.3 Single Direction Conveyor

A roller conveyor follows a pathway 35 m long between a parts production department and an assembly department. Velocity of the conveyor is 40 m/min. Parts are loaded into large tote pans, which are placed onto the conveyor at the load station in the production department. Two operators work at the loading station. The first worker loads parts into tote pans, which takes 25 sec. Each tote pan holds 20 parts. Parts enter the loading station from production at a rate that is in balance with this 25-sec cycle. The second worker loads tote pans onto the conveyor, which takes only 10 sec. Determine (a) spacing between tote pans along the conveyor, (b) maximum possible flow rate in parts/min, and (c) the maximum time allowed to unload the tote pan in the assembly department.

Solution: (a) Spacing between tote pans on the conveyor is determined by the loading time. It takes only 10 sec to load a tote pan onto the conveyor, but 25 sec are required to load parts into the tote pan. Therefore, the loading cycle is limited by this 25 sec. At a conveyor speed of 40 m/min, the spacing will be

$$s_c = (25/60 \text{ min})(40 \text{ m/min}) = \mathbf{16.67 \text{ m}}$$

(b) Flow rate is given by Equation (10.10):

$$R_f = \frac{20(40)}{16.67} = \mathbf{48 \text{ parts/min}}$$

This is consistent with the parts loading rate of 20 parts in 25 sec, which is 0.8 parts/sec or 48 parts/min.

(c) The maximum allowable time to unload a tote pan must be consistent with the flow rate of tote pans on the conveyor. This flow rate is one tote pan every 25 sec, so

$$T_U \leq \mathbf{25 \text{ sec}}$$

Continuous Loop Conveyors. Consider a continuous loop conveyor such as an overhead trolley in which the pathway is formed by an endless chain moving in a track loop, and carriers are suspended from the track and pulled by the chain. The conveyor moves parts in the carriers between a load station and an unload station. The complete loop is divided into two sections: a delivery (forward) loop in which the carriers are loaded and a return loop in which the carriers travel empty, as shown in Figure 10.10(b). The length of the delivery loop is L_d , and the length of the return loop is L_e . Total length of the conveyor is therefore $L = L_d + L_e$. The total time required to travel the complete loop is

$$T_c = \frac{L}{v_c} \quad (10.11)$$

where T_c = total cycle time, min; and v_c = speed of the conveyor chain, m/min (ft/min). The time a load spends in the forward loop is

$$T_d = \frac{L_d}{v_c} \quad (10.12)$$

where T_d = delivery time on the forward loop, min.

Carriers are equally spaced along the chain at a distance s_c apart. Thus, the total number of carriers in the loop is given by

$$n_c = \frac{L}{s_c} \quad (10.13)$$

where n_c = number of carriers; L = total length of the conveyor loop, m (ft); and s_c = center-to-center distance between carriers, m/carrier (ft/carrier). The value of n_c must be an integer, and so the values of L and s_c must be consistent with that requirement.

Each carrier is capable of holding parts on the delivery loop, and it holds no parts on the return trip. Since only those carriers on the forward loop contain parts, the maximum number of parts in the system at any one time is given by

$$\text{Total parts in system} = \frac{n_p n_c L_d}{L} \quad (10.14)$$

As in the single direction conveyor, the maximum flow rate between load and unload stations is

$$R_f = \frac{n_p v_c}{s_c}$$

where R_f = parts per minute, pc/min. Again, this rate must be consistent with limitations on the time it takes to load and unload the conveyor, as defined in Equations (10.8) through (10.10).

Recirculating Conveyors. Recall the two problems complicating the operation of a recirculating conveyor system (Section 10.2.4): (1) the possibility that no empty carriers are immediately available at the loading station when needed and (2) the possibility that no loaded carriers are immediately available at the unloading station when needed. The case of a recirculating conveyor with one load station and one unload station was analyzed by Kwo [8], [9]. According to his analysis, three basic principles must be obeyed in designing such a conveyor system:

1. *Speed Rule.* The operating speed of the conveyor must be within a certain range. The lower limit of the range is determined by the required loading and unloading rates at the respective stations. These rates are dictated by the external systems served by the conveyor. Let R_L and R_U represent the required loading and unloading rates at the two stations, respectively. Then the conveyor speed must satisfy the relationship

$$\frac{n_p v_c}{s_c} \geq \text{Max}\{R_L, R_U\} \quad (10.15)$$

where R_L = required loading rate, pc/min; and R_U = the corresponding unloading rate. The upper speed limit is determined by the physical capabilities of the material handlers who perform the loading and unloading tasks. Their capabilities are defined by the time required to load and unload the carriers, so that

$$\frac{v_c}{s_c} \leq \text{Min}\left\{\frac{1}{T_L}, \frac{1}{T_U}\right\} \quad (10.16)$$

where T_L = time required to load a carrier, min/carrier; and T_U = time required to unload a carrier. In addition to Equations (10.15) and (10.16), another limitation is of course that the speed must not exceed the physical limits of the mechanical conveyor itself.

2. *Capacity Constraint.* The flow rate capacity of the conveyor system must be at least equal to the flow rate requirement to accommodate reserve stock and allow for the time elapsed between loading and unloading due to delivery distance. This can be expressed as follows:

$$\frac{n_p v_c}{s_c} \geq R_f \quad (10.17)$$

In this case, R_f must be interpreted as a system specification required of the recirculating conveyor.

3. *Uniformity Principle.* This principle states that parts (loads) should be uniformly distributed throughout the length of the conveyor, so that there will be no sections of the conveyor in which every carrier is full while other sections are virtually empty. The reason for the uniformity principle is to avoid unusually long waiting times at the load or unload stations for empty or full carriers (respectively) to arrive.

EXAMPLE 10.4 Recirculating Conveyor Analysis: Kwo

A recirculating conveyor has a total length of 300 m. Its speed is 60 m/min, and the spacing of part carriers along its length is 12 m. Each carrier can hold two parts. The task time required to load two parts into each carrier is 0.20 min and the unload time is the same. The required loading and unloading rates are both defined by the specified flow rate, which is 4 parts/min. Evaluate the conveyor system design with respect to Kwo's three principles.

Solution: *Speed Rule:* The lower limit on speed is set by the required loading and unloading rates, both 4 parts/min. Checking this against Equation (10.15),

$$\frac{n_p v_c}{s_c} \geq \text{Max}\{R_L, R_U\}$$

$$\frac{(2 \text{ parts/carrier})(60 \text{ m/min})}{12 \text{ m/carrier}} = 10 \text{ parts/min} > \mathbf{4 \text{ parts/min}}$$

Checking the lower limit,

$$\frac{60 \text{ m/min}}{12 \text{ m/carrier}} = 5 \text{ carriers/min} \leq \text{Min}\left\{\frac{1}{0.2}, \frac{1}{0.2}\right\} = \text{Min}\{5, 5\} = 5$$

The Speed Rule is satisfied.

Capacity Constraint: The conveyor flow rate capacity = 10 parts/min as computed above. Since this is substantially greater than the required delivery rate of 4 parts/min, the capacity constraint is satisfied. Kwo provides guidelines for determining the flow rate requirement that should be compared to the conveyor capacity.

Uniformity Principle: The conveyor is assumed to be uniformly loaded throughout its length, since the loading and unloading rates are equal and the flow rate capacity is substantially greater than the load/unload rate. Conditions for checking the uniformity principle are available in the original papers by Kwo [8], [9].

REFERENCES

- [1] BOSE, P. P., "Basics of AGV Systems," Special Report 784, *American Machinist and Automated Manufacturing*, March 1986, pp. 105–122.
- [2] CASTELBERRY, G., *The AGV Handbook*, AGV Decisions, Inc., published by Braun-Brumfield, Inc., Ann Arbor, MI, 1991.
- [3] EASTMAN, R. M., *Materials Handling*, Marcel Dekker, Inc., New York, 1987.
- [4] FITZGERALD, K. R., "How to Estimate the Number of AGVs You Need," *Modern Materials Handling*, October 1985, p. 79.
- [5] KULWIEC, R. A., *Basics of Material Handling*, Material Handling Institute, Pittsburgh, PA, 1981.

- [6] KULWIEC, R. A., Editor, *Materials Handling Handbook*, 2nd ed., John Wiley & Sons, Inc., New York, 1985.
- [7] KULWIEC, R., “Cranes for Overhead Handling,” *Modern Materials Handling*, July 1998, pp. 43–47.
- [8] Kwo, T. T., “A Theory of Conveyors,” *Management Science*, Vol. 5, No. 1, 1958, pp. 51–71.
- [9] Kwo, T. T., “A Method for Designing Irreversible Overhead Loop Conveyors,” *Journal of Industrial Engineering*, Vol. 11, No. 6, 1960, pp. 459–466.
- [10] MILLER, R. K., *Automated Guided Vehicle Systems*, Co-published by SEAI Institute, Madison, GA and Technical Insights, Fort Lee, NJ, 1983.
- [11] MUTH, E. J., “Analysis of Closed-Loop Conveyor Systems,” *AIIE Transactions*, Vol. 4, No. 2, 1972, pp. 134–143.
- [12] MUTH, E. J., “Analysis of Closed-Loop Conveyor Systems: The Discrete Flow Case,” *AIIE Transactions*, Vol. 6, No. 1, 1974, pp. 73–83.
- [13] MUTH, E. J., “Modelling and Analysis of Multistation Closed-Loop Conveyors,” *International Journal of Production Research*, Vol. 13, No. 6, 1975, pp. 559–566.
- [14] MUTH, E. J., and J. A. WHITE, “Conveyor Theory: A Survey,” *AIIE Transactions*, Vol. 11, No. 4, 1979, pp. 270–277.
- [15] MUTHER, R., and K. HAGANAS, *Systematic Handling Analysis*, Management and Industrial Research Publications, Kansas City, MO, 1969.
- [16] TOMPKINS, J. A., J. A. WHITE, Y. A. BOZER, E. H. FRAZELLE, J. M. TANCHOCO, and J. TREVINO, *Facilities Planning*, 4th ed., John Wiley & Sons, Inc., New York, 2010.
- [17] WITT, C. E., “Palletizing Unit Loads: Many Options,” *Material Handling Engineering*, January, 1999, pp. 99–106.
- [18] ZOLLINGER, H. A., “Methodology to Concept Horizontal Transportation Problem Solutions,” paper presented at the *MHI 1994 International Research Colloquium*, Grand Rapids, MI, June 1994.
- [19] www.agvsystems.com
- [20] www.jervisbwebb.com
- [21] www.mhi.org/cicmhe/resources/taxonomy
- [22] www.mhia.org
- [23] www.wikipedia.org/wiki/Automated_guided_vehicle

REVIEW QUESTIONS

- 10.1** Provide a definition of material handling.
- 10.2** How does material handling fit within the scope of logistics?
- 10.3** Name the five major categories of material handling equipment.
- 10.4** What is included within the term *unitizing equipment*?
- 10.5** What is the Unit Load Principle?
- 10.6** What are the five categories of material transport equipment commonly used to move parts and materials inside a facility?
- 10.7** Give some examples of industrial trucks used in material handling.
- 10.8** What is an automated guided vehicle system (AGVS)?
- 10.9** Name three categories of automated guided vehicles.
- 10.10** What features distinguish laser-guided vehicles from conventional AGVs?

- 10.11** What is forward sensing in AGVS terminology?
- 10.12** What are some of the differences between rail-guided vehicles and automated guided vehicles?
- 10.13** What is a conveyor?
- 10.14** Name some of the different types of conveyors used in industry.
- 10.15** What is a recirculating conveyor?
- 10.16** What is the difference between a hoist and a crane?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Analysis of Vehicle-based Systems

- 10.1 (A)** An automated guided vehicle system has an average travel distance per delivery = 220 m and an average empty travel distance = 160 m. Load and unload times are each 24 sec and the speed of the AGV = 1 m/sec. Traffic factor = 0.9 and availability = 0.94. How many vehicles are needed to satisfy a delivery requirement of 35 deliveries/hr?
- 10.2** In Example 10.2, suppose that the vehicles operate according to the following scheduling rules: (1) vehicles delivering raw work parts from station 1 to stations 2, 3, and 4 must return empty to station 5; and (2) vehicles picking up finished parts at stations 2, 3, and 4 for delivery to station 5 must travel empty from station 1. (a) Determine the empty travel distances associated with each delivery and develop a from-to chart in the format of Table 10.5. (b) The AGVs travel at a speed of 50 m/min and the traffic factor = 0.90. Assume reliability = 100%. From Example 10.2, the delivery distance $L_d = 103.8$ m. Determine the value of L_e . (c) How many automated guided vehicles will be required to operate the system?
- 10.3** In Example 10.2, suppose that the vehicles operate according to the following scheduling rule in order to minimize the distances the vehicles travel empty: vehicles delivering raw work parts from station 1 to stations 2, 3, and 4 must pick up finished parts at these respective stations for delivery to station 5. (a) Determine the empty travel distances associated with each delivery and develop a from-to chart in the format of Table 10.5. (b) The AGVs travel at a speed of 50 m/min and the traffic factor = 0.90. Assume reliability = 100%. From Example 10.2, the delivery distance $L_d = 103.8$ m. Determine the value of L_e . (c) How many automated guided vehicles will be required to operate the system?
- 10.4** A planned manufacturing system will have the layout pictured in Figure P10.4 and will use an automated guided vehicle system to move parts between stations in the layout. All work parts are loaded into the system at station 1, moved to one of three processing stations (2, 3, or 4), and then brought back to station 1 for unloading. Once loaded onto its AGV, each work part stays onboard the vehicle throughout its time in the manufacturing system. Load and unload times at station 1 are each 0.5 min. Processing times at the processing stations are 6.5 min at station 2, 8.0 min at station 3, and 9.5 min at station 4. Vehicle speed = 50 m/min. Assume that the traffic factor = 1.0 and vehicle availability = 100%. (a) Construct the from-to chart for distances. (b) Determine the maximum hourly production rate for each of the three processing stations, assuming that 15 sec will be lost between successive vehicles at each station; this is the time for the vehicle presently at the station to move out and the next vehicle to move into the station for processing. (c) Find the total number of AGVs that will be needed to achieve these production rates.

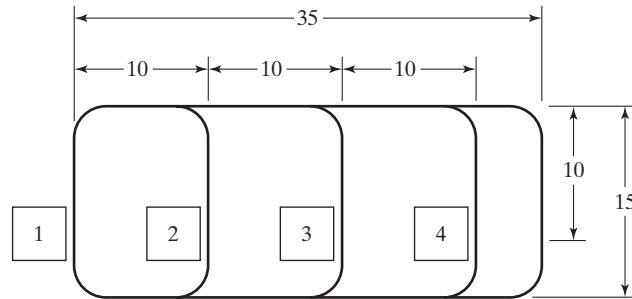


Figure P10.4 FMS layout for Problem 10.4.

- 10.5** In the previous problem, it is unrealistic to assume that the traffic factor will be 1.0 and that vehicle availability will be 100%. It is also unrealistic to believe that the processing stations will operate at 100% reliability. Solve the problem except the traffic factor = 90% and availability of the vehicles and processing workstations = 95%.
- 10.6 (A)** A fleet of forklift trucks is being planned for a new warehouse. The average travel distance per delivery will be 500 ft loaded and the average empty travel distance will be 400 ft. The fleet must make a total of 50 deliveries/hr. Load and unload times are each 0.75 min and the speed of the vehicles = 350 ft/min. Assume the traffic factor for the system = 0.85, availability = 0.95, and worker efficiency = 90%. Determine (a) ideal cycle time per delivery, (b) the resulting average number of deliveries/hr that a forklift truck can make, and (c) how many trucks are required to accomplish the 50 deliveries/hr.
- 10.7** Three forklift trucks are used to deliver pallet loads of parts between work cells in a factory. Average travel distance loaded is 350 ft and the travel distance empty is estimated to be the same. The trucks are driven at an average speed of 3 miles/hr when loaded and 4 miles/hr when empty. Terminal time per delivery averages 1.0 min (load = 0.5 min and unload = 0.5 min). If the traffic factor is assumed to be 0.90, availability = 100%, and worker efficiency = 0.95, what is the maximum hourly delivery rate of the three trucks?
- 10.8** An AGVS has an average loaded travel distance per delivery = 300 ft. The average empty travel distance is not known. Required number of deliveries/hr = 50. Load and unload times are each 0.5 min and the AGV speed = 200 ft/min. Anticipated traffic factor = 0.85 and availability = 0.95. Develop an equation that relates the number of vehicles required to operate the system as a function of the average empty travel distance L_e .
- 10.9** A rail-guided vehicle system is being planned as part of an assembly cell consisting of two parallel lines, as in Figure P10.9. In operation, a base part is loaded at station 1 and delivered to either station 2 or 4, where components are added to the base part. The RGV then goes to either station 3 or 5, respectively, where further assembly of components is accomplished. From stations 3 or 5, the completed product moves to station 6 for removal from the system. Vehicles remain with the products as they move through the station sequence; thus, there is no loading and unloading of parts at stations 2, 3, 4, and 5. After unloading parts at station 6, the vehicles then travel empty back to station 1 for reloading. The hourly moves (parts/hr, above the slash) and distances (ft, below the slash) are listed in the following table. Moves indicated by "L" are trips in which the vehicle is loaded, while "E" indicates moves in which the vehicle is empty. RGV speed = 150 ft/min. Assembly cycle times at stations 2 and 3 = 4.0 min each and at stations 4 and 5 = 6.0 min each. Load and unload times at stations 1 and 6, respectively, are each 0.75 min. Traffic factor = 1.0 and availability = 1.0. How many vehicles are required to operate the system?

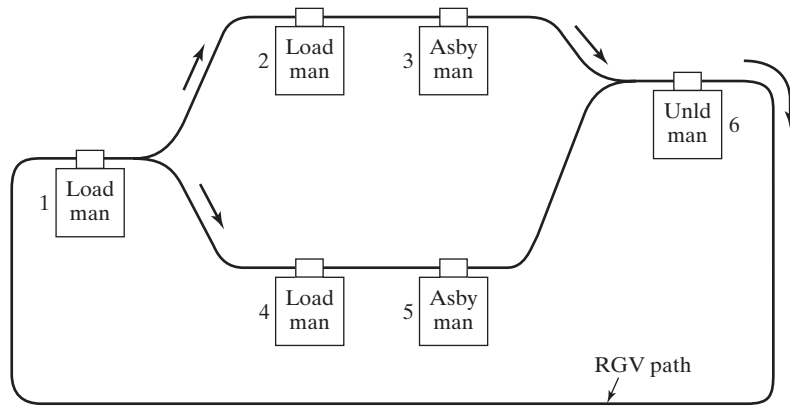


Figure P10.9 Layout for Problem 10.9. Key: Man = manual, Asby = assembly, Unld = unload.

	To	1	2	3	4	5	6
From	1	0/0	13L/100	—	9L/80	—	—
	2	—	0/0	13L/30	—	—	—
	3	—	—	0/0	—	—	13L/50
	4	—	—	—	0/0	9L/30	—
	5	—	—	—	—	0/0	9L/70
	6	22E/300	—	—	—	—	0/0

10.10 An AGVS will be used to satisfy the material flows in the from-to chart below, which shows delivery rates between stations (pc/hr, above the slash) and distances between stations (m, below the slash). Moves indicated by “L” are trips in which the vehicle is loaded, while “E” indicates moves in which the vehicle is empty. It is assumed that availability = 0.90, traffic factor = 0.85, and efficiency = 1.0. Speed of an AGV = 0.9 m/sec. If load handling time per delivery cycle = 1.0 min (load = 0.5 min and unload = 0.5 min), how many vehicles are needed to satisfy the indicated deliveries per hour?

	To	1	2	3	4
From	1	0/0	9L/90	7L/120	5L/75
	2	5E/90	0/0	—	4L/80
	3	7E/120	—	0/0	—
	4	9E/75	—	—	0/0

10.11 An automated guided vehicle system is being proposed to deliver parts between 40 workstations in a factory. Loads must be moved from each station about once every hour; thus, the delivery rate = 40 loads/hr. Average travel distance loaded is estimated to be 250 ft and travel distance empty is estimated to be 300 ft. Vehicles move at a speed = 200 ft/min. Total handling time per delivery = 1.5 min (load = 0.75 min and unload = 0.75 min). Traffic factor F_t becomes increasingly significant as the number of vehicles n_c increases; this can be modeled as $F_t = 1.0 - 0.05(n_c - 1)$, for $n_c = \text{Integer} > 0$. Determine the minimum number of vehicles needed in the factory to meet the flow rate requirement. Assume that availability = 1.0 and worker efficiency = 1.0.

- 10.12** A driverless train AGVS is being planned for a warehouse complex. Each train will consist of a towing vehicle plus four carts. Speed of the trains = 160 ft/min. Only the pulled carts carry loads. Average loaded travel distance per delivery cycle is 2,000 ft and empty travel distance is the same. Assume the travel factor = 0.95 and availability = 1.0. The load handling time per train per delivery is expected to be 10 min. If the requirements on the AGVS are 25 cart loads/hr, determine the number of trains required.
- 10.13** The from-to chart below indicates the number of loads moved per 8-hr day (above the slash) and the distances in ft (below the slash) between departments in a particular factory. Fork lift trucks are used to transport the materials. They move at an average speed = 275 ft/min (loaded) and 350 ft/min (empty). Load handling time (loading plus unloading) per delivery is 1.5 min and anticipated traffic factor = 0.9. Availability = 95% and worker efficiency = 110%. Determine the number of trucks required under each of the following assumptions: (a) the trucks never travel empty; and (b) the trucks travel empty a distance equal to their loaded distance.

		To Dept.	A	B	C	D	E
From Dept	A		0/0	62/500	51/450	45/350	—
	B		—	0/0	—	22/400	—
	C		—	—	0/0	—	76/200
	D		—	—	—	0/0	65/150
	E		—	—	—	—	0/0

- 10.14** A warehouse consists of five aisles of racks (racks on both sides of each aisle) and a loading dock. The rack system is four levels high. Forklift trucks are used to transport loads between the loading dock and the storage compartments of the rack system in each aisle. The trucks move at an average speed = 120 m/min (loaded) and 150 m/min (empty). Load handling time (loading plus unloading) per delivery totals 1.0 min per storage/retrieval delivery on average, and the anticipated traffic factor = 0.90. Worker efficiency = 100% and vehicle availability = 95%. The average distance between the loading dock and the centers of aisles 1 through 5 are 150 m, 250 m, 350 m, 450 m, and 550 m, respectively. These values are to be used to compute travel times. The required rate of storage/retrieval deliveries is 75/hr, distributed evenly among the five aisles, and the trucks perform either storage or retrieval deliveries, but not both in one delivery cycle. Determine the number of forklift trucks required to achieve the 75 deliveries per hour.
- 10.15** Suppose the warehouse in the preceding problem were organized according to a class-based dedicated storage strategy based on activity level of the pallet loads in storage, so that aisles 1 and 2 accounted for 70% of the deliveries (class A) and aisles 3, 4, and 5 accounted for the remaining 30% (class B). Assume that deliveries in class A are evenly divided between aisles 1 and 2, and that deliveries in class B are evenly divided between aisles 3, 4, and 5. How many forklift trucks would be required to achieve 75 storage/retrieval deliveries per hour?
- 10.16** Major appliances are assembled on a production line at the rate of 50/hr. The products are moved along the line on work pallets (one product per pallet). At the final workstation the finished products are removed from the pallets. The pallets are then removed from the line and delivered back to the front of the line for reuse. Automated guided vehicles are used to transport the pallets to the front of the line, a distance of 500 ft. Return trip distance (empty) to the end of the line is also 500 ft. Each AGV carries three pallets and travels at a speed of 200 ft/min (loaded or empty). The pallets form queues at each end of the line, so that neither the production line nor the AGVs are ever starved for pallets. Time required to load each pallet onto an AGV = 15 sec; time to release a loaded AGV and move an empty AGV into position for loading at the end of the line = 12 sec. The same times apply

for pallet handling and release/positioning at the unload station located at the front of the production line. Assume availability = 100% and traffic factor = 1.0 because the route is a simple loop. How many vehicles are needed to operate the AGV system?

- 10.17** For the production line in the previous problem, assume that a single AGV train consisting of a tractor and multiple trailers is used to make deliveries rather than separate vehicles. Time required to load a pallet onto a trailer = 15 sec; and the time to release a loaded train and move an empty train into position for loading at the end of the production line = 30 sec. The same times apply for pallet handling and release/positioning at the unload station located at the front of the production line. The velocity of the AGV train = 175 ft/min (loaded or empty). Assume availability = 100% and traffic factor = 1.0 because there is only one train. If each trailer carries three pallets, how many trailers should be included in the train?
- 10.18 (A)** An AGVS will be installed to deliver loads between four workstations: A, B, C, and D. Hourly flow rates (loads/hr, above the slash) and distances (m, below the slash) within the system are given in the table below (travel loaded denoted by “L” and travel empty denoted by “E”). Load and unload times are each 0.45 min, and travel speed of each vehicle is 1.4 m/sec. A total of 43 loads enter the system at station A, and 30 loads exit the system at station A. In addition, during each hour, six loads exit the system from station B and seven loads exit the system from station D. This is why there are a total of 13 empty trips made by the vehicles within the AGVS. How many vehicles are required to satisfy these delivery requirements, assuming the traffic factor = 0.85 and availability = 95%?

	To	A	B	C	D
From	A	—	18L/95	10L/80	15L/150
	B	6E/95	—	12L/65	
	C			—	22L/80
	D	30L/150 7E/150			—

Analysis of Conveyor Systems

- 10.19 (A)** An overhead trolley conveyor is configured as a closed loop. The delivery loop has a length of 100 m and the return loop is 60 m. All parts loaded at the load station are unloaded at the unload station. Each hook on the conveyor can hold one part and the hooks are separated by 2 m. Conveyor speed = 0.5 m/sec. Determine (a) number of parts in the conveyor system under normal operations, (b) parts flow rate; and (c) maximum loading and unloading times that are compatible with the operation of the conveyor system?
- 10.20** A 400-ft long roller conveyor operates at a velocity = 50 ft/min and is used to move parts in containers between load and unload stations. Each container holds 15 parts. One worker at the load station is able to load parts into containers and place the containers onto the conveyor in 45 sec. It takes 30 sec to unload at the unload station. Determine (a) center-to-center distance between containers, (b) number of containers on the conveyor at one time, and (c) hourly flow rate of parts. (d) By how much must conveyor speed be increased in order to increase flow rate to 1,500 parts/hr?
- 10.21 (A)** A roller conveyor moves tote pans in one direction at 200 ft/min between a load station and an unload station, a distance of 350 ft. With one worker, the time to load parts into a tote pan at the load station is 3 sec per part. Each tote pan holds 10 parts. In addition, it takes 15 sec to load a tote pan of parts onto the conveyor. Determine (a) spacing between

tote pan centers flowing in the conveyor system and (b) flow rate of parts on the conveyor system. (c) Consider the effect of the Unit Load Principle. Suppose the tote pans were smaller and could hold only one part instead of 10. Determine the flow rate of parts in this case if it takes 7 sec to load a tote pan onto the conveyor (instead of 15 sec for the larger tote pan), and it takes the same 3 sec to load the part into the tote pan.

- 10.22** A closed loop overhead conveyor must be designed to deliver parts from one load station to one unload station. The specified flow rate of parts that must be delivered between the two stations is 300 parts/hr. The conveyor has carriers spaced at a center-to-center distance that is to be determined. Each carrier holds one part. Forward and return loops will each be 90 m long. Conveyor speed = 0.5 m/sec. Times to load and unload parts at the respective stations are each = 12 sec. Is the system feasible and if so, what is the appropriate number of carriers and spacing between carriers that will achieve the specified flow rate?
- 10.23** Consider the previous problem, only the carriers are larger and capable of holding up to four parts ($n_p = 2, 3, \text{ or } 4$). The loading time $T_L = 9 + 3n_p$, where T_L is in seconds. With other parameters defined in the previous problem, determine which of the three values of n_p are feasible. For those values that are feasible, specify the appropriate design parameters for (a) spacing between carriers and (b) number of carriers that will achieve this flow rate.
- 10.24** A recirculating conveyor has a total length of 700 ft and a speed of 90 ft/min. Spacing of part carriers = 14 ft. Each carrier holds one part. Automated machines load and unload the conveyor at the load and unload stations. Time to load a part is 0.10 min and unload time is the same. To satisfy production requirements, the loading and unloading rates are each 2.0 parts per min. Evaluate the conveyor system design with respect to the three principles developed by Kwo.
- 10.25** A recirculating conveyor has a total length of 200 m and a speed of 50 m/min. Spacing of part carriers = 5 m. Each carrier holds two parts. Time needed to load a part carrier = 0.15 min. Unloading time is the same. The required loading and unloading rates are 6 parts per min. Evaluate the conveyor system design with respect to the three Kwo principles.
- 10.26** There is a plan to install a continuous loop conveyor system with a total length of 1,000 ft and a speed of 50 ft/min. The conveyor will have carriers separated by 25 ft. Each carrier can hold one part. A load station and an unload station are to be located 500 ft apart along the conveyor loop. Each day, the conveyor system is planned to operate as follows, starting empty at the beginning of the day. The load station will load parts at the rate of one part every 30 sec, continuing this loading operation for 10 min, then resting for 10 min during which no loading occurs. It will repeat this 20 min cycle of loading and then resting throughout the 8-hr shift. The unload station will wait until loaded carriers begin to arrive, then will unload parts at the rate of one part every minute during the 8 hr, continuing until all carriers are empty. Will the planned conveyor system work? Present calculations and arguments to justify your answer.

Storage Systems

CHAPTER CONTENTS

- 11.1 Introduction to Storage Systems
 - 11.1.1 Storage System Performance
 - 11.1.2 Storage Location Strategies
- 11.2 Conventional Storage Methods and Equipment
- 11.3 Automated Storage Systems
 - 11.3.1 Fixed-Aisle Automated Storage/Retrieval Systems
 - 11.3.2 Carousel Storage Systems
- 11.4 Analysis of Storage Systems
 - 11.4.1 Fixed-Aisle Automated Storage/Retrieval Systems
 - 11.4.2 Carousel Storage Systems

The function of a material storage system is to store materials for a period of time and to permit access to those materials when required. Some production plants and storage facilities use manual methods for storing and retrieving materials. The storage function is often accomplished inefficiently in terms of human resources, factory floor space, and material control. More effective approaches and automated methods are available to improve the efficiency of the storage function.

This chapter provides an overview of material storage systems and describes the types of methods and systems used in a company's manufacturing and distribution operations. When used in manufacturing, storage systems are sometimes physically integrated with the production equipment. These cases are covered in several other chapters in this book, including parts storage in single-station automated cells (Chapter 14), buffer

storage in transfer lines (Chapter 16), storage of component parts in automated assembly systems (Chapter 17), and temporary storage of work-in-process in flexible manufacturing systems (Chapter 19). The present chapter emphasizes the storage system itself and the approaches and equipment related to it. Coverage of storage equipment is divided into two major categories: (1) conventional storage methods and (2) automated storage systems. The chapter begins with an overview of storage systems, focusing on performance measures and strategies. The final section of the chapter presents a quantitative analysis of automated storage systems, with emphasis on two important performance measures: storage capacity and throughput.

11.1 INTRODUCTION TO STORAGE SYSTEMS

Materials stored by a manufacturing firm include a variety of types, as indicated in Table 11.1. Categories (1) through (5) relate directly to the product, (6) through (8) relate to the process, and (9) and (10) relate to overall support of factory operations. The different categories require different storage methods and controls, as discussed in the coverage of equipment in Sections 11.2 and 11.3.

Whatever the stored materials, certain metrics and approaches can be used to design and operate the storage system so that it is as efficient as possible in fulfilling its function for the company. The coverage addresses the following topics: (1) measures of storage system performance and (2) storage location strategies.

TABLE 11.1 Types of Materials Typically Stored in a Factory

Type	Description
1. Raw materials	Raw stock to be processed (e.g., bar stock, sheet metal, plastic molding compound)
2. Purchased parts	Parts from vendors to be processed or assembled (e.g., castings, purchased components)
3. Work-in-process	Partially completed parts between processing operations and parts awaiting assembly
4. Finished product	Completed product ready for shipment
5. Rework and scrap	Parts that do not meet specifications, either to be reworked or scrapped
6. Refuse	Chips, swarf, oils, other waste products left over after processing; these materials must be disposed of, sometimes using special precautions
7. Tooling and supplies	Cutting tools, jigs, fixtures, molds, dies, welding wire, and other tools used in production; supplies such as helmets and gloves
8. Spare parts	Parts needed for maintenance and repair of factory equipment
9. Office supplies	Paper, paper forms, writing instruments, and other items used in support of plant office
10. Plant records	Records on product, production, equipment, personnel, etc. (paper documents and electronic media)

11.1.1 Storage System Performance

The performance of a storage system in accomplishing its function must be sufficient to justify its investment and operating expense. Various measures used to assess the performance of a storage system include (1) storage capacity, (2) storage density, (3) accessibility, and (4) throughput. In addition, standard measures used for mechanized and automated systems include (5) utilization and (6) reliability.¹

Storage capacity can be defined and measured in two ways: (1) as the total volumetric space available or (2) as the total number of storage compartments in the system available to hold items or loads. In many storage systems, materials are stored as unit loads that are held in standard-size containers (pallets, tote pans, or other containers). The standard container can readily be handled, transported, and stored by the storage system and by the material transport system that may be connected to it. Hence, storage capacity is conveniently measured as the number of unit loads that can be stored in the system. The physical capacity of the storage system should be greater than the maximum number of loads anticipated to be stored, to provide available empty spaces for materials entering the system, and to allow for variations in maximum storage requirements.

Storage density is defined as the volumetric space available for actual storage relative to the total volumetric space in the storage facility. In many warehouses, aisle space and wasted overhead space account for more volume than the volume available for actual storage of materials. Floor area is sometimes used to assess storage density, because it is convenient to measure this on a floor plan of the facility. However, volumetric density is usually a more appropriate measure than area density.

For efficient use of space, the storage system should be designed to achieve a high density. However, as storage density is increased, **accessibility**, another important measure of storage performance, is adversely affected. **Accessibility** refers to the capability to access any desired item or load stored in the system. In the design of a given storage system, appropriate trade-offs must be made between storage density and accessibility.

System throughput is defined as the hourly rate at which the storage system (1) receives and puts loads into storage and/or (2) retrieves and delivers loads to the output station. In many factory and warehouse operations, there are certain periods of the day when the required rate of storage and/or retrieval transactions is greater than at other times. The storage system must be designed for the maximum throughput that will be required during the day.

System throughput is limited by the time to perform a storage or retrieval (S/R) transaction. A typical storage transaction consists of the following elements: (1) pick up load at input station, (2) travel to storage location, (3) place load in storage location, and (4) travel back to input station. A retrieval transaction consists of: (1) travel to storage location, (2) pick up item from storage, (3) travel to output station, and (4) unload at output station. Each element takes time. The sum of the element times is the transaction time that determines throughput of the storage system. Throughput can sometimes be increased by combining storage and retrieval transactions in one cycle, thus reducing travel time; this is called a *dual-command cycle*. When either a storage or a retrieval transaction alone is performed in the cycle, it is called a *single-command cycle*. The ability to perform dual-command cycles rather than single-command cycles depends on demand and

¹The discussion here is limited to physical storage and not electronic storage media, although analogous performance metrics would apply to electronic storage.

scheduling issues. If, during a certain portion of the day, there is demand for only storage transactions and no retrievals, then it is not possible to include both types of transactions in the same cycle. If both transaction types are required, then greater throughput will be achieved by scheduling dual-command cycles. This scheduling is more readily done by a computerized (automated) storage system than by one controlled manually.

In manually operated systems, time is often lost looking up the storage location of the item being stored or retrieved. Computer-generated pick lists can be used to reduce such losses. Also, greater efficiency can be achieved in manual systems by combining multiple storage and/or retrieval transactions in one cycle, thus reducing time traveling to and from the input/output station. However, the drawback of manual systems is that they are subject to the variations and motivations of the human workers in these systems, and there is a lack of management control over the operations.

Two additional performance measures applicable to mechanized and automated storage systems are utilization and availability. **Utilization** is defined as the proportion of time that the system is actually being used for performing S/R operations compared with the time it is available. Utilization varies throughout the day, as requirements change from hour to hour. It is desirable to design an automated storage system for relatively high utilization, in the range 80–90%. If utilization is too low, then the system is probably oversized. If utilization is too high, then there is no allowance for rush periods or system breakdowns.

Availability is a measure of system reliability, defined as the proportion of time that the system is capable of operating (not broken down) compared with the normally scheduled shift hours (Section 3.1.1). Malfunctions and failures of the equipment cause downtime. Reasons for downtime include computer failures, mechanical breakdowns, load jams, improper maintenance, and incorrect procedures by personnel using the system. The reliability of an existing system can be improved by following good preventive maintenance procedures and by having repair parts on hand for critical components. Backup procedures should be devised to mitigate the effects of system downtime.

11.1.2 Storage Location Strategies

Several strategies can be used to organize stock in a storage system. These storage location strategies affect the performance measures discussed above. The two basic strategies applied in warehousing operations are (1) randomized storage and (2) dedicated storage. Each item type stored in a warehouse is known as a *stock-keeping-unit* (SKU). The SKU uniquely identifies that item type. The inventory records of the storage facility maintain a count of the quantities of each SKU that are in storage.

In randomized storage, items are stored in any available location in the storage system. In the usual implementation of randomized storage, incoming items are placed into storage in the nearest available open location. When an order is received for a given SKU, the stock is retrieved from storage according to a first-in-first-out policy so that the items held in storage the longest are used to make up the order.

In dedicated storage, SKUs are assigned to specific locations in the storage facility. This means that locations are reserved for all SKUs stored in the system, and so the number of storage locations for each SKU must be sufficient to accommodate its maximum inventory level. The basis for specifying the storage locations is usually one of the following: (1) items are stored in part number or product number sequence; (2) items are stored according to activity level, the more active SKUs being located closer to the input/output

station; or (3) items are stored according to their activity-to-space ratios, the higher ratios being located closer to the input/output station.

When comparing the benefits of the two strategies, it is generally found that less total space is required in a storage system that uses randomized storage, but higher throughput rates can usually be achieved when a dedicated storage strategy is implemented based on activity level. Example 11.1 illustrates the storage density advantage of randomized storage.

EXAMPLE 11.1 Comparison of Storage Strategies

Suppose that a total of 50 SKUs must be stored in a storage system. For each SKU, average order quantity = 100 cartons, average depletion rate = 2 cartons/day, and safety stock level = 10 cartons. Each carton requires one storage location in the system. Based on this data, each SKU has an inventory cycle that lasts 50 days. Since there are 50 SKUs in all, management has scheduled incoming orders so that a different SKU arrives each day. Determine the number of storage locations required in the system under two alternative strategies: (a) randomized storage and (b) dedicated storage.

Solution: The inventory for each SKU varies over time as shown in Figure 11.1. The maximum inventory level, which occurs just after an order has been received, is the sum of the order quantity and safety stock level:

$$\text{Maximum inventory level} = 100 + 10 = 110 \text{ cartons}$$

The average inventory is the average of the maximum and minimum inventory levels under the assumption of uniform depletion rate. The minimum value occurs just before an order is received when the inventory is depleted to the safety stock level:

$$\text{Minimum inventory level} = 10 \text{ cartons}$$

$$\text{Average inventory level} = (110 + 10) / 2 = 60 \text{ cartons}$$

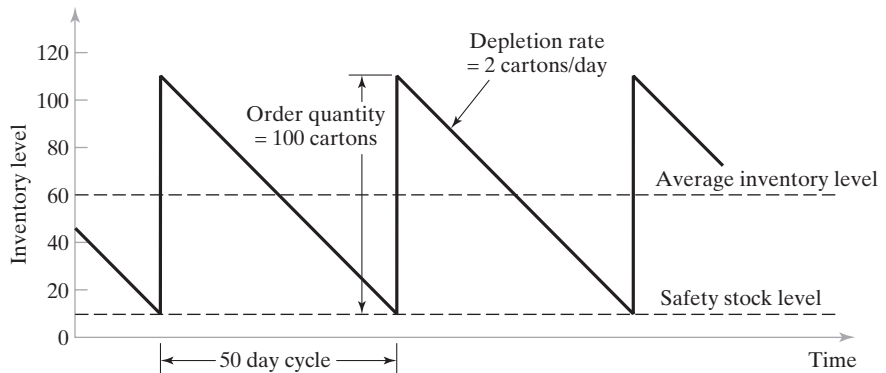


Figure 11.1 Inventory level as a function of time for each SKU in Example 11.1.

(a) Under a randomized storage strategy, the number of locations required for each SKU is equal to the average inventory level of the item, since incoming orders are scheduled each day throughout the 50-day cycle. This means that when the inventory level of one SKU near the beginning of its cycle is high, the level for another SKU near the end of its cycle is low. Thus, the number of storage locations required in the system = (50 SKUs) (60 cartons) = **3,000 locations**.

(b) Under a dedicated storage strategy, the number of locations required for each SKU must equal its maximum inventory level. Thus, the number of storage locations required in the storage system = (50 SKUs) (110 cartons) = **5,500 locations**.

Some of the advantages of both storage strategies can be obtained in a class-based dedicated storage allocation, in which the storage system is divided into several classes according to activity level, and a randomized storage strategy is used within each class. The classes containing more active SKUs are located closer to the input/output point of the storage system for increased throughput, and the randomized locations within the classes reduce the total number of storage compartments required. The effect of class-based dedicated storage on throughput is considered in several end-of-chapter problems.

11.2 CONVENTIONAL STORAGE METHODS AND EQUIPMENT

A variety of storage methods and equipment are available to store the various materials listed in Table 11.1. The choice of method and equipment depends largely on the materials to be stored, the operating philosophy of the personnel managing the storage facility, and budgetary limitations. The traditional (non-automated) methods and equipment types are discussed in this section. Automated storage systems are discussed in the following section. Application characteristics for the different equipment types are summarized in Table 11.2.

TABLE 11.2 Application Characteristics of the Types of Storage Equipment and Methods

Storage Equipment	Advantages and Disadvantages	Typical Applications
Bulk storage	Highest density is possible Low accessibility Low cost per square foot	Storage of low turnover, large stock, or large unit loads
Rack systems	Low cost Good storage density Good accessibility	Palletized loads in warehouses
Shelves and bins	Some stock items not clearly visible	Storage of individual items on shelves and commodity items in bins
Drawer storage	Contents of drawer easily visible Good accessibility Relatively high cost	Small tools Small stock items Repair parts
Automated storage systems	High throughput rates Facilitates use of computerized inventory control system Highest cost equipment Facilitates integration with automated material handling systems	Work-in-process storage Final product warehousing and distribution center Order picking Kitting of parts for electronic assembly

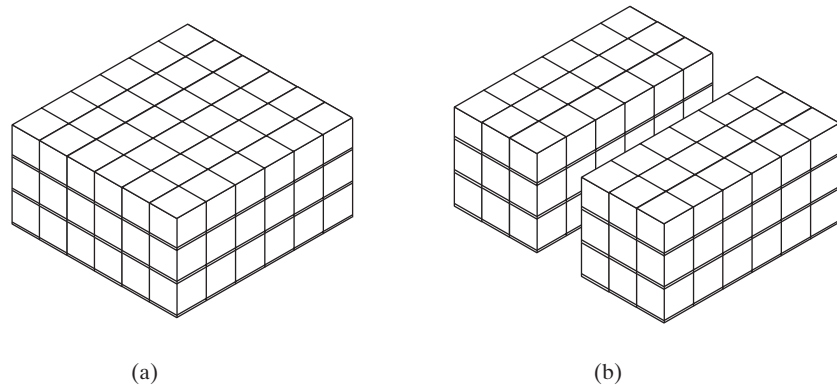


Figure 11.2 Two bulk storage arrangements: (a) high-density bulk storage provides low accessibility; (b) bulk storage with loads arranged to form rows and blocks for improved accessibility.

Bulk Storage. Bulk storage is the storage of stock in an open floor area. The stock is generally contained in unit loads on pallets or similar containers, and unit loads are stacked on top of each other to increase storage density. The highest density is achieved when unit loads are placed next to each other in both floor directions, as in Figure 11.2(a). However, this provides very poor access to internal loads. To increase accessibility, bulk storage loads can be organized into rows and blocks, so that natural aisles are created between pallet loads, as in Figure 11.2(b). The block widths can be designed to provide an appropriate balance between density and accessibility. Depending on the shape and physical support provided by the items stored, there may be a restriction on how high the unit loads can be stacked. In some cases, loads cannot be stacked on top of each other, either because of the physical shape or limited compressive strength of the individual loads. The inability to stack loads in bulk storage reduces storage density, removing one of its principal benefits.

Although bulk storage is characterized by the absence of specific storage equipment, material handling equipment must be used to put materials into storage and to retrieve them. Industrial trucks such as pallet trucks and powered forklifts (Section 10.2.1) are typically used for this purpose.

Rack Systems. Rack systems provide a method of stacking unit loads vertically without the need for the loads themselves to provide support. One of the most common rack systems is the pallet rack, consisting of a frame that includes horizontal load-supporting beams, as illustrated in Figure 11.3. Pallet loads are stored on these horizontal beams. Alternative storage rack systems include

- *Cantilever racks*, similar to pallet racks except the supporting horizontal beams are cantilevered from the vertical central frame. Elimination of the vertical beams at the front of the frame provides unobstructed spans, which facilitates storage of long materials such as rods, bars, and pipes.
- *Flow-through racks*. In place of the horizontal load-supporting beams in a conventional rack system, the flow-through rack uses long conveyor tracks capable of

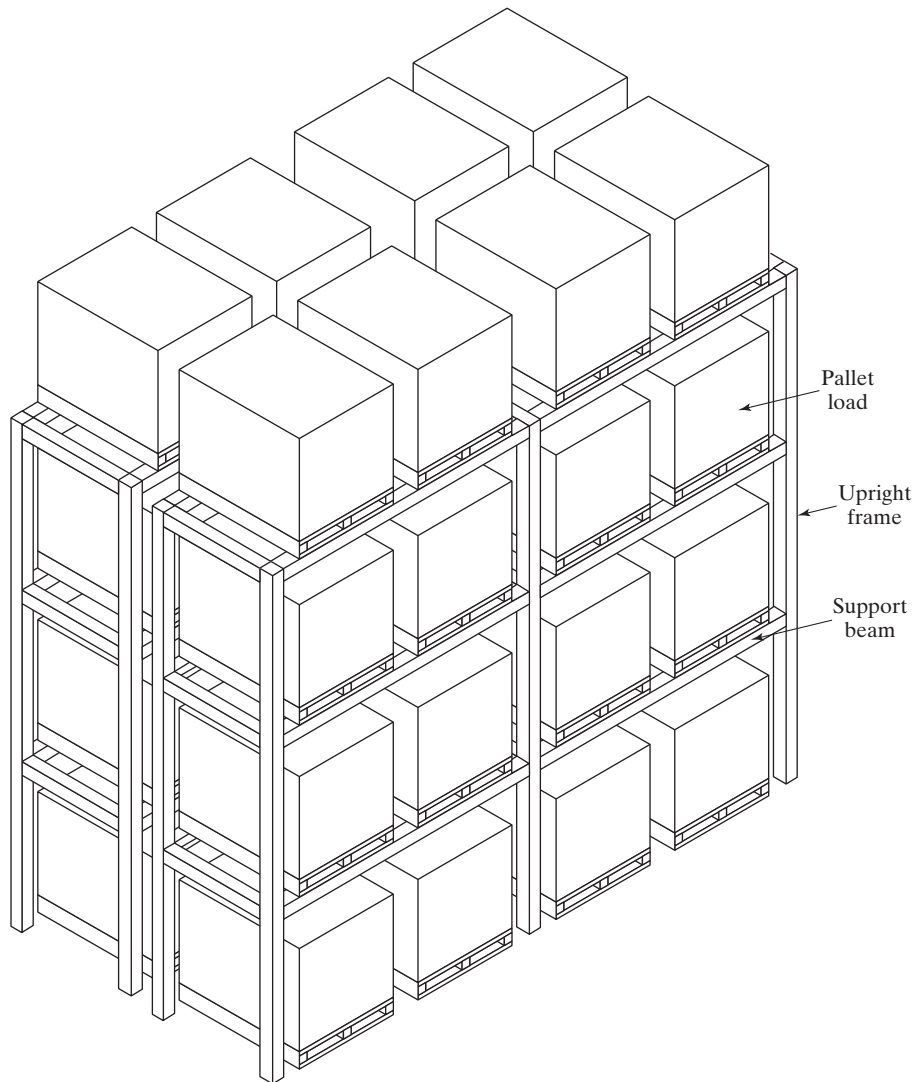


Figure 11.3 Pallet rack system for storage of unit loads on pallets.

supporting a row of unit loads. The unit loads are loaded from one side of the rack and unloaded from the other side, thus providing first-in-first-out stock rotation. The conveyor tracks are inclined at a slight angle to allow gravity to move the loads toward the output side of the rack system.

Shelving and Bins. Shelves represent one of the most common storage equipment types. A shelf is a horizontal platform, supported by a wall or frame, on which materials are stored. Steel shelving sections are manufactured in standard sizes, typically ranging from about 0.9 to 1.2 m (3 to 4 ft) long (in the aisle direction), from 0.3 to 0.6 m

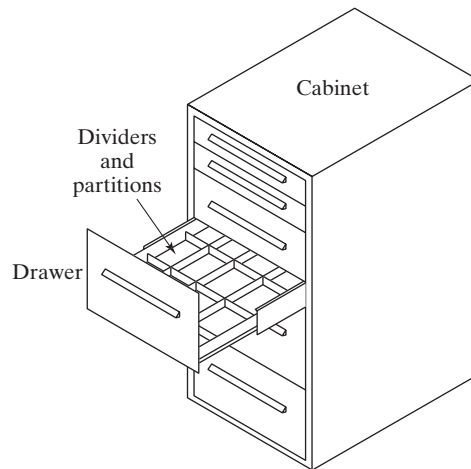


Figure 11.4 Drawer storage.

(12 to 24 in) wide, and up to 3.0 m (10 ft) tall. Shelving often includes bins, which are containers or boxes that hold loose items.

Drawer Storage. Finding items in shelving can sometimes be difficult, especially if the shelf is either far above or far below eye level for the storage attendant. Storage drawers, Figure 11.4, can alleviate this problem because each drawer pulls out to allow its entire contents to be readily seen. Modular drawer storage cabinets are available with a variety of drawer depths for different item sizes and are widely used for storage of tools and maintenance items.

11.3 AUTOMATED STORAGE SYSTEMS

The storage equipment described in the preceding section requires a human worker to access the items in storage. The storage system itself is static. Mechanized and automated storage systems are available that reduce or eliminate the amount of human intervention required to operate the system. The level of automation varies. In less automated systems, a human operator is required to handle each storage/retrieval transaction. In highly automated systems, loads are entered or retrieved under computer control, with no human participation except to input data to the computer. Table 11.2 lists the advantages and disadvantages as well as typical applications of automated storage systems.

An automated storage system represents a significant investment, and it often requires a new and different way of doing business. Companies have a variety of reasons for automating the storage function. Table 11.3 provides a list of possible objectives and reasons behind company decisions to automate their storage operations.

Automated storage systems divide into two general types: (1) fixed-aisle automated storage/retrieval systems and (2) carousel storage systems. A fixed-aisle AS/RS consists of a rack structure for storing loads and a storage/retrieval machine whose motions are linear (x - y - z motions), as pictured in Figure 11.5. By contrast, a carousel system uses

TABLE 11.3 Possible Objectives and Reasons for Automating a Company's Storage Operations

-
- To increase storage capacity
 - To increase storage density
 - To recover factory floor space presently used for storing work-in-process
 - To improve security and reduce pilferage
 - To improve safety in the storage function
 - To reduce labor cost and/or increase labor productivity in storage operations
 - To improve control over inventories
 - To improve stock rotation
 - To improve customer service
 - To increase throughput
-

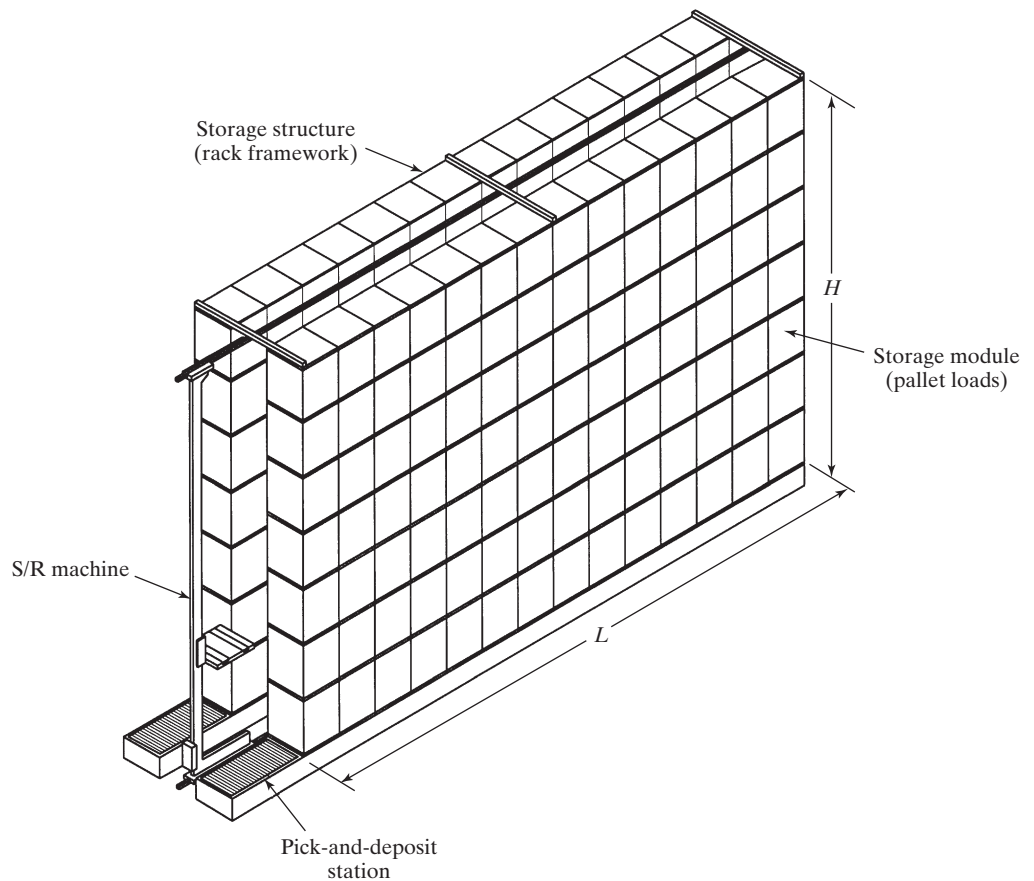


Figure 11.5 One aisle of a unit load automated storage/retrieval system (AS/RS).

storage baskets attached to a chain-driven conveyor that revolves around an oval track loop to deliver the baskets to a load/unload station, as in Figure 11.6. The differences between an AS/RS and a carousel storage system are summarized in Table 11.4. Both types include horizontal and vertical structures, with the horizontal configuration being much more common in both cases.

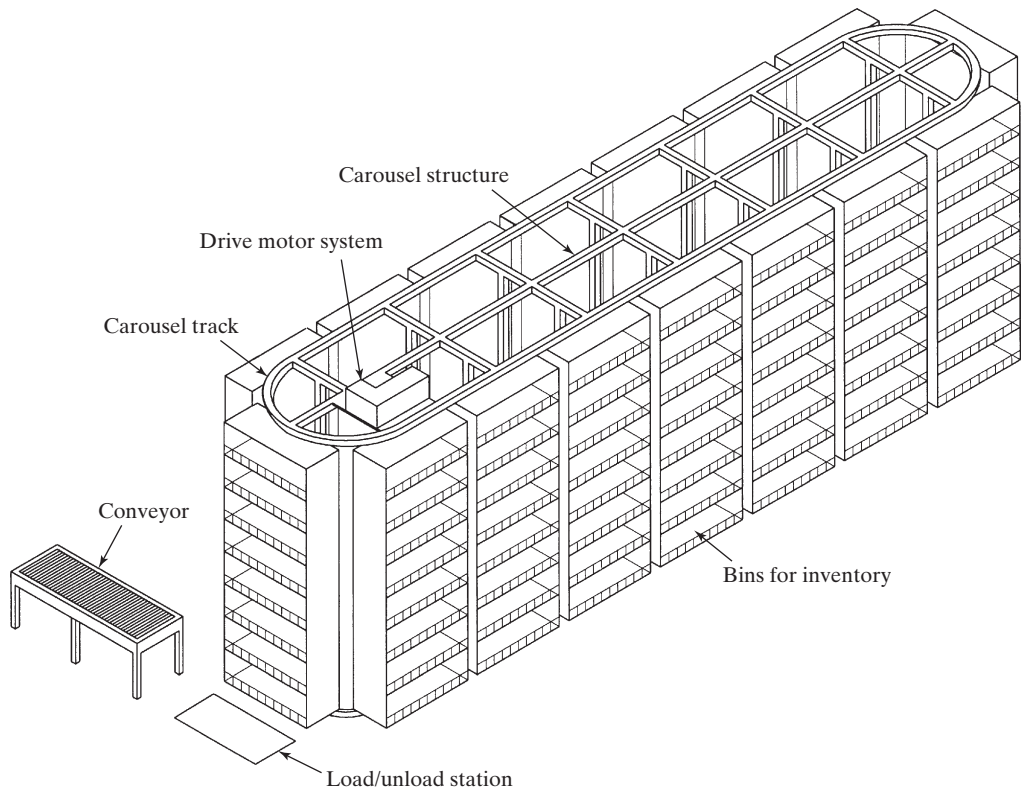


Figure 11.6 A horizontal storage carousel.

TABLE 11.4 Differences Between a Fixed-Aisle AS/RS and a Carousel Storage System

Feature	Fixed-Aisle AS/RS	Carousel Storage System
Storage structure	Rack system to support pallets or shelf system to support tote bins	Baskets suspended from overhead conveyor trolleys
Motions	Linear motions of S/R machine	Revolution of conveyor trolleys around oval track
Storage/retrieval operation	S/R machine travels to compartments in rack structure	Conveyor revolves to bring baskets to load/unload station
Replication of storage capacity	Multiple aisles, each consisting of rack structure and S/R machine	Multiple carousels, each consisting of oval track and storage bins

11.3.1 Fixed-Aisle Automated Storage/Retrieval Systems

A fixed-aisle automated storage/retrieval system (AS/RS) is a storage system consisting of one or more aisles of storage racks attended by storage/retrieval machines, usually one S/R machine per aisle. The system performs storage and retrieval operations with speed and accuracy under a defined degree of automation. The S/R machines (sometimes referred to as *cranes*) are used to deliver materials to the storage racks and to retrieve

materials from the racks. Each AS/RS aisle has one or more input/output stations where materials are delivered into the storage system and withdrawn from it. The input/output stations are called *pickup-and-deposit stations* (P&D stations) in AS/RS terminology. P&D stations can be manually operated or interfaced to some form of automated transport system such as a conveyor or an AGVS (automated guided vehicle system).

Figure 11.5 shows one aisle of an AS/RS that handles and stores unit loads on pallets. A wide range of automation is found in commercially available AS/RSs. At the most sophisticated level, the operations are computer controlled and fully integrated with factory and/or warehouse operations. At the other extreme, human workers control the equipment and perform the storage/retrieval transactions. Fixed-aisle automated storage/retrieval systems are custom-designed for each application, although the designs are based on standard modular components available from each respective AS/RS supplier.

AS/RS Types. Several important categories of fixed-aisle automated storage/retrieval system can be distinguished. The following are the principal types:

- *Unit load AS/RS.* The unit load AS/RS is typically a large automated system designed to handle unit loads stored on pallets or in other standard containers. The system is computer controlled, and the S/R machines are automated and designed to handle the unit load containers. The AS/RS pictured in Figure 11.5 is a unit load system. Other systems described below represent variations of the unit load AS/RS.
- *Deep-lane AS/RS.* The deep-lane AS/RS is a high-density unit load storage system that is appropriate when large quantities of stock are stored, but the number of separate stock types (SKUs) is relatively small. Instead of storing each unit load so that it can be accessed directly from the aisle (as in a conventional unit load system), the deep-lane system stores ten or more loads in a single rack, one load behind the next. Each rack is designed for “flow-through,” with input on one side and output on the other side. Loads are picked up from one side of the rack by an S/R-type machine designed for retrieval, and another machine inputs loads on the entry side of the rack.
- *Miniload AS/RS.* This storage system is used to handle small loads (individual parts or supplies) that are contained in bins or drawers in the storage system. The S/R machine is designed to retrieve the bin and deliver it to a P&D station at the end of the aisle so that individual items can be withdrawn from the bins. The P&D station is usually operated by a human worker. The bin or drawer must then be returned to its location in the system. A miniload AS/RS is generally smaller than a unit load AS/RS and is often enclosed for security of the items stored.
- *Man-on-board S/RS.* A man-on-board (also called *man-aboard*) storage/retrieval system represents an alternative approach to the problem of retrieving individual items from storage. In this system, a human operator rides on the carriage of the S/R machine. Whereas the miniload system delivers an entire bin to the end-of-aisle pick station and must return it subsequently to its proper storage compartment, with the man-on-board system the worker picks individual items directly at their storage locations. This offers an opportunity to increase system throughput.
- *Automated item retrieval system.* These storage systems are also designed for retrieval of individual items or small product cartons; however, the items are stored

in lanes rather than bins or drawers. When an item is retrieved, it is pushed from its lane and drops onto a conveyor for delivery to the pickup station. The operation is somewhat similar to a candy vending machine, except that an item retrieval system has more storage lanes and a conveyor to transport items to a central location. The supply of items in each lane is periodically replenished, usually from the rear of the system so that there is flow-through of items, thus permitting first-in/first-out inventory rotation.

- *Vertical lift modules (VLM)*. All of the preceding AS/RS types are designed around a fixed horizontal aisle. The same principle of using a center aisle to access loads is used in a VLM except that the aisle is vertical. The structure consists of two columns of trays that are accessed by an S/R machine (also called an *extractor*) that delivers the trays one-by-one to a load/unload station at floor level. Vertical lift modules, some with heights of 10 m (30 ft) or more, are capable of holding large inventories while saving valuable floor space in the facility.

AS/RS Applications. Most applications of fixed-aisle automated storage/retrieval systems have been associated with warehousing and distribution operations, but they can also be used to store raw materials and work-in-process in manufacturing. Three application areas can be distinguished: (1) unit load storage and handling, (2) order picking, and (3) work-in-process storage. Unit load storage and retrieval applications are represented by the unit load AS/RS and deep-lane storage systems. These kinds of applications are commonly found in warehousing for finished goods in a distribution center, but rarely in manufacturing. Deep-lane systems are used in the food industry. Order picking involves retrieving materials in less than full unit load quantities. Miniload, man-on-board, and item retrieval systems are used for this application area.

Work-in-process (WIP) storage is a more recent application of automated storage technology. While it is desirable to minimize the amount of work-in-process, WIP is unavoidable and must be effectively managed. Automated storage systems, either fixed-aisle storage/retrieval systems or carousel systems, represent an efficient way to store materials between processing steps, particularly in batch and job shop production.

The merits of an automated WIP storage system for batch and job shop production can best be seen by comparing it with the traditional way of dealing with work-in-process. The typical factory contains multiple work cells, each performing its own processing operations on different parts. At each cell, orders consisting of one or more parts are waiting on the plant floor to be processed, while other completed orders are waiting to be moved to the next cell in the sequence. It is not unusual for a plant engaged in batch production to have hundreds of orders in progress simultaneously, all of which represent work-in-process. The disadvantages of keeping all of this inventory in the plant include (1) time spent searching for orders, (2) parts or even entire orders becoming temporarily or permanently lost, sometimes resulting in repeat orders to reproduce the lost parts, (3) orders not being processed according to their relative priorities at each cell, and (4) orders spending too much time in the factory, causing customer deliveries to be late. These problems indicate poor control of work-in-process.

Automated storage/retrieval systems are also used in high-production operations. In the automobile industry, some final assembly plants use large capacity AS/RSs to temporarily store car and small truck bodies between major assembly steps. The AS/RS can be used for staging and sequencing the work units according to the most efficient production schedule [1].

Automated storage systems help to regain control over WIP. Reasons that justify the installation of automated storage systems for work-in-process include:

- *Buffer storage in production.* A storage system can be used as a buffer storage zone between two processes whose production rates are significantly different. A simple example is a two-process sequence in which the first processing operation feeds a second process, which operates at a slower production rate. The first operation requires only one shift to meet production requirements, while the second step requires two shifts to produce the same number of units. An in-process buffer is needed between these operations to temporarily store the output of the first process.
- *Support of just-in-time delivery.* Just-in-time (JIT) is a manufacturing strategy in which parts required in production and/or assembly are received immediately before they are needed in the plant (Section 26.2). This results in a significant dependency of the factory on its suppliers to deliver the parts on time for use in production. To reduce the chance of stock-outs due to late supplier deliveries, some plants have installed automated storage systems as storage buffers for incoming materials. Although this approach subverts the objectives of JIT, it also reduces some of its risks.
- *Kitting of parts for assembly.* The storage system is used to store components for assembly of products or subassemblies. When an order is received, the required components are retrieved, collected into kits (tote pans), and delivered to the production floor for assembly.
- *Compatible with automatic identification systems.* Automated storage systems can be readily interfaced with automatic identification devices such as bar code readers. This allows loads to be stored and retrieved without needing human operators to identify the loads.
- *Computer control and tracking of materials.* Combined with automatic identification, an automated WIP storage system permits the location and status of work-in-process to be known.
- *Support of factory-wide automation.* Given the need for storage of work-in-process in batch production, an appropriately sized automated storage system can be an important subsystem in a fully automated factory.

Components and Operating Features of an AS/RS. Virtually all of the fixed-aisle automated storage/retrieval systems described earlier consist of the following components, shown in Figure 11.5: (1) storage structure, (2) S/R machine, (3) storage modules (e.g., pallets for unit loads), and (4) one or more pickup-and-deposit stations. In addition, a control system is required to operate the AS/RS.

The storage structure is the rack framework, made of fabricated steel, which supports the loads contained in the AS/RS. The individual storage compartments in the structure must be designed to hold the storage modules used to contain the stored materials. The rack structure may also be used to support the roof and siding of the building in which the AS/RS resides. Another function of the storage structure is to support the aisle hardware required to align the S/R machines with respect to the storage compartments of the AS/RS. This hardware includes guide rails at the top and bottom of the structure as well as end stops and other features required for safe operation.

The S/R machine is used to accomplish storage transactions, delivering loads from the input station into storage, and retrieving loads from storage and delivering them to the output station. To perform these transactions, the storage/retrieval machine must be

capable of horizontal and vertical travel to align its carriage (which carries the load) with the storage compartment in the rack structure. The S/R machine consists of a rigid mast on which is mounted an elevator system for vertical motion of the carriage. Wheels are attached at the base of the mast to permit horizontal travel along a rail system that runs the length of the aisle. A parallel rail at the top of the storage structure is used to maintain alignment of the mast and carriage with respect to the rack structure.

The carriage includes a shuttle mechanism to move loads into and from their storage compartments. The design of the shuttle must also permit loads to be transferred from the S/R machine to the P&D station or other material handling interface with the AS/RS. The carriage and shuttle are positioned and actuated automatically in the usual AS/RS. Man-on-board S/R machines are equipped for a human operator to ride on the carriage.

To accomplish the desired motions of the S/R machine, three drive systems are required: horizontal movement of the mast, vertical movement of the carriage, and shuttle transfer between the carriage and a storage compartment. Modern S/R machines are available with horizontal speeds up to 200 m/min (600 ft/min) along the aisle and vertical or lift speeds up to around 50 m/min (150 ft/min). These speeds determine the time required for the carriage to travel from the P&D station to a particular location in the storage aisle. Acceleration and deceleration have a more significant effect on travel time over short distances. The shuttle transfer is accomplished by any of several mechanisms, including forks (for pallet loads) and friction devices for flat-bottom tote pans.

The storage modules are the unit load containers of the stored material. These include pallets, steel wire baskets and containers, plastic tote pans, and special drawers (used in miniload systems). The storage modules are a standard size that is designed to fit in the storage compartments of the rack structure and can be handled automatically by the carriage shuttle of the S/R machine.

The pickup-and-deposit station is where loads are transferred into and out of the AS/RS. It is generally located at the end of the aisle for access by the external handling system that brings loads to the AS/RS and takes loads away. Pickup stations and deposit stations may be located at opposite ends of the storage aisle or combined at the same location. This depends on the origin of incoming loads and the destination of output loads. A P&D station must be compatible with both the S/R machine shuttle and the external handling system. Common methods to handle loads at the P&D station include manual load/unload, forklift truck, conveyor (e.g., roller), and AGVS.

The principal AS/RS controls problem is positioning the S/R machine within an acceptable tolerance at a storage compartment in the rack structure to deposit or retrieve a load. The locations of materials stored in the system must be determined to direct the S/R machine to a particular storage compartment. Within a given aisle in the AS/RS, each compartment is identified by its horizontal and vertical positions and whether it is on the right side or left side of the aisle. A scheme based on alphanumeric codes can be used for this purpose. Using this location identification scheme, each unit of material stored in the system can be referenced to a particular location in the aisle. The record of these locations is called the "item location file." Each time a storage transaction is completed, the transaction must be recorded in the item location file.

Computer controls and programmable logic controllers are used to determine the required location and guide the S/R machine to its destination. Computer control permits the physical operation of the AS/RS to be integrated with the supporting information and record-keeping system. It allows storage transactions to be entered in real time, inventory records to be accurately maintained, system performance to be monitored, and communications to be facilitated with other factory computer systems. These automatic controls

can be superseded or supplemented by manual controls when required under emergency conditions or for man-on-board operation of the machine.

11.3.2 Carousel Storage Systems

A carousel storage system consists of a series of bins or baskets attached to a chain-driven conveyor that revolves around an oval track loop to deliver the baskets to a load/unload station, as depicted in Figure 11.6. The purpose of the chain conveyor is to position bins at a load/unload station at the end of the oval. The operation is similar to the powered overhead rack system used by dry cleaners to deliver finished garments to the front of the store. Most carousels are operated by a human worker at the load/unload station. The worker activates the powered carousel to deliver a desired bin to the station. One or more parts are removed from or added to the bin, and then the cycle is repeated. Some carousels are automated by using transfer mechanisms at the load/unload station to move loads into and from the carousel.

Carousel Technology. Carousels can be classified as horizontal or vertical. The more common horizontal configuration shown in Figure 11.6 comes in a variety of sizes, ranging between 3 m (10 ft) and 30 m (100 ft) in length. Carousels at the upper end of the range have higher storage density, but the average access cycle time is greater. Accordingly, most carousels are 10–16 m (30–50 ft) long to achieve a proper balance between these competing factors.

A horizontal carousel storage system consists of welded steel framework that supports the oval rail system. The carousel can be either an overhead system (called a *top-driven* unit) or a floor-mounted system (called a *bottom-driven* unit). In the top-driven unit, a motorized pulley system is mounted at the top of the framework and drives an overhead trolley system. The bins are suspended from the trolleys. In the bottom-driven unit, the pulley drive system is mounted at the base of the frame, and the trolley system rides on a rail in the base. This provides more load-carrying capacity for the carousel storage system. It also eliminates the problem of dirt and oil dripping from the overhead trolley system onto the storage contents in top-driven systems.

The design of the individual bins and baskets of the carousel must be consistent with the loads to be stored. Bin widths range from about 50 to 75 cm (20 to 30 in), and depths are up to about 55 cm (22 in). Heights of horizontal carousels are typically 1.8–2.4 m (6–8 ft). Standard bins are made of steel wire to increase operator visibility.

Vertical carousels are constructed to operate around a vertical conveyor loop. They occupy much less floor space than the horizontal configuration, but require sufficient overhead space. The ceiling of the building limits the height of vertical carousels, and therefore their storage capacity is typically lower than for the average horizontal carousel.

Controls for carousel storage systems range from manual call controls to computer control. Manual controls include foot pedals, hand switches, and specialized keyboards. Foot pedal control allows the operator at the pick station to rotate the carousel in either direction to the desired bin position. Hand control involves use of a hand-operated switch that is mounted on an arm projecting from the carousel frame within easy reach of the operator. Again, bidirectional control is the usual mode of operation. Keyboard control permits a greater variety of control features than the previous control types. When the operator enters the desired bin position, the carousel is programmed to deliver the bin to the pick station by the shortest route (i.e., clockwise or counterclockwise motion of the carousel).

Computer control increases opportunities for automation of the mechanical carousel and for management of the inventory records. On the mechanical side, automatic loading and unloading is available on modern carousel storage systems. This allows the carousel to be interfaced with automated handling systems without the need for human participation in the load/unload operations. Data management features provided by computer control include the capability to maintain data on bin locations, items in each bin, and other inventory control records.

Carousel Applications. Carousel storage systems provide a relatively high throughput and are often an attractive alternative to a miniload AS/RS in manufacturing operations where their relatively low cost, versatility, and high reliability are recognized. Typical applications of carousel storage systems include (1) storage and retrieval operations, (2) transport and accumulation, (3) work-in-process, and (4) specialized uses.

Storage and retrieval operations can be efficiently accomplished using carousels when individual items must be selected from groups of items in storage. Sometimes called “pick and load” operations, these procedures are common in order-picking of tools in a toolroom, raw materials in a stockroom, service parts or other items in a wholesale firm, and work-in-process in a factory. In small electronics assembly, carousels are used for kitting of parts to be transported to assembly workstations.

In transport and accumulation applications, the carousel is used to transport and/or sort materials as they are stored. One example of this is in progressive assembly operations where the workstations are located around the periphery of a continuously moving carousel, and the workers have access to the individual storage bins of the carousel. They remove work from the bins to complete their own respective assembly tasks, then place their work into another bin for the next operation at some other workstation. Another example of transport and accumulation applications is sorting and consolidation of items. Each bin is defined for collecting the items of a particular type or customer. When the bin is full, the collected load is removed for shipment or other disposition.

Carousel storage systems often compete with automated storage and retrieval systems for applications where work-in-process is to be temporarily stored. Applications of carousel systems in the electronics industry are common.

One example of specialized use of carousel systems is electrical testing of products or components, where the carousel is used to store the item during testing for a specified period of time. The carousel is programmed to deliver the items to the load/unload station at the conclusion of the test period.

11.4 ANALYSIS OF STORAGE SYSTEMS

Several aspects of the design and operation of a storage system are susceptible to quantitative engineering analysis. This section examines capacity sizing and throughput performance for the two types of automated storage systems.

11.4.1 Fixed-Aisle Automated Storage/Retrieval Systems

While the methods developed here are specifically for fixed-aisle automated storage/retrieval systems, similar approaches can be used for analyzing traditional storage facilities, such as warehouses consisting of pallet racks and bulk storage.

Sizing the AS/RS Rack Structure. The total storage capacity of one storage aisle depends on how many storage compartments are arranged horizontally and vertically in the aisle, as indicated in Figure 11.7. This can be expressed as

$$\text{Capacity per aisle} = 2n_y n_z \quad (11.1)$$

where n_y = number of load compartments along the length of the aisle, and n_z = number of load compartments that make up the height of the aisle. The constant, 2, accounts for the fact that loads are contained on both sides of the aisle.

If the AS/RS is designed for a standard size unit load, then the compartment size must be standardized and its dimensions must be larger than the unit load dimensions. Let x and y = the depth and width dimensions of a unit load (e.g., a standard pallet size as given in Table 10.3), and z = the height of the unit load. The width, length, and height of the rack structure of the AS/RS aisle are related to the unit load dimensions and number of compartments as follows [6]:

$$W = 3(x + a) \quad (11.2a)$$

$$L = n_y(y + b) \quad (11.2b)$$

$$H = n_z(z + c) \quad (11.2c)$$

where W , L , and H are the width, length, and height of one aisle of the AS/RS rack structure, mm (in); x , y , and z are the dimensions of the unit load, mm (in); and a , b , and c are

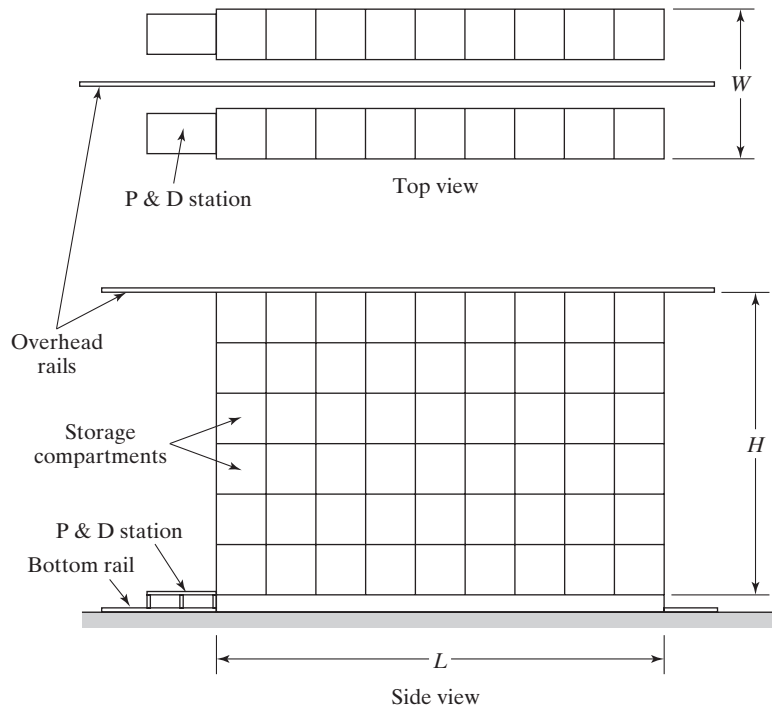


Figure 11.7 Top and side views of a unit load AS/RS, with nine storage compartments horizontally ($n_y = 9$) and six compartments vertically ($n_z = 6$).

allowances designed into each storage compartment to provide clearance for the unit load and to account for the size of the supporting beams in the rack structure, mm (in). For the case of unit loads contained on standard pallets, recommended values for the allowances [6] are: $a = 150$ mm (6 in), $b = 200$ mm (8 in), and $c = 250$ mm (10 in). For an AS/RS with multiple aisles, W is simply multiplied by the number of aisles to obtain the overall width of the storage system. The rack structure is built above floor level by 300–600 mm (12–24 in), and the length of the AS/RS extends beyond the rack structure to provide space for the P&D station.

EXAMPLE 11.2 Sizing an AS/RS System

Each aisle of a four-aisle AS/RS contains 60 storage compartments in the length direction and 12 compartments vertically. All storage compartments are the same size to accommodate standard-size pallets of dimensions: $x = 42$ in and $y = 48$ in. The height of a unit load $z = 36$ in. Using the allowances $a = 6$ in, $b = 8$ in, and $c = 10$ in, determine (a) how many unit loads can be stored in the AS/RS and (b) the width, length, and height of the AS/RS.

Solution: (a) The storage capacity is given by Equation (11.1): Capacity per aisle = $2(60)(12) = 1,440$ unit loads. With four aisles, the total capacity is

$$\text{AS/RS capacity} = 4(1440) = \mathbf{5,760 \text{ unit loads}}$$

(b) From Equations (11.2), the dimensions of the storage rack structure can be computed as:

$$W = 3(42 + 6) = 144 \text{ in} = 12 \text{ ft/aisle}$$

$$\text{Overall width of the AS/RS} = 4(12) = \mathbf{48 \text{ ft}}$$

$$L = 60(48 + 8) = 3,360 \text{ in} = \mathbf{280 \text{ ft}}$$

$$H = 12(36 + 10) = 552 \text{ in} = \mathbf{46 \text{ ft}}$$

AS/RS Throughput. System throughput is defined as the hourly rate of S/R transactions that the automated storage system can perform (Section 11.1.1). A transaction involves depositing a load into storage or retrieving a load from storage. Either of these transactions alone is accomplished in a single-command cycle. A dual-command cycle accomplishes both transaction types in one cycle; because this reduces travel time per transaction, throughput is increased by using dual-command cycles.

Several methods are available to compute AS/RS cycle times to estimate throughput performance. The method presented here is recommended by the Material Handling Institute (MHI) [2]. It assumes (1) randomized storage of loads in the AS/RS (i.e., any compartment in the storage aisle is equally likely to be selected for a transaction), (2) storage compartments of equal size, (3) the P&D station located at the base and end of the aisle, (4) constant horizontal and vertical speeds of the S/R machine, and (5) simultaneous horizontal and vertical travel. For a single-command cycle, the load to be

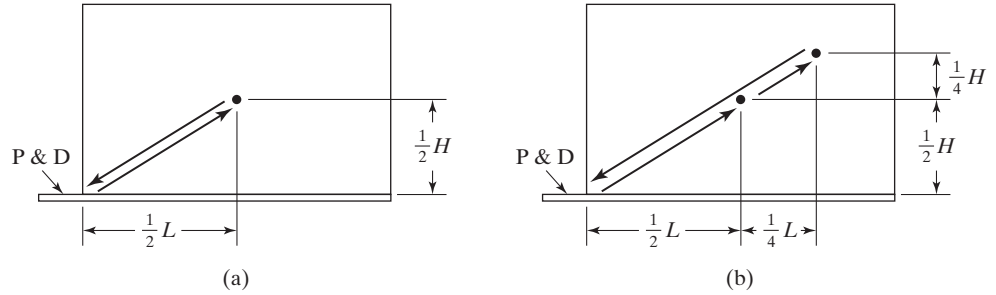


Figure 11.8 Assumed travel trajectory of the S/R machine for (a) single-command cycle and (b) dual-command cycle.

entered or retrieved is assumed to be located at the center of the rack structure, as in Figure 11.8(a). Thus, the S/R machine must travel half the length and half the height of the AS/RS, and it must return the same distance. The single-command cycle time can therefore be expressed by

$$T_{cs} = 2 \text{Max} \left\{ \frac{0.5L}{v_y}, \frac{0.5H}{v_z} \right\} + 2T_{pd} = \text{Max} \left\{ \frac{L}{v_y}, \frac{H}{v_z} \right\} + 2T_{pd} \quad (11.3a)$$

where T_{cs} = cycle time of a single-command cycle, min/cycle; L = length of the AS/RS rack structure, m (ft); v_y = velocity of the S/R machine along the length of the AS/RS, m/min (ft/min); H = height of the rack structure, m (ft); v_z = velocity of the S/R machine in the vertical direction of the AS/RS, m/min (ft/min); and T_{pd} = pickup-and-deposit time, min. Two P&D times are required per cycle, representing load transfers to and from the S/R machine.

For a dual-command cycle, the S/R machine is assumed to travel to the center of the rack structure to deposit a load, and then it travels to 3/4 the length and height of the AS/RS to retrieve a load, as in Figure 11.8(b). Thus, the total distance traveled by the S/R machine is 3/4 the length and 3/4 the height of the rack structure, and back. In this case, cycle time is given by

$$T_{cd} = 2 \text{Max} \left\{ \frac{0.75L}{v_y}, \frac{0.75H}{v_z} \right\} + 4T_{pd} = \text{Max} \left\{ \frac{1.5L}{v_y}, \frac{1.5H}{v_z} \right\} + 4T_{pd} \quad (11.3b)$$

where T_{cd} = cycle time for a dual-command cycle, min/cycle; and the other terms are defined earlier.

System throughput depends on the relative numbers of single- and dual-command cycles performed by the system. Let R_{cs} = number of single-command cycles performed per hour, and R_{cd} = number of dual-command cycles per hour at an assumed utilization level. An equation for the amounts of time spent in performing single-command and dual-command cycles each hour can be formulated as follows:

$$R_{cs}T_{cs} + R_{cd}T_{cd} = 60U \quad (11.4)$$

where U = system utilization during the hour. The right-hand side of the equation gives the total number of minutes of operation per hour. To solve Equation (11.4), the relative

proportions of R_{cs} and R_{cd} must be determined, or assumptions about these proportions must be made. When solved, the total hourly cycle rate is given by

$$R_c = R_{cs} + R_{cd} \quad (11.5)$$

where R_c = total S/R cycle rate, cycles/hr. Note that the total number of storage and retrieval transactions per hour will be greater than this value unless $R_{cd} = 0$, since there are two transactions accomplished in each dual-command cycle. Let R_t = the total number of transactions performed per hour; then

$$R_t = R_{cs} + 2R_{cd} \quad (11.6)$$

EXAMPLE 11.3 AS/RS Throughput Analysis

Consider the AS/RS from Example 11.2, in which an S/R machine is used for each aisle. The length of the storage aisle = 280 ft and its height = 46 ft. Suppose horizontal and vertical speeds of the S/R machine are 200 ft/min and 75 ft/min, respectively. The S/R machine requires 20 sec to accomplish a P&D operation. Determine (a) the single-command and dual-command cycle times per aisle and (b) throughput per aisle under the assumptions that storage system utilization = 90% and the number of single-command and dual-command cycles are equal.

Solution: (a) The single- and dual-command cycle times are calculated by Equations (11.3):

$$T_{cs} = \text{Max}\{280/200, 46/75\} + 2(20/60) = \mathbf{2.066 \text{ min/cycle}}$$

$$T_{cd} = \text{Max}\{1.5 \times 280/200, 1.5 \times 46/75\} + 4(20/60) = \mathbf{3.432 \text{ min/cycle}}$$

(b) From Equation (11.4), the single-command and dual-command activity levels each hour can be established as follows:

$$2.066R_{cs} + 3.432R_{cd} = 60(0.90) = 54.0 \text{ min}$$

According to the problem statement, the number of single-command cycles is equal to the number of dual-command cycles. Thus, $R_{cs} = R_{cd}$. Substituting this relation into the above equation,

$$2.066R_{cs} + 3.432R_{cs} = 54$$

$$5.498R_{cs} = 54$$

$$R_{cs} = 9.822 \text{ single command cycles/hr}$$

$$R_{cd} = R_{cs} = 9.822 \text{ dual command cycles/hr}$$

System throughput is equal to the total number of S/R transactions per hour from Equation (11.6):

$$R_t = R_{cs} + 2R_{cd} = 29.46 \text{ transactions/hr}$$

With four aisle, R_t for the AS/RS = $4(29.46) = \mathbf{117.84 \text{ transactions/hr}}$

11.4.2 Carousel Storage Systems

In this section, the corresponding capacity and throughput relationships for a carousel storage system are developed. Because of their construction, carousel systems do not possess nearly the volumetric capacity of an AS/RS. However, according to sample calculations, a typical carousel system is likely to have a higher throughput rate than an AS/RS.

Storage Capacity. The size and capacity of a carousel can be determined with reference to Figure 11.9. Individual bins or baskets are suspended from carriers that revolve around an oval rail with circumference given by

$$C = 2(L - W) + \pi W \quad (11.7)$$

where C = circumference of the oval conveyor track, m (ft); and L and W are the length and width of the track oval, m (ft).

The capacity of the carousel system depends on the number and size of the bins (or baskets) in the system. Assuming standard-size bins are used, each of a certain volumetric capacity, the number of bins can be used as the measure of capacity. As illustrated in Figure 11.9, the number of bins hanging vertically from each carrier is n_b and n_c = the number of carriers around the periphery of the rail. Thus,

$$\text{Total number of bins} = n_c n_b \quad (11.8)$$

The carriers are separated by a certain distance so that they do not interfere with each other while traveling around the ends of the carousel. Let s_c = the center-to-center spacing of carriers along the oval track. Then the following relationship must be satisfied by the values of s_c and n_c :

$$s_c n_c = C \quad (11.9)$$

where C = circumference, m(ft); s_c = carrier spacing, m/carrier (ft/carrier); and n_c = number of carriers, which must be an integer value.

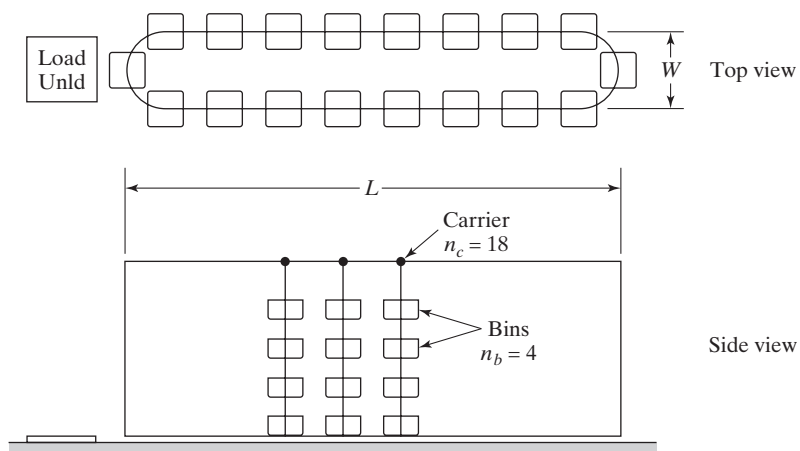


Figure 11.9 Top and side views of horizontal storage carousel with 18 carriers ($n_c = 18$) and four bins/carrier ($n_b = 4$). Key: Unld = unload.

Throughput Analysis. The storage/retrieval cycle time can be derived based on the following assumptions. First, only single-command cycles are performed; a bin is accessed in the carousel either to put items into storage or to retrieve one or more items from storage. Second, the carousel operates with a constant speed v_c ; acceleration and deceleration effects are ignored. Third, random storage is assumed; that is, any location around the carousel is equally likely to be selected for an S/R transaction. And fourth, the carousel can move in either direction. Under this last assumption of bidirectional travel, it can be shown that the mean travel distance between the load/unload station and a bin randomly located in the carousel is $C/4$. Thus, the S/R cycle time is given by

$$T_c = \frac{C}{4v_c} + T_{pd} \quad (11.10)$$

where T_c = S/R cycle time, min; C = carousel circumference as given by Equation (11.7), m (ft); v_c = carousel velocity, m/min (ft/min); and T_{pd} = the average time required to pick or deposit items each cycle by the operator at the load/unload station, min. The number of transactions accomplished per hour is the same as the number of cycles and is given by the following:

$$R_t = R_c = \frac{60}{T_c} \quad (11.11)$$

EXAMPLE 11.4 Carousel Operation

The oval rail of a carousel storage system has length = 12 m and width = 1 m. There are 75 carriers equally spaced around the oval. Suspended from each carrier are six bins. Each bin has volumetric capacity = 0.026 m³. Carousel speed = 20 m/min. Average P&D time for a retrieval = 20 sec. Determine (a) volumetric capacity of the storage system and (b) hourly retrieval rate of the storage system.

Solution: (a) Total number of bins in the carousel is

$$n_c n_b = 75 \times 6 = 450 \text{ bins}$$

$$\text{Total volumetric capacity} = 450(0.026) = \mathbf{11.7 \text{ m}^3}$$

(b) The circumference of the carousel rail is determined by Equation (11.7):

$$C = 2(12 - 1) + 1\pi = 25.14 \text{ m}$$

Cycle time per retrieval is given by Equation (11.10):

$$T_c = \frac{25.14}{4(20)} + 20/60 = 0.647 \text{ min}$$

Expressing throughput as an hourly rate, $R_t = 60/0.647 = \mathbf{92.7 \text{ retrieval transactions/hr}}$

REFERENCES

- [1] FEARE, T., “GM Runs in Top Gear with AS/RS Sequencing,” *Modern Materials Handling*, August 1998, pp. 50–52.
- [2] KULWIEC, R. A., Editor, *Materials Handling Handbook*, 2nd ed., John Wiley & Sons, Inc., NY, 1985.
- [3] Material Handling Institute, *AS/RS in the Automated Factory*, Pittsburgh, PA, 1983.
- [4] Material Handling Institute, *Consideration for Planning and Installing an Automated Storage/Retrieval System*, Pittsburgh, PA, 1977.
- [5] MULCAHY, D. E., *Materials Handling Handbook*, McGraw-Hill, New York, 1999.
- [6] TOMPKINS, J. A., J. A. WHITE, Y. A. BOZER, E. H. FRAZELLE, J. M. TANCHOCO, and J. TREVINO, *Facilities Planning*, 4th ed., John Wiley & Sons, Inc., New York, 2010.
- [7] TRUNK, C., “The Sky’s the Limit for Vertical Lifts,” *Material Handling Engineering*, August 1998, pp. 36–40.
- [8] TRUNK, C., “Pick-To-Light: Choices, Choices, Choices,” *Material Handling Engineering*, September 1998, pp. 44–48.
- [9] TRUNK, C., “ProMat Report: New Ideas for Carousels,” *Material Handling Engineering*, April 1999, pp. 69–74.
- [10] “Vertical Lift Storage Modules: Advances Drive Growth,” *Modern Materials Handling*, October 1998, pp. 42–43.
- [11] WEISS, D. J., “Carousel Systems Capabilities and Design Considerations,” *Automated Material Handling and Storage* (J. A. Tompkins and J. D. Smith, Editors), Auerbach Publishers, Inc., Pennsauken, NJ, 1983.
- [12] www.mhi.org/glossary
- [13] www.wikipedia.org/wiki/Automated_storage_and_retrieval_system

REVIEW QUESTIONS

- 11.1** Materials stored in manufacturing include a variety of types. Name six of the categories listed in Table 11.1.
- 11.2** Name and briefly describe the six measures used to assess the performance of a storage system.
- 11.3** Briefly describe the two basic storage location strategies.
- 11.4** What is a class-based dedicated storage strategy?
- 11.5** Name the four traditional (non-automated) methods for storing materials.
- 11.6** Which of the four traditional storage methods is capable of the highest storage density?
- 11.7** What are some of the objectives and reasons behind company decisions to automate their storage operations? Name six of the ten objectives and reasons listed in Table 11.3.
- 11.8** What are the two basic categories of automated storage systems?
- 11.9** What are the differences between the two basic types of automated storage systems?
- 11.10** What is a vertical lift module?
- 11.11** Identify the three application areas of fixed-aisle automated storage/retrieval systems.
- 11.12** What are the four basic components of nearly all automated storage/retrieval systems?
- 11.13** What is the advantage of a vertical storage carousel over a horizontal storage carousel?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Sizing the AS/RS Rack Structure

- 11.1 (A)** Each aisle of a six-aisle automated storage/retrieval system is to contain 50 storage compartments in the length direction and 8 compartments in the vertical direction. All storage compartments will be the same size to accommodate standard-size pallets of dimensions: $x = 36$ in and $y = 48$ in. The height of a unit load $z = 30$ in. Using the allowances $a = 6$ in, $b = 8$ in, and $c = 10$ in, determine (a) how many unit loads can be stored in the AS/RS, and (b) the width, length, and height of the AS/RS. The rack structure will be built 18 in above floor level.
- 11.2** A unit load AS/RS is being designed to store 1,000 pallet loads in a distribution center located next to the factory. Pallet dimensions are: $x = 1,000$ mm, $y = 1,200$ mm; and the maximum height of a unit load = 1,300 mm. The following is specified: (1) the AS/RS will consist of two aisles with one S/R machine per aisle, (2) length of the structure should be approximately five times its height, and (3) the rack structure will be built 500 mm above floor level. Using the allowances $a = 150$ mm, $b = 200$ mm, and $c = 250$ mm, determine the width, length, and height of the AS/RS rack structure.
- 11.3** Given the rack structure dimensions computed in Problem 11.2, and assuming that 85% of the storage compartments are occupied on average, and that the average volume of a unit load per pallet in storage = 1.0 m^3 , compute the ratio of the total volume of unit loads in storage relative to the total volume occupied by the storage rack structure.
- 11.4** A unit load AS/RS for work-in-process storage in a factory must be designed to store 2,000 pallet loads, with an allowance of no less than 20% additional storage compartments for peak periods and flexibility. The unit load pallet dimensions are: depth (x) = 36 in and width (y) = 48 in. Maximum height of a unit load = 42 in. It has been determined that the AS/RS will consist of four aisles with one S/R machine per aisle. The maximum ceiling height (interior) of the building permitted by local ordinance is 60 ft, so the AS/RS must fit within this height limitation. The rack structure will be built 2 ft above floor level, and the clearance between the rack structure and the ceiling of the building must be at least 18 in. Determine the dimensions (height, length, and width) of the rack structure.

AS/RS Throughput Analysis

- 11.5 (A)** The length of the storage aisle in an AS/RS = 240 ft and its height = 60 ft. Horizontal and vertical speeds of the S/R machine are 400 ft/min and 60 ft/min, respectively. The S/R machine requires 18 sec to accomplish a pick-and-deposit operation. Find (a) the single-command and dual-command cycle times per aisle, and (b) throughput for the aisle under the assumptions that storage system utilization = 85% and the number of single-command and dual-command cycles are equal.
- 11.6** Solve Problem 11.5 except that the ratio of single-command to dual-command cycles is 3:1 instead of 1:1.
- 11.7** An AS/RS is used for work-in-process storage in a manufacturing facility. The AS/RS has five aisles, each aisle being 120 ft long and 40 ft high. The horizontal and vertical speeds of the S/R machine are 400 ft/min and 50 ft/min, respectively. The S/R machine requires 12 sec to accomplish a pick-and-deposit operation. The number of single-command cycles equals the number of dual-command cycles. If the requirement is that the AS/RS must have a

throughput rate of 200 S/R transactions/hr during periods of peak activity, will the AS/RS satisfy this requirement? If so, what is the utilization of the AS/RS during peak hours?

- 11.8** An automated storage/retrieval system installed in a warehouse has five aisles. The storage racks in each aisle are 30 ft high and 150 ft long. The S/R machine for each aisle travels at a horizontal speed of 350 ft/min and a vertical speed of 60 ft/min. The pick-and-deposit time = 0.25 min. Assume that the number of single-command cycles/hr is equal to the number of dual-command cycles/hr and that the system operates at 75% utilization. Determine the throughput rate (loads moved/hr) of the AS/RS.
- 11.9** A 10-aisle automated storage/retrieval system is located in an integrated factory-warehouse facility. The storage racks in each aisle are 18 m high and 95 m long. The S/R machine for each aisle travels at a horizontal speed of 2.5 m/sec and a vertical speed of 0.5 m/sec. Pick-and-deposit time = 20 sec. Assume that the number of single-command cycles/hr is one-half the number of dual-command cycles/hr and that the system operates at 80% utilization. Determine the throughput rate (loads moved/hr) of the AS/RS.
- 11.10** An automated storage/retrieval system for work-in-process has five aisles. The storage racks in each aisle are 10 m high and 50 m long. The S/R machine for each aisle travels at a horizontal speed of 2.0 m/sec and a vertical speed of 0.4 m/sec. Pick-and-deposit time = 15 sec. Assume that the number of single-command cycles/hr is equal to three times the number of dual-command cycles/hr and that the system operates at 90% utilization. Determine the throughput rate (loads moved/hr) of the AS/RS.
- 11.11 (A)** The length of one aisle in an AS/RS is 100 m and its height is 20 m. Horizontal travel speed is 4.0 m/sec. The vertical speed is specified so that the storage system is “square in time,” which means that $L/v_y = H/v_z$. The pick-and-deposit time is 12 sec. Determine the expected throughput rate (transactions/hr) for the aisle if the expected ratio of the number of transactions performed under single-command cycles to the number of transactions performed under dual-command cycles is 2:1. The system operates continuously during the hour.
- 11.12** An automated storage/retrieval system has four aisles. The storage racks in each aisle are 40 ft high and 200 ft long. The S/R machine for each aisle travels at a horizontal speed of 400 ft/min and a vertical speed of 60 ft/min. If the pick-and-deposit time = 0.3 min, determine the throughput rate (loads moved/hr) of the AS/RS, under the assumption that time spent each hour performing single-command cycles is twice the time spent performing dual-command cycles, and that the AS/RS operates at 90% utilization.
- 11.13** An AS/RS with one aisle is 300 ft long and 60 ft high. The S/R machine has a maximum speed of 300 ft/min in the horizontal direction. It accelerates from zero to 300 ft/min in a distance of 15 ft. On approaching its target position (where the S/R machine will transfer a load onto or off of its platform), it decelerates from 300 ft/min to a full stop in 15 ft. The maximum vertical speed is 60 ft/min, and the vertical acceleration and deceleration distances are each 3 ft. Assume simultaneous horizontal and vertical movement, and that the rates of acceleration and deceleration are constant in both directions. The pick-and-deposit time = 0.3 min. Using the general approach of the Material Handling Institute method for computing cycle time but adding considerations for acceleration and deceleration, determine the single-command and dual-command cycle times.
- 11.14** An AS/RS with four aisles is 80 m long and 18 m high. The S/R machine has a maximum speed of 1.6 m/sec in the horizontal direction. It accelerates from zero to 1.6 m/sec in a distance of 2.0 m. On approaching its target position (where the S/R machine will transfer a load onto or off of its platform), it decelerates from 1.6 m/sec to a full stop in 2.0 m. The maximum vertical speed is 0.5 m/sec, and the vertical acceleration and deceleration distances are each 0.3 m. Rates of acceleration and deceleration are constant in both directions. Pick-and-deposit time = 12 sec. Utilization of the AS/RS is assumed to be 90%, and the number of dual-command cycles = the number of single-command cycles.

- (a) Calculate the single-command and dual-command cycle times, including considerations for acceleration and deceleration. (b) Determine the throughput rate for the system.
- 11.15** Your company is seeking proposals for an automated storage/retrieval system that will have a throughput rate of 300 storage/retrieval transactions/hr during the one 8-hr shift per day. The request for proposal indicates that the number of single-command cycles is expected to be four times the number of dual-command cycles. The first proposal received is from a vendor who specifies the following: 10 aisles, each aisle 150 ft long and 50 ft high; horizontal and vertical speeds of the S/R machine = 200 ft/min and 66.67 ft/min, respectively; and pick-and-deposit time = 0.3 min. As the responsible engineer for the project, you must analyze the proposal and make recommendations accordingly. One of the difficulties you see in the proposed AS/RS is the large number of S/R machines that would be required—one for each of the 10 aisles. This makes the proposed system very expensive. Your recommendation is to reduce the number of aisles from 10 to 6 and to select an S/R machine with horizontal and vertical speeds of 300 ft/min and 100 ft/min, respectively. Although each high-speed S/R machine is slightly more expensive than the slower model, reducing the number of machines from 10 to 6 will significantly reduce total cost. Also, fewer aisles will reduce the cost of the rack structure even though each aisle will be somewhat larger since total storage capacity must remain the same. The problem is that throughput rate will be adversely affected by the larger rack system. (a) Determine the throughput rate of the proposed 10-aisle AS/RS and calculate its utilization relative to the specified 300 transactions/hr. (b) Determine the length and height of a 6 aisle AS/RS whose storage capacity would be the same as the proposed 10-aisle system. (c) Determine the throughput rate of the 6-aisle AS/RS and calculate its utilization relative to the specified 300 transactions/hr. (d) Given the dilemma now confronting you, what other alternatives would you analyze and recommendations would you make to improve the design of the system?

AS/RS Throughput for Class-Based Dedicated Storage Strategy

- 11.16 (A)** The aisles in the AS/RS of Example 11.3 will be organized to follow a class-based dedicated storage strategy. There will be two classes, according to activity level. The more active stock is stored in the half of the rack system that is located closest to the input/output station, and the less active stock is stored in the other half of the rack system farther away from the input/output station. Within each half of the rack system, random storage is used. The more active stock accounts for 80% of the transactions, and the less active stock accounts for the remaining 20%. As in Example 11.3, assume that system utilization = 90%, and the number of single-command cycles = the number of dual-command cycles. Determine the throughput of the AS/RS, basing the computation of cycle times on the same kinds of assumptions used in the MHI method.
- 11.17** A unit load automated storage/retrieval system has five aisles. The storage racks are 60 ft high and 280 ft long. The S/R machine travels at a horizontal speed of 200 ft/min and a vertical speed of 80 ft/min. The pick-and-deposit time = 0.3 min. Assume that the number of single-command cycles/hr is four times the number of dual-command cycles/hr and that the system operates at 80% utilization. A class-based dedicated storage strategy is used for organizing the stock, in which unit loads are separated into two classes, according to activity level. The more active stock is stored in the half of the rack system located closest to the input/output station, and the less active stock is stored in the other half of the rack system (farther away from the input/output station). Within each half of the rack system, random storage is used. The more active stock accounts for 75% of the transactions, and the less active stock accounts for the remaining 25% of the transactions. Determine the throughput rate (loads moved/hr into and out of storage) of the AS/RS, basing the computation of cycle times on the same types of assumptions used in the MHI method.

Assume that when dual-command cycles are performed the two transactions per cycle are both in the same class.

- 11.18** The AS/RS aisle of Problem 11.5 will be organized following a class-based dedicated storage strategy. There will be two classes, according to activity level. The more active stock is stored in the half of the rack system that is located closest to the input/output station, and the less active stock is stored in the other half of the rack system farther away from the input/output station. Within each half of the rack system, random storage is used. The more active stock accounts for 80% of the transactions, and the less active stock accounts for the remaining 20%. Assume that system utilization = 85% and the number of single-command cycles = the number of dual-command cycles in each half of the AS/RS. (a) Determine the throughput of the AS/RS, basing the computation of cycle times on the same kinds of assumptions used in the MHI method. (b) A class-based dedicated storage strategy is supposed to increase throughput. Why is throughput less here than in Problem 11.5?

Carousel Storage Systems

- 11.19 (A)** A single carousel storage system is located in a factory making small assemblies. It is 18 m long and 1.0 m wide. The pick-and-deposit time is 0.20 min. The speed at which the carousel operates is 0.6 m/sec. The storage system has a 90% utilization. Determine the hourly throughput rate.
- 11.20** A storage system serving an electronics assembly plant has four storage carousels, each with its own manually operated pick-and-deposit station. The pick-and-deposit time is 0.25 min. Each carousel is 50 ft long and 2.5 ft wide. The speed at which the system revolves is 100 ft/min. Determine the throughput rate of the storage system.
- 11.21** A single carousel storage system has an oval rail loop that is = 40 ft long and 3 ft wide. Fifty carriers are equally spaced around the oval. Suspended from each carrier are five bins. Each bin has a volumetric capacity = 0.95 ft³. Carousel speed = 100 ft/min. Average pick-and-deposit time for a retrieval = 20 sec. Determine (a) volumetric capacity of the storage system and (b) hourly retrieval rate of the storage system.
- 11.22** A carousel storage system is to be designed to serve a mechanical assembly plant. The specifications on the system are that it must have a total of 400 storage bins and a throughput of at least 125 storage and retrieval transactions/hr. Two alternative configurations are being considered: (1) a one-carousel system and (2) a two-carousel system. In either case, the width of the carousel is to be 4.0 ft and the spacing between carriers = 2.5 ft. One picker-operator will be required for the one-carousel system and two picker-operators will be required for the two-carousel system. In either system, $v_c = 75$ ft/min. For the convenience of the picker-operator, the height of the carousel will be limited to five bins. The standard time for a pick-and-deposit operation at the load/unload station = 0.4 min if one part is picked or stored per bin and 0.6 min if more than one part is picked or stored. Assume that 50% of the transactions will involve more than one part. Determine (a) the required length of the one-carousel system and (b) the corresponding throughput rate; (c) the required length of the two-carousel system and (d) the corresponding throughput rate. (e) Which system better satisfies the design specifications?
- 11.23** Given your answers to Problem 11.22, the costs of the two-carousel systems are to be compared. The one-carousel system has an installed cost of \$50,000, and the comparable cost of the two-carousel system is \$75,000. Labor cost for a picker-operator is \$20/hr, including fringe benefits and applicable overhead. The storage systems will be operated 250 days/yr for 7 hr/day, although the operators will be paid for 8 hr. Using a 3-year period in your analysis, and a 25% rate of return, determine (a) the equivalent annual cost for the two design alternatives, assuming no salvage value at the end of three years; and (b) the average cost per storage/retrieval transaction.

Automatic Identification and Data Capture

CHAPTER CONTENTS

- 12.1 Overview of Automatic Identification Methods
- 12.2 Bar Code Technology
 - 12.2.1 Linear (One-Dimensional) Bar Codes
 - 12.2.2 Two-Dimensional Bar Codes
- 12.3 Radio Frequency Identification
- 12.4 Other AIDC Technologies
 - 12.4.1 Magnetic Stripes
 - 12.4.2 Optical Character Recognition
 - 12.4.3 Machine Vision

Automatic identification and data capture (AIDC) refers to technologies that provide direct entry of data into a computer or other microprocessor-controlled system without using a keyboard. Many of these technologies require no human involvement in the data capture and entry process. Automatic identification systems are being used increasingly to collect data in material handling and manufacturing applications. In material handling, the applications include shipping and receiving, storage, sortation, order picking, and kitting of parts for assembly. In manufacturing, the applications include monitoring the status of order processing, work-in-process, machine utilization, worker attendance, and other measures of factory operations and performance. Of course, AIDC has many important applications outside the factory, including retail sales and inventory control, warehousing and distribution center operations, mail

and parcel handling, patient identification in hospitals, check processing in banks, and security systems. This chapter emphasizes material handling and manufacturing applications.

The alternative to automatic data capture is manual collection and entry of data. This typically involves a worker recording the data on paper and later entering them into the computer by means of a keyboard. There are several drawbacks to this method:

1. *Errors* occur in both data collection and keyboard entry of the data when it is accomplished manually. The average error rate of manual keyboard entry is one error per 300 characters.
2. *Time factor*. Manual methods are inherently more time consuming than automated methods. Also, when manual methods are used, there is a time delay between when the activities and events occur and when the data on status are entered into the computer.
3. *Labor cost*. The full attention of human workers is required in manual data collection and entry, with the associated labor cost.

These drawbacks are virtually eliminated when automatic identification and data capture are used. With AIDC, the data on activities, events, and conditions are acquired at the location and time of their occurrence and entered into the computer immediately or shortly thereafter.

Automatic data capture is often associated with the material handling industry. The AIDC industry trade association, the Automatic Identification Manufacturers Association (AIM), started as an affiliate of the Material Handling Institute, Inc. Many of the applications of this technology relate to material handling. But automatic identification and data capture has also become important in shop floor control in manufacturing plants (Section 25.4).

12.1 OVERVIEW OF AUTOMATIC IDENTIFICATION METHODS

Nearly all of the automatic identification technologies consist of three principal components, which also comprise the sequential steps in AIDC [8]:

1. *Data encoder*. A **code** is a set of symbols or signals that usually represent alphanumeric characters. When data are encoded, the characters are translated into a machine-readable code. (For most AIDC techniques, the encoded data are not readable by humans.) A label or tag containing the encoded data is attached to the item that is to be identified.
2. *Machine reader* or *scanner*. This device reads the encoded data, converting them to alternative form, usually an electrical analog signal.
3. *Data decoder*. This component transforms the electrical signal into digital data and finally back into the original alphanumeric characters.

Many different technologies are used to implement automated identification and data collection. Within the category of bar codes alone (currently the leading AIDC

technology), more than 250 different bar code schemes have been devised. AIDC technologies can be divided into the following six categories [18]:

1. *Optical*. Most of these technologies use high-contrast graphical symbols that can be interpreted by an optical scanner. They include linear (one-dimensional) and two-dimensional bar codes, optical character recognition, and machine vision.
2. *Electromagnetic*. The important AIDC technology in this group is radio frequency identification (RFID), which uses a small electronic tag capable of holding more data than a bar code. Its applications are gaining on bar codes due to several mandates from companies like Walmart and from the U.S. Department of Defense.
3. *Magnetic*. These technologies encode data magnetically, similar to recording tape. The two important techniques in this category are (a) magnetic stripe, widely used in plastic credit cards and bank access cards, and (b) magnetic ink character recognition, widely used in the banking industry for check processing.
4. *Smart card*. This term refers to small plastic cards (the size of a credit card) imbedded with microchips capable of containing large amounts of information. Other terms used for this technology include *chip card* and *integrated circuit card*.
5. *Touch techniques*. These include touch screens and button memory.
6. *Biometric*. These technologies are utilized to identify humans or to interpret vocal commands of humans. They include voice recognition, fingerprint analysis, and retinal eye scans.

The most widely used AIDC technologies in production and distribution are bar codes and radio frequency methods. The common applications of AIDC technologies are (1) receiving, (2) shipping, (3) order picking, (4) finished goods storage, (5) manufacturing processing, (6) work-in-process storage, (7) assembly, and (8) sortation. Some of the identification applications require workers to be involved in the data collection procedure, usually to operate the identification equipment in the application. These techniques are therefore semiautomated rather than automated methods. Other applications accomplish the identification with no human participation. The same basic sensor technologies may be used in both cases. For example, certain types of bar code readers are operated by humans, whereas other types operate automatically.

As indicated in the chapter introduction, there are good reasons for using automatic identification and data capture techniques: (1) data accuracy, (2) timeliness, and (3) labor reduction. First and foremost, the accuracy of the data collected is improved with AIDC, in many cases by a significant margin. The error rate in bar code technology is approximately 10,000 times lower than in manual keyboard data entry. The error rates of most of the other technologies are not as low as for bar codes but are still better than manual methods. The second reason for using automatic identification techniques is to reduce the time required by human workers to make the data entry. The speed of data entry for handwritten documents is approximately 5–7 characters/sec and it is 10–15 characters/sec (at best) for keyboard entry [16]. Automatic identification methods are capable of reading hundreds of characters per second. The time savings from using automatic identification techniques can mean substantial labor cost benefits for large plants with many workers.

TABLE 12.1 Comparison of AIDC Techniques and Manual Keyboard Data Entry

Technique	Time to Enter*	Error Rate**	Equipment Cost	Advantages/(Disadvantages)
Manual entry	Slow	High	Low	Low initial cost (Requires human operator)
Bar codes: 1-D	Medium	Low	Low	High speed Good flexibility (Low data density)
Bar codes: 2-D	Medium	Low	High	High speed High data density
Radio frequency	Fast	Low	High	Label need not be visible to reader Read-write capability available High data density (Expensive labeling)
Magnetic stripe	Medium	Low	Medium	Much data can be encoded Data can be changed (Vulnerable to magnetic fields) (Contact required for reading)
OCR (optical character recognition)	Medium	Medium	Medium	Can be read by humans (Low data density) (High error rate)
Machine vision	Fast	***	Very high	High speed

Source: Based on data from Palmer [14].

*Time to enter data is based on a 20-character field. All techniques except machine vision use a human worker either to enter the data (manual entry) or to operate the AIDC equipment (bar codes, RFID, magnetic stripe, OCR). Key: Slow = 5–10 sec, Medium = 2–5 sec, Fast = <2 sec

**Substitution error rate (SER).

***Application dependent.

Although the error rate in automatic identification and data collection technologies is much lower than for manual data collection and entry, errors do occur in AIDC. The industry has adopted two parameters to measure the errors:

1. *First read rate (FRR)*. This is the probability of a successful (correct) reading by the scanner in its initial attempt.
2. *Substitution error rate (SER)*. This is the probability or frequency with which the scanner incorrectly reads the encoded character as some other character. In a given set of encoded data containing n characters, the expected number of errors = SER multiplied by n .

Obviously, it is desirable for the AIDC system to possess a high first read rate and a low substitution error rate. A subjective comparison of substitution error rates for several AIDC technologies is presented in Table 12.1.

12.2 BAR CODE TECHNOLOGY

As mentioned previously, bar codes divide into two basic types: (1) linear, in which the encoded data are read using a linear sweep of the scanner, and (2) two-dimensional, in which the encoded data must be read in both directions.



Figure 12.1 Two forms of linear bar codes are (a) width-modulated, exemplified here by the Universal Product Code, and (b) height-modulated, exemplified here by Postnet, used by the U.S. Postal Service.

12.2.1 Linear (One-Dimensional) Bar Codes

Linear bar codes are the most widely used automatic identification and data capture technique. There are actually two forms of linear bar code symbologies, illustrated in Figure 12.1: (a) width-modulated, in which the symbol consists of bars and spaces of varying width; and (b) height-modulated, in which the symbol consists of evenly spaced bars of varying height. The only significant application of the height-modulated bar code symbologies is in the U.S. Postal Service for ZIP code identification, so the discussion here focuses on the width-modulated bar codes, which are used widely in retailing and manufacturing.

In linear width-modulated bar code technology, the symbol consists of a sequence of wide and narrow colored bars separated by wide and narrow spaces (the colored bars are usually black and the spaces are white for high contrast). The pattern of bars and spaces is coded to represent numeric or alphanumeric characters. Palmer [14] uses the interesting analogy that bar codes might be thought of as a printed version of the Morse code, where narrow bands represent dots and wide bands represent dashes. Using this scheme, the bar code for the familiar SOS distress signal would be as shown in Figure 12.2. Bar codes do not follow Morse code, however; the difficulties with a “Morse” bar code symbology are (1) only the dark bars are used, thus increasing the length of the coded symbol, and (2) the number of bars making up the alphanumeric characters differs, making decoding more difficult [14].

Bar code readers interpret the code by scanning and decoding the sequence of bars. The reader consists of the scanner and decoder. The scanner emits a beam of light that is swept past the bar code (either manually or automatically) and senses light reflections to distinguish between the bars and spaces. The light reflections are sensed by a photodetector, which converts the spaces into an electrical signal and the bars into absence of an electrical signal. The width of the bars and spaces is indicated by the duration of the



Figure 12.2 The SOS distress signal in “Morse” bar codes.

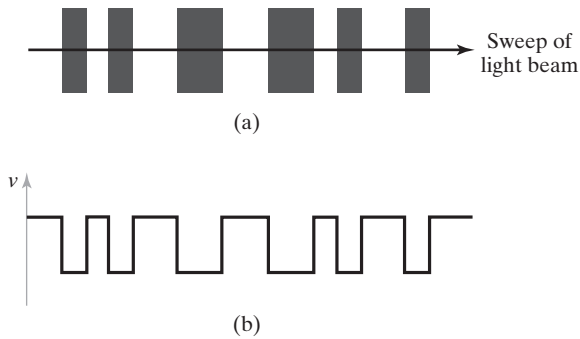


Figure 12.3 Conversion of bar code into a pulse train of electrical signals, (a) bar code and (b) corresponding electrical signal.

corresponding signals. The procedure is depicted in Figure 12.3. The decoder analyzes the pulse train to validate and interpret the corresponding data.

Certainly a major reason for the acceptance of bar codes is their widespread use in grocery markets and other retail stores. In 1973, the grocery industry adopted the Universal Product Code (UPC) as its standard for item identification. This is a 12-digit bar code that uses six digits to identify the manufacturer and five digits to identify the product. The final digit is a check character. The U.S. Department of Defense provided another major endorsement in 1982 by adopting a bar code standard (Code 39) that must be applied by vendors on product cartons supplied to the various agencies of DOD. The UPC is a numerical code (0–9), while Code 39 provides the full set of alphanumeric characters plus other symbols (44 characters in all). These two linear bar codes and several others are compared in Table 12.2.

TABLE 12.2 Some Widely Used Linear Bar Codes

Bar Code	Description	Applications
Codabar	Only 16 characters: 0–9, \$, :, /, ., +, –	Used in libraries, blood banks, and some parcel freight applications
UPC*	Numeric only, length = 12 digits	Widely used in the United States and Canada, in grocery and other retail stores
Code 39	Alphanumeric (see text for description)	Adopted by Department of Defense, automotive, and other manufacturing industries
Postnet	Numeric only**	U.S. Postal Service code for ZIP code numbers
Code 128	Alphanumeric, but higher density	Substitutes in some Code 39 applications
Code 93	Similar to Code 39 but higher density	Same applications as Code 39

Sources: Nelson [13], Palmer [14].

*UPC = Universal Product Code, adopted by the grocery industry in 1973 and based on a symbol developed by IBM Corporation in early grocery tests. A similar standard bar code system was developed in Europe, called the European Article Numbering system (EAN), in 1978.

**This is the only height-modulated bar code in the table. All others are width-modulated.

The Bar Code Symbol. The bar code standard adopted by the automotive industry, the Department of Defense, the General Services Administration, and many other manufacturing industries is Code 39, also known as AIM USD-2 (Automatic Identification Manufacturers Uniform Symbol Description-2). Code 39 uses a series of wide and narrow elements (bars and spaces) to represent alphanumeric and other characters. The wide elements are equivalent to a binary value of one and the narrow elements are equal to zero. The width of the wide bars and spaces is between two and three times the width of the narrow bars and spaces. Whatever the wide-to-narrow ratio, the width must be uniform throughout the code for the reader to be able to consistently interpret the resulting pulse train. Figure 12.4 presents the character structure for USD-2.

The reason for the name Code 39 is that nine elements (bars and spaces) are used in each character and three of the elements are wide. The placement of the wide spaces and bars in the code uniquely designates the character. Each code begins and ends with either a wide or narrow bar. The code is sometimes referred to as code three-of-nine. In addition to the character set in the bar code, there must also be a so-called “quiet zone” both preceding and following the bar code, in which there is no printing that might confuse the decoder.

Bar Code Readers. Bar code readers come in a variety of configurations; some require a human to operate them and others are stand-alone automatic units. They are usually classified as contact or noncontact readers. Contact bar code readers are handheld wands or light pens operated by moving the tip of the wand quickly past the bar code on the object or document. The wand tip must be in contact with the bar code surface or in very close proximity during the reading procedure. In a factory data collection application, they are usually part of a keyboard entry terminal. The terminal is sometimes referred to as a stationary terminal in the sense that it is placed in a fixed location in the shop. When a transaction is entered in the factory, the data are usually communicated to the computer system immediately. In addition to their use in factory data collection systems, stationary contact bar code readers are widely used in retail stores to enter the item in a sales transaction.

Contact bar code readers are also available as portable units that can be carried around the factory or warehouse by a worker. They are battery-powered and include a solid-state memory device capable of storing data acquired during operation. The data can be transferred to the computer system subsequently. Portable bar code readers often include a keypad that can be used by the operator to input data that cannot be entered via bar code. These portable units are used for order picking in a warehouse and similar applications that require a worker to move significant distances in a building.

Noncontact bar code readers focus a light beam on the bar code, and a photodetector reads the reflected signal to interpret the code. The reader probe is located a certain distance from the bar code (several inches to several feet) during the read procedure. Noncontact readers are classified as fixed beam and moving beam scanners. Fixed beam readers are stationary units that use a fixed beam of light. They are usually mounted beside a conveyor and depend on the movement of the bar code past the light beam for their operation. Applications of fixed beam bar code readers are typically in warehousing and material handling operations where large quantities of materials must be identified as they flow past the scanner on conveyors. Fixed beam

Char.	Bar pattern	9 bits	Char.	Bar pattern	9 bits
1		100100001	K		100000011
2		001100001	L		001000011
3		101100000	M		101000010
4		000110001	N		000010011
5		100110000	O		100010010
6		001110000	P		001010010
7		000100101	Q		000000111
8		100100100	R		100000110
9		001100100	S		001000110
0		000110100	T		000010110
A		100001001	U		110000001
B		001001001	V		011000001
C		101001000	W		111000000
D		000011001	X		010010001
E		100011000	Y		110010000
F		001011000	Z		011010000
G		000001101	-		010000101
H		100001100	.		110000100
I		001001100	space		011000100
J		000011100	*		010010100

*Denotes a start/stop code that must be placed at the beginning and end of every bar code message.

Figure 12.4 Character set in USD-2 bar code, a subset of Code 39 [6].

scanners in these kinds of operations represent some of the first applications of bar codes in industry.

Moving beam scanners use a highly focused beam of light, often a laser, actuated by a rotating mirror to traverse an angular sweep in search of the bar code on the object. A scan is defined as a single sweep of the light beam through the angular path. The high

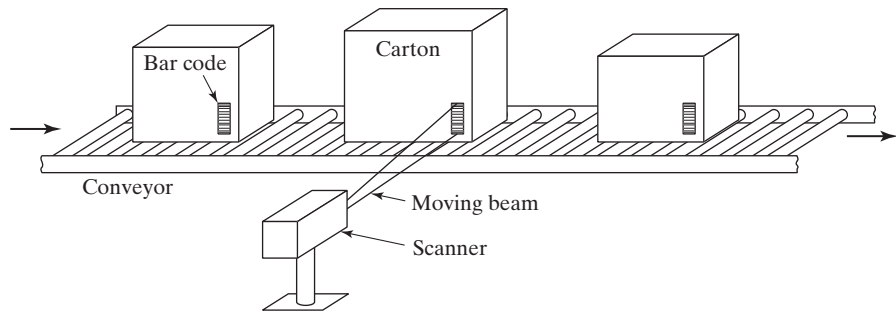


Figure 12.5 Stationary moving beam bar code scanner located along a moving conveyor.

rotational speed of the mirror allows for very high scan rates—up to 1,440 scans/sec [1]. This means that many scans of a single bar code can be made during a typical reading procedure, thus permitting verification of the reading. Moving beam scanners can be either stationary or portable units. Stationary scanners are located in a fixed position to read bar codes on objects as they move past on a conveyor or other material handling equipment. They are used in warehouses and distribution centers to automate the product identification and sortation operations. A typical setup using a stationary scanner is illustrated in Figure 12.5. Portable scanners are handheld devices that the user points at the bar code like a pistol. The vast majority of bar code scanners used in factories and warehouses are of this type.

Bar Code Printers. In many bar code applications, the labels are printed in medium-to-large quantities for product packages and the cartons used to ship the packaged products. These preprinted bar codes are usually produced off-site by companies specializing in these operations. The labels are printed in either identical or sequenced symbols. Printing technologies include traditional techniques such as letterpress, offset lithography, and flexographic printing.

Bar codes can also be printed on-site by methods in which the process is controlled by microprocessor to achieve individualized printing of the bar coded document or item label. These applications tend to require multiple printers distributed at locations where they are needed. The printing technologies used in these applications include ink-jet, laser printing, and laser etching [7], [9], [14].

Examples of applications of these individualized bar code printing methods include keyboard entry of data for inclusion in the bar code of each item that is labeled, unique identification of production lots for pharmaceutical products, and preparation of route sheets and other documents included in a shop packet traveling with a production order. Production workers use bar code readers to indicate order number and completion of each step in the operation sequence.

12.2.2 Two-Dimensional Bar Codes

The first two-dimensional (2-D) bar code was introduced in 1987. Since then, more than a dozen 2-D symbol schemes have been developed, and the number is expected to increase. The advantage of 2-D codes is their capacity to store much greater amounts of data at

higher area densities. Their disadvantage is that special scanning equipment is required to read the codes, and the equipment is more expensive than scanners used for conventional bar codes. Two-dimensional symbologies divide into two basic types: (1) stacked bar codes and (2) matrix symbologies.

Stacked Bar Codes. The first 2-D bar code to be introduced was a stacked symbology. It was developed in an effort to reduce the area required for a conventional bar code. But its real advantage is that it can contain significantly greater amounts of data. A stacked bar code consists of multiple rows of conventional linear bar codes stacked on top of each other. Several stacking schemes have been devised over the years, nearly all of which allow for multiple rows and variations in the numbers of encoded characters possible. An example of a 2-D stacked bar code is illustrated in Figure 12.6. The data density of stacked bar codes is typically five to seven times that of the linear bar code 39.

The encoded data in a stacked bar code are decoded using laser-type scanners that read the lines sequentially. The technical problems encountered in reading a stacked bar code include (1) keeping track of the different rows during scanning, (2) dealing with scanning swaths that cross between rows, and (3) detecting and correcting localized errors [14]. As in linear bar codes, printing defects in the 2-D bar codes are also a problem.

Matrix Symbologies. A matrix symbology consists of 2-D patterns of data cells that are usually square and are colored dark (usually black) or white. The 2-D matrix symbologies were introduced around 1990. Their advantage over stacked bar codes is their capability to contain more data. They also have the potential for higher data densities—up to 30 times more dense than Code 39. Their disadvantage compared to stacked bar codes is that they are more complicated, which requires more sophisticated printing and reading equipment. The symbols must be produced (during printing) and interpreted (during reading) both horizontally and vertically; therefore, they are sometimes referred to as area symbologies. An example of a 2-D matrix code is illustrated

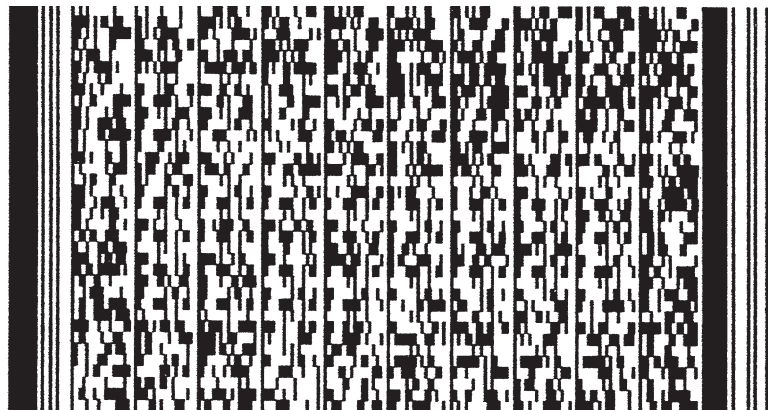


Figure 12.6 A 2-D stacked bar code. Shown is an example of a PDF417 symbol.

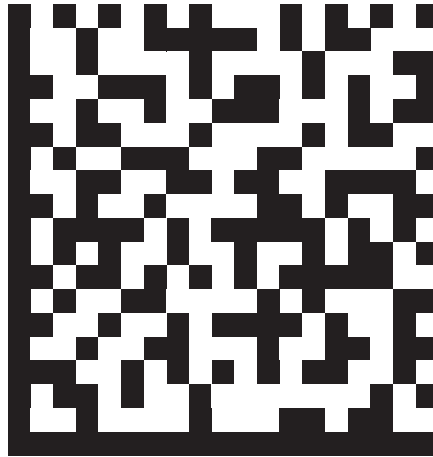


Figure 12.7 A 2-D matrix bar code. Shown is an example of the Data Matrix symbol.

in Figure 12.7. Reading a Data Matrix code requires a machine vision system specially programmed to interpret the code.

Applications of the matrix symbologies are found in part and product identification during manufacturing and assembly. These kinds of applications are expected to grow as computer-integrated manufacturing becomes more pervasive throughout industry. The semiconductor industry has adopted Data Matrix ECC200 (a variation of the Data Matrix code shown in Figure 12.7) as its standard for marking and identifying wafers and other electronic components [12].

12.3 RADIO FREQUENCY IDENTIFICATION

Radio frequency identification technology (RFID) represents the biggest challenge to the dominance of bar codes. Companies including Walmart, Target, and Metro AG (in Germany), as well as the U.S. Department of Defense, have mandated that their suppliers use RFID on incoming materials. In fact the Department of Defense requires a combination of Data Matrix and RFID on all “mission-critical” parts, assemblies, and equipment. These requirements have provided a significant impetus for the implementation of RFID in industry. According to a study of Walmart cited in [17], “RFID stores are 63 percent more effective in replenishing out-of-stock items than traditional stores.”

In radio frequency identification, an identification tag or label containing electronically encoded data is attached to the subject item, which can be a part, product, or container (e.g., carton, tote pan, pallet). The identification tag consists of an integrated circuit chip and a small antenna, as pictured in Figure 12.8. These components are usually enclosed in a protective plastic container or are imbedded in an adhesive-backed label that is attached to item. The tag is designed to satisfy the Electronic Product Code (EPC) standard, which is the RFID counterpart to the Universal Product Code (UPC) used in bar codes. The tag communicates the encoded data by RF to a reader

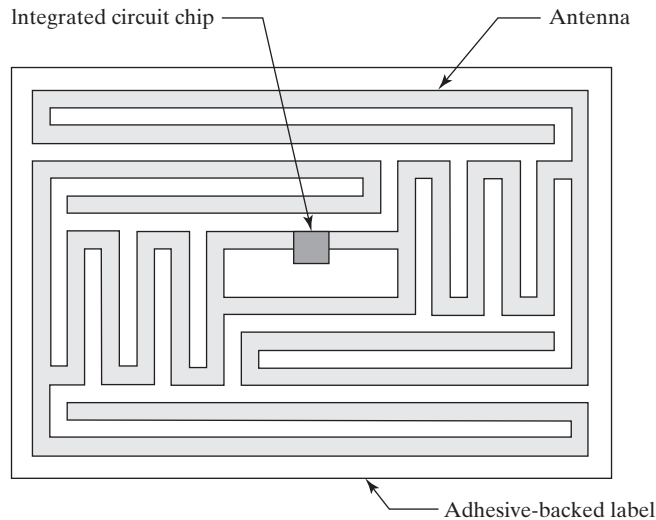


Figure 12.8 RFID label. Approximate size is 20 mm by 30 mm (0.8 in by 1.2 in).

or interrogator as the item is brought into the reader's proximity. The reader can be portable or stationary. It decodes and confirms the RF signal before transmitting the associated data to a collection computer.

Although the RF signals are similar to those used in wireless radio and television transmission, there are differences in how RF technology is used in product identification. One difference is that the communication is in two directions rather than in one direction as in commercial radio and TV. The identification tag is a *transponder*, a device that emits a signal of its own when it receives a signal from an external source. To activate it, the reader transmits a low-level RF magnetic field that serves as the power source for the transponder when they are near each other. Another difference between RFID and commercial radio and TV is that the signal power is substantially lower in RFID applications (milliwatts to several watts), and the communication distances usually range between several millimeters and several meters. Finally, there are differences in the allowable frequencies that can be used for RFID applications versus radio, TV, and other commercial and military users.

RF identification tags are available in two general types: (1) passive and (2) active. Passive tags have no internal power source; they derive their electrical power for transmitting a signal from radio waves generated by the reader when in close proximity. Active tags include their own battery power packs. Passive tags are smaller, less expensive, longer lasting, and have a shorter radio communication range. Active tags generally possess a larger memory capacity and a longer communication range (typically 10 m and more). Applications of active tags tend to be associated with higher value items due to the higher cost per tag.

One of the initial uses of RFID was in Britain in World War II to distinguish between enemy and allied airplanes flying across the English Channel. Commercial and military aircraft still use transponders for identification purposes. Other RFID applications use tags in a variety of different forms, such as credit-card-sized plastic labels for product

TABLE 12.3 Bar Codes versus Radio Frequency Identification

Comparison	Bar Codes	RFID
Technology	Optical	Radio frequency
Read-write capability	Read only	Read-write available
Storage capacity	14–16 digits (linear bar codes)	96–256 digits
Line-of-sight reading	Required	Not required
Reusability	One-time use	Reusable
Cost per label	Very low	About 10 times the cost of bar code for passive tag
Durability	Susceptible to dirt and scratches	More durable in plant environment

Source: Based mostly on Weber [17].

identification and very small glass capsules injected into wild animals for tracking and research purposes. The principal applications of RFID in industry (in approximate descending order of frequency) are (1) inventory management, (2) supply chain management, (3) tracking systems, (4) warehouse control, (5) location identification, and (6) work-in-process tracking [17].

Identification tags in RFID have traditionally been read-only devices that contain up to 20 characters of data identifying the item and representing other information that is to be communicated. Advances in the technology have provided much higher data storage capacity and the ability to change the data in the tag (read/write tags). This has opened opportunities for incorporating much more status and historical information into the automatic identification tag rather than using a central database. Table 12.3 compares the two major AIDC technologies, bar codes and RFID.

Advantages of RFID include the following: (1) identification does not depend on physical contact or direct line of sight observation by the reader, (2) much more data can be contained in the identification tag than with most AIDC technologies, and (3) data in the read/write tags can be altered for historical usage purposes or reuse of the tag. The disadvantage of RFID is that the labels and hardware are more expensive than for most other AIDC technologies. For this reason, RFID systems have traditionally been appropriate only for data collection situations in which environmental factors preclude the use of optical techniques such as bar codes to identify products in manufacturing processes that would obscure any optically coded data (e.g., spray painting). The applications are now expanding beyond these limits due to the mandates set forth by Walmart, the Department of Defense, and others.

In addition to RF identification, radio frequencies are also widely used to augment bar code and other AIDC techniques by providing the communication link between remote bar code readers and some central terminal. This latter application is called radio frequency data communication (RFDC), as distinguished from RFID.

12.4 OTHER AIDC TECHNOLOGIES

The other automated identification and data collection techniques are either used in special applications in factory operations, or they are widely applied outside the factory.

12.4.1 Magnetic Stripes

Magnetic stripes attached to a product or container are sometimes used for item identification in factory and warehouse applications. A magnetic stripe is a thin plastic film containing small magnetic particles whose pole orientations can be used to encode bits of data into the film. The film can be encased in or attached to a plastic card or paper ticket for automatic identification. These are the same kinds of magnetic stripes used to encode data onto plastic credit cards and bank access cards. Two advantages of magnetic stripes are their large data storage capacity and the ability to alter the data contained in them. Although they are widely used in the financial community, their use seems to be declining in shop floor control applications for the following reasons: (1) the magnetic stripe must be in contact with the scanning equipment for reading to be accomplished, (2) there are no convenient shop floor encoding methods to write data into the stripe, and (3) the magnetic stripe labels are more expensive than bar code labels.

12.4.2 Optical Character Recognition

Optical character recognition (OCR) is the use of specially designed alphanumeric characters that are machine readable by an optical reading device. Optical character recognition is a 2-D symbology, and scanning involves interpretation of both the vertical and horizontal features of each character during decoding. Accordingly, when manually operated scanners are used, a certain level of skill is required by the human operator, and first read rates are relatively low (often less than 50% [14]). The substantial benefit of OCR technology is that the characters and associated text can be read by humans as well as by machines.

As an interesting historical note, OCR was selected as the standard automatic identification technology by the National Retail Merchants Association (NRMA) shortly after the UPC bar code was adopted by the grocery industry. Many retail establishments made the investment in OCR equipment at that time. However, the problems with the technology became apparent by the mid-1980s [14]: (1) low first read rate and high substitution error rate when handheld scanners were used, (2) lack of an omnidirectional scanner for automatic checkout, and (3) widespread and growing adoption of bar code technology. NRMA was subsequently forced to revise its recommended standard from OCR technology to bar codes.

For factory and warehouse applications, the list of disadvantages includes (1) the requirement for near-contact scanning, (2) lower scanning rates, and (3) higher error rates compared to bar code scanning.

12.4.3 Machine Vision

The principal application of machine vision is for automated inspection tasks (Section 22.5). For AIDC applications, machine vision systems are used to read 2-D matrix symbols, such as Data Matrix (Figure 12.7), and they can also be used for stacked bar codes, such as PDF-417 (Figure 12.6) [11]. Applications of machine vision also include other types of automatic identification, and these applications may grow in number as the technology advances. For example, machine vision systems are capable of distinguishing among a variety of products moving down a conveyor so that the products can be sorted. The recognition task is accomplished without using special identification codes on the products and is instead based on the inherent geometric features of the object.

REFERENCES

- [1] Accu-Sort Systems, Inc., *Bar Code Technology—Present State, Future Promise*, 2nd ed., Telford, PA (no date).
- [2] “AIDC Technologies—Who Uses Them and Why,” *Modern Materials Handling*, March 1993, pp. 12–13.
- [3] AGAPAKIS, J., and A. STUEBLER, “Data Matrix and RFID—Partnership in Productivity,” *Assembly*, October 2006, pp. 56–59.
- [4] ALLAIS, D. C., *Bar Code Symbology*, Intermec Corporation, 1984.
- [5] ATTARAN, M., “RFID Pays Off,” *Industrial Engineer*, September 2006, pp. 46–50.
- [6] Automatic Identification Manufacturers, *Automatic Identification Manufacturers Manual*, Pittsburgh, PA.
- [7] “Bar Codes Move into the Next Dimension,” *Modern Materials Handling/AIDC News & Solutions*, June 1998, p. A11.
- [8] COHEN, J., *Automatic Identification and Data Collection Systems*, McGraw-Hill Book Company Europe, Berkshire, UK, 1994.
- [9] FORCINO, H., “Bar Code Revolution Conquers Manufacturing,” *Managing Automation*, July 1998, pp. 59–61.
- [10] KINSELLA, B., “Delivering the Goods,” *Industrial Engineer*, March 2005, pp. 24–30.
- [11] MOORE, B., “New Scanners for 2D Symbols,” *Material Handling Engineering*, March 1998, pp. 73–77.
- [12] NAVAS, D., “Vertical Industry Overview: Electronics ‘98,” *ID Systems*, February 1998, pp. 16–26.
- [13] NELSON, B., *Punched Cards to Bar Codes*, Helmers Publishing, Inc., Peterborough, NH, 1997.
- [14] PALMER, R. C., *The Bar Code Book*, 5th ed., Helmers Publishing, Inc., Peterborough, NH, 2007.
- [15] “RFID: Wal-Mart Has Spoken. Will You Comply?” *Material Handling Management*, December 2003, pp. 24–30.
- [16] SOLTIS, D. J., “Automatic Identification System: Strengths, Weaknesses, and Future Trends,” *Industrial Engineering*, November 1985, pp. 55–59.
- [17] WEBER, A., “RFID on the Line,” *Assembly*, January 2006, pp. 78–92.
- [18] www.aimusa.org/techinfo/aidc.html
- [19] www.wikipedia.org/wiki/Barcode
- [20] www.wikipedia.org/wiki/Radio_frequency_identification

REVIEW QUESTIONS

- 12.1** What is automatic identification and data capture?
- 12.2** What are the drawbacks of manual collection and entry of data?
- 12.3** What are the three principal components in automatic identification technologies?
- 12.4** Name four of the six categories of AIDC technologies that are identified in the text.
- 12.5** Name five common applications of AIDC technologies in production and distribution.
- 12.6** There are two forms of linear bar codes. Name them, and indicate what the difference is.
- 12.7** What was the major industry to first use the Universal Product Code (UPC)?
- 12.8** What are the two basic types of two-dimensional bar codes?
- 12.9** What does RFID stand for?

- 12.10** What is a transponder in RFID?
- 12.11** What is the difference between a passive tag and an active tag?
- 12.12** What are the relative advantages of RFID over bar codes?
- 12.13** What are the relative advantages of bar codes over RFID?
- 12.14** What are the reasons why magnetic stripes are not widely used in factory floor operations?
- 12.15** What is the advantage of optical character recognition technology over bar code technology?
- 12.16** What is the principal application of machine vision in industry?

Overview of Manufacturing Systems

CHAPTER CONTENTS

- 13.1 Components of a Manufacturing System
 - 13.1.1 Production Machines
 - 13.1.2 Material Handling System
 - 13.1.3 Computer Control System
 - 13.1.4 Human Resources
- 13.2 Types of Manufacturing Systems
 - 13.2.1 Types of Operations
 - 13.2.2 Number of Workstations and System Layout
 - 13.2.3 Level of Automation
 - 13.2.4 System Flexibility
 - 13.2.5 Classification of Manufacturing Systems

This part of the book considers how automation and material handling technologies, as well as human workers, are combined to create manufacturing systems. A **manufacturing system** is defined as a collection of integrated equipment and human resources, whose function is to perform one or more processing and/or assembly operations on a starting raw material, part, or set of parts. The integrated equipment includes production machines and tools, material handling and work positioning devices, and computer systems. Human resources are required either full time or periodically to keep the system running. The manufacturing system is where the value-added work is accomplished on the parts and products. The position of the manufacturing system in the larger production system is shown in Figure 13.1.

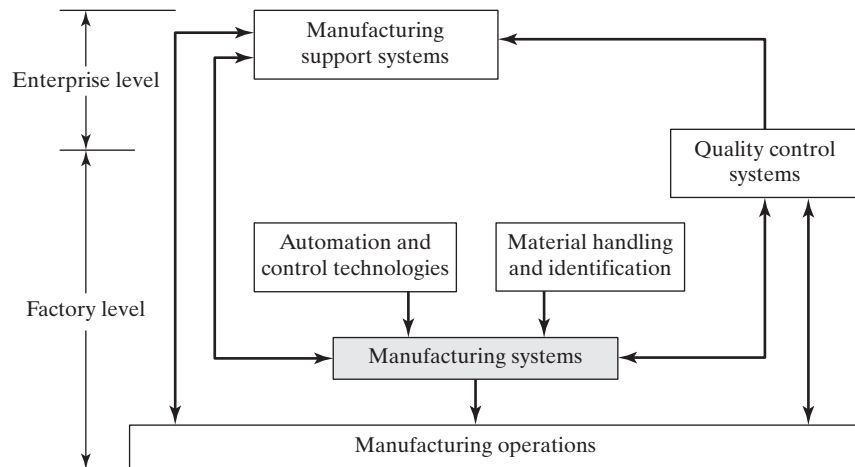


Figure 13.1 The position of the manufacturing system in the larger production system.

The present chapter provides an overview of the various types of manufacturing systems by describing their common components and features. A framework is then developed for distinguishing how the components are combined and organized into different types of systems to achieve specific capabilities in production.

13.1 COMPONENTS OF A MANUFACTURING SYSTEM

A manufacturing system typically consists of the following components: (1) production machines plus tools, fixtures, and other related hardware, (2) a material handling and/or work-positioning system, (3) a computer system to coordinate and/or control the preceding components, and (4) human workers to operate and manage the system.

13.1.1 Production Machines

In virtually all modern manufacturing systems, most of the actual processing or assembly work is accomplished by machines and/or with the aid of tools. In terms of worker participation, the machines can be classified as (1) manually operated, (2) semiautomated, and (3) fully automated.

Manually operated machines are controlled or supervised by a human worker. The machine provides the power for the operation and the worker provides the control. Conventional machine tools (such as lathes, milling machines, and drill presses) fit into this category. The worker must be at the machine continuously to engage the feed, position the tool, load and unload work parts, and perform other tasks related to the operation.

A semiautomated machine performs a portion of the work cycle under some form of program control, and a worker tends to the machine for the remainder of the cycle. An example of this category is a computer numerical control (CNC) machine tool or other programmable production machine that is controlled for most of the work cycle by the part program, but requires a worker to unload the finished part and load the next

workpiece during each cycle. In these cases, the worker must attend to the machine every cycle, but need not be continuously present during the cycle. If the automatic machine cycle takes, say, 10 min while the part unloading and loading portion of the work cycle only takes 1 min, then the worker may be able to tend several machines. This possibility is analyzed in Section 14.4.2.

What distinguishes a fully automated machine from the two previous types is the capability to operate with no human attention for periods of time longer than one work cycle. Although a worker's attention is not required during each cycle, some form of machine tending may be needed periodically. For example, after a certain number of cycles, a new supply of raw material must be loaded into the automated machine.

In manufacturing systems, the term *workstation* is used to refer to a location in the factory where some well-defined task or operation is accomplished by an automated machine, a worker-and-machine combination, or a worker using hand tools and/or portable powered tools. In the last case, there is no definable production machine at the location. Many assembly tasks are in this category. A given manufacturing system may consist of one or more workstations. A system with multiple stations is called a production line, assembly line, machine cell, or other name, depending on its configuration and function. An important observation that will be revisited later in the chapter is that manually operated machines and semiautomated machines are both classified as *manned workstations* because they require a worker to be present during each work cycle, while fully automated machines are classified as *automated workstations* because a worker does not need to be present except periodically.

13.1.2 Material Handling System

In most processing and assembly operations performed on discrete parts and products, the following material handling functions must be performed: (1) loading work units at each station, (2) positioning the work units at the station, and (3) unloading the work units from the station. In manufacturing systems composed of multiple workstations, (4) transporting work units between stations is also required. In many cases, workers perform these functions, but more often some form of mechanized or automated material transport system (Chapter 10) is used to reduce the human effort. Most material transport systems used in production provide (5) a temporary storage function as well. The purpose of storage in these systems is usually to make sure that work is always present for the stations, so that the stations are not starved (meaning that they have nothing to work on).

Some of the issues related to the material handling system are unique to the particular type of manufacturing system, so it makes sense to discuss the details of the handling system when each system is covered in a later chapter. The discussion here is concerned with the general issues related to material handling in manufacturing systems.

Loading, Positioning, and Unloading. These three material handling functions occur at each workstation. Loading involves moving the work units into the production machine or processing equipment from a source inside the station. For example, starting parts in batch processing operations are often stored in containers (pallets, tote bins, etc.) in the immediate vicinity of the station. For most processing operations, especially those requiring accuracy and precision, the work unit must be positioned in the production machine. Positioning means that the part is placed in a fixed location and orientation relative to the work head or tooling that performs the operation. Positioning in the production equipment

is often accomplished by means of a work holder. A **work holder** is a device that accurately locates, orients, and clamps the part for the operation, and resists any forces that may occur during processing. Common work holders include jigs, fixtures, and chucks. When the production operation has been completed, the work unit must be unloaded, that is, removed from the production machine and either placed in a container at the workstation or prepared for transport to the next workstation in the processing sequence. “Prepared for transport” may simply mean the part is loaded onto a conveyor leading to the next station.

When the production machine is manually operated or semiautomated, loading, positioning, and unloading are performed by the worker. This is accomplished either by hand for lightweight work parts or with the aid of a hoist for heavy parts. In fully automated stations, a mechanized device such as an industrial robot, parts feeder, coil feeder (in sheet metal stamping), or automatic pallet changer is used to accomplish these material handling functions.

Work Transport between Stations. In the context of manufacturing systems, work transport means moving parts between workstations in a multistation system. The transport function can be accomplished manually or by material transport equipment.

In some manufacturing systems, work units are passed from station to station by hand, either one at a time or in batches. Moving parts in batches is generally more efficient according to the Unit Load Principle (Section 10.1.2). Manual work transport is limited to cases in which the parts are small and light, so that the manual labor is ergonomically acceptable. When the load to be moved exceeds certain weight standards, powered hoists (Section 10.2.5) and similar lift equipment are used. Manufacturing systems that utilize manual work transport include manual assembly lines and group technology machine cells.

Various types of mechanized and automated material handling equipment are widely used to transport work units in manufacturing systems. Two general categories of work transport can be distinguished, according to the type of routing between stations: (1) fixed routing and (2) variable routing. In **fixed routing**, the work units always flow through the same sequence of workstations. This means that the work units are identical, or similar enough that the processing sequence is the same. Fixed routing is common on production lines. In **variable routing**, work units are transported through a variety of different station sequences. This means that the manufacturing system processes or assembles different styles of work units. Variable routing transport is associated with job shop production and many batch production operations. Manufacturing systems that use variable routing include machine cells and flexible manufacturing systems. The difference between fixed and variable routing is portrayed in Figure 13.2. Table 13.1 lists some of the typical material transport equipment used for the two types of part routing.

Pallet Fixtures and Work Carriers in Transport Systems. Depending on the geometry of the work units and the nature of the processing and/or assembly operations performed, the transport system may be designed to accommodate some form of pallet fixture. A **pallet fixture** is a work holder that is designed to be transported by the material handling system. The part is accurately attached to the fixture on the upper face of the pallet, and the under portion of the pallet is designed to be moved, located, and clamped in position at each workstation in the system. Because the part is accurately located in the fixture, and the pallet is accurately clamped at the station, the part is accurately located at each station for processing or assembly. Use of pallet fixtures is common in automated

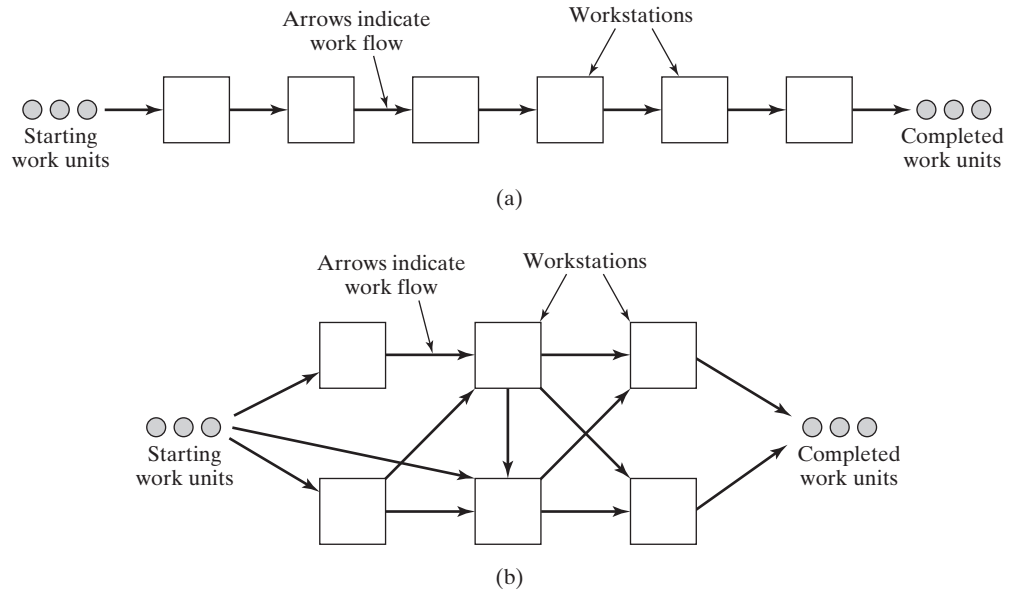


Figure 13.2 Two types of routing in multistation manufacturing systems: (a) fixed routing and (b) variable routing.

manufacturing systems, such as single machine cells with automatic pallet changers, transfer lines, and automated assembly systems.

The fixtures can be designed with modular features that allow them to be used for more than one part geometry. By changing components and making a few adjustments, these **modular pallet fixtures** can accommodate variations in part sizes and shapes. They are ideal for use in flexible manufacturing systems.

Alternative methods of work part transport avoid the use of pallet fixtures. Instead, parts are moved by the handling system either with or without work carriers. A **work carrier** is a container (e.g., tote pan, flat pallet, or wire basket) that holds one or more parts and can be moved in the system. Work carriers do not fixture the part(s) in an exact position. Their role is simply to contain parts during transport. When the parts arrive at the desired destination, any locating requirements for the next operation must be satisfied at that station (this is usually done manually).

TABLE 13.1 Common Material Transport Equipment Used for Fixed and Variable Routing in Multistation Manufacturing Systems

Type of Routing	
Fixed Routing	Variable Routing
Powered roller conveyor	Automated guided vehicle system
Belt conveyor	Power-and-free overhead conveyor
Drag chain conveyor	Monorail system
Overhead trolley conveyor	Cart-on-track conveyor
Rotary indexing mechanisms	
Walking beam transfer equipment	

An alternative to using pallet fixtures or work carriers is *direct transport*, in which the transport system is designed to move the work unit itself. The obvious benefit of this arrangement is that it avoids the expense of purchasing pallet fixtures or work carriers, as well as the ongoing costs of returning them to the starting point in the system for reuse. In manually operated manufacturing systems, direct transport is quite feasible, since any positioning required at workstations can be accomplished by workers. In automated manufacturing systems, in particular systems that require accurate positioning at workstations, the feasibility of direct transport depends on the part's geometry and whether an automated handling method can be devised that is capable of moving, locating, and clamping the part with sufficient precision and accuracy. Not all part shapes allow for direct handling by a mechanized or automated system.

13.1.3 Computer Control System

In modern automated manufacturing systems, a computer system is required to control the automated and semiautomated equipment and to participate in the overall coordination and management of the system. Even in manually driven systems, such as manual assembly lines, a computer system is useful to support production. Typical computer system functions include the following:

- *Communicate instructions to workers.* In manually operated workstations that perform different tasks on different work units, operators must receive processing or assembly instructions for each specific work unit.
- *Download part programs.* The computer sends these instructions to computer-controlled workstations.
- *Control material handling system.* This function coordinates the activities of the material handling system with those of the workstations.
- *Schedule production.* Some production scheduling functions may be accomplished at the site of the manufacturing system.
- *Diagnose failures.* This involves diagnosing equipment malfunctions, preparing preventive maintenance schedules, and maintaining the spare parts inventory.
- *Monitor safety.* This function ensures that the system does not operate in an unsafe manner. The goal of safety monitoring is to protect both the human workers and the equipment comprising the system.
- *Maintain quality control.* The purpose of this control function is to detect and reject defective work units produced by the system.
- *Manage operations.* This consists of managing the overall operations of the manufacturing system, either directly (by supervisory computer control) or indirectly (by preparing the necessary reports for management personnel).

13.1.4 Human Resources

In many manufacturing systems, humans perform some or all of the value-added work on the parts or products. In these cases, the human workers are referred to as direct labor. Through their physical efforts, they directly add to the value of the work unit by

performing manual work on it or by controlling the machines that perform the work. In fully automated systems, direct labor may still be needed to perform activities such as periodically loading and unloading parts, changing tools, and sharpening tools. Human workers are also needed in automated manufacturing systems to manage or support the system as computer programmers, computer operators, part programmers for computer numerical control (CNC) machine, maintenance and repair personnel, and similar indirect roles. In automated systems, the distinction between direct and indirect labor is not always precise.

13.2 TYPES OF MANUFACTURING SYSTEMS

This section explores the various factors that distinguish different types of manufacturing systems. The factors are (1) types of operations performed, (2) number of workstations and system layout, (3) level of automation, and (4) system flexibility. From these factors, a general classification of manufacturing systems is derived.

13.2.1 Types of Operations

First of all, manufacturing systems are distinguished by the types of operations they perform. One distinction is between (1) processing operations on individual work units and (2) assembly operations to join individual parts into assembled entities. Included in this distinction are the technologies of the individual processing and assembly operations (Section 2.2.1).

Additional parameters of the product that affect the operations performed in the manufacturing system are the following:

- *Type of material processed.* Different engineering materials require different types of processes. Processing operations used for metals are usually different from those used for plastics or ceramics. These differences affect the type of equipment and handling method in the manufacturing system.
- *Size and weight of the part or product.* Larger and heavier work units require bigger equipment with greater power capacity. Safety hazards increase with the size and weight of parts and products.
- *Part geometry.* Machined parts can be classified as rotational or non-rotational. Rotational parts are cylindrical or disk-shaped and require turning and related rotational operations. Non-rotational parts are rectangular or cube-like and require milling and related machining operations to shape them. Manufacturing systems that perform machining operations must be distinguished according to whether they make rotational or non-rotational parts. The distinction is important not only because of differences in the machining processes and machine tools required, but because the material handling system must be engineered differently for the two cases.
- *Part or product complexity.* In general, part complexity correlates with the number of processing operations required to produce the part, and product complexity correlates with the number of components that must be assembled (Section 2.4.2).

13.2.2 Number of Workstations and System Layout

The number of workstations is a key factor that differentiates manufacturing system types. It has a strong influence on the performance of the manufacturing system in terms of production rate and reliability. Let the symbol n denote the number of workstations in the system. Thus, manufacturing systems can be distinguished as single-station cells ($n = 1$) or multistation systems ($n > 1$).

The number of workstations in the manufacturing system is a convenient measure of its size. As the number of stations increases, the amount of work that can be accomplished by the system increases. It stands to reason that two workstations can accomplish twice the workload of one station. Thus, one obvious relationship is that the workload capacity of a manufacturing system increases in proportion to the number of workstations in it.

In addition, there must be a synergistic benefit obtained from multiple stations working together rather than individually; otherwise, it makes more sense for the stations to work independently. The synergistic benefit is usually derived from the fact that the total amount of work performed on the part or product is too complex to accomplish at a single workstation. There is just too much work to perform at one station. By breaking the total work content down into tasks, and assigning different tasks to different stations, the workload at each station is simplified. The different stations can be designed to specialize in their own assigned tasks. They are therefore highly efficient. This is what provides a multistation system with its synergistic benefit. Because of the specialization designed into each station in a multistation system, such a system is able to deal with product complexity better than the same number of single stations that each performs the total work content on the part or product. The result is a higher production rate for complex parts and products. Automobile final assembly plants illustrate this advantage. The total work content to assemble each car is typically 15–20 hr—too much time and too much complexity for one workstation to cope with. However, when the total work content is divided into simple tasks of about 1-min duration, and these tasks are assigned to individual workers at stations along the line of flow, cars are produced at the rate of about 60 per hour.

More stations also mean the system is more complex and therefore more difficult to manage and maintain. It consists of more workers, more machines, and more parts being handled. The material handling system is more complex in a multistation system. It becomes increasingly complex as n increases. The logistics and coordination of the system are more involved. Reliability problems occur more frequently.

Closely related to the number of workstations is the way the multiple stations are laid out. Workstation layouts organized for fixed routing are usually arranged linearly, as in a production line, while layouts organized for variable routing can have many possible configurations. The layout of stations is an important factor in determining the most appropriate material handling system, as indicated in Table 13.1.

13.2.3 Level of Automation

The level of automation of the workstations is another factor that characterizes a manufacturing system. Inversely correlated with automation level is the *manning level* of a workstation, symbolized M_i , which is the proportion of time that a worker spends at the station. If $M_i = 1$ for station i , it means that one worker must be at the station

continuously. If one worker tends four automatic machines, then $M_i = 0.25$ for each of the four machines, assuming each machine requires the same amount of attention. On sections of automobile and truck final assembly lines, many stations are occupied by multiple workers, in which case $M_i = 2$ or 3 or more. In general, high values of M_i ($M_i \geq 1$) indicate manual operations at the workstation, while low values ($M_i < 1$) denote some form of automation.

The average manning level of a multistation manufacturing system is a useful indicator of the direct labor content of the system. It is defined as

$$M = \frac{w_u + \sum_{i=1}^n w_i}{n} = \frac{w}{n} \quad (13.1)$$

where M = average manning level for the system; w_u = number of utility workers assigned to the system; w_i = number of workers assigned specifically to station i , for $i = 1, 2, \dots, n$; and w = total number of workers assigned to the system. **Utility workers** are workers who are not assigned to specific workstations; instead they perform functions such as (1) relieving workers at stations for personal breaks, (2) maintenance and repair, (3) material handling, and (4) tool changing. Even a fully automated multistation system is likely to have utility workers who are responsible for keeping it running.

There are two basic levels of automation and its approximate inverse, manning level, for workstations in a manufacturing system: (1) manned workstations and (2) automated workstations. Manned workstations consist of production machines that are manually operated or semiautomated. Both categories require a worker to be in attendance during each and every work cycle. As mentioned earlier, in some cases, one worker may be able to attend more than one machine (e.g., a machine cluster, discussed in Section 14.4.2) if the semiautomatic cycle is long relative to the service required each cycle by the worker.

An automated workstation is centered by a fully automated machine in which a worker is not required to be present during each cycle. Periodic attention by a worker is commonly required for purposes of maintenance, loading and unloading of parts, and so on.

The automation level of the workstations in a manufacturing system defines the level of automation of the system itself. In most cases, this means that the system is manned or automated. However, some multistation systems consist of some stations that are manned while others are fully automated. This is referred to as a partially automated or hybrid system.

13.2.4 System Flexibility

The fourth factor that characterizes a manufacturing system is the degree to which it is capable of dealing with variations in the parts or products it produces. Examples of possible differences and variations that a manufacturing system may have to cope with include (1) starting material, (2) size and weight of the work unit, (3) part geometry, (4) part or product complexity, and (5) optional features in an assembled product. Flexibility is the capability that allows a manufacturing system to cope with a certain level of variation in part or product style without interruptions in production for changeovers between models. Flexibility is generally a desirable feature of a manufacturing system. Systems that possess it are called *flexible manufacturing systems*, or *flexible assembly systems*, or similar names. They can produce different part or assembly styles, or they can readily adapt to new styles when the previous ones become obsolete.

In order to be flexible, a manufacturing system must be able to perform the following functions every work cycle:

- *Identification of different work units.* Different part or product styles require different operations. The manufacturing system must identify the work unit in order to perform the correct operations. In a manually operated or semiautomatic system, this task is usually an easy one for the worker(s). In an automated system, some means of automatic work unit identification must be devised.
- *Quick changeover of operating instructions.* The instructions, or part program in the case of computer-controlled production machines, must correspond to the correct operation for the given part. In the case of a manually operated system, this generally means workers who (1) are skilled in the variety of operations needed to process or assemble the different work unit styles, and (2) know which operations to perform on each work unit style. In semiautomatic and fully automated systems, it means that the required part program is readily available to the controller once the work unit has been identified.
- *Quick changeover of physical setup.* Flexibility in manufacturing means that the different work units are not produced in batches. To enable different work unit styles to be produced with no time lost between one unit and the next, the flexible manufacturing system must be capable of making any necessary changes in fixturing and tooling in a very short time (the changeover time should correspond approximately to the time required to exchange the completed work unit for the next unit to be processed).

These capabilities are often difficult to engineer. In manually operated manufacturing systems, human errors can cause problems, such as workers not performing the correct operations on the different part styles or omitting steps during assembly of the product. In automated systems, sensor systems must be designed to enable work unit identification. Part program changeover is accomplished with relative ease using today's computer technology. Changing the physical setup is often the most challenging problem, and it becomes more difficult as part or product variety increases. Endowing a manufacturing system with flexibility increases its complexity. The material handling system and/or pallet fixtures must be designed to hold a variety of part shapes. The required number of different tools increases. Inspection becomes more complicated because of part variety. The logistics of supplying the system with the correct quantities of different starting work parts is more involved. Scheduling and coordinating the system become more difficult.

13.2.5 Classification of Manufacturing Systems

Summarizing the preceding discussion, three basic types of manufacturing systems can be identified: (1) single-station cells, (2) multistation systems with fixed routing, and (3) multistation systems with variable routing. Each type can be implemented as a manned system or an automated system, as depicted in Figure 13.3. In the case of multistation systems, hybrids consisting of manned and automated stations are also possible.

Single-Station Cells. Applications of single-station cells are widespread. The typical case is a worker-machine cell. Two categories are distinguished: (1) manned cells,

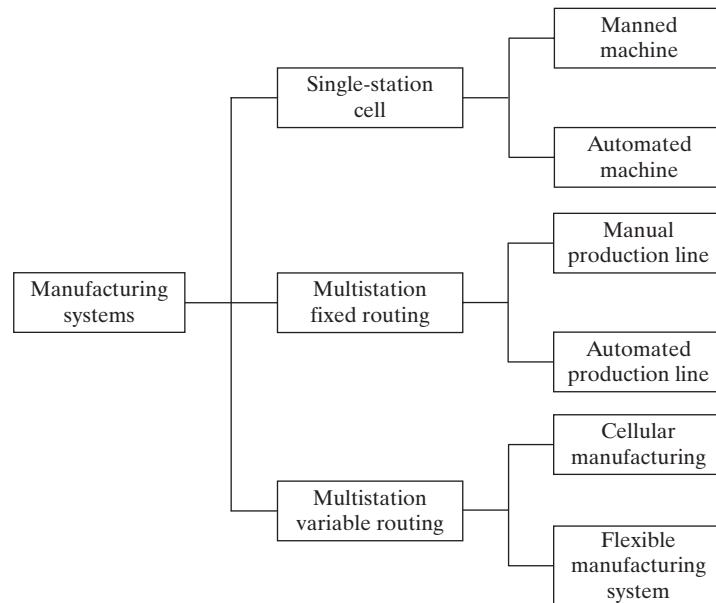


Figure 13.3 Classification of manufacturing systems.

in which a worker must be present each work cycle, and (2) automated cells, in which periodic attention is required less frequently than every cycle. In either case, these systems are used for processing as well as assembly operations. Examples of single-station cells include the following:

- Worker operating an engine lathe (manually operated machine)
- Worker loading and unloading a CNC lathe (semiautomated machine)
- Welder and fitter working in an arc-welding operation (manually operated equipment)
- CNC turning center with parts carousel operating unattended using a robot to load and unload parts (fully automated machine).

Single-station cells are described in Chapter 14. This type of manufacturing system is popular because (1) it is the easiest and least expensive manufacturing system to implement, especially the manned version; (2) it is arguably the most adaptable, adjustable, and flexible manufacturing system; and (3) a manned single workstation can be converted to an automated station if demand for the parts or products made in the station justify this conversion.

Multistation Systems with Fixed Routing. A multistation manufacturing system with fixed routing is a *production line*, which consists of a series of workstations laid out so that the work unit moves from one station to the next, and a portion of the total work content is performed on it at each station. Transfer of work units from one station to the next is usually accomplished by a conveyor or other mechanical transport

system. However, in some cases the work is simply pushed between stations by hand. Production lines are generally associated with mass production, although they can also be applied in batch production. Examples of multistation systems with fixed routing include the following:

- Manual assembly line that produces small power tools (manually operated workstations)
- Machining transfer line (automated workstations)
- Automated assembly machine with a carousel system for work transport (automated workstations)
- Automobile final assembly plant, in which many of the spot welding and spray painting operations are automated while general assembly is manual (hybrid system).

Manual production lines usually perform assembly operations, and manual assembly lines are discussed in Chapter 15. Automated lines perform either processing or assembly operations. The two types are described in Chapters 16 and 17. There are also hybrid systems, in which both manual and automated stations exist in the same line. This case is analyzed in Section 17.2.4 for assembly systems.

Multistation Systems with Variable Routing. A multiple-station system with variable routing is a group of workstations organized to produce a limited range of part or product styles in medium production quantities (typically 100–10,000 units annually). The differences in part or product styles mean differences in operations and sequences of operations that must be performed. The system must possess flexibility in order to cope with this variety. Examples of multiple-station systems with variable routing include the following:

- Manned machine cell designed to produce a family of parts with similar geometric features (manually operated machines)
- Flexible manufacturing system with several CNC machine tools connected by an automated conveyor system and operating under computer control (automated workstations).

The first example represents cellular manufacturing that uses the principles of group technology, discussed in Chapter 18. The flexible manufacturing system in the second example is a fully automated system. Flexibility and flexible manufacturing systems are discussed in Chapter 19.

REFERENCES

- [1] ARONSON, R. B., “Operation Plug-and-Play is On the Way,” *Manufacturing Engineering*, March 1997, pp. 108–112.
- [2] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 3rd ed., John Wiley & Sons, Inc., Hoboken, NJ, 2007.
- [3] GROOVER, M. P., and O. MEJABI, “Trends in Manufacturing System Design,” *Proceedings, IIE Fall Conference*, Nashville, TN, November 1987.

REVIEW QUESTIONS

- 13.1** What is a manufacturing system?
- 13.2** Name the four components of a manufacturing system.
- 13.3** What are the three classifications of production machines, in terms of worker participation?
- 13.4** What are the five material handling functions that must be provided in a manufacturing system?
- 13.5** What is the difference between fixed routing and variable routing in manufacturing systems consisting of multiple workstations?
- 13.6** What is a pallet fixture in work transport in a manufacturing system?
- 13.7** A computer system is an integral component in a modern manufacturing system. Name four of the eight functions of the computer system listed in the text.
- 13.8** What are the four factors that can be used to distinguish manufacturing systems in the classification scheme proposed in the chapter?
- 13.9** Why is manning level inversely correlated with automation level in a manufacturing system?
- 13.10** What is flexibility in a manufacturing system?
- 13.11** What are the three capabilities that a manufacturing system must possess in order to be flexible?
- 13.12** Name the basic categories of manufacturing systems, as they are identified in the text.
- 13.13** What is a production line?

Chapter 14

Single-Station Manufacturing Cells

CHAPTER CONTENTS

- 14.1 Single-Station Manned Cells
- 14.2 Single-Station Automated Cells
 - 14.2.1 Enablers for Unattended Cell Operation
 - 14.2.2 Parts Storage and Automatic Parts Transfer
 - 14.2.3 CNC Machining Centers and Related Machine Tools
- 14.3 Applications of Single-Station Cells
- 14.4 Analysis of Single-Station Cells
 - 14.4.1 Number of Workstations Required
 - 14.4.2 Machine Clusters

Single stations constitute the most common manufacturing system in industry. They operate independently of other workstations in the factory, although their activities are coordinated within the larger production system. Single-station manufacturing cells can be manned or automated. They are used for processing and assembly operations. They can be designed for production situations in which all parts or products are identical, for batch production where different part styles are made in batches, or for production in which different parts are made sequentially, not in batches.

This chapter describes the features and operations of single-station manufacturing cells. Figure 14.1 shows one possible classification scheme. Two analysis issues related to single-station cells are also examined: (1) how many workstations are needed to satisfy production requirements and (2) how many machines can be assigned to one worker in a machine cluster? A *machine cluster* is a collection of two or more identical or similar machines that are serviced by one worker.

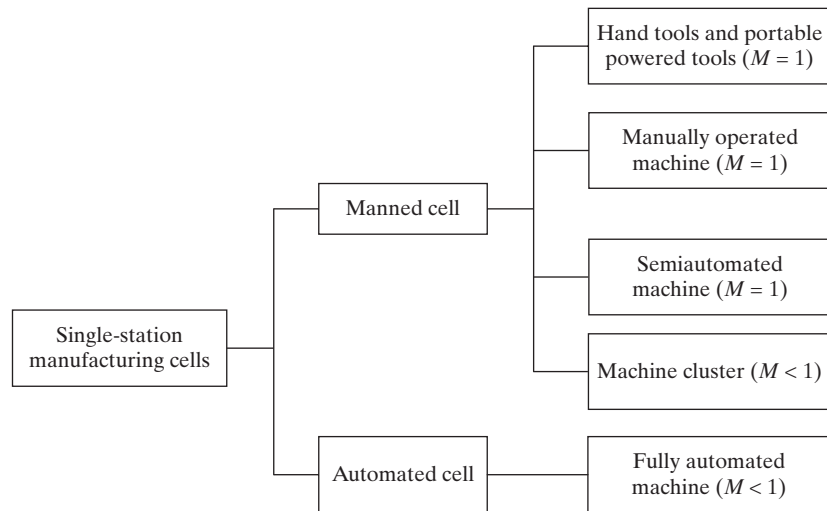


Figure 14.1 Classification scheme for single-station manufacturing cells, including typical manning levels (M).

14.1 SINGLE-STATION MANNED CELLS

The single-station manned cell, the standard model for which is one machine tended by one worker, is probably the most widely used production method today. It dominates job shop production and batch production, and it is not uncommon even in high production. There are many reasons for its widespread adoption.

- It requires the shortest amount of time to implement. The user company can quickly launch production of a new part or product using one or more manual workstations, while it plans and designs a more automated production method.
- It usually requires the least capital investment among alternative manufacturing systems.
- Technologically, it is the easiest system to install and operate, and its maintenance requirements are usually minimal.
- For many situations, particularly for low quantities of production, it results in the lowest cost per unit produced.
- In general, it is the most flexible manufacturing system with regard to changeovers from one part or product style to the next.

In a one-machine/one-worker station, the machine is manually operated or semiautomated. In a manually operated station, the operator controls the machine and loads and unloads the work. A typical processing example is a worker operating a standard machine tool such as an engine lathe, drill press, or forge hammer. The work cycle requires the attention of the worker either continuously or for most of the cycle (e.g., the operator might relax temporarily during the cycle when the feed is engaged on a lathe or drill press).

In a semiautomated station, the machine is controlled by some form of program, such as a part program that controls a CNC machine tool during a portion of the work cycle, and the worker's function is to load and unload the machine each cycle and periodically change

cutting tools. In this case, the worker's attendance at the station is required every work cycle, although the worker's attention may not be continuously occupied throughout the cycle.

There are several alternatives to the standard model of one-machine/one-worker. First, the single-station manned cell includes the case of a worker using hand tools (e.g., screwdriver and wrench in mechanical assembly) or portable powered tools (e.g., powered handheld drill, soldering iron, or arc welding gun). Some manual inspection tasks also fall into this category. The key factor is that the worker performs the task at one location (one workstation) in the factory.

A second alternative is when two or more workers are needed full time to operate the machine or accomplish the task at the workplace. Examples include:

- Two workers required to manipulate heavy forgings in a forge press
- A welder and fitter working in an arc-welding operation
- Multiple workers combining their efforts to assemble one large piece of machinery at a single assembly station.

A third variation from the standard case is when there is a principal production machine, plus other equipment in the station that supports the principal machine. The other equipment is clearly subordinate to the main machine. Examples of clearly subordinate equipment include:

- Drying equipment used to dry the plastic molding compound prior to molding in a manually operated injection molding machine
- A grinder used at an injection molding machine to grind the sprues and runners from plastic moldings for recycling
- Trimming shears used in conjunction with a forge hammer to trim flash from the forgings.

Finally, there are situations in which the portion of the work cycle when the worker is busy is much less than the portion of the cycle taken by the machine. When this occurs, it may be feasible to assign more than one machine to the worker. This is the case referred to as a machine cluster in the chapter introduction. It is described more completely in Section 14.4.2.

14.2 SINGLE-STATION AUTOMATED CELLS

The single-station automated cell consists of a fully automated machine capable of unattended operation for a time period longer than one machine cycle. A worker is not required to be at the machine except periodically to load and unload parts or otherwise tend it. Advantages of this system include the following:

- Labor cost is reduced compared to the single-station manned cell.
- Among automated manufacturing systems, the single-station automated cell is the easiest and least expensive system to implement.
- Production rates are usually higher than for a comparable manned machine.
- It often represents the first step toward implementing an integrated multistation automated system. The user company can install and debug the single automated machines individually, and subsequently integrate them (1) electronically by means of a supervisory computer system and/or (2) physically by means of an

automated material handling system. Recall the automation migration strategy from Section 1.4.3.

The issue of supporting equipment arises in single-station automated cells, just as it does in manned single-station cells. Examples of supporting equipment in automated cells include:

- A fully automated injection-molding machine that uses drying equipment for the plastic molding compound. The drying equipment clearly plays a supporting role to the molding machine.
- A robot loading and unloading an automated production machine. The production machine is the principal machine in the cell, and the robot plays a supporting role.
- CNC lathe with chip conveyor to remove chips from the cutting area. The chip conveyor is the supporting equipment.
- Bowl feeders and other parts feeding devices used to deliver components in a single-robot assembly cell. In this case, the assembly robot is the principal production machine in the cell, and the parts feeders are supporting.

14.2.1 Enablers for Unattended Cell Operation

A key feature of a single-station automated cell is its capability to operate unattended for extended periods of time. The enablers that provide this capability differ depending on whether the system is designed to produce identical work units (no product variety) or different work units (soft product variety).

Enablers for Unattended Production of Identical Work Units. The technical attributes required for unattended operation of automated cells designed for identical parts or products are the following:

- *Programmed cycle* that allows the machine to perform every step of the processing or assembly cycle automatically.
- *Parts-storage system* and a supply of parts that permit continuous operation beyond one machine cycle. The storage system must be capable of holding both raw work parts and completed work units, so two storage units are sometimes required, one for the starting work parts and the second for the completed parts.
- *Automatic transfer of work parts* between the storage system and the machine (automatic unloading of finished parts from the machine and loading of raw work parts to the machine). This transfer is a step in the regular work cycle. The parts-storage system and automatic transfer of parts are discussed in more detail in Section 14.2.2.
- *Periodic attention of a worker* who resupplies raw work parts, takes away finished parts, changes tools as they wear out (depending on the process), and performs other machine tending functions that are necessary for the particular processing or assembly operation.
- *Built-in safeguards* that protect the system against operating conditions that may be (1) unsafe to workers, (2) self-destructive, or (3) destructive to the work units being processed or assembled. Some of these safeguards may simply be in the form of very high process and equipment reliability. In other cases, the cell must be furnished with the capability for error detection and recovery (Section 4.2.3).

Enablers for Unattended Production of Different Work Units. The preceding list of technical attributes also applies to cells designed for product variety. Additional enablers are also required for these cells:

- *Work identification system* that can distinguish between the different starting work units entering the station, so that the correct processing sequence can be used for that part or product style. This may take the form of sensors that recognize the features of the work unit, or it may consist of automatic identification methods (Chapter 12). In some cases, identical starting work units are subjected to different processing operations according to a specified production schedule. If the starting units are identical, a work part identification system is unnecessary.
- *Program downloading capability* to transfer the machine cycle program corresponding to the identified part or product style. This assumes that programs have been prepared in advance for all part styles, and that these programs are stored in the machine control unit or that the control unit has access to them.
- *Quick setup changeover capability* so that the necessary work-holding devices and other tools for each part are available on demand.

The same enablers described here are also required for the unattended operation of workstations in multistation flexible manufacturing systems (Chapter 19).

14.2.2 Parts Storage and Automatic Parts Transfer

The parts-storage system and automatic transfer of parts between the storage system and the processing station are necessary attributes of an automated cell that operates unattended for extended periods of time. The storage system has a parts-storage capacity n_{pc} . Accordingly, the cell can theoretically operate unattended for a length of time given by

$$UT = \sum_{j=1}^{n_{pc}} T_{cj} \quad (14.1)$$

where UT = unattended time of operation of the manufacturing cell, min; T_{cj} = cycle time for part j that is held in the parts-storage system, for $j = 1, 2, \dots, n_{pc}$, and n_{pc} = number of parts that can be stored, pc. This equation assumes that one work unit is processed each cycle. If all of the parts are identical and require the same machine cycle, then the equation simplifies to the following:

$$UT = n_{pc} T_c \quad (14.2)$$

In reality, the unattended time of operation will be somewhat less than this amount (by one or more cycle times), because the worker needs time to unload the finished pieces and load starting work units into the storage system.

Capacities of parts-storage systems range from one part to hundreds. As Equation (14.2) indicates, the time of unattended operation increases directly with storage capacity, so the storage system should be designed with sufficient capacity to satisfy some objective of the plant. Among the possible objectives are the following:

- To provide enough time to allow a worker to tend multiple machines
- To provide a time interval equal to the time between scheduled tool changes, so tooling can be changed during the same machine downtime required for changing parts
- To provide a time interval equal to one complete shift

- To achieve overnight operation, sometimes referred to as *lights-out operation*; that is, to keep the machines running when no workers are in the plant during the middle and/or night shifts.

Storage Capacity of One Part. The minimum storage capacity of a parts-storage system is one work part. In machining, this case is represented by a two-position *automatic pallet changer* (APC), which is used to exchange pallet fixtures between the machine tool worktable and the manually operated load/unload position. The work parts are clamped and located on the pallet fixtures, so that when the pallet fixture is accurately positioned in front of the spindle, the part itself is accurately located for processing. Figure 14.2 shows an APC set up for manual unloading and loading of parts.

When the storage capacity is only one part, this usually means that the worker must be in attendance at the machine full time. While the machine is processing one work part, the worker is unloading the piece just finished and loading the next work part to be processed. This is an improvement over no storage capacity, in which case the processing machine is not being utilized during unloading and loading. If T_m = machine processing time and T_s = worker service time (to perform unloading and loading), then the overall cycle time of the single station with no storage is

$$T_c = T_m + T_s \quad (14.3)$$

By contrast, the overall cycle time for a single station with one part storage capacity, as in Figure 14.2, is

$$T_c = \text{Max}\{T_m, T_s\} + T_r \quad (14.4)$$

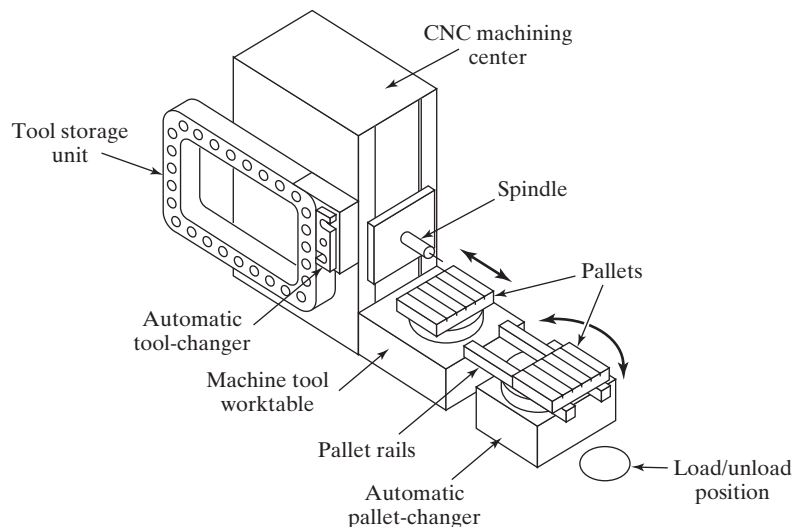


Figure 14.2 Automatic pallet changer integrated with a CNC horizontal machining center (HMC) with manual unloading and loading of work parts. At the completion of the machining cycle, the pallet currently at the spindle is moved onto the automatic pallet changer (APC), and the APC table is rotated 180° to move the other pallet into position for transfer to the machine tool worktable. The HMC is shown here without its safety enclosure.

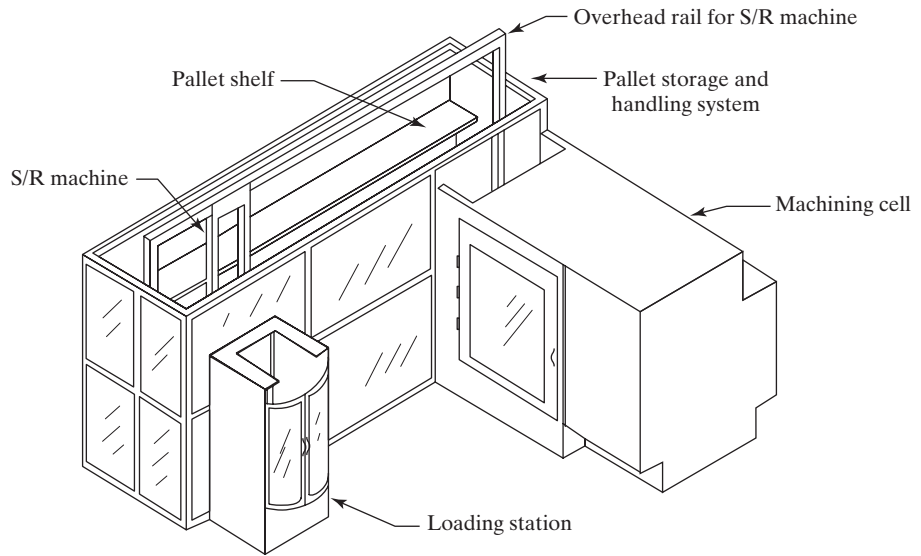


Figure 14.3 Single-station machining cell integrated with an automated pallet storage and handling system. Key: S/R machine = storage retrieval machine.

where T_r = the repositioning time to move the completed part away from the processing head and move the raw work part into position in front of the work head. In most instances, the worker service time is less than the machine processing time, and machine utilization is high. If $T_s > T_m$, the machine experiences forced idle time during each work cycle, and this is undesirable. Methods analysis should be applied to reduce T_s so that $T_s < T_m$.

Storage Capacities Greater than One. Larger storage capacities allow unattended operation, as long as loading and unloading the parts can be accomplished in a reasonable time. Figure 14.3 depicts a single-station machining cell interfaced with an automated pallet storage and handling system. Parts are stored on pallet fixtures and transferred by a dedicated storage/retrieval machine (Section 11.3.1) to the machine tool for processing (e.g., CNC machining center, Section 14.2.3). A commercially available system of this type is called the Flexible Pallet Container (FPC), built by Fastems [9]. The FPC can be designed for various storage capacities and can be connected to a variety of machine tool types.

Figure 14.4 shows several possible designs of parts-storage systems for CNC machining centers. The parts-storage unit is interfaced with an automatic pallet changer, shuttle cart, or other mechanism that is interfaced directly with the machine tool. Comparable arrangements are available for turning centers, in which an industrial robot is commonly used to perform loading and unloading between the machine tool and the parts-storage system. Pallet fixtures are not employed; instead, the robot uses a specially designed dual gripper (Section 8.3.1) to handle the raw parts and finished parts during the unloading/loading portion of the work cycle.

In processes other than machining, various techniques are used for parts storage. In some cases, the starting material is not a discrete work part, as illustrated by the following examples:

- *Sheet metal stamping.* In sheet metal pressworking, automated operation of the press is accomplished using a starting sheet metal coil, whose length is enough for

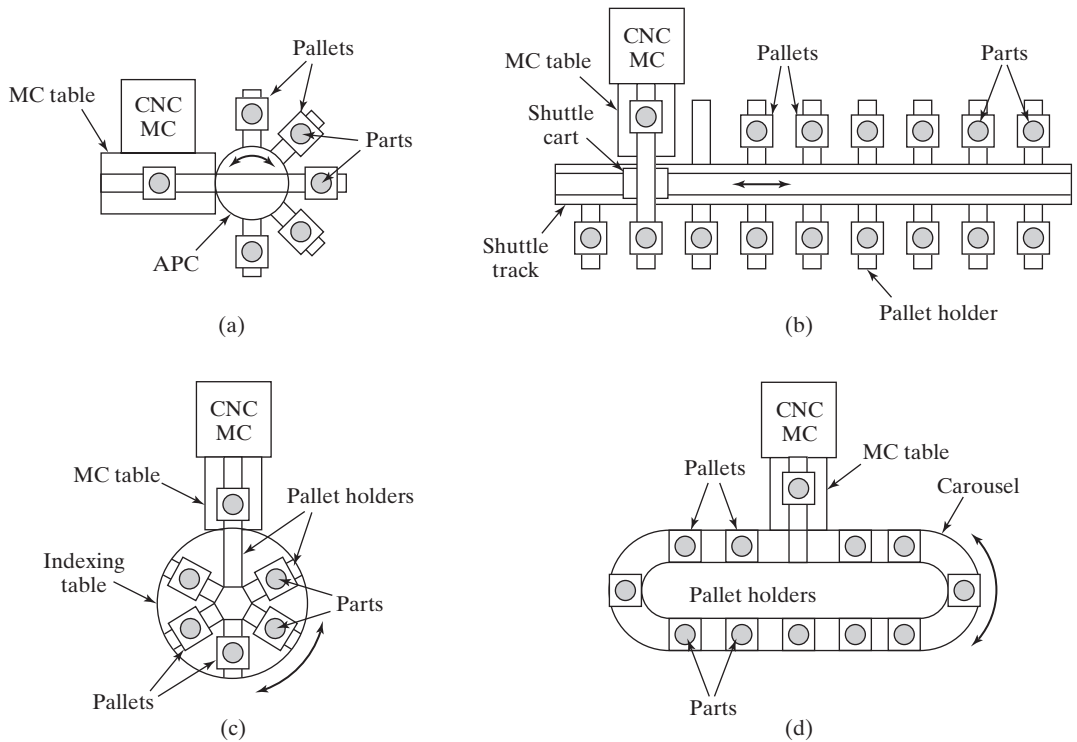


Figure 14.4 Alternative designs of parts-storage systems that might be used with CNC machining centers: (a) automatic pallet changer with pallet holders arranged radially, parts-storage capacity = 5; (b), in-line shuttle cart system with pallet holders along its length, parts-storage capacity = 16; (c) pallets held on indexing table, parts-storage capacity = 6; and (d) parts-storage carousel, parts-storage capacity = 12.

hundreds or even thousands of stampings. Periodic attention is required by a worker to change the starting coil and remove the completed stampings.

- *Plastic injection molding.* The starting molding compound is in the form of small pellets that are loaded into a hopper above the heating barrel of the molding machine. The hopper contains enough material for hundreds of molded parts. The molded parts are stored temporarily in a container beneath the mold. A worker periodically attends the machine by loading plastic into the hopper and collecting the molded parts.

In single-station automated cells for assembly, parts storage must be provided for each component as well as the assembled product. Various parts-storage and delivery systems are discussed in Chapter 17 on automated assembly.

14.2.3 CNC Machining Centers and Related Machine Tools

Many single-station automated cells are designed around computer-numerical control machine tools. This section discusses four important categories of these automated machines: (1) machining centers, (2) turning centers, (3) mill-turn centers, and (4) multitasking machines. The objective behind all of these automated machines is to reduce the number of separate workstations and corresponding setups by which a workpiece is processed to

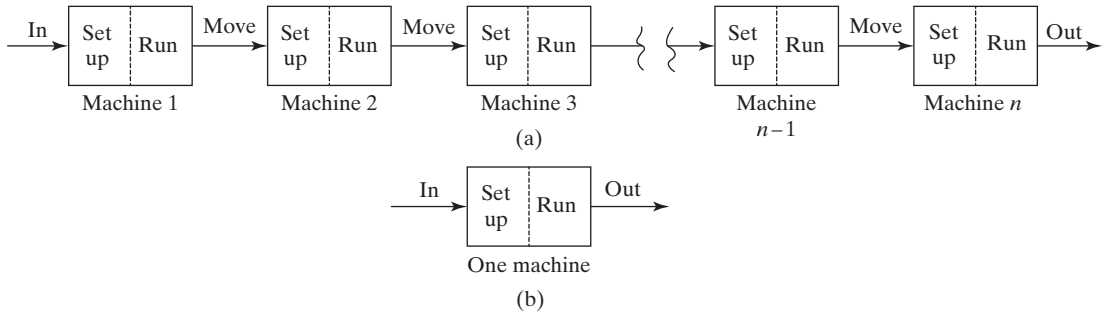


Figure 14.5 The objective of machining centers and related machine tools is to reduce the number of separate machines and setups required to process a given part as in (a) to as few as possible, ideally a single machine and setup as in (b).

as few as possible, ideally one machine and one setup (Strategy 2: Combined operations, Section 1.4.2). The objective is depicted in Figure 14.5.

In addition to their application in automated cells, these machines can also be used in a semiautomated mode. Whether it operates with a worker in attendance or as an automated single station depends on the existence of the enablers discussed in Section 14.2.1. The machine tools discussed here can also be used in flexible manufacturing cells and systems (Chapter 19).

Machining Centers. This type of machine was briefly discussed in Section 7.4.1. A machining center, developed in the late 1950s, is a machine tool capable of performing multiple machining operations on a work part in one setup under NC program control. Today's machining centers are CNC with control of four or five axes. Typical cutting operations performed on a machining center use a rotating cutting tool for operations such as milling, drilling, reaming, and tapping.

Machining centers are classified as vertical, horizontal, or universal. The designation refers to the orientation of the machine spindle. A vertical machining center has its spindle on a vertical axis relative to the worktable, and a horizontal machining center has its spindle on a horizontal axis. This distinction generally results in a difference in the type of work that is performed on the machine. A vertical machining center (VMC) is typically used for flat work that requires tool access from the top. Examples include mold and die cavities, and large components of aircraft. A horizontal machining center (HMC) is used for cube-shaped parts where tool access can best be achieved on the sides of the cube. A universal machining center (UMC) has a work head that swivels its spindle axis to any angle between horizontal and vertical, making this a very flexible machine tool. Airfoil shapes and other curvilinear geometries often require the capabilities of a UMC.

Numerical control machining centers are designed with features to reduce nonproductive time. Typical features include:

- *Automatic tool-changer.* A variety of machining operations means that a variety of cutting tools is required. The tools are contained in a tool storage unit that is integrated with the machine tool. When a cutter needs to be changed, the tool drum rotates to the proper position, and an automatic tool changer (ATC), operating under part program control, exchanges the tool in the spindle for the tool in the tool storage unit. Capacities of the tool storage unit commonly range from 16 to 80 cutting tools.

- *Automatic work part positioner.* Many horizontal and universal machining centers have the capability to orient the work part relative to the spindle. This is accomplished by means of a rotary table on which the part is fixtured. The table can be oriented at any angle about a vertical axis to permit the cutting tool to access almost the entire surface of the part in a single setup.
- *Automatic pallet changer.* Machining centers are often equipped with two (or more) separate pallets that can be presented to the cutting tool using an automatic pallet changer (Section 14.2.2). While machining is being performed with one pallet in position at the machine, the other pallet is in a safe location away from the spindle. In this safe location, the operator can unload the finished part from the prior cycle and then fixture the raw work part for the next cycle.

A numerically controlled horizontal machining center, with many of the features described earlier, is shown in Figure 14.2. Machining centers are used by the automotive industry for high-volume production of transmission components, engine blocks, and engine heads [5].

Turning Centers. The success of NC machining centers motivated the development of NC turning centers. The basic CNC turning center, depicted in Figure 14.6, is capable of performing various turning and related operations, contour turning, drilling, and automatic tool indexing, all under 2-axis computer control (Figure 7.2(b)). The use of multiple cutting tools is enabled by one or more tool turrets, each turret holding typically six to 12 tools for turning and drilling. More advanced turning centers feature opposing dual spindles and chucking systems that allow work parts to be passed from one to the other so that both ends can be machined in one setup, thus reducing cycle times.¹

Other advanced features of turning centers include (1) work part gaging (checking key dimensions after machining), (2) tool monitoring (sensing when the tools are worn),

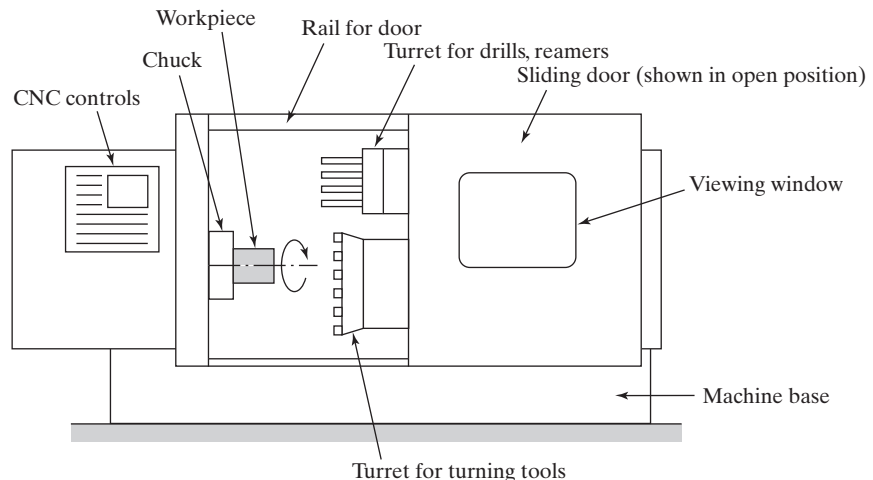


Figure 14.6 Front view of CNC turning center showing two tool turrets, one for single point turning tools and the other for drills and similar tools. Turrets are positioned by CNC.

¹A single spindle does not allow for cutting the portion of the part that is gripped in the chuck without removing and reversing the direction of the part.

(3) automatic tool changing of worn tools, and (4) automatic part changing at the completion of the work cycle.

Mill-Turn Centers. The limitation of the basic turning center, as it is described earlier, is that it can only perform turning-type operations and drilling along the rotational axis of the part. In addition to the traditional x - and z -axes of CNC lathes and turning centers, the mill-turn center provides the capability to orient a cylindrical work part at a specified angle about its axis of rotation and use a rotating cutter to machine features into the outside surface of the part, as illustrated in Figure 14.7. Orientation of the workpiece defines a third axis, called the C -axis, while manipulation of the rotational tool with respect to the work provides one or two more axes: y -axis and B -axis. The y -axis is perpendicular to the x - and z -axes and is used for off-center drilling and milling. The B -axis is rotation about the y -axis and increases the versatility of the drilling and milling capability. As in the turning center, tool turrets are used to hold cutting tools, but in this case one or more of the turrets have spindles with rotational capability for milling, drilling, tapping, and other rotating-tool operations. A conventional CNC turning center does not have the capability to stop the rotation of the work part at a defined angular position, and it does not possess rotating tool spindles.

The mill-turn center has the general configuration of a turning center and is generally limited to smaller-diameter parts that would normally be associated with a horizontal lathe.

Multitasking Machines. The trend in the machine tool industry is in the direction of designing machines that perform all required machining operations in one setup, continuing the advances in machining centers, turning centers, and mill-turn centers. The term *multitasking machine* is frequently used in reference to mill-turn centers because they perform both milling and turning operations. By contrast, machining centers emphasize milling and turning centers emphasize turning. But multitasking machine also refers to machine tools whose configuration is that of a machining center, but whose capabilities include all three of the basic machining operations: turning, milling, and drilling. They may also be designed

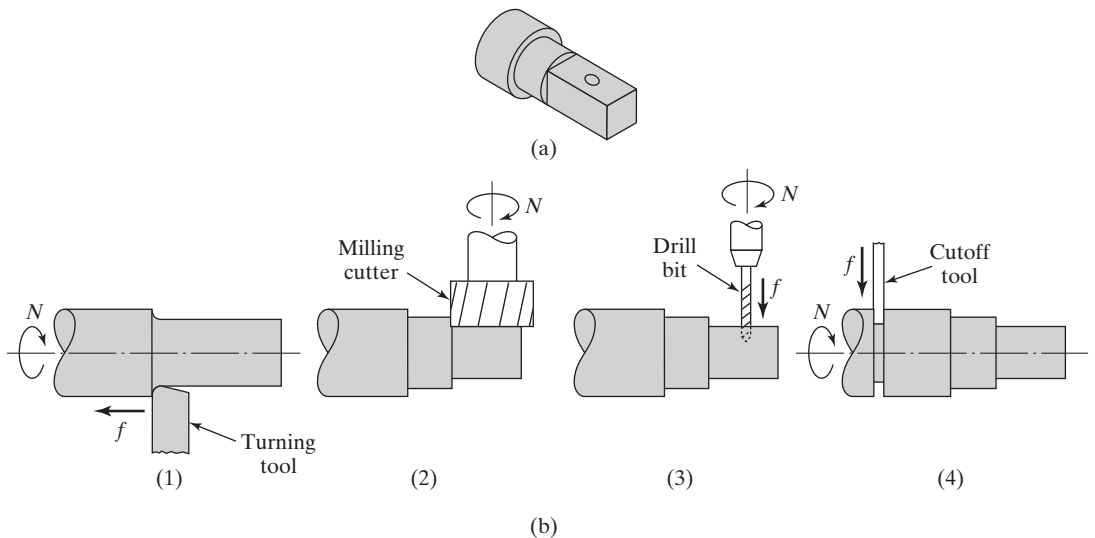


Figure 14.7 Operation of a mill-turn center: (a) example part with turned, milled, and drilled surfaces; and (b) sequence of cutting operations: (1) turn smaller diameter; (2) mill flat with part in programmed angular position, four positions for square cross section; (3) drill hole with part in programmed angular position, and (4) cut off the machined piece.

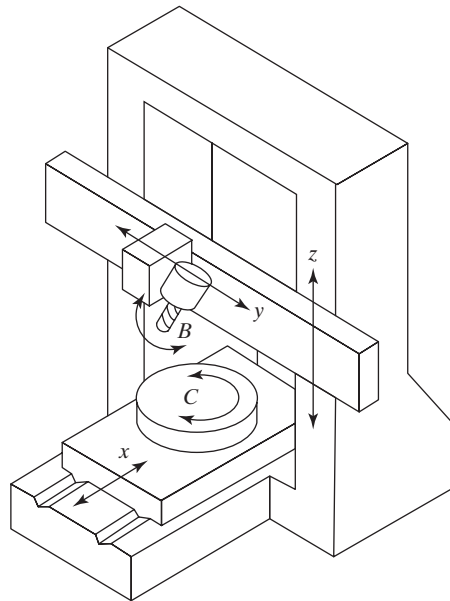


Figure 14.8 One possible design of a multitasking machine with 5-axis control.

to perform other operations such as tapping, gear cutting, and grinding. One possible design is illustrated in Figure 14.8, suggested in [7]. The worktable provides control of the x - and C -axes; that is, the table to which the workpiece attaches translates for positioning and milling, and it rotates for turning. Shown in this gantry design is the motion control of the y -, z -, and B -axes. This type of machine design that is similar to a machining center permits the processing of larger and irregularly shaped parts than is possible on a turning center.

Advantages of this new class of highly versatile machines, compared to more conventional CNC machine tools, include (1) fewer setups, (2) reduced part handling, (3) increased accuracy and repeatability because the parts utilize the same fixture throughout their processing, and (4) faster delivery of parts in small lot sizes. The availability of computer-aided manufacturing software for part programming, simulation, and selection of cutting conditions has become an essential prerequisite for successful implementation of these technologically advanced machines [1].

14.3 APPLICATIONS OF SINGLE-STATION CELLS

Single-station cells are abundant. Most industrial production operations are based on the use of single-station manned and automated cells. The examples in Sections 14.1 and 14.2 illustrate the variety possible. Some additional applications are listed in Table 14.1, which is compiled to show how manned cells (left column) might be converted into automated cells (right column).

14.4 ANALYSIS OF SINGLE-STATION CELLS

Two analysis issues related to single-station manufacturing cells are determining (1) how many single stations are required to satisfy production requirements and (2) how many machines should be assigned to a worker in a machine cluster?

TABLE 14.1 Examples of Single-Station Manned and Automated Cells.

Single-Station Manned Cell	Single-Station Automated Cell
CNC machining center producing identical parts. The machine executes a part program for each part. A worker must be at the machine at the end of each work cycle to unload the part just completed and load the next part onto the machine table.	CNC machining center with pallet storage and handling system, as in Figure 14.3. Parts are identical, and machining is controlled by a part program. Each part is held on a pallet fixture and automatically transferred to the machine. Loading and unloading the storage system can be done off-line (while the machine is operating).
CNC machining center producing a variety of parts. The machine operator must call the appropriate part program and load it into the machine control unit for each consecutive work part.	CNC machining center producing a variety of parts. The appropriate part program is automatically downloaded to the CNC control unit for each consecutive part, based on an automatic part recognition system that identifies the raw part. The cell includes a parts-storage system.
Cluster of two CNC turning centers, each producing the same part but operating independently from its own machine control unit. One worker loads and unloads both machines. The part programs are long enough relative to the load/unload portion of the work cycle that the worker can service both machines with no machine idle time.	Cluster of six CNC turning centers, each producing a different part. Each machine has its own parts-storage system and robotic arm for loading and unloading parts. One worker attends all six machines by periodically unloading and loading the storage units. All six machines can be serviced by the worker with no machine idle time.
Plastic injection-molding machine on semiautomatic cycle, with a worker present to remove the molding and runner system at the end of each molding cycle, and to place parts in a container. Another worker must periodically exchange the container and resupply molding compound to the machine.	Plastic injection-molding machine on automatic cycle, with a mechanical arm to ensure removal of the molding and runner system each molding cycle. Parts are collected in a container beneath the mold. A worker must periodically exchange the container and resupply molding compound to the machine.
Electronics assembly workstation where a worker places components onto printed circuit boards in a batch operation. The worker must periodically delay production to replace the components stored in tote bins. Starting and finished boards are stored in shelves that must be periodically replaced by another worker.	Automated placement machine assembling electronic components onto printed circuit boards in a batch operation. Starting boards and finished boards are stored in shelves for periodic replacement by a human worker, who must also periodically replace the supply of components stored in the magazines.
Assembly workstation where a worker performs mechanical assembly of a subassembly of a product from components located in tote bins at the station.	Robotic assembly cell consisting of one robot that assembles a subassembly of a product from components presented by several parts delivery systems (e.g., bowl feeders, Chapter 17).
Stamping press that punches and forms sheet metal parts from flat blanks in a stack near the press. A worker loads the blank into the press, actuates the press, and then removes the stamping each cycle. Completed stampings are stored in four-wheel trucks that have been specially designed for the part. Cycle time is about 20 sec, most of it in part handling.	Stamping press that punches and forms sheet metal parts from a long coil, as depicted in Figure 14.9. The press operates at a rate of 10 cycles/min, and 1,000 parts can be stamped from each coil. Stampings are collected in a tote box next to the press. When the coil runs out, it must be replaced with a new coil, and the tote box is replaced at the same time.

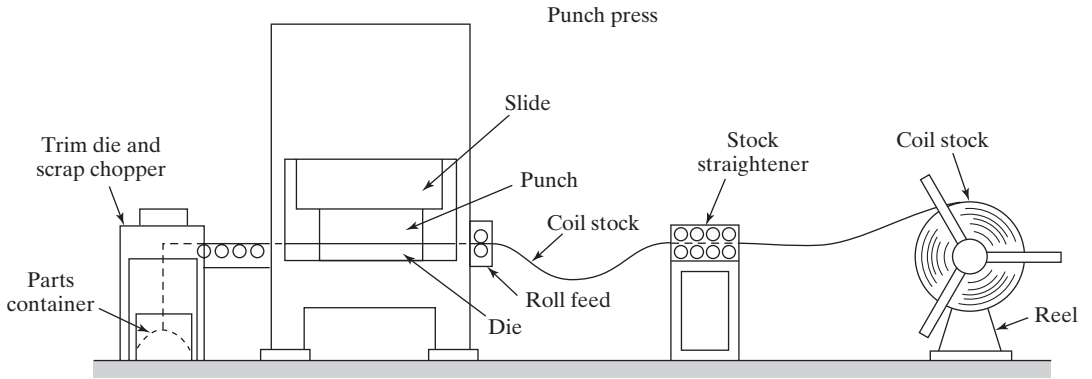


Figure 14.9 Stamping press on automatic cycle producing stampings from a sheet metal coil.

14.4.1 Number of Workstations Required

Any manufacturing system must be designed to produce a specified quantity of parts or products at a specified production rate. In the case of single-station cells, this may mean that more than one work cell is required to achieve the specifications. The problem is to determine the number of cells or workstations needed to produce a given quantity of work units within a specified time period. The basic approach is the following: (1) determine the total workload that must be accomplished in a certain period (hour, week, month, year), and then (2) divide the workload by the hours available on one cell in the same period. This can be reduced to the following equation:

$$n = \frac{WL}{AT} \tag{14.5}$$

where n = number of cells or workstations; WL = workload to be accomplished during the period of interest, hr/period; and AT = available time on one cell in the same period, hr/period/cell.

Workload is defined as the total hours required to produce a given quantity of work units scheduled during the period of interest. It is figured as the quantity of work units to be produced during the period multiplied by the time required for each work unit. The time required for each work unit is the cycle time on the machine, so in its simplest form, workload is given by the following:

$$WL = QT_c$$

where WL = workload scheduled for the period, hr of work/hr or hr of work/wk, etc.; Q = quantity to be produced during the period, pc/hr or pc/wk, etc.; and T_c = cycle time required per piece, hr/pc. If the workload includes multiple part or product styles that can all be produced on the same type of workstation, then

$$WL = \sum_j Q_j T_{cj}$$

where Q_j = quantity of part or product style j produced during the period, pc; T_{cj} = cycle time of part or product style j , hr/pc; and the summation includes all of the parts or products to be made during the period.

Additional factors that add to the workload include setup time and fraction defect rate. Setup time in batch production occurs between batches because the tooling and fixturing must be changed over from the current part style to the next part style, and the equipment controller must be reprogrammed. It is lost time because no parts are produced (except perhaps trial parts to check out the new setup and program). Yet it consumes available time at a workstation. Let TT_{su} = total setup time for all part styles included in the workload to be accomplished. In most situations,

$$TT_{su} = \sum_j T_{su_j}$$

where T_{su_j} = setup time for part or product style j produced during the period, hr.

Defect rate is the fraction of parts produced that are defective. The issue of fraction defect rate is discussed in more detail in Section 21.5. When the defect rate is greater than zero, it means that more parts must be processed in order to yield the desired quantity. If a process is known to produce parts at a certain average scrap rate, then the starting batch size is increased to compensate for the defective parts that will be made. The relationship between the starting quantity and the quantity produced is

$$Q_j = Q_{oj}(1 - q_j)$$

where Q_j = quantity of good units made in the process; Q_{oj} = original or starting quantity; and q_j = fraction defect rate. Thus, if Q_j good units are to be produced, then a total of Q_{oj} starting units must be processed:

$$Q_{oj} = \frac{Q_j}{(1 - q_j)}$$

Summarizing, the combined effect of setup time and fraction defect rate can be accounted for in the following workload equation:

$$WL = TT_{su} + \sum_j \frac{Q_j T_{cj}}{(1 - q_j)} \quad (14.6)$$

Available time is the amount of time during the period of interest that one work cell can devote to satisfying the workload requirement. Thus, during a 1-hr period, one work cell can devote 1 hr of productive time. During a 40-hr week, available time is 40 hr per work cell. Because most work cells are machine-based, the reliability of the machine must be factored into the available time of the work cell. Availability is the measure of reliability introduced in Section 3.1.1. It is the proportion of uptime on the equipment. Thus, equipment availability less than 100% reduces the available time on the machine. The available time per cell is the actual time in the period multiplied by availability:

$$AT = H_p A \quad (14.7)$$

where AT = available time per cell, hr/cell; H_p = actual hours during the period, hr/cell; and A = availability. Equations (14.6) and (14.7) become the numerator and denominator in Equation (14.5) to solve for the number of cells (production machines) to satisfy workload requirements. The following examples illustrate two different setup situations.

EXAMPLE 14.1 Number of Setups is Known

A total of 900 parts must be produced in the lathe section of the machine shop during a particular 40-hr week. The parts are of 20 different styles, and each style is produced in its own batch. Average batch quantity is 45 parts. Each batch requires a setup and the average setup time is 2.5 hr. The average machine cycle time to produce a shaft is 10 min. Availability on the lathes is 100%. How many lathes are required during the week?

Solution: In this case the number of setups required during the week is known because the number of batches is known: 20. Total workload for the 20 setups and 20 production runs is given by:

$$WL = 20(2.5) + 20(45)(10/60) = 50 + 150 = 200 \text{ hr}$$

Given that each lathe is available 40 hr/wk,

$$n = \frac{200}{40} = \mathbf{5 \text{ lathes}}$$

EXAMPLE 14.2 Number of Setups is Not Known

A total of 900 parts must be produced in the lathe section of the machine shop during a particular 40-hr week. The parts are identical. How many lathes will be needed to produce the 900 parts, given that each machine must be set up at the beginning of the week? Each setup takes 2.5 hr. Availability on the lathes is 100%.

Solution: This is similar to Example 14.1, but the number of setups is equal to the number of machines that will be required, and that number is not known, at least not yet. In this problem formulation, the number of hours available on any lathe is reduced by the setup time. The workload to actually produce the parts remains the same, 150 hr. Adding the setup workload,

$$WL = 150 + 2.5n$$

Now dividing by the available time of 40 hr per lathe,

$$n = \frac{150 + 2.5n}{40} = 3.75 + 0.0625n$$

Solving for n ,

$$n - 0.0625n = 0.9375n = 3.75$$

$$n = \mathbf{4 \text{ lathes}}$$

It may be appropriate to separate the two terms on the right-hand side in Equation (14.6) when dividing by the available time. This is because equipment reliability may not be the same during setup, when the machine is not running, as it is during production. The following example illustrates this situation.

EXAMPLE 14.3 Including Availability and Defect Rate

Suppose that in Example 14.1 the anticipated availability of the lathes is 100% during setup and 92% during the production run. The fraction defect rate for lathe work of this type is 5%. Other data from Example 14.1 are applicable. How many lathes are required during the week, given this additional information?

Solution: When there is a separation of tasks between two or more types of work (in this case, setup and run are two separate types of work), care must be exercised to use the various factors only where they are applicable. For example, availability and fraction defect rate do not apply during setup (how can the machine break down or produce defects if it's not running?). Accordingly, it is appropriate to compute the number of equivalent workstations for setup separately from the number for the production run.

For setup, the workload is simply the time spent performing the 20 setups:

$$WL = 20(2.5) = 50.0 \text{ hr}$$

The available hours during the week are $AT = 40$ hr/machine. Thus, the number of lathes required just for setup is determined as:

$$n_{su} = \frac{50}{40} = 1.25 \text{ lathes}$$

Given the fraction defect rate of 5%, the workload for the 20 production runs is computed:

$$WL = \frac{20(45)(10/60)}{(1 - 0.05)} = 157.9 \text{ hr}$$

The available time is affected by the 92% availability:

$$AT = 40(0.92) = 36.8 \text{ hr/machine}$$

$$n_{run} = \frac{157.9}{36.8} = 4.29 \text{ lathes}$$

Total machines required $n = 1.25 + 4.29 = 5.54$ rounded up to **6 lathes**

Comment: Note that the rounding up should occur after adding the machine fractions, not before; otherwise, there is a risk of overestimating machine requirements (as in this problem).



14.4.2 Machine Clusters

When a semiautomatic machine in a single-station cell does not require the continuous attention of a worker during its work cycle, an opportunity exists to assign more than one machine to the worker. The workstation still requires operator attention every cycle. However, the manning level of the workstation can be reduced from $M = 1$ to $M < 1$. This kind of machine organization is sometimes referred to as a “machine cell,” but the term *machine cluster* is used in this book. A **machine cluster** is defined here as a collection of two or more machines producing parts or products with identical cycle times and serviced (usually loaded and unloaded) by one worker. By contrast, a **machine cell** consists of one or more machines organized to produce a family of parts or products. Machine cells are covered in Chapters 18 and 19.

Several conditions must be satisfied in order to organize a collection of machines into a machine cluster: (1) the semiautomatic machine cycle is long relative to the service portion of the cycle that requires the worker’s attention; (2) the semiautomatic cycle time is the same for all machines; (3) the machines that the worker would service are located in close enough proximity to allow time to walk between them; and (4) the work rules of the plant permit a worker to service more than one machine.

Consider a collection of single workstations, all producing the same parts and operating on the same semiautomatic machine cycle time. Each machine operates for a certain portion of the total cycle under its own control T_m (machine time), and then it requires servicing by the worker, which takes T_s . Thus, assuming the worker is always available when servicing is needed, so that the machine is never idle, the total cycle time of a machine is $T_c = T_m + T_s$. If more than one machine is assigned to the worker, a certain amount of time will be lost while the worker walks from one machine to the next, referred to here as the repositioning time, T_r . The time required for the operator to service one machine is therefore $T_s + T_r$, and the time to service n machines is $n(T_s + T_r)$. For the system to be perfectly balanced in terms of worker time and machine cycle time,

$$n(T_s + T_r) = T_m + T_s$$

The number of machines that should be assigned to one worker is given by:

$$n = \frac{T_m + T_s}{T_s + T_r} \quad (14.8)$$

where n = number of machines; T_m = machine semiautomatic cycle time, min; T_s = worker service time per machine, min; and T_r = worker repositioning time between machines, min.

It is likely that the calculated value of n will not be an integer, which means that the worker time in the cycle, $n(T_s + T_r)$, cannot be perfectly balanced with the cycle time T_c of the machines. However, the actual number of machines in the manufacturing system must be an integer, so either the worker or the machines will experience idle time. The number of machines will either be the integer that is greater than n from Equation (14.8) or it will be the integer that is less than n . Let these two integers be identified as n_1 and n_2 . Cost factors can be included in the analysis to help decide which of the two alternatives is preferable. Let C_L = labor cost rate and C_m = machine cost rate. Certain overheads may be included in these rates (see Section 3.2.2). The decision will be based on the cost per work unit produced by the system.

Case 1: If $n_1 \leq n$ is used, then the worker will have idle time, and the cycle time of the machine cluster will be the cycle time of the machines $T_c = T_m + T_s$. Assuming one work unit is produced by each machine during a cycle,

$$C_{pc}(n_1) = \left(\frac{C_L}{n_1} + C_m \right) (T_m + T_s) \quad (14.9)$$

where $C_{pc}(n_1)$ = cost per work unit, \$/pc; C_L = labor cost rate, \$/min; C_m = cost rate per machine, \$/min; and $(T_m + T_s)$ is expressed in min.

Case 2: If $n_2 > n$ is used, then the machines will have idle time, and the cycle time of the machine cluster will be the time it takes for the worker to service the n_2 machines, which is $n_2(T_s + T_r)$. The corresponding cost per piece is given by

$$C_{pc}(n_2) = (C_L + C_m n_2)(T_s + T_r) \quad (14.10)$$

The selection of n_1 or n_2 is based on whichever case results in the lower cost per work unit.

In the absence of cost data needed to make these calculations, it is generally preferable to assign machines to a worker such that the worker has some idle time and the machines are utilized 100%. The reason for this is that the total hourly cost rate of n production machines is usually greater than the labor rate of one worker. Therefore, machine idle time costs more than worker idle time. The corresponding number of machines to assign the worker is therefore given by

$$n_1 = \text{Maximum Integer} \leq \frac{T_m + T_s}{T_s + T_r} \quad (14.11)$$

EXAMPLE 14.4 How Many Machines For One Worker?

A machine shop has many CNC lathes that operate on a semiautomatic cycle under part program control. A significant number of these machines produce the same part, with a machine cycle time = 2.75 min. One worker is required to perform unloading and loading of parts at the end of each cycle. This takes 25 sec. Determine how many machines one worker can service if it takes an average of 20 sec to walk between the machines and no machine idle time is allowed.

Solution: Given that $T_m = 2.75$ min, $T_s = 25$ sec = 0.4167 min, and $T_r = 20$ sec = 0.3333 min, Equation (14.11) can be used to obtain

$$n_1 = \text{Maximum Integer} \leq \left(\frac{2.75 + 0.4167}{0.4167 + 0.3333} = \frac{3.1667}{0.75} = 4.22 \right) = \mathbf{4 \text{ machines}}$$

Each worker can be assigned four machines. With a machine cycle $T_c = 3.1667$ min, the worker will spend $4(0.4167) = 1.667$ min servicing the machines, $4(0.3333) = 1.333$ min walking between the machines, and the worker's idle time during the cycle will be 0.167 min (10 sec).

Note the regularity that exists in the worker's schedule in this example. Imagine the four machines laid out on the four corners of a square, so that the worker services each machine and then proceeds clockwise to the machine in the next corner. Each cycle of servicing and walking takes 3.0 min, with a slack time of 10 sec left over for the worker.

If this kind of regularity characterizes the operation of a cluster of single-station automated cells, then the same kind of analysis can be applied to determine the number of cells to assign to one worker. If, on the other hand, servicing of each cell is required at random and unpredictable intervals, then there will be periods when several cells require servicing at the same time, overloading the capabilities of the human worker, while during other periods the worker will have no cells to service. Queuing analysis is appropriate in this case of random service requirements.

REFERENCES

- [1] ABRAMS, M., "Simply Complex," *Mechanical Engineering*, January 2006, pp. 28–31.
- [2] ARONSON, R., "Multitalented Machine Tools," *Manufacturing Engineering*, January 2005, pp. 65–75.
- [3] DROZDA, T. J., and Wick, C., Editors, *Tool and Manufacturing Engineers Handbook*, 4th ed., *Volume I: Machining*, Society of Manufacturing Engineers, Dearborn, MI, 1983.
- [4] LORINCZ, J., "Multitasking Machining," *Manufacturing Engineering*, February 2006, pp. 45–54.
- [5] LORINCZ, J., "Just Say VMC," *Manufacturing Engineering*, June 2006, pp. 61–67.
- [6] LORINCZ, J., "Machines Evolve in One Setup Processing," *Manufacturing Engineering*, September 2012, pp 69–79.
- [7] NAGAE, A., T. MURAKI, and H. YAMAMOTO, "History and Current Situation of Multi-Tasking Machine Tools," *Journal of SME-Japan* (on-line), 2013.
- [8] WAURZYNIAK, P., "Programming for MTM," *Manufacturing Engineering*, April 2005, pp. 83–91.
- [9] www.fastems.com
- [10] www.haascnc.com
- [11] www.makino.com
- [12] www.mazakusa.com

REVIEW QUESTIONS

- 14.1** Name three reasons why single-station manned cells are so widely used in industry.
- 14.2** What does the term *semiautomated station* mean?
- 14.3** What is a single-station automated cell?
- 14.4** What are the five enablers that are required for unattended operation of automated cells designed to produce identical parts or products?

- 14.5 What are the additional three enablers that are required for unattended operation of automated cells designed for product variety?
- 14.6 What is an automatic pallet changer?
- 14.7 What is a machining center?
- 14.8 What is the difference between a horizontal machining center and a vertical machining center?
- 14.9 What are some of the features of a NC machining center used to reduce nonproductive time in the work cycle?
- 14.10 What is the difference between a turning center and a mill-turn center?
- 14.11 What is a machine cluster?

PROBLEMS

Answers to problems labeled (A) are listed in the appendix.

Parts Storage and Multitasking Machines

- 14.1 (A) A CNC machining center has a programmed cycle time of 25.0 min for a certain part. The time to unload the finished part and load a starting work unit = 5.0 min. (a) If loading and unloading are done directly onto the machine tool table and no automatic storage capacity exists at the machine, what are the cycle time and hourly production rate? (b) If the machine tool has an automatic pallet changer so that unloading and loading can be accomplished while the machine is cutting another part, and the repositioning time = 30 sec, what are the total cycle time and hourly production rate? (c) If the machine tool has an automatic pallet changer that interfaces with a parts storage unit whose capacity is 12 parts, and the repositioning time = 30 sec, what are the total cycle time and hourly production rate? Also, how long does it take to perform the loading and unloading of the 12 parts by the human worker, and what is the time the machine can operate unattended between parts changes?
- 14.2 A machine shop operates one 8-hr shift, five days per week. Each part processed on a CNC machine tool of interest has a programmed cycle time of 37 min. At the end of each programmed cycle, a worker unloads and loads the machine which takes 5 min. Thus the total work cycle time is 42 min, and the worker is idle most of that cycle. The plant manager needs to increase output and is considering three alternatives: (1) install an automatic pallet changer (APC) that would have a repositioning time of 30 sec, which would increase output slightly, (2) purchase a second machine, with no APC, which would double output, or (3) purchase an automated pallet storage and handling system with a storage capacity that is sufficient to allow the machine to operate overnight (two shifts), which would approximately triple the output. The repositioning time between the storage system and the CNC machine is 30 sec. The worker would unload and load the storage system at the beginning of the day shift and then be assigned other work until later in the shift when it would be time to load the storage system for overnight operation. Unloading and loading of the APC in (1) and the storage system in (3) take the same 6.0 min per cycle because both involve pallets. Determine (a) the output per week for each of the three alternatives, (b) the storage capacity of the storage system in alternative (3) that would achieve overnight operation, and (c) the amount of time the worker would be kept busy each day unloading and loading the storage system.
- 14.3 A batch of 35 parts is ordered by a customer about every six months. The parts are currently processed sequentially through five conventional machines, listed in the following

table with setup times and work cycle times per piece. These machines all require an operator to be in attendance during the work cycle. There is a delay of 10 hr/machine due to transport between machines and waiting in queues of other parts processed by these machines. A recommendation has been made to process the parts on a new multitasking machine that would complete the batch in one setup, which would involve a simple fixture and a setup time of 2.0 hr. The work cycle on the multitasking machine consists of the same operations that are accomplished by the five machines, but the cycle time would be less than the sum of the five cycle times by one-half because of tool path improvements and reduced part handling. Determine the manufacturing lead time (how long it takes to complete the batch of 35 parts, including delays) for processing on (a) the five conventional machines and (b) the multitasking machine. Assume that a delay of 10 hr would occur for the multitasking machine due to other work on that machine.

Machine	Setup Time	Work Cycle Time
Engine lathe	2.5 hr	15 min
Horizontal mill	1.25 hr	27 min
Vertical mill	1.5 hr	12 min
Drill press	30 min	7 min
Drill press	45 min	9 min

Determining Workstation Requirements

- 14.4 (A)** A total of 9,000 stampings must be produced in the press department during the next three days. Manually operated presses (one operator per press) will be used to complete the job and the cycle time is 24 sec. Each press must be set up with a punch-and-die set before production starts. Setup time is 2.0 hr, and availability is assumed to be 100%. How many presses and operators must be devoted to this production during the three days, if there are 7.5 hr of available time per machine per day?
- 14.5** A stamping plant must supply an automotive final assembly plant with sheet metal stampings. The plant operates one 8-hr shift for 250 days/yr and must produce 5,000,000 good quality stampings annually. Batch size = 8,000 good stampings produced per batch. Scrap rate = 3%. On average it takes 4.0 sec to produce each stamping when the presses are running. Before each batch, the press must be set up, and that takes 2.5 hr per setup. Availability of the presses is 96% during production and 100% during setup. (a) How many stamping presses will be required to accomplish the specified production? (b) What is the proportion of time spent in setup for each batch?
- 14.6** A new forging plant must supply parts to a construction equipment manufacturer. Forging is a hot operation, so the plant will operate 24 hr/day, five days/wk, 50 wk/yr. Total output from the plant must be 800,000 forgings per year in batches of 1,250 parts per batch. Anticipated scrap rate = 3%. Each forging cell will consist of a furnace to heat the parts, a forging press, and a trim press. Parts are placed in the furnace an hour prior to forging; they are then removed, forged, and trimmed one at a time. The complete cycle takes 1.5 min per part. Each time a new batch is started, the forging cell must be changed over, which consists of changing the forging and trimming dies for the next part style. This takes 3.5 hr on average. Each cell is considered to be 96% reliable (availability = 96%) during operation and 100% reliable during changeover. (a) Determine the number of forging cells that would be required in the new plant. (b) What is the proportion of time spent in setup for each batch?
- 14.7 (A)** A plastic-injection molding plant will be built to produce 4,000,000 molded parts/yr. The plant will run three 8-hr shifts per day, five days/wk, 52 wk/yr. For planning purposes, the average batch size = 5,000 moldings, average changeover time between batches = 5 hr,

and average molding cycle time per part = 22 sec. Assume Scrap rate = 2%, and availability for each molding machine = 97%, which applies to both run time and changeover time. (a) How many molding machines are required in the new plant? (b) What is the time required to produce each batch?

- 14.8** A plastic extrusion plant will be built to produce 30 million meters of plastic extrusions per year. The plant will run three 8-hr shifts per day, 360 days/yr. For planning purposes, the average run length = 7,500 meters of extruded plastic. The average changeover time between runs = 3.5 hr, and average extrusion speed = 15m/min. Assume scrap rate = 1%, and average uptime proportion per extrusion machine = 95% during run time and 100% during changeover. If each extrusion machine requires a floor area of 2 m by 25 m, and there is an allowance of 40% for aisles and office space, what is the total area of the extrusion plant?
- 14.9** Future production requirements in a machine shop call for several automatic bar machines to be added to produce three new parts (A, B, and C). Annual quantities and cycle times for the three parts are given in the table below. The machine shop operates one 8-hr shift for 250 days/yr. The machines are expected to be 95% reliable, and the scrap rate is 3%. How many automatic bar machines will be required to meet the specified annual demand for the three new parts? Assume setup times are negligible.

Part	Annual Demand	Machining Cycle Time
A	25,000	5.0 min
B	40,000	7.0 min
C	10,000	10.0 min

- 14.10** A certain type of machine will be used to produce three products: A, B, and C. Sales forecasts for these products are 52,000, 65,000, and 70,000 units/yr, respectively. Production rates for the three products are, respectively, 12, 15, and 10/hr; and scrap rates are, respectively, 5%, 7%, and 9%. The plant will operate 50 wk/yr, 10 shifts/wk, and 8 hr/shift. It is anticipated that production machines of this type will be down for repairs on average 10% of the time. How many machines will be required to meet demand? Assume setup times are negligible.
- 14.11** An emergency situation has arisen in the milling department, because the ship carrying a certain quantity of a required part from an overseas supplier sank on Friday evening. A certain number of machines in the department must therefore be dedicated to the production of this part during the next week. A total of 1,000 of these parts must be produced, and the production cycle time per part = 16.0 min. Each milling machine used for this rush job must first be set up, which takes 5.0 hr. A scrap rate of 2% can be expected. Assume availability = 100%. (a) If the production week consists of 10 shifts at 8.0 hr/shift, how many machines will be required? (b) If it so happens that only two milling machines can be spared for this emergency job, due to other priority jobs in the department. To cope with the emergency situation, plant management has authorized a three-shift operation for six days next week. Can the 1,000 replacement parts be completed within these constraints?
- 14.12** A machine shop has one CNC vertical machining center (VMC) to produce two parts (A and B) used in the company's main product. The VMC is equipped with an automatic pallet changer (APC) and a parts storage system that holds 10 parts. One thousand units of the product are produced/yr, and one of each part is used in the product. Part A has a machining cycle time of 50 min. Part B has a machining cycle time of 80 min. These cycle times include the operation of the APC. No changeover time is lost between parts. The anticipated scrap rate is zero. The machining center is 95% reliable. The machine shop operates 250 days/yr. How many hours must the CNC machining center operate each day to supply parts for the product?

Machine Clusters

- 14.13 (A)** The CNC grinding section has a large number of machines devoted to grinding shafts for the automotive industry. The grinding cycle takes 3.6 min and produces one part. At the end of each cycle, an operator must be present to unload and load parts, which takes 40 sec. (a) Determine how many grinding machines the worker can service if it takes 20 sec to walk between the machines and no machine idle time is allowed. (b) How many seconds during the work cycle is the worker idle? (c) What is the hourly production rate of this machine cluster?
- 14.14** A worker is currently responsible for tending two machines in a machine cluster. The service time per machine is 0.35 min and the time to walk between machines is 0.15 min. The machine automatic cycle time is 1.90 min. If the worker's hourly rate = \$12/hr and the hourly rate for each machine = \$18/hr, determine (a) the current hourly rate for the cluster, and (b) the current cost per unit of product, given that two units are produced by each machine during each machine cycle. (c) What is the percent idle time of the worker? (d) What is the optimum number of machines that should be used in the machine cluster, if minimum cost per unit of product is the decision criterion?
- 14.15** In a machine cluster, the appropriate number of production machines to assign to the worker is to be determined. Let n = the number of machines. Each production machine is identical and has an automatic processing time $T_m = 4.0$ min. The servicing time $T_s = 12$ sec for each machine. The full cycle time for each machine in the cell is $T_c = T_s + T_m$. The repositioning time for the worker is given by $T_r = 5 + 3n$, where T_r is in sec. T_r increases with n because the distance between machines increases with more machines. (a) Determine the maximum number of machines in the cell if no machine idle time is allowed. For your answer, compute (b) the cycle time and (c) the worker idle time expressed as a percent of the cycle time?
- 14.16** An industrial robot will service n production machines in a machine cluster. All production machines are identical and have the same processing time of 130 sec. The robot servicing and repositioning time for each machine is given by the equation $(T_s + T_r) = 15 + 4n$, where T_s is the servicing time (sec), T_r is the repositioning time (sec), and n = number of machines that the robot services. $(T_s + T_r)$ increases with n because more time is needed to reposition the robot as n increases. The full cycle time for each machine in the cell is $T_c = T_s + T_m$. (a) Determine the maximum number of machines in the cell such that machines are not kept waiting. For your answer, (b) what is the machine cycle time, and (c) what is the robot idle time expressed as a percent of the cycle time T_c ?
- 14.17** A factory production department consists of a large number of work cells. Each cell consists of one human worker performing electronics assembly tasks. The cells are organized into sections within the department, and one foreman supervises each section. It is desired to know how many work cells should be assigned to each foreman. The foreman's job consists of two tasks: (1) provide each cell with a sufficient supply of parts that it can work for 4.0 hr before it needs to be resupplied and (2) prepare production reports for each work cell. Task (1) takes 18.0 min on average per work cell and must be done twice per day. The foreman must schedule the resupply of parts to every cell so that no idle time occurs in any cell. Task (2) takes 9.0 min per work cell and must be done once per day. Neither the workers nor the foreman are allowed to work more than 8.0 hr/day. Each day, the cells continue production from where they stopped the day before. (a) What is the maximum number of work cells that should be assigned to a foreman, on the condition that the work cells must never be idle? (b) With the number of work cells from part (a), how many idle minutes does the foreman have each day?

Chapter 15

Manual Assembly Lines

CHAPTER CONTENTS

- 15.1 Fundamentals of Manual Assembly Lines
 - 15.1.1 Assembly Workstations
 - 15.1.2 Work Transport Systems
 - 15.1.3 Line Pacing
 - 15.1.4 Coping with Product Variety
- 15.2 Analysis of Single-Model Assembly Lines
 - 15.2.1 Cycle Time and Workload Analysis
 - 15.2.2 Repositioning Losses
 - 15.2.3 The Line Balancing Problem
- 15.3 Line Balancing Algorithms
 - 15.3.1 Largest Candidate Rule
 - 15.3.2 Kilbridge and Wester Method
 - 15.3.3 Ranked Positional Weights Method
- 15.4 Workstation Details
- 15.5 Other Considerations in Assembly Line Design
- 15.6 Alternative Assembly Systems
- Appendix 15A: Batch-Model and Mixed-Model Lines
 - 15A.1 Batch-Model Assembly Lines
 - 15A.2 Mixed-Model Assembly Lines

Most manufactured consumer products are assembled. Each product consists of multiple components joined together by various assembly processes. These kinds of products are

usually made on a manual assembly line. Factors favoring the use of manual assembly lines include the following:

- Demand for the product is high or medium
- The products made on the line are identical or similar
- The total work required to assemble the product can be divided into small work elements
- It is technologically impossible or economically infeasible to automate the assembly operations.

A list of products characterized by these factors that are usually made on a manual assembly line are presented in Table 15.1.

There are several reasons why manual assembly lines are so productive compared to alternative methods in which multiple workers each perform all of the tasks to assemble the products.

- *Specialization of labor.* Called “division of labor” by Adam Smith (Historical Note 15.1), this principle asserts that when a large job is divided into small tasks and each task is assigned to one worker, the worker becomes highly proficient at performing the single task. Each worker becomes a specialist.
- *Interchangeable parts,* in which each component is manufactured to sufficiently close tolerances that any part of a certain type can be selected for assembly with its mating component. Without interchangeable parts, assembly would require filing and fitting of mating components, rendering assembly line methods impractical.
- *Work flow principle,* which involves moving the work to the worker rather than vice versa. Each work unit flows smoothly through the production line, traveling the minimum distance between stations.
- *Line pacing.* Workers on an assembly line are usually required to complete their assigned tasks on each work unit within a certain cycle time, which paces the line to maintain a specified production rate. Pacing is generally implemented by means of a mechanized conveyor.

In the present chapter, the engineering and technology of manual assembly lines are discussed. Automated assembly systems are covered in Chapter 17.

TABLE 15.1 Products Usually Made on Manual Assembly Lines

Audio equipment	Electric motors	Pumps
Automobiles	Furniture	Refrigerators
Cameras	Lamps	Stoves
Cell phones and smart phones	Luggage	Tablet computers
Cooking ranges	Microwave ovens	Telephones
Dishwashers	Personal computers and peripherals (keyboards, printers, monitors, etc.)	Toasters and toaster ovens
Dryers (laundry)		Trucks, light and heavy
DVD players		Video game consoles
E-Book readers	Power tools (drills, saws, etc.)	Washing machines (laundry)

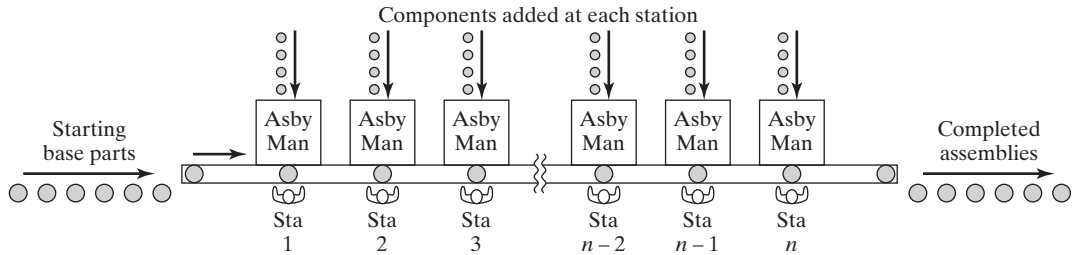


Figure 15.1 Configuration of a manual assembly line. Key: Asby = assembly, Man = manual, Sta = workstation, n = number of stations on the line.

15.1 FUNDAMENTALS OF MANUAL ASSEMBLY LINES

A **manual assembly line** is a production line that consists of a sequence of workstations where assembly tasks are performed by human workers, as depicted in Figure 15.1. Products are assembled as they move along the line. At each station, a worker performs a portion of the total work on the unit. The common practice is to “launch” base parts onto the beginning of the line at regular intervals. Each base part travels through successive stations and workers add components that progressively build the product. A mechanized material transport system is typically used to move the base parts along the line as they are gradually transformed into final products. The production rate of an assembly line is determined by its slowest station. Stations capable of working faster are ultimately limited by the slowest station.

Manual assembly line technology has made a significant contribution to the development of American industry in the 20th century, as indicated in Historical Note 15.1. It remains an important production system throughout the world in the manufacture of automobiles, consumer appliances, and other assembled products listed in Table 15.1.

Historical Note 15.1 Origins of the Manual Assembly Line

Manual assembly lines are based largely on two fundamental work principles. The first is *division of labor*, proposed by Adam Smith (1723–1790) in his book *The Wealth of Nations*, which was published in England in 1776. Using a pin factory to illustrate the division of labor, the book describes how 10 workers, each specializing in the various distinct tasks required to make a pin, produced 48,000 pins per day. This was compared to conventional production, in which each worker performed all of the tasks on each pin, and produced only a few pins per day. Smith did not invent division of labor; there had been other examples of its use in Europe for centuries, but he was the first to note its significance in production.

The second work principle is *interchangeable parts*, based on the efforts of Eli Whitney (1765–1825) and others at the beginning of the 19th century [15]. The origins of the interchangeable parts principle were previously described in Historical Note 1.1. Without interchangeable parts, assembly line technology would not be possible.

The origins of modern production lines can be traced to the meat industry in Chicago, Illinois, and Cincinnati, Ohio. In the mid and late 1800s, meat packing plants used unpowered overhead conveyors to move the slaughtered stock from one worker to the next. These unpowered conveyors were later replaced by power-driven chain conveyors to create

“disassembly lines,” which were the predecessor of the assembly line. The work organization permitted each meat cutter to concentrate on a single task (division of labor).

American automotive industrialist Henry Ford had observed these meat packing operations. In 1913, he and his engineering colleagues designed an assembly line in Highland Park, Michigan, to produce magneto flywheels. Productivity increased fourfold. Flushed by success, Ford applied assembly line techniques to chassis fabrication. The use of chain-driven conveyors and workstations arranged for the convenience and comfort of his assembly line workers increased productivity by a factor of eight, compared to previous single-station assembly methods. These and other improvements resulted in dramatic reductions in the price of the Model T Ford, which was the main product of the Ford Motor Company at the time. Masses of Americans could now afford an automobile because of Ford’s achievement in cost reduction. This stimulated further development and use of production line techniques, including automated transfer lines. It also forced Ford’s competitors and suppliers to imitate his methods, and the manual assembly line became intrinsic to American industry.

15.1.1 Assembly Workstations

A workstation on a manual assembly line is a designated location along the work flow path at which one or more work elements are performed by one or more workers. The work elements represent small portions of the total work that must be accomplished to assemble the product. Typical assembly operations performed at stations on a manual assembly line are listed in Table 15.2. A given workstation also includes the tools (hand tools or powered tools) required to perform the task assigned to the station.

Some workstations are designed for workers to stand, while others allow the workers to sit. When the workers stand, they can move about the station area to perform their assigned task. This is common for assembly of large products such as cars, trucks, and major appliances. The product is typically moved by a conveyor at constant velocity through the station. The worker begins the assembly task near the upstream side of the station and moves along with the work unit until the task is completed, then walks back to the next work unit and repeats the cycle. For smaller assembled products (such as small appliances, electronic devices, and subassemblies used on larger products), the workstations are usually designed to allow the workers to sit while they perform their tasks. This is more comfortable and less fatiguing for the workers and is generally more conducive to precision and accuracy in the assembly task. Additional details related to assembly line workstations are discussed in Section 15.4.

TABLE 15.2 Typical Assembly Operations Performed on a Manual Assembly Line

Application of adhesive	Expansion fitting applications	Snap fitting of two parts
Application of sealant	Insertion of components	Soldering
Arc welding	Press fitting	Spot welding
Brazing	Printed circuit board assembly	Stapling
Cotter pin applications	Riveting and eyelet applications	Stitching
Crimping	Shrink fitting applications	Threaded fastener applications

15.1.2 Work Transport Systems

There are two basic ways to accomplish the movement of work units along a manual assembly line: (1) manually or (2) by a mechanized system. Both methods provide the fixed routing (all work units proceed through the same sequence of stations) that is characteristic of production lines.

Manual Methods of Work Transport. In manual work transport, the units of product are passed from station to station by the workers themselves. Two problems result from this mode of operation: starving and blocking. **Starving** is the situation in which the assembly operator has completed the assigned task on the current work unit, but the next unit has not yet arrived at the station. The worker is thus starved for work. **Blocking** means that the operator has completed the assigned task on the current work unit but cannot pass the unit to the downstream station because that worker is not yet ready to receive it. The operator is therefore blocked from working.

To mitigate the effects of these problems, storage buffers are sometimes used between stations. In some cases, the work units made at each station are collected in batches and then moved to the next station. In other cases, work units are moved individually along a flat table or nonpowered conveyor. When the task is finished at each station, the worker simply pushes the unit toward the downstream station. Space is often allowed for one or more work units in front of each workstation. This provides an available supply of work for the station, as well as room for completed units from the upstream station. Hence, starving and blocking are minimized. The trouble with this method of operation is that it can result in significant work-in-process, which is economically undesirable. Also, workers are unpaced in lines that rely on manual transport methods, and production rates tend to be lower.

Mechanized Work Transport. Powered conveyors and other types of mechanized material handling equipment are widely used to move units along manual assembly lines. These systems can be designed to provide paced or unpaced operation of the line. Three major categories of work transport systems in production lines are (a) continuous transport, (b) synchronous transport, and (c) asynchronous transport. These are illustrated schematically in Figure 15.2. Table 15.3 identifies some of the material transport equipment commonly associated with each of these categories.

A **continuous transport system** uses a continuously moving conveyor that operates at constant velocity, as in Figure 15.2(a). This method is common on manual assembly lines. The conveyor usually runs the entire length of the line. However, if the line is very long, such as the case of an automobile final assembly plant, it is divided into segments with a separate conveyor for each segment.

Continuous transport can be implemented in two ways: (1) work units are fixed to the conveyor, and (2) work units are removable from the conveyor. In the first case, the product is large and heavy (e.g., automobile, washing machine) and cannot be removed from the conveyor. The worker must therefore walk along with the product at the speed of the conveyor in order to accomplish the assigned task.

In the case where work units are small and lightweight, they can be removed from the conveyor for the physical convenience of the operator at each station. Another convenience for the worker is that the assigned task at the station does not need to be completed within a fixed cycle time. Each worker has flexibility to deal with technical problems that may be encountered with a particular work unit. However, on average, each worker must maintain a production rate equal to that of the rest of the line. Otherwise, the line produces incomplete units, which occurs when parts that were supposed to be added at a station are not added because the worker ran out of time.

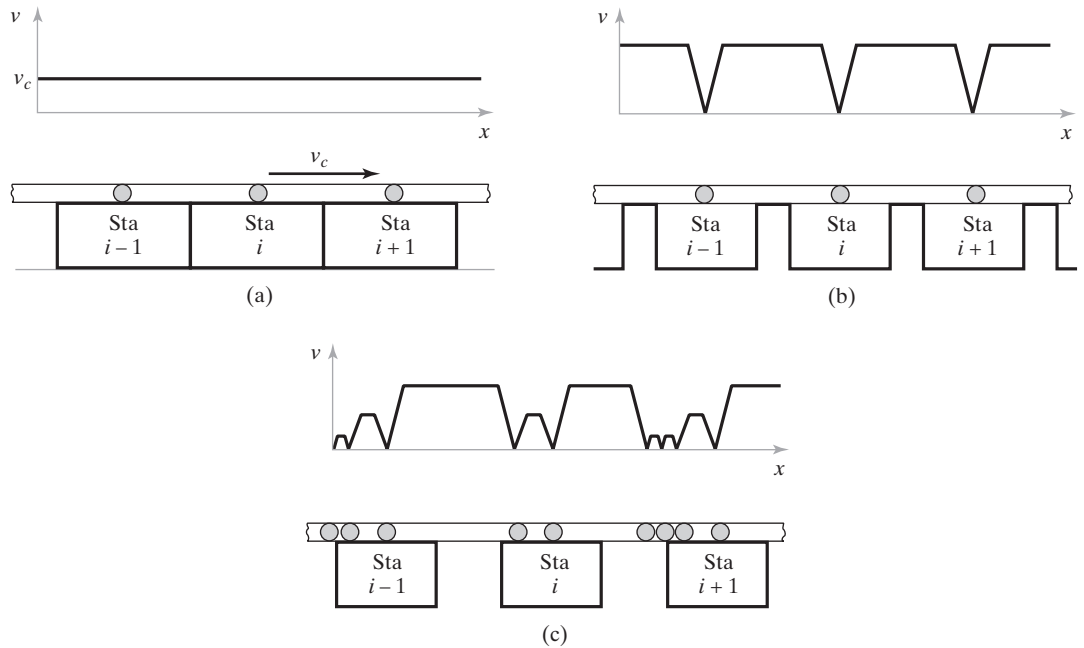


Figure 15.2 Velocity–distance diagram and physical layout for three types of mechanized transport systems used in production lines: (a) continuous transport, (b) synchronous transport, and (c) asynchronous transport. Key: v = velocity, v_c = constant velocity of continuous transport conveyor, x = distance in conveyor direction, Sta = workstation, i = workstation identifier.

TABLE 15.3 Material Handling Equipment Used to Obtain the Three Types of Fixed Routing Work Transport Depicted in Figure 15.2

Work Transport System	Material Handling Equipment (Text Reference)
Continuous transport	Overhead trolley conveyor (Section 10.2.4)
	Belt conveyor (Section 10.2.4)
	Roller conveyor (Section 10.2.4)
	Drag chain conveyor (Section 10.2.4)
Synchronous transport	Walking beam transport equipment (Section 16.1.1)
	Rotary indexing mechanisms (Section 16.1.1)
Asynchronous transport	Power-and-free overhead conveyor (Section 10.2.4)
	Cart-on-track conveyor (Section 10.2.4)
	Powered roller conveyors (Section 10.2.4)
	Automated guided vehicle system (Section 10.2.2)
	Monorail systems (Section 10.2.3)
	Chain-driven or belt-driven systems (Section 16.1.1)

In *synchronous transport* systems, all work units are moved simultaneously between stations with a quick, discontinuous motion, and then positioned at their respective stations. Depicted in Figure 15.2(b), this type of system is also known as *intermittent transport*, which describes the motion experienced by the work units. Synchronous transport

is not common for manual lines, due to the requirement that the task must be completed within a certain time limit. This can cause undue stress on the assembly workers and result in incomplete products. Despite its disadvantages for manual assembly lines, synchronous transport is often ideal for automated production lines, in which mechanized workstations operate on a constant cycle time.

In an *asynchronous transport* system, a work unit leaves a given station when the assigned task has been completed and the worker releases the unit. Work units move independently, rather than synchronously. At any moment, some units are moving between workstations while others are positioned at stations, as in Figure 15.2(c). With asynchronous transport systems, small queues of work units are permitted to form in front of each station. This system tends to be forgiving of variations in worker task times.

15.1.3 Line Pacing

A manual assembly line operates at a certain cycle time that is established to achieve the required production rate of the line. The calculation of this cycle time is explained in Section 15.2. On average each worker must complete the assigned task at his/her station within the cycle time, or else the required production rate will not be achieved. This pacing of the workers is one of the reasons why a manual assembly line is successful. Pacing provides a discipline for the assembly line workers that more or less guarantees a certain production rate. From the viewpoint of management, this is desirable.

Manual assembly lines can be designed with three alternative levels of pacing: (1) rigid pacing, (2) pacing with margin, and (3) no pacing. In rigid pacing, each worker is allowed only a certain fixed time each cycle to complete the assigned task. The allowed time is implemented by a synchronous work transport system and is (usually) equal to the cycle time of the line. Rigid pacing has two undesirable aspects, as mentioned earlier. First, rigid pacing is emotionally and physically stressful to human workers. Although some level of stress is conducive to improved human performance, fast pacing on an assembly line throughout an 8-hr shift (or longer) can have harmful effects on workers. Second, in a rigidly paced operation, if the task has not been completed within the fixed cycle time, the work unit exits the station incomplete. This may inhibit completion of subsequent tasks at downstream stations. Whatever tasks are left undone on the work unit at the regular workstations must later be completed by some other worker in order to yield an acceptable product.

In pacing with margin, the worker is allowed to complete the task at the station within a specified time range. The maximum time of the range is longer than the cycle time, so that a worker is permitted to take more time if a problem occurs or if the task time required for a particular work unit is longer than the average (this occurs when different product styles are produced on the same assembly line). There are several ways in which pacing with margin can be achieved: (1) allowing queues of work units to form between stations, (2) designing the line so that the time a work unit spends inside each station is longer than the cycle time, and (3) allowing the worker to move beyond the boundaries of his/her own station. In method (1), implemented using an asynchronous transport system, work units are allowed to form queues in front of each station, thus guaranteeing that the workers are never starved for work, but also providing extra time for some work units as long as other units take less time. Method (2) applies to lines in which work units are fixed to a continuously moving conveyor and cannot be removed. Because the conveyor speed is constant, when the station length is longer than the distance needed by the worker to

complete the assigned task, the time spent by the work unit inside the station boundaries (called the *tolerance time*) is longer than the cycle time. In method (3), the worker is simply allowed to either move upstream beyond the immediate station to get an early start on the next work unit or move downstream past the current station boundary to finish the task on the current work unit. In either case, there are usually practical limits on how far the worker can move upstream or downstream, making this a case of pacing with margin. The terms *upstream allowance* and *downstream allowance* are sometimes used to designate these limits in movement. In all of these methods, as long as the worker maintains an average pace that matches the cycle time, the required cycle rate of the line is achieved.

The third level of pacing is when there is no pacing, meaning that no time limit exists within which the task at the station must be finished. In effect, each assembly operator works at his/her own pace. This case can occur when (1) manual work transport is used on the line, (2) work units can be removed from the conveyor, allowing the worker to take as much time as desired to complete a given unit, or (3) an asynchronous conveyor is used and the worker controls the release of each work unit from the station. In each of these cases, there is no mechanical means of achieving a pacing discipline on the line. To reach the required production rate, the workers are motivated to achieve a certain pace either by their own collective work ethic or by an incentive system sponsored by the company.

15.1.4 Coping with Product Variety

Owing to the versatility of human workers, manual assembly lines can be designed to deal with differences in assembled products. In general, the product variety must be relatively soft (Section 2.3). Three types of assembly line can be distinguished: (1) single model, (2) batch model, and (3) mixed model.

A ***single-model line*** produces only one product in large quantities. Every work unit is identical, so the task performed at each station is the same for all products. This line type is intended for products with high demand.

Batch-model and mixed-model lines are designed to produce two or more products or models, but different approaches are used to cope with the model variations. A ***batch-model line*** produces each product in batches. Workstations are set up to produce the required quantity of the first product, then the stations are reconfigured to produce the next product, and so on. Products are often assembled in batches when demand for each product is medium. It is generally more economical to use one assembly line to produce several products in batches than to build a separate line for each different model.

Setting up the workstations refers to the assignment of tasks to each station on the line, including any special tools needed to perform the tasks, and the physical layout of the station. The products made on the line are usually similar, and the tasks to make them are therefore similar. However, differences exist among models so that a different sequence of tasks is usually required, and the tools used at a given workstation for the last model might not be the same as those required for the next model. One model may take more total time than another, requiring the line to be operated at a slower pace. Worker retraining or new equipment may be needed to produce each new model. For these kinds of reasons, changes in the station setup must be made before production of the next model can begin. These changeovers result in lost production time on a batch-model line.

A ***mixed-model line*** also produces more than one model; however, the models are not produced in batches; instead, they are made simultaneously on the same line. While one station is working on one model, the next station is processing a different model. Each

Hard variety	Batch-model line
Soft variety	Mixed-model line
No variety	Single-model line
Product variety	Type of assembly line

Figure 15.3 Three types of manual assembly line related to product variety.

station is equipped to perform the variety of tasks needed to produce any model that moves through it. Final assembly of many consumer products are accomplished on mixed-model lines. Examples are automobiles and major appliances, which are characterized by model variations, differences in available options, and even brand name differences in some cases.

Advantages of a mixed-model line over a batch-model line include (1) no lost production time changing over between models, (2) avoidance of the high inventories typical of batch production, and (3) the ability to alter production rates of different models as product demand changes. On the other hand, the problem of assigning tasks to workstations so that they all share an equal workload is more complex on a mixed-model line. Scheduling (determining the sequence of models) and logistics (getting the right parts to each workstation for the model currently at that station) are more difficult in this type of line. And in general, a batch-model line can accommodate wider variations in model configurations.

As a summary of this discussion, Figure 15.3 indicates the position of each of the three assembly line types on a scale of product variety.

15.2 ANALYSIS OF SINGLE-MODEL ASSEMBLY LINES

The relationships developed in this and the following sections are applicable to single-model assembly lines. With a little modification, the same relationships apply to batch-model lines. Mixed-model assembly lines are covered in the appendix to this chapter.

15.2.1 Cycle Time and Workload Analysis

The assembly line must be designed to achieve a production rate, R_p , sufficient to satisfy demand for the product. Product demand is often expressed as an annual quantity, which can be reduced to an hourly rate. Management must decide on the number of shifts per week that the line will operate and the number of hours per shift. Assuming the plant operates 50 weeks per year, the required hourly production rate is given by

$$R_p = \frac{D_a}{50S_wH_{sh}} \quad (15.1)$$

where R_p = average hourly production rate, units/hr; D_a = annual demand for the single product to be made on the line, units/yr; S_w = number of shifts/wk; and H_{sh} = hr/shift. If the line operates 52 weeks rather than 50, then $R_p = D_a/52S_wH_{sh}$. If a time period other than a year is used for product demand, then the equation can be adjusted by using consistent time units in the numerator and denominator.

This production rate must be converted to a cycle time T_c , which is the time interval at which the line will be operated. The cycle time must take into account the reality that some production time will be lost due to occasional equipment failures, power outages, lack of a certain component needed in assembly, quality problems, labor problems, and other reasons. As a consequence of these losses, the line will be up and operating only a certain proportion of time out of the total shift time available; this uptime proportion is referred to as the *line efficiency*.¹ The cycle time can be determined as

$$T_c = \frac{60E}{R_p} \quad (15.2)$$

where T_c = cycle time of the line, min/cycle; R_p = required production rate, as determined from Equation (15.1), units per hour; the constant 60 converts the hourly production rate to a cycle time in minutes; and E = line efficiency. Typical values of E for a manual assembly line are in the range 0.90–0.98. The cycle time T_c establishes the ideal cycle rate for the line

$$R_c = \frac{60}{T_c} \quad (15.3)$$

where R_c = cycle rate for the line, cycles/hr; and T_c is min/cycle as in Equation (15.2). This rate R_c must be greater than the required production rate R_p because the line efficiency E is less than 100%. Line efficiency E is therefore defined as

$$E = \frac{R_p}{R_c} = \frac{T_c}{T_p} \quad (15.4)$$

where T_p = average production cycle time ($T_p = 60/R_p$).

An assembled product requires a certain total amount of time to build. This is the **work content time** (T_{wc}), which is the total time of all work elements that must be performed on the line to make one unit of product. It represents the total amount of work that is to be accomplished on the product by the assembly line. It is useful to compute a theoretical minimum number of workers that will be required on the assembly line to produce a product with known T_{wc} and specified production rate R_p . The approach is basically the same used in Section 14.4.1 to compute the number of workstations required to achieve a specified production workload. Equation (14.5) in that section can be used to determine the number of workers on a production line:

$$w = \frac{WL}{AT} \quad (15.5)$$

where w = number of workers on the line; WL = workload to be accomplished in a given time period, min/hr; and AT = available time per worker during the period, min/hr/worker. The time period of interest will be 60 min. The workload in that period is the hourly production rate multiplied by the work content time of the product, that is,

$$WL = R_p T_{wc} \quad (15.6)$$

where R_p = production rate, pc/hr; and T_{wc} = work content time, min/pc.

¹Line efficiency is basically the same as availability, defined in Section 3.1.1. *Availability* is the more general reliability term; *line efficiency* is the term associated with production lines.

Equation (15.2) can be rearranged to the form $R_p = 60E/T_c$. Substituting this into Equation (15.6),

$$WL = \frac{60ET_{wc}}{T_c}$$

Available time $AT =$ one hour (60 min) multiplied by the proportion uptime on the line; that is,

$$AT = 60E$$

Substituting these terms for WL and AT into Equation (15.5), the equation reduces to the ratio T_{wc}/T_c . Because the number of workers must be an integer,

$$w^* = \text{Minimum Integer} \geq \frac{T_{wc}}{T_c} \quad (15.7)$$

where $w^* =$ theoretical minimum number of workers. If each workstation has one worker, then this ratio also gives the theoretical minimum number of stations on the line.

Achieving this minimum theoretical value in practice is very unlikely. Equation (15.7) ignores two critical factors that exist in real assembly lines and tend to increase the number of workers above the theoretical minimum:

- *Repositioning losses.* Some time will be lost at each station for repositioning of the work unit or the worker. Thus, the time available per worker to perform assembly is less than T_c .
- *The line balancing problem.* It is virtually impossible to divide the work content time evenly among all workstations. Some stations are bound to have an amount of work that requires less time than T_c . This tends to increase the number of workers.

15.2.2 Repositioning Losses

Repositioning losses on a production line occur because some time is required each cycle to reposition the worker, or the work unit, or both. For example, on a continuous transport line with work units attached to the conveyor and moving at a constant speed, time is required for the worker to walk from the unit just completed to the upstream unit entering the station. In other conveyORIZED systems, time is required to remove the work unit from the conveyor and position it at the station for the worker to perform his/her task on it. In all manual assembly lines, there is some lost time for repositioning. Define T_r as the time required each cycle to reposition the worker, the work unit, or both. In the subsequent analysis, it is assumed that T_r is the same for all workers, although repositioning times may actually vary among stations.

The repositioning time T_r must be subtracted from the cycle time T_c to obtain the available time remaining to perform the actual assembly task at each workstation. The time to perform the assigned task at each station is called the *service time*. It is symbolized T_{si} , where i is used to identify station, $i = 1, 2, \dots, n$. Service times will vary among stations because the total work content cannot be allocated evenly among stations. Some stations will have more work than others. There will be at least one station at which T_{si} is maximum. This is referred to as the *bottleneck station* because it establishes the cycle time

for the entire line. This maximum service time must be no greater than the difference between the cycle time T_c and the repositioning time T_r ; that is,

$$\text{Max}\{T_{si}\} \leq T_c - T_r \quad \text{for } i = 1, 2, \dots, n \quad (15.8)$$

where $\text{Max}\{T_{si}\}$ = maximum service time among all stations, min/cycle; T_c = cycle time for the assembly line from Equation (15.2), min/cycle; and T_r = repositioning time (assumed the same for all stations), min/cycle. For simplicity of notation, let T_s denote this maximum allowable service time:

$$T_s = \text{Max}\{T_{si}\} \leq T_c - T_r \quad (15.9)$$

At all stations where T_{si} is less than T_s , workers will be idle for a portion of the cycle, as portrayed in Figure 15.4. If the maximum service time does not consume the entire available time (i.e., when $T_s < T_c - T_r$), it means that the line could be operated at a faster pace than T_c from Equation (15.2). In this case, the cycle time T_c is usually reduced so that $T_c = T_s + T_r$; this allows production rate to be increased slightly.

Repositioning losses reduce the amount of time that can be devoted to productive assembly work on the line. These losses can be expressed in terms of an efficiency factor as

$$E_r = \frac{T_s}{T_c} = \frac{T_c - T_r}{T_c} \quad (15.10)$$

where E_r = repositioning efficiency and the other terms are defined earlier.

15.2.3 The Line Balancing Problem

The work content performed on an assembly line consists of many separate and distinct work elements. Invariably, the sequence in which these elements can be performed is restricted, at least to some extent, and the line must operate at a specified production

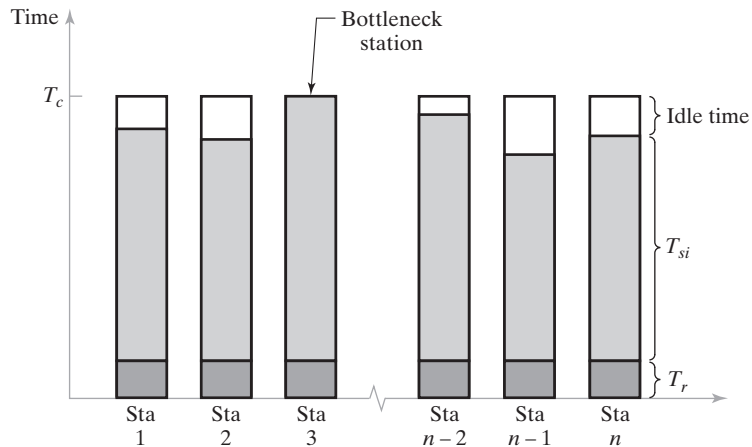


Figure 15.4 Components of cycle time at several stations on a manual assembly line. At the slowest station, the bottleneck station, idle time = zero; at other stations idle time exists. Key: Sta. = workstation, n = number of workstations on the line, T_r = repositioning time, T_{si} = service time, T_c = cycle time.

rate, which reduces to a required cycle time as defined by Equation (15.2). Given these conditions, the line balancing problem is concerned with assigning the individual work elements to workstations so that all workers have an equal amount of work. The terminology of the line balancing problem is discussed in this section, and several algorithms to solve it are presented in Section 15.3.

Two important concepts in line balancing are the separation of the total work content into minimum rational work elements and the precedence constraints that must be satisfied by these elements. Based on these concepts, performance measures can be defined for solutions to the line balancing problem.

Minimum Rational Work Elements. A minimum rational work element is a small amount of work that has a specific limited objective, such as adding a component to the base part, joining two components, or performing some other small portion of the total work content. A minimum rational work element cannot be subdivided any further without loss of practicality. For example, drilling a through-hole in a piece of sheet metal or fastening two machined components together with a bolt or screw would be defined as minimum rational work elements. It makes no sense to divide these tasks into smaller elements of work. The sum of the work element times is equal to the work content time; that is,

$$T_{wc} = \sum_{k=1}^{n_e} T_{ek} \quad (15.11)$$

where T_{ek} = time to perform work element k , min; and n_e = number of work elements into which the work content is divided, that is, $k = 1, 2, \dots, n_e$.

In line balancing, T_{ek} values are assumed to be (1) constant and (2) additive. In fact, these assumptions are not quite true. Work element times are variable, leading to the problem of task time variability. And there is often motion economy that can be achieved by combining two or more work elements, so the time to perform two or more work elements in sequence may be less than the sum of the individual element times. Nevertheless, these assumptions are made to facilitate solution of the line balancing problem.

The task time at station i , or service time as it is called, T_{si} , is composed of the work element times that have been assigned to that station, that is,

$$T_{si} = \sum_{k \in i} T_{ek} \quad (15.12)$$

An underlying assumption is that all T_{ek} are less than the maximum service time T_s .

Different work elements require different times, and when the elements are grouped into logical tasks and assigned to workers, the station service times T_{si} are likely not to be equal. Thus, simply because of the variation among work element times, some workers will be assigned more work, while others will be assigned less. Although service times vary from station to station, they must add up to the work content time:

$$T_{wc} = \sum_{i=1}^n T_{si} \quad (15.13)$$

Precedence Constraints. In addition to the variation in element times that make it difficult to obtain equal service times for all stations, there are restrictions on the order in which the work elements can be performed. Some elements must be done before others.

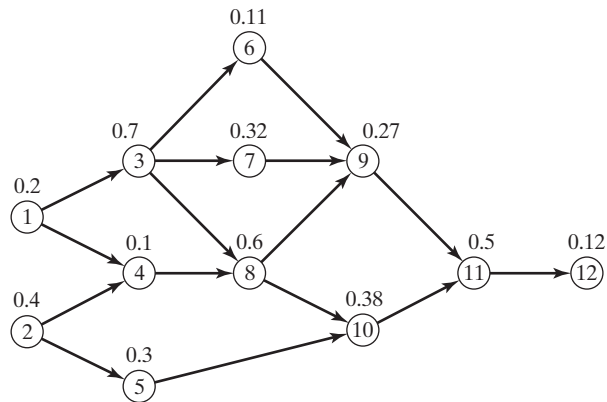


Figure 15.5 Precedence diagram for Example 15.1. Nodes represent work elements, and arrows indicate the sequence in which the elements must be done. Element times are shown above each node.

For example, to create a threaded hole, the hole must be drilled before it can be tapped. A machine screw that will use the tapped hole to attach a mating component cannot be fastened before the hole has been drilled and tapped. These technological requirements on the work sequence are called precedence constraints. They complicate the line balancing problem.

Precedence constraints can be presented graphically in the form of a *precedence diagram*, which is a network diagram that indicates the sequence in which the work elements must be performed. Work elements are symbolized by nodes, and the precedence requirements are indicated by arrows connecting the nodes. The sequence proceeds from left to right. Figure 15.5 presents the precedence diagram for the following example, which illustrates the terminology and some of the equations presented here.

EXAMPLE 15.1 A Problem for Line Balancing

A small electrical appliance is to be produced on a single-model assembly line. The work content of assembling the product has been reduced to the work elements listed in Table 15.4. The table also lists the times for each element and the precedence order in which they must be performed. The line is to be balanced for an annual demand of 100,000 units/yr. The line will operate 50 wk/yr, 5 shifts/wk, and 7.5 hr/shift. There will be one worker per station. Previous experience suggests that the uptime efficiency for the line will be 96%, and repositioning time lost per cycle will be 0.08 min. Determine (a) total work content time T_{wc} , (b) required hourly production rate R_p to achieve the annual demand, (c) cycle time T_c , (d) theoretical minimum number of workers required on the line, and (e) service time T_s to which the line must be balanced.

TABLE 15.4 Work Elements for Example 15.1

No.	Work Element Description	T_{ek} (min)	Must be Preceded By
1	Place frame in work holder and clamp	0.2	–
2	Assemble plug, grommet to power cord	0.4	–
3	Assemble brackets to frame	0.7	1
4	Wire power cord to motor	0.1	1, 2
5	Wire power cord to switch	0.3	2
6	Assemble mechanism plate to bracket	0.11	3
7	Assemble blade to bracket	0.32	3
8	Assemble motor to brackets	0.6	3, 4
9	Align blade and attach to motor	0.27	6, 7, 8
10	Assemble switch to motor bracket	0.38	5, 8
11	Attach cover, inspect, and test	0.5	9, 10
12	Place in tote pan for packing	0.12	11

Solution: (a) The total work content time is the sum of the work element times in Table 15.4.

$$T_{wc} = 4.0 \text{ min}$$

(b) Given the annual demand, the hourly production rate is

$$R_p = \frac{100,000}{50(5)(7.5)} = 53.33 \text{ units/hr}$$

(c) The corresponding cycle time T_c with an uptime efficiency of 96% is

$$T_c = \frac{60(0.96)}{53.33} = 1.08 \text{ min}$$

(d) The theoretical minimum number of workers is given by Equation (15.7):

$$w^* = \text{Min Int} \geq \frac{4.0}{1.08} = 3.7 \text{ rounded up to 4 workers}$$

(e) The available service time against which the line must be balanced is

$$T_s = 1.08 - 0.08 = 1.00 \text{ min}$$

Measures of Line Balance Efficiency. Owing to the differences in minimum rational work element times and the precedence constraints among the elements, it is virtually impossible to obtain a perfect line balance. Measures must be defined to indicate how good a given line balancing solution is. One possible measure is **balance efficiency**, which is the work content time divided by the total available service time on the line:

$$E_b = \frac{T_{wc}}{wT_s} \quad (15.14)$$

where E_b = balance efficiency, often expressed as a percent; T_s = the maximum available service time on the line ($\text{Max}\{T_{si}\}$), min/cycle; and w = number of workers. The denominator in Equation (15.14) gives the total service time available on the line to devote to the assembly of one product unit. The closer the values of T_{wc} and wT_s , the less

idle time on the line. E_b is therefore a measure of how good the line balancing solution is. A perfect line balance yields a value of $E_b = 1.00$. Typical line balancing efficiencies in industry range between 0.90 and 0.95.

The complement of balance efficiency is **balance delay**, which indicates the amount of time lost due to imperfect balancing as a ratio to the total time available, that is,

$$d = \frac{(wT_s - T_{wc})}{wT_s} \quad (15.15)$$

where d = balance delay and the other terms have the same meaning as before. A balance delay of zero indicates a perfect balance. Note that $E_b + d = 1$.

Worker Requirements. In discussing the relationships in this section, three efficiency factors have been identified that reduce the productivity of a manual assembly line:

1. *Line efficiency*, the proportion of uptime on the line E , as defined in Equation (15.4)
2. *Repositioning efficiency*, E_r , as defined in Equation (15.10)
3. *Line balancing efficiency*, E_b , as defined in Equation (15.14).

Together, they constitute the overall labor efficiency on the assembly line:

$$\text{Assembly line labor efficiency} = EE_rE_b \quad (15.16)$$

Using this measure of labor efficiency, a more realistic value for the number of workers on the assembly line can be calculated, based on previous Equation (15.7):

$$w = \text{Minimum Integer} \geq \frac{R_p T_{wc}}{60EE_rE_b} = \frac{T_{wc}}{E_rE_bT_c} = \frac{T_{wc}}{E_bT_s} \quad (15.17)$$

where w = actual number of workers required on the line; R_p = hourly production rate, units/hr; and T_{wc} = work content time per product to be accomplished on the line, min/unit. The trouble with this relationship is that it is difficult to determine values for E , E_r , and E_b before the line is built and operated. Nevertheless, the equation provides an accurate model of the parameters that affect the number of workers required to accomplish a given workload on a single-model assembly line.

15.3 LINE BALANCING ALGORITHMS

The objective in line balancing is to distribute the total workload on the assembly line as evenly as possible among the workers. This objective can be expressed mathematically in two alternative but equivalent forms:

$$\text{Minimize } (wT_s - T_{wc}) \text{ or Minimize } \sum_{i=1}^w (T_s - T_{si}) \quad (15.18)$$

subject to:

$$(1) \sum_{k \in i} T_{ek} \leq T_s$$

and

$$(2) \text{ all precedence requirements are obeyed.}$$

TABLE 15.5 Work Elements Arranged According to T_{ek} Value for the Largest Candidate Rule

Work Element	T_{ek} (min)	Preceded By
3	0.7	1
8	0.6	3, 4
11	0.5	9, 10
2	0.4	–
10	0.38	5, 8
7	0.32	3
5	0.3	2
9	0.27	6, 7, 8
1	0.2	–
12	0.12	11
6	0.11	3
4	0.1	1, 2

This section covers several algorithms to solve the line balancing problem, using the data of Example 15.1 to illustrate. They are (1) largest candidate rule, (2) Kilbridge and Wester method, and (3) ranked positional weights method. These methods are heuristic, meaning they are based on common sense and experimentation rather than mathematical optimization. In each of the algorithms, there is one worker per station, so when referring to a certain station i , that reference includes the worker at station i .

15.3.1 Largest Candidate Rule

In this method, work elements are arranged in descending order according to their T_{ek} values, as in Table 15.5. Given this list, the algorithm consists of the following steps: (1) assign elements to the worker at the first workstation by starting at the top of the list and selecting the first element that satisfies precedence requirements and does not cause the total sum of T_{ek} at that station to exceed the allowable T_s ; when an element is selected for assignment to the station, start back at the top of the list for subsequent assignments; (2) when no more elements can be assigned without exceeding T_s , then proceed to the next station; (3) repeat steps 1 and 2 for as many additional stations as necessary until all elements have been assigned.

EXAMPLE 15.2 Largest Candidate Rule

Apply the largest candidate rule to Example 15.1.

Solution: Work elements are arranged in descending order in Table 15.5, and the algorithm is carried out as presented in Table 15.6. Five workers and stations are required in the solution. Balance efficiency is computed as

$$E_b = \frac{4.0}{5(1.0)} = 0.80$$

Balance delay $d = 0.20$. The line balancing solution is presented in Figure 15.6.

TABLE 15.6 Work Elements Assigned to Stations According to the Largest Candidate Rule

Station	Work Element	T_{ek} (min)	StationTime (min)
1	2	0.4	1.0
	5	0.3	
	1	0.2	
	4	0.1	
2	3	0.7	0.81
	6	0.11	
3	8	0.6	0.98
	10	0.38	
4	7	0.32	0.59
	9	0.27	
5	11	0.5	0.62
	12	0.12	

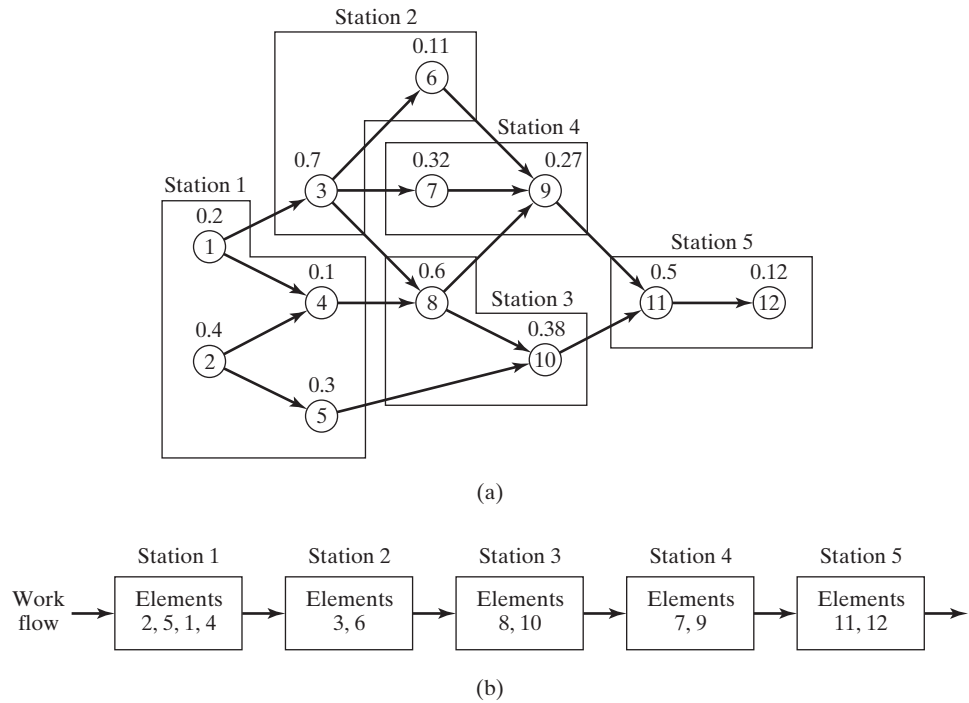


Figure 15.6 Solution for Example 15.2, which indicates: (a) assignment of elements according to the largest candidate rule, and (b) physical sequence of stations with assigned work elements.

15.3.2 Kilbridge and Wester Method

This method has received considerable attention since its introduction in 1961 [18] and has been applied with apparent success to several large line balancing problems in industry [22]. It is a heuristic procedure that selects work elements for assignment

to stations according to their position in the precedence diagram. This overcomes one of the difficulties with the largest candidate rule in which an element may be selected because of a high T_e value but irrespective of its position in the precedence diagram. In general, the Kilbridge and Wester method provides a superior line balance solution to that provided by the largest candidate rule (although not for this example problem).

In the Kilbridge and Wester method, work elements in the precedence diagram are arranged into columns, as shown in Figure 15.7. The elements can then be organized into a list according to their columns, with the elements in the first column listed first. Such a list of elements has been developed for the example problem in Table 15.7.

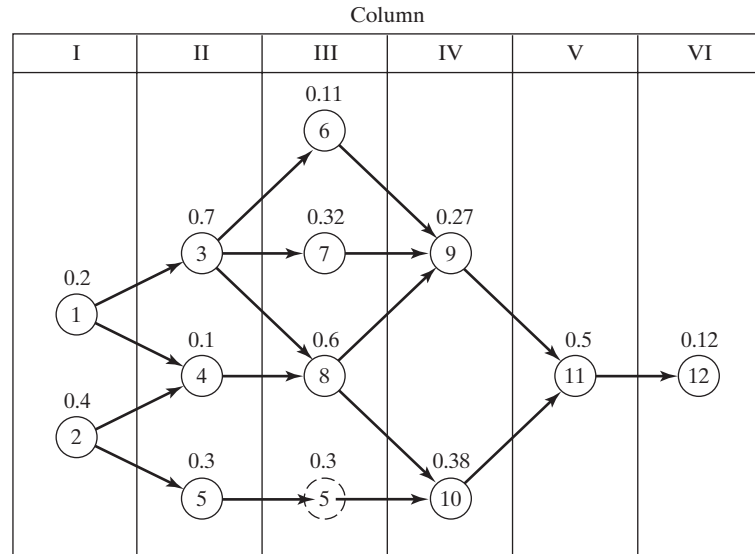


Figure 15.7 Work elements in example problem arranged into columns for the Kilbridge and Wester method.

TABLE 15.7 Work Elements Listed According to Columns from Figure 15.7 for the Kilbridge and Wester Method

Work Element	Column	T_{ek} (min)	Preceded By
2	I	0.4	–
1	I	0.2	–
3	II	0.7	1
5	II, III	0.3	2
4	II	0.1	1, 2
8	III	0.6	3, 4
7	III	0.32	3
6	III	0.11	3
10	IV	0.38	5, 8
9	IV	0.27	6, 7, 8
11	V	0.5	9, 10
12	VI	0.12	11

If a given element can be located in more than one column, then all of the columns for that element should be listed, as in the case of element 5. An additional feature of the list is that elements in a given column are presented in the order of their T_{ek} value; that is, the largest candidate rule has been applied in each column. This is helpful when assigning elements to stations, because it ensures that the larger elements are selected first, thus increasing the chances of making the sum of T_{ek} in each station closer to the allowable T_s limit. Once the list is established, the same three-step procedure is used as before.

EXAMPLE 15.3 Kilbridge and Wester Method

Apply the Kilbridge and Wester method to Example 15.1.

Solution: Work elements are arranged in order of columns in Table 15.7. The Kilbridge and Wester solution is presented in Table 15.8. Five workers are required and the balance efficiency is $E_b = 0.80$. Note that although the balance efficiency is the same as in the largest candidate rule, the allocation of work elements to stations is different.

TABLE 15.8 Work Elements Assigned to Stations According to the Kilbridge and Wester Method

Station	Work Element	Column	T_{ek} (min)	Station Time (min)
1	2	I	0.4	1.0
	1	I	0.2	
	5	II	0.3	
	4	II	0.1	
2	3	II	0.7	0.81
	6	III	0.11	
3	8	III	0.6	0.92
	7	III	0.32	
4	10	IV	0.38	0.65
	9	IV	0.27	
5	11	V	0.5	0.62
	12	VI	0.12	

15.3.3 Ranked Positional Weights Method

The ranked positional weights method was introduced by Helgeson and Birnie [13]. In this method, a ranked positional weight value (call it RPW for short) is computed for each element. The RPW takes into account both the T_{ek} value and its position in the precedence diagram. Specifically, RPW_k is calculated by summing T_{ek} and all other times for elements that follow T_{ek} in the arrow chain of the precedence diagram. Elements are compiled into a list according to their RPW value, and the algorithm proceeds using the same three steps as before.

EXAMPLE 15.4 Ranked Positional Weights Method

Apply the ranked positional weights method to Example 15.1.

Solution: The RPW must be calculated for each element. To illustrate,

$$RPW_{11} = 0.5 + 0.12 = 0.62$$

$$RPW_8 = 0.6 + 0.27 + 0.38 + 0.5 + 0.12 = 1.87$$

Work elements are listed according to RPW value in Table 15.9. Assignment of elements to stations proceeds with the solution presented in Table 15.10. Note that the largest T_s value is 0.92 min. This can be exploited by operating

TABLE 15.9 Elements Ranked According to Their Ranked Positional Weights (RPW)

Work Element	RPW	T_{ek} (min)	Preceded By
1	3.30	0.2	–
3	3.00	0.7	1
2	2.67	0.4	–
4	1.97	0.1	1, 2
8	1.87	0.6	3, 4
5	1.30	0.3	2
7	1.21	0.32	3
6	1.00	0.11	3
10	1.00	0.38	5, 8
9	0.89	0.27	6, 7, 8
11	0.62	0.5	9, 10
12	0.12	0.12	11

TABLE 15.10 Work Elements Assigned to Stations According to the Ranked Positional Weights (RPW) Method

Station	Work Element	T_{ek} (min)	Station Time (min)
1	1	0.2	0.90
	3	0.7	
2	2	0.4	0.91
	4	0.1	
	5	0.3	
	6	0.11	
3	8	0.6	0.92
	7	0.32	
4	10	0.38	0.65
	9	0.27	
5	11	0.5	0.62
	12	0.12	

the line at this faster rate, with the result that line balance efficiency is improved and production rate is increased:

$$E_b = \frac{4.0}{5(.92)} = 0.87$$

The cycle time is $T_c = T_s + T_r = 0.92 + 0.08 = 1.00$; therefore,

$$R_c = \frac{60}{1.0} = 60 \text{ cycles/hr}$$

And given that line efficiency $E = 0.96$, $R_p = 60(0.96) = 57.6 \text{ units/hr}$ □

This is a better solution than the ones provided by the previous line balancing methods. It turns out that the performance of a given line balancing algorithm depends on the problem to be solved. Some line balancing methods work better on some problems, while other methods work better on other problems.

15.4 WORKSTATION DETAILS

By definition, a workstation is a position along the assembly line where one or more workers perform assembly tasks. This section covers several additional details relating to workstations on an assembly line: (1) time-distance relationships and (2) manning level.

Time-Distance Relationships. Referring to Figure 15.8, a workstation has a length dimension L_{si} , where i denotes station i . The total length of the assembly line is the sum of the station lengths:

$$L = \sum_{i=1}^n L_{si} \quad (15.19)$$

where L = length of the assembly line, m (ft); and L_{si} = length of station i , m (ft). In the case when all L_{si} are equal,

$$L = nL_s \quad (15.20)$$

where L_s = station length, m (ft).

A common transport system used on manual assembly lines is a constant speed conveyor, as in Figure 15.8. Base parts are launched onto the beginning of the line at constant time intervals equal to the cycle time T_c . This provides a constant feed rate of base parts, and if the base parts remain fixed to the conveyor during their assembly, this feed rate will be maintained throughout the line. The feed rate is simply the reciprocal of the cycle time,

$$f_p = \frac{1}{T_c} \quad (15.21)$$

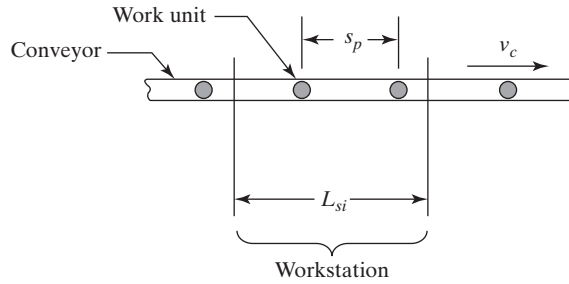


Figure 15.8 Continuously moving conveyor feeding work units past a workstation.

where f_p = feed rate on the line, units/min. A constant feed rate on a constant speed conveyor provides a center-to-center distance between base parts given by

$$s_p = \frac{v_c}{f_p} = v_c T_c \quad (15.22)$$

where s_p = center-to-center spacing between base parts, m/part (ft/part); and v_c = velocity of the conveyor, m/min (ft/min).

As discussed in Section 15.1.3, pacing with margin is a desirable way to operate the line so as to achieve the desired production rate and at the same time allow for some product-to-product variation in task times at workstations. One way to achieve pacing with margin in a continuous transport system is to provide a tolerance time that is greater than the cycle time. **Tolerance time** is the time a work unit spends inside the boundaries of the workstation. It can be determined as the length of the station divided by the conveyor velocity, that is,

$$T_t = \frac{L_s}{v_c} \quad (15.23)$$

where T_t = tolerance time, min/part, assuming that all station lengths are equal. If stations have different lengths, identified by L_{si} , then the tolerance times will differ proportionally, since v_c is constant.

The total elapsed time a work unit spends on the assembly line can be determined simply as the length of the line divided by the conveyor velocity. It is also equal to the sum of the tolerance times for all n stations. Expressing these relationships in equation form,

$$ET = \frac{L}{v_c} = \sum_{i=1}^n T_{ti} \quad (15.24)$$

where ET = elapsed time a work unit (specifically, the base part) spends on the conveyor during its assembly, min. If all tolerance times are equal, then $ET = nT_t$.

Manning Level. This was previously defined in Section 13.2.3. For a manual assembly line, the manning level of workstation i , symbolized M_i , is the number of workers assigned to that station, where $i = 1, 2, \dots, n$ and n = number of workstations on

the line. The generic case is one worker: $M_i = 1$. In cases where the product is large, such as a car or truck, multiple workers are often assigned to one station, so that $M_i > 1$. Multiple manning conserves valuable floor space in the factory and reduces line length and throughput time because fewer stations are required. The average manning level of a manual assembly line is simply the total number of workers on the line divided by the number of stations, that is,

$$M = \frac{w}{n} \quad (15.25)$$

where M = average manning level of the line, workers/station; w = number of workers on the line; and n = number of stations on the line. This seemingly simple ratio is complicated by the fact that manual assembly lines often include more workers than those assigned to stations, so M is not a simple average of M_i values. These additional workers are called *utility workers*. As described in Section 13.2.3, they are not assigned to specific workstations; instead their duties include (1) relieving workers at stations for personal breaks, (2) maintenance and repair, (3) material handling, and (4) tool changing. Repeating Equation (13.1),

$$M = \frac{w_u + \sum_{i=1}^n w_i}{n} \quad (15.26)$$

where w_u = number of utility workers assigned to the system and w_i = number of workers assigned specifically to station i for $i = 1, 2, \dots, n$. The parameter w_i is almost always an integer, except for the unusual case where a worker is shared between two adjacent stations.

15.5 OTHER CONSIDERATIONS IN ASSEMBLY LINE DESIGN

The line balancing algorithms described in Section 15.3 are precise computational procedures that allocate work elements to stations based on deterministic quantitative data. However, the designer of a manual assembly line should not overlook certain other factors, some of which may improve line performance beyond what the balancing algorithms can provide. Following are some of the considerations.

- *Line efficiency.* The uptime proportion E is a critical parameter in assembly line operation. When the entire line goes down, all workers are idled. It is the responsibility of management to maintain a value of E as close to 100% as possible. Steps that can be taken include (1) implementing a preventive maintenance program to minimize downtime occurrences, (2) employing well-trained repair crews to quickly fix breakdowns when they occur, (3) managing incoming components so that parts shortages do not cause line stoppages, and (4) insisting on the highest quality of incoming parts from suppliers so that downtime is not caused by poor quality components.
- *Methods analysis.* Methods analysis involves the study of human work activity to seek out ways in which the activity can be done with less effort, in less time, and

with greater effect. This kind of analysis is an obvious step in the design of a manual assembly line, since the work elements need to be defined in order to balance the line. In addition, methods analysis can be used after the line is in operation to examine workstations that turn out to be bottlenecks. The analysis may result in improved efficiency of workers' hand and body motions, better workplace layout, design of special tools and/or fixtures to facilitate manual work elements, or even changes in the product design for easier assembly (design for assembly is discussed in Chapter 24).

- *Sharing work elements between two adjacent stations.* If a particular work element results in a bottleneck operation at one station, while the adjacent station has ample idle time, it might be possible for the element to be shared between the two stations, perhaps alternating every other cycle.
- *Changing work head speeds at mechanized stations.* At stations where a mechanized operation is performed, the power feed or speed of the process may be increased or decreased to alter the time required to perform the task. If the mechanized operation takes too long, then an increase in speed or feed is indicated. On the other hand, if the mechanized process is of relatively short duration, so that idle time is associated with the station, then a reduction in speed and/or feed may be appropriate. The advantage of reducing the speed/feed combination is that tool life is increased. The opposite occurs when speed or feed is increased. Whether speeds and/or feeds are increased or decreased, procedures must be devised for efficiently changing the tools without causing undue downtime on the line.
- *Preassembly of components.* To reduce the total amount of work done on the regular assembly line, certain subassemblies can be prepared off-line, either by another assembly cell in the plant or by purchasing them from an outside vendor that specializes in the type of processes required. Although it may seem like the work is simply being moved from one location to another, there are some good reasons for organizing assembly operations in this manner: (1) the required process may be difficult to implement on the regular assembly line, (2) task time variability (e.g., for adjustments or fitting) for the associated assembly operations may result in a longer overall cycle time if done on the regular line, and (3) an assembly cell setup in the plant or by a vendor with certain special capabilities to perform the work may be able to achieve higher quality.
- *Storage buffers between Stations.* A storage buffer is a location in the production line where work units are temporarily stored. Reasons to include one or more storage buffers in a production line include (1) to accumulate work units between two stages of the line when their production rates are different, (2) to smooth production between stations with large task time variations, and (3) to permit continued operation of certain sections of the line when other sections are temporarily down for service or repair. The use of storage buffers generally improves the performance of the line operation by increasing line efficiency.
- *Zoning constraints.* In addition to precedence constraints, there may be other restrictions on the line balancing solution. Zoning constraints impose limitations on the grouping of work elements and/or their allocation to workstations. Zoning

constraints may be positive or negative. A positive zoning constraint means that certain elements should be grouped together at the same workstation if possible. For example, spray painting elements should all be grouped together due to the need for special enclosures. A negative zoning constraint indicates that certain work elements might interfere with each other and therefore should not be located near each other. For example, a work element requiring delicate adjustments should not be located near an assembly operation in which loud sudden noises occur, such as hammering.

- *Parallel workstations.* Parallel stations are sometimes used to balance a production line. Their most obvious application is where a particular station has an unusually long task time that would cause the production rate of the line to be less than that required to satisfy product demand. In this case, two stations operating in parallel and both performing the same long task may eliminate the bottleneck. In other situations, the advantage of using parallel stations is not as obvious. Conventional line balancing methods, such as the largest candidate rule, the Kilbridge and Wester method, and ranked positional weights method, do not consider the use of parallel workstations. It turns out that the only way to achieve a perfect balance in the earlier example problem is by using parallel stations.

EXAMPLE 15.5 Parallel Work Stations for Better Line Balance

Can a perfect line balance be achieved in Example 15.1 using parallel stations?

Solution: The answer is yes. Using a parallel station configuration to replace positions 1 and 2, and reallocating the elements as indicated in Table 15.11, will achieve a perfect balance. The solution is illustrated in Figure 15.9.

TABLE 15.11 Assignment of Work Elements to Stations for Example 15.5 Using Parallel Workstations

Station	Work Element	T_{ek} (min)	Station Time (min)
1, 2*	1	0.2	2.00/2 = 1.00
	2	0.4	
	3	0.7	
	4	0.1	
	8	0.6	
3	5	0.3	1.00
	6	0.11	
	7	0.32	
	9	0.27	
4	10	0.38	1.00
	11	0.5	
	12	0.12	

*Stations 1 and 2 are in parallel.

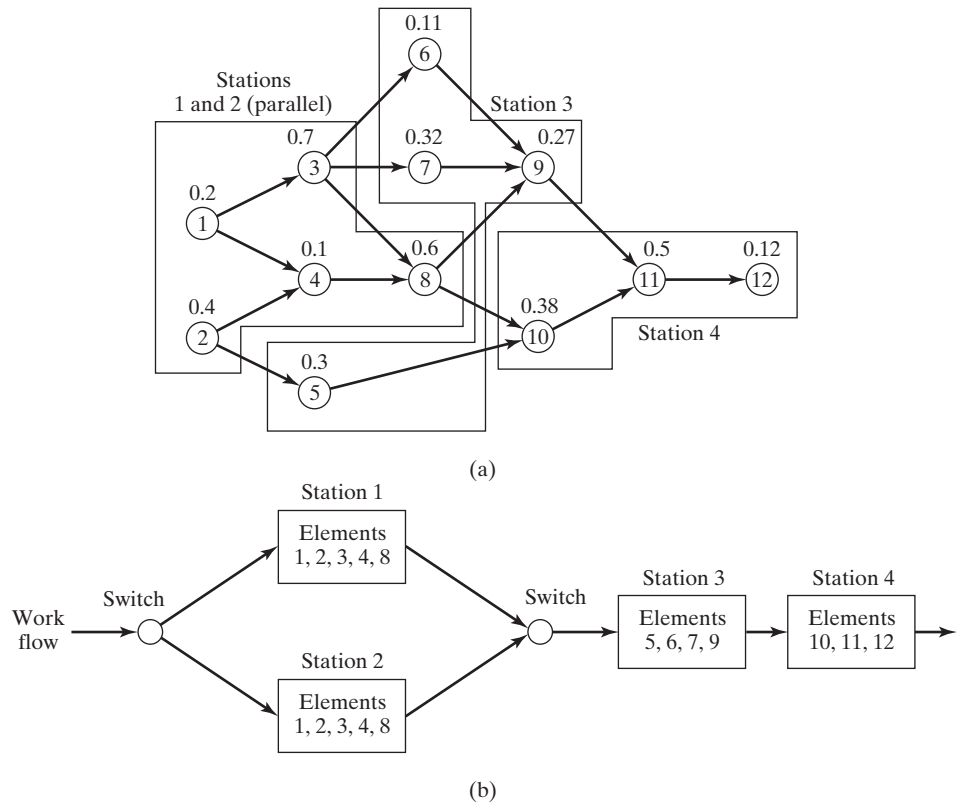


Figure 15.9 Solution for Example 15.5 using parallel workstations: (a) precedence diagram and (b) workstation layout showing element assignments.

Work content time $T_{wc} = 4.0$ min as before. To determine the available service time, note that there are two conventional stations (3 and 4) with $T_s = 1.0$ min each. The parallel stations (1 and 2) each have service times of 2.0 min, but each is working on its own unit of product so the effective throughput of the two stations is one work unit every minute. Using this reasoning, the balance efficiency is computed as follows:

$$E_b = \frac{4.0}{2(1.0) + 2.0} = 1.00 = 100\%$$

15.6 ALTERNATIVE ASSEMBLY SYSTEMS

The well-defined pace of a manual assembly line has merit from the viewpoint of maximizing production rate. However, assembly line workers often complain about the monotony of the repetitive tasks they must perform and the unrelenting pace they must maintain when a moving conveyor is used. Poor quality workmanship, sabotage of the line equipment, and other problems have occurred on high production assembly

lines. To address these issues, alternative assembly systems are available in which the work is made less monotonous and repetitious by enlarging the scope of the tasks performed, or the work is automated. This section briefly discusses two alternative assembly systems: (1) single-station assembly cells and (2) assembly work cells consisting of worker teams and multiple workstations.

A single-station assembly cell consists of a single workstation in which assembly is accomplished manually on the product or some major subassembly of the product. This method is generally used on products that are complex and produced in small quantities, sometimes one-of-a-kind. The workstation may use one or more workers, depending on the size and complexity of the product, variety of worker skills required, and the production schedule. Custom-engineered products such as machine tools, industrial equipment, and prototype models of complex products (e.g., aircraft, appliances, cars) are assembled on single-station cells.

Assembly cells consisting of multiple workstations and operated by worker teams are seen as a more rewarding work organization compared to the pacing that occurs on most manual assembly lines. Instead of the straight line flow typical of a conventional assembly line, the cell is often U-shaped. This layout allows for improved interactions and teamwork among workers. The pace of the work is controlled largely by the workers rather than by a pacing mechanism such as a powered conveyor moving at a constant speed. The number of assembly tasks assigned to each worker is greater than on a corresponding assembly line. The work is therefore less repetitious, broader in scope, and more rewarding. Because of this job enlargement, fewer workers are needed in the cell and less floor space is required.

Other ways to organize assembly work by teams include moving the product through multiple workstations, but having the same worker team follow the product from station to station. This form of team assembly was pioneered by Volvo, the Swedish car maker. It uses independently operated automated guided vehicles (Section 10.2.2) that hold major components and/or subassemblies of the automobile and deliver them to manual assembly workstations along the line. At each station, the guided vehicle stops at the station and is not released to proceed until the assembly task at that station has been completed by the worker team. Thus, production rate is determined by the pace of the team, rather than by a moving conveyor. The reason for moving the work unit through multiple stations, rather than performing all the assembly at one station, is because the many component parts assembled to the car must be located at more than one station. As the car moves through each station, parts from that station are added. The difference between this and the conventional assembly line is that all work is done by one worker team moving with the car. Accordingly, the members of the team achieve greater personal satisfaction at having accomplished a major portion of the car assembly. Workers on a conventional line who perform a very small portion of the total car assembly do not usually have this level of job satisfaction.

The use of automated guided vehicles allows the assembly system to be configured with parallel paths, queues of parts between stations, and other features not typically found on a conventional assembly line. In addition, these team assembly systems can be designed to be highly flexible and capable of dealing with variations in product and corresponding variations in assembly cycle times at the different workstations. Accordingly, this type of team assembly is generally used when there are many different models to be produced, and the variations in the models result in significant differences in station service times.

Reported benefits of worker team assembly systems compared to conventional assembly line include greater worker satisfaction, better product quality, increased capability to accommodate model variations, and greater ability to cope with problems that require more time without stopping the entire production line. The principal disadvantage is that these team systems are not capable of the high production rates characteristic of a conventional assembly line.

Another alternative assembly system is automated assembly, covered in Chapter 17, which includes hybrid assembly systems consisting of both automated stations and human assembly operators.

REFERENCES

- [1] ANDREASEN, M., S., KAHLER, and T., LUND, *Design for Assembly*, IFS (Publications) Ltd., UK, and Springer-Verlag, Berlin, 1983.
- [2] BARD, J. F., E. M. DAR-EL, and A. SHTUB, "An Analytical Framework for Sequencing Mixed-Model Assembly Lines," *International Journal of Production Research*, Vol. 30, No. 1, 1992, pp. 35–48.
- [3] BOOTHROYD, G., P. DEWHURST, and W. KNIGHT, *Product Design for Manufacture and Assembly*, Marcel Dekker, Inc., New York, 1994.
- [4] BRALLA, J. G., *Handbook of Product Design for Manufacturing*, McGraw-Hill Book Company, New York, 1986, Chapter 7.
- [5] CHOW, W.-M., *Assembly Line Design: Methodology and Applications*, Marcel Dekker, Inc., New York, 1990.
- [6] DAR-EL, E. M., and F. COTHER, "Assembly Line Sequencing for Model Mix," *International Journal of Production Research*, Vol. 13, No. 5, 1975, pp. 463–477.
- [7] DAR-EL, E. M., "Mixed-Model Assembly Line Sequencing Problems," *OMEGA*, Vol. 6, No. 4, 1978, pp. 313–323.
- [8] DAR-EL, E. M., and A. NAVIDI, "A Mixed-Model Sequencing Application," *International Journal of Production Research*, Vol. 19, No. 1, 1981, pp. 69–84.
- [9] DEUTSCH, D. F., "A Branch and Bound Technique for Mixed-Model Assembly Line Balancing," *Ph.D. Dissertation* (Unpublished), Arizona State University, 1971.
- [10] FERNANDES, C. J. L., "Heuristic Methods for Mixed-Model Assembly Line Balancing and Sequencing," *M.S. Thesis* (Unpublished), Lehigh University, 1992.
- [11] FERNANDES, C. J. L., and M. P. GROOVER, "Mixed-model Assembly Line Balancing and Sequencing: A Survey," *Engineering Design and Automation*, Vol. 1, No. 1, 1995, pp. 33–42.
- [12] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [13] HELGESON, W. B., and D. P. BIRNIE, "Assembly Line Balancing Using Ranked Positional Weight Technique," *Journal of Industrial Engineering*, Vol. 12, No. 6, 1961, pp. 394–398.
- [14] HOFFMAN, T., "Assembly Line Balancing: A Set of Challenging Problems," *International Journal of Production Research*, Vol. 28, No. 10, 1990, pp. 1807–1815.
- [15] HOUNSHELL, D. A., *From the American System to Mass Production, 1800–1932*, The Johns Hopkins University Press, Baltimore, MD, 1984.
- [16] HYER, N. L., and U. WEMMERLOV, *Reorganizing the Factory: Competing through Cellular Manufacturing*, Productivity Press, Portland, OR, 2002.
- [17] IGNALL, E. J., "A Review of Assembly Line Balancing," *Journal of Industrial Engineering*, Vol. 16, No. 4, 1965, pp. 244–252.

- [18] KILBRIDGE, M., and WESTER, L., "A Heuristic Method of Assembly Line Balancing," *Journal of Industrial Engineering*, Vol. 12, No. 6, 1961, pp. 292–298.
- [19] MACASKILL, J. L. C., "Production Line Balances for Mixed-Model Lines," *Management Science*, Vol. 19, No. 4, 1972, pp. 423–434.
- [20] MOODIE, C. L., and YOUNG, H. H., "A Heuristic Method of Assembly Line Balancing for Assumptions of Constant or Variable Work Element Times," *Journal of Industrial Engineering*, Vol. 16, No. 1, 1965, pp. 23–29.
- [21] NOF, S. Y., W. E. WILHELM, and H.-J. WARNECKE, *Industrial Assembly*, Chapman & Hall, London, UK, 1997.
- [22] PRENTING, T. O., and N. T. THOMOPOULOS, *Humanism and Technology in Assembly Systems*, Hayden Book Company, Inc., Rochelle Park, NJ, 1974.
- [23] REKIEK, B., and A. DELCHAMBRE, *Assembly Line Design: The Balancing of Mixed-Model Hybrid Assembly Lines with Generic Algorithms*, Springer Verlag London Limited, UK, 2006.
- [24] SUMICHRAST, R. T., R. R. RUSSEL, and B. W. TAYLOR, "A Comparative Analysis of Sequencing for Mixed-Model Assembly Lines in a Just-In-Time Production System," *International Journal of Production Research*, Vol. 30, No. 1, 1992, pp. 199–214.
- [25] VILLA, C., "Multi Product Assembly Line Balancing," *Ph.D. Dissertation* (Unpublished), University of Florida, 1970.
- [26] WHITNEY, D., *Mechanical Assemblies*, Oxford University Press, New York, 2004.
- [27] WILD, R., *Mass Production Management*, John Wiley & Sons, London, UK, 1972.

REVIEW QUESTIONS

- 15.1 What are the four factors that favor the use of manual assembly lines?
- 15.2 What are the four reasons given in the text that explain why manual assembly lines are so productive compared to alternative methods in which multiple workers each perform all of the tasks to assemble the product?
- 15.3 What is a manual assembly line?
- 15.4 What do the terms *starving* and *blocking* mean?
- 15.5 Identify and briefly describe the three major categories of mechanized work transport systems used in production lines.
- 15.6 To cope with product variety, three types of assembly line are described in the text. Name the three types and explain the differences between them.
- 15.7 What does the term *line efficiency* mean in production line terminology?
- 15.8 The theoretical minimum number of workers on an assembly line w^* is the minimum integer that is greater than the ratio of the work content time T_{wc} divided by the cycle time T_c . Two factors are identified in the text that make it difficult to achieve this minimum value in practice. Name the two factors.
- 15.9 What is the difference between the cycle time T_c and the service time T_s ?
- 15.10 What is a minimum rational work element?
- 15.11 What is meant by the term *precedence constraint*?
- 15.12 What is meant by the term *balance efficiency*?
- 15.13 What is the difference between how the largest candidate rule works and how the Kilbridge and Wester method works?
- 15.14 What is meant by the term *manning level* in the context of a manual assembly line?
- 15.15 What are storage buffers and why are they sometimes used on a manual assembly line?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Analysis of Single-Model Assembly Lines

- 15.1 (A)** Annual demand for a new assembled product is expected to be 75,000 units. Work content time for the product is 25.8 min. The assembly line works 50 wk/yr, 40 hr/wk. Expected line efficiency is 95%. With one worker per station, determine (a) average hourly production rate, (b) cycle time, and (c) ideal minimum number of workers.
- 15.2** A new product is to be assembled on a manual assembly line. The line is to be designed to produce 100,000 units/yr. Work content time for the product is 39.5 min. The assembly line will operate 52 wk/yr, 5 shifts/wk, 8 hr/shift. Expected line efficiency is 96%. There will be one worker per station. Determine (a) average hourly production rate, (b) cycle time, and (c) ideal minimum number of workstations.
- 15.3** A product whose work content time = 52.0 min is to be assembled on a manual production line. Required production rate is 30 units/hr. From previous experience, it is estimated that proportion uptime = 0.95, balance efficiency = 93%, and repositioning time = 6 sec. Determine (a) cycle time, (b) ideal minimum number of workers required on the line, (c) more realistic estimate of the number of workers on the line when proportion uptime, balance efficiency and repositioning time are accounted for.
- 15.4** A manual assembly line has 20 workstations and produces 24 units/hr with one operator per station. Work content time to assemble the product = 41.8 min. Proportion uptime = 0.94, and repositioning time = 9 sec. Determine the balance delay.
- 15.5** A manual assembly line must be designed for a product with annual demand = 95,000 units. Work content time = 45.0 min. The line will have one worker per station and operate 50 wk/yr, 5 shifts/wk, and 7.5 hr/shift. Work units will be attached to a continuously moving conveyor. Estimated line efficiency = 0.97, balancing efficiency = 0.92, and repositioning efficiency = 0.95. Determine (a) hourly production rate to meet demand and (b) number of workers required.
- 15.6** A single model assembly line is being planned to produce a consumer appliance at the rate of 150,000 units/yr. The line will be operated 8 hr/shift, 2 shifts per day, 5 days/wk, 52 wk/yr. Work content time = 35.8 min. For planning purposes, it is anticipated that the proportion uptime on the line will be 95%. Determine (a) average hourly production rate, (b) cycle time, and (c) theoretical minimum number of workers required on the line. (d) If the balance efficiency is 0.93 and the repositioning time = 6 sec, how many workers will actually be required? (e) What is the assembly line labor efficiency?
- 15.7** Required production rate for a new product is 45 units/hr and its assembly work content time is 1.25 hr. It will be produced on an assembly line that includes four automated workstations. Because of the automated stations, the line will have an expected uptime efficiency = 90%. The remaining manual stations will each have one worker. It is anticipated that 5% of the cycle time will be lost due to repositioning at the bottleneck station. If the balance delay is expected to be 0.07, determine (a) the cycle time, (b) number of workers, and (c) assembly line labor efficiency on the line.
- 15.8** A final assembly plant for a new automobile model is to have a capacity of 180,000 units annually. The plant will operate 50 wk/yr, 2 shifts/day, 5 days/wk, and 7.5 hr/shift. It will be divided into three departments: (1) body shop, (2) paint shop, (3) general assembly department. The body shop welds the car bodies using robots, and the paint shop coats the bodies. Both of these departments are highly automated. General assembly has no automation. There are 15.0 hr of work content time on each car in this third department, where cars are moved by a continuous conveyor. In addition to the workers assembling the product on the line in general assembly, there are 25 utility workers. Determine (a) hourly production

rate of the plant, (b) number of workers and workstations in general assembly, given that its manning level is 2.4, balancing efficiency = 94%, proportion uptime = 95%, and a repositioning time of 0.15 min is allowed for each worker. (c) What is the assembly line labor efficiency in general assembly?

- 15.9 (A)** Production rate for a certain assembled product is 48 units/hr. The assembly work content time = 35 min. The line operates at 92% uptime. Ten workstations have two workers on opposite sides of the line so that both sides of the product can be worked on simultaneously. The remaining stations have one worker. Repositioning time lost by each worker is 0.15 min/cycle. It is known that the number of workers on the line is two more than the number required for perfect balance. Determine (a) number of workers, (b) number of workstations, (c) balance efficiency, and (d) average manning level (ignore utility workers).
- 15.10** The work content time is 50 min for a product assembled on a manual production line. The line uses an overhead conveyor that moves at 1.2 m/min. There are 27 workstations on the line, one-third of which have two workers; the rest have one worker each. Repositioning time per worker is 9 sec and uptime efficiency is 95%. (a) What would be the hourly production rate if the line were perfectly balanced? (b) If the actual production rate is 35 units/hr, what is the balance efficiency of the line? (c) To compensate for service time variability, it has been decided that the tolerance time should be 50% greater than the cycle time. To achieve this, what station length should be used on the line? (d) Determine the elapsed time that each base part spends on the production line?
- 15.11** The production rate of a manual assembly line is 38 units/hr. The work content time of the product made on the line is 24.8 min. Work units are attached to a moving conveyor whose speed = 1.5 m/min. Repositioning time per worker is 8 sec, line efficiency is 96%, and manning level is 1.25 (ignoring utility workers). Owing to imperfect line balancing, the number of workers needed on the line is about 10% more than the number required for perfect balance. If the workstations are arranged in a line, and the length of each station is 3.5 m, (a) how long is the entire production line, and (b) what is the elapsed time a base part spends on the line?

Line Balancing (Single-Model Lines)

- 15.12** Show that the two statements of the objective function in single-model line balancing in Equation (15.20) are equivalent.
- 15.13** The table below defines the precedence relationships and element times for a new model toy. (a) Construct the precedence diagram for this job. (b) If the ideal cycle time = 1.1 min, repositioning time = 0.1 min, and uptime proportion is assumed to be 1.0, what is the theoretical minimum number of workstations required to minimize the balance delay under the assumption that there will be one worker per station? (c) Use the largest candidate rule to assign work elements to stations. (d) Compute the balance delay for your solution.

Work Element	T_e (min)	Immediate Predecessors
1	0.5	–
2	0.3	1
3	0.8	1
4	0.2	2
5	0.1	2
6	0.6	3
7	0.4	4, 5
8	0.5	3, 5
9	0.3	7, 8
10	0.6	6, 9

- 15.14 (A)** Solve the previous problem using the Kilbridge and Wester method in part (c).
- 15.15** Solve the previous problem using the ranked positional weights method in part (c).
- 15.16** A manual assembly line is to be designed to make a small consumer product. The work elements, their times, and precedence constraints are given in the table below. The workers will operate the line for 400 min per day and must produce 300 products per day. A mechanized belt, moving at a speed of 1.25 m/min, will transport the products between stations. Because of the variability in the time required to perform the assembly operations, it has been determined that the tolerance time should be 1.5 times the cycle time of the line. (a) Determine the ideal minimum number of workers on the line. (b) Use the Kilbridge and Wester method to balance the line. (c) Compute the balance delay for your solution in part (b).

Element	Time T_e	Preceded by	Element	Time T_e	Preceded by
1	0.4 min	–	6	0.2 min	3
2	0.7 min	1	7	0.3 min	4
3	0.5 min	1	8	0.9 min	4, 9
4	0.8 min	2	9	0.3 min	5, 6
5	1.0 min	2, 3	10	0.5 min	7, 8

- 15.17** Solve the previous problem using the ranked positional weights method in part (b).
- 15.18 (A)** A manual assembly line operates with a mechanized conveyor. The conveyor moves at a speed of 5 ft/min, and the spacing between base parts launched onto the line is 4 ft. It has been determined that the line operates best when there is one worker per station and each station is 6 ft long. There are 14 work elements that must be accomplished to complete the assembly, and the element times and precedence requirements are listed in the table below. Determine (a) feed rate and corresponding cycle time, (b) tolerance time for each worker, and (c) ideal minimum number of workers on the line. (d) Draw the precedence diagram for the problem. (e) Determine an efficient line balancing solution. (f) For your solution, determine the balance delay.

Element	T_e	Preceded by	Element	T_e	Preceded by
1	0.2 min	–	8	0.2 min	5
2	0.5 min	–	9	0.4 min	5
3	0.2 min	1	10	0.3 min	6, 7
4	0.6 min	1	11	0.1 min	9
5	0.1 min	2	12	0.2 min	8, 10
6	0.2 min	3, 4	13	0.1 min	11
7	0.3 min	4	14	0.3 min	12, 13

- 15.19** A new small electrical appliance is to be assembled on a single-model assembly line. The line will be operated 250 days/yr, 15 hr/day. The work content has been divided into work elements as defined in the following table. Also given are the element times and precedence requirements. Annual production is to be 200,000 units. It is anticipated that the line efficiency will be 0.96. Repositioning time for each worker is 0.08 min. Determine (a) average hourly production rate, (b) cycle time, and (c) theoretical minimum number of workers required to meet annual production requirements. (d) Use one of the line balancing algorithms to balance the line. For your solution, determine (e) balance efficiency and (f) overall labor efficiency on the line.

Element No.	Element Description	T_e (min)	Preceded by
1	Place frame on workholder and clamp	0.15	–
2	Assemble fan to motor	0.37	–
3	Assemble bracket A to frame	0.21	1
4	Assemble bracket B to frame	0.21	1
5	Assemble motor to frame	0.58	1, 2
6	Affix insulation to bracket A	0.12	3
7	Assemble angle plate to bracket A	0.29	3
8	Affix insulation to bracket B	0.12	4
9	Attach link bar to motor and bracket B	0.30	4, 5
10	Assemble three wires to motor	0.45	5
11	Assemble nameplate to housing	0.18	–
12	Assemble light fixture to housing	0.20	11
13	Assemble blade mechanism to frame	0.65	6, 7, 8, 9
14	Wire switch, motor, and light	0.72	10, 12
15	Wire blade mechanism to switch	0.25	13
16	Attach housing over motor	0.35	14
17	Test blade mechanism, light, etc.	0.16	15, 16
18	Affix instruction label to cover plate	0.12	–
19	Assemble grommet to power cord	0.10	–
20	Assemble cord and grommet to cover plate	0.23	18, 19
21	Assemble power cord leads to switch	0.40	17, 20
22	Assemble cover plate to frame	0.33	21
23	Final inspect and remove from workholder	0.25	22
24	Package	1.75	23

Workstation Details

- 15.20 (A)** An overhead continuous conveyor is used to carry dishwasher base parts along a manual assembly line while components are being added to them. The spacing between appliances = 2.2 m and the speed of the conveyor = 1.2 m/min. The length of each workstation is 3.5 m. There are a total of 25 stations, four of which have two workers. There are also three utility workers assigned to the line. Determine (a) cycle time and feed rate, (b) tolerance time, (c) manning level, and (d) elapsed time a dishwasher base part spends on the line.
- 15.21** A moving belt line is used to assemble a product whose work content = 22 min. Production rate = 35 units/hr, and the proportion uptime = 0.96. The length of each station = 2.0 m and station manning level = 1.0 for all stations. The belt speed can be set at any value between 0.6 and 3.0 m/min. It is expected that the balance delay will be about 0.08 or slightly higher. Time lost for repositioning each cycle is 6 sec. (a) Determine the number of stations needed on the line. (b) Using a tolerance time that is 50% greater than the cycle time, what would be an appropriate belt speed and spacing between parts?
- 15.22** In the general assembly department of an automobile final assembly plant, there are 495 workstations, and the cycle time = 0.93 min. If each workstation is 6.2 m long, and the tolerance time = the cycle time, determine the following: (a) speed of the conveyor, (b) center-to-center spacing between units on the line, (c) total length of the general assembly line, assuming no vacant space between stations, and (d) elapsed time a work unit spends in the general assembly department.
- 15.23** Total work content for a product assembled on a manual production line is 33.0 min. Production rate of the line must be 47 units/hr. Base parts are attached to a moving conveyor whose speed = 2.2 m/min. Repositioning time per worker is 6 sec, and line efficiency

is 94%. Due to imperfect line balancing, the number of workers needed on the line must be two more workers than the number required for perfect balance. Manning level = 1.6, excluding utility workers. Determine (a) the number of workers and (b) the number of workstations on the line. (c) What is the balance efficiency for this line? (d) If the workstations are arranged in a line, and the length of each station is 3.3 m, what is the tolerance time in each station? (e) What is the elapsed time a work unit spends on the line?

- 15.24** A manual assembly line is to be designed for a certain major appliance whose assembly work content time = 2.0 hours. The line will be designed for an annual production rate of 100,000 units. The plant will operate one 8-hr shift per day, 250 days/yr. A continuous conveyor system will be used and it will operate at a speed = 1.6 m/min. The line must be designed under the following assumptions: balance delay = 6%, uptime efficiency = 96%, repositioning time = 6 sec for each worker, and average manning level = 1.25, not counting utility workers. (a) How many workers will be required to operate the assembly line? If each station is 2.0 m long, (b) how long will the production line be, and (c) what is the elapsed time a work unit spends on the line?

Batch-Model and Mixed-Model Assembly Lines (Appendix 15A)

- 15.25** Two products are to be produced on a batch-model assembly line that will operate 40 hr/wk and 50 wk/yr, but some of that time must be devoted to product changeovers between batches. Annual demand (D_{aj}), batch quantities (Q_j), work content time (T_{wcj}), and changeover time (T_{suj}) for each product are listed in the table below. The anticipated line efficiency = 0.97, balance efficiency = 0.95, and repositioning time = 0.2 min. Determine (a) number of workers on the line, (b) production rates for the two products, and (c) the production schedule for the year. (d) Could the number of workers be reduced if the batch sizes were doubled? If so, by how many workers?

Product	D_{aj}	Q_j	T_{wcj}	T_{suj}
A	16,000	800	48 min	6 hr
B	22,000	1,100	39 min	5 hr

- 15.26 (A)** A batch-model assembly line is being planned to produce three portable power tools: a drill, a sander, and a jig saw. The three models will be produced in batches because annual demand for each power tool is not sufficient to employ a line full time for each. Time to change over the line between production runs is 4 hr. The line will operate 40 hr/wk, 50 wk/yr, 1 worker per station. Data on work content time, cycle time, and annual demand are presented in the table below. Estimated line efficiency = 0.95 and balance efficiency = 0.93. Repositioning time per worker = 9 sec. Batches of each power tool will be produced 10 times/yr, with batch quantities proportional to annual demand for each product. Determine (a) the number of workers on the line, (b) the production rates for the three products, and (c) the production schedule for the year.

Product	Work Content Time	Annual Demand
A Drill	26 min	30,000
B Sander	19 min	18,000
C Jig saw	28 min	12,000

- 15.27** Two models, A and B, are to be produced on a mixed-model assembly line that operates 2,000 hr/yr. Annual demand and work content time for model A are 24,000 units and 32.0 min,

respectively; and for model B are 40,000 and 21.0 min. Line efficiency = 0.95, balance efficiency = 0.93, repositioning time = 0.10 min, and manning level = 1 for all stations. Determine how many workers must be on the production line in order to produce this workload.

- 15.28 (A)** Three models, A, B, and C, will be produced on a mixed-model assembly line. Hourly production rate and work content time for model A are 10 units/hr and 45.0 min; for model B are 20 units/hr and 35.0 min; and for model C are 30 units/hr and 25.0 min. Line efficiency is 95%, balance efficiency is 0.94, repositioning efficiency = 0.93, and manning level = 1.3. Determine how many workers and workstations must be on the production line in order to produce this workload.
- 15.29** For Problem 15.27, determine the variable rate launching intervals for models A and B.
- 15.30** For Problem 15.28, determine the variable rate launching intervals for models A, B, and C.
- 15.31** For Problem 15.27, determine (a) the fixed rate launching interval, and (b) the launch sequence of models A and B during 1 hr of production.
- 15.32** For Problem 15.28, determine (a) the fixed rate launching interval, and (b) the launch sequence of models A, B, and C during 1 hr of production.
- 15.33** Two models, A and B, are to be assembled on a mixed-model line. Hourly production rates for the two models are: A, 25 units/hr; and B, 18 units/hr. The work elements, element times, and precedence requirements are given in the table below. Elements 6 and 8 are not required for model A, and elements 4 and 7 are not required for model B. Assume $E = 1.0$, $E_r = 1.0$, and $M_i = 1$. (a) Construct the precedence diagram for each model and for both models combined into one diagram. (b) Find the theoretical minimum number of workstations required to achieve the required production rate. (c) Use the Kilbridge and Wester method to solve the line balancing problem. (d) Determine the balance efficiency for your solution in (c).

Work Element k	T_{eAk}	Preceded by	T_{eBk}	Preceded by
1	0.5 min	–	0.5 min	–
2	0.3 min	1	0.3 min	1
3	0.7 min	1	0.8 min	1
4	0.4 min	2	–	–
5	1.2 min	2, 3	1.3 min	2, 3
6	–	–	0.4 min	3
7	0.6 min	4, 5	–	–
8	–	–	0.7 min	5, 6
9	0.5 min	7	0.5 min	8
T_{wc}	4.2 min		4.5 min	

- 15.34** For the data given in Problem 15.33, solve the mixed-model line balancing problem except use the ranked positional weights method to determine the order of entry of work elements.
- 15.35** Three models, A, B, and C, are to be assembled on a mixed-model line. Hourly production rates for the three models are: A, 15 units/hr; B, 10 units/hr; and C, 5 units/hr. The work elements, element times, and precedence requirements are given in the following table. Assume $E = 1.0$, $E_r = 1.0$, and $M_i = 1$. (a) Construct the precedence diagram for each model and for all three models combined into one diagram. (b) Find the theoretical minimum number of workstations required to achieve the required production rate. (c) Use the Kilbridge and Wester method to solve the line balancing problem. (d) Determine the balance efficiency for the solution in (c).

Element	T_{eAk}	Preceded by	T_{eBk}	Preceded by	T_{eCk}	Preceded by
1	0.6 min	–	0.6 min	–	0.6 min	–
2	0.5 min	1	0.5 min	1	0.5 min	1
3	0.9 min	1	0.9 min	1	0.9 min	1
4	–		0.5 min	1	–	
5	–		–		0.6 min	1
6	0.7 min	2	0.7 min	2	0.7 min	2
7	1.3 min	3	1.3 min	3	1.3 min	3
8	–		0.9 min	4	–	
9	–		–		1.2 min	5
10	0.8 min	6, 7	0.8 min	6, 7, 8	0.8 min	6, 7, 9
T_{wc}	4.8 min		6.2 min		6.6 min	

15.36 For the data given in Problem 15.35, (a) solve the mixed-model line balancing problem except that line efficiency = 0.96 and repositioning efficiency = 0.95. (b) Determine the balance efficiency for your solution.

15.37 For Problem 15.35, determine (a) the fixed rate launching interval and (b) the launch sequence of models A, B, and C during 1 hr of production.

15.38 Two similar models, A and B, are to be produced on a mixed-model assembly line. There are four workers and four stations on the line ($M_i = 1$ for $i = 1, 2, 3, 4$). Hourly production rates for the two models are: for A, 7 units/hr; and for B, 5 units/hr. The work elements, element times, and precedence requirements for the two models are given in the table below. As the table indicates, most elements are common to both models. Element 5 is unique to model A, while elements 8 and 9 are unique to model B. Assume $E = 1.0$ and $E_r = 1.0$. (a) Develop the mixed-model precedence diagram for the two models and for both models combined. (b) Determine a line balancing solution that allows the two models to be produced on the four stations at the specified rates. (c) Using your solution from (b), solve the fixed rate model launching problem by determining the fixed rate launching interval and constructing a table to show the sequence of model launchings during the hour.

Work Element k	T_{eAk}	Preceded by	T_{eBk}	Preceded by
1	1 min	–	1 min	–
2	3 min	1	3 min	1
3	4 min	1	4 min	1, 8
4	2 min	–	2 min	8
5	1 min	2	–	–
6	2 min	2, 3, 4	2 min	2, 3, 4
7	3 min	5, 6	3 min	6, 9
8	–	–	4 min	–
9	–	–	2 min	4
T_{wc}	16 min		21 min	

APPENDIX 15A: BATCH-MODEL AND MIXED-MODEL LINES

This appendix explores some of the approaches that can be used to plan and analyze batch-model and mixed-model assembly lines.

15A.1 Batch-Model Assembly Lines

A batch-model production line (BMAL) produces different products in batches. It is appropriate when product variety is too great for the products to be produced on a mixed-model line. Its disadvantage is that downtime occurs when the line is changed over from one product to the next. On the other hand, there must be some similarity among the products or it would make no sense to try to assemble them on the same basic line.

The equations developed in Section 15.2 to analyze a single-model line can be adapted for the BMAL. To determine the average production rate for the line based on annual demand, the sum of demands for all of the products to be made on the line is used:

$$R_p = \frac{\sum_{j=1}^P D_{aj}}{50S_w H_{sh} - T_d} \quad (15A.1)$$

where D_{aj} = demand for product j , units/hr, and the summation is carried out over the number of products to be made on the line P ; and T_d = total downtime during the year for changeovers between products. From this, the average cycle time can be determined from Equation (15.2): $T_c = 60E/R_p$, where T_c = average cycle time, min/pc and E = line efficiency. Average in this instance means the average over the P products made on the line. The average service time is the cycle time less the repositioning time T_r , which is assumed to be the same for all stations and products: $T_s = T_c - T_r$.

To determine the number of workers on the line, a weighted average of the work content times is used, where the weighting is based on the annual demands for each product:

$$w = \text{Minimum Integer} \geq \frac{\sum_{j=1}^P D_{aj} T_{wcj}}{E_b T_s} \quad (15A.2)$$

where E_b = anticipated line balance efficiency. If there is one worker per station (typical), then Equation (15A.2) also gives the number of stations.

Now that the number of workers and stations has been determined, each product j will be produced at its own service time and associated cycle time and production rate. The service time for product j can be determined by rearranging Equation (15.14) as follows:

$$T_{sj} = \frac{T_{wcj}}{wE_b} \quad (15A.3)$$

where T_{wcj} = work content time for product j , min/unit. Then, the cycle time for product j is

$$T_{cj} = T_{sj} + T_r \quad (15A.4)$$

The corresponding production rate for product j is calculated by rearranging Equation (15.2):

$$R_{pj} = \frac{60E}{T_{cj}} \quad (15A.5)$$

The following example illustrates the use of these equations as well as the issues of changeover and scheduling in a batch-model line.

EXAMPLE 15A.1 Analysis of a Batch-Model Assembly Line

Two products, A and B, are to be produced on a BMAL. The plant operates 2,000 hr/yr, but the downtime between batches is 5 hr. Annual demand, work content time, and batch quantities for the two products are given in the following table:

Product j	D_{aj} (units/yr)	T_{wcj} (min)	Q_j (units)
A	20,000	30.0	2,000
B	35,000	40.0	3,500

The anticipated line efficiency = 0.96 and balance efficiency = 0.94, and repositioning time = 0.1 min. Determine (a) the number of workers required on the line, (b) the production rates for the two products, and (c) the production schedule for the year.

Solution: (a) Given the annual demands and batch quantities, the number of batches (and changeovers resulting in downtime) will be 10 for each product, or a total of 20. At 5 hr each, that is $20(5) = 100$ hr of downtime. The total annual demand for both products is $20,000 + 35,000 = 55,000$. Using Equation (15A.1),

$$\text{Average } R_p = \frac{55,000}{2,000 - 100} = 28.95 \text{ units/hr}$$

Average cycle time $T_c = 60(0.96)/28.95 = 1.99$ min, and average service time $T_s = 1.99 - 0.1 = 1.89$ min. The weighted average work content time = 36.36 min. The number of workers on the line is determined from Equation (15A.2):

$$w = \text{Minimum Integer } \frac{36.36}{1.89(0.94)} = 20.47 \text{ rounded up to } \mathbf{21 \text{ workers}}$$

With one worker per station, the number of workstations $n = 21$.

(b) The service time for product A is $T_{sA} = 30/(21 \times 0.94) = 1.52$ min, its cycle time $T_{cA} = 1.62$ min, and its production rate $R_{pA} = 60(0.96)/1.62 = \mathbf{35.56 \text{ units/hr}}$.

The service time for product B is $T_{sB} = 40/(21 \times 0.94) = 2.03$ min, its cycle time $T_{cB} = 2.13$ min, and its production rate $R_{pB} = 60(0.96)/2.13 = \mathbf{27.09 \text{ units/hr}}$.

(c) Batch quantities are specified in the table: $Q_A = 2,000$ and $Q_B = 3,500$. The production schedule will be to set up the line for product A (5 hr) and produce the batch ($2,000/35.56 = 56.25$ hr), and then change over to product B (5 hr) and produce the batch ($3,500/27.09 = 129.20$ hr). This cycle is repeated 10 times during the year. Total time = $10(5 + 56.25 + 5 + 129.20) = 1,954.5$ hr. This is slightly less than 2,000 hr because the number of workers was rounded up from 20.47 to 21. □

The BMAL line balancing problem can be solved separately for each product made on the line, using the same line balancing methods used for single-model lines (Section 15.3). Some attempt is usually made to assign similar tasks to the same stations from one product to the next.

15A.2 Mixed-Model Assembly Lines

Unlike the batch-model line, a mixed-model assembly line (MMAL) is capable of producing a variety of different product models simultaneously and continuously (not in batches). Each workstation specializes in a certain set of assembly work elements, but the stations are sufficiently flexible that they can perform their respective tasks on different models. This section covers some of the technical issues related to mixed-model assembly lines, specifically (1) determining the number of workers and other operating parameters, (2) line balancing, and (3) model launching.

Number of Workers on the Line. To determine the overall production rate on the MMAL, Equation (15.1) is adapted in the same way as for the BMAL:

$$R_p = \frac{\sum_{j=1}^P D_{aj}}{50S_w H_{sh}} \quad (15A.6)$$

Note that the denominator in this equation needs no downtime adjustment compared to Equation (15A.1) because there is no lost production time between models in the MMAL. The production rate of each model can be determined from its respective demand rate:

$$R_{pj} = \frac{D_{aj}}{50S_w H_{sh}} \quad (15A.7)$$

The individual production rates will sum to the overall rate:

$$R_p = \sum_{j=1}^P R_{pj} \quad (15A.8)$$

From this average production rate, the average cycle time and average service time can be determined for models produced on the line: $T_c = 60E/R_p$ and $T_s = T_c - T_r$.

Determining the number of workers on the line is again based on a weighted average work content time as defined in Equation (15A.2), repeated here:

$$w = \text{Minimum Integer} \frac{\sum_{j=1}^P D_{aj} T_{wcj}}{E_b T_s \sum_{j=1}^P D_{aj}}$$

If production rates for each model are known rather than annual demands, then the number of workers can be determined using Equation (15.5): $w = WL/AT$, where workload is defined as the summation of $R_{pj} T_{wcj}$ for all j , and AT is the available time per worker during the period under consideration (e.g., $AT = 60EE_r E_b$).

EXAMPLE 15A.2 Number of Workers on a Mixed-Model Line

The annual demand and work content time for two models to be produced on a mixed-model assembly line with one worker per station are given in the following table:

Model j	D_{aj} (units/yr)	T_{wcj} (min)
A	8,000	27.0
B	12,000	25.0

Anticipated line efficiency = 0.96 and balance efficiency = 0.92. Repositioning time = 0.15 min. The line will operate 2,000 hr/yr. Determine (a) the hourly production rate for each model and the overall production rate and (b) the number of workers on the line.

Solution: (a) Hourly production rate of model A is $R_{pA} = 8,000/2,000 = 4.0$ units/hr. Production rate of model B is $R_{pB} = 12,000/2,000 = 6.0$ units/hr. Overall production rate $R_p = 4 + 6 = 10$ units/hr.

(b) The weighted average work content time by Equation (15A.2) is 25.80 min. The average cycle time is $T_c = 60(0.96)/10 = 5.76$ min. Average service time $T_s = 5.76 - 0.15 = 5.61$ min. Anticipated balance efficiency is given as 0.92. Using these values, the number of workers is calculated as:

$$w = \text{Minimum Integer} \geq \frac{25.8}{5.61(0.92)} = 4.999 \text{ rounded up to } \mathbf{5 \text{ workers}}$$

Mixed-Model Line Balancing. Algorithms to solve the mixed-model line balancing problem are usually adaptations of methods for single-model lines. The present treatment of this topic is admittedly limited. Mixed-model line balancing and its companion problem, model sequencing, is covered in greater depth in several of the references, including [7], [22], [23], [24], [27]. A literature review of these topics is presented in [11].

In single-model line balancing, work element times are utilized to balance the line, as in Section 15.3. In mixed-model assembly line balancing, total work element times per hour (or per shift) are used. The objective function can be expressed as

$$\text{Minimize } (wAT - WL) \text{ or Minimize } \sum_{i=1}^w (AT - TT_{si}) \quad (15A.9)$$

where w = number of workers or stations (again assuming the $M_i = 1$, so $n = w$); AT = available time in the period of interest (e.g., hour, shift), min/hr/worker; WL = workload to be accomplished during the same period, min/hr; and TT_{si} = total service time at station i to perform its assigned portion of the workload, min.

The two statements in Equation (15A.9) are equivalent. Hourly workload can be calculated by summing the production rates by the work content times for all products:

$$WL = \sum_{j=1}^P R_{pj} T_{wcj} \quad (15A.10)$$

To determine total service time at station i , first compute the total time to perform each element in the workload. Let T_{ejk} = time to perform work element k on product j . The total time per element is given by

$$TT_k = \sum_{j=1}^P R_{pj} T_{ejk} \quad (15A.11)$$

where TT_k = total time within the workload that must be allocated to element k for all products, min. Based on these TT_k values, element assignments can be made to each station according to one of the line balancing algorithms. Total service times at each station are computed:

$$TT_{si} = \sum_{k \in i} TT_k \quad (15A.12)$$

where TT_{si} = total service time at station i which equals the sum of the times of the elements that have been assigned to that station, min.

Measures of balance efficiency for mixed-model assembly line balancing correspond to those in single-model line balancing,

$$E_b = \frac{WL}{w(\text{Max}\{TT_{si}\})} \quad (15A.13)$$

where E_b = balance efficiency; WL = workload from Equation (15A.10), min; w = number of workers (stations); and $\text{Max}\{TT_{si}\}$ = maximum value of total service time among all stations in the solution. It is possible that the line balancing solution will yield a value of $\text{Max}\{TT_{si}\}$ that is less than the available total time AT . This situation occurs in the following example.

EXAMPLE 15A.3 Mixed-Model Assembly Line Balancing

This is a continuation of Example 15A.2. For the two models A and B, hourly production rates are 4 units/hr for A and 6 units/hr for B. Most of the work elements are common to the two models, but in some cases the elements take longer for one model than for the other. The elements, times, and precedence requirements are given in Table 15A.1. Also given: $E = 0.96$, repositioning

TABLE 15A.1 Work Elements for Models A and B in Example 15A.3

Work Element k	T_{eAK} (min)	Preceded by	T_{eBK} (min)	Preceded by
1	3	–	3	–
2	4	1	4	1
3	2	1	3	1
4	6	1	5	1
5	3	2	–	–
6	4	3	2	3
7	–	–	4	4
8	5	5, 6	4	7
T_{wc}	27		25	

time $T_r = 0.15$ min, and $M_i = 1$ for all i . (a) Construct the precedence diagram for each model and for both models combined into one diagram. (b) Use the Kilbridge and Wester method to solve the line balancing problem. (c) Determine the balance efficiency for the solution in (b).

Solution: (a) The precedence diagrams are shown in Figure 15A.1.

(b) To use the Kilbridge and Wester method, (1) calculate total production time requirements for each work element, TT_k , according to Equation (15A.11); this is done in Table 15A.2; (2) arrange the elements according to columns in the precedence diagram, as in Table 15A.3 (within columns, the elements are

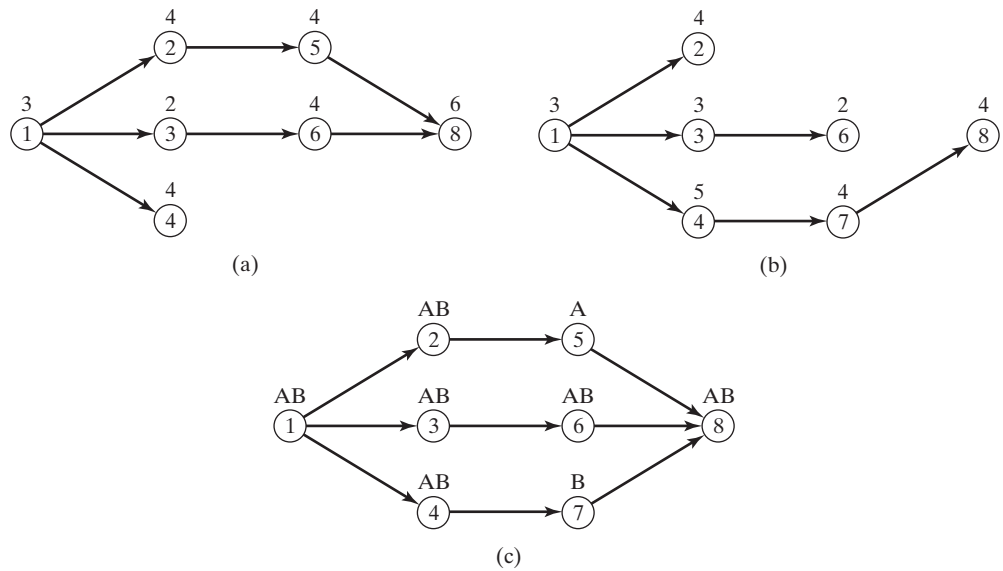


Figure 15A.1 Precedence diagrams for Example 15A.3: (a) for model A, (b) for model B, and (c) for both models combined.

TABLE 15A.2 Total Times Required for Each Element in Each Model to Meet Respective Production Rates and for Both Models in Example 15A.3

Element k	$R_{pA}T_{eAk}$ (min)	$R_{pB}T_{eBk}$ (min)	$\sum_{j=A,B} R_{pj}T_{ejk}$ (min)
1	12	18	30
2	16	24	40
3	8	18	26
4	24	30	54
5	12	0	12
6	16	12	28
7	0	24	24
8	20	24	44
			258

TABLE 15A.3 Elements Arranged in Columns in Example 15A.3

Element	Column	TT_k (min)	Preceded by
1	I	30	–
4	II	54	1
2	II	40	1
3	II	26	1
6	III	28	3
7	III	24	4
5	III	12	2
8	IV	44	5, 6, 7

listed according to the largest candidate rule); and (3) allocate elements to workstations by using the three-step procedure defined in Section 15.3.1. To accomplish this third step, the available time per worker is computed, given proportion uptime $E = 0.96$ and repositioning efficiency E_r . To determine E_r , note that the total production rate $R_p = 4 + 6 = 10$ units/hr. The corresponding cycle time is found by multiplying the reciprocal of this rate by proportion uptime E and accounting for the difference in time units, as follows:

$$T_c = \frac{60(0.96)}{10} = 5.76 \text{ min}$$

The service time each cycle is the cycle time less the repositioning time T_r :

$$T_s = 5.76 - 0.15 = 5.61 \text{ min}$$

Now repositioning efficiency can be determined as follows:

$$E_r = 5.61/5.76 = 0.974$$

Hence, the available time against which the line is to be balanced is:

$$AT = 60(0.96)(0.974) = 56.1 \text{ min}$$

Allocating elements to stations against this limit, the final solution is presented in Table 15A.4.

TABLE 15A.4 Allocation of Work Elements to Stations in Example 15A.3 by Using the Kilbridge and Wester Method

Station i	Element	TT_k (min)	TT_{si} (min)
1	1	30	
	3	26	56
2	4	54	54
3	2	40	
	5	12	52
4	6	28	
	7	24	52
5	8	44	44
			258

(c) Balance efficiency is determined by Equation (15A.13). $\text{Max}\{TT_{si}\} = 56$ min. Note that this is slightly less than the available time of 56.1 min, so the line will operate slightly faster than originally planned.

$$E_b = \frac{258}{5(56)} = 0.921 = 92.1\%$$

Model Launching in Mixed-Model Lines. It was previously noted that production on a manual assembly line typically involves launching of base parts onto the beginning of the line at regular time intervals. In a single-model line, this time interval is constant and set equal to the cycle time T_c . The same applies for a batch-model line, but T_c is likely to differ for each batch because the models are different and their production requirements are probably different. In a mixed-model line, model launching is more complicated because each model is likely to have a different work content time, which translates into different station service times. Thus, the time interval between launches and the selection of which model to launch are interdependent. For example, if a series of models with high work content times are launched at short time intervals, the assembly line will quickly become congested (overwhelmed by too much work). On the other hand, if a series of models with low work content times are launched at long time intervals, then stations will be starved for work (with resulting idleness). Neither congestion nor idleness is desirable.

Determining the time interval between successive launches is referred to as the *launching discipline*. Two alternative launching disciplines are available for mixed-model assembly lines: (1) variable-rate launching and (2) fixed-rate launching.

Variable-Rate Launching. In variable-rate launching, the time interval between the launching of the current base part and the next is set equal to the cycle time of the current unit. Since different models have different work content times and thus different task times per station, their cycle times and launch time intervals vary. The time interval in variable-rate launching can be expressed as

$$T_{cv}(j) = \frac{T_{wcj}}{wE_rE_b} \quad (15A.14)$$

where $T_{cv}(j)$ = time interval before the next launch in variable-rate launching, min; T_{wcj} = work content time of the product just launched (model j), min; w = number of workers on the line; E_r = repositioning efficiency; and E_b = balance efficiency. If manning level $M_i = 1$ for all i , then the number of stations n can be substituted for w . With variable-rate launching, as long as the launching interval is determined by this formula, then models can be launched in any sequence desired.

EXAMPLE 15A.4 Variable-Rate Launching in a Mixed-Model Assembly Line

Determine the variable-rate launching intervals for models A and B in Examples 15A.2 and 15A.3. From the results of Example 15A.3, $E_r = 0.974$ and $E_b = 0.921$.

Solution: Applying Equation (15A.14) for model A,

$$T_{cv}(\text{A}) = \frac{27.0}{5(.974)(.921)} = 6.020 \text{ min}$$

And for model B,

$$T_{cv}(\text{B}) = \frac{25.0}{5(.974)(.921)} = 5.574 \text{ min}$$

When a unit of model A is launched onto the front of the line, 6.020 min must elapse before the next launch. When a unit of model B is launched onto the front of the line, 5.574 min must elapse before the next launch.

The advantage of variable-rate launching is that units can be launched in any order without causing idle time or congestion at workstations, as long as the specified model mix is achieved by the end of the shift. The model mix can be adjusted at a moment's notice to adapt to changes in demand for the various products made on the line. However, certain technical and logistical issues must be addressed when variable-rate launching is used. One technical issue is that the work carriers on a moving conveyor are usually located at constant intervals along its length and so the work units must be attached only at these positions. This is not compatible with variable-rate launching which presumes that work units can be attached at any location along the conveyor corresponding to the variable-rate launching interval T_{cv} for the preceding model. One of the logistical issues in variable-rate launching is the problem of supplying the correct components and subassemblies to the individual stations for the models being assembled on the line at any given moment. Because of these kinds of issues, industry seems to prefer fixed-rate launching.

Fixed-Rate Launching for Two Models. In fixed-rate launching, the time interval between two consecutive launches is constant. This launching discipline is usually set by the speed of the conveyor and the spacing between work carriers (e.g., hooks on a chain conveyor occur at regular spacings in the chain). The time interval in fixed-rate launching depends on the product mix and production rates of models on the line. Of course, the schedule must be consistent with the time and manpower available on the line, so repositioning efficiency and line balance efficiency must be figured in. Given the hourly production schedule, as well as values of E_r and E_b , the launching time interval is determined as

$$T_{cf} = \frac{\frac{1}{R_p} \sum_{j=1}^P R_{pj} T_{wcj}}{w E_r E_b} \quad (15A.15)$$

where T_{cf} = time interval between launches in fixed-rate launching, min; R_{pj} = production rate of model j , units/hr; T_{wcj} = work content time of model j , min/unit; R_p = total production rate of all models in the schedule or simply the sum of R_{pj} values; P = the number of models produced in the scheduled period, $j = 1$ or 2 ($P = 2$); and w , E_r , and E_b have the same meaning as before. If manning level $M_i = 1$ for all i , then n can be used in place of w in the equation.

In fixed-rate launching, the models must be launched in a specific sequence; otherwise, station congestion and/or idle time (starving) will occur. Several algorithms, each with advantages and disadvantages, have been developed to select the model sequence [6], [10], [22], [24], [27]. In the present coverage, the findings of this previous research are synthesized to provide two approaches to the fixed-rate launching problem, one that works for two models and another that works for three or more models.

Congestion and idle time can be identified in each successive launch as the difference between the cumulative fixed-rate launching interval and the sum of the launching intervals for the individual models that have been launched onto the line. This difference can be expressed mathematically as

$$\text{Congestion time or idle time} = \sum_{h=1}^m T_{cjh} - mT_{cf} \quad (15A.16)$$

where T_{cf} = fixed-rate launching interval determined by Equation (15A.15), m = launch sequence during the period of interest; h = launch index number for summation purposes; and T_{cjh} = the cycle time associated with model j in launch position h , min, calculated as

$$T_{cjh} = \frac{T_{wcj}}{wE_r E_b} \quad (15A.17)$$

where the symbols on the right-hand side of the equation are the same as for Equation (15A.14).

Congestion is recognized when Equation (15A.16) yields a positive difference, indicating that the actual sum of task times for the models thus far launched (m) exceeds the planned cumulative task time. Idle time is identified when Equation (15A.16) yields a negative value, indicating that the actual sum of task times is less than the planned time for the current launch m . It is desirable to minimize both congestion and idle time. Accordingly, the following procedure is proposed, in which the model sequence is selected so that the square of the difference between the cumulative fixed-rate launching interval and the cumulative individual model-launching interval is minimized for each launch. Expressing this procedure in equation form,

$$\text{For each launch } m, \text{ select } j \text{ so as to minimize } \left(\sum_{h=1}^m T_{cjh} - mT_{cf} \right)^2 \quad (15A.18)$$

where all terms have been defined above.

EXAMPLE 15A.5 Fixed-Rate Launching for Two Models

Determine: (a) the fixed-rate launching interval for the production schedule in Example 15A.2, and (b) the launch sequence of models A and B during the hour. Use E_r and E_b from Example 15A.3.

Solution: (a) The combined production rate of models A and B is $R_p = 4 + 6 = 10$ units/hr. The fixed time interval is computed by using Equation (15A.15):

$$T_{cf} = \frac{1}{10} \frac{(4(27) + 6(25))}{5(.974)(.921)} = 5.752 \text{ min}$$

TABLE 15A.5 Fixed-Rate Launching Sequence for Example 15A.5

Launch m	mT_{cf}	$\left(\sum_{h=1}^{m-1} T_{cjh} + T_{cAm} - mT_{cf}\right)^2$	$\left(\sum_{h=1}^{m-1} T_{cjh} + T_{cBm} - mT_{cf}\right)^2$	Model
1	5.752	0.072	0.032	B
2	11.504	0.008	0.127	A
3	17.256	0.128	0.008	B
4	23.008	0.032	0.071	A
5	28.760	0.201	0.000	B
6	34.512	0.073	0.031	B
7	40.264	0.008	0.125	A
8	46.016	0.130	0.007	B
9	51.768	0.033	0.070	A
10	57.520	0.202	0.000	B

(b) To use the sequencing rule in Equation (15A.18), compute T_{cjh} for each model by Equation (15A.17). The values are the same as those computed in Example 15A.4 for the variable-launching case: for model A, $T_{cAh} = 6.020$ min; and for model B, $T_{cBh} = 5.574$ min.

To select the first launch, compare

$$\text{For model A, } (6.020 - 1(5.752))^2 = 0.072$$

$$\text{For model B, } (5.574 - 1(5.752))^2 = 0.032$$

The value is minimized for model B; therefore, a base part for model B is launched first ($m = 1$). To select the second launch, compare

$$\text{For model A, } (5.574 + 6.020 - 2(5.752))^2 = 0.008$$

$$\text{For model B, } (5.574 + 5.574 - 2(5.752))^2 = 0.127$$

The value is minimized for model A; therefore, a base part for model A is launched second ($m = 2$). The procedure continues in this way, with the results displayed in Table 15A.5. □

Fixed-Rate Launching for Three or More Models. The reader will note that four units of A and six units of B are scheduled in the sequence in Table 15A.5, which is consistent with the production rate data given in the original example. This schedule is repeated each successive hour. When only two models are being launched in a mixed-model assembly line, Equation (15A.18) yields a sequence that matches the desired schedule used to calculate T_{cf} and T_{cjh} . However, when three or more models are being launched onto the line, Equation (15A.18) is likely to yield a schedule that does not provide the desired model mix during the period. What happens is that models whose T_{cjh} values are close to T_{cf} are overproduced, while models with T_{cjh} values significantly different from T_{cf} are underproduced or even omitted from the schedule. The sequencing procedure can be adapted for the case of three or more models by adding a term to the equation that forces the desired schedule to be met. The additional term is the ratio

of the quantity of model j to be produced during the period divided by the quantity of model j units that have yet to be launched in the period, that is,

$$\text{Additional term for three or more models} = \frac{R_{pj}}{Q_{jm}}$$

where R_{pj} = quantity of model j to be produced during the period, that is, the production rate of model j , units/hr; and Q_{jm} = quantity of model j units remaining to be launched during the period as m (number of launches) increases, units/hr. Accordingly, the fixed-rate launching procedure for three or more models can be expressed as

$$\text{For each launch } m, \text{ select } j \text{ so as to minimize } \left(\sum_{h=1}^m T_{cjh} - mT_{cf} \right)^2 + \frac{R_{pj}}{Q_{jm}} \quad (15A.19)$$

where all terms have been previously defined. The effect of the additional term is to reduce the chances that a unit of any model j will be selected for launching as the number of units of that model already launched during the period increases. When the last unit of model j scheduled during the period has been launched, the chance of launching another unit of model j becomes zero.

Selecting the sequence in fixed-rate launching can sometimes be simplified by dividing all R_{pj} values in the schedule by the largest common denominator (if one exists) that results in a set of new values all of which are integers. For instance, in Example 15A.5 the hourly schedule consists of four units of model A and six units of model B. Both numbers are divisible by two, reducing the schedule to two units of A and three units of B every half hour. These values can then be used in the ratio in Equation (15A.19). The model sequence obtained from Equation (15A.19) is then repeated as necessary to fill out the hour or shift.

EXAMPLE 15A.6 Fixed-Rate Launching for Three Models

A third model, C, is added to the production schedule in Example 15A.5. Two units of model C will be produced each hour, and its work content time = 30 min. The proportion of uptime $E = 0.96$, as before.

Solution: To begin, the total hourly production rate is calculated:

$$R_p = 4 + 6 + 2 = 12 \text{ units/hr}$$

Cycle time is determined based on this rate and the given value of proportion uptime E :

$$T_c = \frac{60(0.96)}{12} = 4.80 \text{ min}$$

Then

$$T_s = 4.80 - 0.15 = 4.65 \text{ min}$$

Using these values, the repositioning efficiency is determined:

$$E_r = 4.65/4.80 = 0.96875$$

To determine balance efficiency, the workload is divided by the available time on the line, where available time is adjusted for line efficiency E and repositioning efficiency E_r . Workload is computed as follows:

$$WL = 4(27) + 6(25) + 2(30) = 318 \text{ min/hr}$$

Available time to be used in line balancing is thus

$$AT = 60(.96)(.96875) = 55.80 \text{ min/hr/worker}$$

The number of workers (and stations, since $M_i = 1$) required is given by

$$w = \text{Minimum Integer} \geq \frac{318}{55.8} = 5.7 \text{ rounded up to 6 workers}$$

For this example, it is assumed that the line can be balanced with six workers, leading to the following balance efficiency:

$$E_b = \frac{318}{6(55.8)} = 0.94982$$

Using the values of E_r and E_b in Equation (15A.15), the fixed-rate launching interval is calculated:

$$T_{cf} = \frac{\frac{1}{12}(318)}{6(0.96875)(0.94982)} = 4.80 \text{ min}$$

The T_{cjh} values for each model are, respectively,

$$T_{cAh} = \frac{27}{6(0.96875)(0.94982)} = 4.891 \text{ min}$$

$$T_{cBh} = \frac{25}{6(0.96875)(0.94982)} = 4.528 \text{ min}$$

$$T_{cCh} = \frac{30}{6(0.96875)(0.94982)} = 5.434 \text{ min}$$

Note that the models A, B, and C are produced at rates of four, six, and two units per hour. Dividing by two these rates can be reduced to 2, 3, and 1 per half hour, respectively. These are the values that will be used in the additional term of Equation (15A.19), given that the starting values of Q_{jm} for $m = 1$ are $Q_{A1} = 2$, $Q_{B1} = 3$, and $Q_{C1} = 1$.

$$\text{For model A, } (4.891 - 4.80)^2 + \frac{2}{2} = 1.008$$

$$\text{For model B, } (4.528 - 4.80)^2 + \frac{3}{3} = 1.074$$

$$\text{For model C, } (5.434 - 4.80)^2 + \frac{1}{1} = 1.402$$

The minimum value occurs if a unit of model A is launched. Thus, the first launch ($m = 1$) is model A. The value of Q_{A1} is decremented by the one unit already launched, so that $Q_{A2} = 1$. For the second launch,

TABLE 15A.6 Fixed-Rate Launching Sequence for Example 15A.6

m	mT_{cf}	$\left(\sum_{h=1}^{m-1} T_{cjh} + T_{cAm} - mT_{cf}\right)^2 + \frac{R_{pA}}{Q_{Am}}$	$\left(\sum_{h=1}^{m-1} T_{cjh} + T_{cBm} - mT_{cf}\right)^2 + \frac{R_{pB}}{Q_{Bm}}$	$\left(\sum_{h=1}^{m-1} T_{cjh} + T_{cCm} - mT_{cf}\right)^2 + \frac{R_{pC}}{Q_{Cm}}$	Model
1	4.80	1.008	1.074	1.402	A
2	9.60	2.033	1.033	1.526	B
3	14.40	2.008	1.705	1.205	C
4	19.20	2.296	1.526	∞	B
5	24.00	2.074	3.008	∞	A
6	28.80	∞	3.000	∞	B

$$\text{For model A, } (4.891 + 4.891 - 2(4.80))^2 + \frac{2}{1} = 2.033$$

$$\text{For model B, } (4.891 + 4.528 - 2(4.80))^2 + \frac{3}{3} = 1.033$$

$$\text{For model C, } (4.891 + 5.434 - 2(4.80))^2 + \frac{1}{1} = 1.526$$

The minimum occurs when a model B unit is launched. Thus, for $m = 2$, a unit of model B is launched, and $Q_{B3} = 2$. The procedure continues in this way, with the results displayed in Table 15A.6.

Automated Production Lines

CHAPTER CONTENTS

- 16.1 Fundamentals of Automated Production Lines
 - 16.1.1 Work Part Transport
 - 16.1.2 Storage Buffers
 - 16.1.3 Control of the Production Line
- 16.2 Applications of Automated Production Lines
 - 16.2.1 Machining Systems
 - 16.2.2 System Design Considerations
- 16.3 Analysis of Transfer Lines
- Appendix 16A: Transfer Lines with Internal Storage

The manufacturing systems considered in this chapter are used for high-volume production of parts that require multiple processing operations. Each processing operation is performed at a workstation, and the stations are physically integrated by means of a mechanized work transport system to form an automated production line. Machining (milling, drilling, and similar rotating cutter operations) is commonly performed on these production lines, in which case the term *transfer line* or *transfer machine* is used. Other applications of automated production lines include robotic spot welding in automobile final assembly plants, sheet metal pressworking, and electroplating of metals. Similar automated lines are used for assembly operations; however, the technology of automated assembly is sufficiently different that coverage of this topic is postponed until the following chapter.

Automated production lines are examples of fixed automation (Section 1.2.1), and it is generally difficult to alter the sequence and content of the processing operations once the line is built. Their application is therefore appropriate only under the following conditions:

- High demand, requiring high production quantities
- Stable product design, because frequent design changes are difficult to accommodate on an automated production line
- Long product life, at least several years in most cases
- Multiple operations performed on the product during its manufacture.

When the application satisfies these conditions, automated production lines provide the following advantages:

- Low amount of direct labor
- Low product cost, because the cost of fixed equipment is spread over many units
- High production rate
- Minimal work-in-progress and manufacturing lead time
- Minimal use of factory floor space.

The disadvantage of an automated production line is that it is difficult to reuse the equipment when demand for the product decreases or when the user company has overestimated the demand and the line is underutilized. Accordingly, many automated lines today are designed with flexible workstations, such as CNC (computer numerical control) machining centers (Section 14.2.3), so that the stations can be used in future automated lines [12].

16.1 FUNDAMENTALS OF AUTOMATED PRODUCTION LINES

An automated production line consists of multiple workstations that are automated and linked together by a work handling system that transfers parts from one station to the next, as depicted in Figure 16.1. A raw work part enters one end of the line, and the processing steps are performed sequentially as the part progresses forward (from left to right in the drawing). The line may include inspection stations to perform intermediate quality checks. Also, manual stations may be located along the line to perform certain operations that are difficult or uneconomical to automate. Each station performs a different operation, so all operations must be performed to complete each work unit. Multiple parts are processed simultaneously on the line, one part at each station. In the simplest form of production line, the number of parts on the line at any moment is equal to the number of workstations, as in the figure. In more complicated lines, provision is made for temporary parts storage between stations, in which case there are more parts than stations.

An automated production line operates in cycles, similar to a manual assembly line (Chapter 15). Each cycle consists of processing time plus the time to transfer parts to the next station. The slowest workstation sets the pace of the line, just as in an assembly line.

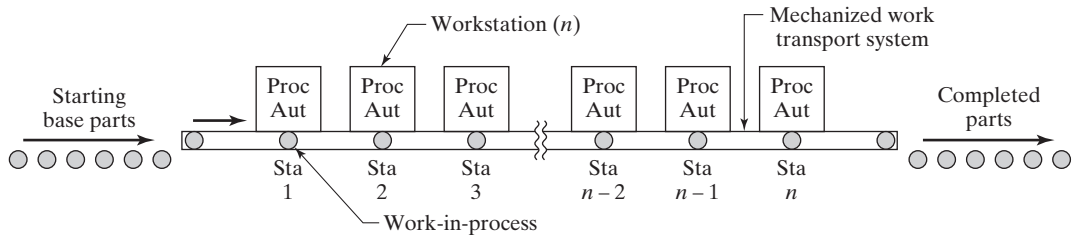


Figure 16.1 General configuration of an automated production line. Key: Proc = processing operation, Aut = automated workstation.

16.1.1 Work Part Transport

The work part transport system moves parts between stations on the line. Transport mechanisms used on automated production lines are usually either synchronous or asynchronous but rarely continuous (Section 15.1.2). Synchronous transport has been the traditional means of moving parts in a transfer line. However, asynchronous transport provides certain advantages over synchronous transport: (1) they are more flexible, (2) they permit queues of parts to form between workstations to act as storage buffers (Section 16.1.2), and (3) it is easier to rearrange or expand the production line. These advantages come at a higher first cost. Continuous work transport systems, although widely used on manual assembly lines, are uncommon on automated lines due to the difficulty in providing accurate registration between the station work heads and the continuously moving parts.

Depending on the geometry of the work part to be processed, the line may utilize pallet fixtures for part handling. A **pallet fixture** is a work-holding device that is designed to (1) fixture the part in a precise location relative to its base and (2) be moved, located, and accurately clamped in position at successive workstations by the transfer system. With the parts accurately located on the pallet fixture, and the pallet accurately registered at a given workstation, the part itself is accurately positioned relative to the processing operation performed at the station. The location requirement is especially critical in machining operations, where tolerances are typically specified in hundredths of a millimeter or thousandths of an inch. The term *palletized transfer line* is sometimes used to identify a transfer line that uses pallet fixtures or similar work-holding devices. The alternative method of work part location is to simply index the parts themselves from station to station. This is called a *free transfer line*, and it has the obvious benefit that it avoids the cost of the pallet fixtures. However, certain part geometries require the use of pallet fixtures to facilitate handling and ensure accurate location at a workstation. When pallet fixtures are used, a means must be provided to deliver them back to the front of the line for reuse.

System Configurations. Although Figure 16.1 shows the flow of work to be in a straight line, the work flow can actually take several different forms: (1) in-line, (2) segmented in-line, and (3) rotary. The in-line configuration consists of a sequence of stations in a straight line arrangement, as in Figure 16.1. This configuration is common for machining big workpieces, such as automotive engine blocks, engine heads, and transmission cases. Because these parts require a large number of operations, a production line with many stations is needed. The in-line configuration can accommodate a large number of stations. In-line systems can also be designed with integrated storage buffers along the flow path (Section 16.1.2).

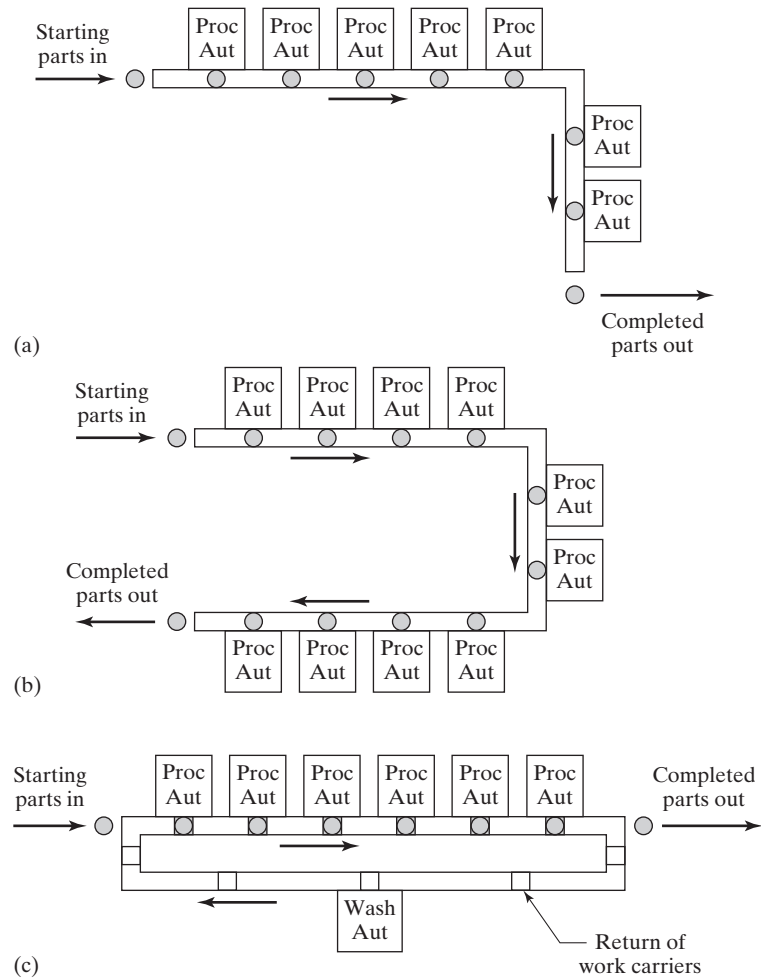


Figure 16.2 Several possible layouts of the segmented in-line configuration of an automated production line: (a) L-shaped, (b) U-shaped, and (c) rectangular. Key: Proc = processing operation, Aut = automated workstation, Wash = work carrier washing station.

The segmented in-line configuration consists of two or more straight-line transfer sections, where the segments are usually perpendicular to each other. Figure 16.2 shows several possible layouts of the segmented in-line category. There are a number of reasons for designing a production line in these configurations rather than in a pure straight line: (1) available floor space may limit the length of the line, (2) a workpiece in a segmented in-line configuration can be reoriented to present different surfaces for machining, and (3) the rectangular layout provides for swift return of work-holding fixtures to the front of the line for reuse.

Figure 16.3 shows two transfer lines that perform metal machining operations on automotive castings. The first line, on the left-hand side, is a segmented in-line configuration in the shape of a rectangle. Pallet fixtures are used in this line to position the

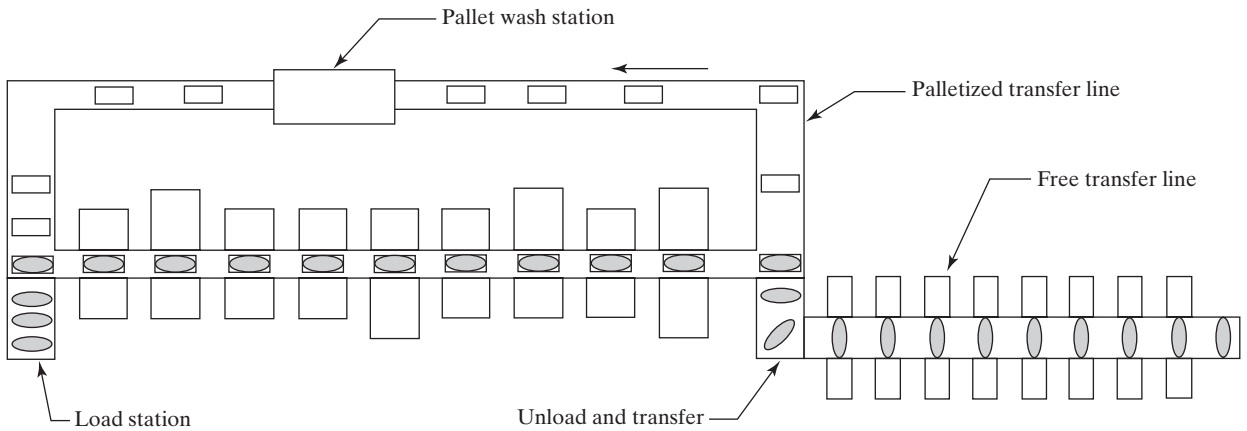


Figure 16.3 Two machining transfer lines. On the left is a segmented in-line configuration that uses pallet fixtures to locate the work parts. The return loop brings the pallets back to the front of the line. On the right, the second transfer line is an in-line configuration. The manual station between the lines is used to reorient the parts, represented as ovals. Pallet fixtures are represented as rectangles.

starting castings at the workstations for machining. It is a palletized transfer line. The second line, on the right side, is a conventional in-line configuration. When processing on the first line is completed, the parts are manually transferred to the second line, where they are reoriented to present different surfaces for machining. In this line the parts are moved individually by the transfer mechanism, using no pallet fixtures. It is a free transfer line.

In the rotary configuration, the work parts are attached to fixtures around the periphery of a circular worktable, and the table is indexed (rotated in fixed angular amounts) to present the parts to workstations for processing. A typical arrangement is illustrated in Figure 16.4. The worktable is often referred to as a dial, and the equipment is called a *dial-indexing machine*. Although the rotary configuration does not seem

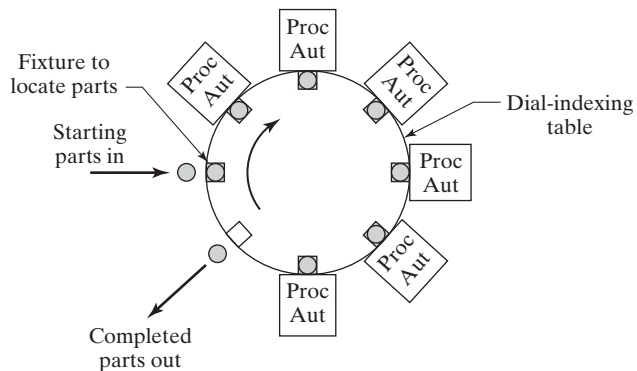


Figure 16.4 Rotary indexing machine (dial-indexing machine). Key: Proc = processing operation, Aut = automated workstation.

to belong to the class of production systems called “lines,” its operation is nevertheless very similar. By comparison with the in-line and segmented in-line configurations, rotary indexing systems are commonly limited to smaller work parts and fewer workstations, and they cannot readily accommodate buffer storage capacity. On the positive side, the rotary system usually involves a less expensive piece of equipment and typically requires less floor space.

Work part transport mechanisms can be divided into two categories: (1) linear transport systems for in-line and segmented in-line systems, and (2) rotary indexing mechanisms for dial-indexing machines. Some of the linear transport systems provide synchronous movement, while others provide asynchronous motion. The rotary indexing mechanisms all provide synchronous motion.

Linear Transfer Systems. Most of the material transport systems described in Chapter 10 provide a linear motion, and some of these are used for parts transfer in automated production lines. These include powered roller conveyors, belt conveyors, chain-driven conveyors, and cart-on-track conveyors (Section 10.2.4). Figure 16.5 illustrates the possible application of a chain driven or belt conveyor to provide continuous or intermittent movement of parts between stations. Either a chain or flexible steel belt is used to transport parts using work carriers attached to the conveyor. The chain is driven by pulleys in either an “over-and-under” configuration, in which the pulleys turn about a horizontal axis, or an “around-the-corner” configuration, in which the pulleys rotate about a vertical axis.

The belt conveyor can also be adapted for asynchronous movement of work units using friction between the belt and the part to move parts between stations. The forward motion of the parts is stopped at each station using pop-up pins or other stopping mechanisms. Cart-on-track conveyors also provide asynchronous parts movement and are designed to position their carts within about ± 0.12 mm (± 0.005 in), which is adequate for many processing situations.

Many machining type transfer lines utilize *walking-beam transfer* systems, in which the parts are synchronously lifted up from their respective stations by a transfer beam and moved one position ahead, to the next station. The transfer beam lowers the parts into nests that position them for processing at their stations. The beam then retracts to make ready for the next transfer cycle. The action sequence is depicted in Figure 16.6.

Rotary Indexing Mechanisms. Several mechanisms are available to provide the rotational indexing motion required in a dial-indexing machine that might be used

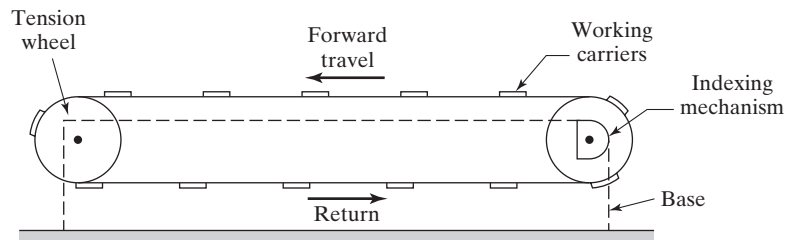


Figure 16.5 Side view of chain or steel belt driven conveyor (“over-and-under” type) for linear work part transfer by using work carriers.

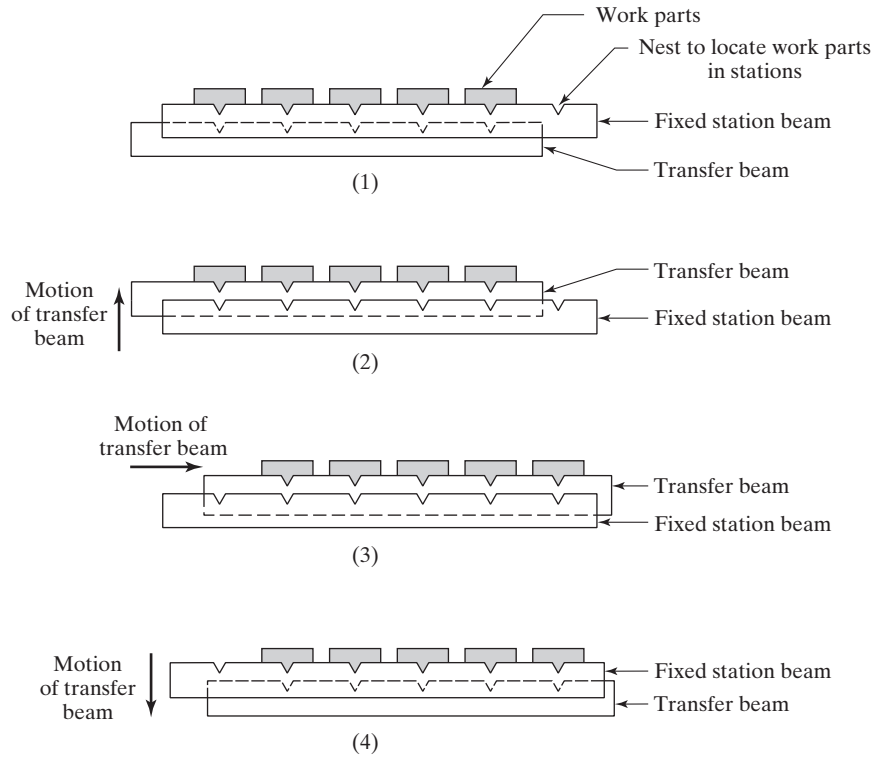


Figure 16.6 Operation of walking-beam transfer system: (1) work parts at station positions on fixed station beam, (2) transfer beam is raised to lift work parts from nests, (3) elevated transfer beam moves parts to next station positions, and (4) transfer beam lowers to drop work parts into nests at new station positions. Transfer beam then retracts to original position shown in (1).

for processing or assembly operations. A representative type is the *Geneva mechanism*, which uses a continuously rotating driver to index the table through a partial rotation, as illustrated in Figure 16.7. If the driven member has six slots for a six-station dial-indexing table, each turn of the driver results in a 1/6-th rotation of the worktable, or 60°. The driver only causes motion of the table through a portion of its own rotation. For a six-slotted Geneva, 120° of driver rotation is used to index the table. The remaining 240° of driver rotation is dwell time for the table, during which the operation must be completed on the work unit. In general,

$$\theta = \frac{360}{n_s} \tag{16.1}$$

where θ = angle of rotation of worktable during indexing (degrees of rotation), and n_s = number of equally spaced slots in the Geneva. The angle of driver rotation during indexing = 2θ , and the angle of driver rotation during which the worktable experiences dwell time is $(360 - 2\theta)$. Geneva mechanisms usually have four, five, six, or eight

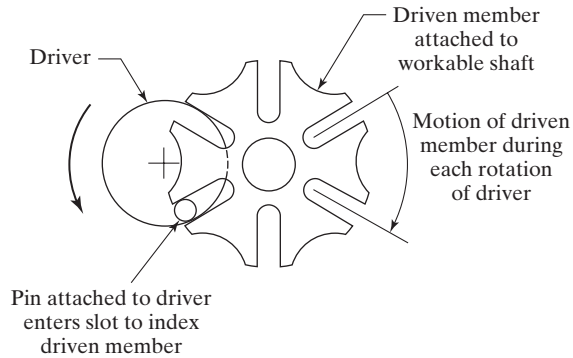


Figure 16.7 Geneva mechanism with six slots.

slots, which establish the maximum number of workstation positions that can be placed around the periphery of the table. Given the rotational speed of the driver, total cycle time is

$$T_c = \frac{1}{N} \quad (16.2)$$

where T_c = cycle time, min; and N = rotational speed of driver, rev/min. Of the total cycle time, the dwell time, or available service time per cycle, is given by

$$T_s = \frac{(180 + \theta)}{360N} \quad (16.3)$$

where T_s = available service or processing time or dwell time, min; and the other terms are defined earlier. Similarly, the indexing time is given by

$$T_r = \frac{(180 - \theta)}{360N} \quad (16.4)$$

where T_r = indexing time, min. This indexing time has previously been referred to as the repositioning time, so the same notation is retained for consistency.

EXAMPLE 16.1 Geneva Mechanism for a Rotary Indexing Table

A rotary worktable is driven by a Geneva mechanism with six slots, as in Figure 16.7. The driver rotates at 30 rev/min. Determine the cycle time, available processing time, and the lost time each cycle to index the table.

Solution: With a driver speed of 30 rev/min, the total cycle time is given by Equation (16.2):

$$T_c = (30)^{-1} = 0.0333 \text{ min} = \mathbf{2.0 \text{ sec}}$$

The angle of rotation of the worktable during indexing for a six-slotted Geneva is given by Equation (16.1):

$$\theta = \frac{360}{6} = 60^\circ$$

Equations (16.3) and (16.4) give the available service time and indexing time, respectively, as

$$T_s = \frac{(180 + 60)}{360(30)} = 0.0222 \text{ min} = \mathbf{1.333 \text{ sec}}$$

$$T_r = \frac{(180 - 60)}{360(30)} = 0.0111 \text{ min} = \mathbf{0.667 \text{ sec}}$$

16.1.2 Storage Buffers

Automated production lines can be designed with storage buffers. A storage buffer is a location in the production line where parts can be collected and temporarily stored before proceeding to downstream workstations. The storage buffers can be manually operated or automated. When it is automated, a storage buffer consists of a mechanism to accept parts from the upstream workstation, a place to store the parts, and a mechanism to supply parts to the downstream station. A key parameter of a storage buffer is its storage capacity, that is, the number of work parts it can hold. Storage buffers may be located between every pair of adjacent stations, or between line stages containing multiple stations. There are several reasons why storage buffers are used on automated production lines:

- To reduce the impact of station breakdowns. Storage buffers between stages on a production line permit one stage to continue operation while the other stage is down for repairs. This situation is analyzed in Appendix 16A.
- To provide a bank of parts to supply the line. Parts can be collected into a storage unit and automatically fed to a downstream manufacturing system. This permits untended operation of the system between refills.
- To provide a place to put the output of the line.
- To allow for curing time or other process delay. A curing time is required for some processes such as painting or adhesive application. The storage buffer is designed to provide sufficient time for curing to occur before supplying the parts to the downstream station.
- To smooth cycle time variations. Although this is generally not an issue in an automated line, it is relevant in manual production lines, where cycle time variations are an inherent feature of human performance.

Storage buffers are more readily accommodated in the design of an in-line transfer machine than a rotary indexing machine. In the latter case, buffers are sometimes located (1) before a dial-indexing system to provide a bank of raw starting work parts, (2) following the dial-indexing machine to accept the output of the system, or (3) between pairs of adjacent dial-indexing machines.

16.1.3 Control of the Production Line

Controlling an automated production line is complex, owing to the sheer number of sequential and simultaneous activities that occur during its operation. This section covers (1) the basic control functions that are accomplished to run the line and (2) controllers used on automated lines.

Control Functions. Three basic control functions can be distinguished in the operation of an automated production line: (1) sequence control, (2) safety monitoring, and (3) quality control.

The purpose of sequence control is to coordinate the sequence of actions of the transport system and associated workstations. The various activities of the production line must be carried out with split-second timing and accuracy. On a transfer line, for example, the parts must be released from their current workstations, transported, located, and clamped into position at their respective next stations. Then the work heads must be actuated to begin their feed cycles, and so on. The sequence control function in automated production line operation includes both logic control and sequence control, discussed in Chapter 9.

The safety monitoring function ensures that the production line does not operate in an unsafe manner. Safety applies to both the human workers in the area and the equipment itself. Additional sensors must be incorporated into the line beyond those required for sequence control, in order to complete the safety feedback loop and avoid hazardous operation. For example, interlocks must be installed to prevent the equipment from operating when workers are performing maintenance or other duties on the line. In the case of machining transfer lines, cutting tools must be monitored for breakage and/or excessive wear to prevent feeding a defective cutter into the work. A more complete treatment of safety monitoring in manufacturing systems is presented in Section 4.2.1.

In the quality control function, certain quality attributes of the work parts are monitored. The purpose is to detect and possibly reject defective work units produced on the line. The inspection devices required to accomplish quality control are sometimes incorporated into existing processing stations. In other cases, separate inspection stations are included in the line for the sole purpose of checking the desired quality characteristic. Inspection principles and practices, and the associated inspection technologies, are discussed in Chapters 21 and 22.

Line Controllers. Programmable logic controllers (PLCs, Chapter 9) are the conventional controllers used on automated production lines today. Personal computers (PCs) equipped with control software and designed for the factory environment are also widely used. Computer control offers the following benefits:

- Opportunity to improve and upgrade the control software, such as adding specific control functions not anticipated in the original system design
- Recording data on process performance, equipment reliability, and product quality (in some industries product quality records must be maintained for legal reasons)
- Diagnostic routines to expedite maintenance and repair when line breakdowns occur and to reduce the duration of downtime incidents
- Generation of preventive maintenance schedules to reduce the frequency of downtime occurrences
- A PC provides a more convenient interface than a PLC between the operator and the automated line.

16.2 APPLICATIONS OF AUTOMATED PRODUCTION LINES

Machining is one of the most common processing applications and is the focus of most of the discussion in this section. Other processes performed on automated production lines and similar systems include sheet metal forming and cutting, rolling mill operations, spot

welding of automobile car bodies, painting, plating operations, and assembly. Automated assembly systems are discussed in Chapter 17.

16.2.1 Machining Systems

Many applications of machining transfer machines, both in-line and rotary configurations, are found in the automotive industry to produce engine and drive-train components. In fact, the first transfer lines can be traced to the automobile industry (Historical Note 16.1). Machining operations commonly performed on transfer lines include milling, drilling, reaming, tapping, grinding, and similar rotational cutting tool operations. It is possible to perform turning and boring on transfer lines, but these applications are less common. In this section, the various multiple-station machining systems are described.

Transfer Lines. In a transfer line, the workstations containing machining work heads are arranged in an in-line or segmented in-line configuration and the parts are moved between stations by transfer mechanisms such as the walking-beam system (Section 16.1.1). The transfer line is the most highly automated and productive system in terms of the number of operations that can be performed to accommodate complex work geometries. It is also the most expensive of the systems discussed in this section. Machining type transfer lines are pictured in Figure 16.3. The transfer line can include a large number of workstations, but reliability of the system decreases as the number of stations is increased (Section 16.3).

Today, many transfer lines are being designed for flexibility and ease of change-over so that (1) different but similar work parts can be produced on the same system and (2) workstations from obsolete lines can be used on new lines [8], [11], [12], and [14]. Thus, there is a trend in transfer lines in the direction of flexible manufacturing systems (Chapter 19). Indeed, the term *flexible transfer line* is sometimes applied to these systems. The workstations in these lines consist of both fixed tooling and CNC machines, so that

Historical Note 16.1 Transfer Lines [13]

Development of automated transfer lines originated in the automobile industry, which had become the largest mass production industry in the United States by the early 1920s, and was also a major industry in Europe. The Ford Motor Company had pioneered the development of the moving assembly line, but the operations performed on these lines were manual. The next step was to extend the principle of manual assembly lines by building lines capable of automatic or semiautomatic operation. The first fully automatic production line is credited to L. R. Smith of Milwaukee, Wisconsin, during 1919 and 1920. This line produced automobile chassis frames out of sheet metal, using air-powered riveting heads that rotated into position at each station to engage the work part. The line performed a total of 550 operations on each frame and was capable of producing over a million chassis frames per year.

The first metal machining multistation line was developed by Archdale Company in England for Morris Engines in 1923 to machine automobile engine blocks. It had 53 stations, performed 224 min of machining on each part, and had a production rate of 15 blocks/hr. It was not a true automatic line because it required manual transfer of work between stations. Yet it stands as an important forerunner of the automated transfer line.

The first machining line to use automatic work transfer between stations was built by Archdale Company for Morris Engines in 1924. This line performed 45 machining operations on gearboxes and produced at the rate of 17 units/hr. Reliability problems limited the success of this first transfer line.

differences in work parts can be accommodated by the CNC stations while the common operations are performed by stations with fixed tooling. Some of the CNC machine tools are new, while others are equipment that has been redeployed from previous lines and reconfigured for the new products. The opportunity to use redeployed stations represents a significant saving for the user company when compared to the purchase of new machine tools. The topic of reconfigurable manufacturing systems is covered in Section 19.5.2.

Rotary Transfer Machines and Related Systems. A rotary transfer machine consists of a horizontal circular worktable, upon which are fixtured the parts to be processed, and around whose periphery are located stationary work heads. The worktable is indexed to present each part to each work head to accomplish the sequence of machining operations. An example is shown in Figure 16.8. By comparison with a transfer line, the rotary indexing machine is limited to smaller, lighter work parts and fewer workstations.

Two variants of the rotary transfer machine are the center-column machine and the trunnion machine. In the *center-column machine*, vertical machining heads are mounted on a center column in addition to the stationary machining heads located on the outside of the horizontal worktable, thereby increasing the number of machining operations that can be performed. The center-column machine, depicted in Figure 16.9, is considered to be a high production machine that makes efficient use of floor space. The *trunnion machine* gets its name from a vertically oriented worktable, or trunnion, to which are attached work holders to fixture the parts for machining. Since the trunnion indexes around a horizontal axis, this provides the opportunity to perform machining operations on opposite sides of the work part. Additional work heads can be located around the periphery of the trunnion to increase the number of machining directions. Trunnion machines are more suitable for smaller work parts than the other rotary machines discussed here.

16.2.2 System Design Considerations

Most companies that use automated production lines and related systems turn the design of the system over to a machine tool builder that specializes in this type of equipment. The customer (company purchasing the equipment) must develop specifications that include design drawings of the part and the required production rate. Typically, several machine tool builders are invited to submit proposals. Each proposal is based

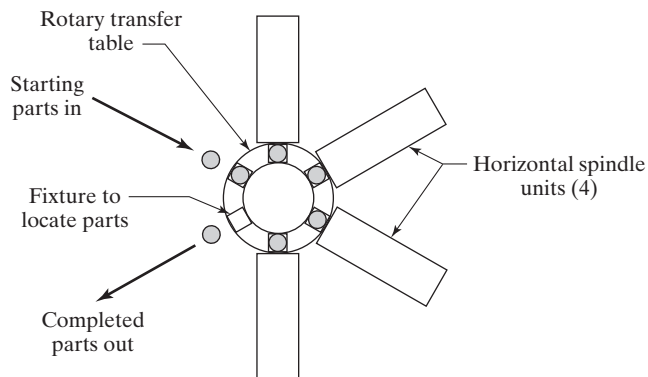


Figure 16.8 Plan view of a rotary transfer machine.

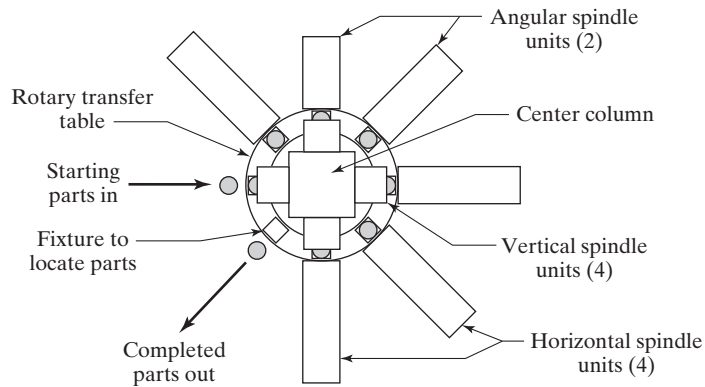


Figure 16.9 Plan view of the center-column machine.

on the machinery components comprising the builder's product line and depends on the ingenuity of the engineer preparing the proposal. The proposed line consists of standard work heads, spindles, feed units, drive motors, transfer mechanisms, bases, and other standard modules, all assembled into a special configuration to match the machining requirements of the particular part. Examples of these standard modules are illustrated in Figures 16.10 and 16.11. The controls for the system are either designed by the machine builder or sublet as a separate contract to a controls specialist. Transfer lines and indexing machines constructed using this building-block approach are sometimes referred to as *unitized production lines*.

An alternative approach in designing an automated line is to use standard machine tools and to connect them with standard or special material handling devices. The material handling hardware serves as the transfer system that moves work between the standard machines. The term *link line* is sometimes used in connection with this type of construction. In some cases, the individual machines are manually operated if there are fixturing and location problems that are difficult to solve without human assistance.

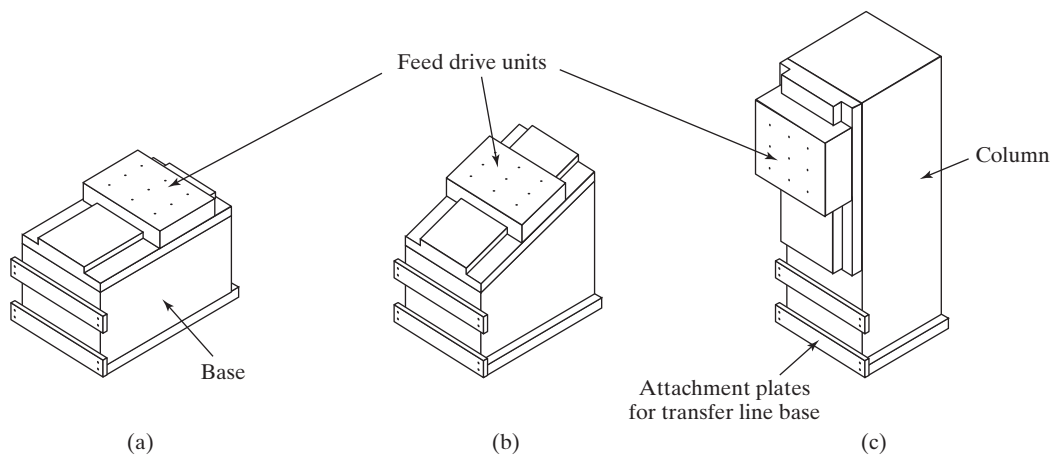


Figure 16.10 Standard feed units used with in-line or rotary transfer machines: (a) horizontal feed drive unit, (b) angular feed drive unit, and (c) vertical column unit.

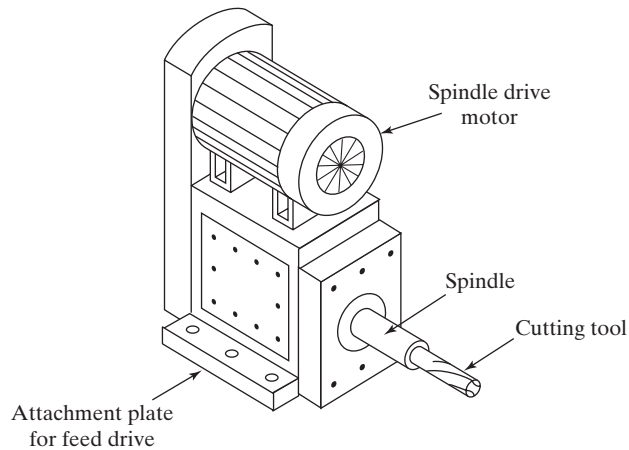


Figure 16.11 Standard milling head unit. This unit attaches to the feed drive units in Figure 16.10.

A company often prefers to develop a link line rather than a unitized production line because it can utilize existing equipment in the plant. This usually means the production line can be installed sooner and at lower cost. Since the machine tools in the system are standard, they can be reused when the production run is finished. Also, the lines can be engineered by personnel within the company rather than outside contractors. The limitation of the link line is that it tends to favor simpler part shapes and therefore fewer operations and workstations. Unitized lines are generally capable of higher production rates and require less floor space. However, their high cost makes them suitable only for very long production runs on products that are not subject to frequent design changes.

16.3 ANALYSIS OF TRANSFER LINES

In the analysis and design of automated production lines, three problem areas must be considered: (1) line balancing, (2) processing technology, and (3) system reliability.

The line balancing problem is most closely associated with manual assembly lines (Section 15.2.3), but it is also an issue on automated production lines. Somehow, the total work content to be accomplished on the automated line must be divided as evenly as possible among the workstations. In a manual assembly line, the total work content can be divided into much smaller work elements, and the elements can then be grouped and assigned to workstations to determine the task that is performed at each station. Each task has a corresponding service time. In an automated production line, the tasks consist of processing steps whose sequence and service times are limited by technological considerations. For example, in a machining transfer line, certain operations must be performed before others. Drilling must precede tapping to create a threaded hole. Locating surfaces must be machined before the features that will use those locating surfaces are machined. These precedence constraints, as they were called in Chapter 15, impose a significant restriction on the order in which the processing steps can be carried out. Once the sequence of operations is established, then the service time at a given station depends on how long it takes to accomplish the operation at that station.

Process technology refers to the body of knowledge about the particular manufacturing processes used on the production line. For example, in the machining process, process technology includes the metallurgy and machinability of the work material, the proper application of cutting tools, selection of speeds and feeds, chip control, and a host of other problem areas and issues. Many of the problems encountered in machining can be solved by application of machining theory and principles. The same is true of other processes. In each process, a technology has been developed over many years of research and practice. By applying this technology, each individual workstation in the production line can be designed to operate at or near its maximum performance.

The third problem area in the analysis and design of automated production lines is reliability. In a highly complex and integrated system such as an automated production line, failure of any one component can stop the entire system. This reliability problem is the primary focus of this section. Here the coverage is limited to the analysis of transfer lines with no internal parts storage. In Appendix 16A, transfer lines with internal storage buffers are analyzed.

Figure 16.1 illustrates the configuration of a transfer line with no internal storage. The mathematical models developed in this section are also applicable to rotary indexing machines, shown in Figure 16.4. The following assumptions are made about the operation of these systems: (1) the workstations perform processing operations such as machining, not assembly; (2) processing times at each station are constant, though not necessarily equal; and (3) work part transport is synchronous.

Cycle Time Analysis. In the operation of an automated production line, parts are introduced into the first workstation and are processed and transported at regular intervals to succeeding stations. This interval defines the ideal cycle time T_c of the production line. T_c is the processing time for the slowest station on the line plus the transfer time, that is,

$$T_c = \text{Max}\{T_{si}\} + T_r \quad (16.5)$$

where T_c = ideal cycle time on the line, min; T_{si} = the processing time at station i , min; and T_r = repositioning time, called the transfer time here, min. The $\text{Max}\{T_{si}\}$ is used in Equation (16.5) because this longest service time establishes the pace of the production line. The remaining stations with shorter service times must wait for the slowest station. Therefore, these other stations will experience idle time. The situation is the same as for a manual assembly line depicted in Figure 15.4.

In the operation of a transfer line, random breakdowns and planned stoppages cause downtime on the line. Common reasons for downtime on an automated production line are listed in Table 16.1. Although the breakdowns and line stoppages occur randomly, their frequency can be measured over the long run. When the line stops, it is down a certain amount of time for each downtime occurrence. Downtime occurrences cause the actual average production cycle time of the line to be longer than the ideal cycle time given by Equation (16.5). The actual average production time T_p can be formulated as follows:

$$T_p = T_c + FT_d \quad (16.6)$$

where F = downtime frequency, line stops/cycle; and T_d = average downtime per line stop, min. The downtime T_d includes the time for the repair crew to swing into action, diagnose the cause of the failure, fix it, and restart the line. Thus, FT_d = downtime averaged on a per cycle basis.

TABLE 16.1 Common Reasons for Downtime on an Automated Production Line

Mechanical failure of a workstation	Power outages
Mechanical failure of the transfer system	Stockouts of starting work units
Tool failure at a workstation	Insufficient space for completed parts
Tool adjustment at a workstation	Preventive maintenance on the line
Scheduled tool change at a station	Worker breaks
Electrical malfunctions	Poor-quality starting work parts

Line downtime is usually associated with failures at individual workstations. Many of the reasons for downtime listed in Table 16.1 represent malfunctions that cause a single station to stop production. Since all workstations on an automated production line with no internal storage are interdependent, the failure of one station causes the entire line to stop. Let p_i = probability or frequency of a failure at station i , where $i = 1, 2, \dots, n$, and n = the number of workstations on the line. The frequency of line stops per cycle is obtained by merely summing the frequencies p_i over the n stations, that is,

$$F = \sum_{i=1}^n p_i \quad (16.7)$$

where F = expected frequency of line stops per cycle, from Equation (16.6); p_i = frequency of station breakdown per cycle at station i , causing a line stop; and n = number of workstations on the line. If all p_i are assumed equal, which is unlikely but useful for approximation and computation purposes, then

$$F = np \quad (16.8)$$

where all p_i are equal, $p_1 = p_2 = \dots = p_n = p$.

Performance Measures. One of the important measures of performance on an automated transfer line is production rate, which is the reciprocal of T_p :

$$R_p = \frac{1}{T_p} \quad (16.9)$$

where R_p = actual average production rate, pc/min; and T_p is the actual average production time from Equation (16.6), min. It is of interest to compare this rate with the ideal production rate given by

$$R_c = \frac{1}{T_c} \quad (16.10)$$

where R_c = ideal production rate, pc/min. It is customary to express production rates on automated production lines as hourly rates, so the rates in Equations (16.9) and (16.10) must be multiplied by 60.

The machine tool builder uses the ideal production rate R_c in its proposal for the automated transfer line and speaks of it as the production rate at 100% efficiency. Unfortunately, because of downtime, the line will not operate at 100% efficiency. While it may seem deceptive for the machine tool builder to ignore the effect of downtime on production rate, the amount of downtime experienced on the line is mostly the responsibility of the company using the production line. In practice, most of the reasons for

downtime occurrences in Table 16.1 represent factors that must be controlled and managed by the user company.

In the context of automated production lines, line efficiency refers to the proportion of uptime on the line and is really a measure of reliability (availability, Section 3.1.1) more than efficiency. Nevertheless, this is the terminology of production lines. Line efficiency can be calculated as

$$E = \frac{T_c}{T_p} = \frac{T_c}{T_c + FT_d} \quad (16.11)$$

where E = the proportion of uptime on the production line, and the other terms are as previously defined.

An alternative measure of performance is the proportion of downtime on the line D , which is given by

$$D = \frac{FT_d}{T_p} = \frac{FT_d}{T_c + FT_d} \quad (16.12)$$

It is obvious that

$$E + D = 1.0 \quad (16.13)$$

An important performance measure of an automated production line is the cost per unit produced. This piece cost includes the cost of the starting material that is to be processed on the line, the cost of time on the production line, and the cost of any tooling that is consumed (e.g., cutting tools on a machining line). The piece cost can be expressed as the sum of the three factors

$$C_{pc} = C_m + C_o T_p + C_t \quad (16.14)$$

where C_{pc} = cost per piece, \$/pc; C_m = cost of starting material, \$/pc; C_o = cost per minute to operate the line, \$/min; T_p = average production time per piece, min/pc; and C_t = cost of tooling per piece, \$/pc. C_o includes the allocation of the capital cost of the equipment over its expected service life, labor to operate the line, applicable overheads, maintenance and other relevant costs, all reduced to a cost per minute (Section 3.2.3).

Equation (16.14) does not include factors such as scrap rates, inspection costs, and rework costs associated with fixing defective work units. These factors can usually be incorporated into the unit piece cost in a fairly straightforward way.

EXAMPLE 16.2 Transfer Line Performance

A machine tool builder submits a proposal for a 20-station transfer line to machine a certain component currently produced by conventional methods. The proposal states that the line will operate at a production rate of 50 pc/hr at 100% efficiency. On similar transfer lines, the probability of station breakdowns per cycle is equal for all stations: $p = 0.005$ breakdowns/cycle. It is also estimated that the average downtime per line stop will be 8.0 min. The starting casting that is to be machined on the line costs \$3.00 per part. The line operates at a cost of \$75.00/hr. The 20 cutting tools (one tool per station) last for 50 parts each, and average cost per tool is \$2.00 per cutting edge. Determine (a) production rate, (b) line efficiency, and (c) cost per piece produced on the line.

Solution: (a) At 100% efficiency, the line produces 50 pc/hr. The reciprocal gives the unit time, or ideal cycle time per piece:

$$T_c = \frac{1}{50} = 0.02 \text{ hr/pc} = 1.2 \text{ min}$$

With a station breakdown frequency $p = 0.005$, the frequency of line stops is

$$F = 20(0.005) = 0.10 \text{ breakdowns per cycle}$$

Given an average downtime of 8.0 min, the average production time per piece is

$$T_p = T_c + FT_d = 1.2 + 0.10(8.0) = 1.2 + 0.8 = 2.0 \text{ min/pc}$$

Actual average production rate is the reciprocal of average production time per piece:

$$R_p = \frac{1}{2.0} = 0.500 \text{ pc/min} = \mathbf{30.0 \text{ pc/hr}}$$

(b) Line efficiency is the ratio of ideal cycle time to actual average production time:

$$E = \frac{1.2}{2.0} = 0.60 = \mathbf{60\%}$$

(c) Tooling cost per piece is $C_t = (20 \text{ tools})(\$2/\text{tool})/(50 \text{ parts}) = \$0.80/\text{pc}$

Now the unit cost can be calculated by Equation (16.14). The hourly rate of \$75/hr to operate the line is equivalent to \$1.25/min

$$C_{pc} = 3.00 + 1.25(2.0) + 0.80 = \mathbf{\$6.30/pc}$$

What the Equations Tell Us. Two general truths about the operation of automated transfer lines are revealed by the equations in this section:

- As the number of workstations on an automated production line increases, line efficiency and production rate are adversely affected.
- As the reliability of individual workstations decreases, line efficiency and production rate are adversely affected.

Perhaps the biggest difficulty in the practical use of the equations is determining the values of p_i for the various workstations. No records are available on station breakdown frequencies for a proposed transfer line, and yet these critical reliability factors are needed to predict the performance of the line. The most reasonable approach is to base the values of p_i on previous experience and historical data for similar workstations.

REFERENCES

- [1] BUZACOTT, J. A., "Automatic Transfer Lines with Buffer Stocks," *International Journal of Production Research*, Vol. 5, No. 3, 1967, pp. 183–200.
- [2] BUZACOTT, J. A., "Prediction of the Efficiency of Production Systems without Internal Storage," *International Journal of Production Research*, Vol. 6, No. 3, 1968, pp. 173–188.

- [3] BUZACOTT, J. A., “The Role of Inventory Banks in Flow-Line Production Systems,” *International Journal of Production Research*, Vol. 9, No. 4, 1971, pp. 425–436.
- [4] BUZACOTT, J. A., and L. E. HANIFIN, “Models of Automatic Transfer Lines with Inventory Banks—A Review and Comparison,” *AIIE Transactions*, Vol. 10, No. 2, 1978, pp. 197–207.
- [5] BUZACOTT, J. A., and L. E. HANIFIN, “Transfer Line Design and Analysis—An Overview,” *Proceedings*, 1978 Fall Industrial Engineering Conference of AIIE, Atlanta, GA. December 1978.
- [6] BUZACOTT, J. A., and J. G. SHANTHIKUMAR, *Stochastic Models of Manufacturing Systems*, Prentice Hall, Englewood Cliffs, NJ, 1993, Chapters 5 and 6.
- [7] GROOVER, M. P., “Analyzing Automatic Transfer Lines,” *Industrial Engineering*, Vol. 7, No. 11, 1975, pp. 26–31.
- [8] KOELSCH, J. R., “A New Look to Transfer Lines,” *Manufacturing Engineering*, April 1994, pp. 73–78.
- [9] LAVALLEE, R. J., “Using a PC to Control a Transfer Line,” *Control Engineering*, February 2, 1991, pp. 43–56.
- [10] MASON, F., “High Volume Learns to Flex,” *Manufacturing Engineering*, April 1995, pp. 53–59.
- [11] OWEN, J. V., “Transfer Lines Get Flexible,” *Manufacturing Engineering*, January 1999, pp. 42–50.
- [12] WAURZYNIAK, P., “Automation Flexibility,” *Manufacturing Engineering*, September 2010, pp. 79–87.
- [13] WILD, R., *Mass-Production Management*, John Wiley & Sons, London, UK, 1972.
- [14] www.mag-ias.com

REVIEW QUESTIONS

- 16.1** Name three of the four conditions under which automated production lines are appropriate.
- 16.2** What is an automated production line?
- 16.3** What is a pallet fixture, as the term is used in the context of an automated production line?
- 16.4** What is a dial-indexing machine?
- 16.5** Why are continuous work transport systems uncommon on automated production lines?
- 16.6** Is a Geneva mechanism used to provide linear motion or rotary motion?
- 16.7** What is a *storage buffer* as the term is used for an automated production line?
- 16.8** Name three reasons for including a storage buffer in an automated production line?
- 16.9** What are the three basic control functions that must be accomplished to operate an automated production line?
- 16.10** Name some of the industrial applications of automated production lines.
- 16.11** What is the difference between a unitized production line and a link line?
- 16.12** What are the three problem areas that must be considered in the analysis and design of an automated production line?
- 16.13** As the number of workstations on an automated production line increases, does line efficiency (a) decrease, (b) increase, or (c) remain unaffected?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Geneva Mechanism

- 16.1 (A)** A rotary worktable is driven by a Geneva mechanism with five slots. The driver rotates at 24 rev/min. Determine (a) the cycle time, (b) available process time, and (c) indexing time each cycle.
- 16.2** A Geneva with six slots is used to operate the worktable of a dial-indexing machine. The slowest workstation on the dial-indexing machine has an operation time of 2.5 sec, so the table must be in a dwell position for this length of time. (a) At what rotational speed must the driven member of the Geneva mechanism be turned to provide this dwell time? (b) What is the indexing time each cycle?
- 16.3** Solve the previous problem except that the Geneva has eight slots.

Automated Production Lines (No Internal Storage)

- 16.4 (A)** A 12-station automated production line has an ideal cycle time of 30 sec. Line stops occur on average once every 20 cycles. When a line stop occurs, average downtime is 4.0 min. Cost of each starting work part is \$1.55, and the cost to operate the line is \$66/hr. Tooling cost is \$0.27 per work part. Determine (a) average hourly production rate, (b) line efficiency, and (c) cost of a workpiece produced.
- 16.5** In the operation of a 10-station transfer line, the ideal cycle time is 1.08 min. Line stops occur due to random mechanical and electrical failures once every 28 cycles on average. When a line stop occurs, average downtime is 6.0 min. In addition to these downtimes, the tools at each workstation on the line must be changed every 100 cycles, which takes a total of 12.0 min for all ten stations. Determine (a) average hourly production rate, (b) line efficiency, and (c) proportion downtime.
- 16.6** A six-station dial-indexing machine operates at an ideal cycle rate of 10/min and has a breakdown frequency of 0.03 stops/cycle. Average downtime per breakdown is 3.5 min. Determine (a) average hourly production rate and (b) line efficiency.
- 16.7** In the operation of a 15-station automated production line, the ideal cycle time = 0.85 min. Breakdowns occur at a rate of once every 35 cycles on average, and the average downtime per breakdown is 9.2 min. The production line is located in a plant that works an 8-hr day, 5 days/wk. Determine (a) line efficiency and (b) number of parts the production line produces in a 40-hr week.
- 16.8** A 17-station in-line transfer machine has an ideal cycle time of 1.35 min. Station breakdowns occur with a probability of 0.01. Average downtime is 8.0 min per line stop. The starting work part is a casting that costs \$3.20. Operating cost of the transfer line is \$108/hr, and tooling cost is \$0.07 per piece per station. Determine (a) ideal production rate, (b) frequency of line stops, (c) average actual production rate, (d) line efficiency, and (e) cost per completed part.
- 16.9** A ten-station rotary-indexing machine performs machining operations at nine workstations, and the tenth station is used for unloading and loading parts. The longest process time on the line is 1.75 min and the loading/unloading operation requires less time than this. It takes 9.0 sec to index the machine between workstations. Stations break down with a frequency of 0.006, which is considered equal for all ten stations. When breakdowns occur, it takes an average of 8.0 min to diagnose the problem and make repairs. The starting work part costs \$2.50 per unit. Operating cost of the indexing machine is \$96/hr, and

tooling cost is \$0.38 per piece. Determine (a) line efficiency, (b) average hourly production rate, and (c) completed part cost.

- 16.10 (A)** A transfer line has six stations that function as listed in the table below. Transfer time = 0.18 min. Average downtime per occurrence = 8.0 min. A total of 20,000 parts must be processed through the transfer machine. Determine (a) proportion downtime, (b) average hourly production rate, and (c) how many hours of operation are required to produce the 20,000 parts.

Station	Operation	Process Time	p_i
1	Load part	0.78 min	0
2	Drill three holes	1.25 min	0.02
3	Ream two holes	0.90 min	0.01
4	Tap two holes	0.85 min	0.04
5	Mill flats	1.32 min	0.01
6	Unload parts	0.45 min	0

- 16.11** The cost to operate a 20-station transfer line is \$144/hr. The line operates with an ideal cycle time of 0.90 min. Downtime occurrences happen on average once per 34 cycles. Average downtime per occurrence is 10.0 min. It is proposed that a new computer system and associated sensors be installed to monitor the line and diagnose downtime occurrences when they happen. This new system is expected to reduce downtime per occurrence from 10 min to 7.5 min. (a) If the cost of purchasing and installing the new system is \$12,000, how many parts must the system produce for the savings to pay for the computer system? (b) How many hours of operation will be required to produce this number of parts?
- 16.12** The operation of a 16-station transfer line has been logged for five days (40 hr). During this time, there were a total of 127 downtime occurrences on the line for a total downtime of 682 min. Of the total occurrences, 105 were station failures and 22 were transfer mechanism failures. The line performs a sequence of machining operations, the longest of which takes 0.52 min. The transfer mechanism takes 0.08 min to move parts from one station to the next each cycle. Determine the following based on the five-day observation period: (a) number of parts produced, (b) line efficiency, (c) production rate, (d) average downtime per line stop, and (e) frequency rate associated with the transfer mechanism failures.
- 16.13** An eight-station rotary indexing machine performs the machining operations shown in the table below, with processing times and breakdown frequencies for each station. Transfer time is 0.15 min. A study of the system was undertaken, during which time 2,000 parts were completed. The study also revealed that when breakdowns occur, the average downtime is 7.0 min. For the study period, determine (a) average hourly production rate, (b) line uptime efficiency, and (c) how many hours were required to produce the 2,000 parts.

Station	Process	Process Time	Breakdowns
1	Load part	0.50 min	0
2	Mill top	0.85 min	22
3	Mill sides	1.10 min	31
4	Drill two holes	0.60 min	47
5	Ream two holes	0.43 min	8
6	Drill six holes	0.92 min	58
7	Tap six holes	0.75 min	84
8	Unload part	0.40 min	0

- 16.14** A 14-station transfer line has been observed for 50 hr to identify type of downtime occurrence, how many occurrences, and time lost. The results showed that 68 line stops were due to tool changes for a total downtime of 329 min, 45 line stops were random station failures for 242 min, and 20 line stops resulted from transfer mechanism failures for 98 min. The ideal cycle time for the line is 0.60 min, which includes transfer time. Determine (a) how many parts were produced during the 50 hr, (b) line efficiency, (c) average production rate per hour, and (d) frequency associated with transfer mechanism failures. Of the three reasons for downtime occurrences, which one has the longest average downtime per occurrence?
- 16.15** An automated production line operates with an ideal cycle time of 35 sec. Line stops are characterized by a mean time between failures of 70 min and a mean time to repair of 8.0 min. What is the average hourly production rate?
- 16.16** A machine shop is negotiating with a potential customer on a job that would consist of producing 120,000 parts in the first year for a contracted price of \$450,000. It is not known whether there would be a continuation of the job after that, so the shop must break even on the work during that first year. The engineering department has proposed an automated production line that would operate with an ideal cycle time of 1.50 min. It is anticipated that the line efficiency would be 80% and that average down time per line stop would be 7.0 min. Material cost will be \$1.10 per starting work part and tooling cost is estimated at \$0.25 per part. A 3% scrap rate must be planned for this job, so more than 120,000 parts must be processed to achieve the contracted quantity. Finally, to separate the good parts from the defectives, an inspection cost of \$0.06 per part must be factored in. (a) How many hours would the line have to operate to produce the 120,000 parts? (b) During that time, how many breakdowns would occur? (c) Ignoring overhead costs, what is the maximum installed cost of the line for the shop to break even on the job.
- 16.17 (A)** A part is to be produced on an automated production line. Total work content time to make the part is 36 min, and this work will be divided evenly among the workstations, so that the processing time at each station is $36/n$, where n = the number of stations. In addition, the time required to transfer parts between workstations is 6 sec. Thus, the cycle time = $(0.1 + 36/n)$ min. In addition, it is anticipated that the station breakdown frequency will be 0.005, and that the average downtime per breakdown will be 8.0 min. (a) How many workstations should be included in the line to maximize production rate? Also, what are (b) the hourly production rate and (c) line efficiency for this number of stations?

Automated Production Lines with Storage Buffers (Appendix 16A)

- 16.18 (A)** A 30-station transfer line has an ideal cycle time of 0.75 min, an average downtime of 6.0 min per line stop occurrence, and a station failure frequency of 0.01 for all stations. A proposal has been submitted to locate a storage buffer between stations 15 and 16 to improve line efficiency. Determine (a) the current line efficiency and production rate, and (b) the maximum possible line efficiency and production rate that would result from installing the storage buffer.
- 16.19** Given the data in Problem 16.18, solve the problem except that (a) the proposal is to divide the line into three stages, that is, with two storage buffers located between stations 10 and 11, and between stations 20 and 21, respectively; and (b) the proposal is to use an asynchronous line with large storage buffers between every pair of stations on the line: that is, a total of 29 storage buffers.
- 16.20** In Problem 16.18, if the capacity of the proposed storage buffer is to be 20 parts, determine (a) line efficiency, and (b) production rate of the line. Assume that the downtime ($T_d = 6.0$ min) is a constant.
- 16.21** Solve Problem 16.20 but assume that the downtime ($T_d = 6.0$ min) follows the geometric repair distribution.

- 16.22** In the transfer line of Problems 16.18 and 16.20, suppose it is more technically feasible to locate the storage buffer between stations 11 and 12, rather than between stations 15 and 16. Determine (a) the maximum possible line efficiency and production rate that would result from installing the storage buffer, and (b) the line efficiency and production rate for a storage buffer with a capacity of 20 parts. Assume that the downtime per line stop ($T_d = 6.0$ min) is a constant.
- 16.23** A proposed synchronous transfer line will have 20 stations and will operate with an ideal cycle time of 0.5 min. All stations are expected to have an equal probability of breakdown, $p = 0.01$. The average downtime per breakdown is expected to be 5.0 min. An option under consideration is to divide the line into two stages, each stage having 10 stations, with a buffer storage zone between the stages. It has been decided that the storage capacity should be 20 units. The cost to operate the line is \$96.00/hr. Installing the storage buffer would increase the line operating cost by \$12.00/hr. Ignoring material and tooling costs, determine (a) line efficiency, production rate, and unit cost for the one-stage configuration, and (b) line efficiency, production rate, and unit cost for the optional two-stage configuration (assume a constant repair time).
- 16.24** A two-week study has been performed on a 12-station transfer line that is used to machine engine heads for an automotive company. During 80 hr of observation, the line was down 42 hr, and 1,689 parts were completed. The accompanying table lists the machining operation performed at each station, the process times, and the downtime occurrences for each station. Transfer time between stations is 6 sec. To address the downtime problem, it has been proposed to divide the line into two stages, each consisting of six stations. The storage buffer between the stages would have a storage capacity of 20 parts. Determine (a) line efficiency and production rate of the current one-stage configuration and (b) line efficiency and production rate of the proposed two-stage configuration. (c) Given that the line is to be divided into two stages, should each stage consist of six stations as proposed, or is there a better division of stations into stages? Support your answer.

Station	Operation	Process Time	Downtime Occurrences
1	Load part (manual)	0.50 min	0
2	Rough mill top	1.10 min	15
3	Finish mill top	1.25 min	18
4	Rough mill sides	0.75 min	23
5	Finish mill sides	1.05 min	31
6	Mill surfaces for drill	0.80 min	9
7	Drill two holes	0.75 min	22
8	Tap two holes	0.40 min	47
9	Drill three holes	1.10 min	30
10	Ream three holes	0.70 min	21
11	Tap three holes	0.45 min	30
12	Unload and inspect part (manual)	0.90 min	0
Totals:		9.40 min	246

- 16.25** In Problem 16.24, the current line has an operating cost of \$66.00/hr. The starting work part is a casting that costs \$4.50 per piece. Disposable tooling costs \$1.25 per piece. The proposed storage buffer will add \$6.00/hr to the operating cost of the line. Does the improvement in production rate justify this \$6 increase?
- 16.26** A 16-station transfer line can be divided into two stages by installing a storage buffer between stations 8 and 9. The probability of failure at any station is 0.01. The ideal cycle

time is 1.0 min and the downtime per line stop is 10.0 min. These values are applicable for both the one-stage and two-stage configurations. The downtime should be considered a constant value. The cost of installing the storage buffer is a function of its capacity. This cost function is $C_b = \$0.60b/\text{hr} = \$0.01b/\text{min}$, where b = the buffer capacity. However, the buffer can only be constructed to store increments of 10 (in other words, b can take on values of 10, 20, 30, etc.). The cost to operate the line itself is \$120/hr. Ignore material and tooling costs. Based on cost per unit of product, determine the buffer capacity b that will minimize unit product cost.

- 16.27 (A)** The uptime efficiency of a 20-station automated production line is only 40%. The ideal cycle time is 48 sec, and the average downtime per line stop occurrence is 3.0 min. Assume the frequency of breakdowns for all stations is equal ($p_i = p$ for all stations) and that the downtime is constant. To improve uptime efficiency, it is proposed to install a storage buffer with a 15-part capacity for \$14,000. The present production cost is \$4.00 per unit, ignoring material and tooling costs. How many units would have to be produced for the \$14,000 investment to pay for itself?
- 16.28** A transfer line is divided into two stages with a storage buffer between them. Each stage consists of nine stations. The ideal cycle time of each stage = 1.0 min, and frequency of failure for each station is 0.01. Average downtime per stop is 8.0 min, and a constant downtime distribution is assumed. Determine the required capacity of the storage buffer such that the improvement in line efficiency compared to a zero buffer capacity would be 80% of the improvement yielded by a buffer with infinite capacity.
- 16.29** A 20-station transfer line presently operates with a line efficiency $E = 1/3$. The ideal cycle time = 1.0 min. The repair distribution is geometric with an average downtime per occurrence of 8.0 min, and each station has an equal probability of failure. It is possible to divide the line into two stages with 10 stations each, separating the stages by a storage buffer of capacity b . With the information given, determine the required value of b that will increase the efficiency from $E = 1/3$ to $E = 2/5$.

APPENDIX 16A: TRANSFER LINES WITH INTERNAL STORAGE

As described in Section 16.3, the workstations are interdependent in an automated production line with no internal parts storage. When one station breaks down, all other stations on the line are affected, either immediately or by the end of a few cycles of operation, due to starving or blocking. These terms have the same meanings as in the operation of manual assembly lines (Section 15.1.2). **Starving** on an automated production line means that a workstation is prevented from performing its cycle because it has no part to work on. When a breakdown occurs at any workstation on the line, the downstream stations will either immediately or eventually become starved for parts. **Blocking** means that a station is prevented from performing its work cycle because it cannot pass the part just completed to the neighboring downstream station. When a breakdown occurs at a station on the line, the upstream stations become blocked because the broken-down station cannot accept the next part for processing from its upstream neighbor. Therefore, none of the upstream stations can pass its completed part forward.

Downtime on an automated line due to starving and blocking can be reduced by adding one or more parts-storage buffers between workstations. Storage buffers divide the line into stages that can operate independently for a number of cycles, the number depending on the storage capacity of the buffer. If one storage buffer is used, the line is divided into two stages. If two buffers are used at two different locations along the line, then a three-stage line is formed, and so forth. The upper limit is to have storage buffers between every pair of adjacent stations. The number of stages will then equal the number of workstations.

For an n -stage line, there will be $n - 1$ storage buffers, not including the raw parts inventory at the front of the line or the finished parts inventory at the end of the line.

Consider a two-stage transfer line, with a storage buffer separating the stages. Suppose that, on average, the storage buffer is half full. If the first stage breaks down, the second stage can continue to operate (avoid starving) using parts that have been collected in the buffer. And if the second stage breaks down, the first stage can continue to operate (avoid blocking) because it has the buffer to receive its output. The reasoning for a two-stage line can be extended to production lines with more than two stages. For any number of stages in an automated production line, the storage buffers allow each stage to operate somewhat independently, the degree of independence depending on the capacity of the upstream and downstream buffers.

Limits of Storage Buffer Effectiveness. Two extreme cases of storage buffer effectiveness can be identified: (1) no buffer storage capacity at all, and (2) infinite capacity storage buffers. In the analysis that follows, it is assumed that the ideal cycle time T_c is the same for all stages considered. This is generally desirable in practice because it helps to balance production rates among stages.

In the case of no storage capacity, the production line acts as one stage. When a station breaks down, the entire line stops. This is the case of a production line with no internal storage analyzed in Section 16.3. The efficiency of the line is given by Equation (16.11). It is rewritten here as the line efficiency of a zero capacity storage buffer,

$$E_0 = \frac{T_c}{T_c + FT_d} \quad (16A.1)$$

where the subscript 0 identifies E_0 as the efficiency of a line with zero storage buffer capacity, and the other terms have the same meanings as before.

The opposite extreme is the theoretical case where buffer zones of infinite capacity are installed between every pair of stages. If it is assumed that each buffer zone is half full (in other words, each buffer zone has an infinite supply of parts as well as the capacity to accept an infinite number of additional parts), then each stage is independent of the rest. The presence of infinite storage buffers means that no stage will ever be blocked or starved because of a breakdown at some other stage. Of course, an infinite capacity storage buffer cannot be realized in practice.

For all transfer lines with storage buffers, the overall line efficiency is limited by the bottleneck stage. That is, production on all other stages is ultimately restricted by the slowest stage. The downstream stages can only process parts at the output rate of the bottleneck stage. And it makes no sense to run the upstream stages at higher production rates because this will only accumulate inventory in the storage buffer ahead of the bottleneck. As a practical matter, therefore, the upper limit on the efficiency of the entire line is determined by the efficiency of the bottleneck stage. Given that the cycle time T_c is the same for all stages, the efficiency of any stage k is given by

$$E_k = \frac{T_c}{T_c + F_k T_{dk}} \quad (16A.2)$$

where the subscript k is used to identify the stage. According to the preceding logic, the overall line efficiency is given by

$$E_\infty = \text{Minimum}\{E_k\} \quad \text{for } k = 1, 2, \dots, K \quad (16A.3)$$

where the subscript ∞ identifies E_∞ as the efficiency of a line whose storage buffers all have infinite capacity.

By including one or more storage buffers in an automated production line, one expects the line efficiency to be greater than E_0 but E_∞ cannot be achieved because buffer zones of infinite capacity are not possible. Hence, the actual value of line efficiency for a given buffer capacity b will fall somewhere between these extremes:

$$E_0 < E_b < E_\infty \quad (16A.4)$$

Next, consider the problem of evaluating E_b for realistic levels of buffer capacity for a two-stage automated production line ($K = 2$).

Analysis of a Two-Stage Transfer Line. Most of the discussion in this section is based on the work of Buzacott, who pioneered the analytical research on production lines with buffer stocks. Several of his publications are listed in the references [1], [2], [3], [4], [5], and [6]. The presentation in this section follows Buzacott's analysis in [1].

The two-stage line is divided by a storage buffer of capacity b , which is the number of work parts it can store. The buffer receives the output of stage 1 and forwards it to stage 2, temporarily storing any parts up to its capacity b when stage 2 experiences a line stop. The ideal cycle time T_c is the same for both stages. It is assumed that the downtime distributions of each stage are the same with mean downtime = T_d . Let F_1 and $F_2 =$ the breakdown rates of stages 1 and 2, respectively; F_1 and F_2 are not necessarily equal.

Over the long run, both stages must have equal efficiencies. If the efficiency of stage 1 were greater than that of stage 2, then inventory would build up in the storage buffer until its capacity b is reached. Thereafter, stage 1 would be blocked when it out-produced stage 2. Similarly, if the efficiency of stage 2 were greater than that of stage 1, the inventory in the buffer would become depleted, thus starving stage 2. Accordingly, the efficiencies in the two stages would tend to equalize over time. The overall line efficiency for the two-stage line can be expressed as

$$E_b = E_0 + D'_1 h(b) E_2 \quad (16A.5)$$

where $E_b =$ overall line efficiency for a two-stage line with buffer capacity b ; $E_0 =$ line efficiency for the same line with no internal storage; and the second term on the right-hand side ($D'_1 h(b) E_2$) represents the improvement in efficiency that results from having a storage buffer with $b > 0$. Consider the terms on the right-hand side in Equation (16A.5). The value of E_0 was given by Equation (16A.1), but it is rewritten here to explicitly define the two-stage efficiency when $b = 0$:

$$E_0 = \frac{T_c}{T_c + (F_1 + F_2) T_d} \quad (16A.6)$$

The term D'_1 can be thought of as the proportion of total time that stage 1 is down, defined as follows:

$$D'_1 = \frac{F_1 T_d}{T_c + (F_1 + F_2) T_d} \quad (16A.7)$$

The term $h(b)$ is the proportion of the downtime D'_1 (when stage 1 is down) that stage 2 could be up and operating within the limits of storage buffer capacity b . Buzacott presents equations for evaluating $h(b)$ using Markov chain analysis. The equations cover several different downtime distributions based on the assumption that both stages are never down at the same time. Four of these equations are presented in Table 16A.1.

TABLE 16A.1 Formulas for Computing $h(b)$ in Equation (16A.5) for a Two-Stage Automated Production Line Under Several Downtime Distributions

Assumptions and definitions: Assume that the two stages have equal downtime distributions ($T_{d1} = T_{d2} = T_d$) and equal cycle times ($T_{c1} = T_{c2} = T_c$). Let F_1 = downtime frequency for stage 1 and F_2 = downtime frequency for stage 2. Define r to be the ratio of breakdown frequencies as follows:

$$r = \frac{F_1}{F_2} \quad (16A.8)$$

With these definitions and assumptions, the relationships for $h(b)$ can be expressed for two theoretical downtime distributions as derived by Buzacott [1]:

Constant downtime: Each downtime occurrence is assumed to be of constant duration T_d . This is a case of no downtime variation. Given buffer capacity b , define B and L as

$$b = B \frac{T_d}{T_c} + L \quad (16A.9)$$

where $B = \text{Maximum Integer} \leq b \frac{T_c}{T_d}$ and L represents the leftover units, the amount by which b exceeds $B \frac{T_d}{T_c}$. There are two cases:

$$\text{Case 1: } r = 1.0. \quad h(b) = \frac{B}{B+1} + L \frac{T_c}{T_d} \frac{1}{(B+1)(B+2)} \quad (16A.10)$$

$$\text{Case 2: } r \neq 1.0. \quad h(b) = r \frac{1 - r^B}{1 - r^{B+1}} + L \frac{T_c}{T_d} \frac{r^{B+1}(1-r)^2}{(1-r^{B+1})(1-r^{B+2})} \quad (16A.11)$$

Geometric downtime distribution: In this downtime distribution, the probability that repairs are completed during any cycle duration T_c is independent of the time since repairs began. This is a case of maximum downtime variation. There are two cases:

$$\text{Case 1: } r = 1.0. \quad h(b) = \frac{b \frac{T_c}{T_d}}{2 + (b-1) \frac{T_c}{T_d}} \quad (16A.12)$$

$$\text{Case 2: } r \neq 1.0. \quad \text{Define } K = \frac{1 + r - \frac{T_c}{T_d}}{1 + r - r \frac{T_c}{T_d}} \text{ then } h(b) = \frac{r(1 - K^b)}{1 - rK^b} \quad (16A.13)$$

Finally, E_2 corrects for the unrealistic assumption in the calculation of $h(b)$ that both stages are never down at the same time. What is more realistic is that when stage 1 is down but stage 2 is producing using parts stored in the buffer, occasionally stage 2 itself will break down. E_2 is calculated as

$$E_2 = \frac{T_c}{T_c + F_2 T_d} \quad (16A.14)$$

It should be mentioned that Buzacott's derivation of Equation (16A.5) in [1] omitted the E_2 term, relying on the assumption that stages 1 and 2 will not share downtimes. However, without E_2 the equation tends to overestimate line efficiency. With E_2 included, as in Equation (16A.5), the calculated values are much more realistic. In subsequent research, Buzacott developed other equations that agree closely with results given by Equation (16A.5).

EXAMPLE 16A.1 Two-Stage Automated Production Line

A 20-station transfer line is divided into two stages of 10 stations each. The ideal cycle time of each stage is $T_c = 1.2$ min. All of the stations in the line have the same probability of stopping, $p = 0.005$. The downtime is assumed constant when a breakdown occurs, $T_d = 8.0$ min. Compute the line efficiency for the following buffer capacities: (a) $b = 0$, (b) $b = \infty$, (c) $b = 10$, and (d) $b = 100$.

Solution: (a) A two-stage line with 20 stations and $b = 0$ turns out to be the same case as in Example 16.2. To review,

$$F = np = 20(0.005) = 0.10 \text{ and } T_p = T_c + FT_d = 1.2 + 0.1(8) = 2.0 \text{ min}$$

$$E_0 = \frac{1.2}{2.0} = \mathbf{0.60}$$

(b) For a two-stage line with 20 stations (each stage has 10 stations) and $b = \infty$,

$$F_1 = F_2 = 10(0.005) = 0.05 \text{ and } T_p = 1.2 + 0.05(8) = 1.6 \text{ min}$$

$$E_\infty = E_1 = E_2 = \frac{1.2}{1.6} = \mathbf{0.75}$$

(c) For a two-stage line with $b = 10$, each of the terms in Equation (16A.5) must be determined. E_0 is known from part (a): $E_0 = 0.60$, and E_2 from part (b): $E_2 = 0.75$. Hence,

$$D'_1 = \frac{0.05(8)}{1.2 + (0.05 + 0.05)(8)} = \frac{0.40}{2.0} = 0.20$$

Evaluation of $h(b)$ is from Equation (16A.10) for a constant repair distribution. In Equation (16A.9), the ratio

$$\frac{T_d}{T_c} = \frac{8.0}{1.2} = 6.667. \text{ For } b = 10, B = 1 \text{ and } L = 3.333. \text{ Thus,}$$

$$h(b) = h(10) = \frac{1}{1+1} + 3.333 \left(\frac{1.2}{8.0} \right) \frac{1}{(1+1)(1+2)} = 0.50 + 0.0833 = 0.5833$$

Equation (16A.5) can now be used:

$$E_{10} = 0.600 + 0.20(0.5833)(0.75) = 0.600 + 0.0875 = \mathbf{0.6875}$$

(d) For $b = 100$, the only parameter in Equation (16A.5) that is different from part (c) is $h(b)$. For $b = 100$, $B = 15$ and $L = 0$ in Equation (16A.9). Thus,

$$h(b) = h(100) = \frac{15}{15+1} = 0.9375$$

Using this value, $E_{100} = 0.600 + 0.20(0.9375)(0.75) = 0.600 + 0.1406 = \mathbf{0.7406}$



The value of $h(b)$ not only serves its role in Equation (16A.5), it also provides information on how much improvement in efficiency is obtained from any given value of b . Note in Example 16A.1 that the difference between E_∞ and $E_0 = 0.75 - 0.60 = 0.15$. For $b = 10$, $h(b) = h(10) = 0.5833$, which means that 58.33% of the maximum possible improvement in line efficiency is achieved by using a buffer capacity of 10. For $b = 100$, $h(b) = h(100) = 0.9375$, which means 93.75% of the maximum possible improvement is obtained.

Not only are the line efficiencies of a two-stage production line of interest. The corresponding production rates are also important. These can be evaluated based on knowledge of the ideal cycle time T_c and the definition of line efficiency. According to Equation (16.11), $E = T_c/T_p$. Since $R_p =$ the reciprocal of T_p , $E = T_c R_p$. Rearranging,

$$R_p = \frac{E}{T_c} \quad (16A.15)$$

EXAMPLE 16A.2 Production Rates on the Two-Stage Line of Example 16A.1

Compute the production rates for the four cases in Example 16A.1. $T_c = 1.2$ min as before.

Solution: (a) For $b = 0$, $E_0 = 0.60$. Applying Equation (16A.15),

$$R_p = 0.60/1.2 = 0.5 \text{ pc/min} = \mathbf{30 \text{ pc/hr}}$$

This is the same value calculated in Example 16.2.

(b) For $b = \infty$, $E_\infty = 0.75$, and $R_p = 0.75/1.2 = 0.625 \text{ pc/min} = \mathbf{37.5 \text{ pc/hr}}$

(c) For $b = 10$, $E_{10} = 0.6875$, and $R_p = 0.6875/1.2 = 0.5729 \text{ pc/min} = \mathbf{34.375 \text{ pc/hr}}$

(d) For $b = 100$, $E_{100} = 0.7406$, and $R_p = 0.7406/1.2 = 0.6172 \text{ pc/min} = \mathbf{37.03 \text{ pc/hr}}$

In Example 16A.1, a constant repair distribution was assumed. Every breakdown had the same constant repair time of 8.0 min. It is more realistic to expect that there will be some variation in the repair time. Table 16A.1 provides two possible distributions, representing extremes in variability. The constant repair distribution was used in Examples 16A.1 and 16A.2, which represents the case of no downtime variation. This is covered by Equations (16A.10) and (16A.11). The other extreme is the case of very high variation. This is presented in Table 16A.1 as the geometric repair distribution, where $h(b)$ is computed by Equations (16A.12) and (16A.13).

EXAMPLE 16A.3 Effect of High Variability in Downtime

Evaluate the line efficiencies and production rates for the two-stage line in Examples 16A.1 and 16A.2 using the geometric repair distribution instead of the constant downtime distribution.

Solution: For (a) and (b), values of E_0 and E_∞ will be the same as in Example 16A.2.

(a) $E_0 = 0.60$ and $R_p = 30 \text{ pc/hr}$

(b) $E_\infty = 0.75$ and $R_p = 37.5 \text{ pc/hr}$

(c) For $b = 10$, all of the parameters in Equation (16A.5) remain the same except $h(b)$.

Using Equation (16A.12),

$$h(b) = h(10) = \frac{10(1.2/8.0)}{2 + (10 - 1)(1.2/8.0)} = 0.4478$$

Now using Equations (16A.5) and (16A.15),

$$E_{10} = 0.600 + 0.20(0.4478)(0.75) = 0.6672 \text{ and}$$

$$R_p = 0.6672(60)/1.2 = 33.36 \text{ pc/hr}$$

(d) For $b = 100$, again the only change is in $h(b)$.

$$h(b) = h(100) = \frac{100(1.2/8.0)}{2 + (100 - 1)(1.2/8.0)} = 0.8902$$

$$E_{100} = 0.600 + 0.20(0.8902)(0.75) = 0.7333 \text{ and}$$

$$R_p = 0.7333(60)/1.2 = 36.67 \text{ pc/hr}$$

Note that when the values of line efficiency and production rate for $b = 10$ and $b = 100$ in this example are compared with the corresponding values in Examples 16A.1 and 16A.2, both values are lower here. It must be concluded that increased downtime variability degrades line performance.

Transfer Lines with More Than Two Stages. If the line efficiency of an automated production line can be increased by dividing it into two stages with a storage buffer between, then one might infer that further improvements in performance can be achieved by adding additional storage buffers. Although exact formulas are not presented to compute line efficiencies as a function of buffer capacity b in lines with more than one storage buffer, efficiencies can readily be determined for the case of infinite buffer capacity in such lines.

EXAMPLE 16A.4 Transfer Lines with More Than One Storage Buffer

For the same 20-station transfer line considered in the previous examples, compare line efficiencies and production rates for the following cases, assuming an infinite buffer capacity: (a) no storage buffer, (b) one buffer, (c) three buffers, and (d) 19 buffers. Base the comparison on constant repair times. Assume in cases (b) and (c) that the buffers are located in the line so as to equalize the downtime frequencies, that is, all F_i are equal.

Solution: The answers for (a) and (b) have already been computed in Example 16A.2.

(a) For the case of no storage buffer, $E_\infty = 0.60$ and $R_p = 0.60(60)/1.2 = \mathbf{30 \text{ pc/hr}}$

(b) For one storage buffer (a two-stage line), $E_\infty = 0.75$ and $R_p = 0.75(60)/1.2 = \mathbf{37.5 \text{ pc/hr}}$

(c) For the case of three storage buffers (a four-stage line),

$$F_1 = F_2 = F_3 = F_4 = 5(.005) = 0.025 \text{ and}$$

$$T_p = 1.2 + 0.025(8) = 1.4 \text{ min/pc}$$

$$E_\infty = 1.2/1.4 = \mathbf{0.8571} \text{ and } R_p = 0.8571(60)/1.2 = \mathbf{42.86 \text{ pc/hr}}$$

(d) For the case of 19 storage buffers (each stage is one station),

$$F_1 = F_2 = \dots = F_{20} = 1(0.005) = 0.005 \text{ and}$$

$$T_p = 1.2 + 0.005(8) = 1.24 \text{ min/pc}$$

$$E_\infty = 1.2/1.24 = \mathbf{0.9677} \text{ and } R_p = 0.9677(60)/1.2 = \mathbf{48.39 \text{ pc/hr}}$$

Comment: This last value is very close to the ideal production rate of $R_c = 60/1.2 = 50 \text{ pc/hr}$.

What the Equations Tell Us. The equations and analysis in this appendix provide the following practical guidelines in the design and operation of automated production lines with internal storage buffers:

- If E_0 and E_∞ are nearly equal in value, little advantage is gained by adding a storage buffer to the line. If E_∞ is significantly greater than E_0 , then storage buffers offer the possibility of significantly improving line performance.
- In considering a multistage automated production line, workstations should be divided into stages so as to make the efficiencies of all stages as equal as possible. In this way, the maximum difference between E_0 and E_∞ is achieved, and no single stage will stand out as a significant bottleneck.
- In the operation of an automated production line with storage buffers, if any of the buffers are nearly always empty or nearly always full, this indicates that the production rates of the stages on either side of the buffer are out of balance and that the storage buffer is serving little useful purpose.
- The maximum possible line efficiency is achieved by (1) setting the number of stages equal to the number of stations—that is, by providing a storage buffer between every pair of stations and (2) by using large capacity buffers.
- The “law of diminishing returns” operates in multistage automated lines. It is manifested in two ways: (1) as the number of storage buffers is increased, line efficiency improves at an ever decreasing rate, and (2) as the storage buffer capacity is increased, line efficiency improves at an ever decreasing rate.

Chapter 17

Automated Assembly Systems

CHAPTER CONTENTS

- 17.1 Fundamentals of Automated Assembly Systems
 - 17.1.1 System Configurations
 - 17.1.2 Parts Delivery at Workstations
 - 17.1.3 Applications
- 17.2 Analysis of Automated Assembly Systems
 - 17.2.1 Parts Delivery System at Workstations
 - 17.2.2 Multistation Assembly Machines
 - 17.2.3 Single-Station Assembly Machines
 - 17.2.4 Partial Automation
 - 17.2.5 What the Equations Tell Us

The term *automated assembly* refers to mechanized and automated devices that perform various assembly tasks in an assembly line or cell. Much progress has been made in the technology of assembly automation in recent years. Some of this progress has been motivated by advances in the field of robotics. Industrial robots are sometimes used as components in automated assembly systems (Chapter 8). In this chapter, automated assembly is discussed as a distinct field of automation. Although the manual assembly methods described in Chapter 15 will be used for many years into the future, there are significant opportunities for productivity gains in the use of automated methods.

Like the transfer lines discussed in the preceding chapter, automated assembly systems are usually included in the category of fixed automation. Most automated assembly systems are designed to perform a fixed sequence of assembly steps on a specific product.

Automated assembly technology should be considered when the following conditions exist:

- High product demand. Automated assembly systems should be considered for products made in millions of units (or close to this range).
- Stable product design. In general, any change in the product design means a change in workstation tooling and possibly the sequence of assembly operations. Such changes can be very costly.
- A limited number of components in the assembly. Riley [11] recommends a maximum of around a dozen parts.
- The product is designed for automated assembly. In Chapter 24, the product design factors that allow for automated assembly are explored.

Automated assembly systems involve a significant capital expense. However, the investments are generally less than for the automated transfer lines because (1) work units produced on automated assembly systems are usually smaller than those made on transfer lines and (2) assembly operations do not have the large mechanical force and power requirements of processing operations such as machining. Accordingly, in comparing an automated assembly system and a transfer line with the same number of stations, the assembly system would tend to be physically smaller. This usually reduces the cost of the system.

17.1 FUNDAMENTALS OF AUTOMATED ASSEMBLY SYSTEMS

An automated assembly system performs a sequence of automated assembly operations to combine multiple components into a single entity. The single entity can be a final product or a subassembly in a larger product. In many cases, the assembled entity consists of a base part to which other components are attached. The components are usually joined one at a time, so the assembly is completed progressively.

A typical automated assembly system consists of the following subsystems: (1) one or more workstations at which the assembly steps are accomplished, (2) parts feeding devices that deliver the individual components to the workstation(s), and (3) a work handling system for the assembled entity. In assembly systems with one workstation, the work handling system moves the base part into and out of the station. In systems with multiple stations, the handling system transfers the partially assembled base part between stations.

Control functions required in automated assembly machines are the same as in the automated production lines of Chapter 16: (1) sequence control, (2) safety monitoring, and (3) quality control. These functions are described in Section 16.1.3.

17.1.1 System Configurations

Automated assembly systems can be classified according to physical configuration. The principal configurations, illustrated in Figure 17.1, are (a) in-line assembly machine, (b) dial-type assembly machine, (c) carousel assembly system, and (d) single-station assembly machine.

The in-line assembly machine, Figure 17.1(a), is a series of automatic workstations located along an in-line transfer system. It is the assembly version of the machining transfer line. Synchronous and asynchronous transfer systems are the common means of transporting base parts from station to station with the in-line configuration.

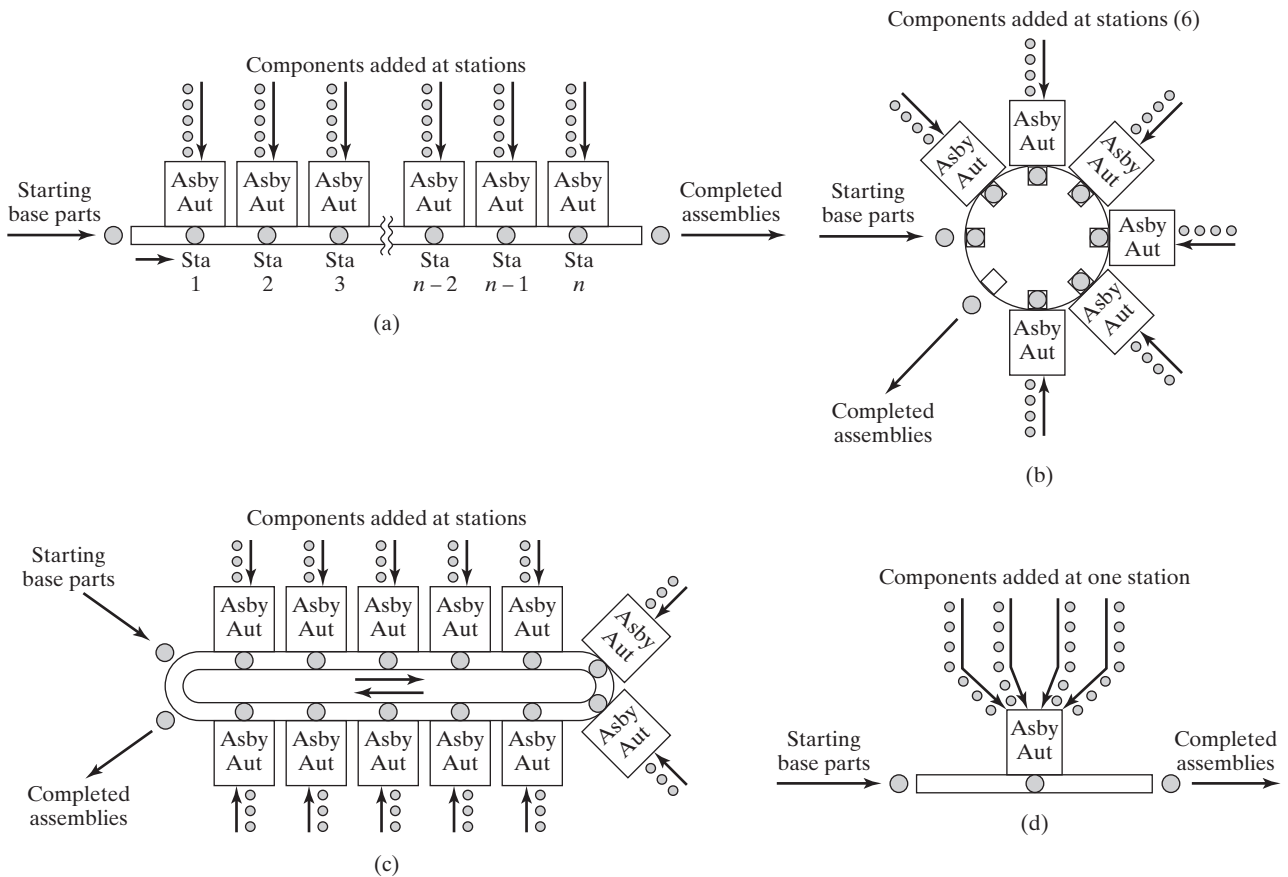


Figure 17.1 Types of automated assembly systems: (a) in-line, (b) dial-type, (c) carousel, and (d) single station.

In the typical application of the dial-type machine, Figure 17.1(b), base parts are loaded onto fixtures or nests attached to the circular dial. Components are added and/or joined to the base part at the various workstations located around the periphery of the dial. The dial-indexing machine operates with a synchronous or intermittent motion, in which the cycle consists of the service time plus indexing time. Dial-type assembly machines are sometimes designed to use a continuous rather than intermittent motion. This is common in beverage bottling and canning plants, but not in mechanical and electronics assembly.

The operation of dial-type and in-line assembly systems is similar to the operation of their counterparts for processing operations described in Section 16.1.1, except that assembly operations are performed. For synchronous transfer of work between stations, the ideal cycle time equals the operation time at the slowest station plus the transfer time between stations. The production rate, at 100% uptime, is the reciprocal of the ideal cycle time. Owing to part jams at the workstations and other malfunctions, the system will always operate at less than 100% uptime.

As seen in Figure 17.1(c), the carousel assembly system represents a hybrid between the circular work flow of the dial-type assembly machine and the straight work flow of the in-line system. The carousel configuration can be operated with continuous, synchronous, or asynchronous transfer mechanisms to move the work around the carousel. Carousels with asynchronous transfer of work are often used in partially automated assembly systems (Section 17.2.4).

In the single-station assembly machine, Figure 17.1(d), assembly operations are performed on a base part at a single location. The typical operating cycle involves the placement of the base part at a stationary position in the workstation, the addition of components to the base, and finally the removal of the completed assembly from the station. An important application of single-station assembly is the component placement machine, widely used in the electronics industry to populate components onto printed circuit boards. For mechanical assemblies, the single-station cell is sometimes selected as the configuration for robotic assembly applications. Parts are fed into the single station, and the robot adds them to the base part and performs the fastening operations. Compared with the other three system types, the cycle time is longer in a single-station assembly system because all of the assembly tasks are performed sequentially instead of simultaneously. Hence, production rates are inherently slower. Single-station assembly systems are analyzed in Section 17.2.3.

17.1.2 Parts Delivery at Workstations

In each of the configurations described earlier, a workstation accomplishes one or both of the following tasks: (1) a component is delivered to the assembly work head and added to the existing base part in front of the work head (at the first station in the system, the base part is often deposited onto a work carrier or pallet fixture), and (2) a fastening or joining operation is performed at the station to permanently attach components to the existing base part. In the case of a single-station assembly system, these tasks are carried out multiple times at the single station. Task (1) requires the parts to be delivered to the assembly work head. The parts delivery system typically consists of the following hardware:

1. *Hopper*. This is the container into which the components are loaded at the workstation. A separate hopper is used for each component type. The components are usually loaded into the hopper in bulk. This means that the parts are randomly oriented in the hopper.
2. *Parts feeder*. This is a mechanism that removes the components from the hopper one at a time for delivery to the assembly work head. The hopper and parts feeder are often combined into one operating mechanism. A vibratory bowl feeder, pictured in Figure 17.2, is a very common example of the hopper-feeder combination.

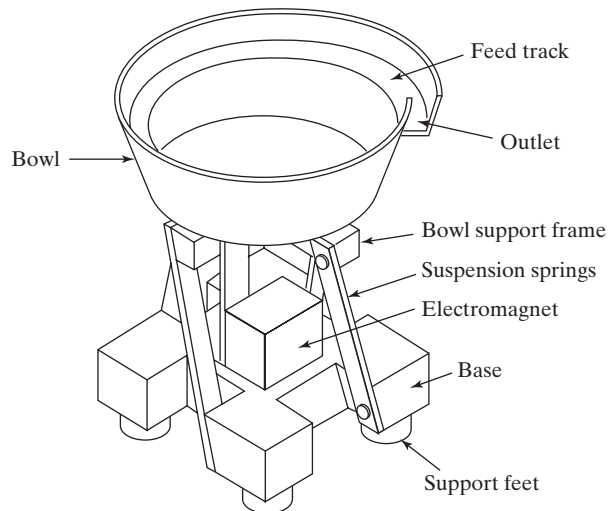


Figure 17.2 Vibratory bowl feeder.

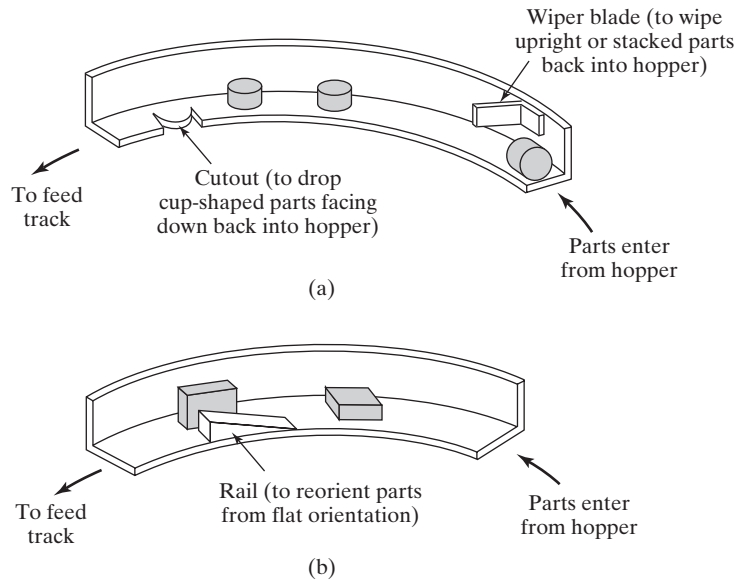


Figure 17.3 (a) Selector and (b) orientor devices used with parts feeders in automated assembly systems.

3. *Selector and/or orientor.* These elements of the delivery system establish the proper orientation of the components for the assembly work head. A **selector** is a device that acts as a filter, permitting only parts in the correct orientation to pass through. Incorrectly oriented parts are rejected back into the hopper. An **orientor** is a device that allows properly oriented parts to pass through, and reorients parts that are not properly oriented initially. Several selector and orientor schemes are illustrated in Figure 17.3. Selector and orientor devices are often combined and incorporated into one hopper-feeder system.
4. *Feed track.* The preceding elements of the delivery system are usually separated from the assembly work head by a certain distance. A feed track moves the components from the hopper and parts feeder to the location of the assembly work head, maintaining proper orientation of the parts during the transfer. There are two general categories of feed tracks: gravity and powered. Gravity feed tracks are most common. In this type, the hopper and parts feeder are located at an elevation above that of the work head. Gravity is used to deliver the components to the work head. The powered feed track uses vibratory action, air pressure, or other means to force the parts to travel along the feed track toward the assembly work head.
5. *Escapement and placement device.* The escapement removes components from the feed track at time intervals that are consistent with the cycle time of the assembly work head. The placement device physically places the component in the correct location at the workstation for the assembly operation. These elements are sometimes combined into a single operating mechanism. In other cases, they are two separate devices. Several types of escapement and placement devices are pictured in Figure 17.4.

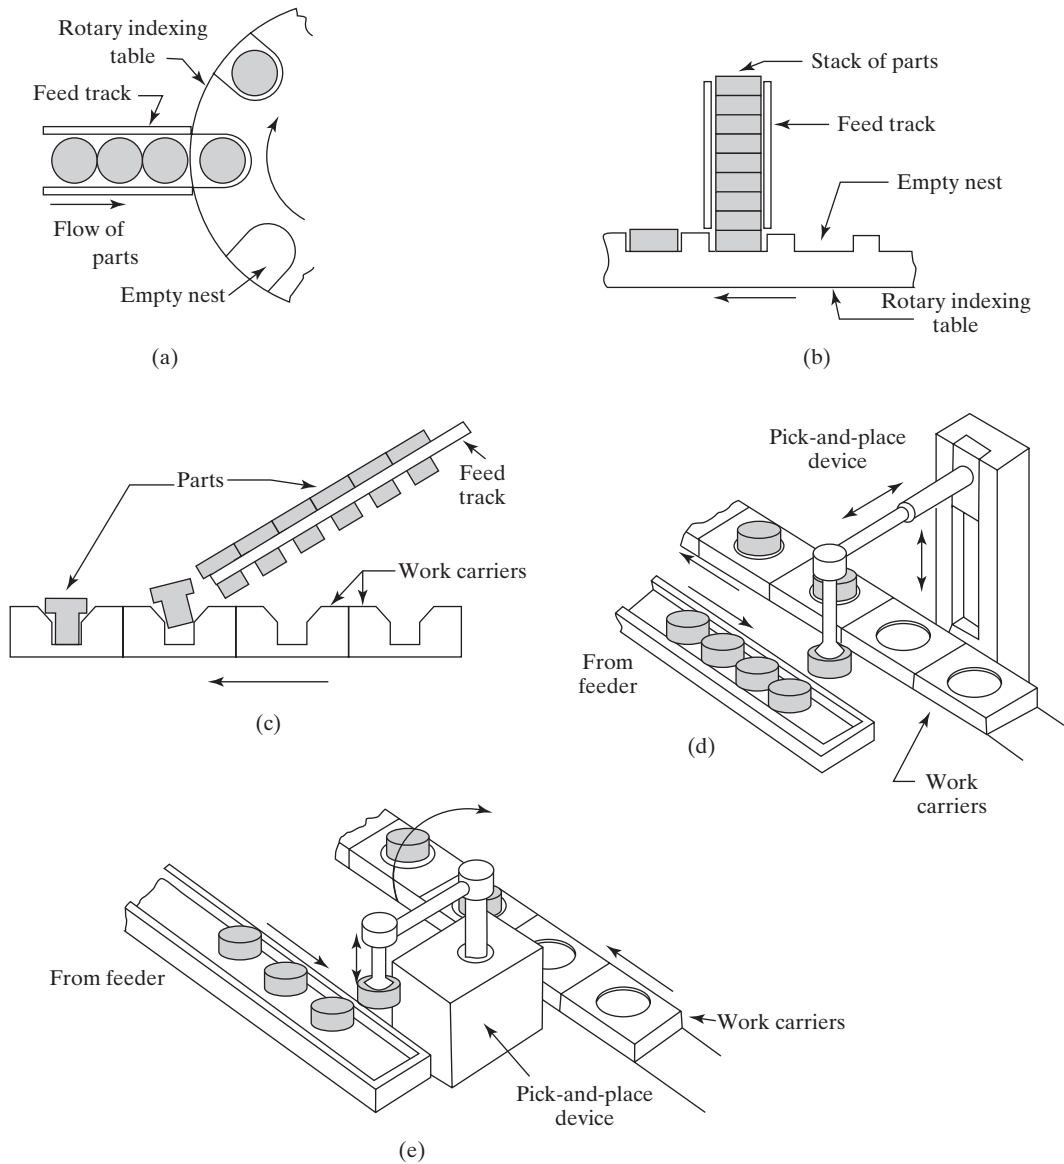


Figure 17.4 Various escapement and placement devices used in automated assembly systems: (a) and (b) horizontal and vertical devices for placement of parts onto dial-indexing table; (c) escapement of rivet-shaped parts actuated by work carriers; (d) and (e) two types of pick-and-place mechanisms that use suction cups to pick up parts.

The hardware elements of the parts delivery system are illustrated schematically in Figure 17.5. A parts selector is illustrated in the diagram. Improperly oriented parts are returned to the hopper. In the case of a parts orientor, improperly oriented parts are reoriented and proceed to the feed track. A more detailed description of the various elements of the delivery system is provided in Boothroyd, Poli, and Murch [3].

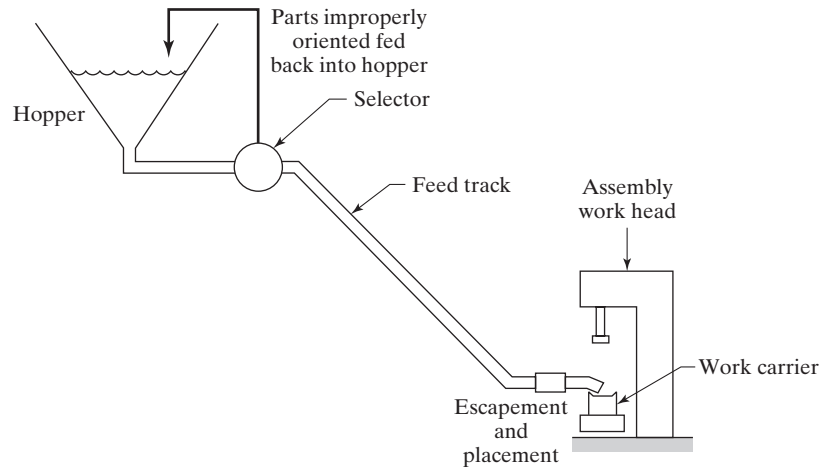


Figure 17.5 Hardware elements of the parts delivery system at an assembly workstation.

17.1.3 Applications

Automated assembly systems are used to produce a wide variety of products and sub-assemblies. Table 17.1 presents a list of typical products made by automated assembly.

Table 17.2 provides a representative list of assembly processes that are performed on automated assembly machines. It should be noted that certain assembly processes are more suitable for automation than others. For example, threaded fasteners (screws, bolts, and nuts), although common in manual assembly, are a challenging assembly method to automate. This issue is discussed in Chapter 24, which also provides some guidelines for designing products for automated assembly.

TABLE 17.1 Typical Products Made by Automated Assembly

Alarm clocks	Fuel injectors	Pumps for household appliances
Ball bearings	Gearboxes	Small electric motors
Ball point pens	Lightbulbs	Spark plugs
Cigarette lighters	Locks	Wrist watches
Computer diskettes	Mechanical pens and pencils	
Electrical plugs and sockets	Printed circuit board assemblies	

TABLE 17.2 Typical Assembly Processes Used in Automated Assembly Systems

Automatic dispensing of adhesive	Snap fitting
Insertion of components (electronic assembly)	Soldering
Placement of components (electronic assembly)	Spot welding
Riveting	Stapling
Screw fastening (automatic screwdriver)	Stitching

17.2 ANALYSIS OF AUTOMATED ASSEMBLY SYSTEMS

This section provides mathematical models to analyze the following topics in automated assembly: (1) the parts delivery system at workstations, (2) multistation automated assembly systems, (3) single-station automated assembly systems, and (4) partial automation.

17.2.1 Parts Delivery System at Workstations

In the parts delivery system, Figure 17.5, the parts feeding mechanism is capable of removing components from the hopper at a certain rate f . These components are assumed to be randomly oriented initially, and must be presented to the selector or orientor to establish the correct orientation. In the case of a selector, a certain proportion of the components will be correctly oriented initially and these will be allowed to pass through. The remaining components that are incorrectly oriented will be rejected back to the hopper. In the case of an orientor, incorrectly oriented components will be reoriented, resulting ideally in a 100% rate of components passing through the device. In many delivery system designs, the functions of the selector and the orientor are combined. Let θ be the proportion of components that pass through the selector-orientor process and are correctly oriented for delivery into the feed track. Hence the effective rate of delivery of components from the hopper into the feed track is $f\theta$. The remaining proportion, $(1 - \theta)$, is recirculated back into the hopper. Obviously, the delivery rate $f\theta$ of components to the work head must be sufficient to keep up with the cycle rate of the assembly machine.

Assuming the delivery rate of components $f\theta$ is greater than the cycle rate R_c of the assembly machine, the system needs to have a means of limiting the size of the queue in the feed track. The usual solution is to place a sensor (e.g., limit switch or optical sensor) near the top of the feed track to turn off the feeding mechanism when the feed track is full. This sensor is referred to as the high-level sensor, and its location defines the active length L_{f2} of the feed track. If the length of a component in the feed track is L_c , then the number of parts that can be held in the feed track is $n_{f2} = L_{f2}/L_c$. The length must be measured from a point on a given component to the corresponding point on the next component in the queue to allow for possible overlap of parts. The value of n_{f2} is the capacity of the feed track.

Another sensor placed along the feed track at some distance from the first sensor is used to restart the feeding mechanism. If the location of this low-level sensor is defined as L_{f1} , then the number of components in the feed track at this point is $n_{f1} = L_{f1}/L_c$.

The rate at which parts in the feed track are reduced when the high-level sensor is actuated (which turns off the feeder) = R_c , which is the cycle rate of the automated assembly work head. On average, the rate at which the quantity of parts will increase upon actuation of the low-level sensor (which turns on the feeder) is $f\theta - R_c$. This rate of increase will not be uniform due to the random nature of the feeder-selector operation. Accordingly, the value of n_{f1} must be large enough to virtually eliminate the possibility of a stock out after the low-level sensor has turned on the feeder. The following example illustrates how these rates of decrease and increase can be used to determine the depletion and replenishment times in the feed track.

EXAMPLE 17.1 Parts Delivery System in Automatic Assembly

The cycle time for a given assembly work head = 6 sec. The parts feeder has a feed rate of 50 components per min. The probability that a given component fed by the feeder will pass through the selector is $\theta = 0.25$. The number of parts in the feed track corresponding to the low-level sensor is $n_{f1} = 6$. The capacity of the feed track is $n_{f2} = 18$ parts. Determine (a) how long it will take for the supply of parts in the feed track to go from n_{f2} to n_{f1} , and (b) how long it will take on average for the supply of parts to go from n_{f1} to n_{f2} .

Solution: (a) $T_c = 6 \text{ sec} = 0.1 \text{ min}$. The rate of depletion of parts in the feed track starting from n_{f2} will be $R_c = 1/0.1 = 10 \text{ parts/min}$

$$\text{Time to deplete feed track (time to go from } n_{f2} \text{ to } n_{f1}) = T_{de} = \frac{18 - 6}{10} = \mathbf{1.2 \text{ min}}$$

(b) The rate of parts increase in the feed track when the low-level sensor is reached is $f\theta - R_c = (50)(0.25) - 10 = 12.5 - 10 = 2.5 \text{ parts/min}$

$$\text{Time to replenish feed track (time go from } n_{f1} \text{ to } n_{f2}) = T_{re} = \frac{18 - 6}{2.5} = \mathbf{4.8 \text{ min}}$$

17.2.2 Multistation Assembly Machines

In this section, the operation and performance of automated assembly machines that have several workstations are analyzed. These include dial-indexing machines, many in-line assembly systems, and certain carousel systems. Assumptions underlying the analysis are similar to those in the analysis of transfer lines: (1) assembly operations at the stations have constant element times, although the times are not necessarily equal at all stations; (2) synchronous parts transfer is used; and (3) there is no internal storage.

The analysis of an automated assembly machine with multiple stations shares much in common with the approach used for transfer lines in Section 16.3. Some modifications in the analysis must be made to account for the fact that components are being added at workstations in the assembly system, whereas no components are added in transfer lines. The operations of multistation assembly systems are depicted in Figures 17.1(a), (b), and (c). The equations that describe these operations are based on the approach developed by Boothroyd and Redford [2].

The typical operation at a workstation consists of a component being added and/or joined in some fashion to an existing assembly. The existing assembly consists of a base part plus the components assembled to it at previous stations. The base part is launched onto the line either at or before the first workstation. The components added at each station must be clean, uniform in size and shape, of high quality, and consistently oriented. When the feed mechanism and assembly work head attempt to join a component that does not satisfy this specification, the station can jam. When a jam occurs, it results in the shutdown of the entire system until the fault is corrected. Thus, in addition to the other mechanical and electrical failures that interrupt the operation of an automated production line, the problem of defective components is one that specifically plagues the operation of an automatic assembly system.

The Assembly Machine as a Game of Chance. Defective parts occur in manufacturing with a certain fraction defect rate q ($0 \leq q \leq 1.0$). In the operation of an assembly workstation, q is the probability that the component to be added during the current cycle is defective. When an attempt is made to feed and assemble a defective component, the defect might or might not cause the station to jam. Let m = probability that a defect results in a jam at the station and consequential stoppage of the line. Since the values of q and m may be different for different stations, these terms are subscripted as q_i and m_i , where $i = 1, 2, \dots, n$, and n is the number of workstations on the assembly machine.

At a particular workstation, say station i , there are three possible events that might occur when the feed mechanism attempts to feed the next component and the assembly device attempts to join it to the existing assembly at the station.

1. The component is defective and causes a station jam. The probability of this event is the fraction defect rate of the parts at the station (q_i) multiplied by the probability that a defect will cause the station to jam (m_i). This product is the same term p_i as in the previous analysis of transfer machines in Section 16.3. For an assembly machine, $p_i = m_i q_i$. When the station jams, the component must be cleared and the next component allowed to feed and be assembled. It is assumed that the probability of two consecutive defects is very small, equal to q_i^2 .
2. The component is defective but does not cause a station jam. This has a probability $(1 - m_i)q_i$. With this outcome, a bad part is joined to the existing assembly, perhaps rendering the entire assembly defective.
3. The component is not defective. This is the most desirable outcome and the most likely by far (it is hoped). The probability that a part added at the station is not defective is equal to the proportion of good parts $(1 - q_i)$.

The probabilities of the three possible events must sum to unity for any workstation; that is,

$$m_i q_i + (1 - m_i)q_i + (1 - q_i) = 1 \quad (17.1)$$

For the special case where $m_i = m$ and $q_i = q$ for all i , this equation reduces to the following:

$$mq + (1 - m)q + (1 - q) = 1 \quad (17.2)$$

Although it is unlikely that all m_i are equal and all q_i are equal, the equation is nevertheless useful for computation and approximation purposes.

To determine the complete distribution of possible outcomes that can occur on an n -station assembly machine, the terms of Equation (17.1) are multiplied together for all n stations:

$$\prod_{i=1}^n [m_i q_i + (1 - m_i)q_i + (1 - q_i)] = 1 \quad (17.3)$$

In the special case where $m_i = m$ and $q_i = q$ for all i , this reduces to

$$[mq + (1 - m)q + (1 - q)]^n = 1 \quad (17.4)$$

Expansion of Equation (17.3) reveals the probabilities for all possible sequences of events that can take place on the n -station assembly machine. Regrettably, the number of terms

in the expansion becomes very large for a machine with more than two or three stations. The exact number of terms is equal to 3^n , where n = number of stations. For example, for an eight-station line, the number of terms = $3^8 = 6561$, each term representing the probability of one of the 6,561 possible outcome sequences on the assembly machine.

Measures of Performance. Fortunately, it is not necessary to calculate every term to use the description of assembly machine operation provided by Equation (17.3). One of the performance characteristics of interest is the proportion of assemblies that contain one or more defective components. Two of the three terms in Equation (17.3) represent events in which a defective component is not added at the given station. The first term is $m_i q_i$, which indicates that a station jam has occurred, preventing a defective component from being added to the existing assembly. The other term is $(1 - q_i)$, which means that a good component has been added at the station. The sum of these two terms represents the probability that a defective component is not added at station i . Multiplying these probabilities for all stations provides the proportion of acceptable product coming off the line:

$$P_{ap} = \prod_{i=1}^n (1 - q_i + m_i q_i) \quad (17.5)$$

where P_{ap} can be thought of as the *yield* of good assemblies produced by the assembly machine. If P_{ap} = the proportion of good assemblies, then the proportion of assemblies containing at least one defective component P_{qp} is given by

$$P_{qp} = 1 - P_{ap} = 1 - \prod_{i=1}^n (1 - q_i + m_i q_i) \quad (17.6)$$

In the case of equal m_i and equal q_i , these two equations become, respectively,

$$P_{ap} = (1 - q + mq)^n \quad (17.7)$$

$$P_{qp} = 1 - (1 - q + mq)^n \quad (17.8)$$

The yield P_{ap} is an important performance metric of an assembly machine. To have a certain proportion of assemblies with one or more defective components in the final output is a significant problem. These assemblies must be identified by inspection and sortation, or they will be mixed in with the good assemblies, which could lead to undesirable consequences when the assemblies are placed in service.

Other performance measures of interest are the machine's production rate, the proportion of uptime and downtime, and the average cost per unit produced. To calculate production rate, the frequency of downtime occurrences per cycle F is first determined. If each station jam results in a machine downtime occurrence, F is found by summing the expected number of station jams per cycle:

$$F = \sum_{i=1}^n p_i = \sum_{i=1}^n m_i q_i \quad (17.9)$$

In the case of a station performing only a joining or fastening operation and not adding a part at the station, then the contribution to F made by that station is p_i , the probability of a station breakdown, where p_i does not depend on m_i and q_i .

If $m_i = m$ and $q_i = q$ for all stations, $i = 1, 2, \dots, n$, then the above equation for F reduces to the following:

$$F = nmq \quad (17.10)$$

The average actual production time per assembly is given by

$$T_p = T_c + \sum_{i=1}^n m_i q_i T_d \quad (17.11)$$

where T_c = ideal cycle time of the assembly machine, which is the longest assembly task time on the machine plus the indexing or transfer time, min; and T_d = average downtime per occurrence, min. For the case of equal m_i and q_i ,

$$T_p = T_c + nmqT_d \quad (17.12)$$

The production rate is the reciprocal of average actual production time:

$$R_p = \frac{1}{T_p} \quad (17.13)$$

This is the same relationship as Equation (16.9) for transfer lines. However, the operation of assembly machines is different from processing machines. In an assembly machine, unless $m_i = 1.0$ for all stations, the production output will include some assemblies with one or more defective components. Accordingly, the production rate should be corrected to give the rate of acceptable product, that is, those that contain no defects. This is simply the yield P_{ap} multiplied by the production rate

$$R_{ap} = P_{ap}R_p = \frac{P_{ap}}{T_p} = \frac{\prod_{i=1}^n (1 - q_i + m_i q_i)}{T_p} \quad (17.14)$$

where R_{ap} = production rate of acceptable product, units/min. When all m_i are equal and all q_i are equal, the corresponding equation is

$$R_{ap} = P_{ap}R_p = \frac{P_{ap}}{T_p} = \frac{(1 - q + mq)^n}{T_p} \quad (17.15)$$

Equation (17.13) gives the production rate of all assemblies made on the system, including those that contain one or more defective parts. Equations (17.14) and (17.15) give production rates for good product only. The problem still remains that the defective products are mixed in with the good units. This issue of inspection and sortation is considered in Chapter 21.

Line efficiency is calculated as the ratio of ideal cycle time to average actual production time. This is the same ratio as defined in Chapter 16, Equation (16.11),

$$E = \frac{R_p}{R_c} = \frac{T_c}{T_p} \quad (17.16)$$

where T_p is calculated from Equation (17.11) or Equation (17.12). The proportion downtime $D = 1 - E$, as before. No attempt has been made to correct line efficiency E for the yield of good assemblies. The efficiency of the assembly machine and the quality of units produced by it are treated here as separate issues.

On the other hand, the cost per assembled product must take account of the output quality. Therefore, the general cost formula given in Equation (16.14) in the previous chapter must be corrected for yield, as

$$C_{pc} = \frac{C_m + C_o T_p + C_t}{P_{ap}} \quad (17.17)$$

where C_{pc} = cost per good assembly, \$/pc; C_m = cost of materials, which includes the cost of the base part plus components added to it, \$/pc; C_o = operating cost of the assembly system, \$/min; T_p = average actual production time, min/pc; C_t = cost of disposable tooling, \$/pc; and P_{ap} = yield from Equation (17.5). The effect of the denominator is to increase the cost per assembly; as the quality of the individual components deteriorates, the average cost per good quality assembly increases.

In addition to the traditional ways of indicating line performance (production rate, line efficiency, cost per unit), there is the additional metric of yield. While the yield of good product is an important issue in any automated production line, it can be explicitly included in the formulas for assembly machine performance by means of q and m .

EXAMPLE 17.2 Multistation Automated Assembly System

A 10-station in-line assembly machine has an ideal cycle time = 6 sec. The base part is automatically loaded prior to the first station, and components are added at each of the stations. The fraction defect rate at each of the 10 stations is $q = 0.01$, and the probability that a defect will jam is $m = 0.5$. When a jam occurs, the average downtime is 2 min. Cost to operate the assembly machine is \$42.00/hr. Other costs are ignored. Determine (a) average production rate of all assemblies, (b) yield of good assemblies, (c) average production rate of good product, (d) uptime efficiency of the assembly machine, and (e) cost per unit.

Solution: (a) $T_c = 6 \text{ sec} = 0.1 \text{ min}$. The average production cycle time is $T_p = 0.1 + (10)(0.5)(0.01)(2.0) = 0.2 \text{ min}$. The production rate is therefore

$$R_p = \frac{60}{0.2} = \mathbf{300 \text{ total assemblies/hr}}$$

(b) The yield is given by Equation (17.7):

$$P_{ap} = \{1 - .01 + 0.5(0.01)\}^{10} = \mathbf{0.9511}$$

(c) Average actual production rate of good assemblies is determined by Equation (17.15):

$$R_{ap} = 300(0.9511) = \mathbf{285.3 \text{ good assemblies/hr}}$$

(d) The efficiency of the assembly machine is

$$E = 0.1/0.2 = 0.50 = \mathbf{50\%}$$

(e) Cost to operate the assembly machine $C_o = \$42/\text{hr} = \$0.70/\text{min}$

$$C_{pc} = (0.70/\text{min})(0.2 \text{ min/pc})/0.9511 = \mathbf{\$0.147/\text{pc}}$$



EXAMPLE 17.3 Effect of Variations in q and m on Assembly System Performance

This example shows how the performance measures in Example 17.2 are affected by variations in q and m . First, for $m = 0.5$, determine the production rate, yield, and efficiency for $q = 0$, $q = 0.01$, and $q = 0.02$. Second, for $q = 0.01$, determine the production rate, yield, and efficiency for $m = 0$, $m = 0.5$, and $m = 1.0$.

Solution: Computations similar to those in Example 17.2 provide the following results:

q	m	R_p (pc/hr)	Yield	R_{ap} (pc/hr)	E	C_{pc}
0	0.5	600	1.0	600	100%	\$0.07
0.01	0.5	300	0.951	285	50%	\$0.15
0.02	0.5	200	0.904	181	33.3%	\$0.23
0.01	0	600	0.904	543	100%	\$0.08
0.01	0.5	300	0.951	285	50%	\$0.15
0.01	1.0	200	1.0	200	33.3%	\$0.21

The results of Example 17.3 show that as fraction defect rate q increases (meaning that component quality gets worse) all five measures of performance suffer. Production rate drops, yield of good product is reduced, proportion uptime decreases, and cost per unit increases.

The effect of m (probability that a defect will jam the work head and cause the assembly machine to stop) is less obvious. At low values of m ($m = 0$) for the same component quality level ($q = 0.01$), production rate and machine efficiency are high, but yield of good product is low. Instead of interrupting the assembly machine operation and causing downtime, all defective components pass through the assembly process to become part of the final product. At $m = 1.0$, all defective components are removed before they become part of the product. Therefore, yield is 100%, but removing the defects takes time, adversely affecting production rate, efficiency, and cost per unit.

17.2.3 Single-Station Assembly Machines

The single-station assembly system is depicted in Figure 17.1(d). It consists of a single work head, with several components feeding into the station to be assembled to a base part. Let n_e = the number of distinct assembly elements that are performed on the machine. Each element has an element time, T_{ej} , where $j = 1, 2, \dots, n_e$. The ideal cycle time for the single-station assembly machine is the sum of the individual element times of the assembly operations to be performed on the machine, plus the handling time to load the base part into position and unload the completed assembly. The ideal cycle time can be expressed as

$$T_c = T_h + \sum_{j=1}^{n_e} T_{ej} \tag{17.18}$$

where T_h = handling time, min.

Many of the assembly elements involve the addition of a component to the existing subassembly. As in the analysis of multiple-station assembly, each component type has a

certain fraction defect rate, q_j , and there is a certain probability that a defective component will jam the workstation, m_j . When a jam occurs, the assembly machine stops, and it takes an average T_d to clear the jam and restart the system. The inclusion of downtime resulting from jams in the machine cycle time gives

$$T_p = T_c + \sum_{j=1}^{n_c} q_j m_j T_d \quad (17.19)$$

For elements that do not include the addition of a component, the value of $q_j = 0$ and m_j is irrelevant. This might occur, for example, when a fastening operation is performed with no part added during element j . In this type of operation, a term $p_j T_d$ would be included in the above expression to allow for a downtime during that element, where $p_j =$ the probability of a station failure during element j . For the special case of equal q and equal m values for all components added, Equation (17.19) becomes

$$T_p = T_c + nmqT_d \quad (17.20)$$

Determining yield (proportion of assemblies that contain no defective components) for the single-station assembly machine makes use of the same equations as for the multiple station systems, Equations (17.5) or (17.7). Uptime efficiency is computed as $E = T_c/T_p$ using the values of T_c and T_p from Equations (17.18) and (17.19) or (17.20).

EXAMPLE 17.4 Single-Station Automatic Assembly System

A single-station assembly machine performs five work elements to assemble four components to a base part. The elements are listed in the table below, together with the fraction defect rate (q) and probability of a station jam (m) for each of the components added (NA means not applicable).

Element	Operation	Time (sec)	q	m	p
1	Add gear	4	0.02	1.0	
2	Add spacer	3	0.01	0.6	
3	Add gear	4	0.015	0.8	
4	Add gear and mesh	7	0.02	1.0	
5	Fasten	5	0	NA	0.012

Time to load the base part is 3 sec and time to unload the completed assembly is 4 sec, giving a total load/unload time of $T_h = 7$ sec. When a jam occurs, it takes an average of 1.5 min to clear the jam and restart the machine. Determine (a) production rate of all product, (b) yield of good product, (c) production rate of good product, and (d) uptime efficiency of the assembly machine.

Solution: (a) The ideal cycle time of the assembly machine is

$$T_c = 7 + (4 + 3 + 4 + 7 + 5) = 30 \text{ sec} = 0.5 \text{ min}$$

Frequency of downtime occurrences is

$$F = 0.02(1.0) + 0.01(0.6) + 0.015(0.8) + 0.02(1.0) + 0.012 = 0.07$$

Adding the average downtime due to jams,

$$T_p = 0.5 + 0.07(1.5) = 0.5 + 0.105 = 0.605 \text{ min}$$

Production rate is therefore $R_p = 60/0.605 = \mathbf{99.2 \text{ total assemblies/hr}}$

(b) Yield of good product is the following, from Equation (175):

$$\begin{aligned} P_{ap} &= \{1 - 0.02 + 1.0(0.02)\} \{1 - 0.01 + 0.6(0.01)\} \\ &\quad \{1 - 0.015 + 0.8(0.015)\} \{1 - 0.02 + 1.0(0.02)\} \\ &= (1.0)(0.996)(0.997)(1.0) = \mathbf{0.993} \end{aligned}$$

(c) Production rate of only good assemblies is

$$R_{ap} = 99.2(0.993) = \mathbf{98.5 \text{ good assemblies/hr}}$$

(d) Uptime efficiency is

$$E = 0.5/0.605 = 0.8264 = \mathbf{82.64\%}$$

As the analysis suggests, increasing the number of elements in the assembly machine cycle results in a longer cycle time, decreasing the production rate of the machine. Accordingly, applications of a single-station assembly machine are limited to lower volume, lower production rate situations. For higher production rates, one of the multistation assembly systems is generally preferred.

17.2.4 Partial Automation

Many assembly lines in industry contain a combination of automated and manual workstations. These cases of partially automated production lines occur for two main reasons:

1. Automation is introduced gradually on an existing manual line. Suppose demand for the product made on a manually operated line increases, so the company decides to increase production and reduce labor costs by automating some or all of the stations. The simpler operations are automated first, and the transition toward a fully automated line is accomplished over a long period of time. Until then, the line operates as a partially automated system. (See Automation Migration Strategy, Section 1.4.3.)
2. Certain manual operations are too difficult or too costly to automate. Therefore, when the sequence of workstations is planned for the line, certain stations are designed to be automated while the others are designed as manual stations.

Examples of operations that might be too difficult to automate are assembly procedures or processing steps involving alignment, adjustment, or fine-tuning of the work unit. These operations often require special human skills and/or senses to carry out. Many inspection procedures also fall into this category. Defects in a product or part that can be easily perceived by a human inspector are sometimes difficult for an automated inspection device to detect. Another problem is that the automated inspection device can only check for the defects for which it was designed, whereas a human inspector is capable of sensing a variety of unanticipated imperfections and problems.

To analyze the performance of a partially automated production line, the following assumptions are made: (1) workstations perform either processing or assembly operations, (2) processing and assembly times at automated stations are constant, though not necessarily equal at all stations, (3) the system uses synchronous transfer of parts, (4) the system has no internal buffer storage, and (5) station breakdowns occur only at automated stations. Breakdowns do not occur at manual stations because the human workers are flexible enough, it is assumed, to adapt to the kinds of disruptions and malfunctions that would interrupt the operation of an automated workstation. For example, if a human operator were to retrieve a defective part from the parts bin at the station, the worker would immediately discard the part and select another without much lost time. Of course, this assumption of human adaptability is not always correct, but the analysis is based on it.

The ideal cycle time T_c is determined by the slowest station on the line, which is generally one of the manual stations. If the cycle time is determined by a manual station, then T_c will exhibit variability, simply because there is random variation in any repetitive human activity. However, it is assumed that the average T_c remains constant over time. Given the assumption that breakdowns occur only at automated stations, let n_a = the number of automated stations and T_d = average downtime per occurrence. For the automated stations that perform processing operations, let p_i = the probability (frequency) of breakdowns per cycle, and for automated stations that perform assembly operations, let q_i and m_i equal, respectively, the defect rate and probability that the defect will cause station i to stop. The average actual production time can now be defined as:

$$T_p = T_c + \sum_{i \in n_a} p_i T_d \quad (17.21)$$

where the summation applies to the n_a automated stations only. For those automated stations that perform assembly operations in which a part is added,

$$p_i = m_i q_i$$

If all p_i , m_i , and q_i are equal, respectively, to p , m , and q , then the preceding equations reduce to

$$T_p = T_c + n_a p T_d \quad (17.22)$$

and $p = mq$ for those stations that perform assembly consisting of the addition of a part.

Given that n_a is the number of automated stations, then n_w = the number of stations operated by workers, and $n_a + n_w = n$, where n = the total station count. Let C_{asi} = cost to operate automatic workstation i , \$/min; C_{wi} = cost to operate manual workstation i , \$/min; and C_{at} = cost to operate the automatic transfer mechanism. Then the total cost to operate the line is given by

$$C_o = C_{at} + \sum_{i \in n_a} C_{asi} + \sum_{i \in n_w} C_{wi} \quad (17.23)$$

where C_o = cost of operating the partially automated production system, \$/min. For all $C_{asi} = C_{as}$, and all $C_{wi} = C_w$, then

$$C_o = C_{at} + n_a C_{as} + n_w C_w \quad (17.24)$$

Now the total cost per unit produced on the line can be calculated as

$$C_{pc} = \frac{C_m + C_o T_p + C_t}{P_{ap}} \quad (17.25)$$

where C_{pc} = cost per good assembly, \$/pc; C_m = cost of materials and components being processed and assembled on the line, \$/pc; C_o = cost of operating the partially automated production system by either of Equations (17.23) or (17.24), \$/min; T_p = average actual production time, min/pc; C_t = any cost of disposable tooling, \$/pc; and P_{ap} = proportion of good assemblies by Equations (17.5) or (17.7).

EXAMPLE 17.5 Partial Automation

The company is considering replacing one of the current manual workstations with an automatic work head on a 10-station production line. The current line has six automatic stations and four manual stations. Current cycle time is 30 sec. The limiting process time is at the manual station that is proposed for replacement. Implementing the proposal would allow the cycle time to be reduced to 24 sec. The new station would cost \$0.20/min. Other cost data: $C_w = \$0.15/\text{min}$, $C_{as} = \$0.10/\text{min}$, and $C_{at} = \$0.12/\text{min}$. Breakdowns occur at each automated station with a probability $p = 0.01$. The new automated station is expected to have the same frequency of breakdowns. Average downtime per occurrence $T_d = 3.0$ min, which will be unaffected by the new station. Material costs and tooling costs will be neglected in the analysis. It is desired to compare the current line with the proposed change on the basis of production rate and cost per piece. Assume a yield of 100% good product.

Solution: For the current line, $T_c = 30$ sec = 0.50 min

$$T_p = 0.50 + 6(0.01)(3.0) = 0.68 \text{ min and } R_p = 1/0.68 = 1.47 \text{ pc/min} = \mathbf{88.2 \text{ pc/hr}}$$

$$C_o = 0.12 + 4(0.15) + 6(0.10) = \$1.32/\text{min and } C_{pc} = 1.32(0.68) = \mathbf{\$0.898/\text{pc}}$$

For the proposed line, $T_c = 24$ sec = 0.4 min

$$T_p = 0.40 + 7(0.01)(3.0) = 0.61 \text{ min and } R_p = 1/0.61 = 1.64 \text{ pc/min} = \mathbf{98.4 \text{ pc/hr}}$$

$$C_o = 0.12 + 3(0.15) + 6(0.10) + 1(0.20) = \$1.37/\text{min and } C_{pc} = 1.37(0.61) = \mathbf{\$0.836/\text{pc}}$$

Even though the line would be more expensive to operate per unit time, the proposed change would increase production rate and reduce piece cost.

17.2.5 What the Equations Tell Us

The equations derived in this section reveal several practical guidelines for the design and operation of automated assembly systems and the products made on such systems.

- The parts delivery system at each station must be designed to deliver components to the assembly operation at a net rate (parts feeder multiplied by pass-through proportion of the selector/orientor) that is greater than or equal to the cycle rate of the assembly work head. Otherwise, assembly system performance is limited by the parts delivery system rather than the assembly process technology.

- The quality of components added in an automated assembly system has a significant effect on system performance. Poor quality, as represented by the fraction defect rate, can result in
 1. Station jams that stop the entire assembly system, which has adverse effects on production rate, uptime proportion, and cost per unit produced; or
 2. Assembly of defective components in the product, which has adverse effects on yield of good assemblies and product cost.
- As the number of workstations increases in an automated assembly system, uptime efficiency and production rate tend to decrease due to parts quality and station reliability effects. This reinforces the need to use only the highest quality components on automated assembly systems.
- The cycle time of a multistation assembly system is determined by the slowest station (longest assembly task) in the system. The number of assembly tasks to be performed is important only insofar as it affects the reliability of the assembly system. By comparison, the cycle time of a single-station assembly system is determined by the sum of the assembly element times rather than by the longest assembly element.
- Compared with a multistation assembly machine, a single-station assembly system with the same number of assembly tasks has a lower production rate but a higher uptime efficiency.
- Multistation assembly systems are appropriate for high production applications and long production runs. In comparison, single-station assembly systems have a longer cycle time and are more appropriate for mid-range quantities of product.
- An automated station should be substituted for a manual station only if it reduces cycle time sufficiently to offset any negative effects of lower reliability.

REFERENCES

- [1] ANDREASEN, M. M., S. KAHLER, and T. LUND, *Design for Assembly*, IFS (Publications) Ltd., UK, and Springer-Verlag, Berlin, FRG, 1983.
- [2] BOOTHROYD, G., and A. H. REDFORD, *Mechanized Assembly*, McGraw-Hill Publishing Company, Ltd., London, 1968.
- [3] BOOTHROYD, G., C. POLI, and L. E. MURCH, *Automatic Assembly*, Marcel Dekker, Inc., New York, 1982.
- [4] BOOTHROYD, G., P. DEWHURST, and W. KNIGHT, *Product Design for Manufacture and Assembly*, Marcel Dekker, Inc., New York, 1994.
- [5] DELCHAMBRE, A., *Computer-Aided Assembly Planning*, Chapman & Hall, London, UK, 1992.
- [6] GAY, D. S., "Ways to Place and Transport Parts," *Automation*, June 1973.
- [7] GROOVER, M. P., M. WEISS, R. N. NAGEL, and N. G. ODREY, *Industrial Robotics: Technology, Programming, and Applications*, McGraw-Hill Book Company, New York, 1986, Chapter 15.
- [8] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [9] MURCH, L. E., and G. BOOTHROYD, "On-off Control of Parts Feeding," *Automation*, August 1970, pp. 32–34.
- [10] NOF, S. Y., W. E. WILHELM, and H.-J. WARNECKE, *Industrial Assembly*, Chapman & Hall, London, UK, 1997.

- [11] RILEY, F. J., *Assembly Automation*, Industrial Press Inc., New York, 1983.
- [12] SCHWARTZ, W. H., "Robots Called to Assembly," *Assembly Engineering*, August 1985, pp. 20–23.
- [13] WARNECKE, H. J., M. SCHWEIZER, K. TAMAKI, and S. NOF, "Assembly," *Handbook of Industrial Engineering*, Institute of Industrial Engineers, John Wiley & Sons, Inc., New York, 1992, pp. 505–562.
- [14] www.atsautomation.com
- [15] www.autodev.com
- [16] www.magnemotion.com
- [17] www.setpointusa.com

REVIEW QUESTIONS

- 17.1 Name three of the four conditions under which automated assembly technology should be considered.
- 17.2 What are the four automated assembly system configurations listed in the text?
- 17.3 Name the typical hardware components of a workstation parts delivery system.
- 17.4 Name six typical products that are made by automated assembly.
- 17.5 Considering the assembly machine as a game of chance, what are the three possible events that might occur when the feed mechanism attempts to feed the next component to the assembly work head at a given workstation in a multistation system?
- 17.6 Name some of the important performance measures for an automated assembly system.
- 17.7 Why is the production rate inherently lower on a single-station assembly system than on a multistation assembly system?
- 17.8 What are two reasons for the existence of partially automated production lines?
- 17.9 What are the effects of poor quality parts, as represented by the fraction defect rate, on the performance of an automated assembly system?

PROBLEMS

Answers to problems labeled (A) are listed in the appendix.

Parts Feeding

- 17.1 (A) The feeder-selector device at one of the workstations of an assembly machine has a feed rate of 56 components/min and provides a throughput of one part in five. The ideal cycle time of the assembly machine is 6 sec. The low-level sensor on the feed track is set at 10 components, and the high-level sensor is set at 25 components. (a) How long will it take for the supply of components to be depleted from the high-level sensor to the low-level sensor once the feeder-selector device is turned off? (b) How long will it take for the components to be resupplied from the low-level sensor to the high-level sensor, on average, after the feeder-selector device is turned on? (c) What are the time proportions that the feeder-selector device is turned on and turned off?
- 17.2 Solve Problem 17.1 but use a feed rate of 50 parts/min. How does the reduced feed rate of the feeder-selector affect the operation of the assembly machine?

- 17.3** The ideal cycle time of an assembly machine is 5 sec. The parts feeder at one of the workstations has a feed rate of 75 components/min and the probability that the components will pass through the selector is 18%. The active length of the feed track (where the high-level sensor is located) is 350 mm. The low-level sensor on the feed track is located 100 mm from the station work head. The components have a length of 12.5 mm in the feed track direction, and there is no overlapping of parts. (a) How long will it take for the supply of parts to be depleted from the high-level sensor to the low-level sensor once the feeder-selector device is turned off? (b) How long will it take for the parts to be resupplied from the low-level sensor to the high-level sensor, on average, after the feeder-selector device is turned on? (c) What are the time proportions that the feeder-selector device is turned on and turned off?
- 17.4** An assembly machine has eight stations and must produce at an average rate of 500 completed assemblies/hr. Average downtime per breakdown is 2.5 min. When a breakdown occurs, all subsystems (including the feeder) stop. The frequency of breakdowns of the assembly machine is once every 55 parts. Average downtime per breakdown is 2.0 min. One of the stations is an automatic assembly operation that uses a feeder-selector. Components fed into the selector have a 20% probability of passing through. Parts rejected by the selector are fed back into the hopper. What minimum rate must the feeder deliver components to the selector during system uptime in order to keep up with the assembly machine?

Multistation Assembly Systems

- 17.5 (A)** A 10-station assembly machine has an ideal cycle time of 6 sec. The fraction defect rate at each station is 0.005 and a defect always jams the affected station. When a breakdown occurs, it takes 1.2 min, on average, for the system to be put back into operation. Determine (a) the hourly production rate for the assembly machine, (b) yield of good product (final assemblies containing no defective components), and (c) proportion uptime of the system.
- 17.6** Solve Problem 17.5 but assume that defects never jam the workstations. Other data are the same.
- 17.7** Solve Problem 17.5 but assume that $m = 0.5$ for all stations. Other data are the same.
- 17.8** A six-station dial-indexing machine assembles components to a base part. The operations, element times, q and m values for components added are given in the table below (NA means q and m are not applicable to the operation). The indexing time is 2 sec. When a jam occurs, it requires 1.5 min to release the jam and put the machine back in operation. Determine (a) hourly production rate for the assembly machine, (b) yield of good product (final assemblies containing no defective components), and (c) proportion uptime of the system.

Station	Operation	ElementTime	q	m
1	Add part A	4 sec	0.015	0.6
2	Fasten part A	3 sec	NA	NA
3	Assemble part B	5 sec	0.01	0.8
4	Add part C	4 sec	0.02	1.0
5	Fasten part C	3 sec	NA	NA
6	Assemble part D	6 sec	0.01	0.5

- 17.9** A six-station automatic assembly line runs 4,000 hr/yr and has an ideal cycle time of 10 sec. Downtime occurs for two reasons. First, mechanical and electrical failures cause line stops

that occur with a frequency of once per 120 cycles. Average downtime for these causes is 3.0 min. Second, defective components also result in downtime. The fraction defect rate of each of the six components added to the base part at the six stations is 1.0%, and the probability that a defective component will cause a station jam is 0.5 for all stations. Downtime per occurrence for defective parts is 2.0 min. Determine (a) total number of assemblies produced in one year, (b) number of assemblies with at least one defective component, and (c) number of assemblies with all six defective components.

- 17.10 (A)** An eight-station automatic assembly machine has an ideal cycle time of 6 sec. Downtime is caused by defective parts jamming at the individual assembly stations. The average downtime per occurrence is 2.5 min. Fraction defect rate is 0.2% and the probability that a defective part will jam at a given station is 0.6 for all stations. The cost to operate the assembly machine is \$95.00/hr and the cost of components being assembled is \$0.73 per unit assembly. Ignore other costs. Determine (a) yield of good assemblies, (b) average hourly production rate of good assemblies, (c) proportion of assemblies with at least one defective component, and (d) unit cost of the assembled product.
- 17.11** An automated assembly machine has four stations. The first station presents the base part, and the other three stations add components to the base. The ideal cycle time for the machine is 3 sec, and the average downtime when a jam results from a defective component is 1.5 min. The fraction defective rates (q) and probabilities that a defective component will jam the station (m) are given in the table below. Quantities of 100,000 for each of the bases, brackets, pins, and retainers are used to stock the assembly line for operation. Determine (a) proportion of good product to total product coming off the line, (b) hourly production rate of good product coming off the line, (c) total number of final assemblies produced, given the starting component quantities. Of the total, how many are good product, and how many are products that contain at least one defective component? (d) Of the number of defective assemblies determined in part (c), how many will have defective base parts? How many will have defective brackets? How many will have defective pins? How many will have defective retainers?

Station	Part Identification	q	m
1	Base	0.01	1.0
2	Bracket	0.02	1.0
3	Pin	0.03	1.0
4	Retainer	0.04	0.5

- 17.12** A six-station automatic assembly machine has an ideal cycle time of 6 sec. At stations 2 through 6, parts feeders deliver components to be assembled to a base part that is added at the first station. Each of stations 2 through 6 is identical and the five components are identical. That is, the completed product consists of the base part plus five identical components. The base parts have zero defects, but the other components are defective at a rate q . When an attempt is made to assemble a defective component to the base part, the machine stops ($m = 1.0$). It takes an average of 2.0 min to make repairs and start the machine up after each stoppage. Since all components are identical, they are purchased from a supplier who can control the fraction defect rate very closely. However, the supplier charges a premium for better quality. The cost per component is determined by the following equation: cost per component = $0.1 + 0.0012/q$, where q = fraction defect rate. Cost of the base part is 20 cents. Accordingly, the total cost of the base part and the five components is: product material cost = $0.70 + 0.006/q$. The cost to operate the automatic assembly machine is \$150.00/hr. The problem facing the production manager is this: As the component quality decreases (q increases), downtime increases which drives production costs up. As the quality improves (q decreases), material cost increases because of the price formula

used by the supplier. To minimize total cost, the optimum value of q must be determined. Determine the value of q that minimizes the total cost per assembly. Also, determine the associated cost per assembly and hourly production rate. (Ignore other costs.)

- 17.13** A six-station dial-indexing machine is designed to perform four assembly operations at stations 2 through 5 after a base part has been manually loaded at station 1. Station 6 is the unload station. Each assembly operation involves the attachment of a component to the existing base. At each of the four assembly stations, a hopper-feeder is used to deliver components to a selector device that separates components that are improperly oriented and drops them back into the hopper. The system was designed with the operating parameters for stations 2 through 5 as given in the table below. It takes 2 sec to index the dial from one station to the next. When a component jams, it takes an average of 2 min to release the jam and restart the system. Line stops due to mechanical and electrical failures of the assembly machine are not significant and can be neglected. The foreman says the system was designed to produce at a certain hourly rate, which takes into account the jams resulting from defective components. However, the actual delivery of finished assemblies is far below that designed production rate. Analyze the problem and determine the following: (a) The designed average hourly production rate that the foreman alluded to. (b) What is the proportion of assemblies coming off the system that contain one or more defective components? (c) What seems to be the problem that limits the assembly system from achieving the expected production rate? (d) What is the hourly production rate that the system is actually achieving? State any assumptions that you make in determining your answer.

Station	Assembly Time	Feed Rate f	Selector θ	q	m
2	4 sec	32/min	0.25	0.01	1.0
3	7 sec	20/min	0.50	0.005	0.6
4	5 sec	20/min	0.20	0.02	1.0
5	3 sec	15/min	1.0	0.01	0.7

- 17.14** For Example 17.4, which deals with a single-station assembly system, suppose that the sequence of assembly elements were to be accomplished on a seven-station assembly system with synchronous parts transfer. Each element is performed at a separate station (stations 2 through 6) and the assembly time at each respective station is the same as the element time given in the example. Assume that the handling time is divided evenly (3.5 sec each) between a load station (station 1) and an unload station (station 7). The transfer time is 2 sec, and the average downtime per downtime occurrence is 2.0 min. Determine (a) hourly production rate of all completed units, (b) yield, (c) production rate of good quality completed units, and (d) uptime efficiency.

Single-Station Assembly Systems

- 17.15 (A)** A single-station assembly machine is to be considered as an alternative to the dial-indexing machine in Problem 17.8. Use the data given in that problem to determine (a) hourly production rate, (b) yield of good product (final assemblies containing no defective components), and (c) proportion uptime of the system. Handling time to load the base part and unload the finished assembly is 7 sec and the downtime averages 1.5 min every time a component jams. Why is the proportion uptime so much higher than in the case of the dial-indexing machine in Problem 17.8?
- 17.16** A single-station robotic assembly system performs a series of five assembly elements, each of which adds a different component to a base part. Each element takes 3.5 sec. In addition,

the handling time needed to move the base part into and out of position is 4.5 sec. The fraction defect rate is 0.003 for all components, and the probability of a jam by a defective component is 0.7. Average downtime per occurrence is 2.5 min. Determine (a) hourly production rate, (b) yield of good product in the output, and (c) uptime efficiency. (d) What proportion of the output contains a defective component from the third of the five elements performed in the work cycle?

- 17.17** A single-station assembly cell uses an industrial robot to perform a series of assembly operations. The base part and parts 2 and 3 are delivered by vibratory bowl feeders that use selectors to insure that only properly oriented parts are delivered to the robot for assembly. The robot cell performs the elements in the table below (also given are feeder rates, selector proportion θ , element times, fraction defect rate q , and probability of jam m , and, for the last element, the frequency of downtime incidents p). In addition to the times given in the table, the time required to unload the completed subassembly is 4 sec. When a line stop occurs, it takes an average of 1.8 min to make repairs and restart the cell. Determine (a) yield of good product, (b) average hourly production rate of good product, and (c) uptime efficiency for the cell. State any assumptions you must make about the operation of the cell in order to solve the problem.

Element	Feed Rate f	Selector θ	Element	Time T_e	q	m	p
1	15 pc/min	0.30	Load base part	4 sec	0.01	0.6	
2	12 pc/min	0.25	Add part 2	3 sec	0.02	0.3	
3	25 pc/min	0.10	Add part 3	4 sec	0.03	0.8	
4			Fasten	3 sec			0.02

Partial Automation

- 17.18 (A)** A partially automated production line has three mechanized and three manual workstations, a total of six stations. The ideal cycle time is 57 sec, which includes a transfer time of 3 sec. Data on the six stations are listed in the table below. Cost of the transfer mechanism is \$0.10/min, cost to run each automated station is \$0.12/min, and labor cost to operate each manual station is \$0.17/min. It has been proposed to substitute an automated station in place of station 5. The cost of this new station is estimated at \$0.25/min and its breakdown rate = 0.02 per cycle, but its process time would be only 30 sec, thus reducing the overall cycle time of the line from 57 sec to 36 sec. Average downtime per breakdown of the current line, as well as for the proposed configuration, is 3.0 min. Determine the following for the current line and the proposed line: (a) hourly production rate, (b) proportion uptime, and (c) cost per unit. Assume that when an automated station stops, the whole line stops, including the manual stations. Also, in computing costs, neglect material and tooling costs.

Station	Type	Process Time	p_i
1	Manual	36 sec	0
2	Automatic	15 sec	0.01
3	Automatic	20 sec	0.02
4	Automatic	25 sec	0.01
5	Manual	54 sec	0
6	Manual	33 sec	0

- 17.19** A manual assembly line has six stations. The service time at each manual station is 60 sec. Parts are transferred by hand from one station to the next, and the lack of discipline in this method adds 12 sec to the cycle time. Hence, the current cycle time is 72 sec. The following two proposals have been made: (1) Install a mechanized transfer system to pace the line; and (2) automate one or more of the manual stations using robots that would perform the same tasks as humans only faster. The second proposal requires the mechanized transfer system of the first proposal and would result in a partially- or fully automated assembly line. The transfer system would have a transfer time of 6 sec, thus reducing the cycle time on the manual line to 66 sec. Regarding the second proposal, all six stations are candidates for automation. Each automated station would have an assembly time of 30 sec. Thus if all six stations were automated the cycle time for the line would be 36 sec. There are differences in the quality of parts added at the stations; these data are given in the table below for each station (q = fraction defect rate, m = probability that a defect will jam the station). Average downtime per station jam at the automated stations is 3.0 min. Assume that the manual stations do not experience line stops due to defective components. Cost data: C_{at} = \$0.10/min; C_w = \$0.20/min; and C_{as} = \$0.15/min. Determine if either or both of the proposals should be accepted. If the second proposal is accepted, how many stations should be automated and which ones? Use cost per piece as the criterion for your decision. Assume for all cases considered that when an automated station stops, the whole line stops, including the manual stations.

Station	q_i	m_i	Station	q_i	m_i
1	0.005	1.0	4	0.020	1.0
2	0.010	1.0	5	0.025	1.0
3	0.015	1.0	6	0.030	1.0

- 17.20** Solve Problem 17.19, except that the probability that a defective part will jam the automated station is $m = 0.5$ for all stations.

Group Technology and Cellular Manufacturing

CHAPTER CONTENTS

- 18.1 Part Families and Machine Groups
 - 18.1.1 What is a Part Family?
 - 18.1.2 Intuitive Grouping
 - 18.1.3 Parts Classification and Coding
 - 18.1.4 Production Flow Analysis
 - 18.2 Cellular Manufacturing
 - 18.2.1 Composite Part Concept
 - 18.2.2 Machine Cell Design
 - 18.3 Applications of Group Technology
 - 18.4 Analysis of Cellular Manufacturing
 - 18.4.1 Rank-order Clustering
 - 18.4.2 Arranging Machines in a GT Cell
 - 18.4.3 Performance Metrics in Cell Operations
- Appendix 18A: Opitz Parts Classification and Coding System

Batch manufacturing is estimated to be the most common form of production in the United States, constituting more than 50% of total manufacturing activity. It is important to make mid-volume manufacturing, which is traditionally accomplished in batches, as efficient and productive as possible. In addition, there has been a trend to integrate the design and manufacturing functions in a firm. An approach directed at both of these objectives is group technology (GT).

Group technology is a manufacturing philosophy in which similar parts are identified and grouped together to take advantage of their similarities in design and production.

Similar parts are arranged into part families, where each part family possesses similar design and/or manufacturing characteristics. For example, a plant producing 10,000 different part numbers may be able to group the vast majority of these parts into 30 or 40 distinct families. It is reasonable to believe that the processing of each member of a given family is similar, and this should result in manufacturing efficiencies. The efficiencies are generally achieved by arranging the production equipment into cells (machine groups) to facilitate work flow. Organizing the production equipment into machine cells, where each cell specializes in the production of a part family, is called *cellular manufacturing*. The origins of group technology and cellular manufacturing can be traced to around 1925 (Historical Note 18.1).

Group technology and cellular manufacturing are applicable to a wide variety of production situations. The following conditions are when GT is most appropriate:

- The plant currently uses traditional batch production and a process-type layout, which results in much material handling, high in-process inventory, and long manufacturing lead times.
- It is possible to group the parts into part families. This is a necessary condition. Each GT machine cell is designed to produce a given part family, or a limited collection of part families, so it must be possible to identify part families made in the plant. Fortunately, in the typical mid-volume production plant, most of the parts can be grouped into part families.

Historical Note 18.1 Group Technology (GT)

In 1925, R. Flanders of the United States presented a paper before the American Society of Mechanical Engineers that described a way of organizing manufacturing at Jones and Lamson Machine Company that would today be called group technology. In 1937, A. Sokolovskiy of the former Soviet Union described the essential features of group technology by proposing that parts of similar configuration be produced by a standard process sequence, thus permitting flow-line techniques to be used for work normally accomplished by batch production. In 1949, A. Korling of Sweden presented a paper in Paris on “group production,” whose principles are an adaptation of production line techniques to batch manufacturing. In the paper, he described how to decentralize work into independent groups, each containing the machines and tooling to produce “a special category of parts.”

In 1959, researcher S. Mitrofanov of the Soviet Union published a book titled *Scientific Principles of Group Technology*. The book was widely read and is considered responsible for over 800 plants in the Soviet Union using group technology by 1965. Another researcher, H. Opitz in Germany, studied parts manufactured by the German machine tool industry and developed the well-known parts classification and coding system for machined parts that bears his name (Appendix 18A).

In the United States, the first application of group technology was at the Langston Division of Harris-Intertype in Camden, New Jersey, in the late 1960s. Traditionally a machine shop arranged as a process-type layout, the company reorganized into “family of parts” lines, each of which specialized in producing a given part configuration. Part families were identified by taking photos of about 15% of the parts made in the plant and grouping them into families. When the changes were implemented, productivity was improved by 50% and lead times were reduced from weeks to days.

There are two major tasks that a company must undertake when it implements group technology. These tasks represent significant obstacles to the application of GT.

1. *Identifying the part families.* If the plant makes 10,000 different parts, reviewing all of the part drawings and grouping the parts into families is a substantial and time-consuming task.
2. *Rearranging production machines into machine cells.* It is time-consuming and costly to plan and accomplish this rearrangement, and the machines are not producing during the changeover.

Group technology and cellular manufacturing offer substantial benefits to companies that have the perseverance to implement them:

- GT promotes standardization of tooling, fixturing, and setups.
- Material handling is reduced because the distances within a machine cell are much shorter than within the entire factory.
- Process planning and production scheduling are simplified.
- Setup times are reduced, resulting in lower manufacturing lead times.
- Work-in-process is reduced.
- Worker satisfaction usually improves when workers collaborate in a GT cell.
- Higher quality work is accomplished.

18.1 PART FAMILIES AND MACHINE GROUPS

The logical starting point in this chapter's coverage of group technology, cellular manufacturing, and related topics is the underlying concept of part families. This section describes part families and the grouping of machines into cells that specialize in producing those families.

18.1.1 What is a Part Family?

A part family is a collection of parts that are similar either in geometric shape and size or in the processing steps required in their manufacture. The parts within a family are different, but their similarities are close enough to merit their inclusion as members of the part family. Figures 18.1 and 18.2 show two different part families. The two

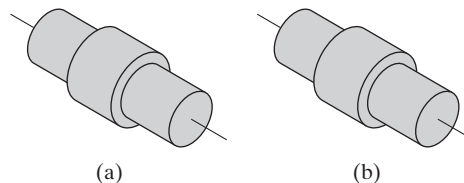


Figure 18.1 Two parts of identical shape and size but different manufacturing requirements: (a) 1,000,000 pc/yr, tolerance = ± 0.010 in., material = 1015 CR steel, nickel plate; and (b) 100 pc/yr, tolerance = ± 0.001 in., material = 18–8 stainless steel.

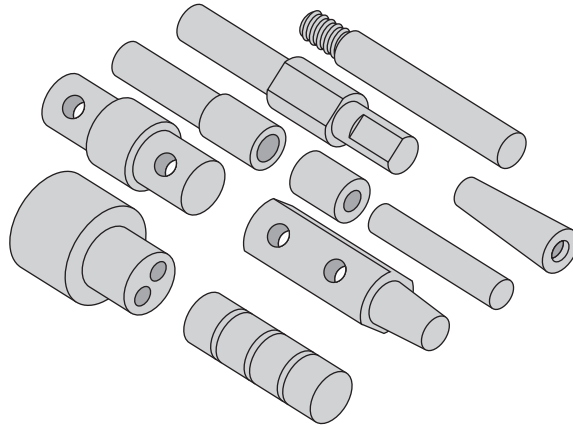


Figure 18.2 A family of parts with similar manufacturing process requirements but different design attributes. All parts are machined from cylindrical stock by turning; some parts require drilling and/or milling.

parts in Figure 18.1 are very similar in terms of geometric design, but quite different in terms of manufacturing because of differences in tolerances, production quantities, and materials. The parts shown in Figure 18.2 constitute a part family in manufacturing, but their different geometries make them appear quite different from a design viewpoint.

One of the important manufacturing advantages of grouping work parts into families can be explained with reference to Figures 18.3 and 18.4. Figure 18.3 shows a process-type plant layout for batch production in a machine shop. The various machine tools are arranged by function. There is a lathe department, milling machine department, drill press department, and so on. To machine a given part, the workpiece must be transported between departments, perhaps visiting the same department several times. This results in much material handling, large in-process inventories, many machine setups, long manufacturing lead times, and high cost. Figure 18.4 shows a production shop of equivalent capacity that has its machines arranged into cells. Each cell is organized to specialize in the production of a particular part family. Advantages are gained in the form of reduced workpiece handling, lower setup times, fewer setups (in some cases, no setup changeovers are necessary), less in-process inventory, and shorter lead times.

The biggest single obstacle in changing over to group technology from a conventional job shop is the problem of grouping the parts into families. There are three general methods for solving this problem. All three are time consuming and involve the analysis of much data by properly trained personnel. The three methods are (1) intuitive grouping, (2) parts classification and coding, and (3) production flow analysis.

18.1.2 Intuitive Grouping

This method, also known as the *visual inspection* method, is the least sophisticated and least expensive method. It is claimed to be the most common method that companies use to identify part families [35]. Intuitive grouping involves the classification of parts

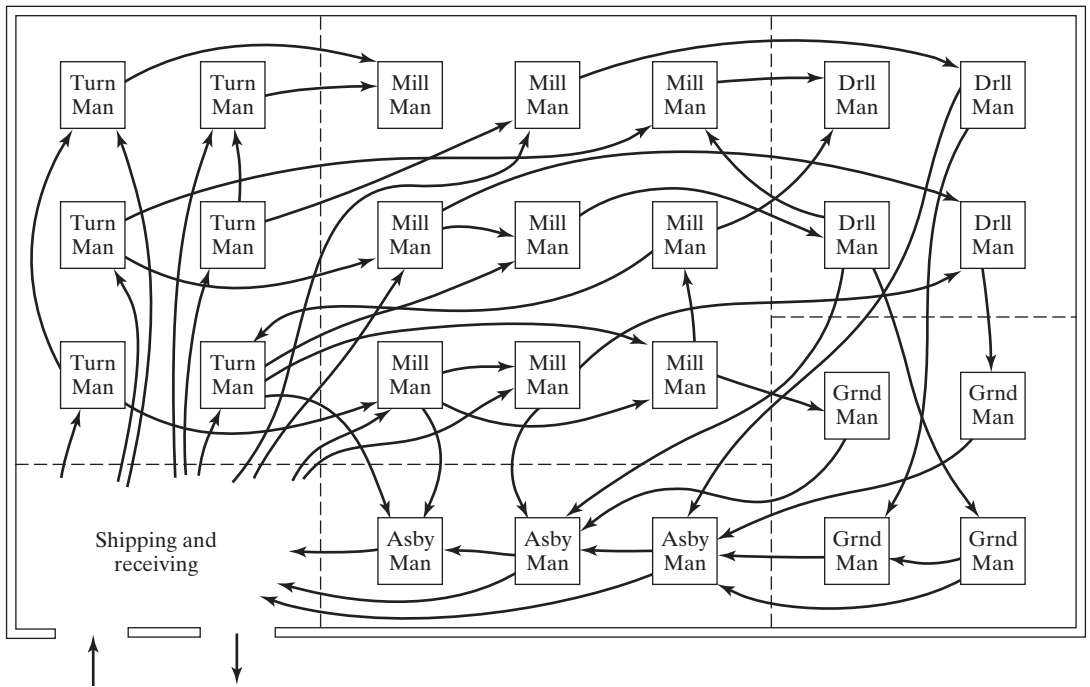


Figure 18.3 Process-type plant layout. (Key: Turn = turning, Mill = milling, Drill = drilling, Grnd = grinding, Asby = assembly, Man = manual operation; arrows indicate work flow through plant, and dashed lines indicate separation of machines into departments.)

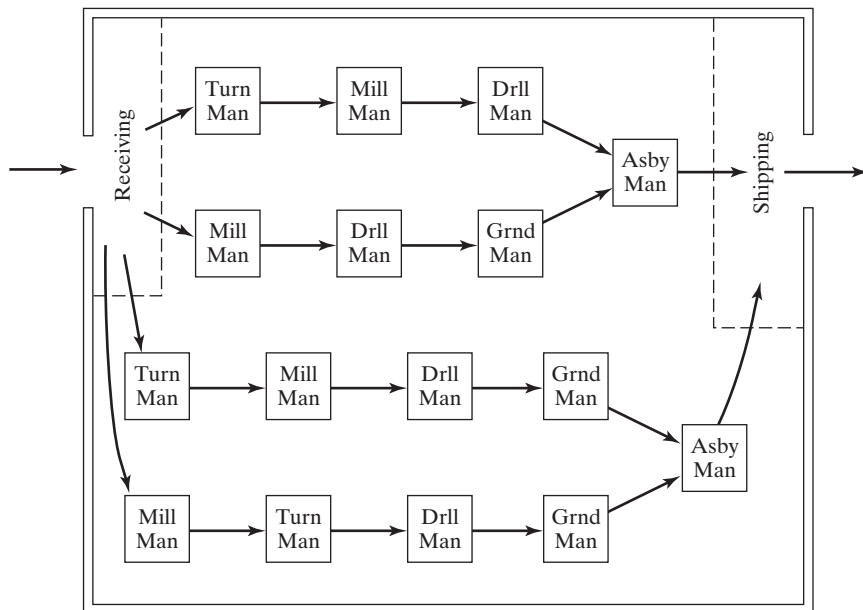


Figure 18.4 Group-technology layout. (Key: Turn = turning, Mill = milling, Drill = drilling, Grnd = grinding, Asby = assembly, Man = manual operation; arrows indicate work flow in machine cells.)

TABLE 18.1 Design and Manufacturing Attributes Typically Included in a Group Technology Classification and Coding System

Part Design Attributes	Part Manufacturing Attributes
Basic external shape	Major processes
Basic internal shape	Minor operations
Rotational or rectangular shape	Operation sequence
Length-to-diameter ratio (rotational parts)	Major dimension
Aspect ratio (rectangular parts)	Surface finish
Material types	Machine tool
Part function	Production cycle time
Major dimensions	Batch size
Minor dimensions	Annual production
Tolerances	Fixtures required
Surface finish	Cutting tools used in manufacture

into families by experienced technical staff in the plant who examine either the physical parts or their photographs and arrange them into groups having similar features. Two categories of part similarities can be distinguished: (1) design attributes, which are concerned with part characteristics such as geometry, size, and material, and (2) manufacturing attributes, which consider the processing steps required to make a part. Table 18.1 presents a list of common design and manufacturing attributes typically included in a part classification scheme. A certain amount of overlap exists between design and manufacturing attributes, because a part's geometry is largely determined by the manufacturing processes performed on it. Accordingly, by classifying parts into families, potential machine groups are also identified.

Although intuitive grouping is generally considered the least accurate of the three, it was the method used in one of the first major success stories of group technology in the United States, the Langston Division of Harris-Intertype in New Jersey (Historical Note 18.1).

18.1.3 Parts Classification and Coding

This method is the most time consuming of the three. In parts classification and coding, similarities among parts are identified and these similarities are related in a coding system that usually includes both a part's design and manufacturing attributes. Reasons for using a coding scheme include:

- *Design retrieval.* A designer faced with the task of developing a new part can use a design retrieval system to determine if a similar part already exists. Simply changing an existing part would take much less time than designing a whole new part from scratch.
- *Automated process planning.* The part code for a new part can be used to search for process plans for existing parts with identical or similar codes.
- *Machine cell design.* The part codes can be used to design machine cells capable of producing all members of a particular part family, using the composite part concept (Section 18.2.1).

To accomplish parts classification and coding, an analyst must examine the design and/or manufacturing features of each part. This is sometimes done by looking in tables to match the subject part against the features described and diagrammed in the tables. The Opitz classification and coding system uses tables of this kind (Appendix 18A). An alternative and more productive approach involves using a computerized classification and coding system, in which the user responds to questions asked by the computer. On the basis of the responses, the computer assigns a code number to the part. Whichever method is used, the classification results in a code number that uniquely identifies the part's attributes.

The principal functional areas that would use a parts classification and coding system are design and manufacturing. Accordingly, parts classification and coding systems fall into one of three categories: (1) systems based on part design attributes, (2) systems based on part manufacturing attributes, and (3) systems based on both design and manufacturing features. The typical design and manufacturing part attributes have previously been noted in Table 18.1.

In terms of the meaning of the symbols in the code, there are three structures used in classification and coding schemes:

1. *Hierarchical structure*, also known as a *monocode*, in which the interpretation of each successive symbol depends on the values of the preceding symbols
2. *Chain-type structure*, also known as a *polycode*, in which the interpretation of each symbol in the sequence is always the same; it does not depend on the values of preceding symbols
3. *Mixed-mode structure*, a hybrid of the two previous coding schemes.

To distinguish the hierarchical and chain-type structures, consider a two-digit code number for a part, such as 15 or 25. Suppose the first digit stands for the general shape of the part: 1 means the part is cylindrical (rotational), and 2 means the geometry is block-like. In a hierarchical structure, the interpretation of the second digit depends on the value of the first digit. If preceded by 1, the 5 might indicate a length-to-diameter ratio; and if preceded by 2, the 5 might indicate an aspect ratio between the length and width dimensions of the part. In the chain-type structure, the symbol 5 would have the same meaning whether preceded by 1 or 2. For example, it might indicate the overall length of the part. The advantage of the hierarchical structure is that in general more information can be included in a code of a given number of digits. The mixed-mode structure uses a combination of hierarchical and chain-type structures.

The number of digits in the code can range between 6 and 30. Coding schemes that contain only design data require fewer digits, perhaps 12 or fewer. Most classification and coding systems include both design and manufacturing data, and this usually requires 20–30 digits. This might seem like too many digits for a human reader to easily comprehend, but most of the data processing of the codes is accomplished by computer, for which a large number of digits is of minor concern.

A number of parts classification and coding systems are described in the literature (e.g., [15], [18], and [29]), including a number of commercial packages that were developed. However, none of the systems has been universally adopted. One reason is that a classification and coding system must be customized for each company, because each company's products are unique. A system that works for one company may not work

for another company. Another reason is the significant expense for the user company to implement a coding system.¹

18.1.4 Production Flow Analysis

Production flow analysis (PFA) is an approach to part family identification and machine cell formation that was pioneered by J. Burbidge [7], [8], [9]. It is a method for identifying part families and associated machine groupings that uses the information contained on production route sheets rather than part drawings. Work parts with identical or similar routings are classified into part families. These families can then be used to form logical machine cells in a group-technology layout. Since PFA uses manufacturing data rather than design data to identify part families, it can overcome two possible anomalies that can occur in parts classification and coding. First, parts whose basic geometries are quite different may nevertheless require similar or even identical process routings. Second, parts whose geometries are quite similar may nevertheless require process routings that are quite different. Recall Figures 18.1 and 18.2.

The procedure in production flow analysis must begin by defining the scope of the study, which means deciding on the population of parts to be analyzed. Should all of the parts in the plant be included in the study, or should a representative sample be selected for analysis? Once this decision is made, then the procedure in PFA consists of the following steps:

1. *Data collection.* The minimum data needed in the analysis are the part number and operation sequence, which is contained in shop documents called route sheets or operation sheets. Each operation is usually associated with a particular machine, and so determining the operation sequence also determines the machine sequence.
2. *Sortation of process routings.* In this step, the parts are arranged into groups according to the similarity of their process routings. To facilitate this step, all operations or machines included in the shop are reduced to code numbers, such as those shown in Table 18.2. For each part, the operation codes are listed in the order in which they

TABLE 18.2 Possible Code Numbers Indicating Operations and/or Machines for Sortation in Production Flow Analysis (Highly Simplified)

Operation or Machine	Code
Cutoff	01
Lathe	02
Turret lathe	03
Mill	04
Drill—manual	05
NC drill	06
Grind	07

¹Parts classification and coding was a popular topic in the trade literature during the 1980s, and, as mentioned, a number of commercial classification and coding systems were available. The companies included Brisch-Birn Inc. (Brisch System), Lovelace, Lawrence & Co. (Part Analog System), Manufacturing Data Systems, Inc. (CODE), Metcut Research Associates (CUTPLAN), and Organization for Industrial Research (Multi-Class). An Internet search revealed that most of these companies are no longer in business or their business no longer includes parts classification and coding. This is why coverage of this topic has been reduced in this edition of the book relative to earlier editions.

are performed. A sortation procedure is then used to arrange parts into “packs,” which are groups of parts with identical routings. Some packs may contain only one part number, indicating the uniqueness of the processing of that part. Other packs will contain many parts, and these will constitute a part family.

3. *PFA chart.* The processes used for each pack are then displayed in a PFA chart, a simplified example of which is illustrated in Table 18.3.² The chart is a tabulation of the process or machine code numbers for all of the part packs. In some of the GT literature [27], the PFA chart is referred to by the term *part-machine incidence matrix*. In this matrix, the entries have a value $x_{ij} = 1$ or 0: a value of $x_{ij} = 1$ indicates that the corresponding part i requires processing on machine j , and $x_{ij} = 0$ indicates that no processing of component i is accomplished on machine j . For clarity in presenting the matrix, the 0s are often indicated as blank (empty) entries, as in Table 18.3.
4. *Cluster analysis.* From the pattern of data in the PFA chart, related groupings are identified and rearranged into a new pattern that brings together packs with similar machine sequences. One possible rearrangement of the original PFA chart is shown in Table 18.4, where different machine groupings are indicated within blocks. The blocks might be considered as possible machine cells. It is often the case (but not in Table 18.4) that some packs do not fit into logical groupings. These parts might be analyzed to see if a revised process sequence can be developed that fits into one of the groups. If not, these parts must continue to be fabricated through a conventional process layout. Section 18.4.1 examines a systematic technique called *rank-order clustering* that can be used to perform the cluster analysis.

The weakness of production flow analysis is that the data used in the technique are derived from existing production route sheets. In all likelihood, these route sheets have been prepared by different process planners over many years, during which new equipment may have been installed and old equipment retired. Consequently, the routings may contain operations and machine selections that are biased by the process planners’ backgrounds, experiences, and expertise. Thus, the final machine groupings obtained in the analysis may be suboptimal. Notwithstanding this weakness, PFA has

TABLE 18.3 PFA Chart, Also Known as a Part-Machine Incidence Matrix

Machines (j)	Parts (i)								
	A	B	C	D	E	F	G	H	I
1	1			1				1	
2					1				1
3			1		1				1
4		1				1			
5	1							1	
6			1						1
7		1				1	1		

²For clarity in the part-machine incidence matrices and related discussion, parts are identified by alphabetic character and machines by number. In practice, numbers would be used for both.

TABLE 18.4 Rearranged PFA Chart, Indicating Possible Machine Groupings

Machines (j)	Parts (i)								
	C	E	I	A	D	H	F	G	B
3	1	1	1						
2		1	1						
6	1		1						
1				1	1	1			
5				1		1			
7							1	1	1
4							1		1

the virtue of requiring less time than a complete parts classification and coding procedure. This is attractive to many firms wishing to introduce group technology into their plant operations.

18.2 CELLULAR MANUFACTURING

Whether part families have been determined by intuitive grouping, parts classification and coding, or production flow analysis, there are advantages in producing those parts using GT machine cells rather than a traditional process-type machine layout. When the machines are grouped, the term *cellular manufacturing* is used to describe this work organization. **Cellular manufacturing** is an application of group technology in which dissimilar machines or processes have been aggregated into cells, each of which is dedicated to the production of a part or product family, or a limited group of families. Typical objectives in cellular manufacturing are similar to those of group technology:

- To shorten manufacturing lead times by reducing setup, work-part handling, waiting times, and batch sizes.
- To reduce work-in-process inventory. Smaller batch sizes and shorter lead times reduce work-in-process.
- To improve quality. This is accomplished by allowing each cell to specialize in producing a smaller number of different parts. This reduces process variability.
- To simplify production scheduling. The similarity among parts in the family reduces the complexity of production scheduling. Instead of scheduling parts through a sequence of machines in a process-type shop layout, the system simply schedules the parts through the cell.
- To reduce setup times. This is accomplished by using group tooling (cutting tools, jigs, and fixtures) that have been designed to process the part family, rather than part tooling, which is designed for an individual part. This reduces the number of individual tools required as well as the time to change tooling between parts.

Hyer and Wemmerlov [21] make an interesting comparison between manufacturing cells and job shops that use a conventional process layout. As described in Section 2.3.1, a

process layout consists of production departments in each of which the equipment is *similar* (e.g., lathe department, drill press department, milling department). This organization lends itself to processing of *dissimilar* parts. A manufacturing cell consists of *dissimilar* equipment that is organized to produce *similar* parts (part families).

Two aspects of cellular manufacturing are considered in this section: (1) the composite part concept and (2) machine cell design.

18.2.1 Composite Part Concept

Part families are defined by the fact that their members have similar design and/or manufacturing features. The composite part concept takes this part family definition to its logical conclusion. The **composite part** for a given family is a hypothetical part that includes all of the design and manufacturing attributes of the family. In general, an individual part in the family will have some of the features that characterize the family, but not all of them.

There is always a correlation between part design features and the production operations required to generate those features. Round holes are made by drilling, cylindrical shapes are made by turning, flat surfaces by milling, and so on. A production cell designed for the part family would include those machines required to make the composite part. Such a cell would be capable of producing any member of the family, simply by omitting those operations corresponding to features not possessed by the particular part. The cell would be designed to allow for size variations within the family as well as feature variations.

To illustrate, consider the composite part in Figure 18.5(a). It represents a family of rotational parts with features defined in part (b) of the figure. Associated with each feature is a certain machining operation, as summarized in Table 18.5. A machine cell to produce this part family would be designed with the capability to accomplish all seven operations required to produce the composite part (last column in the table). To produce a specific member of the family, operations would be included to fabricate the required features of the part. For parts without all seven features, unnecessary operations would

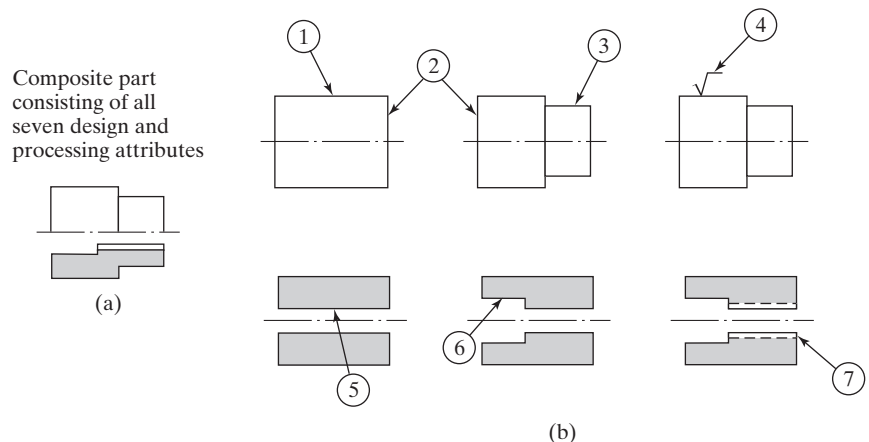


Figure 18.5 Composite part concept: (a) the composite part for a family of machined rotational parts, and (b) the individual features of the composite part. See Table 18.5 for key to individual features and corresponding manufacturing operations.

TABLE 18.5 Design Features of the Composite Part in Figure 18.5 and the Manufacturing Operations Required to Shape Those Features

Label	Design Feature	Corresponding Manufacturing Operation
1	External cylinder	Turning
2	Cylinder face	Facing
3	Cylindrical step	Turning
4	Smooth surface	External cylindrical grinding
5	Axial hole	Drilling
6	Counterbore	Counterboring
7	Internal threads	Tapping

simply be omitted. Machines, fixtures, and tools would be organized for efficient flow of work parts through the cell.

In practice, the number of design and manufacturing attributes is greater than seven, and allowances must be made for variations in overall size and shape of the parts in the family. Nevertheless, the composite part concept is useful for visualizing part families and the machine cell design problem.

18.2.2 Machine Cell Design

Design of the machine cell is critical in cellular manufacturing. The cell design determines to a great degree the performance of the cell. This section discusses types of cells, cell layouts, and the key machine concept.

Types of Machine Cells. GT cells can be distinguished as either (1) assembly cells, which produce families of subassemblies or products, or (2) part cells, which process families of parts. Assembly cells are discussed in Section 15.6.

Machine cells for part family production can be classified according to the number of machines and the degree to which the material flow is mechanized between machines. Four common GT cell configurations are (1) single-machine cell, (2) group-machine cell with manual handling, (3) group-machine cell with semi-integrated handling, and (4) flexible manufacturing cell or flexible manufacturing system.

As its name indicates, the *single-machine cell* consists of one machine plus supporting fixtures and tooling. This type of cell can be applied to work parts whose attributes allow them to be made on one basic type of process, such as turning or milling. For example, the composite part of Figure 18.5 could be produced on a conventional turret lathe with the possible exception of the cylindrical grinding operation (step 4).

The *group-machine cell with manual handling* is an arrangement of more than one machine used collectively to produce one or more part families, and there is no provision for mechanized parts movement between machines in the cell. Instead, the human operators who run the cell perform the material handling function. The cell is often organized into a U-shaped layout, as shown in Figure 18.6. This layout is considered appropriate when there is variation in the work flow among the parts made in the cell. It also allows the multifunctional workers in the cell to move easily between machines [26]. Other advantages of U-shaped cells in batch-model assembly applications, compared to a conventional paced assembly line, include (1) easier changeover from one model to the next, (2) improved quality, (3) visual control of work-in-process, (4) lower initial investment because the cells

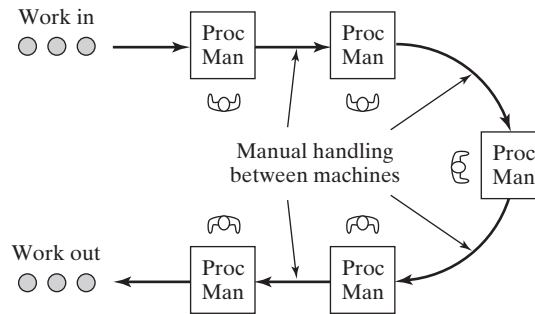


Figure 18.6 Machine cell with manual handling between machines. A U-shaped machine layout is shown. (Key: Proc = processing operation (mill, turn, etc.), Man = manual operation; arrows indicate work flow.)

are simpler and no powered conveyor is required, (5) greater worker satisfaction due to job enlargement and absence of pacing, and (6) more flexibility to adjust to increased demand simply by adding more cells [14].

The group-machine cell with manual handling is sometimes achieved in a conventional process layout without rearranging the equipment. This is done by simply assigning certain machines to be included in the machine group, and restricting their work to specified part families. This allows many of the benefits of cellular manufacturing to be achieved without the expense of rearranging equipment in the shop. Obviously, the material handling benefits of GT are minimized with this organization.

The **group-machine cell with semi-integrated handling** uses a mechanized handling system, such as a conveyor, to move parts between machines in the cell. The **flexible manufacturing system (FMS)** combines a fully integrated material handling system with automated processing stations. The FMS is the most highly automated of the group-technology machine cells. The following chapter is devoted to this form of automation, and discussion of it is deferred until then.

Machine Cell Layouts. Various layouts are used in GT cells. The U-shape in Figure 18.6 is a popular configuration in cellular manufacturing. Other GT layouts include in-line, loop, and rectangular, shown in Figure 18.7 for the case of semi-integrated handling.

Determining the most appropriate cell layout depends on the routings of parts produced in the cell. Four types of part movement can be distinguished in a mixed-model part production system. They are illustrated in Figure 18.8 and defined as follows, where the forward direction of work flow is from left to right in the figure: (1) **repeat operation**, in which a consecutive operation is carried out on the same machine, so that the part does not actually move; (2) **in-sequence move**, in which the part moves forward from the current machine to an immediate neighbor; (3) **bypassing move**, in which the part moves forward from the current machine to another machine that is two or more machines ahead; and (4) **backtracking move**, in which the part moves backward from the current machine to another machine.

When the application consists exclusively of in-sequence moves, an in-line layout is appropriate. A U-shaped layout also works well here and has the advantage of closer

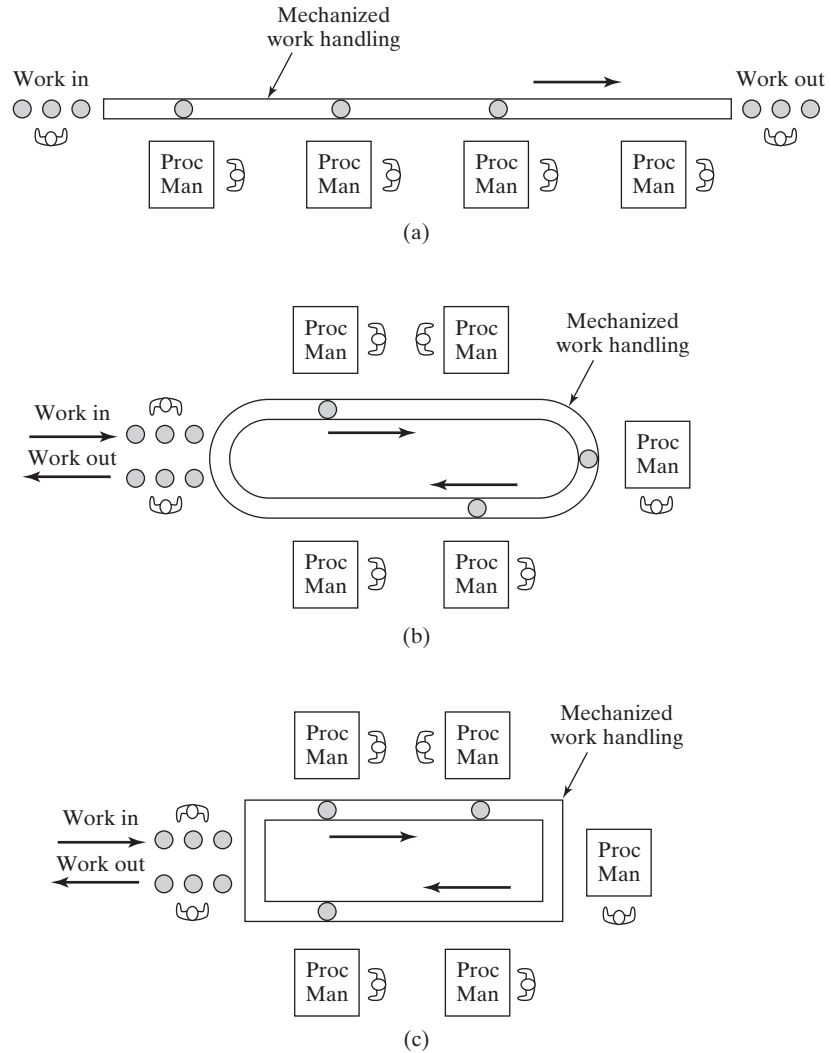


Figure 18.7 Machine cells with semi-integrated handling: (a) in-line layout, (b) loop layout, and (c) rectangular layout. (Key: “Proc” = processing operation (mill, turn, etc.), “Man” = manual operation; arrows indicate work flow.)

interaction among the workers in the cell. When the application includes repeated operations, multiple stations (machines) are often required. For cells requiring bypassing moves, the U-shape layout is appropriate. When backtracking moves are needed, a loop or rectangular layout allows recirculation of parts within the cell. Additional factors that must be accommodated by the cell design include:

- *Amount of work to be done by the cell.* This includes the quantity of parts per year and the processing (or assembly) time per part at each station. These factors determine the workload that must be accomplished by the cell and therefore the number of machines that must be included, as well as total operating cost of the cell and the investment that can be justified.

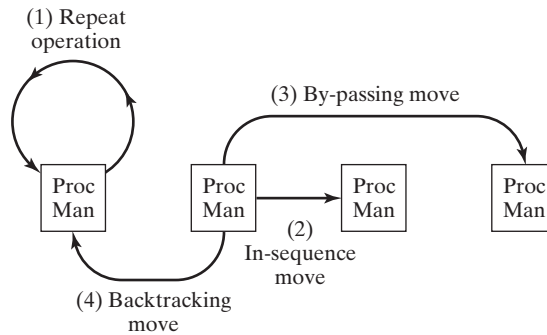


Figure 18.8 Four types of part moves in a mixed-model production system. The forward flow of work is from left to right.

- *Part size, shape, weight, and other physical attributes.* These factors determine the size and type of material handling and processing equipment that must be used.

Key Machine Concept. In some respects, a GT machine cell operates like a manual assembly line, and it is desirable to spread the workload as evenly as possible among the machines in the cell. On the other hand, there is typically a certain machine in a cell (or perhaps more than one machine in a large cell) that is more expensive to operate than the other machines or that performs certain critical operations in the plant. This machine is referred to as the *key machine*. It is important that the utilization of this key machine be high, even if it means that the other machines in the cell have relatively low utilizations. The other machines are referred to as *supporting machines*, and they should be organized in the cell to keep the key machine busy. In a sense, the cell is designed so that the key machine becomes the bottleneck in the system.

The key machine concept is sometimes used to plan the GT machine cell. The approach is to decide what parts should be processed through the key machine and then determine what supporting machines are required to complete the processing of those parts.

There are generally two measures of utilization that are of interest in a GT cell: the utilization of the key machine and the utilization of the overall cell. The utilization of the key machine can be measured using the usual definition (see Section 18.4.3). The utilization of each of the other machines can be evaluated similarly. The cell utilization is obtained by taking a simple arithmetic average of all the machines in the cell.

18.3 APPLICATIONS OF GROUP TECHNOLOGY

In the chapter introduction, group technology was defined as a “manufacturing philosophy.” GT is not a particular technique, although various tools and techniques, such as parts classification and coding and production flow analysis, have been developed to implement it. The group-technology philosophy can be applied in a number of areas. The discussion here focuses on the two main areas of manufacturing and product design.

GT Manufacturing Applications. The most common applications of GT are in manufacturing, and the most common application in manufacturing involves the formation of cells of one kind or another. Not all companies rearrange machines to form cells.

There are three ways in which group-technology principles can be applied in manufacturing [20]:

1. *Informal scheduling and routing of similar parts through selected machines.* This approach achieves setup advantages, but no formal part families are defined and no physical rearrangement of equipment is undertaken.
2. *Virtual machine cells.* This approach involves the creation of part families and dedication of equipment to the manufacture of these part families, but without the physical rearrangement of machines into cells. The machines in the virtual cell remain in their original locations in the factory. Use of virtual cells seems to facilitate the sharing of machines with other virtual cells producing other part families [22].
3. *Formal machine cells.* This is the conventional GT approach in which a group of dissimilar machines are physically relocated into a cell that is dedicated to the production of one or a limited set of part families (Section 18.2.2). The machines in a formal machine cell are located in close proximity to one another in order to minimize part handling, throughput time, and work-in-process.

Other GT applications in manufacturing include process planning, family tooling, and numerical control (NC) part programs. Process planning of new parts can be facilitated by identifying part families. The new part is associated with an existing part family, and generation of the process plan for the new part follows the routing of the other members of the part family. This is done in a formalized way if parts classification and coding is used. The approach is discussed in the context of automated process planning (Section 24.2.1).

Ideally, all members of the same part family require similar setups, tooling, and fixturing. This generally results in a reduction in the amount of tooling and fixturing needed. Instead of using a special tool kit developed for each part, a GT system uses a tool kit developed for each part family. The concept of a *modular fixture*, also known as a *flexible fixture*, can often be exploited, in which a common base fixture is used that can accommodate adaptations to rapidly switch between different parts in the family.

A similar approach can be applied in NC part programming. *Parametric programming* [25] involves the preparation of a common NC program that covers the entire part family, and the program is then adapted for individual members of the family by inserting dimensions and other parameters applicable to the particular part. Parametric programming reduces both part programming time and setup time.

GT Product Design Applications. The application of group technology in product design is principally for design retrieval systems that reduce part proliferation. It has been estimated that the cost of releasing a new part design ranges between \$2,000 and \$12,000 [32]. In a survey of industry reported in Wemmerlov and Myer [31], it was concluded that in about 20% of new part situations, an existing part design could have been used. In about 40% of the cases, an existing part design could have been used with modifications. The remaining cases required new part designs. If the cost savings for a company generating 1,000 new part designs per year were 75% when an existing part design could be used (assuming that there would still be some cost of time associated with the new part for engineering analysis and design retrieval) and 50% when an existing design could be modified, then the total annual savings to the company would be \$700,000 to \$4,200,000, or 35% of the company's total design expense due to part releases. The level of design savings described here requires an efficient design retrieval procedure. Most design retrieval procedures are based on parts classification and coding systems.

Other design applications of group technology involve simplification and standardization of design parameters such as tolerances, inside radii on corners, chamfer sizes on outside edges, hole sizes, and thread sizes. These measures simplify design procedures and reduce part proliferation. Design standardization also pays dividends in manufacturing by reducing the required number of distinct lathe tool nose radii, drill sizes, and fastener sizes. There is also a benefit in reducing the amount of data and information that the company must handle. Fewer part designs, design attributes, tools, fasteners, and so on mean fewer and simpler design documents, process plans, and other data records.

18.4 ANALYSIS OF CELLULAR MANUFACTURING

Many quantitative techniques have been developed to deal with problems in group technology and cellular manufacturing. Two problem areas are considered in this section: (1) grouping parts and machines into families, and (2) arranging machines in a GT cell. The first problem area has been the subject of academic research, and several publications are listed in references [2], [3], [12], [13], [23], and [24]. The technique described here for solving the part and machine grouping problem is rank-order clustering [23]. The second problem area has also been the subject of research, and several reports are listed in references [1], [7], [9], and [19]. In Section 18.4.2, a heuristic approach by Hollier is introduced [19].

18.4.1 Rank-order Clustering

The problem addressed here is determining how machines in an existing plant should be grouped into machine cells. The problem is the same whether the cells are virtual or formal (Section 18.3). It is basically the problem of identifying part families. After part families have been identified, the machines to produce a given part family can be selected and grouped together.

The rank-order clustering technique, first proposed by King [23], is specifically applicable in production flow analysis. It is an efficient and easy-to-use algorithm for grouping machines into cells. In a starting part-machine incidence matrix that might be compiled to document the part routings in a machine shop (or other job shop), the occupied locations in the matrix are organized in a seemingly random fashion. Rank-order clustering works by reducing the part-machine incidence matrix to a set of diagonalized blocks that represent part families and associated machine groups. Starting with the initial part-machine incidence matrix, the algorithm consists of the following steps:

1. In each row of the matrix, read the series of 1s and 0s (blank entries = 0s) from left to right as a binary number. Rank the rows in order of decreasing value. In case of a tie, rank the rows in the same order as they appear in the current matrix.
2. Numbering from top to bottom, is the current order of rows the same as the rank order determined in the previous step? If yes, go to step 7. If no, go to the following step.
3. Reorder the rows in the part-machine incidence matrix by listing them in decreasing rank order, starting from the top.
4. In each column of the matrix, read the series of 1s and 0s (blank entries = 0s) from top to bottom as a binary number. Rank the columns in order of decreasing value. In case of a tie, rank the columns in the same order as they appear in the current matrix.

5. Numbering from left to right, is the current order of columns the same as the rank order determined in the previous step? If yes, go to step 7. If no, go to the following step.
6. Reorder the columns in the part-machine incidence matrix by listing them in decreasing rank order, starting with the left column. Go to step 1.
7. Stop.

For readers unaccustomed to evaluating binary numbers in steps 1 and 4, it might be helpful to convert each binary value into its decimal equivalent. For example, the entries in the first row of the matrix in Table 18.3 are read as 100100010. This converts to its decimal equivalent as follows: $(1 \times 2^8) + (0 \times 2^7) + (0 \times 2^6) + (1 \times 2^5) + (0 \times 2^4) + (0 \times 2^3) + (0 \times 2^2) + (1 \times 2^1) + (0 \times 2^0) = 256 + 32 + 2 = 290$. Decimal conversion becomes impractical for the large numbers of parts found in practice, so it is preferable to compare the binary numbers.

In Example 18.1, it is possible to divide the parts and machines into three mutually exclusive part-machine groups. This represents the ideal case because the part families and

EXAMPLE 18.1 Rank-order Clustering Technique

Apply the rank-order clustering technique to the part-machine incidence matrix in Table 18.3.

Solution: Step 1 consists of reading the series of 1s and 0s in each row as a binary number. This is done in Table 18.6(a), converting the binary value for each row to its decimal equivalent. The values are then rank-ordered in the far right-hand column. In step 2, it is seen that the row order is different from the starting matrix. Therefore, the rows are reordered in step 3. In step 4, the series of 1s and 0s in each column are read from top to bottom as a binary number (again this has been converted to the decimal equivalent) and rank the columns in order of decreasing value, as shown in Table 18.6(b). In step 5, it is observed that the column order is different from the preceding matrix. Proceeding from step 6 back to steps 1 and 2, and a reordering of the columns provides a row order that is in descending value and the algorithm is concluded (step 7). The final solution is shown in Table 18.6(c). A comparison of this solution with Table 18.4 reveals that they are the same part-machine groupings.

TABLE 18.6(a) First Iteration (Step 1) in the Rank-order Clustering Technique Applied to Example 18.1

Binary values	2 ⁸	2 ⁷	2 ⁶	2 ⁵	2 ⁴	2 ³	2 ²	2 ¹	2 ⁰		
	Parts									Decimal Equivalent	Rank
Machines	A	B	C	D	E	F	G	H	I		
1	1			1				1		290	1
2					1				1	17	7
3			1		1					81	5
4		1				1				136	4
5	1							1		258	2
6			1						1	65	6
7		1				1	1			140	3

TABLE 18.6(b) Second Iteration (Steps 3 and 4) in the Rank-order Clustering Technique Applied to Example 18.1

Machines	Parts									Binary values
	A	B	C	D	E	F	G	H	I	
1	1			1				1		2^6
5	1							1		2^5
7		1				1	1			2^4
4		1				1				2^3
3			1		1				1	2^2
6			1						1	2^1
2					1				1	2^0
Decimal	96	24	6	64	5	24	16	96	7	
equivalent Rank	1	4	8	3	9	5	6	2	7	

TABLE 18.6(c) Solution of Example 18.1

Machines	Parts								
	A	H	D	B	F	G	I	C	E
1	1	1	1						
5	1	1							
7				1	1	1			
4				1	1				
3							1	1	1
6							1	1	
2							1		1

associated machine cells are completely segregated. However, it is not uncommon for an overlap in processing requirements to exist between machine groups. That is, a given part type needs to be processed by more than one machine group. One way of dealing with the overlap is simply to duplicate the machine that is used by more than one part family, placing the same machine type in both cells. Other approaches, attributed to Burbidge [23], include (1) change the routing so that all processing can be accomplished in the primary machine group, (2) redesign the part to eliminate the processing requirement outside the primary machine group, and (3) purchase the parts from an outside supplier.

18.4.2 Arranging Machines in a GT Cell

After part-machine groupings have been identified, the next problem is to organize the machines into the most logical sequence. A simple yet effective method is suggested by Hollier [19]³ that uses data contained in from-to charts (Section 10.3.1) and is intended to place the machines in an order that maximizes the proportion of in-sequence moves

³Hollier [19] presented six heuristic approaches to solving the machine arrangement problem, of which only one is described here. He presents a comparison of the six methods in his paper.

within the cell. The method is based on the use of from-to ratios determined by summing the total flow from and to each machine in the cell. The algorithm can be reduced to three steps:

1. *Develop the from-to chart.* The data contained in the chart indicate numbers of part moves between the machines (or workstations) in the cell. Moves into and out of the cell are not included in the chart.
2. *Determine the “from-to ratio” for each machine.* This is accomplished by summing all of the “From” trips and “To” trips for each machine (or operation). The “From” sum for a machine is determined by adding the entries in the corresponding row, and the “To” sum is determined by adding the entries in the corresponding column. For each machine, the “from-to ratio” is calculated by taking the “From” sum for each machine and dividing by the respective “To” sum.
3. *Arrange machines in order of decreasing from-to ratio.* Machines with a high from-to ratio distribute more work to other machines in the cell but receive less work from other machines. Conversely, machines with a low from-to ratio receive more work than they distribute. Therefore, machines are arranged in order of descending from-to ratio; that is, machines with high ratios are placed at the beginning of the work flow, and machines with low ratios are placed at the end of the work flow. In case of a tie, the machine with the higher “From” value is placed ahead of the machine with a lower value.

EXAMPLE 18.2 Group-technology Machine Sequence Using the Hollier Method

A GT cell has four machines: 1, 2, 3, and 4. An analysis of 50 parts processed on these machines has been summarized in the from-to chart in Table 18.7. Additional information: 50 parts enter the machine grouping at machine 3, 20 parts leave after processing at machine 1, and 30 parts leave machine 4 after processing. Determine the most logical machine sequence using the Hollier method.

TABLE 18.7 From-To Chart for Example 18.2

From	To			
	1	2	3	4
1	0	5	0	25
2	30	0	0	15
3	10	40	0	0
4	10	0	0	0

Solution: Summing the “From” trips and “To” trips for each machine yields the “From” and “To” sums in Table 18.8. The from-to ratios are listed in the last column on the right. Arranging the machines in order of descending from-to ratio, the machines in the cell should be sequenced as follows:

$$3 \rightarrow 2 \rightarrow 1 \rightarrow 4$$

TABLE 18.8 From-To Sums and From-To Ratios for Example 18.2

From	To				"From" sums	From-to ratio
	1	2	3	4		
1	0	5	0	25	30	0.60
2	30	0	0	15	45	1.0
3	10	40	0	0	50	∞
4	10	0	0	0	10	0.25
"To" sums	50	45	0	40	135	

It is helpful to use a graphical technique, such as the network diagram (Section 10.3.1), to conceptualize the work flow in the cell. The network diagram for the machine arrangement in Example 18.2 is presented in Figure 18.9. The flow is mostly in-line; however, there is some bypassing and backtracking of parts that must be considered in the design of any material handling system that might be used in the cell. A powered conveyor would be appropriate for the forward flow between machines, with manual handling for the back flow.

Three ratings can be defined to compare solutions to the machine sequencing problem: (1) percentage of in-sequence moves, (2) percentage of bypassing moves, and (3) percentage of backtracking moves. Each rating is computed by adding all of the values representing that type of move and dividing by the total number of moves. It is desirable for the percentage of in-sequence moves to be high, and for the percentage of backtracking moves to be low. The Hollier method is designed to achieve these goals. Bypassing moves are less desirable than in-sequence moves, but certainly better than backtracking.

EXAMPLE 18.3 Rating Machine Sequences

Compute (a) the percentage of in-sequence moves, (b) the percentage of bypassing moves, and (c) the percentage of backtracking moves for the solution in Example 18.2.

Solution: From Figure 18.9, the number of in-sequence moves = 40 + 30 + 25 = 95, the number of bypassing moves = 10 + 15 = 25, and the number of backtracking

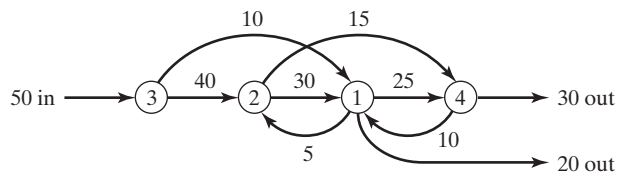


Figure 18.9 Network diagram for machine cell in Example 18.2. Flow of parts into and out of the cells is included.

moves = 5 + 10 = 15. The total number of moves = 135 (totaling either the “From” sums or the “To” sums). Thus,

- (a) Percentage of in-sequence moves = $95/135 = 0.704 = 70.4\%$
- (b) Percentage of bypassing moves = $25/135 = 0.185 = 18.5\%$
- (c) Percentage of backtracking moves = $15/135 = 0.111 = 11.1\%$

18.4.3 Performance Metrics in Cell Operations

Some of the equations developed in Chapter 3 for factory operations can be adapted to the operations of group-technology cells. Suppose the cell consists of n machines (workstations) and produces a family of parts with n_f family members. Let i = a subscript to identify machines ($i = 1, 2, \dots, n$), and let j = a subscript to identify family members ($j = 1, 2, \dots, n_f$). The production time of family member j on machine i is given by T_{pij} , which is determined as follows:

$$T_{pij} = \frac{T_{suij} + Q_j T_{cij}}{Q_j} \quad (18.1)$$

where T_{suij} = the setup or changeover time to prepare for family member j on machine i , min; T_{cij} = operation cycle time for family member j on machine i , min/pc; and Q_j = batch quantity for family member j , pc. Unlike conventional batch production, one would expect the T_{suij} value to be minimal; in the ideal case, there would be no lost time for changeover in cellular manufacturing ($T_{suij} = 0$). Similarly, batch quantity Q_j would be low, perhaps a batch size of one ($Q_j = 1$). With these values, $T_{pij} = T_{cij}$. However, Equation (18.1) allows for changeover time between different family members, and for the family members to be run in batches if there is a changeover time.

The production rate R_{pij} for family member j on machine i is the reciprocal of production time, multiplied by 60 to express it as an hourly rate:

$$R_{pij} = \frac{60}{T_{pij}} \quad (18.2)$$

Let f_{ij} = the fraction of time during steady-state operation that machine i is processing family member j . Under normal conditions, it follows that for each machine i ,

$$0 \leq \sum_j f_{ij} \leq 1 \text{ where } 0 \leq f_{ij} \leq 1 \text{ for all } i. \quad (18.3)$$

The value of $\sum_j f_{ij}$ for each machine is the utilization of that machine within the cell. That is,

$$U_i = \sum_j f_{ij} \quad (18.4)$$

where U_i = utilization of machine i . If $\sum f_{ij} = 1$, the machine is fully utilized. More likely, $\sum f_{ij}$ will be less than 1 for at least some of the machines in the cell. The average utilization of the cell is the average of the machine utilizations:

$$U = \frac{\sum_{i=1}^n \sum_j f_{ij}}{n} = \frac{\sum_j U_i}{n} \quad (18.5)$$

Each family member is processed through n_{oj} operations (machines) in the cell. The production rate of the cell is given by

$$R_p = \frac{\sum_{i=1}^n \sum_j f_{ij} R_{pij}}{n_{oj}} \quad (18.6)$$

where R_p = average hourly production rate (pc/hr) of the cell; n_{oj} = the number of operations required to produce family member j , and the other terms are defined earlier.

One of the advantages of cellular manufacturing is reduced lead time to get parts through the cell compared to a job shop. The manufacturing lead time is the sum of setup time, run time, and nonoperation time. The nonoperation time consists of waiting time and move time within the cell. For any family member, this can be expressed as follows:

$$MLT_j = \sum_{i=1}^{n_{oj}} (T_{suij} + Q_j T_{cij} + T_{noij}) \quad (18.7)$$

where MLT_j = manufacturing lead time for part family member j , min; T_{suij} = setup (changeover) time for operation i on family member j , min; Q_j = batch quantity of family member j being processed in the cell, pc; T_{cij} = cycle time for operation i on family member j , min/pc; T_{noij} = nonoperation time associated with operation i , min; and i indicates the operation sequence in the processing: $i = 1, 2, \dots, n_{oj}$. One would expect the setup time to be minimal in a group-technology cell, depending on how similar the family members are. The nonoperation time in a GT cell would also be expected to be significantly less than in a conventional job shop or batch production situation. The average manufacturing lead time for the part family is given by the following:

$$MLT = \frac{\sum_{j=1}^{n_f} MLT_j}{n_f} \quad (18.8)$$

where MLT = average manufacturing lead time for the n_f family members, min; and MLT_j = lead time for family member j from Equation (18.7).

The work-in-process within the cell can be determined from the production rate and manufacturing lead time. As in Chapter 3, the determination is based on Little's formula (Section 3.1.3, footnote 2):

$$WIP = R_p(MLT) \quad (18.9)$$

where WIP = work-in-process in the plant, pc; R_p = average hourly production rate from Equation (18.6), pc/hr; and MLT = average manufacturing lead time from Equation (18.8), hr.

EXAMPLE 18.4 Performance Metrics for a GT Cell

A group-technology cell has three machines and is used to process a family of four similar parts. The table below lists production quantities (Q_j), production times (T_{p1j}), and machine fractions for each family member (f_{ij}). Assume the nonoperation times (T_{no}) are all the same at 30 min per machine. Determine (a) average hourly production rate for the cell, (b) utilization of each machine and average utilization of the cell, (c) manufacturing lead time, and (d) work-in-process.

Part	Q_j	Machine 1		Machine 2		Machine 3	
		T_{p1} (min)	f_{1j}	T_{p2} (min)	f_{2j}	T_{p3} (min)	f_{3j}
A	1	3.0	0.2	4.5	0.3	2.25	0.15
B	1	2.0	0.2	4.0	0.4	3.0	0.3
C	1	5.0	0.25	4.0	0.2	3.0	0.15
D	1	4.0	0.3	1.333	0.1	2.667	0.2

Solution: A spreadsheet calculator was used to perform the calculations. Hourly production rates for each machine and family member were computed using Equation (18.2). The quantities of each family member produced in 1 hr were $Q_{ij} = f_{ij}R_{p1j}$. The total for each column represents the hourly output of all parts from each machine (17.5 pc/hr). Finally, the MLT values were obtained from $MLT_j = T_{p1j} + T_{p2j} + T_{p3j} + 3T_{no}$. These were averaged to obtain $99.7 \text{ min} = 1.661 \text{ hr}$.

R_{p1}	R_{p2}	R_{p3}	Q_1	Q_2	Q_3	MLT
20.00	13.33	26.67	4.00	4.00	4.00	99.75
30.00	15.00	20.00	6.00	6.00	6.00	99.00
12.00	15.00	20.00	3.00	3.00	3.00	102.00
15.00	45.00	22.50	4.50	4.50	4.50	68.00
			17.50	17.50	17.50	398.75
						Average $MLT = 99.7$

Summary: (a) Hourly production rate for each machine and for the cell $R_p = 17.5 \text{ parts/hr}$

Note that all three machines have the same production rate, which means that the workload in the cell is balanced.

(b) Utilization for each machine is given by $\sum f_{ij}$ for each machine i . Thus, $U_1 = 0.95$, $U_2 = 1.0$, and $U_3 = 0.80$. Average cell utilization $U = 0.917$.

(c) Average manufacturing lead time $MLT = 99.7 \text{ min} = 1.661 \text{ hr}$

(d) Average work-in-process $WIP = (17.5 \text{ parts/hr})(1.661 \text{ hr}) = 29.1 \text{ parts}$

REFERENCES

- [1] ANEKE, N. A. G., and A. S. CARRIE, "A Design Technique for the Layout of Multi-Product Flowlines," *International Journal of Production Research*, Vol. 24, 1986, pp. 471–481.
- [2] ASKIN, R. G., H. M. SELIM, and A. J. VAKHARIA, "A Methodology for Designing Flexible Cellular Manufacturing Systems," *IIE Transactions*, Vol. 29, 1997, pp. 599–610.
- [3] BEAULIEU, A., A. GHARBI, and A. AIT-KADI, "An Algorithm for the Cell Formation and the Machine Selection Problems in the Design of a Cellular Manufacturing System," *International Journal of Production Research*, Vol. 35, 1997, pp. 1857–1874.
- [4] BLACK, J. T., "An Overview of Cellular Manufacturing Systems and Comparison to Conventional Systems," *Industrial Engineering*, November 1983, pp. 36–48.
- [5] BLACK, J. T., *The Design of the Factory with a Future*, McGraw-Hill Book Company, New York, 1990.
- [6] BLACK, J. T., and S. L. HUNTER, *Lean Manufacturing Systems and Cell Design*, Society of Manufacturing Engineers, Dearborn, MI, 2003.
- [7] BURBIDGE, J. L., "Production Flow Analysis," *Production Engineer*, Vol. 41, 1963, p. 742.
- [8] BURBIDGE, J. L., *The Introduction of Group Technology*, John Wiley & Sons, NY, 1975.
- [9] BURBIDGE, J. L., "A Manual Method of Production Flow Analysis," *Production Engineer*, Vol. 56, 1977, p. 34.
- [10] BURBIDGE, J. L., *Group Technology in the Engineering Industry*, Mechanical Engineering Publications Ltd., London, UK, 1979.
- [11] BURBIDGE, J. L., "Change to Group Technology: Process Organization is Obsolete," *International Journal of Production Research*, Vol. 30, 1992, pp. 1209–1219.
- [12] CANTAMESSA, M., and A. TURRONI, "A Pragmatic Approach to Machine and Part Grouping in Cellular Manufacturing Systems Design," *International Journal of Production Research*, Vol. 35, 1997, pp. 1031–1050.
- [13] CHANDRASEKHARAN, M. P., and R. RAJAGOPALAN, "ZODIAC: An Algorithm for Concurrent Formation of Part Families and Machine Cells," *International Journal of Production Research*, Vol. 25, 1987, pp. 835–850.
- [14] ESPINOSA, A., "The New Shape of Manufacturing," *Assembly*, October 2003, pp. 52–54.
- [15] GALLAGHER, C. C., and W. A. KNIGHT, *Group Technology*, Butterworth & Co. Ltd., London, UK, 1973.
- [16] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 3rd ed., John Wiley & Sons, Inc., Hoboken, NJ, 2007.
- [17] HAM, I., "Introduction to Group Technology," *Technical Report MMR76-03*, Society of Manufacturing Engineers, Dearborn, MI, 1976.
- [18] HAM, I., K. HITOMI, and T. YOSHIDA, *Group Technology: Applications to Production Management*, Kluwer-Nijhoff Publishing, Boston, MA, 1985.
- [19] HOLLIER, R. H., "The Layout of Multi-Product Lines," *International Journal of Production Research*, Vol. 2, 1963, pp. 47–57.
- [20] HYER, N. L., and U. WEMMERLOV, "Group Technology in the U.S. Manufacturing Industry: A Survey of Current Practices," *International Journal of Production Research*, Vol. 27, 1989, pp. 1287–1304.
- [21] HYER, N. L., and U. WEMMERLOV, *Reorganizing the Factory: Competing through Cellular Manufacturing*, Productivity Press, Portland, OR, 2002.
- [22] IRANI, S. A., T. M. CAVALIER, and P. H. COHEN, "Virtual Manufacturing Cells: Exploiting Layout Design and Intercell Flows for the Machine Sharing Problem," *International Journal of Production Research*, Vol. 31, 1993, pp. 791–810.

- [23] KING, J. R., “Machine-Component Grouping in Production Flow Analysis: An Approach Using a Rank-order Clustering Algorithm,” *International Journal of Production Research*, Vol. 18, 1980, pp. 213–222.
- [24] KUSIAK, A., “EXGT-S: A Knowledge Based System for Group Technology,” *International Journal of Production Research*, Vol. 26, 1988, pp. 1353–1367.
- [25] LYNCH, M., *Computer Numerical Control for Machining*, McGraw-Hill, Inc., New York, 1992.
- [26] MONDEN, Y., *Toyota Production System*, Industrial Engineering and Management Press, Institute of Industrial Engineers, Norcross, GA, 1983.
- [27] MOODIE, C., R. UZSOY, and Y. YIH, *Manufacturing Cells: A Systems Engineering View*, Taylor & Francis Ltd., London, UK, 1995.
- [28] OPITZ, H., *A Classification System to Describe Workpieces*, Pergamon Press, Oxford, UK, 1970.
- [29] OPITZ, H., and H. P. WIENDAHL, “Group Technology and Manufacturing Systems for Medium Quantity Production,” *International Journal of Production Research*, Vol. 9, No. 1, 1971, pp. 181–203.
- [30] SINGH, N., and D. RAJAMANI, *Cellular Manufacturing Systems: Design, Planning, and Control*, Chapman & Hall, London, UK, 1996.
- [31] WEMMERLOV, U., and N. L. HYER, “Cellular Manufacturing in U.S. Industry: A Survey of Users,” *International Journal of Production Research*, Vol. 27, 1989, pp. 1511–1530.
- [32] WEMMERLOV, U., and N. L. HYER, “Group Technology,” *Handbook of Industrial Engineering*, G. Salvendy (ed.), John Wiley & Sons, Inc., New York, 1992, pp. 464–488.
- [33] WILD, R., *Mass Production Management*, John Wiley & Sons Ltd., London, UK, 1972.
- [34] www.clrh.com
- [35] www.strategosinc.com

REVIEW QUESTIONS

- 18.1** What is group technology?
- 18.2** What is cellular manufacturing?
- 18.3** What are the production conditions under which group technology and cellular manufacturing are most applicable?
- 18.4** What are the two major tasks that a company must undertake when it implements group technology?
- 18.5** What is a part family?
- 18.6** What are the three methods for solving the problem of grouping parts into part families?
- 18.7** What is the difference between a hierarchical structure and a chain-type structure in a classification and coding scheme?
- 18.8** What is production flow analysis?
- 18.9** What are the typical objectives when implementing cellular manufacturing?
- 18.10** What is the *composite part concept*, as the term is applied in group technology?
- 18.11** What are the four common GT cell configurations, as identified in the text?
- 18.12** What is the key machine concept in cellular manufacturing?
- 18.13** What is the difference between a virtual machine cell and a formal machine cell?
- 18.14** What is the principal application of group technology in product design?
- 18.15** What is the application of rank-order clustering?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Rank-Order Clustering

- 18.1 (A)** Apply the rank-order clustering technique to the part-machine incidence matrix in the following table to identify logical part families and machine groups. Parts are identified by letters, and machines are identified numerically.

		Parts				
Machines		A	B	C	D	E
1		1				
2			1			1
3		1			1	
4			1	1		
5					1	

- 18.2** Apply the rank-order clustering technique to the part-machine incidence matrix in the following table to identify logical part families and machine groups. Parts are identified by letters, and machines are identified numerically.

		Parts					
Machines		A	B	C	D	E	F
1		1				1	
2					1		1
3		1	1				
4				1	1		
5			1			1	
6				1	1		1

- 18.3** Apply the rank-order clustering technique to the part-machine incidence matrix in the following table to identify logical part families and machine groups. Parts are identified by letters, and machines are identified numerically.

		Parts								
Machines		A	B	C	D	E	F	G	H	I
1		1								1
2			1					1		
3				1		1			1	
4			1				1	1		
5				1						1
6							1	1		
7		1			1					
8				1		1				

- 18.4** Apply the rank-order clustering technique to the part-machine incidence matrix in the following table to identify logical part families and machine groups. Parts are identified by letters, and machines are identified numerically.

Machines	Parts								
	A	B	C	D	E	F	G	H	I
1			1	1	1				
2	1	1					1	1	1
3						1	1	1	
4	1	1		1					
5			1		1				
6		1						1	1
7	1		1	1					
8		1				1		1	1

- 18.5** The following table lists the weekly quantities and routings of ten parts that are being considered for cellular manufacturing in a machine shop. Parts are identified by letters and machines are identified numerically. For the data given, (a) develop the part-machine incidence matrix, and (b) apply the rank-order clustering technique to the part-machine incidence matrix to identify logical part families and machine groups.

Part	Weekly Quantity	Machine Routing	Part	Weekly Quantity	Machine Routing
A	50	3 → 2 → 7	F	60	5 → 1
B	20	6 → 1	G	5	3 → 2 → 4
C	75	6 → 5	H	100	3 → 2 → 4 → 7
D	10	6 → 5 → 1	I	40	2 → 4 → 7
E	12	3 → 2 → 7 → 4	J	15	5 → 6 → 1

Machine Cell Organization and Design

- 18.6 (A)** Four machines used to produce a family of parts are to be arranged into a GT cell. The from-to data for the parts processed by the machines are shown in the table below. (a) Determine the most logical sequence of machines for this data. (b) Construct the network diagram for the data, showing where and how many parts enter and exit the system. (c) Compute the percentages of in-sequence moves, bypassing moves, and backtracking moves in the solution. (d) Develop a feasible layout plan for the cell.

From	To			
	1	2	3	4
1	0	10	0	40
2	0	0	0	0
3	50	0	0	20
4	0	50	0	0

- 18.7** In Problem 18.5, two logical machine groups are identified by rank-order clustering. For each machine group, (a) determine the most logical sequence of machines for this data. (b) Construct the network diagram for the data. (c) Compute the percentages of in-sequence moves, bypassing moves, and backtracking moves in the solution.

- 18.8** Five machines will constitute a GT cell. The from-to data for the machines are shown in the table below. (a) Determine the most logical sequence of machines for this data, and construct the network diagram, showing where and how many parts enter and exit the system. (b) Compute the percentages of in-sequence moves, bypassing moves, and back-tracking moves in the solution. (c) Develop a feasible layout plan for the cell based on the solution.

From	To				
	1	2	3	4	5
1	0	10	80	0	0
2	0	0	0	85	0
3	0	0	0	0	0
4	70	0	20	0	0
5	0	75	0	20	0

- 18.9** A GT machine cell contains three machines. Machine 1 feeds machine 2 which is the key machine in the cell. Machine 2 feeds machine 3. The cell is set up to produce a family of five parts (A, B, C, D, and E). The operation times for each part at each machine are given in the table below. The products are to be produced in the ratios 4:3:2:2:1, respectively. (a) If 35 hr/wk are worked, determine how many of each product will be made by the cell. (b) What is the utilization of each machine in the cell?

Part	Operation time		
	Machine 1	Machine 2	Machine 3
A	4.0 min	15.0 min	10.0 min
B	15.0 min	18.0 min	7.0 min
C	26.0 min	20.0 min	15.0 min
D	15.0 min	20.0 min	10.0 min
E	8.0 min	16.0 min	10.0 min

- 18.10** A GT cell will machine the components for a family of parts. The parts come in several different sizes and the cell will be designed to quickly change over from one size to the next. This will be accomplished using fast-change fixtures and downloading the part programs from the plant computer to the CNC (computer numerical control) machines in the cell. The parts are rotational type, and so the cell must be able to perform turning, boring, facing, drilling, and cylindrical grinding operations. Accordingly, there will be several machine tools in the cell, of types and numbers to be specified by the designer. To transfer parts between machines in the cell, the designer may elect to use a belt or similar conveyor system. Any conveyor equipment of this type will be 0.4 m wide. The arrangement of the various pieces of equipment in the cell is the principal problem to be considered. The raw work parts will be delivered into the machine cell on a belt conveyor. The finished parts must be deposited onto a conveyor that delivers them to the assembly department. The input and output conveyors are 0.4 m wide, and the designer must specify where they enter and exit the cell. The parts are currently machined by conventional methods in a process-type layout. In the current production method, there are seven machines involved but two of the machines are duplicates. "From-to" data have been collected for the jobs that are relevant to this problem.

From	To							Parts out
	1	2	3	4	5	6	7	
1	0	112	0	61	59	53	0	0
2	12	0	0	0	0	226	0	45
3	74	0	0	35	31	0	180	0
4	0	82	0	0	0	23	5	16
5	0	73	0	0	0	23	0	14
6	0	0	0	0	0	0	0	325
7	174	16	20	30	20	0	0	0
Parts in	25	0	300	0	0	0	75	

The from-to data indicate the number of work parts moved between machines during a typical 40-hr week. The two categories “parts in” and “parts out” indicate parts entering and exiting the seven machine group. A total of 400 parts on average are processed through the seven machines each week. However, as indicated by the data, not all 400 parts are processed by every machine. Machines 4 and 5 are identical and assignment of parts to these machines is arbitrary. Average production rate capacity on each of the machines for the particular distribution of this parts family is given in the table below. Also given are the floor space dimensions of each machine in meters. Assume that all loading and unloading operations take place in the center of the machine.

Machine	Operation	Production rate	Machine dimensions
1	Turn outside diameter	9 pc/hr	3.5 m × 1.5 m
2	Bore inside diameter	15 pc/hr	3.0 m × 1.6 m
3	Face ends	10 pc/hr	2.5 m × 1.5 m
4	Grind outside diameter	12 pc/hr	3.0 m × 1.5 m
5	Grind outside diameter	12 pc/hr	3.0 m × 1.5 m
6	Inspect	5 pc/hr	Bench 1.5 m × 1.5 m
7	Drill	9 pc/hr	1.5 m × 2.5 m

Operation 6 is currently a manual inspection operation. It is anticipated that this manual station will be replaced by a coordinate measuring machine (CMM). This automated inspection machine will triple throughput rate to 15 parts/hr from 5 parts/hr for the manual method. The floor space dimensions of the CMM are 2.0 m × 1.6 m. All other machines currently listed are to be candidates for inclusion in the new machine cell. (a) Analyze the problem and determine the most appropriate sequence of machines in the cell using the data contained in the from-to chart. (b) Construct the network diagram for the cell, showing where and how many parts enter and exit the cell. (c) Determine the utilization and production capacity of the machines in the cell as you have designed it. (d) Prepare a layout (top view) drawing of the GT cell, showing the machines, and any other pieces of equipment in the cell. (e) Write a one-page (or less) description of the cell, explaining the basis of your design and why the cell is arranged as it is.

Performance Metrics in Cell Operations

- 18.11 (A)** A family of three parts is processed through a group-technology cell consisting of two machines. The following table lists production quantities (Q_j), production times ($T_{p_{ij}}$), and machine fractions for each family member (f_{ij}). Assume the nonoperation times (T_{no}) are all equal to 20 min per machine. Determine (a) average hourly production rate for the cell,

(b) utilization of each machine and average utilization of the cell, (c) manufacturing lead time, and (d) work-in-process. A spreadsheet calculator is recommended for this problem.

Part	Q_j	Machine 1		Machine 2	
		T_{p1} (min)	f_{1j}	T_{p2} (min)	f_{2j}
A	1	4.00	0.400	3.00	0.300
B	1	3.00	0.200	6.00	0.400
C	1	5.00	0.250	6.00	0.300

- 18.12** A group-technology cell has three machines and is used to process a family of four parts. The table below lists production quantities (Q_j), production times (T_{pij}), and machine fractions for each family member (f_{ij}). Assume the nonoperation times (T_{no}) are all the same at 40 min per machine. Determine (a) average hourly production rate for the cell, (b) utilization of each machine and average utilization of the cell, (c) manufacturing lead time, and (d) work-in-process. A spreadsheet calculator is recommended for this problem.

Part	Q_j	Machine 1		Machine 2		Machine 3	
		T_{p1} (min)	f_{1j}	T_{p2} (min)	f_{2j}	T_{p3} (min)	f_{3j}
A	1	4.0	0.4	3.0	0.3	2.0	0.2
B	1	2.0	0.2	4.0	0.4	1.8	0.18
C	1	5.0	0.1	6.0	0.12	2.5	0.05
D	1	4.0	0.3	2.0	0.15	3.33	0.25

- 18.13** Three machines are used in a group-technology cell to process a family of five parts. The table below lists production quantities (Q_j), production times (T_{pij}), and machine fractions for each family member (f_{ij}). Part E requires a changeover time of 5 min on each machine so it is produced in batches of 5 parts. Nonoperation times (T_{no}) are the same for all parts and machines: 25 min per machine. Determine (a) average hourly production rate for the cell, (b) utilization of each machine and average utilization of the cell, (c) manufacturing lead time, and (d) work-in-process. A spreadsheet calculator is recommended for this problem.

Part	Q_j	Machine 1		Machine 2		Machine 3	
		T_{p1} (min)	f_{1j}	T_{p2} (min)	f_{2j}	T_{p3} (min)	f_{3j}
A	1	1.50	0.200	2.25	0.300	1.50	0.200
B	1	2.50	0.200	4.00	0.320	2.25	0.180
C	1	4.0	0.100	2.00	0.050	1.00	0.025
D	1	1.75	0.100	2.10	0.120	3.50	0.200
E	5	3.00	0.250	2.52	0.210	2.40	0.200

- 18.14** A group-technology cell consists of four machines and processes a family of six part styles in equal quantities. During 8 hr, a total of 180 parts are produced, and each part spends 32 min in the cell on average, either being processed by one of the machines or waiting to be processed. All six part styles are processed through all four machines in the same order. One machine is the key machine which is utilized 100%. The other three machines have utilizations ranging between 60% and 85%. Five of the parts in the family require no changeover time on any machine, but the sixth part requires a changeover time of 4 min on the key machine. The six parts are currently produced consecutively, so a disproportionate

amount of the time of the key machine is spent processing the sixth part. (a) What is the average work-in-process (number of parts) in the cell at any moment? A proposal has been made to process the sixth part in batches, so the 4-min changeover time would be spread over the number of units in the batch. How many hours would be required to process the same 180 parts if the sixth part were processed in batch sizes of (b) 10 parts and (c) 30 parts?

18.15 A GT assembly cell consisting of five workstations and five workers produces eight similar subassemblies at an average rate of 16 units/hr. All subassemblies go through all five stations. The number of parts in the cell at any moment is twice the number of workers. The lead worker in the cell claims that the time a given work unit spends in the cell is less than 20 min. His reasoning is that with five workers each producing at 16 units/hr, the average time at each station = $60/16 = 3.75$ min. With five stations, the total time is $5 \times 3.75 = 18.75$ min. Is he correct or is the time a given work unit spends in the cell more than what he claims?

APPENDIX 18A: OPITZ PARTS CLASSIFICATION AND CODING SYSTEM

The Opitz system is of interest because it was one of the first published classification and coding schemes for mechanical parts [28], [29] (Historical Note 18.1). It was developed by H. Opitz of the University of Aachen in Germany and represents one of the pioneering efforts in group technology. It is probably the best known of the parts classification and coding systems. It is intended for machined parts. The Opitz coding scheme uses the following digit sequence:

12345 6789 ABCD

The basic code consists of nine digits, which can be extended by adding four more digits. The first nine are intended to convey both design and manufacturing data. The interpretation of the first nine digits is defined in Figure 18A.1. The first five digits, 12345, are called the *form code*. This describes the primary design attributes of the part, such

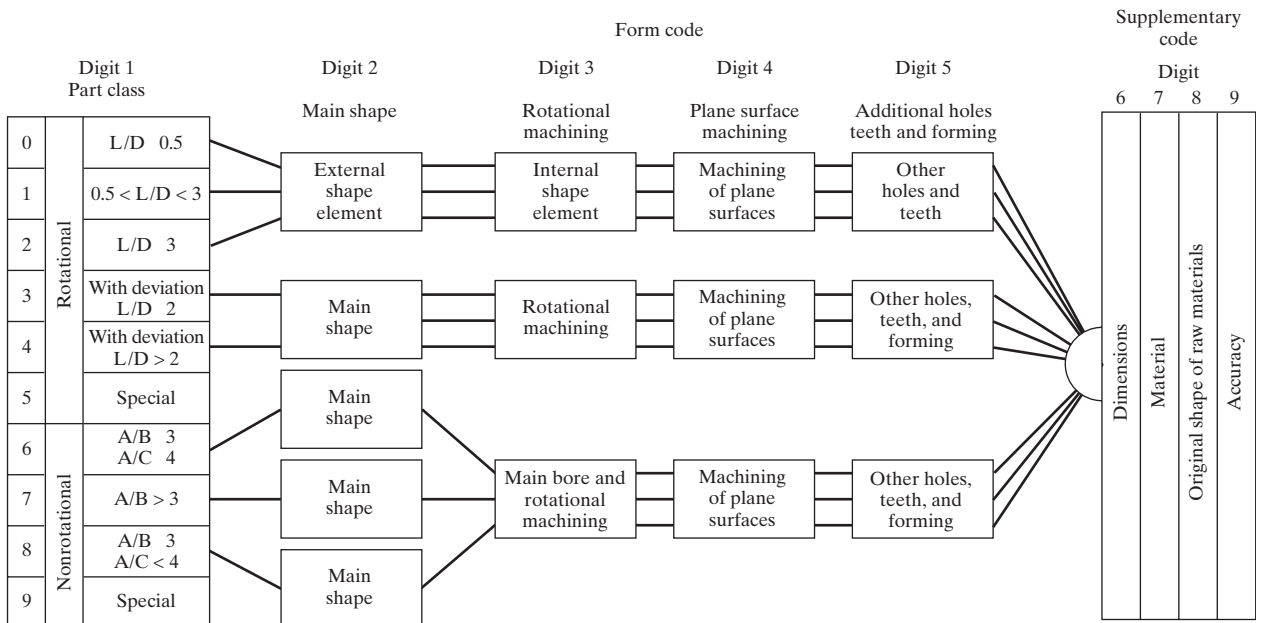


Figure 18A.1 Basic structure of the Opitz system of parts classification and coding.

as external shape (e.g., rotational versus rectangular) and machined features (holes, threads, gear teeth, etc.). The next four digits, 6789, constitute the *supplementary code*, which indicates some of the attributes that would be useful in manufacturing (e.g., dimensions, work material, starting shape, and accuracy). The extra four digits, ABCD, are referred to as the *secondary code* and are intended to identify the production operation type and sequence. The secondary code can be designed by the user firm to serve its own particular needs.

The complete coding system is too complex to cover here; Opitz wrote an entire book on his system [28]. However, to get an idea of how it works, consider the form code consisting of the first five digits as defined in Figure 18A.1. The first digit identifies whether the part is rotational or nonrotational. It also describes the general shape and proportions of the part. The coverage here is limited to rotational parts that do not possess any unusual features, those with first digit values of 0, 1, or 2. For this class of work parts, the coding of the first five digits is defined in Figure 18A.2. Consider the following example to demonstrate the coding of a given part.

Digit 1		Digit 2		Digit 3		Digit 4		Digit 5							
Part class		External shape, external shape elements		Internal shape, internal shape elements		Plane surface machining		Auxiliary holes and gear teeth							
Rotational parts	0	L/D 0.5		0		Smooth, no shape elements		0		No auxiliary hole					
	1	0.5 < L/D < 3		1		No shape elements		1		Surface plane and/or curved in one direction, external		1		Axial, not on pitch circle diameter	
	2	L/D 3		2		Thread		2		External plane surface related by graduation around the circle		2		Axial on pitch circle diameter	
	3			3		Functional groove		3		External groove and/or slot		3		Radial, not on pitch circle diameter	
	4			4		No shape elements		4		External spline (polygon)		4		Axial and/or radial and/or other direction	
	5			5		Thread		5		External plane surface and/or slot, external spline		5		Axial and/or radial on PCD and/or other directions	
Nonrotational parts	6			6		Functional groove		6		Internal plane surface and/or slot		6		Spur gear teeth	
	7			7		Functional cone		7		Internal spline (polygon)		7		Bevel gear teeth	
	8			8		Operating thread		8		Internal and external polygon, groove and/or slot		8		Other gear teeth	
	9			9		All others		9		All others		9		All others	

Figure 18A.2 Form code (digits 1 through 5) for rotational parts in the Opitz coding system. The first digit of the code is limited to values 0, 1, or 2.

EXAMPLE 18A.1 Opitz Part Coding System

Given the rotational part design in Figure 18A.3, determine the form code in the Opitz classification and coding system.

Solution: With reference to Figure 18A.2, the five-digit code is developed as follows:

Length-to-diameter ratio, $L/D = 1.5$	Digit 1 = 1
External shape: stepped on both ends with screw thread on one end	Digit 2 = 5
Internal shape: part contains a through-hole	Digit 3 = 1
Plane surface machining: none	Digit 4 = 0
Auxiliary holes, gear teeth, etc.: none	Digit 5 = 0

The form code in the Opitz system is 15100.

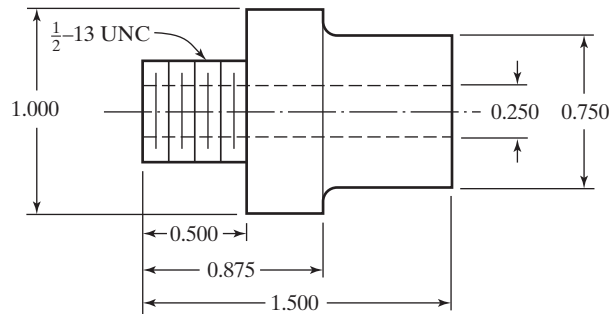


Figure 18A.3 Part design for Example 18A.1.

Flexible Manufacturing Cells and Systems

CHAPTER CONTENTS

- 19.1 What is a Flexible Manufacturing System?
 - 19.1.1 Flexibility
 - 19.1.2 Types of FMS
- 19.2 FMC/FMS Components
 - 19.2.1 Workstations
 - 19.2.2 Material Handling and Storage System
 - 19.2.3 Computer Control System
- 19.3 FMS Application Considerations
 - 19.3.1 FMS Applications
 - 19.3.2 FMS Planning and Implementation Issues
 - 19.3.3 FMS Benefits
- 19.4 Analysis of Flexible Manufacturing Systems
 - 19.4.1 Bottleneck Model
 - 19.4.2 Extended Bottleneck Model
 - 19.4.3 Sizing the FMS
 - 19.4.4 What the Equations Tell Us
- 19.5 Alternative Approaches to Flexible Manufacturing
 - 19.5.1 Mass Customization
 - 19.5.2 Reconfigurable Manufacturing Systems
 - 19.5.3 Agile Manufacturing

The flexible manufacturing system (FMS) is a type of machine cell to implement cellular manufacturing. It is the most automated and technologically sophisticated of the group-technology (GT) cells. An FMS typically possesses multiple automated stations

and is capable of variable routings among stations. Its flexibility allows it to cope with soft product variety (Section 2.3). An FMS integrates into one highly automated manufacturing system many of the concepts and technologies discussed in previous chapters, including flexible automation (Section 1.2.1), CNC machines (Chapter 7), distributed computer control (Section 5.3.3), automated material handling and storage (Chapters 10 and 11), and group technology (Chapter 18). The concept for flexible manufacturing systems originated in Britain in the early 1960s (Historical Note 19.1). The first FMS installations in the United States occurred around 1967. These initial systems performed machining operations on families of parts using NC machine tools.

FMS technology can be applied in production situations similar to those identified for cellular manufacturing:

- Presently the plant either produces parts in batches or uses manned GT cells, and management wants to automate.
- It is possible to group a portion of the parts made in the plant into part families, whose similarities permit them to be processed on the machines in the flexible manufacturing system. Part similarities can be interpreted to mean that (1) the parts belong to a common product and/or (2) the parts possess similar geometries. In either case, the processing requirements of the parts must be sufficiently similar to allow them to be made on the FMS.

Historical Note 19.1 Flexible Manufacturing Systems [21], [23], [24]

The flexible manufacturing system was first conceptualized for machining, and it required the prior development of numerical control. The concept is credited to David Williamson, a British engineer employed by Molins during the mid 1960s. Molins applied for a patent for the invention that was granted in 1965. The concept was called *System 24* because it was believed that the group of machine tools comprising the system could operate 24 hr a day, 16 hr of which would be unattended by human workers. The original concept included computer control of the NC machines, production of a variety of parts, and use of tool magazines that could hold various tools for different machining operations.

One of the first flexible manufacturing systems to be installed in the United States was a machining system at Ingersoll-Rand Company in Roanoke, Virginia, in the late 1960s by Sundstrand, a machine tool builder. Other systems introduced soon after included a Kearney & Trecker FMS at Caterpillar Tractor and Cincinnati Milacron's "Variable Mission System." Most of the early FMS installations in the United States were in large companies, such as Ingersoll-Rand, Caterpillar, John Deere, and General Electric Company. These large companies had the financial resources to make the major investments necessary, and they also possessed the prerequisite experience in NC machine tools, computer systems, and manufacturing systems to pioneer the new FMS technology. Flexible manufacturing systems were also installed in other countries around the world. In the Federal Republic of Germany (West Germany, now Germany), a manufacturing system was developed in 1969 by Heidleberger Druckmaschinen in cooperation with the University of Stuttgart. In the USSR (now Russia), a flexible manufacturing system was demonstrated at the 1972 Stanki Exhibition in Moscow. The first Japanese FMS was installed around the same time by Fuji Xerox. By around 1985, the number of FMS installations throughout the world had increased to about 300. About 20–25% of these were located in the United States. In recent years, there has been an emphasis on smaller, less expensive flexible manufacturing cells.

- The parts or products made by the facility are in the mid-volume, mid-variety production range. The appropriate production volume range is 5,000–75,000 parts per year [14]. If annual production is below this range, an FMS is likely to be an expensive alternative. If production volume is above this range, then a more specialized production system should probably be considered.

The differences between installing a flexible manufacturing system and implementing a manually operated machine cell are the following: (1) the FMS requires a significantly greater capital investment because new equipment is being installed, whereas the manually operated machine cell might only require existing equipment to be relocated, and (2) the FMS is technologically more sophisticated for the human resources who must make it work. However, the potential benefits are substantial. They include increased machine utilization, reduced factory floor space, greater responsiveness to change, lower inventory and manufacturing lead times, and higher labor productivity. Section 19.3.3 elaborates on these benefits.

This chapter addresses the following questions: What makes an FMS flexible? What are their components and applications? And how is FMS technology implemented? In Section 19.4, a mathematical model is presented for assessing the performance of an FMS.

19.1 WHAT IS A FLEXIBLE MANUFACTURING SYSTEM?

A flexible manufacturing system (FMS) is a highly automated GT machine cell, consisting of one or more processing stations (usually CNC machine tools), interconnected by an automated material handling and storage system and controlled by a distributed computer system. The reason the FMS is called flexible is that it is capable of processing a variety of different part styles simultaneously at the various workstations, and the mix of part styles and quantities of production can be adjusted in response to changing demand patterns.

An FMS relies on the principles of group technology. No manufacturing system can be completely flexible. There are limits to the range of parts or products that can be made in an FMS. Accordingly, a flexible manufacturing system is designed to produce parts (or products) within a defined range of styles, sizes, and processes. In other words, an FMS is capable of producing a single part family or a limited range of part families.

A more appropriate term for FMS would be *flexible automated manufacturing system*. The use of the word “automated” would distinguish this type of production technology from other manufacturing systems that are flexible but not automated, such as a manned GT machine cell. The word “flexible” would distinguish it from other manufacturing systems that are highly automated but not flexible, such as a conventional transfer line.¹

19.1.1 Flexibility

The issue of manufacturing system flexibility was discussed in Section 13.2.4, and the three capabilities that a manufacturing system must possess in order to be flexible were identified as (1) the ability to identify the different incoming part or product styles processed by the system, (2) quick changeover of operating instructions, and (3) quick changeover of physical

¹Notwithstanding the appropriateness of the term *flexible automated manufacturing system*, the current terminology (*flexible manufacturing system*) is well established in the commercial and research literature.

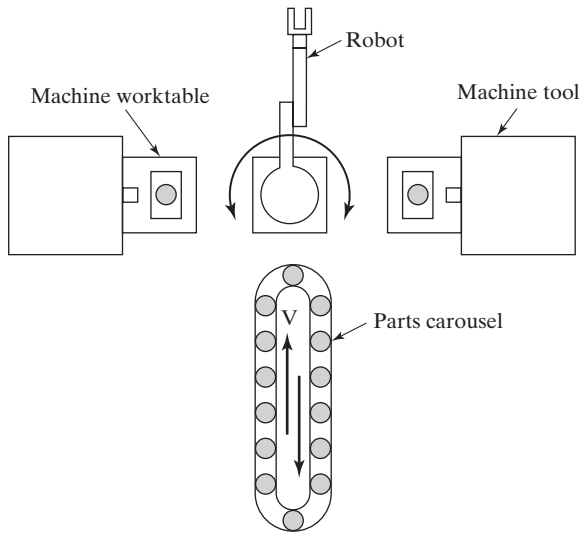


Figure 19.1 Automated manufacturing cell with two machine tools and robot. Is it a flexible cell?

setup. Flexibility is an attribute that applies to both manual and automated systems. In manual systems, the human workers are often the enablers of the system's flexibility.

To develop the concept of flexibility in an automated manufacturing system, consider a machine cell consisting of two CNC machine tools that are loaded and unloaded by an industrial robot from a parts storage system, perhaps in the arrangement depicted in Figure 19.1. The cell operates unattended for extended periods of time. Periodically, a worker must unload completed parts from the storage system and replace them with new work parts. By any definition, this is an automated manufacturing cell, but is it a flexible manufacturing cell? One might argue yes, it is flexible because the cell consists of CNC machine tools, and CNC machines are flexible because they can be programmed to machine different part configurations. However, if the cell only operates in a batch mode, in which the same part style is produced by both machines in lots of several hundred units, then this does not qualify as flexible manufacturing.

To qualify as being flexible, an automated manufacturing system should satisfy the following four tests of flexibility:²

1. *Part-variety test.* Can the system process different part or product styles in a mixed-model (non-batch) mode?
2. *Schedule-change test.* Can the system readily accept changes in production schedule, that is, changes in part mix and/or production quantities?
3. *Error-recovery test.* Can the system recover gracefully from equipment malfunctions and breakdowns, so that production is not completely disrupted?

²These four tests, as they are called here, are sometimes referred to as types or dimensions of flexibility [3], [7], [21], and [25]. The part-variety test is called *machine flexibility* or *production flexibility*. The schedule-change test is called *mix flexibility* or *volume flexibility*. The error-recovery test is called *routing flexibility*, and the new-part test is called *product flexibility*. Other names for flexibility have been developed by other authors and researchers.

4. *New-part test.* Can new part designs be introduced into the existing part mix with relative ease if their features qualify them as being members of the part family for which the system was designed? Also, can design changes be made in existing parts without undue challenge to the system?

If the answer to all of these questions is “yes” for a given manufacturing system, then the system is flexible. The most important tests are (1) and (2). Test (3) is applicable to multi-machine systems but in single-machine systems when the one machine breaks down it is difficult to avoid a halt in production. Test (4) would seem to not apply to systems designed for a part family whose members are all known in advance. However, such a system may have to deal with design changes to members of that existing part family.

Getting back to the robotic work cell, the four tests of flexibility are satisfied if the cell (1) can machine different part configurations in a mix rather than in batches; (2) permits changes in production schedule (changes in part mix); (3) is capable of continuing to operate even though one machine experiences a breakdown (e.g., while repairs are being made on the broken machine, its work is temporarily reassigned to the other machine), and (4) can accommodate new part designs if the NC part programs are written off-line and then downloaded to the system for execution. The fourth capability requires the new part to be within the part family intended for the FMS, so that the tooling used by the CNC machines as well as the end effector of the robot are compatible with the new part design.

19.1.2 Types of FMS

Each FMS is designed for a specific application, that is, a specific family of parts and processes. Therefore, each FMS is custom-engineered and unique. Given these circumstances, one would expect to find a great variety of system designs to satisfy a wide variety of application requirements.

Flexible manufacturing systems can be distinguished according to the kinds of operations they perform: processing operations or assembly operations. An FMS is usually designed to perform one or the other but rarely both. A difference that is applicable to machining systems is whether the system will process rotational parts or nonrotational parts. Flexible machining systems with multiple stations that process rotational parts are less common than systems that process nonrotational parts. Two other ways to classify flexible manufacturing systems are by number of machines and level of flexibility.

Number of Machines. Flexible manufacturing systems have a certain number of processing machines. The following are typical categories: (1) single-machine cell, (2) flexible manufacturing cell, and (3) flexible manufacturing system.

A *single-machine cell* consists of one CNC machining center combined with a parts-storage system for unattended operation, as in Figure 19.2. Completed parts are periodically unloaded from the parts-storage unit, and raw work parts are loaded into it. The cell can be designed to operate in a batch mode, a flexible mode, or a combination of the two. When operated in a batch mode, the machine processes parts of a single style in specified lot sizes and is then changed over to process a batch of the next part style. When operated in a flexible mode, the system satisfies three of the four flexibility tests. It is capable of (1) processing different part styles, (2) responding to changes in production schedule, and (4) accepting new part introductions. Test (3), error recovery, cannot be satisfied because if the single machine breaks down, production stops.

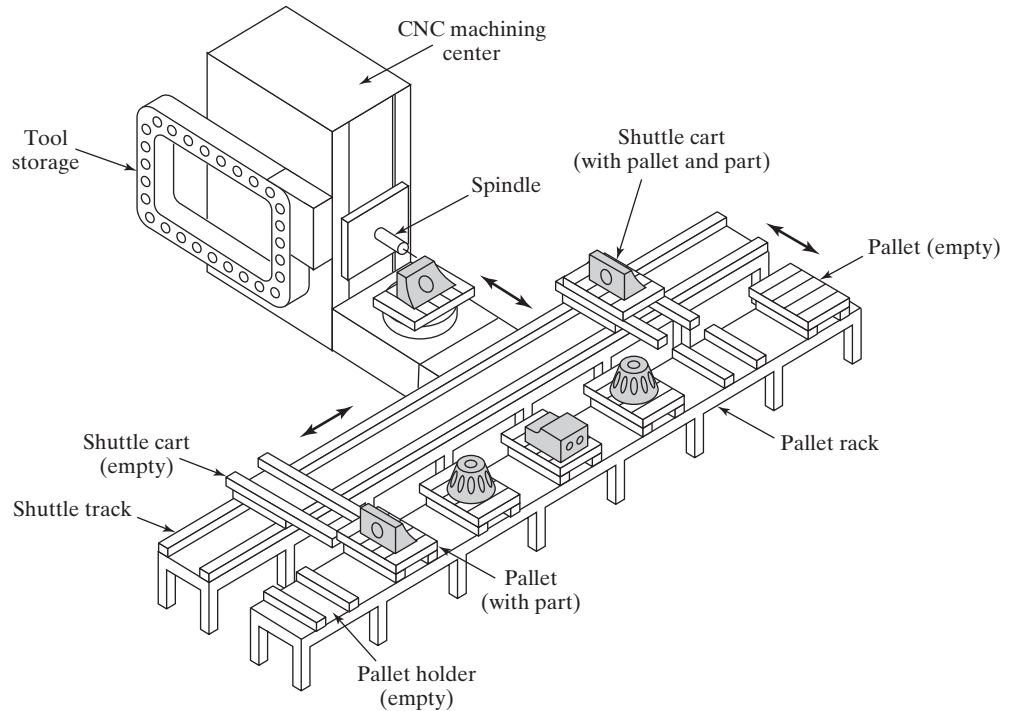


Figure 19.2 Single-machine cell consisting of one CNC machining center and parts-storage unit.

A *flexible manufacturing cell* (FMC) consists of two or three processing workstations (typically CNC machining centers or turning centers) plus a parts-handling system. The parts-handling system is connected to a load/unload station. The handling system usually includes a limited parts-storage capacity. One possible FMC is illustrated in Figure 19.3. A flexible manufacturing cell satisfies the four flexibility tests discussed previously.

A *flexible manufacturing system* (FMS) has four or more processing stations connected mechanically by a common parts-handling system and electronically by a distributed computer system. Thus, an important distinction between an FMS and an FMC is the number of machines: an FMC has two or three machines, while an FMS has four or more.³ There are usually other differences as well. One is that the FMS generally includes nonprocessing workstations that support production but do not directly participate in it. These other stations include part/pallet washing stations, inspection stations, and so on. Another difference is that the computer control system of an FMS is generally more sophisticated, often including functions not always found in a cell, such as diagnostics and tool monitoring. These additional functions are needed more in an FMS than in an FMC because the FMS is more complex.

³The dividing line that separates an FMS from an FMC is defined here to be four machines. It should be noted that not all practitioners would agree with that dividing line; some might prefer a higher value, while others would prefer a lower value. Also, the distinction between cell and system seems to apply only to flexible manufacturing systems that are automated. The manually operated counterparts of these systems, discussed in Chapter 18, seem to always be referred to as cells, no matter how many workstations are included.

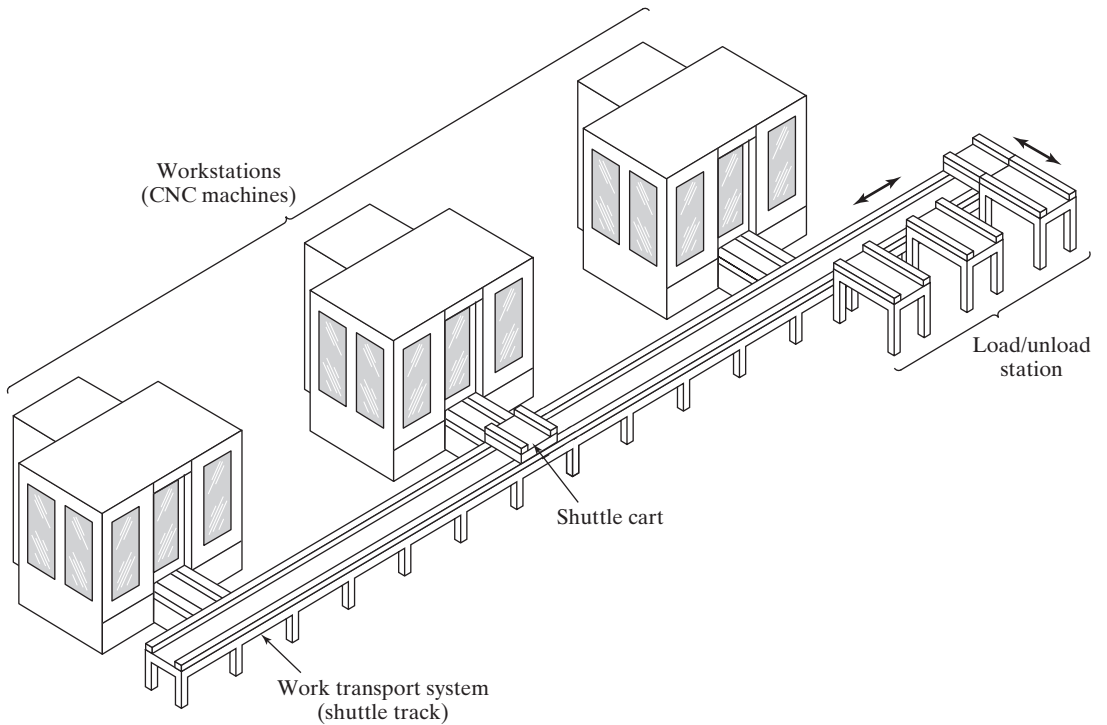


Figure 19.3 A flexible manufacturing cell consisting of three identical processing stations (CNC machining centers), a load/unload station, and a parts-handling system.

Table 19.1 compares the three systems in terms of the four flexibility tests.

Level of Flexibility. Another way to classify flexible manufacturing systems is according to the level of flexibility designed into the system. Two categories of flexibility are discussed here: (1) dedicated and (2) random-order.

TABLE 19.1 Four Tests of Flexibility Applied to the Three Types of Manufacturing Cells and Systems

System Type	Four Tests of Flexibility			
	1. Part Variety	2. Schedule Change	3. Error Recovery	4. New Part
Single-machine cell	Yes, but processing is sequential, not simultaneous.	Yes	Limited recovery due to only one machine.	Yes
Flexible manufacturing cell (FMC)	Yes, simultaneous production of different parts.	Yes	Error recovery limited by fewer machines than FMS.	Yes
Flexible manufacturing system (FMS)	Yes, simultaneous production of different parts.	Yes	Machine redundancy minimizes effect of machine breakdowns.	Yes

A *dedicated FMS* is designed to produce a limited variety of part styles, and the complete population of parts is known in advance. The part family may be based on product commonality rather than geometric similarity. The product design is considered stable, so the system can be designed with a certain amount of process specialization to make the operations more efficient. Instead of being general purpose, the machines can be designed for the specific processes required to make the limited part family, thus increasing the production rate of the system. In some instances, the machine sequence may be identical or nearly identical for all parts processed, so a transfer line may be appropriate, in which the workstations possess the necessary flexibility to process the different parts in the mix. Indeed, the term *flexible transfer line* is sometimes used for this case (Section 16.2.1).

A *random-order FMS* is more appropriate when the following circumstances apply: (1) the part family is large, (2) there are substantial variations in part configurations, (3) new part designs will be introduced into the system and engineering changes will be made to parts currently produced, and (4) the production schedule is subject to change from day-to-day. To accommodate these variations, the random-order FMS must be more flexible than the dedicated FMS. It is equipped with general-purpose machines to deal with the product variations and is capable of processing parts in various sequences (random order). A more sophisticated computer control system is required for this FMS type.

The trade-off between flexibility and productivity can be seen in these two system types. The dedicated FMS is less flexible but capable of higher production rates. The random-order FMS is more flexible but at the cost of lower production rates. Table 19.2 presents a comparison of the dedicated FMS and random-order FMS in terms of the four flexibility tests.

19.2 FMC/FMS COMPONENTS

The three basic components of a flexible manufacturing system are (1) workstations, (2) material handling and storage system, and (3) computer control system. In addition, even though an FMS is highly automated, people are required to manage and operate the system. Functions typically performed by humans include (1) loading raw work parts into the system, (2) unloading finished parts (or assemblies) from the system, (3) changing and setting tools, (4) performing equipment maintenance and repair, (5) performing NC part programming, (6) programming and operating the computer system, and (7) managing the system.

TABLE 19.2 Four Tests of Flexibility Applied to Dedicated and Random-Order Systems

Four Tests of Flexibility				
System Type	1. Part Variety	2. Schedule Change	3. Error Recovery	4. New Part
Dedicated FMS	Limited. All parts are known in advance.	Limited changes can be tolerated.	Usually limited by sequential processes.	No. New part introductions are difficult.
Random-order FMS	Yes. Substantial part variations are possible.	Frequent and significant changes are possible.	Machine redundancy minimizes effect of machine breakdowns.	Yes. System is designed for new part designs.

19.2.1 Workstations

The processing or assembly equipment used in an FMC or FMS depends on the type of work accomplished by the system. In one designed for machining operations, the principal types of processing station are CNC machine tools. However, the FMS concept is applicable to other processes as well. Following are the types of workstations typically found in an FMS.

Load/Unload Stations. The load/unload station is the physical interface between the FMS and the rest of the factory. It is where raw work parts enter the system and finished parts exit the system. Loading and unloading can be accomplished either manually (the most common method) or by automated handling systems. If manually performed, the load/unload station should be ergonomically designed to permit convenient and safe movement of work parts. Mechanized cranes and other handling devices are installed to assist the operator with parts that are too heavy to lift by hand. A certain level of cleanliness must be maintained at the workplace, and air hoses or other washing facilities are used to flush away chips and ensure clean mounting and locating points. The station is often raised slightly above floor level using an open-grid platform to permit chips and cutting fluid to drop through the openings for subsequent recycling or disposal.

The load/unload station includes a data entry unit and monitor for communication between the operator and the computer system. Through this system, the operator receives instructions regarding which part to load onto the next pallet to adhere to the production schedule. When different pallets are required for different parts, the correct pallet must be supplied to the station. When modular fixturing is used, the correct fixture must be specified and the required components and tools must be available at the workstation to build it. When the part loading procedure has been completed, the handling system must launch the pallet into the system. These conditions require communication between the computer system and the operator(s) at the load/unload station.

Machining Stations. The most common applications of flexible manufacturing systems are machining operations. The workstations used in these systems are therefore predominantly CNC machine tools. Most common are CNC machining centers, which possess features that make them compatible with the FMS, including automatic tool changing and tool storage, use of palletized work parts, CNC, and capacity for distributed numerical control (Section 7.2.3). Machining centers are available with automatic pallet changers that can be readily interfaced with the FMS part-handling system. Machining centers are generally used for nonrotational parts. For rotational parts, turning centers are used; and for parts that are mostly rotational but require multi-tooth rotational cutters (milling and drilling), mill-turn centers and multitasking machines can be used. These equipment types are described in Section 14.2.3.

Assembly. Some flexible manufacturing systems are designed to perform assembly operations. Flexible automated assembly systems are gradually replacing manual labor in the assembly of products typically made in batches. Industrial robots are often used as the automated workstations in these flexible assembly systems. They can be programmed to perform tasks with variations in sequence and motion pattern to accommodate the different product styles assembled in the system. Other examples of flexible assembly workstations are the programmable component placement machines widely used in electronics assembly.

Other Stations and Equipment. Inspection can be incorporated into a flexible manufacturing system, either by including an inspection operation at a processing workstation or by including a station specifically designed for inspection. Coordinate measuring machines (Section 22.3), special inspection probes that can be used in a machine tool spindle (Section 22.3.4), and machine vision (Section 22.5) are three possible technologies for performing inspection on an FMS. Inspection is particularly important in flexible assembly systems to ensure that components have been properly added at the workstations. The topic of automated inspection is examined in more detail in Chapter 21.

In addition to the above, other operations and functions are often accomplished on a flexible manufacturing system. These include cleaning parts and/or pallet fixtures, central coolant delivery systems for the entire FMS, and centralized chip-removal systems often installed below floor level.

19.2.2 Material Handling and Storage System

The second major component of an FMS is its material handling and storage system. This section covers the functions of the handling system, types of handling equipment used in an FMS, and types of FMS layout.

Functions of the Handling System. The material handling and storage system in a flexible manufacturing system performs the following functions:

- *Random independent movement of work parts between stations.* Parts must be moved from any machine in the system to any other machine to provide various routing alternatives for different parts and to make machine substitutions when certain stations are busy or broken down.
- *Handling a variety of work part configurations.* For nonrotational parts, this is usually accomplished by using modular pallet fixtures in the handling system. The fixture is located on the top face of the pallet and is designed to accommodate a variety of part styles by means of common components, quick-change features, and other devices that permit a rapid changeover for a given part. The base of the pallet is designed for the material handling system. For rotational parts, industrial robots are often used to load and unload turning machines and to move parts between stations.
- *Temporary storage.* The number of parts in the FMS will typically exceed the number of parts being processed at any moment. Thus, each station has a small queue of parts, perhaps only one part, waiting to be processed; this helps to maintain high machine utilization.
- *Convenient access for loading and unloading work parts.* The handling system must include locations for load/unload stations.
- *Compatibility with computer control.* The handling system must be under the direct control of the computer system which directs it to the various workstations, load/unload stations, and storage areas.

Material Handling Equipment. The types of material handling systems used to transfer parts between stations in an FMS include a variety of conventional material transport equipment (Chapter 10), in-line transfer mechanisms (Section 16.1.1), and industrial robots (Chapter 8). The material handling function in an FMS is often shared between two systems: (1) a primary handling system and (2) a secondary handling system.

The primary handling system establishes the basic layout of the FMS and is responsible for moving parts between stations.

The secondary handling system consists of transfer devices, automatic pallet changers, and similar mechanisms located at the FMS workstations. The function of the secondary handling system is to transfer work from the primary system to the machine tool or other processing station and to position the parts with sufficient accuracy to perform the processing or assembly operation. Other purposes served by the secondary handling system include (1) reorientation of the work part if necessary to present the surface that is to be processed, and (2) buffer storage of parts to minimize work-change time and maximize station utilization. In some FMS installations, the positioning and registration requirements at the individual workstations are satisfied by the primary work-handling system. In these cases, there is no secondary handling system.

FMS Layout Configurations. The material handling system establishes the FMS layout. Most layout configurations found in today's flexible manufacturing systems can be classified into one of four categories: (1) in-line layout, (2) loop layout, (3) open field layout, and (4) robot-centered cell. The types of material handling equipment utilized in these four layouts are summarized in Table 19.3.

In the in-line layout, the machines and handling system are arranged in a straight line. In its simplest form, the parts progress from one workstation to the next in a well-defined sequence with work always moving in one direction and no back-flow, as in Figure 19.4(a). The operation of this type of system is similar to a transfer line (Chapter 16), except that a variety of work parts are processed in the system. For in-line systems requiring greater routing flexibility, a linear transfer system that permits movement in two directions can be used. One possible arrangement is shown in Figure 19.4(b), in which a secondary work-handling system is located at each station to separate parts from the primary line. The secondary handling system provides temporary storage of parts at each station.

The in-line layout can be combined with an integrated parts-storage system, as in Figure 19.5. Depending on the capacity of the storage system, this arrangement can be used for "lights out" operation of the FMS, in which workers load parts into the system during the day shift, and the FMS operates unattended during the two overnight shifts. A single-machine manufacturing system with integrated storage is shown in Figure 14.3.

In the loop layout, the workstations are organized in a loop that is served by a parts-handling system in the same shape, as shown in Figure 19.6(a). Parts usually flow in one

TABLE 19.3 Material Handling Equipment Typically Used as the Primary Handling System for FMS Layouts

Layout Configuration	Typical Material Handling System
In-line layout	In-line transfer system (Section 16.1.1) Conveyor system (Section 10.2.4) Rail-guided vehicle system (Section 10.2.3) Overhead rail-guided vehicle system with robotic part handling
Loop layout	Conveyor system (Section 10.2.4) In-floor towline carts (Section 10.2.4)
Open field layout	Automated guided vehicle system (Section 10.2.2) In-floor towline carts (Section 10.2.4)
Robot-centered layout	Industrial robot (Chapter 8)

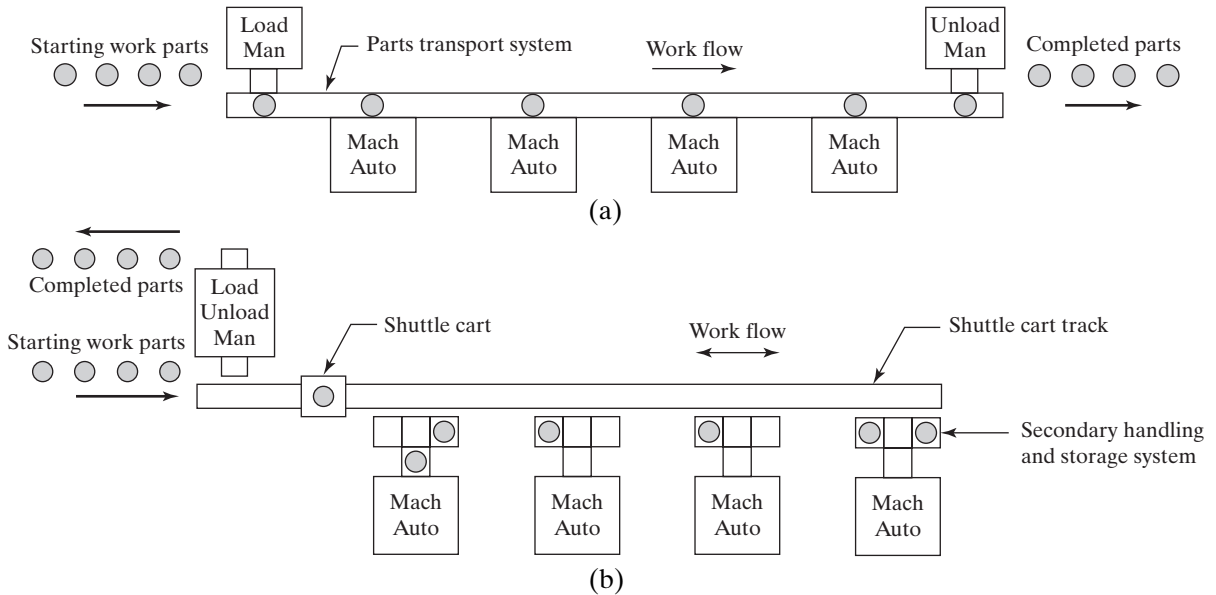


Figure 19.4 FMS in-line layouts: (a) one-direction flow similar to a transfer line, (b) linear transfer system with secondary parts-handling and storage system at each station to facilitate flow in two directions. Key: Load = parts loading station, Unload = parts unloading station, Mach = machining station, Man = manual station, Auto = automated station.

direction around the loop with the capability to stop and be transferred to any station. A secondary handling system is shown at each workstation to allow parts to move around the loop without obstruction. The load/unload station(s) are typically located at one end of the loop. An alternative form of loop layout is the rectangular layout. As shown in Figure 19.6(b), this arrangement might be used to return pallets to the starting position in a straight line machine arrangement.

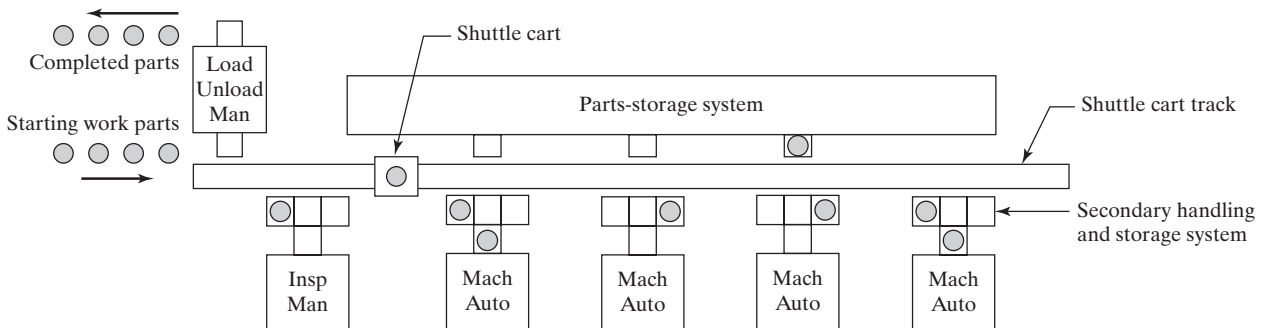


Figure 19.5 FMS in-line layout with integrated part-storage system. Key: Load = parts loading station, Unload = parts unloading station, Mach = machining station, Man = manual station, Auto = automated station.

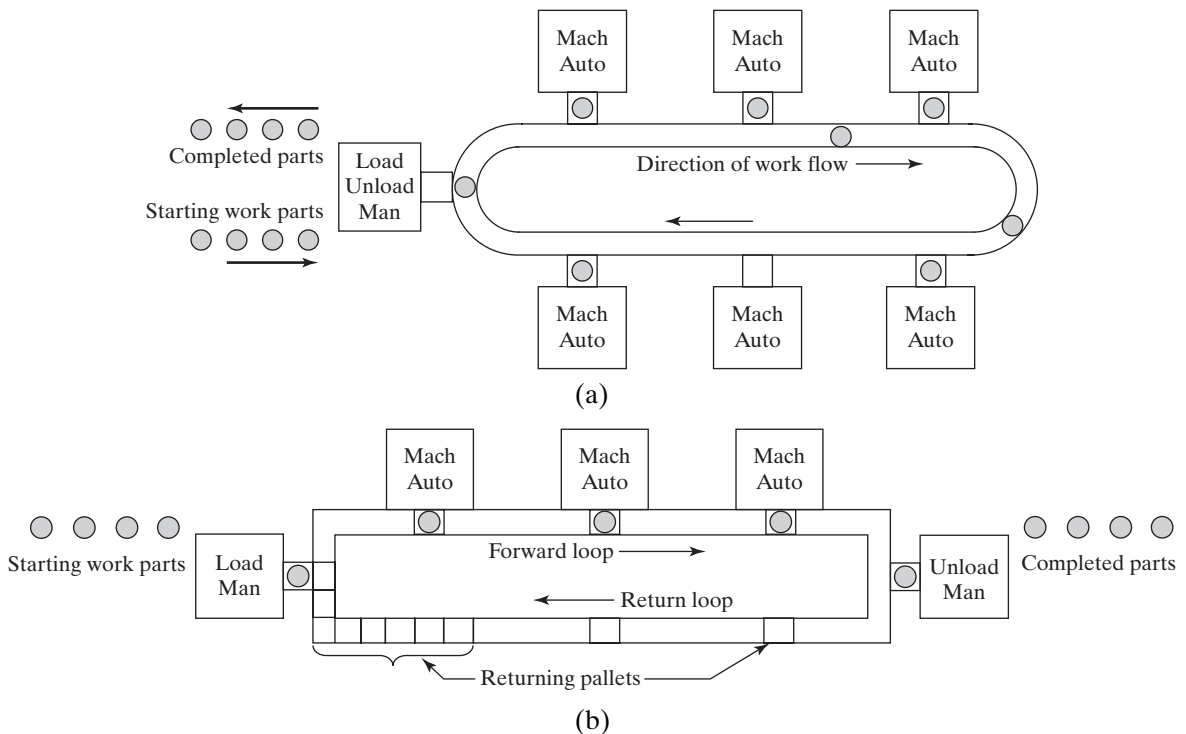


Figure 19.6 (a) FMS loop layout with secondary parts-handling system at each station to allow unobstructed flow on the loop, and (b) rectangular layout for recirculation of empty pallets to the parts loading station. Key: Load = parts loading station, Unload = parts unloading station, Mach = machining station, Man = manual station, Auto = automated station.

The open field layout consists of multiple loops and branches, and may include sidings as well, as illustrated in Figure 19.7. This layout type is generally appropriate for processing large families of parts. The number of different machine types may be limited, and parts are routed to different workstations depending on which one becomes available first.

The robot-centered layout (Figure 19.1) uses one or more robots as the material handling system. Industrial robots can be equipped with grippers that make them well suited for the handling of rotational parts, and robot-centered FMS layouts are often used to process cylindrical or disk-shaped parts. As an alternative to a robot-centered cell, a robot can be mounted on a floor-installed rail-guided vehicle or suspended from an overhead gantry crane to service multiple CNC turning centers in an in-line layout. The configuration would be similar to the layout shown in Figure 19.5, with a part-storage system on one side of the rail and CNC machines on the other side.

19.2.3 Computer Control System

The FMS includes a distributed computer control system (Section 5.3.3) that is interfaced to the workstations, material handling system, and other hardware components. A typical FMS computer system consists of a central computer and microcomputers controlling the individual machines and other components. The central computer coordinates the

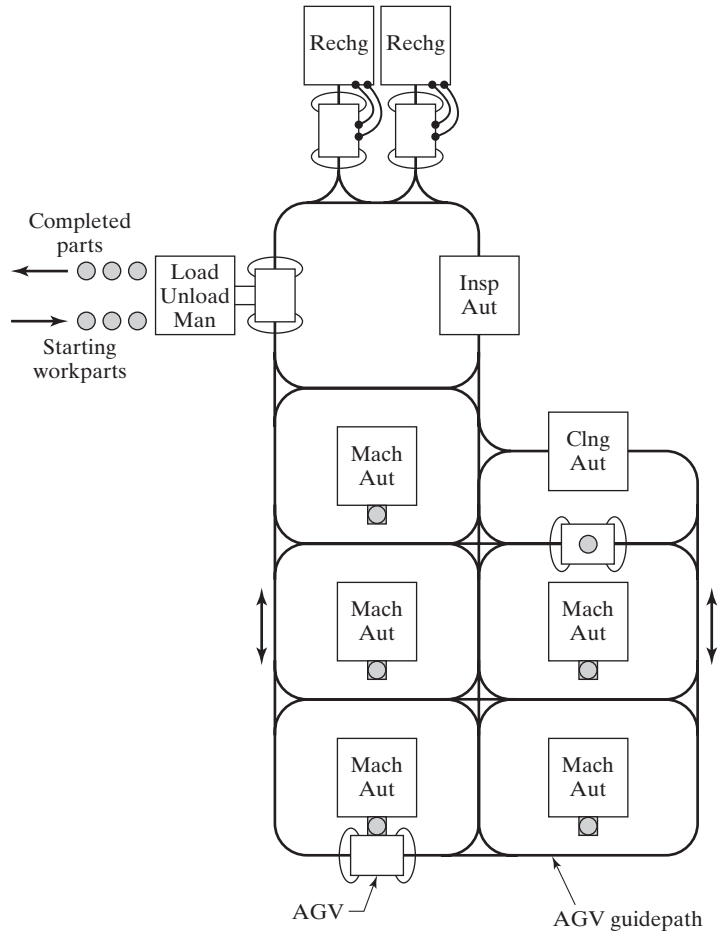


Figure 19.7 FMS open field layout. Key: Load = parts loading station, Unload = parts unloading station, Mach = machining station, Man = manual station, Aut = automated station, AGV = automated guided vehicle, Rechg = AGV battery recharging station, Cng = cleaning, Insp = inspection.

activities of the components to achieve smooth overall operation of the system. In addition, an uplink from the FMS to the corporate host computer is provided. Functions performed by the FMS computer control system can be divided into the following categories:

1. *Workstation control.* In a fully automated FMS, the individual processing or assembly stations generally operate under some form of computer control, such as CNC.
2. *Distribution of control instructions to workstations.* Part programs are stored in the central computer and downloaded to machines. Distributed numerical control (Section 7.2.3) is used for this purpose. The DNC system allows submission of new programs and editing of existing programs as needed.
3. *Production control.* The mix and rate at which the various parts are launched into the system must be managed, based on specified daily production rates for each part

type, numbers of raw work parts available, and number of applicable pallets.⁴ This is accomplished by routing an applicable pallet to the load/unload area and providing instructions to the operator to load the desired work part.

4. *Traffic control.* This refers to the management of the primary material handling system that moves parts between stations. Traffic control is accomplished by actuating switches at branches and merging points, stopping parts at machine tool transfer locations, and moving pallets to load/unload stations.
5. *Shuttle control.* This function is concerned with the operation and control of the secondary handling system at each workstation. This must be coordinated with traffic control and synchronized with the operation of the machine tool it serves.
6. *Tool control.* This is concerned with managing two aspects of the cutting tools: (a) tool location, which involves keeping track of the cutting tools at each workstation and making sure that the correct tools are available at each station for the parts that are to be routed to that station; and (b) tool life monitoring, which involves comparing the expected tool life for each cutting tool with the cumulative machining time of the tool, and alerting a worker when a tool replacement is needed.
7. *Performance monitoring and reporting.* The computer control system collects data on the operation and performance of the flexible manufacturing system. The data are periodically summarized, and reports on system performance are prepared for management. The collected data include proportion uptime and utilization of each machine, daily and weekly production quantities, and cutting tool status (tool locations and tool life monitoring). In addition to reports on these data, management can request instantaneous status information on the current condition of the system.
8. *Diagnostics.* This function is used to indicate the probable source of the problem when a malfunction occurs. It can also be used to plan preventive maintenance and identify impending system failures. The purpose of the diagnostics function is to reduce breakdowns and downtime, and to increase availability of the system.

19.3 FMS APPLICATION CONSIDERATIONS

This section covers several topics related to the application and implementation of FMS technology as well as the benefits that are associated with FMS installations.

19.3.1 FMS Applications

Flexible automation is applicable to a variety of manufacturing operations. FMS technology is most widely applied in machining operations. Other applications include sheet metal pressworking and assembly.

Flexible Machining Systems. Historically, most of the applications of flexible machining systems have been in milling and drilling operations (nonrotational parts), using CNC machining centers. FMS applications for turning (rotational parts) were much less common until recently, and the systems that are installed tend to consist of fewer machines.

⁴The term *applicable pallet* refers to a pallet that is fixtured to accept a work part of a given style or geometry.

For example, single-machine cells consisting of parts-storage units, parts-loading robots, and CNC turning centers are widely used today, although not always in a flexible mode.

Unlike rotational parts, nonrotational parts are often too heavy for a human operator to easily and quickly load into the machine tool. Accordingly, pallet fixtures were developed so that these parts could be loaded onto the pallet off-line using hoists, and then the part-on-pallet could be moved into position in front of the machine tool spindle. Nonrotational parts also tend to be more expensive than rotational parts, and the manufacturing lead times tend to be longer. These factors provide a strong incentive to produce them as efficiently as possible, using FMS technology.

EXAMPLE 19.1 Vought Aerospace FMS

A flexible manufacturing system was installed at Vought Aerospace in Dallas, Texas, by Cincinnati Milacron. The system is used to machine approximately 600 different aircraft components. The FMS consists of eight CNC horizontal machining centers plus inspection modules. Part handling is accomplished by an automated guided vehicle system (AGVS) using four vehicles. Loading and unloading of the system is done at two stations. These load/unload stations consist of storage carousels that permit parts to be stored on pallets for subsequent transfer to the machining stations by the AGVS. The system is capable of processing a sequence of single, one-of-a-kind parts in a continuous mode, so a complete set of components for one aircraft can be made efficiently without batching.

Other FMS Applications. Additional manufacturing operations in which efforts have been made to develop flexible automated systems include sheet metal stamping [38] and assembly [36]. The following example illustrates the development efforts in the pressworking area.

EXAMPLE 19.2 Flexible Fabricating System

The term *flexible fabricating system* (FFS) is sometimes used in connection with systems that perform sheet metal pressworking operations. One FFS concept was developed by Wiedemann Division of Cross & Trecker Company. The system was designed to unload sheet metal stock from the automated storage/retrieval system (AS/RS), move the stock by rail-guided cart to the CNC punch press operations, and then move the finished parts back to the AS/RS, all under computer control.

19.3.2 FMS Planning and Implementation Issues

Implementation of a flexible manufacturing system represents a major investment and commitment by the user company. It is important that the installation of the system be preceded by a thorough planning and design process, and that its operation be characterized by good management of all resources: machines, tools, pallets, parts, and people. The

coverage in this section is organized around (1) planning and design issues and (2) operations management issues.

Planning and Design Issues. The initial phase of FMS planning must consider the parts that will be produced by the system. The issues are similar to those in cellular manufacturing. They include the following:

- *Part family considerations.* Any flexible manufacturing system must be designed to process a limited range of part or product styles. In effect, the part family to be processed on the FMS must be defined. Part families can be based on product commonality as well as part similarity. The term *product commonality* refers to different components used on the same product. Many successful FMS installations are designed to accommodate part families defined by this criterion. This allows all of the components required to assemble a given product unit to be completed just prior to assembly.
- *Processing requirements.* The types of parts and their processing requirements determine the types of processing equipment that will be used in the system. In machining applications, nonrotational parts are produced by machining centers, milling machines, and similar machine tools; rotational parts are machined by turning centers and similar equipment.
- *Physical characteristics of the work parts.* The size and weight of the parts determine the sizes of the machines and the size of the material handling system that must be used.
- *Production volume.* Quantities to be produced by the system determine how many machines of each type will be required. Production volume is also a factor in selecting the most appropriate type of material handling equipment for the system.

After the part family, production volumes, and similar part issues have been decided, the design of the system is initiated. Important factors that must be specified in FMS design include:

- *Types of workstations.* The types of machines are determined by part processing requirements. Consideration of workstations must also include the load/unload station(s).
- *Variations in process routings and FMS layout.* If variations in process sequence are minimal, then an in-line flow is appropriate. For a system with higher product variety, a loop might be more suitable. If there is significant variation in the processing, an open field layout is appropriate.
- *Material handling system.* Selection of the material handling equipment and layout are closely related, because the type of handling system determines the layout. The material handling system includes both primary and secondary handling systems (Section 19.2.2).
- *Work-in-process and storage capacity.* The level of work-in-process (WIP) allowed in the FMS is an important variable in determining its utilization and efficiency. If the WIP level is too low, then stations may become starved for work, causing reduced utilization. If the WIP level is too high, then congestion may result. The WIP level should be planned, not just allowed to happen. Storage capacity in the FMS must be compatible with WIP level.

- *Tooling.* Tooling decisions include types and numbers of tools at each station, and the degree of duplication of tooling at different stations. Tool duplication at stations increases the flexibility with which parts can be routed through the system.
- *Pallet fixtures.* In machining systems for nonrotational parts, it is necessary to select the number of pallet fixtures used in the system. Factors influencing the decision include allowed WIP levels and differences in part style and size. Parts that differ too much in configuration and size require different fixturing.

Operations Management Issues. Once the FMS is installed, its resources must be optimized to meet production requirements and achieve operational objectives related to profit, quality, and customer satisfaction. The operational problems that must be addressed include the following [23], [25], [33], [34]:

- *Scheduling and dispatching.* Scheduling of production in the FMS is dictated by the master production schedule (Section 25.1). Dispatching is concerned with launching of parts into the system at the appropriate times. Several of the following problem areas are related to scheduling.
- *Machine loading.* This problem is concerned with deciding which parts will be processed on which machines and then allocating tooling and other resources to those machines to accomplish the required production schedule.
- *Part routing.* Routing decisions involve selecting the routes that should be followed by each part in the production mix in order to maximize use of workstation resources.
- *Part grouping.* Part types must be grouped for simultaneous production, given limitations on available tooling and other resources at workstations.
- *Tool management.* Managing the available tools involves making decisions on when to change tools and how to allocate tools to workstations in the system.
- *Pallet and fixture allocation.* This problem is concerned with the allocation of pallets and fixtures to the parts being produced in the system. Different parts require different fixtures, and before a given part style can be launched into the system, a fixture for that part must be made available. Modular fixtures (Section 18.3) are used to increase pallet and fixture interchangeability.

19.3.3 FMS Benefits

A number of benefits can be expected in successful FMS applications. The principal benefits are the following:

- *Increased machine utilization.* Flexible manufacturing systems achieve a higher average utilization than machines in a conventional job or batch machine shop. Reasons for this include (1) 24 hr per day operation, (2) automatic tool changing of machine tools, (3) automatic pallet changing at workstations, (4) queues of parts at stations, and (5) dynamic scheduling of production that compensates for irregularities.
- *Fewer machines required.* Because of higher machine utilization, fewer machines are required compared to a batch production plant of equivalent capacity.
- *Reduction in factory floor space.* Compared to a batch production plant of equivalent capacity, an FMS generally requires less floor area.

- *Greater responsiveness to change.* A flexible manufacturing system improves response capability to part design changes, introduction of new parts, changes in production schedule and product mix, machine breakdowns, and cutting tool failures. Adjustments can be made in the production schedule from one day to the next to respond to rush orders and special customer requests.
- *Reduced inventory requirements.* Because different parts are processed together rather than separately in batches, work-in-process is less than in batch production. For the same reason, final parts inventories are also reduced compared to make-to-stock production systems.
- *Lower manufacturing lead times.* Closely correlated with reduced work-in-process is the time spent in process by the parts. This means faster customer deliveries.
- *Reduced direct labor requirements and higher labor productivity.* Higher production rates and lower reliance on direct labor mean greater productivity per labor hour with an FMS than with conventional production methods.
- *Opportunity for unattended production.* The high level of automation in a flexible manufacturing system allows it to operate for extended periods of time without human attention. In the most optimistic scenario, parts and tools are loaded into the system at the end of the day shift, the FMS continues to operate throughout the night, and the finished parts are unloaded the next morning.

19.4 ANALYSIS OF FLEXIBLE MANUFACTURING SYSTEMS

Many of the design and operational problems identified in Section 19.3.2 can be addressed using quantitative analysis techniques. Flexible manufacturing systems constitute an active area of interest in operations research, and many of the important contributions are included in the list of references at the end of this chapter. FMS analysis techniques can be classified into (1) deterministic models, (2) queueing models, (3) discrete event simulation, and (4) other approaches, including heuristics.

Deterministic models are useful in obtaining starting estimates of system performance. Later in this section, a deterministic model is presented that is useful in the beginning stages of FMS design to provide rough estimates of system parameters such as production rate, capacity, and utilization. Deterministic models do not permit evaluation of operating characteristics such as the buildup of queues and other dynamics that can impair system performance. Consequently, deterministic models tend to overestimate FMS performance. On the other hand, if actual system performance is much lower than the estimates provided by these models, it may be a sign of either poor system design or poor management of FMS operations.

Queueing models can be used to describe some of the dynamics not accounted for in deterministic approaches. These models are based on the mathematical theory of queues. They permit the inclusion of queues, but only in a general way and for relatively simple system configurations. The performance measures that are calculated are usually average values for steady-state operation of the system. Examples of queueing models to study flexible manufacturing systems are described in several of the references [4], [31], and [34]. Probably the most well known of the FMS queueing models is CAN-Q [29], [30].

In the later stages of design, discrete event simulation probably offers the most accurate method for modeling the specific aspects of a given flexible manufacturing system [28], [39]. The computer model can be constructed to closely resemble the details of a

complex FMS operation. Characteristics such as layout configuration, number of pallets in the system, and production scheduling rules can be incorporated into the simulation model. Indeed, the simulation can be helpful in optimizing these characteristics.

Other techniques that have been applied to analyze FMS design and operational problems include mathematical programming [32] and various heuristic approaches [1], [13].

19.4.1 Bottleneck Model

Important aspects of FMS performance can be mathematically described by a deterministic model called the bottleneck model, developed by Solberg [31].⁵ Although it has the limitations of a deterministic approach, the bottleneck model is simple and intuitive. It can be used to provide starting estimates of FMS design parameters such as production rate, number of workstations, and similar measures. The term *bottleneck* refers to the fact that the output of the production system has an upper limit, given that the product mix flowing through the system is fixed. The model can be applied to any production system that possesses this bottleneck feature, for example, a manually operated group technology cell or a production job shop. It is not limited to flexible manufacturing systems.

Terminology and Symbols. The features, terms, and symbols for the bottleneck model, as they might be applied to a flexible manufacturing system, are defined as follows:

- *Part mix.* The mix of the various part or product styles produced by the system is defined by p_j , where p_j = the fraction of the total system output that is of style j . The subscript $j = 1, 2, \dots, n_f$, where n_f = the total number of different part styles (family members) made in the FMS during the time period of interest. The values of p_j must sum to unity, that is,

$$\sum_{j=1}^{n_f} p_j = 1.0 \quad (19.1)$$

- *Workstations and servers.* The flexible manufacturing system has a number of distinctly different workstation types n . In the terminology of the bottleneck model, each workstation type may have more than one server, which simply means that it is possible to have two or more machines of the same type and capable of performing the same operations. Using the terms *stations* and *servers* in the bottleneck model is a precise way of distinguishing between machines that accomplish identical operations and those that accomplish different operations. Let s_i = the number of servers at workstation i , where $i = 1, 2, \dots, n$. The load/unload station is included as one of the stations in the FMS.
- *Process routing.* For each part or product, the process routing defines the sequence of operations, the workstations where operations are performed, and the associated processing times. The sequence includes the loading operation at the beginning of processing on the FMS and the unloading operation at the end of processing. Let T_{cijk} = processing cycle time, which is the total time that a production unit occupies a given workstation server, not counting any waiting time at the station. In the

⁵Solberg's model has been simplified somewhat in this coverage, and the notation and performance measures have been adapted to be consistent with the discussion in this and other chapters.

notation for T_{cijk} , the subscript i refers to the station, j refers to the part or product style, and k refers to the sequence of operations in the process routing. For example, the fourth operation in the process plan for part A is performed on machine 2 and takes 8.5 min; thus, $T_{c2A4} = 8.5$ min. Note that process plan j is unique to part j . The bottleneck model does not conveniently allow for alternative process plans for the same part.

- *Part-handling system.* The material handling system used to transport parts or products within the FMS can be considered to be a special case of a workstation. Let it be designated as station $n + 1$, and the number of carriers in the system (conveyor carts, AGVs, monorail vehicles, etc.) is analogous to the number of servers in a regular workstation. Let s_{n+1} = the number of carriers in the part-handling system.
- *Transport time.* Let T_r = the mean transport time (repositioning time) required to move a part from one workstation to the next station in the process routing. This value could be computed for each individual transport based on transport velocity and distances between stations in the FMS, but it is more convenient to simply use an average transport time for all moves in the FMS. The same kind of average value was used for repositioning time in Chapter 15 on manual assembly lines.
- *Operation frequency.* The operation frequency is defined as the expected number of times a given operation in the process routing is performed for each work unit. For example, an inspection might be performed on a sampling basis, once every four units; hence, the frequency for this operation would be 0.25. In other cases, the part may have an operation frequency greater than 1.0, for example, for a calibration procedure that may have to be performed more than once on average to be completely effective. Let f_{ijk} = operation frequency for operation k in process plan j at station i .

FMS Operational Parameters. Using the above terms, certain operational parameters of the system can be defined. The average workload for a given station is defined as the mean total time spent at the station per part. It is calculated as

$$WL_i = \sum_j \sum_k T_{cijk} f_{ijk} p_j \quad (19.2)$$

where WL_i = average workload for station i , min; T_{cijk} = processing cycle time for operation k in process plan j at station i , min; and f_{ijk} = operation frequency for operation k in part j at station i ; and p_j = part-mix fraction for part j .

The part-handling system (station $n + 1$) is a special case, as noted previously. The workload of the handling system is the mean transport time multiplied by the average number of transports required to complete the processing of a work part. The average number of transports is equal to the mean number of operations in the process routing minus one. That is,

$$n_t = \sum_i \sum_j \sum_k f_{ijk} p_j - 1 \quad (19.3)$$

where n_t = mean number of transports, and the other terms are defined earlier.

EXAMPLE 19.3 Determining n_t

Consider a manufacturing system with two stations: (1) a load/unload station and (2) a machining station. The system processes just one part, part A, so the part-mix fraction $p_A = 1.0$. The frequency of all operations is $f_{iAk} = 1.0$. The parts are loaded at station 1, routed to station 2 for machining, and then sent back to station 1 for unloading (three operations in the routing). Using Equation (19.3),

$$n_t = 1(1.0) + 1(1.0) + 1(1.0) - 1 = 3 - 1 = 2$$

Looking at it another way, the process routing is (station 1) \rightarrow (station 2) \rightarrow (station 1). Counting the number of arrows gives the number of transports: $n_t = 2$.⁶

The workload of the handling system can now be computed:

$$WL_{n+1} = n_t T_r \quad (19.4)$$

where WL_{n+1} = workload of the handling system, min; n_t = mean number of transports by Equation (19.3); and T_r = mean transport time per move, min.

System Performance Metrics. Measures to assess performance of a flexible manufacturing system include production rate of all parts, production rate of each part style, utilization of the different workstations, and number of busy servers at each workstation. These measures can be calculated under the assumption that the FMS is producing at its maximum possible rate. This rate is constrained by the bottleneck station in the system, which is the station with the highest workload per server. The workload per server is simply the ratio WL_i/s_i for each station. Thus, the bottleneck is identified by finding the maximum value of the ratio among all stations. The comparison must include the handling system, because it might be the bottleneck.

Let WL^* and s^* equal the workload and number of servers, respectively, for the bottleneck station. The maximum production rate of all parts of the FMS can be determined as the ratio of s^* to WL^* . It is the maximum production rate, because it is limited by the capacity of the bottleneck station,

$$R_p^* = \frac{s^*}{WL^*} \quad (19.5)$$

where R_p^* = maximum production rate of all part styles produced by the system, which is determined by the capacity of the bottleneck station, pc/min; s^* = number of servers at the bottleneck station, and WL^* = workload at the bottleneck station, min/pc. It is not difficult to grasp the validity of this formula as long as all parts are processed through the bottleneck station. A little more thought is required to appreciate that Equation (19.5) is also valid even when not all the parts pass through the bottleneck station, as long as the product mix (p_j values) remains constant. In other words, if those parts not passing

⁶Counting the arrows works only when $f_{ijk} = 1$ for all i, j , and k . When one or more f_{ijk} = fractions, then this is a fractional move, and the counting of arrows gets complicated. The safest approach is to use Equation (19.3).

through the bottleneck are not allowed to increase their production rates to reach their respective bottleneck limits, then these parts' rates will be limited by the part-mix ratios.

The value of R_p^* includes parts of all styles produced in the system. Individual part production rates can be obtained by multiplying R_p^* by the respective part-mix ratios. That is,

$$R_{pj}^* = p_j(R_p^*) = p_j \frac{s^*}{WL^*} \quad (19.6)$$

where R_{pj}^* = maximum production rate of part style j , pc/min; and p_j = part-mix fraction for part style j .

The mean utilization of each workstation is the proportion of time that the servers at the station are working and not idle. This can be computed as:

$$U_i = \frac{WL_i}{s_i} (R_p^*) = \frac{WL_i}{s_i} \frac{s^*}{WL^*} \quad (19.7)$$

where U_i = utilization of station i ; WL_i = workload of station i , min/pc; s_i = number of servers at station i ; and R_p^* = overall production rate, pc/min. The utilization of the bottleneck station is 100% at R_p^* .

To obtain the average station utilization, simply compute the average value for all stations, including the transport system:

$$\bar{U} = \frac{\sum_{i=1}^{n+1} U_i}{n+1} \quad (19.8)$$

where \bar{U} is an unweighted average of the workstation utilizations.

An alternative and perhaps more meaningful measure of overall FMS utilization can be obtained using a weighted average, where the weighting is based on the number of servers at each station for the n regular stations in the system, including the load/unload station but excluding the transport system. The argument for omitting the transport system is that the utilization of the processing stations is the important measure of FMS utilization. The purpose of the transport system is to serve the processing stations, and therefore its utilization should not be included in the average. The overall FMS utilization is calculated as:

$$\bar{U}_s = \frac{\sum_{i=1}^n s_i U_i}{\sum_{i=1}^n s_i} \quad (19.9)$$

where \bar{U}_s = overall FMS utilization, s_i = number of servers at station i , and U_i = utilization of station i .

Finally, the number of busy servers at each station is of interest. All of the servers at the bottleneck station are busy at the maximum production rate, but the servers at the other stations are idle some of the time. The values can be calculated as

$$BS_i = WL_i(R_p^*) = WL_i \frac{s^*}{WL^*} \quad (19.10)$$

where BS_i = number of busy servers on average at station i and WL_i = workload at station i .

EXAMPLE 19.4 Bottleneck Model

A flexible machining system consists of a load/unload station and two machining workstations. Station 1 is the load/unload station with one server (human worker). Station 2 performs milling and consists of three identical CNC milling machines. Station 3 performs drilling and consists of two identical CNC drill presses. The stations are connected by a part-handling system that has two carriers. The mean transport time is 2.5 min. The FMS produces three parts, A, B, and C. The part-mix fractions and process routings for the three parts are presented in the table below. The operation frequency $f_{ijk} = 1.0$ for all i, j , and k . Determine (a) maximum production rate of the FMS, (b) corresponding production rates of each product, (c) utilization of each station, (d) average utilization of the processing stations, and (e) number of busy servers at each station.

Part j	Part Mix p_j	Operation k	Description	Station i	Process Time T_{cijk} (min)
A	0.4	1	Load	1	4
		2	Mill	2	25
		3	Drill	3	10
		4	Unload	1	2
B	0.35	1	Load	1	4
		2	Mill	2	20
		3	Drill	3	15
		4	Unload	1	2
C	0.25	1	Load	1	4
		2	Mill	2	15
		3	Unload	1	2

Solution: The computations were performed using a spreadsheet calculator with the results shown below. Equations used to compute the entries are given in the top row of the table. Station 2 has the highest WL/s ratio (6.9167) so it is the bottleneck station.

Equation		(19.2)	(19.4)	(19.7)	(19.10)
Station	Servers	WL	WL	WL/s	U
1 (Load/unload)	1	6		6	0.867
2 (Mill)	3	20.75		6.917*	1
3 (Drill)	2	9.25		4.625	0.668
4 (Part handling)	2		6.875	3.438	0.497
					0.994

* Highest value of WL/s denotes bottleneck station.

(a) Overall production rate is given by Equation (19.5) using station 2 values:

$$R_p^* = s^*/WL^* = 3/20.75 = 0.1446 \text{ pc/min} = \mathbf{8.675 \text{ pc/hr}}$$

(b) To determine the production rate of each product, multiply R_p^* by its respective part-mix fraction.

$$R_{pA}^* = 8.675(0.4) = \mathbf{3.470 \text{ pc/hr}}$$

$$R_{pB}^* = 8.675(0.35) = \mathbf{3.036 \text{ pc/hr}}$$

$$R_{pC}^* = 8.675(0.25) = \mathbf{2.169 \text{ pc/hr}}$$

(c) The utilization of each station can be computed using Equation (19.7). The values are shown in the table.

(d) Average utilization of the processing stations is based on Equation (19.9):

$$\bar{U}_s = \frac{0.8675 + 3 + 1.3373}{6} = \mathbf{0.8675}$$

(e) Mean number of busy servers at each station is determined using Equation (19.10). The values are shown in the table. □

19.4.2 Extended Bottleneck Model

The bottleneck model assumes that the bottleneck station is utilized 100% and that there are no delays due to queues in the system. This implies, on the one hand, that there are a sufficient number of parts in the system to avoid starving of workstations and, on the other hand, that there will be no delays due to queueing. Solberg [31] argued that the assumption of 100% utilization makes the bottleneck model overly optimistic and that a queueing model which accounts for process time variations and delays would more realistically describe the performance of a flexible manufacturing system.

An alternative approach, developed by Mejabi [24], addresses some of the weaknesses of the bottleneck model without resorting to queueing computations (which can be difficult). He called his approach the *extended bottleneck model*. This extended model assumes a closed queueing network in which there are always a certain number of work parts in the FMS. Let N = this number. When one part is completed and exits the FMS, a new raw work part immediately enters the system, so that N remains constant. The new part may or may not have the same process routing as the one that just departed.

N plays a critical role in the operation of the manufacturing system. If N is smaller than the number of workstations, then some of the stations will be idle due to starving, sometimes even the bottleneck station. In this case, the production rate of the FMS will be less than R_p^* calculated in Equation (19.5). If N is larger than the number of workstations, then the system will be fully loaded, with parts waiting in front of stations. In this case, R_p^* will provide a good estimate of the production capacity of the system. However, work-in-process (*WIP*) will be high, and manufacturing lead time (*MLT*) will be long.

In effect, *WIP* corresponds to N , and *MLT* is the sum of processing times at the stations, transport times between stations, and any waiting time experienced by the parts in the system:

$$MLT = \sum_{i=1}^n WL_i + WL_{n+1} + T_w \quad (19.11)$$

where $\sum_{i=1}^n WL_i$ = summation of average workloads over all stations in the FMS, min; WL_{n+1} = workload of the part-handling system, min; and T_w = mean waiting time experienced by a part due to queues at the stations, min.

WIP (i.e., N) and *MLT* are correlated. If N is small, then *MLT* will take on its smallest possible value because waiting time will be short or even zero. If N is large, then *MLT* will be long and there will be waiting time for parts in the system. Thus there are two alternative cases, and adjustments must be made in the bottleneck model to account for them. To do this, Mejabi used the well-known Little's formula⁷ from queueing theory. Using the symbols developed here, Little's formula is expressed as:

$$N = R_p(MLT) \quad (19.12)$$

where N = number of parts in the system, pc; R_p = production rate of the system, pc/min; and *MLT* = manufacturing lead time (time spent by a part in the system), min. Now consider the two cases:

Case 1: When N is small, production rate is less than in the bottleneck case because the bottleneck station is not fully utilized. In this case, the waiting time T_w of a unit is theoretically zero, and Equation (19.11) reduces to

$$MLT_1 = \sum_{i=1}^n WL_i + WL_{n+1} \quad (19.13)$$

where the subscript in MLT_1 is used to identify case 1. Production rate can be estimated using Little's formula:

$$R_p = \frac{N}{MLT_1} \quad (19.14)$$

and production rates of the individual parts are given by

$$R_{pj} = p_j R_p \quad (19.15)$$

As indicated waiting time is assumed to be zero:

$$T_w = 0 \quad (19.16)$$

Case 2: When N is large, the estimate of maximum production rate provided by Equation (19.5) should be valid: $R_p^* = s^*/WL^*$, where the asterisk (*) denotes that production rate is constrained by the bottleneck station in the system. The production rates of the individual products are given by

$$R_{pj}^* = p_j R_p^* \quad (19.17)$$

In this case, average manufacturing lead time is evaluated using Little's formula:

$$MLT_2 = \frac{N}{R_p^*} \quad (19.18)$$

The mean waiting time a part spends in the system can be estimated by rearranging Equation (19.11) to solve for T_w :

$$T_w = MLT_2 - \left(\sum_{i=1}^n WL_i + WL_{n+1} \right) \quad (19.19)$$

⁷Little's formula is usually given as $L = \lambda W$, where L = expected number of units in the system, λ = processing rate of units in the system, and W = expected time spent by a unit in the system.

The decision on whether to use case 1 or case 2 depends on the value of N . The dividing line between cases 1 and 2 is determined by whether N is greater than or less than a critical value given by

$$N^* = R_p^* \left(\sum_{i=1}^n WL_i + WL_{n+1} \right) = R_p^*(MLT_1) \quad (19.20)$$

where N^* = critical value of N , the dividing line between the bottleneck and non-bottleneck cases. If $N < N^*$, then case 1 applies. If $N \geq N^*$, then case 2 applies.

EXAMPLE 19.5 Extended Bottleneck Model

Use the extended bottleneck model on the data in Example 19.4 to compute hourly production rate, manufacturing lead time, and waiting time for four values of N : (a) $N = 4$, (b) $N = 6$, (c) $N = 7$, and (d) $N = 10$.

Solution: First compute the critical value of N , using Equation (19.20). From Example 19.4 $R_p^* = 8.675/60 = 0.1446$ pc/min. Also needed is the value of MLT_1 . Using previously calculated values from Example 19.4 in Equation (19.13),

$$MLT_1 = 6 + 20.75 + 9.25 + 6.875 = 42.875 \text{ min} = \sim 42.9 \text{ min}$$

The critical value of N is given by Equation (19.20):

$$N^* = 0.1446(42.875) = 6.2 \text{ pc}$$

(a) $N = 4$ is less than the critical value, so the equations for case 1 apply.

$$MLT_1 = \mathbf{42.9 \text{ min}}$$

$$R_p = \frac{N}{MLT_1} = \frac{4}{42.875} = 0.0933 \text{ pc/min} = \mathbf{5.6 \text{ pc/hr}}$$

$$T_w = \mathbf{0}$$

(b) $N = 6$ is again less than the critical value, so case 1 applies.

$$MLT_1 = \mathbf{42.9 \text{ min}}$$

$$R_p = \frac{6}{42.875} = 0.1399 \text{ pc/min} = \mathbf{8.4 \text{ pc/hr}}$$

$$T_w = \mathbf{0}$$

(c) $N = 7$ is greater than the critical value, so case 2 applies.

$$R_p^* = \frac{s^*}{WL^*} = \frac{3}{20.75} = 0.1446 \text{ pc/min} = \mathbf{8.7 \text{ pc/hr}}$$

$$MLT_2 = \frac{7}{0.1446} = \mathbf{\sim 48.4 \text{ min}}$$

$$T_w = 48.4 - 42.9 = \mathbf{\sim 5.5 \text{ min}}$$

(d) $N = 10$ is greater than the critical value, so case 2 applies.

$$R_p^* = 0.1446 \text{ pc/min} = \mathbf{8.7 \text{ pc/hr}}$$
 calculated in part (c)

$$MLT_2 = \frac{10}{0.1446} = \mathbf{\sim 69.167 \text{ min}}$$

$$T_w = 69.2 - 42.9 = \mathbf{\sim 26.3 \text{ min}}$$

The results of this example typify the behavior of the extended bottleneck model, shown in Figure 19.8. Below N^* (Case 1), MLT has a constant value, and R_p decreases proportionally as N decreases. Manufacturing lead time cannot be less than the sum of the processing and transport times, and production rate is adversely affected by low values of N because stations become starved for work. Above N^* (Case 2), R_p has a constant value equal to R_p^* and MLT increases. No matter how large N is, the production rate cannot be greater than the output capacity of the bottleneck station. Manufacturing lead time increases because backlogs build up at the stations.

These observations might tempt the reader to conclude that the optimum N value occurs at N^* , because MLT is at its minimum possible value and R_p is at its maximum possible value. However, caution must be exercised in the use of the extended bottleneck model (and the same caution applies even more so to the conventional bottleneck model, which disregards the effect of N). It is intended to be a rough-cut method to estimate performance in the early phases of FMS design. More reliable estimates of performance can be obtained using computer simulations of detailed models of the FMS—models that include considerations of layout, material handling and storage system, and other system design factors.

19.4.3 Sizing the FMS

The bottleneck model can be used to calculate the number of servers required at each workstation to achieve a specified production rate. Such calculations would be useful during the initial stages of FMS design in determining the “size” (number of workstations and servers) of the system. To make the computation, the part mix, process routings, and processing times must be known so that workloads can be calculated for each station to

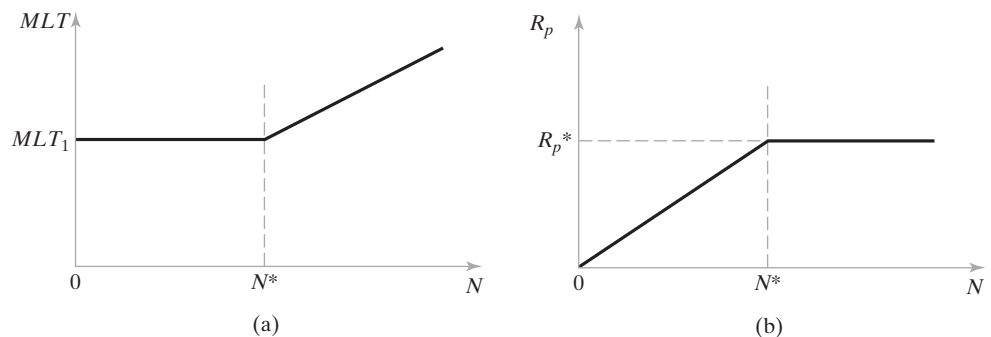


Figure 19.8 General behavior of the extended bottleneck model: (a) manufacturing lead time MLT as a function of N ; and (b) production rate R_p as a function of N .

be included in the FMS. Given the workloads, the number of servers at each station i is determined as

$$s_i = \text{Minimum Integer} \geq R_p(WL_i) \quad (19.21)$$

where s_i = number of servers at station i ; R_p = specified production rate of all parts to be produced by the system, pc/min; and WL_i = workload at station i , min. The following example illustrates the procedure.

EXAMPLE 19.6 Sizing the FMS

Suppose the part mix, process routings, and processing times for the family of parts to be machined on a proposed FMS are those given in Example 19.4. The FMS will operate 24 hr/day, 5 days/wk, 50 wk/yr. Determine (a) the number of servers that will be required at each station i to achieve an annual production rate of 60,000 parts/yr and (b) the utilization of each workstation.

Solution: (a) The number of hours of FMS operation per year will be $24 \times 5 \times 50 = 6,000$ hr/yr. The hourly production rate is given by:

$$R_p = \frac{60,000}{6,000} = 10.0 \text{ pc/hr} = 0.1667 \text{ pc/min}$$

The workloads at each station were previously calculated in Example 19.4: $WL_1 = 6.0$ min, $WL_2 = 20.75$ min, $WL_3 = 9.25$ min, $WL_4 = 6875.0$ min, and $WL_5 = 10.06$ min. Using Equation (19.21), the following number of servers are required at each station:

$$s_1 = \text{minimum integer} \geq 0.1667(6.0) = 1.000 = \mathbf{1 \text{ server}}$$

$$s_2 = \text{minimum integer} \geq 0.1667(20.75) = 3.458 \text{ rounded up to } \mathbf{4 \text{ servers}}$$

$$s_3 = \text{minimum integer} \geq 0.1667(9.25) = 1.54 \text{ rounded up to } \mathbf{2 \text{ servers}}$$

$$s_4 = \text{minimum integer} \geq 0.1667(6.875) = 1.146 \text{ rounded up to } \mathbf{2 \text{ servers}}$$

(b) The utilization at each workstation is determined as the calculated value of s_i divided by the resulting minimum integer value $\geq s_i$.

$$U_1 = 1.0/1 = 1.0 = \mathbf{100\%}$$

$$U_2 = 3.458/4 = 0.865 = \mathbf{86.5\%}$$

$$U_3 = 1.54/2 = 0.77 = \mathbf{77\%}$$

$$U_4 = 1.146/2 = 0.573 = \mathbf{57.3\%}$$

The maximum value is at station 1, the load/unload station. This is the bottleneck station.

Because the number of servers at each workstation must be an integer, station utilization may be less than 100% for most of the stations. In Example 19.6, the load/unload station has a utilization of 100%, but all of the other stations have utilizations less than 100%. It's a shame that the load/unload station is the bottleneck on the overall production rate of the FMS. It would be much more desirable for one of the production stations to be the bottleneck.

EXAMPLE 19.7 The FMS Sizing Problem Revisited

For Example 19.6, (a) make the necessary design changes in the FMS so that the production rate of the system is limited by one of the production stations rather than by the load/unload station. (b) Then, determine the maximum possible annual production rate of the FMS for the 6,000 operating hours per year.

Solution: (a) Given that the highest utilization in Example 19.6 is $U_1 = 100\%$, it makes sense to increase the number of servers at this station. This will reduce the utilization for this station, thereby making one of the other stations into the bottleneck. For station 1, currently with 1 server, change s_1 to $s_1 = 2$ servers. With this change, station 2 becomes the new bottleneck because it has the next highest utilization factor ($U_2 = 86.5\%$).

(b) The maximum possible production rate of the FMS can be increased so that the bottleneck station operates at 100% utilization. This is accomplished by dividing the current production rate at 86.5% utilization ($R_p = 10$ pc/hr) by the current utilization factor ($U_2 = 0.865$).

$$R_p^* = \frac{10.0}{0.865} = 11.56 \text{ pc/hr}$$

At 6,000 operating hours per year, $R_p^* = 11.56(6,000) = \mathbf{69,364 \text{ pc/yr}}$. The utilizations at all other stations are affected by this higher production rate. Using Equation (19.7), the revised station utilizations are computed to be $U_1 = 57.8\%$, $U_2 = 100\%$, $U_3 = 89.2\%$, and $U_4 = 66.3\%$.

19.4.4 What the Equations Tell Us

Despite their limitations, the bottleneck model and extended bottleneck model provide the following practical guidelines on the design and operation of flexible manufacturing systems:

- For a given product or part mix, the total production rate of the FMS is ultimately limited by the productive capacity of the bottleneck station, which is the station with the maximum workload per server.
- If the product or part-mix ratios can be relaxed, it may be possible to increase total FMS production rate by increasing the utilization of nonbottleneck workstations.
- The number of parts in the FMS at any time should be greater than the number of servers (processing machines) in the system. A ratio of around two parts per server is probably optimum, assuming that the parts are distributed throughout the FMS to ensure that one part is waiting at every station. This is especially critical at the bottleneck station.
- If work-in-process (number of parts in the system) is kept too low, production rate of the system is reduced.

- If work-in-process is allowed to be too high, then manufacturing lead time will be long with no improvement in production rate.
- As a first approximation, the bottleneck model can be used to estimate the number of servers at each station (number of machines of each type) to achieve a specified overall production rate of the system.

19.5 ALTERNATIVE APPROACHES TO FLEXIBLE MANUFACTURING

This section explores three approaches that are sometimes considered in the context of flexible manufacturing: (1) mass customization, (2) reconfigurable manufacturing systems, and (3) agile manufacturing.

19.5.1 Mass Customization

The upper limit of flexible manufacturing is the capability to produce a unique product for each customer. This is called *mass customization*, the ideal realization of which is to produce a large variety of products at efficiencies approaching those of mass production. Each product is customized to satisfy the specifications of an individual customer. Referring back to the definitions of production quantity and product variety in Section 2.3, the distinction between mass production and mass customization is the following: In the extreme, mass production is the production of very large quantities of one product style, whereas mass customization involves the production of individually customized product styles in large quantities.

The challenge for the company that attempts to engage in mass customization is to manage its design and production operations without wasteful product proliferation, in which the company offers so many choices and available options that it cannot be profitable. The consequences of product proliferation are usually negative: (1) large inventories of raw material, work-in-process, and finished product; (2) high purchasing costs because there are so many parts to order; (3) too many setups and short production runs, (4) too much special tooling for each product style, (5) high overhead costs of managing the variety, (6) so much marketing literature and design data; and (7) customer confusion. How can a company offer customized product variety but avoid the negative consequences of product proliferation?

The successful mass customizer uses a number of approaches to operate efficiently while achieving large product variety. The following are four of these approaches:

- *Design of products that are customizable.* The product is designed so that it can be readily customized, whether this is accomplished by the manufacturer or by the merchant who deals directly with the customer. When done by the manufacturer, the customized product is completed at the last moment, as in postponement, and all of the components and modules are in stock beforehand. An example is a customer selecting from among available design parameters and options, and the product is then assembled to those specifications. Cars are sometimes ordered this way. An example of merchant customization is a paint dealer mixing colorants with a standard neutral base paint to achieve the exact color wanted by the customer. Finally, adjustability and customizability may be designed into the product

by the mass customizer, so that customers themselves can individualize the product. For example, car seats can be adjusted by the driver and software settings can be customized by users of personal computers.

- *Soft product variety.* Two kinds of product variety were identified in Section 2.3: hard variety and soft variety. Mass customization relies on the use of soft product variety, which means that there are only small differences among available product styles. The differences may seem significant to the customer, but they are easily managed by the company in production. The strategy is to minimize the real differences among product styles while persuading customers to believe they are purchasing products that are unique and customized. An obvious example is offering a product in which all internal components are identical but the product is available in a variety of external colors.
- *Design modularity.* This is another way in which mass customizers achieve efficiencies. The product is designed using standard modules that can be assembled in unique combinations for individual customers. The modules are building blocks that can be produced at low cost, but they can be combined in various ways to achieve a customized product. Of course, the modules must be designed so as to facilitate assembly. For example, the purchaser of a personal computer specifies from a variety of features and options related to hardware and software modules that are included in the completed PC.
- *Postponement.* The mass customizer waits until the last possible moment to complete the product. That moment does not occur until after a customer order is received. Postponement is far preferable to carrying a large inventory of finished products that match all of the possible combinations and permutations of options that customers might order.

19.5.2 Reconfigurable Manufacturing Systems

A reconfigurable manufacturing system (RMS) is an integrated system consisting of CNC machining stations, parts-transport system, and computer control system that is designed with features that permit its function and production capacity to be adjusted in response to changing demand patterns. Its range of applications lies between those of an FMS and a transfer line. An FMS is designed to produce one or more part families and emphasizes flexibility over high production rates. A transfer line is a dedicated system that emphasizes high production rate at the sacrifice of flexibility. It is designed to produce one part style with maximum efficiency. Both of these manufacturing systems are designed for a fixed capacity and known part style (in the case of the transfer line) or family of part styles (in the case of the FMS). In addition, these manufacturing systems are expensive, the lead time to design and build them is considerable, and there are risks of obsolescence and overestimation of demand for their output.

What distinguishes an RMS is that it is designed so that its production capacity can be increased or decreased and that its physical structure can be altered for part style changes quickly and without major renovations to the structure. There are limits to the range of part styles that can be accommodated on an RMS. An RMS that has been reconfigured is capable of producing a part family that is more limited than the part family produced on a comparable FMS. The term *customized part family* is used to denote this narrower range of part styles. But the RMS can produce this customized part family at higher production rates than the FMS. And when the production run for the current part

family is completed and the RMS needs to be reconfigured for the next customized part family, its structural design permits this to be accomplished easily. This kind of reconfiguration and redeployment of equipment was encountered in the context of flexible transfer lines in Section 16.2.1.

The following are six features that characterize manufacturing systems that can be classified as reconfigurable [16]:

- *Customized flexibility.* An RMS is limited to the production of a customized part family.
- *Convertibility.* An RMS is designed to be readily changed over to the production of a different but similar part family. The system's functionality can be easily changed. For example, the CNC machine tools are designed with more axes for greater versatility.
- *Scalability.* An RMS is designed so that its production capacity can, with minimum effort, be increased or decreased by adding or subtracting productive resources. For example, the parts-handling system is designed with unused connection points to attach additional production machines if demand increases.
- *Modularity.* The components of the RMS (hardware and software) are modular. They are designed for ease of assembly into alternative system configurations that match the changing requirements of production.
- *Integrate-ability.* The RMS modules can be rapidly integrated because they have been designed using standards and protocols that facilitate integration in mechanical assembly and control architecture.
- *Diagnostics-ability.* An RMS is designed with attributes of self-diagnosis that allow the current status of the system to be determined, quality problems to be recognized, and operational problems to be detected.

19.5.3 Agile Manufacturing

Agile manufacturing can be defined as (1) an enterprise-level strategy of introducing new products into rapidly changing markets and (2) an organization possessing the ability to thrive in a competitive environment characterized by continuous and sometimes unforeseen change.

Manufacturing companies that are agile tend to exhibit the following four principles or characteristics of agility [8], [9]:

1. *Organize to master change.* In an agile company, the human and physical resources can be rapidly reconfigured to adapt to a changing environment and new market opportunities, thus allowing the company to flourish amid uncertainty.
2. *Leverage the impact of people and information.* In an agile company, knowledge is valued, innovation is rewarded, and authority is distributed to the appropriate level in the organization. Management provides the resources that personnel need. The organization has an entrepreneurial spirit.
3. *Cooperate to enhance competitiveness.* The objective of an agile company is to bring new products to market as rapidly as possible using whatever resources and competencies are required, wherever they exist. This may involve partnering with other companies, possibly even competitors, to form what are called *virtual enterprises*.

4. *Enrich the customer.* The products of an agile company are perceived by their customers as solutions to problems. Pricing of a product may be based on the value of the solution rather than on manufacturing cost.

As the definition and list of four agility principles indicate, agile manufacturing involves more than just manufacturing. It involves the firm's organizational structure, the way the firm treats its people, its partnerships with other organizations, and its relationships with customers. It is as much a business strategy as it is an approach to manufacturing.

How does a company become agile? Two important approaches are (1) reorganizing the company's production systems to make them more agile and (2) managing relationships and valuing the knowledge that exists in the organization.

Reorganizing the Production System for Agility. Companies seeking to be agile try to organize themselves based on the following tactical approaches, which include the areas of product design and marketing as well as production:

- *Master mass customization.* If the agile company is engaged in mass customization, it must excel at designing products that are readily customized and the use of soft product variety, design modularity, and postponement, as described in Section 19.5.1.
- *Use reconfigurable manufacturing systems.* Agile companies must be able to change-over their manufacturing systems to exploit new market opportunities, using the RMS features described in Section 19.5.2.
- *Frequent new product introductions.* The agile company maintains a high rate of new product introductions. Even for products that are successful in the marketplace, the company nevertheless introduces new models to remain competitive.
- *Design products that are upgradeable and reconfigurable.* An agile company tries to design products so that customers who purchased the base model can buy additional options to upgrade the product. Also, new models can be reconfigured from the previous model without drastic and time-consuming redesign effort.
- *Pricing by customer value.* The price of the product is determined according to its value to the customer rather than according to its own cost.
- *Be an effective niche market competitor.* Many companies have become successful by competing effectively in niche markets. Using the same basic product platform, the product is reconfigured to provide offerings for different markets.

Managing Relationships for Agility. Two types of relationships should be distinguished in the context of agility: (1) internal relationships and (2) relationships between the company and other organizations.

Internal relationships are those that exist within the firm, between coworkers and between supervisors and subordinates. Relationships inside the firm must be managed to promote agility. Some of the important objectives include: (1) make the work organization adaptive, (2) provide cross-functional training, (3) encourage rapid partnership formation, and (4) provide effective electronic communications capability.

External relationships are those that exist between the company and external suppliers, customers, and partners. It is desirable to form and cultivate external relationships for the following reasons: (1) to establish interactive, proactive relationships

with customers; (2) to provide rapid identification and certification of suppliers; (3) to install effective electronic communications and commerce capability; and (4) to encourage rapid partnership formation for mutual commercial advantage.

The fourth reason raises the issue of the *virtual enterprise*, which is defined as a temporary partnership of independent resources (personnel, assets, etc.) intended to exploit a temporary market opportunity. Once the market opportunity is passed and the objective is achieved, the organization is dissolved. In such a partnership, resources are shared among the partners, and benefits (profits) are also shared. Virtual enterprises are sometimes created by competing firms. Formation of a virtual enterprise has the following potential benefits: (1) It may provide access to resources and technologies not available in-house, (2) it may provide access to new markets and distribution channels, (3) it may reduce product development time, and (4) it accelerates technology transfer.

REFERENCES

- [1] ASKIN, R. G., H. M. SELIM, and A. J. VAKHARIA, "A Methodology for Designing Flexible Cellular Manufacturing Systems," *IIE Transactions*, Vol. 29, 1997, pp. 599–610.
- [2] BASNET, C., and J. H. MIZE, "Scheduling and Control of Flexible Manufacturing Systems: A Critical Review," *International Journal of Computer Integrated Manufacturing*, Vol. 7, 1994, pp. 340–355.
- [3] BROWNE, J., D. DUBOIS, K. RATHMILL, S. P. SETHI, and K. E. STECKE, "Classification of Flexible Manufacturing Systems," *FMS Magazine*, Vol. 2, April 1984, pp. 114–117.
- [4] BUZACOTT, J. A. "Modeling Automated Manufacturing Systems," *Proceedings*, 1983 Annual Industrial Engineering Conference, Louisville, Kentucky, May 1983, pp. 341–347.
- [5] BUZACOTT, J. A., and J. G. SHANTHIKUMAR, *Stochastic Models for Manufacturing Systems*, Prentice Hall, Englewood Cliffs, NJ, 1993.
- [6] BUZACOTT, J. A., and D. D. YAO, "Flexible Manufacturing Systems: A Review of Analytical Models," *Management Science*, Vol. 32, 1986, pp. 890–895.
- [7] FALKNER, C. H., "Flexibility in Manufacturing Systems," *Proceedings*, Second ORSA/TIMS Conference on Flexible Manufacturing Systems: Operations Research Models and Applications, Edited by K. E. Stecke and R. Suri, Elsevier Science Publishers, New York, 1986, pp. 95–106.
- [8] GOLDMAN, S., R. NAGEL, and K. PREISS, *Agile Competitors and Virtual Organizations*, Van Nostrand Reinhold, New York, 1995.
- [9] GOLDMAN, S. L., "The Agility Revolution," *lecture* presented at Agility Forum, Lehigh University, Bethlehem, PA, October 15, 1996.
- [10] GROOVER, M. P., and O. MEJABI, "Trends in Manufacturing System Design," *Proceedings*, IIE Fall Conference, Nashville, TN, November 1987.
- [11] JABLONSKI, J., "Reexamining FMSs," Special Report 774, *American Machinist*, March 1985, pp. 125–140.
- [12] JOSHI, S. B., and J. S. SMITH, Editors, *Computer Control of Flexible Manufacturing Systems*, Chapman & Hall, London, UK, 1994.
- [13] KATTAN, I. A., "Design and Scheduling of Hybrid Multi-Cell Flexible Manufacturing Systems," *International Journal of Production Research*, Vol. 35, 1997, pp. 1239–1257.
- [14] KLAHORST, H. T., "How To Plan Your FMS," *Manufacturing Engineering*, September 1983, pp. 52–54.
- [15] KOELSCH, J. R., "A New Look to Transfer Lines," *Manufacturing Engineering*, April 1994, pp. 73–78.

- [16] KOREN, Y., and M. SHPITALNI, "Design of reconfigurable manufacturing systems," *Journal of Manufacturing Systems* (2011), doi:10.1016/j.msy.2011.01.001.
- [17] KOUVELIS, P., "Design and Planning Problems in Flexible Manufacturing Systems: A Critical Review," *Journal of Intelligent Manufacturing*, Vol. 3, 1992, pp. 75–99.
- [18] KUSIAK, A., and C.-X. FENG, "Flexible Manufacturing," *The Engineering Handbook*, Richard C. Dorf (ed.), CRC Press, 1996, pp. 1718–1723.
- [19] LENZ, J. E., *Flexible Manufacturing*, Marcel Dekker, Inc., New York, 1989.
- [20] LORINCZ, J., "Challenging Process Engineering," *Manufacturing Engineering*, June 2012, pp 61–67.
- [21] LUGGEN, W. W., *Flexible Manufacturing Cells and Systems*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1991.
- [22] MAHONEY, R. M., *High-Mix Low-Volume Manufacturing*, Hewlett-Packard Company, Prentice Hall, Upper Saddle River, NJ, 1997.
- [23] MALEKI, R. A., *Flexible Manufacturing Systems: The Technology and Management*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1991.
- [24] MEJABI, O., "Modeling in Flexible Manufacturing Systems Design," *PhD Dissertation*, Lehigh University, Bethlehem, PA, 1988.
- [25] MOHAMED, Z. M., *Flexible Manufacturing Systems—Planning Issues and Solutions*, Garland Publishing, Inc., New York, 1994.
- [26] MOODIE, C., R. UZSOY, and Y. YIH, Editors, *Manufacturing Cells: A Systems Engineering View*, Taylor & Francis, London, UK, 1996.
- [27] PINE II, B. J. *Mass Customization*. Harvard Business School Press, Cambridge, MA, 1993.
- [28] RAHIMIFARD, S., and S. T. NEWMAN, "Simultaneous Scheduling of Workpieces, Fixtures and Cutting Tools within Flexible Machining Cells," *International Journal of Production Systems*, Vol. 15, 1997, pp. 2379–2396.
- [29] SOLBERG, J. J., "A Mathematical Model of Computerized Manufacturing Systems," *Proceedings of the 4th International Conference on Production Research*, Tokyo, Japan, 1977.
- [30] SOLBERG, J. J., "CAN-Q User's Guide," Report No. 9 (Revised), NSF Grant No. APR74-15256, Purdue University, School of Industrial Engineering, West Lafayette, IN, 1980.
- [31] SOLBERG, J. J., "Capacity Planning with a Stochastic Workflow Model," *AIIE Transactions*, Vol. 13, No. 2, 1981, pp. 116–122.
- [32] STECKE, K. E., "Formulation and Solution of Nonlinear Integer Production Planning Problems for Flexible Manufacturing Systems," *Management Science*, Vol. 29, 1983, pp. 273–288.
- [33] STECKE, K. E., "Design, Planning, Scheduling and Control Problems of FMS," *Proceedings, First ORSA/TIMS Special Interest Conference on Flexible Manufacturing Systems*, Ann Arbor, MI, 1984.
- [34] STECKE, K. E., and J. J. SOLBERG, "The Optimality of Unbalancing Both Workloads and Machine Group Sizes in Closed Queuing Networks of Multiserver Queues," *Operational Research*, Vol. 33, 1985, pp. 822–910.
- [35] SURI, R., "An Overview of Evaluative Models for Flexible Manufacturing Systems," *Proceedings, First ORSA/TIMS Special Interest Conference on Flexible Manufacturing Systems*, University of Michigan, Ann Arbor, MI, August 1984, pp. 8–15.
- [36] WATERBURY, R., "FMS Expands into Assembly," *Assembly Engineering*, October 1985, pp. 34–37.
- [37] WAURZYNIAK, P., "Automation Flexibility," *Manufacturing Engineering*, September 2010, pp 79–87.

- [38] WINSHIP, J. T., "Flexible Sheetmetal Fabrication," Special Report 779, *American Machinist*, August 1985, pp. 95–106.
- [39] WU, S. D., and R. A. WYSK, "An Application of Discrete-Event Simulation to On-line Control and Scheduling in Flexible Manufacturing," *International Journal of Production Research*, Vol. 27, 1989, pp. 247–262.
- [40] www.mag-ias.com
- [41] www.mazakusa.com
- [42] www.methodsmachine.com

REVIEW QUESTIONS

- 19.1 Name three production situations in which FMS technology can be applied.
- 19.2 What is a flexible manufacturing system?
- 19.3 What are the three capabilities that a manufacturing system must possess in order to be flexible?
- 19.4 Name the four tests of flexibility that a manufacturing system must satisfy in order to be classified as flexible.
- 19.5 What is the dividing line between a flexible manufacturing cell and a flexible manufacturing system, in terms of the number of processing stations in the system?
- 19.6 What is the difference between a dedicated FMS and a random-order FMS?
- 19.7 What are the three basic components of a flexible manufacturing system?
- 19.8 Name the seven functions performed by human resources in an FMS.
- 19.9 What are the five functions of the material handling and storage system in a flexible manufacturing system?
- 19.10 What is the difference between the primary and secondary handling systems that are common in flexible manufacturing systems?
- 19.11 The text lists four categories of layout configurations that are found in flexible manufacturing systems. Name them.
- 19.12 What are the benefits that can be expected from a successful FMS installation?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Bottleneck Model

- 19.1 **(A)** A flexible machining cell consists of two machining workstations and a load/unload station. Station 1 is the load/unload station with one server (human worker). Station 2 consists of two identical CNC milling machines. Station 3 has one CNC drill press. The stations are connected by a part-handling system that has two work carriers. The mean transport time is 1.5 min. The FMC produces two parts, A and B. The part-mix fractions and process routings for the two parts are presented in the following table. The operation frequency $f_{ijk} = 1.0$ for all operations. Determine (a) maximum production rate of the FMS, (b) corresponding

production rates of each product, (c) utilization of each station, and (d) number of busy servers at each station. A spreadsheet calculator is recommended for this problem.

Part j	Part Mix p_j	Operation k	Description	Station i	Process Time T_{cijk}
A	0.4	1	Load	1	4 min
		2	Mill	2	30 min
		3	Drill	3	10 min
		4	Unload	1	2 min
B	0.6	1	Load	1	4 min
		2	Mill	2	40 min
		3	Drill	3	15 min
		4	Unload	1	2 min

- 19.2 (A)** A flexible manufacturing cell consists of two machining workstations plus a load/unload station. The load/unload station is station 1 with one server (human worker). Station 2 consists of one CNC machining center. Station 3 has one CNC drill press. The three stations are connected by a part-handling system that has one work carrier. The mean transport time is 2.0 min. The FMC produces three parts, A, B, and C. The part-mix fractions and process routings for the three parts are presented in the table below. The operation frequency is $f_{ijk} = 1.0$ for all operations. Determine (a) maximum production rate of the FMC, (b) corresponding production rates of each product, (c) utilization of each machine in the system, and (d) number of busy servers at each station. A spreadsheet calculator is recommended for this problem.

Part j	Part Mix p_j	Operation k	Description	Station i	Process Time T_{cijk}
A	0.2	1	Load	1	3 min
		2	Mill	2	20 min
		3	Drill	3	12 min
		4	Unload	1	2 min
B	0.3	1	Load	1	3 min
		2	Mill	2	15 min
		3	Drill	3	30 min
		4	Unload	1	2 min
C	0.5	1	Load	1	3 min
		2	Drill	3	14 min
		3	Mill	2	22 min
		4	Unload	1	2 min

- 19.3** Solve Problem 19.2 except the number of servers at station 2 (CNC milling machines) = 3 and the number of servers at station 3 (CNC drill presses) = 2. Note that with the increase in the number of machines from two to five, the FMC is now an FMS according to the definitions in Section 19.1.2. A spreadsheet calculator is recommended for this problem.
- 19.4** An FMS consists of three stations plus a load/unload station. Station 1 loads and unloads parts using two servers (material handling workers). Station 2 consists of two identical CNC horizontal milling machines. Station 3 consists of three identical CNC vertical milling machines. Station 4 consists of two identical CNC drill presses. The machines are connected

by a part-handling system that has two work carriers and a mean transport time = 2.0 min. The FMS produces four parts, A, B, C, and D, whose part-mix fractions and process routings are presented in the table below. The operation frequency is $f_{ijk} = 1.0$ for all operations. Determine (a) maximum production rate of the FMS, (b) utilization of each machine in the system, and (c) average utilization of the regular stations. A spreadsheet calculator is recommended for this problem.

Part j	Part Mix p_j	Operation k	Description	Station i	Process Time T_{cijk}
A	0.2	1	Load	1	4 min
		2	H. Mill	2	15 min
		3	V. Mill	3	14 min
		4	Drill	4	13 min
		5	Unload	1	3 min
B	0.2	1	Load	1	4 min
		2	Drill	4	12 min
		3	H. Mill	2	16 min
		4	V. Mill	3	11 min
		5	Drill	4	17 min
		6	Unload	1	3 min
C	0.25	1	Load	1	4 min
		2	H. Mill	2	10 min
		3	Drill	4	9 min
		4	Unload	1	3 min
D	0.35	1	Load	1	4 min
		2	V. Mill	3	18 min
		3	Drill	4	8 min
		4	Unload	1	3 min

- 19.5** Solve Problem 19.4 except the number of drill presses = 3. A spreadsheet calculator is recommended for this problem.
- 19.6** A semiautomated flexible manufacturing cell is used to produce three products, A, B, and C. The products are made by two automated processing stations followed by an assembly station. There is also a load/unload station. Material handling between stations is accomplished by mechanized carts that move tote bins containing the particular components to be processed and then assembled into a given product. The carts are kept busy while the tote bins are queued in front of the workstations. Each tote bin remains with the product throughout processing and assembly. The details of the FMC can be summarized as follows:

Station	Description	Number of Servers
1	Load and unload	2 human workers
2	Process X	1 automated server
3	Process Y	1 automated server
4	Assembly	2 human workers
5	Transport	Number of carriers to be determined

The product-mix fractions and station processing times for the parts are presented in the following table. The same station sequence is followed by all products: $1 \rightarrow 2 \rightarrow 3 \rightarrow 4 \rightarrow 1$.

Product j	Product Mix p_j	Station 1	Station 2	Station 3	Station 4	Station 1
A	0.25	3 min	10 min	13 min	5 min	2 min
B	0.45	3 min	5 min	8 min	10 min	2 min
C	0.30	3 min	7 min	6 min	8 min	2 min

The average cart transfer time between stations is 2.0 min. (a) What is the bottleneck station in the FMC, assuming that the material handling system is not the bottleneck? (b) At full capacity, what is the overall production rate of the system and the rate for each product? (c) What is the minimum number of carts required in the material handling system to keep up with the production workstations? (d) Compute the average utilization of the regular stations in the FMC. (e) What recommendations would you make to improve the efficiency and/or reduce the cost of operating the FMC? A spreadsheet calculator is recommended for this problem.

- 19.7 (A)** An FMS consists of four stations. Station 1 is a load/unload station with one server. Station 2 consists of three identical CNC milling machines. Station 3 consists of two identical CNC drill presses. Station 4 is an inspection station with one server that performs inspections on a sampling of the parts. The stations are connected by a part-handling system that has two work carriers and whose mean transport time = 2.0 min. The FMS produces four parts, A, B, C, and D. The part-mix fractions and process routings for the four parts are presented in the table below. Note that the operation frequency at the inspection station (f_{ijk}) is less than 1.0 to account for the fact that only a fraction of the parts are inspected. Determine (a) maximum production rate of the FMS, (b) corresponding production rate of each part, (c) utilization of each station in the system, and (d) average utilization of the regular stations (excluding the part-handling system). A spreadsheet calculator is recommended for this problem.

Part j	Part Mix p_j	Operation k	Description	Station i	Process Time t_{ijk}	Frequency f_{ijk}
A	0.1	1	Load	1	3.5 min	1.0
		2	Mill	2	20 min	1.0
		3	Drill	3	15 min	1.0
		4	Inspect	4	12 min	0.5
		5	Unload	1	1.5 min	1.0
B	0.2	1	Load	1	4 min	1.0
		2	Drill	3	16 min	1.0
		3	Mill	2	25 min	1.0
		4	Drill	3	14 min	1.0
		5	Inspect	4	15 min	0.2
		6	Unload	1	2 min	1.0
C	0.3	1	Load	1	3 min	1.0
		2	Drill	3	23 min	1.0
		3	Inspect	4	8 min	0.5
		4	Unload	1	1.5 min	1.0
D	0.4	1	Load	1	3 min	1.0
		2	Mill	2	30 min	1.0
		3	Inspect	4	12 min	0.333
		4	Unload	1	1.5 min	1.0

- 19.8** A flexible manufacturing system produces a family of 15 parts and consists of six station types, including the part-handling system. The number of servers and workloads for each

station are given in the table below. Determine (a) hourly production rate of the system and (b) utilization of each station. (c) If the number of machines at station 3 were increased from 2 to 3, what effect would this have on hourly production rate of the system? (d) If the number of carts at station 6 were reduced from 2 to 1, what effect would this have on hourly production rate of the system? (e) If the number of workers at station 1 were reduced from 2 to 1, what effect would this have on hourly production rate of the system? A spreadsheet calculator is recommended for parts (a) and (b) of this problem.

Station	Description	Number of Servers	Workload (min)
1	Load and unload	2 human workers	17.8
2	Mill	3 machines	34.4
3	Drill	2 machines	15.0
4	Turn	1 machine	10.5
5	Inspection	1 human worker	8.1
6	Part handling	2 carts	8.3

Extended Bottleneck Model

- 19.9 (A)** Use the extended bottleneck model to solve for the overall production rate, manufacturing lead time, and waiting time for the data in Problem 19.2 with the following number of parts in the system: (a) $N = 2$ parts and (b) $N = 4$ parts.
- 19.10** Use the extended bottleneck model to solve for the overall production rate, manufacturing lead time, and waiting time for the data in Problem 19.3 with the following number of parts in the system: (a) $N = 3$ parts and (b) $N = 6$ parts.
- 19.11** Use the extended bottleneck model to solve for the overall production rate, manufacturing lead time, and waiting time for the data in Problem 19.4 with the following number of parts in the system: (a) $N = 5$ parts, (b) $N = 8$ parts, and (c) $N = 12$ parts. (d) Also determine the average utilization of the regular workstations, excluding the part-handling system, for the three cases of N in (a), (b), and (c).
- 19.12** Use the extended bottleneck model to solve for the overall production rate, manufacturing lead time, and waiting time for the data in Problem 19.5 with the following number of parts in the system: (a) $N = 8$ parts, (b) $N = 11$ parts, and (c) $N = 15$ parts. (d) Also determine the overall utilization of the regular workstations, excluding the part-handling system, for the three cases of N in (a), (b), and (c).
- 19.13** For the data given in Problem 19.6, use the extended bottleneck model to develop the relationships for production rate R_p and manufacturing lead time MLT each as a function of the number of parts in the system N . Plot the relationships as in Figure 19.8.
- 19.14** A flexible manufacturing system is used to produce three products: A, B, and C. The FMS consists of a load/unload station, two automated processing stations, an inspection station, and an automated guided-vehicle system (AGVS) with an individual cart for each product. The conveyor carts remain with the parts during their time in the system, and therefore the mean transport time includes not only the move time, but also the average total processing time per part. The number of servers at each station is given in the following table:

Station 1	Load and unload	2 workers
Station 2	Process X	3 servers
Station 3	Process Y	4 servers
Station 4	Inspection	1 server
Transport system	Conveyor	8 carriers

All parts follow either of two routings, which are $1 \rightarrow 2 \rightarrow 3 \rightarrow 4 \rightarrow 1$ or $1 \rightarrow 2 \rightarrow 3 \rightarrow 1$, the difference being that inspections at station 4 are performed on only one part in four for each product ($f_{4jk} = 0.25$). The product mix and process times for the parts are presented in the table below:

Product j	Part Mix p_j	Station 1	Station 2	Station 3	Station 4	Station 1
A	0.2	5 min	15 min	25 min	20 min	4 min
B	0.3	5 min	10 min	30 min	20 min	4 min
C	0.5	5 min	20 min	10 min	20 min	4 min

The move time between stations is 2 min. (a) Using the bottleneck model, show that the conveyor system is the bottleneck in the present FMS configuration, and determine the overall production rate of the system. (b) Determine how many carts are required to eliminate the AGVS as the bottleneck. (c) With the number of carts determined in (b), use the extended bottleneck model to determine the production rate for the case when $N = 8$; that is, only eight parts are allowed in the system even though the AGVS has a sufficient number of carriers to handle more than eight. (d) How close are your answers in (a) and (c)? Why?

- 19.15** A group-technology cell is organized to produce a family of products. The cell consists of three processing stations, each with one server; an assembly station with 3 servers; and a load/unload station with 2 servers. A mechanized transfer system moves the products between stations. The transfer system has a total of 6 transfer carts. Each cart includes a workholder that holds the products during their processing and assembly, and therefore, each cart must remain with the product throughout processing and assembly. The cell resources can be summarized as follows:

Station	Description	Number of Servers
1	Load and unload	2 workers
2	Process X	1 server
3	Process Y	1 server
4	Process Z	1 server
5	Assembly	3 workers
6	Transport system	6 carriers

The GT cell is currently used to produce four products. All products follow the same routing, which is $1 \rightarrow 2 \rightarrow 3 \rightarrow 4 \rightarrow 5 \rightarrow 1$. The product mix and station times for the parts are presented in the table below:

Product j	Product Mix p_j	Station 1	Station 2	Station 3	Station 4	Station 5	Station 1
A	0.35	4 min	8 min	5 min	7 min	18 min	2.5 min
B	0.25	4 min	4 min	8 min	6 min	14 min	2.5 min
C	0.10	4 min	2 min	6 min	5 min	11 min	2.5 min
D	0.30	4 min	6 min	7 min	10 min	12 min	2.5 min

The average transfer between stations takes 2 min in addition to the time spent at each workstation. (a) Determine the bottleneck station in the GT cell and the critical value of N .

Determine the overall production rate, manufacturing lead time, and waiting time of parts in the cell, given that the number of parts in the system = N^* . If N^* is not an integer, use the integer that is closest to N^* . (b) Compute the utilizations of the six stations for part (a). (c) Compute the overall production rate, manufacturing lead time, and waiting time of parts in the cell, given that the number of parts in the system = $N^* + 4$. If N^* is not an integer, use the integer that is closest to $N^* + 4$. (d) Compute the utilizations of the six stations for part (c). (e) Determine the average manufacturing lead times for each product for the two cases: $N = N^*$ and $N = N^* + 4$. A spreadsheet calculator is recommended for parts (a), (b), and (d) of this problem.

- 19.16** A flexible manufacturing cell consists of a manual load/unload station, three CNC machines, and an automated guided vehicle system (AGVS) with two vehicles. The vehicles deliver parts to the individual machines, drop off the parts, and then go perform other work. The workstations are listed in the table below, where the AGVS is station 5.

Station	Description	Servers
1	Load and unload	1 worker
2	Milling	1 CNC milling machine
3	Drilling	1 CNC drill press
4	Grinding	1 CNC grinding machine
5	AGVS	2 vehicles

The FMC is used to machine four parts. The product mix, routings, and processing times for the parts are presented in the table below:

Part j	Part Mix p_j	Station Routing	Station 1	Station 2	Station 3	Station 4	Station 1
A	0.25	1 → 2 → 3 → 4 → 1	4 min	8 min	7 min	18 min	2 min
B	0.33	1 → 3 → 2 → 1	4 min	9 min	10 min	0	2 min
C	0.12	1 → 2 → 4 → 1	4 min	10 min	0	14 min	2 min
D	0.30	1 → 2 → 4 → 3 → 1	4 min	6 min	12 min	16 min	2 min

The mean travel time of the AGVS between any two stations in the FMC is 3.0 min, which includes the time required to transfer loads to and from the stations. Given that the loading on the system is maintained at 8 parts (8 work parts in the system at all times), use the extended bottleneck model to determine (a) the bottleneck station, (b) hourly production rate of the system (c) average time to complete a part and average waiting time, and (d) the average utilization of the regular stations in the system, not including the AGVS. A spreadsheet calculator is recommended for this problem.

Sizing the FMS

- 19.17 (A)** A flexible manufacturing cell is used to produce four parts. The FMC consists of one load/unload station and two automated processing stations (processes X and Y). The number of servers for each station type is to be determined. The FMS also includes an automated part-handling system with individual carts to transport parts between servers. The carts move the parts from one server to the next, drop them off, and proceed to the next

delivery task. Average time required per transfer is anticipated to be 3.5 min. The following table summarizes the FMS:

Station 1	Load and unload	Number of human servers (workers) to be determined
Station 2	Process X	Number of automated servers to be determined
Station 3	Process Y	Number of automated servers to be determined
Station 4	Transport system	Number of carts to be determined

All parts follow the same routing, which is $1 \rightarrow 2 \rightarrow 3 \rightarrow 1$. The product mix and processing times at each station are presented in the table below:

Product j	Product Mix p_j	Station 1	Station 2	Station 3	Station 1
A	0.1	3 min	23 min	25 min	2 min
B	0.3	3 min	16 min	18 min	2 min
C	0.4	3 min	19 min	10 min	2 min
D	0.2	3 min	35 min	13 min	2 min

Required production is 10 parts per hour, distributed according to the product mix indicated. Use the bottleneck model to determine (a) the minimum number of servers at each station and the minimum number of carts in the transport system that are required to satisfy production demand and (b) the utilization of each station for the answers in part (a). A spreadsheet calculator is recommended for this problem.

- 19.18** A flexible machining system is being planned that will consist of four workstations plus a part-handling system. Station 1 will be a load/unload station. Station 2 will consist of horizontal machining centers. Station 3 will consist of vertical machining centers. Station 4 will be an inspection station. For the part mix that will be processed by the FMS, the workloads at the four stations are as follows: $WL_1 = 7.5$ min, $WL_2 = 22.0$ min, $WL_3 = 18.0$ min, and $WL_4 = 10.2$ min. The workload of the part-handling system $WL_5 = 8.0$ min. The FMS will be operated 16 hr per day, 250 days per year. Maintenance will be performed during non-production hours, so uptime proportion (availability) is expected to be 97%. Annual production of the system will be 50,000 parts. Determine (a) the number of machines (servers) of each type (station) required to satisfy production requirements and (b) the utilization of each station. (c) What is the maximum possible production rate of the system if the bottleneck station were to operate at 100% utilization?
- 19.19** Consider the part mix, process routings, and processing times for the three parts in Problem 19.2. The FMS planned for this part family will operate 250 days per year and the anticipated availability of the system is 90%. Determine how many servers at each station will be required to achieve an annual production rate of 40,000 parts per year if (a) the FMS operates 8 hr per day, (b) 16 hr per day, and (c) 24 hr per day. (d) Which system configuration is preferred, and why? A spreadsheet calculator is recommended for this problem.
- 19.20** Consider the part mix, process routings, and processing times for the four parts in Problem 19.4. The FMS proposed to machine these parts will operate 20 hr per day, 250 days per year. Assume system availability = 95%. Determine (a) how many servers at each station will be required to achieve an annual production rate of 75,000 parts per year, and (b) the utilization of each workstation. (c) What is the maximum possible annual production rate of the system if the bottleneck station were to operate at 100% utilization? A spreadsheet calculator is recommended for this problem.

Quality Programs for Manufacturing

CHAPTER CONTENTS

- 20.1 Quality in Design and Manufacturing
- 20.2 Traditional and Modern Quality Control
 - 20.2.1 Traditional Quality Control
 - 20.2.2 The Modern View of Quality Control
- 20.3 Process Variability and Process Capability
 - 20.3.1 Process Variations
 - 20.3.2 Process Capability and Tolerances
- 20.4 Statistical Process Control
 - 20.4.1 Control Charts
 - 20.4.2 Other SPC Tools
 - 20.4.3 Implementing SPC
- 20.5 Six Sigma
 - 20.5.1 Overview and Statistical Basis of Six Sigma
 - 20.5.2 Measuring the Sigma Level
- 20.6 Taguchi Methods in Quality Engineering
 - 20.6.1 Robust Design
 - 20.6.2 The Taguchi Loss Function
- 20.7 ISO 9000
- Appendix 20A: The Six Sigma DMAIC Procedure
 - 20A.1 Define
 - 20A.2 Measure
 - 20A.3 Analyze
 - 20A.4 Improve
 - 20A.5 Control

In the United States, quality control (QC) has traditionally been concerned with detecting poor quality in manufactured products and taking corrective action to eliminate it. Operationally, QC has often been limited to inspecting the product and its components, and deciding whether the dimensions and other features conformed to design specifications. If they did, the product was shipped. If not, the product was reworked or scrapped. The modern view of quality control encompasses a broader scope of activities that are accomplished throughout the enterprise, not just by the inspection department. The quality programs described in this chapter reflect this modern view. The common objective of these programs is to assure that a product will satisfy or surpass the needs and requirements of the customer.

This part of the book contains three chapters dealing with quality control systems. The position of quality control systems in the larger production system is shown in Figure 20.1, which depicts QC as a manufacturing support system, but QC also includes inspection procedures and equipment that are used in the factory. Inspection is the subject of Chapters 21 and 22. Chapter 21 examines inspection principles and practices used in manufacturing systems, and Chapter 22 describes the various technologies used to accomplish inspection and measurement. The present chapter discusses several quality-related programs that are widely used throughout industry. The list of these programs is indicated in the chapter contents. The coverage begins with some general issues on quality and QC.

20.1 QUALITY IN DESIGN AND MANUFACTURING

Two aspects of quality in a manufactured product must be distinguished [9]: (1) product features and (2) freedom from deficiencies. Product features are the characteristics of a product that result from design; they are the functional and aesthetic features of the product intended to appeal to and provide satisfaction to the customer. In an automobile, these features include the size and style of the car, the arrangement of the dashboard, the fit and finish of the body, and similar aspects. They also include the available options for the customer to choose. Table 20.1 lists some of the important general product features.

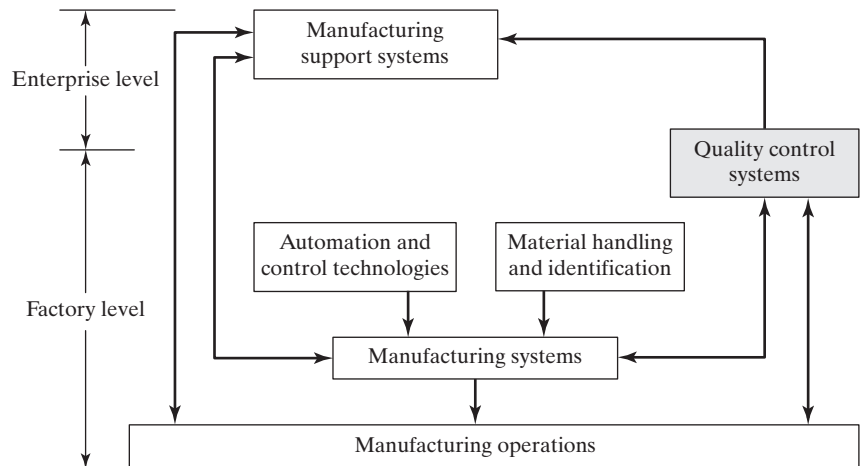


Figure 20.1 Quality control systems in the larger production system.

TABLE 20.1 Two Aspects of Quality (Compiled from Juran and Gryna [9] and Other Sources)

Product Features	Freedom from Deficiencies
Design configuration, size, weight	Absence of defects
Function and performance	Conformance to specifications
Distinguishing features of the model	Components within tolerance
Aesthetic appeal	No missing parts
Ease of use	No early failures
Availability of options	
Reliability and dependability	
Durability and long service life	
Serviceability	
Reputation of product and producer	

The sum of the features of a product usually defines its grade, which relates to the level in the market at which the product is aimed. Cars and most other products come in different grades. Certain cars provide basic transportation because that is what some customers want, while others are upscale for consumers willing to spend more to own a “better product.” The features are decided in design, and they generally determine the inherent cost of the product. Superior features and more of them translate to higher cost.

Freedom from deficiencies means that the product does what it is supposed to do (within the limitations of its design features) and that it is absent of defects and out-of-tolerance conditions (see Table 20.1). This aspect of quality applies to the individual components of the product as well as to the product itself. Achieving freedom from deficiencies means producing the product in conformance with design specifications, which is the responsibility of the manufacturing departments. Although the inherent cost to make a product is a function of its design, minimizing the product’s cost to the lowest possible level within the limits set by its design is largely a matter of avoiding defects, tolerance deviations, and other errors during production. Costs of these deficiencies include scrapped parts, larger lot sizes for scrap allowances, rework, reinspection, sortation, customer complaints and returns, warranty costs and customer allowances, lost sales, and lost goodwill in the marketplace.

To summarize, product features are the aspect of quality for which the design department is responsible. Product features determine to a large degree the price that a company can charge for its products. Freedom from deficiencies is the quality aspect for which the manufacturing departments are responsible. The ability to minimize these deficiencies strongly influences the cost of the product. These are generalities that oversimplify the way things work, because the responsibility for high quality extends well beyond the design and manufacturing functions in an organization.

20.2 TRADITIONAL AND MODERN QUALITY CONTROL

The principles and approaches to quality control have evolved during the 20th century. Early applications of QC were associated with the developing field of statistics. Since the 1980s, global competition and the demand of the consuming public for high-quality products have resulted in a modern view of quality control, which includes programs such as statistical process control, Six Sigma, and ISO 9000.

20.2.1 Traditional Quality Control

Traditional QC focused on inspection. In many factories, the only department responsible for quality control was the inspection department. Much attention was given to sampling and statistical methods, which were termed *statistical quality control*. In **statistical quality control** (SQC), inferences are made about the quality of a population of manufactured items (e.g., components, subassemblies, products) based on a sample taken from the population. The sample consists of one or more of the items drawn at random from the population. Each item in the sample is inspected for certain quality characteristics of interest. In the case of a manufactured part, these characteristics relate to the process or processes just completed. For example, a cylindrical part may be inspected for diameter following the turning operation that generated it.

Two statistical sampling methods dominate the field of statistical quality control: (1) control charts and (2) acceptance sampling. A **control chart** is a graphical technique in which statistics on one or more part or product characteristics of interest are plotted over time to determine if the process is behaving normally or abnormally. The chart has a central line that indicates the value of the process mean under normal operation. Abnormal process behavior is identified when the process parameter strays significantly from the process mean. Control charts are widely used in statistical process control, which is the topic of Section 20.4.

Acceptance sampling is a statistical technique in which a sample drawn from a batch of parts is inspected, and a decision is made whether to accept or reject the batch on the basis of the quality of the sample. Acceptance sampling is traditionally used for various purposes: (1) verifying quality of raw materials received from a vendor, (2) deciding whether or not to ship a batch of parts or products to a customer, and (3) inspecting parts between steps in a manufacturing sequence.

In statistical sampling, which includes both control charts and acceptance sampling, there are risks that defects will slip through the inspection process and that defective products will be delivered to the customer. With the growing demand for 100% good quality rather than even a small fraction of defective product, the use of sampling procedures has declined over the past several decades in favor of 100% automated inspection.

The management principles and practices that characterized traditional quality control included the following [5]:

- Customers are external to the organization. The sales and marketing department is responsible for relations with customers.
- The company is organized by functional departments. There is little appreciation of the interdependence of the departments in the larger enterprise. The loyalty and viewpoint of each department tends to be centered on itself rather than on the corporation.
- Quality is the responsibility of the inspection department. The quality function in the organization emphasizes inspection and conformance to specifications. Its objective is simple: eliminate defects.
- Inspection follows production. The objectives of production (to ship product) often clash with the objectives of quality control (to ship only good product).
- Knowledge of statistical quality control techniques reside only in the minds of the QC experts in the organization. Workers' responsibilities are limited to following instructions. Managers and technical staff do all the planning.

20.2.2 The Modern View of Quality Control

High quality is achieved by a combination of good management and good technology. The two factors must be integrated to achieve an effective quality system in an organization. The management factor is captured in the frequently used term *total quality management*. The technology factor includes traditional statistical tools combined with modern measurement and inspection technologies.

Total Quality Management. Total quality management (TQM) is a management approach that pursues three main objectives: (1) achieving customer satisfaction, (2) continuously improving, and (3) involving the entire workforce. These objectives contrast sharply with the practices of traditional management regarding quality control. Compare the following factors, which reflect the modern view of quality management, with the preceding list that characterizes the traditional approach to quality management:

- Quality is focused on customer satisfaction. Products are designed and manufactured with this quality focus. “Quality is customer satisfaction” defines the requirement for any product.¹ The product features must be established to achieve customer satisfaction. The product must be manufactured free of deficiencies.
- Included in the focus on customers is the notion that there are internal customers as well as external customers. External customers are those who buy the company’s products. Internal customers are departments or individuals inside the company who are served by other departments and individuals in the organization. The final assembly department is the customer of the parts production departments, the engineer is the customer of the technical staff support group, and so forth.
- The quality goals of the organization are driven by top management, which determines the overall attitude toward quality in a company. The quality goals of a company are not established in manufacturing; they are defined at the highest levels of the organization. Does the company want to simply meet specifications set by the customer, or does it want to make products that go beyond the technical specifications? Does it want to be known as the lowest price supplier, or as the highest quality producer in its industry? Answers to these kinds of questions define the quality goals of the company. These must be set by top management. Through the goals they define, the actions they take, and the examples they set, top management determines the overall attitude toward quality in the company.
- Quality control is not just the job of the inspection department; it is pervasive in the organization. It extends from the top of the organization through all levels. It is understood that product design has an important influence on product quality. Decisions made in product design directly impact the quality that can be achieved in manufacturing.
- In manufacturing, the view is that inspecting the product after it is made is not good enough. Quality must be built into the product. Production workers must inspect their own work and not rely on the inspection department to find their mistakes.
- The pursuit of high quality extends outside the immediate organization to suppliers. One of the tenets of a modern QC system is to develop close relationships with suppliers.
- High product quality is a process of continuous improvement. It is a never-ending chase to design better products and then to manufacture them better.

¹The statement is attributed to J. M. Juran [9].

Quality Control Technologies. Good technology also plays an important role in achieving high quality. Modern technologies in quality control include (1) quality engineering and (2) quality function deployment. Quality engineering is discussed in Section 20.6. The topic of quality function deployment is related to product design and is discussed in Section 23.3. Other technologies in modern quality control include (3) 100% automated inspection, (4) on-line inspection, (5) coordinate measurement machines for dimensional measurement, and (6) noncontact sensors such as machine vision for inspection. These topics are discussed in the following two chapters.

20.3 PROCESS VARIABILITY AND PROCESS CAPABILITY

Before describing the various quality programs, it is appropriate to discuss process variability, the reason for needing these programs. In any manufacturing operation, variability exists in the process output. In a machining operation, which is one of the most accurate manufacturing processes, the machined parts may appear to be identical, but close inspection reveals dimensional differences from one part to the next.

20.3.1 Process Variations

Manufacturing process variations can be divided into two types: (1) random and (2) assignable. Random variations result from intrinsic variability in the process, no matter how well designed or well controlled it is. All processes are characterized by these kinds of variations, if one looks closely enough. Random variations cannot be avoided; they are caused by factors such as inherent human variability from one operation cycle to the next, minor variations in raw materials, and machine vibration. Individually, these factors may not amount to much, but collectively the errors can be significant enough to cause trouble unless they are within the tolerances specified for the part. Random variations typically form a normal statistical distribution. The output of the process tends to cluster about the mean value, in terms of the product's quality characteristic of interest, such as part length or diameter. A large proportion of the population is centered around the mean, with fewer parts away from the mean. When the only variations in the process are of this type, the process is said to be *in statistical control*. This kind of variability will continue so long as the process is operating normally. It is when the process deviates from this normal operating condition that variations of the second type appear.

Assignable variations indicate an exception from normal operating conditions. Something has occurred in the process that is not accounted for by random variations. Reasons for assignable variations include operator mistakes, defective raw materials, tool failures, and equipment malfunctions. Assignable variations in manufacturing usually betray themselves by causing the output to deviate from the normal distribution. The process has become *out of statistical control*.

Consider the previous descriptions of random and assignable variations with reference to Figure 20.2. The variation of some part characteristic of interest is shown at four points in time, t_0 , t_1 , t_2 , and t_3 . These are the times during operation of the process when samples are taken to assess the distribution of values of the part characteristic. At sampling time t_0 , the process is operating in statistical control, and the variation in the part characteristic follows a normal distribution whose mean = μ_0 and standard deviation = σ_0 . This represents the inherent variability of the process during normal

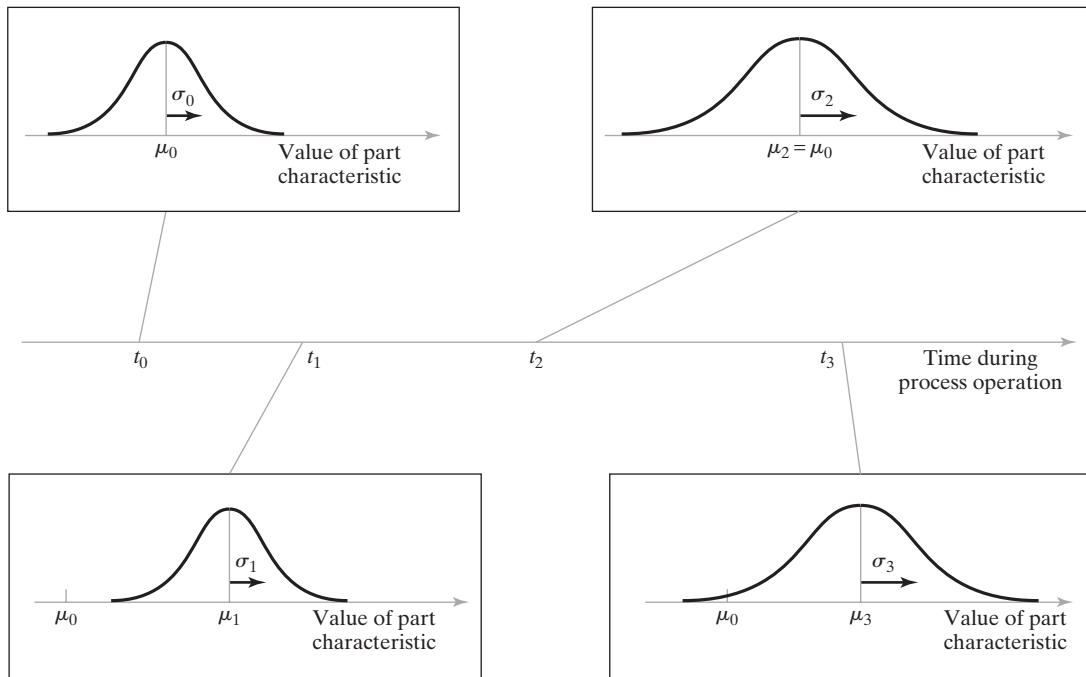


Figure 20.2 Distribution of values of a part characteristic of interest at four times during process operation: at t_0 , process is in statistical control; at t_1 , process mean has increased; at t_2 , process standard deviation has increased; and at t_3 , both process mean and standard deviation have increased.

operation. At sampling time t_1 , an assignable variation has been introduced into the process, which is manifested by an increase in the process mean ($\mu_1 > \mu_0$). The process standard deviation seems unchanged ($\sigma_1 = \sigma_0$). At time t_2 , the process mean seems to have assumed its normal value ($\mu_2 = \mu_0$), but the variation about the process mean has increased ($\sigma_2 > \sigma_0$). Finally, at sampling time t_3 , both the mean and standard deviation of the process have increased ($\mu_3 > \mu_0$ and $\sigma_3 > \sigma_0$).

Using statistical methods based on the preceding distinction between random and assignable variations, it should be possible to periodically observe the process by collecting measurements of the part characteristic of interest and thereby detect when the process has gone out of statistical control. The most applicable statistical method for doing this is the control chart (Section 20.4.1).

20.3.2 Process Capability and Tolerances

Process capability relates to the normal variations inherent in the output when the process is in statistical control. By definition, **process capability** equals ± 3 standard deviations about the mean output value (a total range of 6 standard deviations):

$$PC = \mu \pm 3\sigma \tag{20.1}$$

where PC = process capability; μ = process mean, which is set at the nominal value of the product characteristic; and σ = standard deviation of the process. Assumptions underlying

this definition are that (1) the output is normally distributed and (2) steady-state operation has been achieved and the process is in statistical control. Under these assumptions, 99.73% of the parts produced will have output values that fall within $\pm 3.0\sigma$ of the mean.

The process capability of a given manufacturing operation is not always known (in fact, it is rarely known), and the characteristic of interest must be measured to assess it. These measurements form a sample, and so the parameters μ and σ in Equation (20.1) must be estimated from the sample average and the sample standard deviation, respectively. The sample average \bar{x} is given by

$$\bar{x} = \frac{\sum_{i=1}^n x_i}{n} \quad (20.2)$$

and the sample standard deviation s can be calculated from

$$s = \sqrt{\frac{\sum_{i=1}^n (x_i - \bar{x})^2}{n - 1}} \quad (20.3)$$

where x_i = measurement i of the part characteristic of interest and n = the number of measurements in the sample, $i = 1, 2, \dots, n$. The values of \bar{x} and s are then substituted for μ and σ in Equation (20.1) to yield the following best estimate of process capability:

$$PC = \bar{x} \pm 3s \quad (20.4)$$

The issue of tolerances is germane to this discussion of process capability. Design engineers tend to assign dimensional tolerances to components and assemblies based on their judgment of how size variations will affect function and performance. The factors in favor of wide and narrow tolerances are summarized in Table 20.2.

The design engineer should consider the relationship between the tolerance on a given dimension (or other part characteristic) and the process capability of the operation producing the dimension. Ideally, the specified tolerance should be greater than the process capability. If function and available processes prevent this, then a sortation operation

TABLE 20.2 Factors in Favor of Wide and Narrow Tolerances

Wide (Loose) Tolerances	Narrow (Tight) Tolerances
<p>Yield in manufacturing is increased. Fewer defects are produced. Fabrication of special tooling (dies, jigs, molds, etc.) is easier. Tools are therefore less costly. Setup and tooling adjustment is easier. Fewer production operations may be needed. Less skilled, lower cost labor can be used. Machine maintenance may be reduced. The need for inspection may be reduced. Overall manufacturing cost is reduced.</p>	<p>Parts interchangeability is increased in assembly. Fit and finish of the assembled product is better, for greater aesthetic appeal. Product functionality and performance are likely to be improved. Durability and reliability of the product may be increased. Serviceability of the product in the field is likely to be improved due to increased parts interchangeability. Product may be safer in use.</p>

TABLE 20.3 Defect Rate as a Function of Process Capability Index for a Process Operating in Statistical Control

Process Capability Index (PCI)	Tolerance = Number of Standard Deviations	Defect Rate (%)	Defects per Million	Comments
0.333	± 1.0	31.74	317,400	Sortation required
0.667	± 2.0	4.56	45,600	Sortation required
1.000	± 3.0	0.27	2,700	Tolerance = PCI
1.333	± 4.0	0.0063	63	Defects are infrequent
1.667	± 5.0	0.000057	0.57	Defects are rare
2.000	± 6.0	0.0000002	0.002	Virtually no defects

may have to be included in the manufacturing sequence to separate parts that are within tolerance from those that are beyond. This sortation step increases part cost.

When design tolerances are specified as being equal to process capability, the upper and lower boundaries of this range define the *natural tolerance limits*. It is useful to know the ratio of the specified tolerance range relative to the process capability. This ratio, called the *process capability index*, is defined as

$$PCI = \frac{UTL - LTL}{6\sigma} \quad (20.5)$$

where PCI = process capability index, UTL = upper tolerance limit of the tolerance range, LTL = lower tolerance limit, and 6σ = range of the natural tolerance limits. The underlying assumptions in this definition are that (1) bilateral tolerances are used and (2) the process mean is set equal to the nominal design specification, so that the numerator and denominator in Equation (20.5) are centered about the same value.

Table 20.3 shows how defect rate (fraction that is out of tolerance) varies with process capability index. It is clear that any increase in the tolerance range will reduce the percentage of nonconforming parts. The desire to achieve very low fraction defect rates has led to the popular notion of “six sigma” limits in quality control (bottom row in Table 20.3). Achieving six sigma limits virtually eliminates defects in manufactured product. The Six Sigma quality program is covered in Section 20.5 and Appendix 20A.

20.4 STATISTICAL PROCESS CONTROL

Statistical process control (SPC) involves the use of various methods to measure and analyze a process. SPC methods are applicable in both manufacturing and nonmanufacturing situations, but most of the applications are in manufacturing. The overall objectives of SPC are to (1) improve the quality of the process output, (2) reduce process variability and achieve process stability, and (3) solve processing problems. There are seven principal methods and tools used in statistical process control, sometimes referred to as the “magnificent seven” [12]: (1) control charts, (2) histograms, (3) Pareto charts, (4) check sheets, (5) defect concentration diagrams, (6) scatter diagrams, and (7) cause-and-effect diagrams. Most of these tools are statistical and/or technical in nature. However, it should be mentioned that statistical process control includes not only the magnificent seven tools. There are also nontechnical aspects in the implementation of SPC. To be

successful, statistical process control must include a commitment to quality that pervades the organization from senior management to the starting worker on the production line.

This section emphasizes the seven SPC tools. A more detailed treatment of statistical process control is presented in several of the references [5], [6], [9], [12], [15], and [17].

20.4.1 Control Charts

Control charts are the most widely used method in statistical process control. The underlying principle of control charts is that the variations in any process divide into two types, as described in Section 20.3.1: (1) random variations, which are the only variations present if the process is in statistical control; and (2) assignable variations, which indicate a departure from statistical control. The purpose of a control chart is to identify when the process has gone out of statistical control, thus signaling the need for corrective action.

A **control chart** is a graphical technique in which statistics computed from measured values of a certain process output characteristic (e.g., part dimension) are plotted over time to determine if the process remains in statistical control. The general form of the control chart is illustrated in Figure 20.3. The chart consists of three horizontal lines that remain constant over time: a center line (*CL*), a lower control limit (*LCL*), and an upper control limit (*UCL*). The center line is usually set at the nominal design value of the part or product characteristic of interest, and the upper and lower control limits are generally set at ± 3 standard deviations of the nominal value.

It is highly unlikely that a sample drawn from the process lies outside the upper or lower control limits while the process is in statistical control. Therefore, if it happens that a sample value does fall outside these limits, it is interpreted to mean that the process is out of control. After an investigation to determine the reason for the out-of-control condition, appropriate corrective action is taken to eliminate the condition. Alternatively, if the process is operating in statistical control, and there is no evidence of undesirable trends in the data, then no adjustments should be made since they would introduce an assignable variation to the process. The philosophy “if it ain’t broke, don’t fix it” is applicable in control charts.

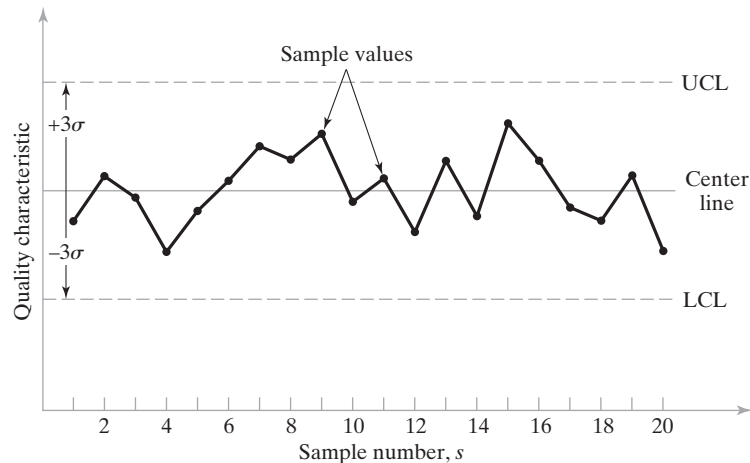


Figure 20.3 Control chart.

There are two basic types of control charts: (1) control charts for variables, and (2) control charts for attributes. Control charts for variables require a measurement of the quality characteristic of interest. Control charts for attributes simply require a determination of either the fraction of defects in the sample or the number of defects in the sample.

Control Charts for Variables. A process that is out of statistical control manifests this condition in the form of significant changes in (1) process mean and/or (2) process variability. Corresponding to these possibilities, there are two principal types of control charts for variables: (1) \bar{x} chart and (2) R chart. The \bar{x} chart (call it “x-bar chart”) is used to plot the average measured value of a certain quality characteristic for each of a series of samples taken from the process. It indicates how the process mean changes over time. The R chart plots the range of each sample, thus monitoring the variability of the process and indicating whether it changes over time.

A suitable quality characteristic of the process must be selected as the variable to be monitored in the \bar{x} and R charts. In a mechanical process, this might be a shaft diameter or other critical dimension. Measurements of the process itself must be used to construct the two control charts.

With the process operating smoothly and absent of assignable variations, a series of samples ($m = 20$ or more is generally recommended) of small size (e.g., $n = 5$ parts per sample) are collected and the characteristic of interest is measured for each part. The following procedure is used to construct the center line, LCL , and UCL for each chart:

1. Compute the mean \bar{x} and range R for each of the m samples.
2. Compute the grand mean $\bar{\bar{x}}$, which is the mean of the \bar{x} values for the m samples; this will be the center line for the \bar{x} chart; $CL = \bar{\bar{x}}$.
3. Compute \bar{R} which is the mean of the R values for the m samples; this will be the center line for the R chart, $CL = \bar{R}$.
4. Determine the upper and lower control limits, LCL and UCL , for the \bar{x} and R charts. Values of standard deviation can be estimated from the sample data using Equation (20.3) to compute these control limits. However, an easier approach is based on statistical factors tabulated in Table 20.4 that have been derived

TABLE 20.4 Constants for the \bar{x} and R Charts

Sample Size N	\bar{x} Chart	R Chart	
	A_2	D_3	D_4
3	1.023	0	2.574
4	0.729	0	2.282
5	0.577	0	2.114
6	0.483	0	2.004
7	0.419	0.076	1.924
8	0.373	0.136	1.864
9	0.337	0.184	1.816
10	0.308	0.223	1.777

specifically for these control charts. Values of the factors depend on sample size n . For the \bar{x} chart,

$$LCL = \bar{\bar{x}} - A_2\bar{R} \quad (20.6a)$$

$$UCL = \bar{\bar{x}} + A_2\bar{R} \quad (20.6b)$$

and for the R chart,

$$LCL = D_3\bar{R} \quad (20.7a)$$

$$UCL = D_4\bar{R} \quad (20.7b)$$

EXAMPLE 20.1 \bar{x} and R Charts

Although 20 or more samples are recommended, a smaller number is used here to illustrate the calculations. Suppose eight samples ($m = 8$) of size 5 ($n = 5$) have been collected from a manufacturing process that is in statistical control, and the dimension of interest has been measured for each part. Determine the values of the center line, LCL , and UCL to construct the \bar{x} and R charts. The calculated values of \bar{x} and R for each sample are given here (measured values are in centimeters), which is step (1) in the procedure:

s	1	2	3	4	5	6	7	8
\bar{x}	2.008	1.998	1.993	2.002	2.001	1.995	2.004	1.999
R	0.027	0.011	0.017	0.009	0.014	0.020	0.024	0.018

Solution: In step (2), the grand mean of the sample averages is computed.

$$\bar{\bar{x}} = \frac{2.008 + 1.998 + 1.993 + 2.002 + 2.001 + 1.995 + 2.004 + 1.999}{8}$$

$$= 2.000 \text{ cm}$$

$$CL = \mathbf{2.000 \text{ cm}}$$

In step (3), the mean value of R is computed.

$$R = \frac{0.027 + 0.011 + 0.017 + 0.009 + 0.014 + 0.020 + 0.024 + 0.018}{8}$$

$$= 0.0175 \text{ cm}$$

$$CL = \mathbf{0.0175 \text{ cm}}$$

In step (4), the values of LCL and UCL are determined based on factors in Table 20.4. First, using Equation (20.6) for the \bar{x} chart,

$$LCL = 2.000 - 0.577(0.0175) = \mathbf{1.9899 \text{ cm}}$$

$$UCL = 2.000 + 0.577(0.0175) = \mathbf{2.0101 \text{ cm}}$$

And for the R chart using Equation (20.7),

$$LCL = 0(0.0175) = \mathbf{0}$$

$$UCL = 2.114(0.0175) = \mathbf{0.0370 \text{ cm}}$$

The two control charts are shown in Figure 20.4 with the sample data plotted in the charts.

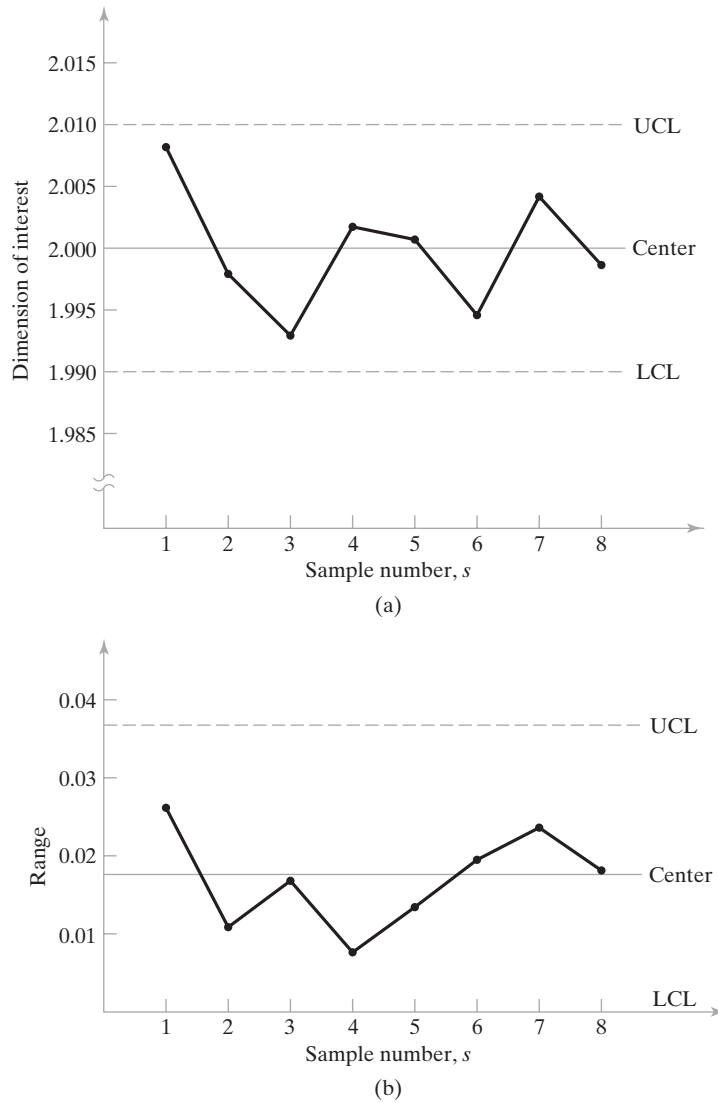


Figure 20.4 Control charts for Example 20.1: (a) \bar{x} chart and (b) R chart.

Control Charts for Attributes. Control charts for attributes monitor the fraction defect rate or the number of defects in the sample as the plotted statistic. Examples of these kinds of attributes include fraction of nonconforming parts in a sample, proportion of plastic molded parts that have flash, number of defects per automobile, and number of flaws in a roll of sheet steel. Inspection procedures that involve GO/NO-GO gaging are included in this group since they determine whether a part is good or bad.

The two principal types of control charts for attributes are (1) the p chart, which plots the fraction defect rate in successive samples, and (2) the c chart, which plots the number of defects, flaws, or other nonconformities per sample.

In the p chart, the quality characteristic of interest is the proportion (p for proportion) of nonconforming or defective units. For each sample, this proportion p_i is the ratio of the number of nonconforming or defective items d_i over the number of units in the sample n (assuming samples are of equal size in constructing and using the control chart),

$$p_i = \frac{d_i}{n} \quad (20.8)$$

where i is used to identify the sample. If the p_i values for a sufficient number of samples are averaged, the mean value \bar{p} is a reasonable estimate of the true value of p for the process. The p chart is based on the binomial distribution, where p is the probability of a nonconforming unit. The center line in the p chart is the computed value of \bar{p} for m samples of equal size n collected while the process is operating in statistical control:

$$\bar{p} = \frac{\sum_{i=1}^m p_i}{m} \quad (20.9)$$

The control limits are computed as three standard deviations on either side of the center line. Thus,

$$LCL = \bar{p} - 3\sqrt{\frac{\bar{p}(1 - \bar{p})}{n}} \quad (20.10a)$$

$$UCL = \bar{p} + 3\sqrt{\frac{\bar{p}(1 - \bar{p})}{n}} \quad (20.10b)$$

where the standard deviation of \bar{p} in the binomial distribution is given by

$$\sigma_p = \sqrt{\frac{\bar{p}(1 - \bar{p})}{n}} \quad (20.11)$$

If the value of \bar{p} is relatively low and the sample size n is small, then the lower control limit computed by the first of these equations is likely to be a negative value. In this case, let $LCL = 0$ (the fraction defect rate cannot be less than zero).

EXAMPLE 20.2 p Chart

Ten samples ($m = 10$) of 20 parts each ($n = 20$) have been collected. In one sample there were no defects; in three samples there was one defect; in five samples there were two defects; and in one sample there were three defects. Determine the center line, lower control limit, and upper control limit for the p chart.

Solution: The center line of the control chart can be calculated by summing the total number of defects found in all samples and dividing by the total number of parts sampled:

$$\bar{p} = \frac{1(0) + 3(1) + 5(2) + 1(3)}{10(20)} = \frac{16}{200} = 0.08 = 8\%$$

$$CL = 8\%$$

The lower control limit is given by Equation (20.10a):

$$\begin{aligned} LCL &= 0.08 - 3\sqrt{\frac{0.08(1 - 0.08)}{20}} = 0.08 - 3(0.06066) \\ &= 0.08 - 0.182 \rightarrow 0\% \end{aligned}$$

The upper control limit is given by Equation (20.10b):

$$\begin{aligned} UCL &= 0.08 + 3\sqrt{\frac{0.08(1 - 0.08)}{20}} = 0.08 + 3(0.06066) = 0.08 + 0.182 \\ &= 0.262 = 26.2\% \end{aligned}$$

In the c chart (c for count), the number of defects in the sample is plotted over time. The sample may be a single product such as an automobile, and c = number of quality defects found during final inspection, or the sample may be a length of carpeting at the factory prior to cutting, and c = number of imperfections per 100 meters. The c chart is based on the Poisson distribution, where c = parameter representing the number of events occurring within a defined sample space (e.g., defects per car, imperfections per unit length of carpet). The best estimate of the true value of c is the mean value over a large number of samples drawn while the process is in statistical control:

$$\bar{c} = \frac{\sum_{i=1}^m c_i}{m} \quad (20.12)$$

This value of \bar{c} is used as the center line for the control chart. In the Poisson distribution, the standard deviation is the square root of parameter c . Thus, the control limits are

$$LCL = \bar{c} - 3\sqrt{\bar{c}} \quad (20.13a)$$

$$UCL = \bar{c} + 3\sqrt{\bar{c}} \quad (20.13b)$$

EXAMPLE 20.3 *c* Chart

A continuous plastic extrusion process is operating in statistical control. Eight hundred meters of the extrudate have been examined and a total of 14 surface defects have been detected in that length. Develop a *c* chart for the process, using defects per hundred meters as the quality characteristic of interest.

Solution: The average value of the parameter *c* can be determined by using Equation (20.12):

$$\bar{c} = \frac{14}{8} = 1.75$$

This will be used as the center line for the control chart: $CL = 1.75$

The lower and upper control limits are given by Equations (20.13a) and (20.13b):

$$LCL = 1.75 - 3\sqrt{1.75} = 1.75 - 3(1.323) = 1.75 - 3.969 \rightarrow \mathbf{0 \text{ defects}}$$

$$UCL = 1.75 + 3\sqrt{1.75} = 1.75 + 3(1.323) = 1.75 + 3.969 = \mathbf{5.719 \text{ defects}}$$

Interpreting the Control Charts. When control charts are used to monitor process quality, random samples are drawn from the process of the same size *n* used to construct the charts. For \bar{x} and *R* charts, the \bar{x} and *R* values of the measured characteristic are plotted on the control chart. By convention, the points are usually connected as in the figures displayed in this chapter. To interpret the data, one looks for signs that indicate the process is not in statistical control. The most obvious sign is when \bar{x} or *R* (or both) lies outside the *LCL* or *UCL* limits. This indicates an assignable cause such as bad starting materials, an inexperienced operator, wrong equipment setting, broken tooling, or similar factors. An out-of-limit \bar{x} indicates a shift in the process mean. An out-of-limit *R* shows that the variability of the process has probably changed. The usual effect is that *R* increases, indicating variability has risen.

Less obvious conditions may be revealed even though the sample points lie within $\pm 3\sigma$ limits. These conditions include (1) trends or cyclical patterns in the data, which may mean wear or other factors that occur as a function of time; (2) sudden changes in the average values of the data; and (3) points consistently near the upper or lower limits. The same kinds of interpretations that apply to the \bar{x} chart and *R* chart also apply to the *p* chart and *c* chart.

Montgomery [12] provides the following list of indicators that a process is likely to be out of statistical control and that corrective action should be taken: (1) one point that lies outside the *UCL* or *LCL*, (2) two out of three consecutive points that lie beyond ± 2 sigma on one side of the center line of the control chart, (3) four out of five consecutive points that lie beyond ± 1 sigma on one side of the center line of the control chart, (4) eight consecutive points that lie on one side of the center line, and (5) six consecutive points in which each point is always higher or always lower than its predecessor.

Control charts serve as the feedback loop in statistical process control, as suggested by Figure 20.5. They represent the measurement step in process control. If the control chart indicates that the process is in statistical control, then no action is taken. However, if the process is identified as being out of statistical control, then the cause of the problem must be identified and corrective action must be taken.

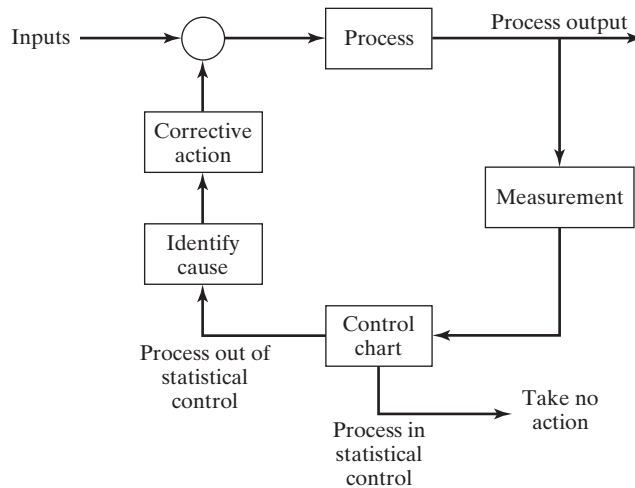


Figure 20.5 Control charts used as the feedback loop in statistical process control.

20.4.2 Other SPC Tools

Although control charts are the most commonly used tool in statistical process control, other tools are also important. Each has its own area of application. This section covers the remaining six of the magnificent seven.

Histograms. The histogram is a basic graphical tool in statistics. After the control chart, it is probably the most important member of the SPC tool kit. A histogram is a statistical graph consisting of bars representing different values or ranges of values, in which the length of each bar is proportional to the frequency or relative frequency of the value or range, as shown in Figure 20.6. It is a graphical display of the frequency distribution of the numerical data. What makes the histogram such a useful statistical tool is that it enables an analyst to quickly visualize the features of a complete set of data. These features include (1) the shape of the distribution, (2) any central tendency exhibited by the distribution, (3) approximations of the mean and mode of the distribution, and (4) the amount of scatter or spread in the data. With regard to Figure 20.6, one can see that the distribution is normal (in all likelihood), and that the mean is around 2.00. The standard deviation can be approximated by taking the range of values shown in the histogram ($2.025 - 1.975$) and dividing by 6, based on the fact that nearly the entire distribution (99.73%) is contained within $\pm 3\sigma$ of the mean value in a normal distribution. This gives a σ value of around 0.008.

Pareto Charts. A Pareto chart is a special form of histogram, illustrated in Figure 20.7, in which attribute data are arranged according to some criteria such as cost or value. When appropriately used, it provides a graphical display of the tendency for a small proportion of a given population to be more valuable than the much larger majority. This tendency is sometimes referred to as *Pareto's Law*, which can be succinctly stated, “the vital few and the trivial many.”² The “law” was identified by Vilfredo Pareto

²The statement is attributed to J. Juran [3].

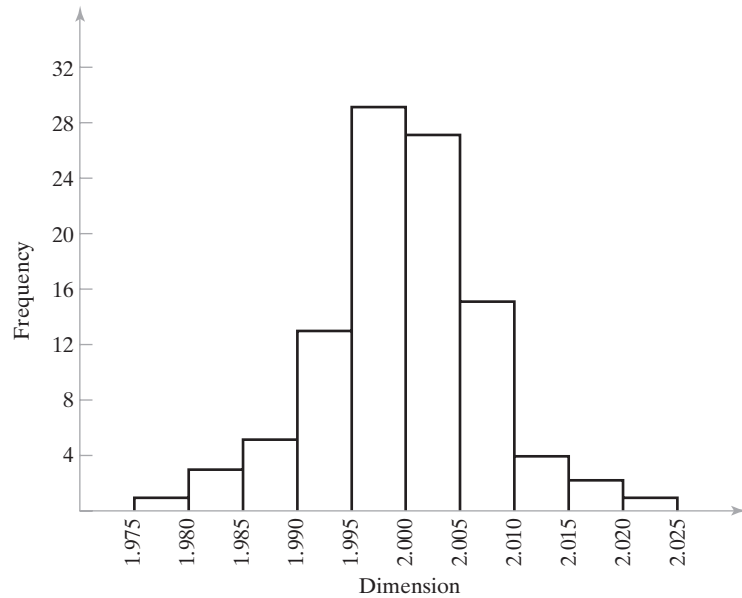


Figure 20.6 Histogram of data collected from the process in Example 20.1.

(1848–1923), an Italian economist and sociologist who studied the distribution of wealth in Italy and found that most of it was held by a small percentage of the population.

Pareto's Law applies not only to the distribution of wealth, but to many other distributions as well. The law is often identified as the 80–20% rule (although exact percentages may differ from 80 and 20): 80% of the wealth of a nation is in the hands

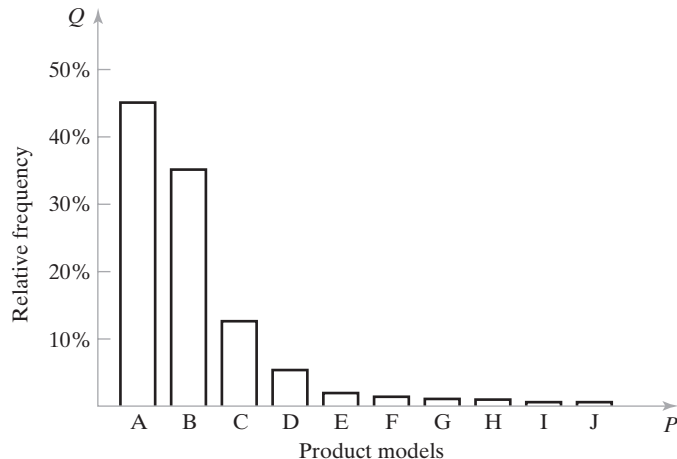


Figure 20.7 Typical (hypothetical) Pareto distribution of a factory's production output. Although there are ten models produced, two of the models account for 80% of the total units. This chart is sometimes referred to as a P – Q chart, where P = products and Q = quantity of production.

of 20% of its people; 80% of inventory value is accounted for by 20% of the items in inventory; 80% of sales revenues are generated by 20% of the customers; and 80% of a factory's production output is concentrated in only 20% of its product models (as in Figure 20.7). What is suggested by Pareto's Law is that the most attention and effort in any study or project should be focused on the smaller proportion of the population that is the most important.

Check Sheets. A check sheet (not to be confused with "check list") is a data-gathering tool generally used in the preliminary stages of the study of a quality problem. The operator running the process (e.g., the machine operator) is often given the responsibility for recording the data on the check sheet, and the data is often recorded in the form of simple checkmarks (hence, the check sheet's name).

Check sheets can take many different forms, depending on the problem situation and the ingenuity of the analyst. The form should be designed to allow some interpretation of results directly from the raw data, although subsequent data analysis may be necessary to recognize trends, diagnose the problem, or identify areas for further study.

Defect Concentration Diagrams. A defect concentration diagram is a drawing of the product (or part), with all relevant views displayed, onto which have been sketched the various defect types at the locations where each occurred. An analysis of the defect types and corresponding locations can identify the underlying causes of the defects.

Montgomery [12] describes a case study involving the final assembly of refrigerators that were plagued by surface defects. A defect concentration diagram (Figure 20.8) was utilized to analyze the problem. The defects were clearly shown to be concentrated around the middle sections of the refrigerators. Upon investigation, it was learned that a belt was wrapped around each unit for material handling purposes. It became evident that the defects were caused by the belt, and corrective action was taken to improve the handling method.

Scatter Diagrams. In many industrial manufacturing operations, it is desired to identify a possible relationship between two process variables. The scatter diagram is useful in this regard. A scatter diagram is an x - y plot of the data taken of the two variables

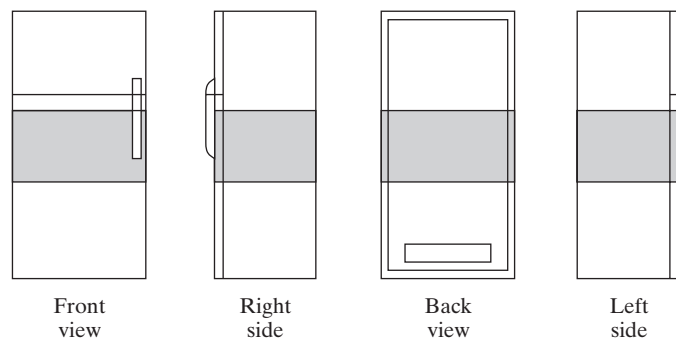


Figure 20.8 Defect concentration diagram showing four views of refrigerator with locations of surface defects indicated in cross-hatched areas.

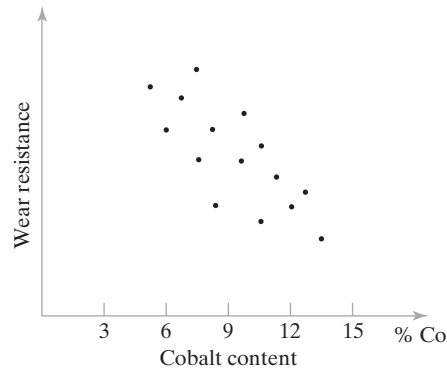


Figure 20.9 Scatter diagram showing the effect of cobalt binder content on wear resistance of a cemented carbide cutting tool insert.

in question, as illustrated in Figure 20.9. The data are plotted as pairs; for each x_i value, there is a corresponding y_i value. The shape of the data points considered in aggregate often reveals a pattern or relationship between the two variables. For example, the scatter diagram in Figure 20.9 indicates that a negative correlation exists between cobalt content and wear resistance of a cemented carbide cutting tool. As cobalt content increases, wear resistance decreases. One must be circumspect in using scatter diagrams and in extrapolating the trends that might be indicated by the data. For instance, it might be inferred from the diagram that a cemented carbide tool with zero cobalt content would possess the highest wear resistance of all. However, cobalt serves as an essential binder in the pressing and sintering process used to fabricate cemented carbide tools, and a minimum level of cobalt is necessary to hold the tungsten carbide particles together in the final product. Another reason why caution is recommended in the use of the scatter diagram is that only two variables are plotted. There may be other variables in the process whose importance in determining the output is far greater than the two variables displayed.

Cause-and-Effect Diagrams. The cause-and-effect diagram is a graphical-tabular chart used to list and analyze the potential causes of a given problem. It is not really a statistical tool like the preceding tools. As shown in Figure 20.10, the diagram consists of a central stem leading to the effect (the problem), with multiple branches coming off the stem listing the various groups of possible causes of the problem. Owing to its characteristic appearance, the cause-and-effect diagram is also known as a *fishbone diagram*. In application, the cause-and-effect diagram is developed by a quality team. The team then attempts to determine which causes are most consequential and how to take corrective action against them.

20.4.3 Implementing SPC

There is more to successful implementation of statistical process control than the seven SPC tools. The tools provide the mechanism by which SPC can be implemented, but the mechanism requires a driving force. The driving force in implementing SPC is management's commitment to quality and the process of continuous improvement. Through its

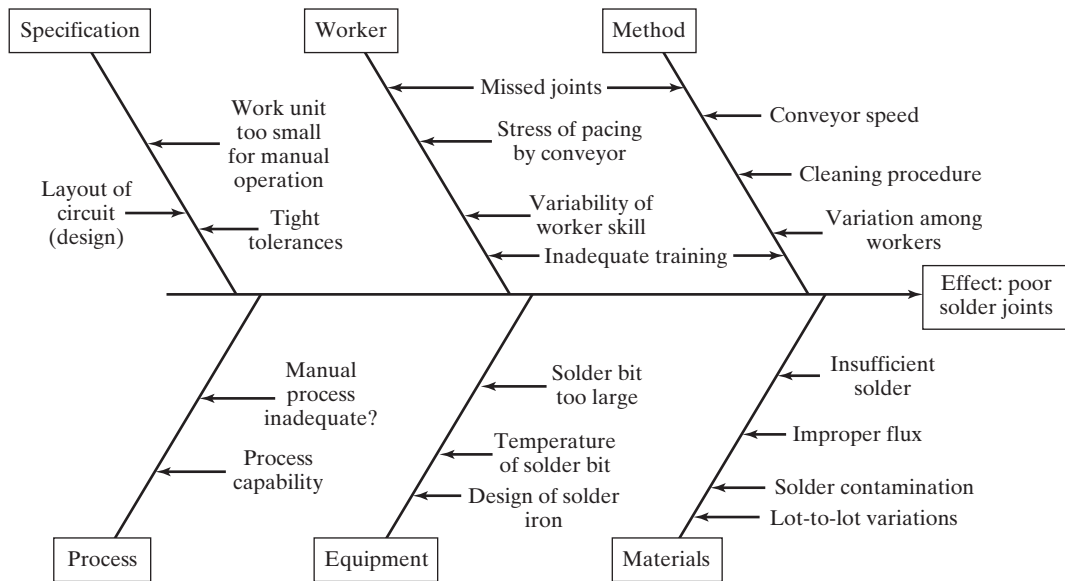


Figure 20.10 Cause-and-effect diagram for a manual soldering operation. The diagram indicates the effect (the problem is poor solder joints) at the end of the arrow and the possible causes are listed on the branches leading toward the effect.

involvement and example, management drives the successful implementation of SPC. Although management is the most important ingredient, there are other factors that play a role. Five elements usually present in a successful SPC program can be identified as follows in their order of importance, based on Montgomery [12]:

1. *Management commitment and leadership.* This is the most important element. Management sets the example for others in the organization to follow. Continuous quality improvement is a management-driven process.
2. *Team approach to problem solving.* Solving quality problems in production usually requires the attention and expertise of more than one person. It is difficult for one individual, acting alone, to make the necessary changes to solve a quality problem. Teams whose members contribute a broad pool of knowledge and skills are the most effective approach to problem solving.
3. *SPC training for all employees.* Employees at all levels in the organization from the chief executive officer to the starting production worker must be knowledgeable about the tools of SPC so that they can apply the tools in all functions of the enterprise.
4. *Emphasis on continuous improvement.* Due to the commitment and example of management, the process of continuous improvement is pervasive throughout the organization.
5. *A recognition and communication system.* Finally, there should be a mechanism for recognizing successful SPC efforts and communicating them throughout the organization.

20.5 SIX SIGMA³

Six Sigma is the name of a quality-focused program that utilizes worker teams to accomplish projects aimed at improving an organization's operational performance. The first Six Sigma program was developed and implemented by Motorola Corporation around 1980. It has been widely adopted by many companies in the United States. In the normal distribution, six sigma implies near perfection in a process, and that is the goal of a Six Sigma program. To operate at the six sigma level over the long term, a process must be capable of producing no more than 3.4 defects per million, where a defect refers to anything that is outside of customer specifications. Six Sigma projects can be applied to any manufacturing, service, or business processes that affect customer satisfaction. There is a strong emphasis on customer satisfaction in Six Sigma, and customers are both internal and external.

20.5.1 Overview and Statistical Basis of Six Sigma

The general goals of Six Sigma and the improvement projects performed under its banner are (1) better customer satisfaction, (2) high quality products and services, (3) reduced defects, (4) improved process capability through reduction in process variations, (5) continuous improvement, and (6) cost reduction through more effective and efficient processes.

Worker teams who participate in a Six Sigma project are trained in the use of statistical and problem-solving tools as well as project management techniques to define, measure, analyze, and make improvements in the operations of the organization by eliminating defects and variability in its processes. The teams are empowered by management, whose responsibility is to identify the important problems in the processes of the organization and to sponsor the teams to address those problems. Six Sigma teams use a problem-solving approach called *DMAIC*, sometimes pronounced “duh-may-ick,” which consists of five steps: (1) define the project goals and customer requirements, (2) measure the process to assess current performance, (3) analyze the process to determine causes of defects and variations, (4) improve the process, and (5) control the future process performance. Appendix 20A describes DMAIC in more detail.

A central concept of Six Sigma is that defects in a given process can be measured and quantified. Once they are quantified, the underlying causes of the defects can be identified, and corrective action can be taken to fix the causes and eliminate the defects. The results of the corrective action can be seen using the same measurement procedures in a before-and-after comparison. The comparison is often expressed in terms of sigma level. For example, the process was originally operating at the three sigma level, but after the improvements it is now operating at the five sigma level. In terms of defect levels, this means that the process was previously producing 66,807 defects per 1,000,000, and now it is producing only 233 defects per 1,000,000. Table 20.5 lists various other sigma levels, as well as corresponding defects per million (DPM) and other measures.

The traditional metric for good process quality is $\pm 3\sigma$ (three sigma level). As discussed in Section 20.3, if a process is stable and in statistical control for a given output variable of interest, and this variable is normally distributed, then 99.73% of the process output is within the range defined by $\pm 3\sigma$. This situation is illustrated in Figure 20.11. It

³This section and Appendix 20A are based largely on Chapter 21 in [7].

TABLE 20.5 Sigma Levels and Corresponding Defects per Million, Fraction Defect Rate, and Yield in a Six Sigma Program

Sigma Level	Defects per Million*	Fraction Defect Rate q	Yield Y
6.0σ	3.4	0.0000034	99.99966%
5.8σ	8.5	0.0000085	99.99915%
5.6σ	21	0.000021	99.9979%
5.4σ	48	0.000048	99.9952%
5.2σ	108	0.000108	99.9892%
5.0σ	233	0.000233	99.9770%

4.8σ	483	0.000483	99.9517%
4.6σ	968	0.000968	99.9032%
4.4σ	1,866	0.001866	99.813%
4.2σ	3,467	0.003467	99.653%
4.0σ	6,210	0.006210	99.379%

3.8σ	10,724	0.01072	98.93%
3.6σ	17,864	0.01768	98.23%
3.4σ	28,716	0.02872	97.13%
3.2σ	44,565	0.04457	95.54%
3.0σ	66,807	0.06681	93.32%

2.8σ	96,801	0.09680	90.32%
2.6σ	135,666	0.13567	86.43%
2.4σ	184,060	0.18406	81.59%
2.2σ	241,964	0.2420	75.80%
2.0σ	308,538	0.3085	69.15%

1.8σ	382,089	0.3821	61.79%
1.6σ	460,172	0.4602	53.98%
1.4σ	539,828	0.5398	46.02%
1.2σ	617,911	0.6179	38.21%
1.0σ	691,462	0.6915	30.85%

Source: Compiled from Eckes [4], Appendix.

*Can also be used for defective units per million and defects per million opportunities, as defined in Section 20.5.2.

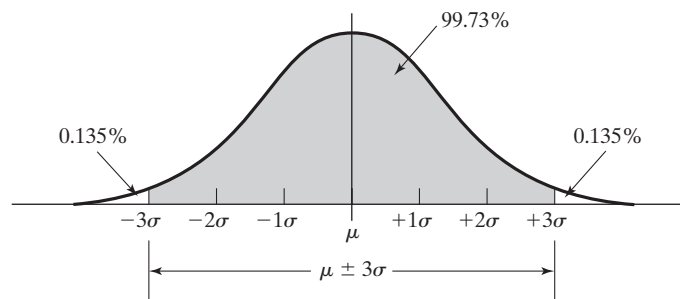


Figure 20.11 Normal distribution of process output variable, showing the $\pm 3\sigma$ limits.

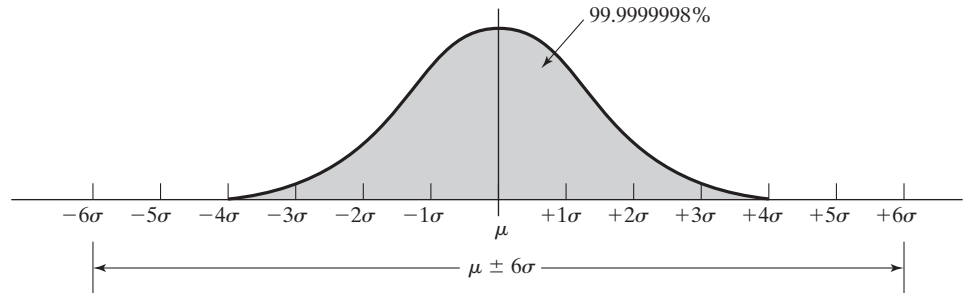


Figure 20.12 Normal distribution of process output variable, showing the $\pm 6\sigma$ limits.

means that there is 0.27% (0.135% in each tail) of the output that lies beyond these limits, or 2,700 parts per million produced (1,350 in each tail).

Compare this with a process that operates at the six sigma level. Under the same assumptions (normally distributed stable process in statistical control), the proportion of the output that lies within the range $\pm 6\sigma$ is 99.999998%. This corresponds to a defect rate of only 0.002 defects per million (see bottom line in Table 20.3 on process capability index). The situation is illustrated in Figure 20.12.

The reader may have noticed that this defect rate does not match the rate associated with six sigma in Table 20.5. The rate shown in Table 20.5 is 3.4 defects per million, which corresponds to a yield of 99.99966%. Why is there a difference? Which is correct? If one looks up the proportion of the population that lies within $\pm 6\sigma$ in a standard normal probability table (if a table could be found that goes that high), one would find that 99.999998% is the correct value, not 99.99966%. Admittedly, the difference between the two yields does not seem like much. But the difference between 0.002 defects per million and 3.4 defects per million is significant.

There are two reasons for the differences between the rate of defects per million in Tables 20.3 and 20.5. First, the values in Table 20.5 refer to only one tail of the normal distribution, whereas the values in Table 20.3 refer to both tails. Second, when the engineers at Motorola devised the Six Sigma standard, they considered processes that operate over the long run, and these processes tend to deviate from the original process mean. While data are collected from a process over a relatively short period of time (e.g., a few weeks or months) to determine the mean and standard deviation, the same process may run for years. During the long-term operation of that process, its mean is likely to shift to the right or left. To compensate for these likely shifts, Motorola elected to use 1.5σ as the magnitude of the shift, while leaving the original $\pm 6\sigma$ limits in place for the process. The effect of this shift is shown in Figure 20.13. Accordingly, when 6σ is used in Six Sigma, it really means 4.5σ and one tail in the normal probability tables.

20.5.2 Measuring the Sigma Level

As mentioned earlier, the performance of the process of interest is measured before and after any improvements are made so that the effect of the improvements can be assessed. In a Six Sigma project, the comparison is typically based on the sigma level. First, the

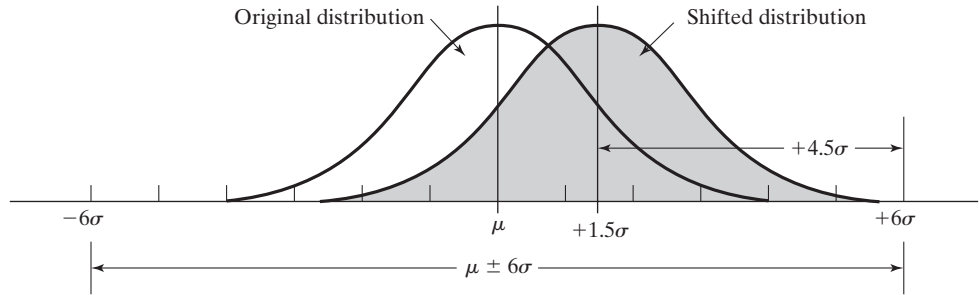


Figure 20.13 Normal distribution shift by a distance of 1.5σ from the original mean.

number of defects per million is determined, and then this is converted to the corresponding sigma level using tables similar to Table 20.5.

There are several alternative measures of defects per million that can be used in a Six Sigma program. The most appropriate measure is probably the defects per million opportunities (*DPMO*), which refers to the fact that there may be more than one opportunity for defects to occur in each unit. Thus, the number of opportunities takes into account the complexity of the product or service so that entirely different types of products can be compared on the same sigma scale. Defects per million opportunities is calculated as

$$DPMO = 1,000,000 \frac{N_d}{N_u N_o} \tag{20.14}$$

where *DPMO* = defects per million opportunities, N_d = number of defects, N_u = number of units in the population of interest, and N_o = number of opportunities for a defect per unit. The factor 1,000,000 converts the proportion into defects per million.

Other common measures include defects per million (*DPM*) and defective units per million (*DUPM*). Defects per million measures all of the defects encountered in the population, considering that there is more than one opportunity for a defect per defective unit:

$$DPM = 1,000,000 \frac{N_d}{N_u} \tag{20.15}$$

Defective units per million is the count of defective units in the population of interest, considering that a defective unit may contain more than one defect:

$$DUPM = 1,000,000 \frac{N_{du}}{N_u} \tag{20.16}$$

where N_{du} = number of defective units. The following example illustrates the procedure for determining *DPMO*, *DPM*, and *DUPM*, as well as the corresponding sigma levels.

EXAMPLE 20.4 Determining the Sigma Level of a Process

A refrigerator final assembly plant inspects its completed products for 37 features that are considered critical-to-quality (CTQ). During the previous three-month period, 31,487 refrigerators were produced, among which 1,690 had defects of the 37 CTQ features, and 902 refrigerators had one or more defects. Determine (a) defects per million opportunities and corresponding sigma level, (b) defects per million and corresponding sigma level, and (c) defective units per million and corresponding sigma level.

Solution: Summarizing the data: $N_o = 37$ defect opportunities per product, $N_u = 31,487$ product units, $N_d = 1,690$ defects, and $N_{du} = 902$ defective units.

$$(a) \text{ DPMO} = 1,000,000 \frac{1,690}{31,487(37)} = \mathbf{1,451 \text{ defects per million opportunities}}$$

This corresponds to the **4.5 sigma** level (interpolating between the 4.4 and 4.6 sigma levels in Table 20.5).

$$(b) \text{ DPM} = 1,000,000 \frac{1,690}{31,487} = \mathbf{53,673 \text{ defects per million}}$$

This corresponds to the **3.1 sigma** level.

$$(c) \text{ DUPM} = 1,000,000 \frac{902}{31,487} = \mathbf{28,647 \text{ defective units per million}}$$

This corresponds to the **3.4 sigma** level. □

20.6 TAGUCHI METHODS IN QUALITY ENGINEERING

The term *quality engineering* encompasses a broad range of engineering and operational activities whose aim is to ensure that a product's quality characteristics are at their nominal or target values. The field of quality engineering owes much to Genichi Taguchi, who has had an important influence on its development, especially in the design area—both product and process design. This section reviews two of the Taguchi methods: (1) robust design and (2) the Taguchi loss function. More complete treatments of Taguchi's methods can be found in references [5], [11], [14], and [18].

20.6.1 Robust Design

An important Taguchi principle is to specify product and process parameters to create a design that resists failure or reduced performance in the face of variations. Taguchi calls the variations *noise factors*, which are sources of variation that are impossible or difficult to control and that affect the functional characteristics of the product. Three types of noise factors can be distinguished:

1. *Unit-to-unit noise factors.* These are inherent random variations in the process and product caused by variability in raw materials, machinery, and human participation. They are associated with a production process that is in statistical control.
2. *Internal noise factors.* These sources of variation are internal to the product or process. They include (1) time-dependent factors such as wear of mechanical components, spoilage of raw materials, and fatigue of metal parts; and (2) operational errors, such as improper settings on the product or machine tool.
3. *External noise factors.* An external noise factor is a source of variation that is external to the product or process, such as outside temperature, humidity, raw material supply, and input voltage. Internal and external noise factors constitute what have been previously called assignable variations. Taguchi distinguishes between internal and external noise factors because external noise factors are generally more difficult to control.

A **robust design** is one in which the function and performance of the product or process are relatively insensitive to variations in any of the above noise factors. In product design, robustness means that the product can maintain consistent performance with minimal disturbance due to variations in uncontrollable factors in its operating environment. In process design, robustness means that the process continues to produce good product with minimal effect from uncontrollable variations in its operating environment. Examples of robust designs are presented in Table 20.6.

20.6.2 The Taguchi Loss Function

The Taguchi loss function is a useful concept in tolerance design. Taguchi defines poor quality as “the loss a product costs society from the time the product is released for shipment” [18]. Loss includes costs to operate, failure to function, maintenance and repair costs, customer dissatisfaction, injuries caused by poor design, and similar costs. Some

TABLE 20.6 Robust Designs in Products and Processes

Product Design	An airplane that flies as well in stormy weather as in clear weather. A car that starts as well in Fairbanks, Alaska, in January as in Phoenix, Arizona, in July. A tennis racket that returns the ball just as well when hit near the rim as when hit in dead center. A hospital operating room that maintains lighting and life support systems when the electric power to the hospital is interrupted.
Process Design	A turning operation that produces a good surface finish throughout a wide range of cutting speeds. A plastic injection molding operation that molds a good part despite variations in ambient temperature and humidity in the factory. A metal forging operation that presses good parts in spite of variations in starting temperature of the raw billet.
Other	A biological species that survives unchanged for millions of years despite significant climatic changes in the world in which it lives.

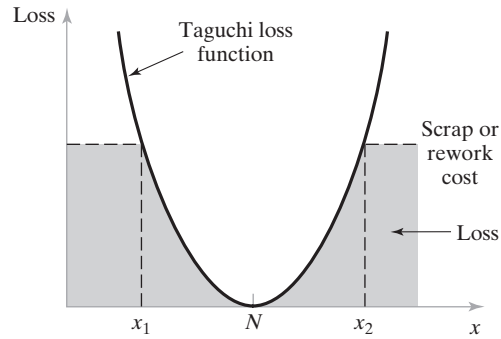


Figure 20.14 The quadratic quality loss function.

of these losses are difficult to quantify in monetary terms, but they are nevertheless real. Defective products (or their components) that are detected, repaired, reworked, or scrapped before shipment are not considered part of this loss. Instead, any expense to the company resulting from scrap or rework of defective product is a manufacturing cost rather than a quality loss.

Loss occurs when a product's functional characteristic differs from its nominal or target value. Although functional characteristics do not translate directly into dimensional features, the loss relationship is most readily understood in terms of dimensions. When the dimension of a component deviates from its nominal design value, the component's function is adversely affected. No matter how small the deviation, there is some loss in function. The loss increases at an accelerating rate as the deviation grows, according to Taguchi. Let x = the quality characteristic of interest, where N = its nominal value, then the loss function will be a U-shaped curve as in Figure 20.14. Taguchi uses a quadratic equation to describe the curve

$$L(x) = k(x - N)^2 \quad (20.17)$$

where $L(x)$ = loss function, k = constant of proportionality, and x and N are defined earlier. At some level of deviation $(x_2 - N) = -(x_1 - N)$, the loss will be prohibitive, and it will be necessary to scrap or rework the product. This level identifies one possible way of specifying the tolerance limit for the dimension. But even within these limits, there is also a loss, as suggested by the cross-hatching.

In the traditional approach to quality control, tolerance limits are defined and any product within those limits is acceptable. Whether the quality characteristic (e.g., the dimension) is close to the nominal value or close to one of the tolerance limits, it is acceptable. Trying to visualize this approach in terms analogous to the preceding relation, the discontinuous loss function in Figure 20.15 is obtained. In this approach, any value within the upper tolerance limit (*UTL*) and lower tolerance limit (*LTL*) is acceptable. The reality is that products closer to the nominal specification are better quality and will work better, look better, last longer, and have components that fit better. In short, products made closer to nominal specifications will provide greater customer satisfaction. In order to improve quality and customer satisfaction, one must attempt to reduce the loss by designing the product and process to be as close as possible to the target value.

It is possible to make calculations based on the Taguchi loss function, if one accepts the assumption of the quadratic loss equation, Equation (20.17). The following examples

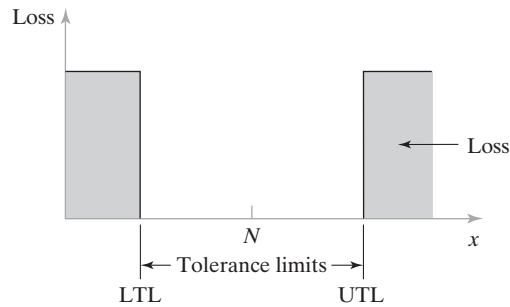


Figure 20.15 Loss function implicit in traditional tolerance specification.

illustrate several aspects of its application: (1) estimating the constant k in the loss function, Equation (20.17), based on known cost data, (2) using the Taguchi loss function to estimate the cost of alternative tolerances, and (3) comparing the expected loss for alternative manufacturing processes that have different process distributions.

EXAMPLE 20.5 Estimating the Constant k in the Taguchi Loss Function

Suppose that a certain part dimension is specified as 100.0 ± 0.20 mm. To investigate the impact of this tolerance on product performance, the company has studied its repair records to discover that if the ± 0.20 mm tolerance is exceeded, there is a 60% chance that the product will be returned for repairs, at a cost of \$100 to the company (during the warranty period) or to the customer (beyond the warranty period). Estimate the Taguchi loss function constant k for this data.

Solution: In Equation (20.17) for the loss function, the value of $(x - N)$ is the tolerance value 0.20. The loss is the expected cost of the repair, which can be calculated as follows:

$$E\{L(x)\} = 0.60(\$100) + 0.40(0) = \$60$$

Using this cost in Equation (20.17),

$$60 = k(0.20)^2 = k(0.04)$$

$$k = \frac{60}{0.04} = \$1,500$$

Therefore, the Taguchi loss function for this case is the following:

$$L(x) = 1,500(x - N)^2 \tag{20.18}$$

The Taguchi loss function can be used to evaluate the relative costs of alternative tolerances that might be applied to the component in question, as illustrated in the following example.

EXAMPLE 20.6 Using the Loss Function to Estimate Cost of Alternative Tolerances

Use the Taguchi quadratic loss function, Equation (20.18), to evaluate the cost of alternative tolerances for the same data as in Example 20.5. Specifically, given the nominal dimension of 100, as before, determine the cost (value of the loss function) for tolerances of (a) ± 0.10 mm and (b) ± 0.05 mm.

Solution: (a) For a tolerance of ± 0.10 mm, the value of the loss function is:

$$L(x) = 1,500(0.10)^2 = 1,500(0.01) = \mathbf{\$15.00}$$

(b) For a tolerance of ± 0.05 mm, the value of the loss function is:

$$L(x) = 1,500(0.05)^2 = 1,500(0.0025) = \mathbf{\$3.75}$$

The loss function can be figured into production piece cost computations, if certain characteristics of the process are known, namely: (1) the applicable Taguchi loss function, (2) the production cost per piece, (3) the probability distribution of the process for the product parameter of interest, and (4) the cost of sortation, rework, and/or scrap for an out of tolerance piece. Combining these terms, the total piece cost is

$$C_{pc} = C_p + C_s + qC_r + L(x) \quad (20.19)$$

where C_{pc} = total cost per piece, C_p = production cost per piece, C_s = inspection and sortation cost per piece, q = proportion of parts falling outside of the tolerance limits and needing rework, C_r = rework cost per piece for those parts requiring rework, and $L(x)$ = Taguchi loss function cost per piece. Owing to the probability distribution associated with the production process, the analysis requires the use of expected costs. In the case of the normal distribution, it can be shown that the expected value of $(x - N)^2$ is the variance of the distribution σ^2 . Thus, the expected value of the Taguchi loss function for this case is given by

$$E\{L(x)\} = k\sigma^2 \quad (20.20)$$

where σ^2 = the variance of the production process, and its square root is the standard deviation σ of the process.

EXAMPLE 20.7 Comparing the Expected Cost for Alternative Manufacturing Processes

Suppose that the part in Examples 20.5 and 20.6 can be produced by two alternative manufacturing processes. Both processes can produce parts with an average dimension at the desired nominal value of 100 mm. The distribution of the output is normal for each process, but their standard deviations are different. The relevant data for the two processes are given in the following table:

	Process A	Process B
Production cost per piece	\$5.00	\$10.00
Cost of sortation per piece	\$1.00	\$1.00
Rework cost per piece if tolerance exceeded	\$20.00	\$20.00
Taguchi loss function	Equation (20.18)	Equation (20.18)
Process standard deviation (mm)	0.08	0.04

Determine the expected cost per piece for the two processes.

Solution: The total cost per piece includes the other costs, namely the production cost per piece, inspection and sortation cost, and rework cost, if there is any rework, in addition to the loss function cost. For process A, the production cost per piece is \$5.00, the sortation cost is \$1.00 per piece, and the rework cost is \$20.00. However, the rework cost is only applicable to those parts that fall outside the specified tolerance of ± 0.20 mm. The proportion of parts that lie beyond this interval can be found by computing the standard normal z statistic and determining the associated probability. The z -value is $0.20/0.08 = 2.5$, and the probability (from standard normal tables) is 0.0124. The Taguchi loss function is given by Equation (20.18), but the standard deviation is substituted in the loss equation: $E\{L(x)\} = 1,500(0.08)^2 = \9.60 . The total cost per piece is calculated as follows:

$$C_{pc} = 5.00 + 1.00 + 0.0124(20.00) + 9.60 = \mathbf{\$15.85 \text{ per piece}}$$

For process B, although its production piece cost is much higher than for process A, there are virtually no out-of-tolerance units produced (as long as the process is in statistical control, which can be verified by statistical sampling). Thus, the sortation step can be omitted. Also, there is no rework. The Taguchi loss function $E\{L(x)\} = 1,500(0.04)^2 = \2.40 . Total cost per piece for process B is calculated as follows:

$$C_{pc} = 10.00 + 0 + 0 + 2.40 = \mathbf{\$12.40 \text{ per piece}}$$

Owing to a much smaller Taguchi loss function cost, process B is the lower cost production method. □

Equation (20.20) represents a special case of the more general situation. The special case is when the process mean μ , which is the average of all x_i , is centered about the nominal value N . The more general case is when the process mean μ may or may not be centered about the nominal design value. In this more general case, the calculation of the value of the Taguchi loss function becomes

$$E\{L(x)\} = k[(\mu - N)^2 + \sigma^2] \quad (20.21)$$

If the process mean is centered at the nominal value, so that $\mu = N$, then Equation (20.21) reduces to Equation (20.20).

20.7 ISO 9000

This chapter on quality programs would not be complete without mention of the principal standard devoted to this subject. ISO 9000 is a set of international standards on quality developed by the International Organization for Standardization (ISO), based in Geneva, Switzerland, and representing virtually all industrialized nations. The U.S. representative to ISO is the American National Standards Institute (ANSI). The American Society for Quality (ASQ) is the ANSI member organization that is responsible for quality standards. ASQ publishes and disseminates ANSI/ASQ Q9000, which is the U.S. version of ISO 9000.

ISO 9000 establishes standards for the systems and procedures used by a facility that affect the quality of the products and services produced by the facility. It is not a standard for the products or services themselves. ISO 9000 is not just one standard; it is a family of standards. The family includes a glossary of quality terms, guidelines for selecting and using the various standards, models for quality systems, and guidelines for auditing quality systems.

The ISO standards are generic rather than industry-specific. They are applicable to any facility producing any product and/or providing any service, no matter what the market. As mentioned, the focus of the standards is on the facility's quality system rather than its products or services. In the ISO standards, a *quality system* is defined as "the organizational structure, responsibilities, procedures, processes, and resources needed to implement quality management." ISO 9000 is concerned with the set of activities undertaken by a facility to ensure that its output provides customer satisfaction. It does not specify methods or procedures for achieving customer satisfaction; instead it describes concepts and objectives for achieving it.

ISO 9000 can be applied in a facility in two ways. The first is to implement the standards or selected portions of the standards simply for the sake of improving the firm's quality systems. Improving the procedures and systems for delivering high quality products and/or services is a worthwhile accomplishment, whether or not formal recognition is awarded. Implementation of ISO 9000 requires that all of a facility's activities affecting quality be carried out in a three-phase cycle that continues indefinitely. The three phases are (1) planning the activities and procedures that affect quality, (2) controlling the activities that affect quality to ensure that customer specifications are satisfied and that corrective action is taken on any deviations from specifications, and (3) documenting the activities and procedures affecting quality to ensure that quality objectives are understood by employees, feedback is provided for planning, and evidence of quality system performance is available for managers, customers, and for certification purposes.

The second way to apply ISO 9000 is to become registered. ISO 9000 registration not only improves the facility's quality systems, but it also provides formal certification that the facility meets the requirements of the standard. This benefits the firm in several ways. Two significant benefits are (1) reducing the frequency of quality audits performed by the facility's customers and (2) qualifying the facility for business partnerships with companies that require ISO 9000 registration. This latter benefit is especially important for firms doing business in the European Community, where certain products are classified as regulated and ISO 9000 registration is required for companies making these products as well as their suppliers.

Registration is obtained by having the facility certified by an accredited third-party agency. The certification process consists of on-site inspections and review of the firm's documentation and procedures so that the agency is satisfied that the facility conforms to the ISO 9000 standard. If the outside agency finds the facility nonconforming in certain areas, then it will notify the facility about which areas need upgrading, and schedule a repeat visit. Once the facility is registered, the external agency will periodically audit the facility to verify continuing conformance. The facility must pass these audits in order to retain ISO 9000 registration.

REFERENCES

- [1] ARNOLD, K. L., *The Manager's Guide to ISO 9000*, The Free Press, New York, 1994.
- [2] BESTERFIELD, D. H., C. BESTERFIELD-MICHNA, G. H. BESTERFIELD and M. BESTERFIELD-SACRE., *Total Quality Management*, 3rd ed., Prentice Hall, Upper Saddle River, New Jersey, 2003.
- [3] CROSBY, P. B., *Quality is Free*, McGraw-Hill Book Company, New York, 1979.
- [4] ECKES, G., *Six Sigma for Everyone*, John Wiley & Sons, Inc., Hoboken, NJ, 2003.
- [5] EVANS, J. R., and W. M. LINDSAY, *The Management and Control of Quality*, 6th ed., West Publishing Company, St. Paul, MN, 2004.
- [6] GOETSCH, D. L., and S. B. DAVIS, *Quality Management*, 7th ed., Prentice Hall, Upper Saddle River, NJ, 2012.

- [7] GROOVER, M. P., *Work Systems and the Methods, Measurement, and Management of Work*, Pearson Prentice Hall, Upper Saddle River, NJ, 2007.
- [8] JING, G. G., and L. NING, "Claiming Six Sigma," *Industrial Engineer*, February 2004, pp. 37–39.
- [9] JURAN, J. M., and F. M. GRYNA, *Quality Planning and Analysis*, 3rd ed., McGraw-Hill, Inc., New York, 1993.
- [10] KANTNER, R., *The ISO 9000 Answer Book*, Oliver Wight Publications, Inc., Essex Junction, VT, 1994.
- [11] LOCHNER, R. H., and J. E. MATAR, *Designing for Quality*, ASQC Quality Press, Milwaukee, WI, 1990.
- [12] MONTGOMERY, D., *Introduction to Statistical Quality Control*, 6th ed., John Wiley & Sons, Inc., New York, 2008.
- [13] OKES, D., "Improve Your Root Cause Analysis," *Manufacturing Engineering*, March 2005, pp. 171–178.
- [14] PEACE, G. S., *Taguchi Methods*, Addison-Wesley Publishing Company, Inc., Reading, MA, 1993.
- [15] PYZDEK, T., and R. W. BERGER, *Quality Engineering Handbook*, 2nd ed., Marcel Dekker, Inc., New York, and ASQC Quality Press, Milwaukee, WI, 2003.
- [16] STAMATIS, D. H., *Six Sigma Fundamentals—A Complete Guide to the System, Methods, and Tools*, Productivity Press, New York, 2004.
- [17] SUMMERS, D. C. S., *Quality*, 5th ed., Prentice Hall, Upper Saddle River, NJ, 2009.
- [18] TAGUCHI, G., E. A. ELSAYED, and T. C. HSIANG, *Quality Engineering in Production Systems*, McGraw-Hill Book Company, New York, 1989.
- [19] TITUS, R., "Total Quality Six Sigma Overview," Slide presentation, Lehigh University, Bethlehem, PA, May 2003.
- [20] www.isixsigma.com
- [21] www.ge.com/sixsigma
- [22] www.motorola.com/sixsigma

REVIEW QUESTIONS

- 20.1 What are the two aspects of quality in a manufactured product? List some of the product characteristics in each category.
- 20.2 Discuss the differences between the traditional view of quality control and the modern view.
- 20.3 What are the three main objectives of total quality management?
- 20.4 What do the terms *external customer* and *internal customer* mean?
- 20.5 Manufacturing process variations can be divided into two types: (1) random and (2) assignable. Distinguish between these two types.
- 20.6 What is meant by the term *process capability*?
- 20.7 What is a control chart?
- 20.8 What are the two basic types of control charts?
- 20.9 What is a histogram?
- 20.10 What is a Pareto chart?
- 20.11 What is a defect concentration diagram?
- 20.12 What is a scatter diagram?
- 20.13 What is a cause-and-effect diagram?
- 20.14 What is Six Sigma?
- 20.15 What are the general goals of Six Sigma?
- 20.16 Why does 6σ in Six Sigma really mean 4.5σ ?

- 20.17** What does DMAIC stand for?
- 20.18** Why is defects per million (DPM) not necessarily the same as defects per million opportunities (DPMO)?
- 20.19** What is a robust design in Taguchi's quality engineering?
- 20.20** What is ISO 9000?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Process Capability

(**Note:** Problems 20.2, 20.5, 20.25, 20.26, 20.27, and 20.28 require the use of standard normal distribution tables not included in this book.)

- 20.1 (A)** A turning process is in statistical control and the output is normally distributed, producing parts with a mean diameter = 45.025 mm and a standard deviation = 0.035 mm. Determine the process capability.
- 20.2** In Problem 20.1, the design specification on the part is that the diameter = 45.000 ± 0.150 mm. (a) What proportion of parts fall outside the tolerance limits? (b) If the process is adjusted so that its mean diameter = 45.000 mm and the standard deviation remains the same, what proportion of parts fall outside the tolerance limits?
- 20.3** An automated tube-bending operation produces parts with an included angle = 91.2° . The process is in statistical control and the values of included angle are normally distributed with a standard deviation = 0.55° . The design specification on the angle = $90.0^\circ \pm 2.0^\circ$. (a) Determine the process capability. (b) If the process is adjusted so that its mean = 90.0° , determine the process capability index.
- 20.4** A plastic extrusion process is in statistical control and the output is normally distributed. The extrudate is subsequently cut into individual parts, and the extruded parts have a critical cross-sectional dimension = 13.65 mm with standard deviation = 0.27 mm. Determine the process capability.
- 20.5** In Problem 20.4, the design specification on the part is that the critical cross-sectional dimension = 13.5 ± 1.0 mm. (a) What proportion of parts fall outside the tolerance limits? (b) If the process were adjusted so that its mean diameter = 13.5 mm and the standard deviation remained the same, what proportion of parts would fall outside the tolerance limits? (c) With the adjusted mean at 13.5 mm, determine the process capability index.

Control Charts

- 20.6 (A)** Seven samples of five parts each have been collected from an extrusion process which is in statistical control, and the diameter of the extrudate has been measured for each part. (a) Determine the values of the center line, LCL , and UCL for \bar{x} and R charts. The calculated values of \bar{x} and R for each sample are given below (measured values are in inches). (b) Construct the control charts and plot the sample data on the charts.

s	1	2	3	4	5	6	7
\bar{x}	1.002	0.999	0.995	1.004	0.996	0.998	1.006
R	0.010	0.011	0.014	0.020	0.008	0.013	0.017


- 20.7** Ten samples of size $n = 8$ have been collected from a process in statistical control, and the dimension of interest has been measured for each part. (a) Determine the values of the center line, LCL , and UCL for the \bar{x} and R charts. The calculated values of \bar{x} and R for each sample are given below (measured values are in mm). (b) Construct the control charts and plot the sample data on the charts.

s	1	2	3	4	5	6	7	8	9	10
\bar{x}	9.22	9.15	9.20	9.28	9.19	9.12	9.20	9.24	9.17	9.23
R	0.24	0.17	0.30	0.26	0.27	0.19	0.21	0.32	0.21	0.23


- 20.8** In 10 samples of size $n = 8$ for a process that is in statistical control, the average value of the sample means is $\bar{\bar{x}} = 5.501$ in for the dimension of interest, and the mean of the ranges of the samples is $\bar{R} = 0.024$ in. Determine (a) lower and upper control limits for the \bar{x} chart and (b) lower and upper control limits for the R chart.
- 20.9** In 20 samples each of size $n = 6$ for a process that is in statistical control, the grand mean of the samples is $\bar{\bar{x}} = 85.0$ for the characteristic of interest, and the mean of the ranges of the samples is $\bar{R} = 7.25$. Determine (a) lower and upper control limits for the \bar{x} chart and (b) lower and upper control limits for the R chart.
- 20.10** A p chart is to be constructed for a process that is in statistical control. Eight samples of 20 parts each have been collected, and the average number of defects per sample = 2.4. Determine the center line, LCL , and UCL for the p chart.
- 20.11** Twelve samples of equal size have been taken to prepare a p chart for a process that is in statistical control. The total number of parts in these 12 samples was 600 and the total number of defects counted was 96. Determine the center line, LCL , and UCL for the p chart.
- 20.12** The yield of good chips during a certain step in silicon processing of integrated circuits averages 89%. This processing step is considered to be in statistical control. The number of chips per wafer is 156. Determine the center line, LCL , and UCL for the p chart that would be used for this processing step.
- 20.13** (A) The upper and lower control limits for a p chart are $LCL = 0.10$ and $UCL = 0.30$. Determine the sample size n that is used with this control chart.
- 20.14** The lower and upper control limits for a p chart are $LCL = 0$ and $UCL = 0.25$. The center line of the p chart is at 0.11. Determine the sample size n that is used with this control chart.
- 20.15** Twelve cars were inspected after final assembly. The number of defects ranged between 87 and 139 defects per car with an average of 116. Assuming that the assembly process was in statistical control, determine the center line and upper and lower control limits for the c chart that might be used in this situation.
- 20.16** For each of the three control charts in Figure P20.16, identify whether or not there is evidence that the process is out of control.

Determining Sigma Level in Six Sigma


- 20.17** (A) A garment manufacturer produces 15 different dress styles, and every year new dress styles are introduced and old styles are discarded. Whatever the style, the final inspection department checks each dress before it leaves the factory for eight features that are considered critical-to-quality for customer satisfaction. The inspection report for last month indicated that a total of 301 deficiencies of the eight features were found among 6,250 dresses produced. Determine (a) defects per million opportunities and (b) sigma level for the manufacturer's production performance.

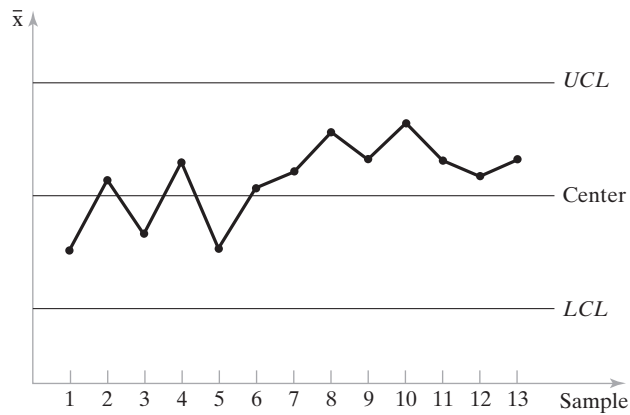

(a)

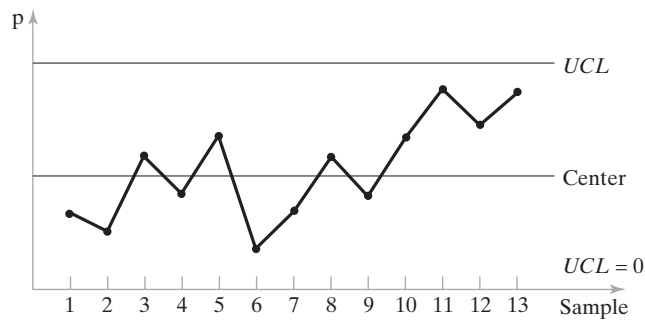

(b)

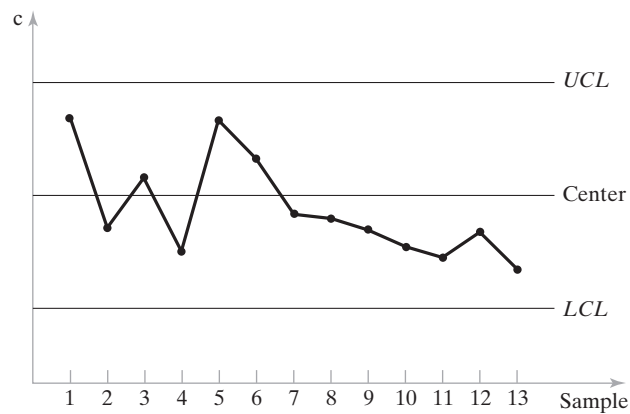

(c)

Figure P20.16 Control charts for Problem 20.16.

- 20.18** A producer of cell phones checks each phone prior to packaging, using seven critical-to-quality characteristics that are deemed important to customers. Last year, out of 205,438 phones produced by the company, a total of 578 phones had at least one defect, and the total number of defects among these 578 phones was 1,692. Determine (a) the number of defects per million opportunities and corresponding sigma level, (b) the number of defects per million and corresponding sigma level, and (c) the number of defective units per million and corresponding sigma level.

- 20.19** The inspection department in an automobile final assembly plant checks cars coming off the line against 85 features that are considered critical-to-quality for customer satisfaction. During a one-month period, a total of 16,578 cars were produced. For those cars, a total of 1,989 defects of various types were found, and the total number of cars that had one or more defects was 512. Determine (a) the number of defects per million opportunities and corresponding sigma level, (b) the number of defects per million and corresponding sigma level, and (c) the number of defective units per million and corresponding sigma level.
- 20.20** A digital camera maker produces three different models: (1) base model, (2) zoom model, and (3) zoom model with extra memory. Data for the three models are shown in the table below. The three models have been on the market for one year, and the first year's sales are given in the table. Also given are critical-to-quality (CTQ) characteristics and total defects that have been tabulated for the products sold. Higher model numbers have more CTQ characteristics (opportunities for defects) because they are more complex. The category of total defects refers to the total number of defects of all CTQ characteristics for each model. For each of the three models, determine (a) the number of defects per million opportunities and corresponding sigma level, (b) the number of defects per million and corresponding sigma level, and (c) the number of defective units per million and corresponding sigma level. (d) Does any one model seem to be produced at a higher quality level than the others? (e) Determine aggregate values for *DPMO*, *DPM*, and *DUPM* and their corresponding sigma levels for all models made by the camera maker.

Model	Annual Sales	CTQ Characteristics	Number of Defective Cameras	Total Number of Defects
1	62,347	16	127	282
2	31,593	23	109	429
3	18,662	29	84	551

Taguchi Loss Function

- 20.21** A certain part dimension on a power garden tool is specified as 25.50 ± 0.30 mm. Company repair records indicate that if the ± 0.30 mm tolerance is exceeded, there is a 75% chance that the product will be returned for replacement. The cost associated with replacing the product, which includes not only the product cost itself but also the additional paperwork and handling associated with replacement, is estimated to be \$300. Determine the constant k in the Taguchi loss function for this data.
- 20.22 (A)** The design specification on the resistance for an electronic component is 0.50 ± 0.02 ohm. If the tolerance is exceeded and the component is scrapped, the company suffers a \$20 cost. (a) What is the implied value of the constant k in the Taguchi quadratic loss function? (b) If the output of the process that sets the resistance is centered on 0.50 ohm, with a standard deviation of 0.005 ohm, what is the expected loss per unit?
- 20.23** The Taguchi quadratic loss function for a particular component in a piece of earthmoving equipment is $L(x) = 3500(x - N)^2$, where x = the actual value of a critical dimension and N is the nominal value. If $N = 150.00$ mm, determine the value of the loss function for tolerances of (a) ± 0.20 mm and (b) ± 0.10 mm.
- 20.24** The Taguchi loss function for a certain component is given by $L(x) = 8,000(x - N)^2$, where x = the actual value of a dimension of critical importance and N is its nominal value. Company management has decided that the maximum loss that can be accepted is \$10.00. (a) If the nominal dimension is 30.00 mm, at what value should the tolerance on this dimension be set? (b) Does the value of the nominal dimension have any effect on the tolerance that should be specified?

- 20.25** Two alternative manufacturing processes, A and B, can be used to produce a certain dimension on one of the parts in an assembled product. Both processes can produce parts with an average dimension at the desired nominal value. The tolerance on the dimension is ± 0.15 mm. The output of each process follows a normal distribution. However, the standard deviations are different. For process A, $\sigma = 0.12$ mm; and for process B, $\sigma = 0.07$ mm. Production costs per piece for A and B are \$7.00 and \$12.00, respectively. If inspection and sortation is required, the cost is \$0.50 per piece. If a part is found to be defective, it must be scrapped at a cost = its production cost. The Taguchi loss function for this component is given by $L(x) = 2,500(x - N)^2$, where x = value of the dimension and N is its nominal value. Determine the average cost per piece for the two processes.
- 20.26** Solve Problem 20.25, except that the tolerance on the dimension is ± 0.30 mm rather than ± 0.15 mm.
- 20.27** Solve Problem 20.25, except that the average value of the dimension produced by process B is 0.10 mm greater than the nominal value specified. The average value of the dimension produced by process A remains at the nominal value N .
- 20.28** Two different manufacturing processes, A and B, can be used to produce a certain component. The specification on the dimension of interest is 100.00 mm \pm 0.20 mm. The output of process A follows the normal distribution, with $\mu = 100.00$ mm and $\sigma = 0.10$ mm. The output of process B is a uniform distribution defined by $f(x) = 2.0$ for $99.75 \leq x \leq 100.25$ mm. Production costs per piece for processes A and B are each \$5.00. Inspection and sortation cost is \$0.50 per piece. If a part is found to be defective, it must be scrapped at a cost = twice its production cost. The Taguchi loss function for this component is given by $L(x) = 2,500(x - N)^2$, where x = value of the dimension and N is its nominal value. Determine the average cost per piece for the two processes.

APPENDIX 20A: THE SIX SIGMA DMAIC PROCEDURE

The problem-solving approach used by worker teams in a Six Sigma project is called *DMAIC* (“duh-may-ick”), which is an acronym for the five steps in the approach:

1. *Define* the project goals and customer requirements
2. *Measure* the process to assess its current performance
3. *Analyze* the process and determine root causes of variations and defects
4. *Improve* the process by reducing variations and defects
5. *Control* the future process performance by institutionalizing the improvements.

These are the basic steps in an improvement procedure intended for existing processes that are currently operating at low sigma levels and need improvement. *DMAIC* provides the worker team with a systematic and data-driven approach to solve an identified problem. It is a road map that guides the team toward improvement in the process of interest. Although the approach seems very sequential (step 1, then step 2, and so on), an iterative implementation of *DMAIC* is sometimes required. For example, in the analyze step (step 3), the team may discover that it did not collect the right data in the measure step (step 2). Therefore, it must repeat the previous step to correct the deficiency.

The following paragraphs describe the five steps of the *DMAIC* approach and some of the typical tools that might be applied in each step.

20A.1 Define

The first step in *DMAIC* consists of (1) organizing the project team, (2) providing it with a charter (the problem to solve), (3) identifying the customers served by the process, and (4) developing a high-level process map.

Organizing the Project Team. Members of the project team are selected on the basis of their knowledge of the problem area and other skills. The team members, at least some of them, have had Six Sigma training. Some are the workers who operate the process of interest. Team leaders in a Six Sigma project are called *black belts*; they are the project managers. They have had detailed training in the entire range of Six Sigma problem-solving techniques. Assisting them are *green belts*, other team members who have been trained in some Six Sigma techniques. Providing technical resources and serving as consultants and mentors for the black belts are *master black belts*. Master black belts are generally full-time positions, and they are selected for their teaching aptitudes, quantitative skills, and experience in Six Sigma.

Participating in the formation of a Six Sigma project team is an individual known in Six Sigma terminology as the *champion*, who is typically a member of management. The champion is often the owner of the process, and the process has problems.

The Charter. The charter is the documentation that justifies the project. Much of the substance of the charter is provided by the champion, the one with the problem. The charter documentation usually includes the following:

- *Problem statement and background.* What is wrong with the process? How long has the problem existed? How does the process currently operate, and how should it be operating? This section attempts to define the problem in quantitative terms.
- *Objectives of the project.* What should the project team be able to accomplish within a certain time frame, say six months? What will be the benefits of the project?
- *Scope of the project.* What areas should the project team focus on, and what areas should it avoid?
- *Business case for solving the problem.* How is the project justified in economic terms? What is the potential return by accomplishing the project? Why is this problem more important than other problems?
- *Project schedule.* What are the logical milestones in the project? These are often defined in terms of the five steps in the DMAIC procedure. When should the define step be completed? How many weeks should the measure step take?

Identifying the Customer(s). Every process serves customers. The output of the process (e.g., the product or part produced or the service delivered) has one or more customers. Otherwise, there would be no need for the process. Customers are the recipients of the process output and are directly affected by its quality, either positively or negatively. Customers have needs and requirements that must be satisfied or exceeded. An important function in the define step is to identify exactly who the customers of the process are and what their requirements are.

When the team is identifying the customers, it is particularly useful for it to determine those characteristics of the process output that are critical-to-quality (CTQ) from a customer's viewpoint. The CTQ characteristics are the features or elements of the process and its output that directly impact the customer's perception of quality. Typical CTQ characteristics include the reliability of a product (e.g., automobile, appliance, lawn mower) or the timeliness of a service (e.g., fast-food delivery, plumbing repairs). Identifying the CTQ characteristics allows the Six Sigma team to focus on what's important and not to dissipate its energy on what's not important.

High-Level Process Map. The final task in the define step is to develop a high-level process map. *Process mapping* is a graphical technique that can be used to depict the sequence of steps that operate on the inputs to the process and produce the output.

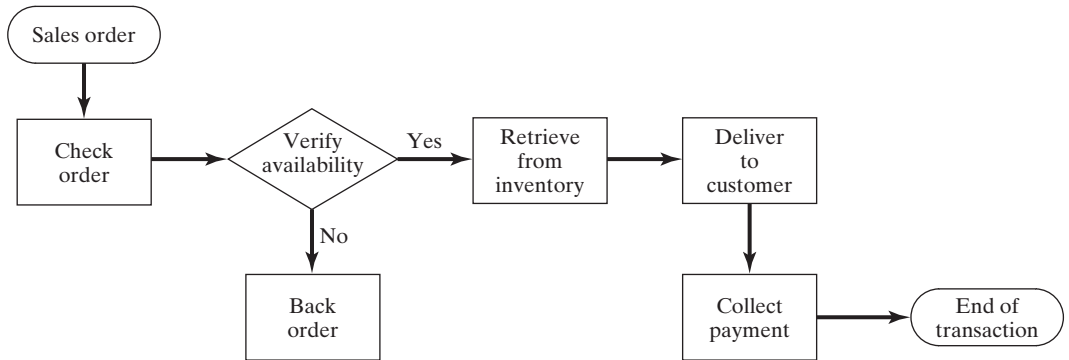


Figure 20A.1 An example of a process map showing the sequence of steps and their inter-relationships.

An example is illustrated in Figure 20A.1. Process maps provide a detailed picture of the process or system of interest. They help the team members understand the issues and communicate with one another.

Process mapping is the preferred technique in a Six Sigma project because it can be used to portray a process at various levels of detail. In the define step, when the improvement project is just getting under way, it is appropriate to visualize the process at a high level, absent of the details that will be examined in subsequent steps. The process map developed here should include the suppliers, inputs, process, outputs, and customers.

In addition to the high level viewpoint, the process map should also be an “as is” picture of the current process, unimproved. Viewing the status quo process map may very well provide leads that will result in improvements. The “as is” process map provides a benchmark against which to compare the subsequent improvements.

20A.2 Measure

The second step in DMAIC consists of (1) collecting data and (2) measuring the current sigma level of the process. Assessing the sigma level of the current process allows the team to make comparisons later, after improvements have been made.

The first step in data collection is deciding what should be measured. This decision should be made with reference to the process map and the critical-to-quality (CTQ) characteristics developed in the define step. The measurements can be classified into three categories:

- *Input measures.* These are variables related to the process inputs, which are provided by its suppliers. What are the important quality measures to assess the performance of the suppliers?
- *Process measures.* These are the internal variables of the process itself. In general, they deal with efficiency measures such as cycle time and waiting time, and quality measures such as dimensional variables and fraction defect rate.
- *Output measures.* These are the measures seen by the customer. They indicate how well customer requirements and expectations are being satisfied. They are functionally related to the input measures and process measures.

Every Six Sigma project is different, and different types of data must be collected for each one. It is usually necessary to design data collection forms for the project, perhaps using check sheets from statistical process control (Section 20.4.2).

Once the decisions have been made regarding which variables to measure, and data collection forms have been designed, the actual data collection begins. Adjustments are sometimes required as problems are encountered in the collection procedure. The problems may be related to occurrences or variables in the process that were not anticipated (e.g., identification of an important variable that was previously overlooked) or design of the data collection forms (e.g., no space on the form to note unusual events). An important rule of data collection in a Six Sigma project is that the team itself should be involved in the data collection so that it can recognize these problems and take the appropriate corrective actions [16].

After data collection has been completed, the team is in a position to analyze the current sigma level of the “as-is” process. This provides a starting point for making improvements and measuring their effects on the process. It allows a before-and-after comparison. The first step in assessing the current sigma level of the process is to determine the number of defects per million, which is then converted to the corresponding sigma level, as explained in Section 20.5.2.

20A.3 Analyze

The analyze step in DMAIC can be divided into the following phases: (1) basic data analysis, (2) process analysis, and (3) root cause analysis. The analyze step is a bridge between measure (step 2) and improve (step 4). Analyze takes the data collected in step 2 and provides a quantitative basis for developing improvements in step 4. The analyze phase seeks to identify where the improvement opportunities lie.

Basic Data Analysis. The purpose of the basic data analysis is to present the collected data in a way that lends itself to making inferences. This usually means graphical displays of the data, borrowing tools from SPC such as histograms, Pareto charts, and scatter diagrams. Additional statistical analysis tools often used for data analysis include regression analysis (least squares analysis), analysis of variance, and hypothesis testing.

Process Analysis. Process analysis is concerned with interpreting the results of the basic data analysis and developing a more detailed picture of the way the process operates and what is wrong with it. The more detailed picture usually includes a series of process maps that focus on the individual steps in the high-level process map created earlier in step 1 in DMAIC. The low-level process maps are useful in better understanding the inner workings of the process. The Six Sigma team progresses through a process analysis by asking questions like

- What are the value-adding steps in the process?
- What are the non-value-adding but necessary steps?
- What are the steps that add no value and could be eliminated?
- What are the steps that generate variations, deviations, and errors in the process?
- Which steps are efficient and which steps are inefficient (in terms of time, labor, equipment, materials, and other resources)? The inefficient steps merit further scrutiny.
- Why is there so much waiting time in this process?
- Why is so much material handling required?

Root Cause Analysis. Root cause analysis attempts to identify the significant factors that affect process performance. The situation can be depicted using the following general equation:

$$y = f(x_1, x_2, \dots, x_i, \dots, x_n) \quad (20A.1)$$

where y = some output variable of interest in the project (e.g., some quality feature of importance to the customer); and $x_1, x_2, \dots, x_i, \dots, x_n$ are the independent variables in the process that may affect the output variable. The value of y is a function of the values of x_i . In root cause analysis, the team attempts to determine which of the x_i variables are most important and how they influence y . In all likelihood, there is more than one y variable of interest. For each y , there is likely to be a different set of x_i variables.

Root cause analysis consists of the following phases: (1) brainstorming of hypotheses, (2) eliminating the unlikely hypotheses, and (3) validating the remaining hypotheses. In general, **brainstorming** is a group problem-solving activity that consists of group members spontaneously contributing ideas on a subject of mutual interest. The cause-and-effect diagram (Section 20.4.2) is a tool that is sometimes used to focus thoughts in brainstorming.

At the end of the brainstorming phase, there is a large list of hypotheses, some of which are less likely to be valid than others. The elimination phase begins. The team must use its collective wisdom and knowledge of the process to identify which hypotheses are highest in priority and which ones should be eliminated from further consideration. The list of hypotheses is reduced from a large number to a much smaller number. The important x_i variables are identified, and the relationships of $y = f(x)$ are conjectured.

The final phase of root cause analysis is concerned with validating the reduced list of hypotheses. It involves testing these hypotheses and determining the mathematical relationships for $y = f(x_1, x_2, \dots, x_i, \dots, x_n)$. Scatter diagrams (Section 20.4.2) can be especially useful in determining the shape of the relationship and the form of the mathematical model for the process. In some cases, the team must collect additional data on particular variables that have been identified as significant. It may conduct experiments to ensure that the desired information is extracted from the data collection procedure in the most efficient way.

20A.4 Improve

The fourth step of DMAIC consists of the following phases: (1) generation of alternative improvements, (2) analysis and prioritization of the alternative improvements, and (3) implementation of the improvements.

Generation of Alternative Improvements. The preceding root cause analysis should indicate the areas in which potential improvements and problem solutions are likely to be found. The Six Sigma team uses brainstorming sessions to generate and refine the alternatives. The team searches for improvements and solutions that will reduce defects, increase customer satisfaction, improve the quality of the product or service, reduce variation, and increase process efficiency.

Analysis and Prioritization. In all likelihood, the team has generated more alternatives for improvement than feasibly can be implemented. At this point, the alternatives must be analyzed and prioritized, and those alternatives that are deemed impractical must be discarded. Process mapping is a useful technique that can be used to analyze the alternatives.

The process map developed in this phase is a “should be” description of the process. It incorporates the potential improvements and solutions into the current process to allow visualization and provides graphical documentation of how it would work after the changes have been made. This allows the proposed improvements to be analyzed and refined prior to implementation.

Implementing the Improvements. Having prioritized the proposed improvements, the team moves on to the next phase in the DMAIC improve step, implementation. The priority list of proposed improvements determines where to start. Implementation can

proceed one proposal at a time or in groups of proposals, depending on how the proposed changes relate to each other. For example, if the changes in the process required by two different proposals are very similar, it may make sense to implement both at the same time, even though one proposal occupies a much higher priority than the other. Also, if the objectives of the project are to achieve a certain level of overall improvement in the process that is deemed sufficient, then it may not be necessary to implement all of the proposals on the list.

To determine the overall process improvement, the same quality performance measurements should be made as in the original sigma level assessment. This will provide the project team with a before-and-after comparison to gage the effect of the various changes.

20A.5 Control

Sometimes after process improvements are made, they are gradually discarded and the improvement benefits are eroded over time. Reasons for this phenomenon include human resistance to change, familiarity and comfort associated with the former method, absence of standard procedures detailing the new method, and lack of attention by supervisory personnel. The purpose of the control step in DMAIC is to avoid this potential erosion and to maintain the improved performance that was achieved through implementation of the proposed changes. The control step consists of the following actions: (1) develop a control plan, (2) transfer responsibility back to original owner, and (3) disband the Six Sigma team.

Development of a Control Plan. The final task of the Six Sigma team is to document the results of the project and develop a control plan that will sustain the improvements that have been made in the process. The control plan documentation establishes the *standard operating procedure* (SOP) for the improved process, which should address issues and questions such as the following:

- Details of the process control relationships. This refers to the various $y = f(x_i)$ relationships that have been developed by the Six Sigma team. These relationships indicate how control of the process is achieved and which variables (x_i) are important to achieve it.
- What input variables must be measured and monitored?
- What process variables must be measured and monitored?
- What output variables must be measured and monitored?
- Who is responsible for these measurements?
- What are the corrective action procedures that should be followed in the event that something goes wrong in the process?
- What institutional procedures must be established to maintain the improvements?
- What are the worker training requirements to sustain the improvements?

Transferring Responsibility and Disbanding the Team. The Six Sigma team has been actively involved in the operation of the process for an extended period of time by now. Its work is nearly complete. One of its final actions is to turn whatever responsibility the team had for operating the process back to its original owner (e.g., the champion). The team must make sure that the owner understands the control plan and that it will be continuously implemented.

Once responsibility reverts back to the original owner, the team is no longer needed. It is therefore disbanded, and the master black belt is assigned to a new team and the next project.

Chapter 21

Inspection Principles and Practices

CHAPTER CONTENTS

- 21.1 Inspection Fundamentals
 - 21.1.1 Types of Inspection
 - 21.1.2 Inspection Procedure
 - 21.1.3 Inspection Accuracy
 - 21.1.4 Inspection versus Testing
- 21.2 Sampling versus 100% Inspection
 - 21.2.1 Sampling Inspection
 - 21.2.2 100% Manual Inspection
- 21.3 Automated Inspection
- 21.4 When and Where to Inspect
 - 21.4.1 Off-Line and On-Line Inspection
 - 21.4.2 Product Inspection versus Process Monitoring
 - 21.4.3 Distributed Inspection versus Final Inspection
- 21.5 Analysis of Inspection Systems
 - 21.5.1 Effect of Defect Rate in Serial Production
 - 21.5.2 Final Inspection versus Distributed Inspection
 - 21.5.3 Inspection or No Inspection
 - 21.5.4 What the Equations Tell Us

In quality control, inspection is the means by which poor quality is detected and good quality is assured. Inspection is traditionally accomplished using labor-intensive methods that are time-consuming and costly. Consequently, manufacturing lead time and product cost are increased without adding any real value to the products. In addition, manual

inspection is performed after the process is complete, often after a significant time delay. Therefore, if a bad product has been made, it is too late to correct the defect(s) during regular processing. Parts already manufactured that do not meet specified quality standards must either be scrapped or reworked at additional cost.

New approaches to quality control are addressing these problems and drastically altering the way inspection is accomplished. The new approaches include

- 100% automated inspection rather than sampling inspection by manual methods
- On-line sensor systems to accomplish inspection during or immediately after the manufacturing process, instead of off-line inspection performed later
- Software tools to track and analyze the sensor measurements over time for statistical process control
- Feedback control of the manufacturing operation, monitoring process variables that determine product quality rather than the product itself
- Advanced inspection and sensor technologies, combined with computer-based systems to automate the operation of the sensor systems.

Some of these modern approaches to inspection are examined in this chapter, with an emphasis on automating the inspection function. The relevant inspection technologies such as coordinate measuring machines and machine vision are discussed in the following chapter.

21.1 INSPECTION FUNDAMENTALS

The term *inspection* refers to the activity of examining the product, its components, sub-assemblies, or the raw materials to determine whether they conform to design specifications, which are defined by the product designer.

21.1.1 Types of Inspection

Inspections can be classified into two types, according to the amount of information derived from the inspection procedure about the item's conformance to specification:

1. *Inspection for variables*, in which one or more quality characteristics of interest are measured using an appropriate measuring instrument or sensor. Measurement principles are discussed in Section 22.1.
2. *Inspection for attributes*, in which the part or product is inspected to determine whether it conforms to the accepted quality standard. The determination is sometimes based simply on the judgment of the inspector. In other cases, the inspector uses a gage to aid in the decision. Inspection by attributes can also involve counting the number of defects in a product.

Examples of the two types of inspection are listed in Table 21.1. To relate these differences to the discussion of control charts in the previous chapter, inspection for variables uses the \bar{x} chart and R chart, whereas inspection for attributes uses the p chart or c chart.

TABLE 21.1 Examples of Inspection for Variables and Inspection for Attributes

Inspection for Variables	Inspection for Attributes
Measuring the diameter of a cylindrical part	Gaging a cylindrical part with a GO/NO-GO gage to determine if it is within tolerance
Measuring the temperature of a toaster oven to see if it is within the range specified by design engineering	Determining the fraction defect rate of a sample of production parts
Measuring the electrical resistance of an electronic component	Counting the number of defects in an automobile as it leaves the final assembly plant
Measuring the specific gravity of a fluid chemical product	Counting the number of imperfections in a production run of carpeting

The advantage of inspection for variables is that more information is obtained from the inspection procedure about the item's conformance to design specifications. The inspection yields a quantitative value. Data can be collected and recorded over time to observe trends in the process that makes the part. The data can be used to fine-tune the process so that future parts are produced with dimensions closer to the nominal design value. In attributes inspection (e.g., when a dimension is simply checked with a gage), all that is known is whether the part is acceptable and perhaps whether it is too big or too small. On the other hand, inspection for attributes does have the advantage that it can be done quickly and therefore at lower cost. Measuring the quality characteristic is a more involved procedure that takes more time.

21.1.2 Inspection Procedure

A typical inspection procedure performed on an individual item, such as a part, subassembly, or final product, consists of the following steps [2]:

1. *Presentation.* The item is presented for examination.
2. *Examination.* The item is examined for one or more nonconforming features. In inspection for variables, examination consists of measuring a dimension or other attribute of the part or product. In inspection for attributes, it involves gaging one or more dimensions or searching the item for flaws.
3. *Decision.* Based on the examination, a decision is made whether the item satisfies the defined quality standards. The simplest case involves a binary decision, in which the item is deemed either acceptable or unacceptable. In more complicated cases, the decision may involve grading the item into one of more than two possible quality categories, such as grade A, grade B, and unacceptable.
4. *Action.* The decision should result in some action, such as accepting or rejecting the item, or sorting the item into the most appropriate quality grade. It may also be desirable to take action to correct the manufacturing process to minimize the future occurrence of defects.

The inspection procedure is traditionally performed by a human worker (manual inspection), but automated inspection systems are increasingly being used as sensor and computer technologies are developed and refined for the purpose. In some production situations only one item is produced (e.g., a one-of-a-kind machine or a prototype), and the

inspection procedure is applied only to the one item. In other situations, such as batch production and mass production, the inspection procedure is repeated either on all of the items in the production run (100% inspection, sometimes called *screening*) or on only a sample taken from the population of items (sampling inspection). Manual inspection is more likely to be used when only one item or a sample of parts from a larger batch is inspected, whereas automated systems are more common for 100% inspection in mass production.

In the ideal inspection procedure, all of the specified dimensions and attributes of the part or product would be inspected. However, inspecting every dimension is time consuming and expensive. In general, it is unnecessary. As a practical matter, certain dimensions and specifications are more important than others in terms of assembly or function of the product. These important specifications are called *key characteristics* (KCs). They are the specifications that should be recognized as important in design; they are identified as KCs in the part drawings and engineering specifications, given the most attention in manufacturing, and inspected in quality control. Examples of KCs include matching dimensions of assembled components, surface roughness on bearing surfaces, straightness and concentricity of high speed rotating shafts, and finishes of exterior surfaces of consumer products. The inspection procedure should be designed to focus on these KCs. It usually turns out that if the processes responsible for the KCs are maintained in statistical control (Section 20.3.1), then the other dimensions of the part will also be in statistical control. If these less important part features deviate from their nominal values, the consequences, if any, are less severe than if a KC deviates.

21.1.3 Inspection Accuracy

Errors sometimes occur in the inspection procedure during the examination and decision steps. Items of good quality are incorrectly classified as not conforming to specifications, and nonconforming items are mistakenly classified as conforming. These two kinds of mistakes are called *Type I* and *Type II* errors. A Type I error occurs when an item of good quality is incorrectly classified as being defective. It is a “false alarm.” A Type II error is when an item of poor quality is erroneously classified as being good. It is a “miss.” These error types are portrayed graphically in Table 21.2.

Inspection errors do not always neatly follow the above classification. For example, in inspection for variables, a common inspection error consists of incorrectly measuring a part dimension. As another example, a form of inspection for attributes involves counting the number of nonconforming features on a given product, such as the number of defects on a new automobile coming off the final assembly line. An error is made if the inspector misses one of the defects. In both of these examples, an error may result in either a conforming feature being classified as nonconforming (Type I error) or a nonconforming feature being classified as conforming (Type II error).

TABLE 21.2 Type I and Type II Inspection Errors

Decision	Conforming Item	Nonconforming Item
Accept item	Good decision	Type II error (miss)
Reject item	Type I error (false alarm)	Good decision

In manual inspection, these errors result from factors such as (1) complexity and difficulty of the inspection task, (2) inherent variations in the inspection procedure, (3) judgment required by the human inspector, (4) mental fatigue of the human inspector, and (5) inaccuracies or problems with the gages or measuring instruments used in the inspection procedure. When the procedure is accomplished by an automated system, inspection errors occur due to factors such as (1) complexity and difficulty of the inspection task, (2) resolution of the inspection sensor, which is affected by “gain” and similar control parameter settings, (3) equipment malfunctions, and (4) faults or “bugs” in the computer program controlling the inspection procedure.

The term *inspection accuracy* refers to the capability of the inspection process to avoid these types of errors. Inspection accuracy is high when few or no errors are made. Measures of inspection accuracy are suggested by Drury [2] for the case in which parts are classified by an inspector (or automatic inspection system) into either of two categories, conforming or nonconforming. Considering this binary case, let p_1 = proportion of times (or probability) that a conforming item is classified as conforming, and let p_2 = proportion of times (or probability) that a nonconforming item is classified as nonconforming. Both of these proportions (or probabilities) correspond to correct decisions. Thus, $(1 - p_1)$ = probability that a conforming item is classified as nonconforming (Type I error), and $(1 - p_2)$ = probability that a nonconforming item is classified as conforming (Type II error).

If q = actual fraction defect rate in the batch of items, a table of possible outcomes can be constructed as in Table 21.3 to show the fraction of parts correctly and incorrectly classified and for those incorrectly classified, whether the error is Type I or Type II.

These proportions would have to be assessed empirically for individual inspectors by determining the proportion of correct decisions made in each of the two cases of conforming and nonconforming items in a parts batch of interest. Unfortunately, the proportions vary for different inspection tasks. The error rates are generally higher (lower p_1 and p_2 values) for more difficult inspection tasks. Also, different inspectors tend to have different p_1 and p_2 rates. Typical values of p_1 range between 0.90 and 0.99, and typical p_2 values range between 0.80 and 0.90, but values as low as 0.50 for both p_1 and p_2 have been reported [2].

The parameters p_1 and p_2 are measures of inspection accuracy for a human inspector or an automated inspection system. Each measure taken separately provides useful information because p_1 and p_2 would be expected to vary independently to some degree, and they would depend on the inspection task and the person or system performing the inspection. A practical difficulty in applying the measures is determining the true values of p_1 and p_2 . These values would have to be determined by an alternative inspection process, which would itself be prone to the same errors as the first process whose accuracy is being assessed.

TABLE 21.3 Table of Possible Outcomes in Inspection Procedure, Given q , p_1 , and p_2

Decision	True State of Item		Total
	Conforming	Nonconforming	
Accept item	$p_1(1 - q)$	$(1 - p_2)q$ Type II error	$p_1 + q(1 - p_1 - p_2)$
Reject item	$(1 - p_1)(1 - q)$ Type I error	p_2q	$1 - p_1 - q(1 - p_1 - p_2)$
Total	$(1 - q)$	q	1.0

EXAMPLE 21.1 Inspection Accuracy

A human worker has inspected a batch of 100 parts and reported a total of 12 defects in the batch. On careful reexamination, it was found that four of these reported defects were in fact good pieces (four false alarms), whereas six defective units in the batch were undetected by the inspector (six misses). What is the inspector's accuracy in this instance? Specifically, what are the values of p_1 and p_2 ?

Solution: Of the 12 reported defects, four are good, leaving eight defects among those reported. In addition, six other defects were found among the reportedly good units. Thus, the total number of defects in the batch of 100 is $8 + 6 = 14$. This means there were $100 - 14 = 86$ good units in the batch. The values of p_1 and p_2 can be assessed on the basis of these numbers.

To assess p_1 , note that the inspector reported 12 defects, leaving 88 that were reported as acceptable. Of these 88, six were actually defects, thus leaving $88 - 6 = 82$ actual good units reported by the inspector. Thus, the proportion of good parts reported as conforming is

$$p_1 = \frac{82}{86} = \mathbf{0.9535}$$

There are 14 defects in the batch, of which the inspector correctly identified eight. Thus, the proportion of defects reported as nonconforming is

$$p_2 = \frac{8}{14} = \mathbf{0.5714}$$

21.1.4 Inspection versus Testing

Quality control utilizes both inspection and testing procedures to detect whether a part or product is within design specifications. Both activities are important in a company's quality control program. Whereas inspection is used to assess the quality of the product relative to design specifications, *testing* is a term in quality control that refers to assessment of the functional aspects of the product: Does the product operate the way it is supposed to operate? Will it continue to operate for a reasonable period of time? Will it operate in environments of extreme temperature and humidity? Accordingly, **QC testing** can be defined as a procedure in which the item being tested (product, subassembly, part, or material) is observed during actual operation or under conditions that might be present during operation. For example, a product might be tested by running it for a certain period of time to determine whether it functions properly. If the product passes the test, it is approved for shipment to the customer. As another example, a part, or the material out of which the part is to be made, might be tested by subjecting it to a stress load that is equivalent to or greater than the load anticipated during normal service.

Sometimes the testing procedure is damaging or destructive to the item. To ensure that the majority of the items (e.g., raw materials or finished products) are of satisfactory quality, a limited number of the items are sacrificed. However, the expense of destructive testing is significant enough that great efforts are made to devise methods that do not

result in the destruction of the item. These methods are referred to as *nondestructive testing* (NDT) and *nondestructive evaluation* (NDE).

Another type of testing procedure involves not only the testing of the product to see that it functions properly; it also requires a calibration of the product that depends on the outcome of the test. During the testing procedure, one or more operating variables of the product are measured, and adjustments are made in certain inputs that influence these operating variables. For example, in the testing of certain appliances with heating elements, if the measured temperature is too high or too low after a specified time, adjustments can be made in the control circuitry (e.g., changes in potentiometer settings) to bring the temperature within the acceptable operating range.

21.2 SAMPLING VERSUS 100% INSPECTION

The primary focus of this chapter is inspection rather than testing. As suggested by the preceding descriptions of the two functions, inspection is more closely associated with manufacturing operations. Inspection can be performed using statistical sampling or 100%.

21.2.1 Sampling Inspection

Inspection is traditionally accomplished using manual labor. The work is often boring and monotonous, yet the need for precision and accuracy is great. Sometimes it takes hours to measure the important dimensions of only one work part. Because of the time and expense involved in inspection work, sampling procedures are often used to reduce the need to inspect every part. The statistical sampling procedures are known by the terms *acceptance sampling* or *lot sampling*.

Types of Sampling Plans. There are two basic types of acceptance sampling: (1) variables sampling and (2) attributes sampling, corresponding to inspection for variables and inspection for attributes described in Section 21.1.1. In a variables sampling plan, a random sample is taken from the population, and the quality characteristic of interest (e.g., a part dimension) is measured for each unit in the sample. These measurements are then averaged, and the mean value is compared with an allowed value for the plan. The batch is then accepted or rejected depending on the results of this comparison. The allowed value used in the comparison is chosen so that the probability that the batch will be rejected is small unless the actual quality level in the population is indeed poor.

In an attributes sampling plan, a random sample is drawn from the batch, and the units in the sample are classified as acceptable or defective, depending on the quality criterion being used. The batch is accepted if the number of defects does not exceed a certain value, called the *acceptance number*. If the number of defects found in the sample is greater than the acceptance number, the batch is rejected. As in variables sampling, the value of the acceptance number is selected so that the probability that the batch will be rejected is small unless the overall quality of the parts in the batch is poor.

In sampling, there is almost always a probability that the batch will be rejected even if the overall quality is acceptable (except when $q = 0$ in the batch). Similarly, there is a probability that the batch will be accepted even if the overall quality level in the batch is not acceptable (except when $q = 1$). Statistical errors are a fact of life in statistical sampling. What is meant by the word “acceptable” in the context of acceptance sampling and

what are the risks associated with committing a statistical error? The focus here will be on attributes sampling, but the same basic notions apply to variables sampling. Ideally, a batch of parts would be absolutely free of defects. However, such perfection is difficult if not impossible to attain in practice. Accordingly, the customer and the supplier agree that a certain level of quality is acceptable, even though that quality is less than perfect. This *acceptable quality level (AQL)*, as it is called, is defined in terms of fraction defect rate q_o . Alternatively, there is another level of quality, again defined in terms of fraction defect rate q_1 , where $q_1 > q_o$, which the customer and supplier agree is unacceptable. This q_1 level is called the *lot tolerance percent defective (LTPD)*.

Statistical Errors in Sampling. Two possible statistical errors can occur in acceptance sampling. The first is rejecting a batch of product that is equal to or better than the *AQL* (meaning that the actual $q \leq q_o$). This is a Type I error, and the probability of committing this type of error is called the *producer's risk* and symbolized α . The second error is accepting a batch of product whose quality is worse than the *LTPD* ($q \geq q_1$). This is a Type II error, and the probability of this error is called the *consumer's risk* and symbolized β . These errors are depicted in Table 21.4. Sampling errors should not be confused with the inspection errors previously described in the discussion of inspection accuracy (Section 21.1.3). Sampling errors occur because only a fraction of the total population has been inspected. One is at the mercy of the laws of probability as to whether the sample is an accurate reflection of the population. Inspection errors, on the other hand, occur when an individual item is wrongly classified as being defective when it is good (Type I error) or good when it is defective (Type II error).

Design of an acceptance sampling plan involves determining values of the sample size Q_s and the acceptance number N_a that provide the agreed-on *AQL* and *LTPD*, together with the associated probabilities α and β (producer's and consumer's risks). Procedures for determining Q_s and N_a based on *AQL*, *LTPD*, α , and β are described in texts on quality control, such as [3] and [4]. Also, standard sampling plans have been developed, such as MIL-STD-105D (also known as ANSI/ASQC Z1.4, the U.S. standard, and ISO/DIS-2859, the international standard).

Operating Characteristic Curve. Much information about a sampling plan can be obtained from its operating characteristic curve (OC curve). The operating characteristic curve for a given sampling plan gives the probability that a batch will be accepted as a function of the possible fraction defect rates that might exist in the batch. The general shape of the OC curve is shown in Figure 21.1. In effect, the OC curve indicates the degree of protection provided by the sampling plan for various quality levels of incoming lots. If the incoming batch has a high quality level (low q), then the probability of acceptance is high. If the quality level of the incoming batch is poor (high q), then the probability of acceptance is low.

TABLE 21.4 Type I and Type II Sampling Errors

Decision	Acceptable Batch	Unacceptable Batch
Accept batch	Good decision	Type II error (β) Consumer's risk
Reject batch	Type I error Producer's risk (α)	Good decision

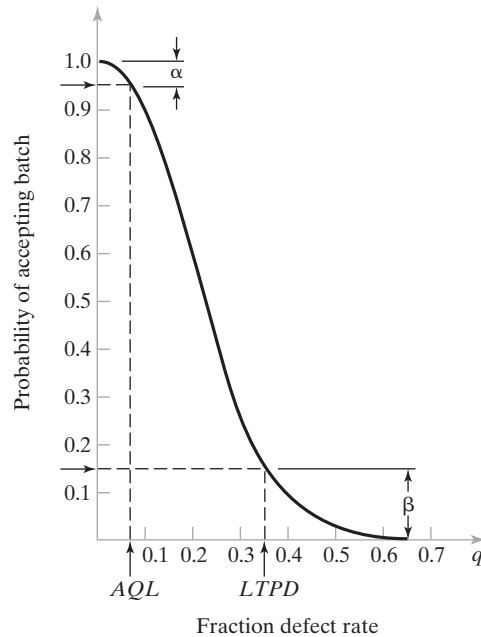


Figure 21.1 The operating characteristic (OC) curve for a given sampling plan shows the probability of accepting the lot for different fraction defect rates of incoming batches.

When a batch is rejected as a result of a sampling procedure, several possible actions might be taken. One possibility is to send the parts back to the supplier. If there is an immediate need for the parts in production, this action may be impractical. A more appropriate action may be to inspect the batch 100% and sort out the defects, which are sent back to the supplier for replacement or credit. A third possible action is to sort out the defects and rework or replace them at the supplier's expense. Whatever the action, rejecting a batch leads to corrective action that has the effect of improving the overall quality of the batch exiting the inspection operation. A given sampling plan can be described by its *average outgoing quality curve* (AOQ curve), the typical shape of which is illustrated in Figure 21.2. The AOQ curve shows the average quality of batches passing through the sampling inspection plan as a function of incoming lot quality (before inspection). As one would expect, when the incoming quality is good (low q), the average outgoing quality is good (low AOQ). When the incoming quality is poor (high q), the AOQ is also low because there is a strong probability of rejecting the batch, with the resulting action that defectives in the batch are sorted out and replaced with good parts. It is in the intermediate range, between the AQL and LTPD, that the outgoing batch quality of the sampling plan is the poorest. As shown in the plot, the highest AOQ level will be found at some intermediate value of q , and this AOQ is called the *average outgoing quality limit* (AOQL) of the plan.

21.2.2 100% Manual Inspection

When sampling inspection is conducted, the sample size is often small compared with the size of the population. The sample size may represent only 1% or fewer of the number of parts in the batch. Because only a portion of the items in the population is inspected in a statistical sampling procedure, there is a risk that some defective parts will slip around the

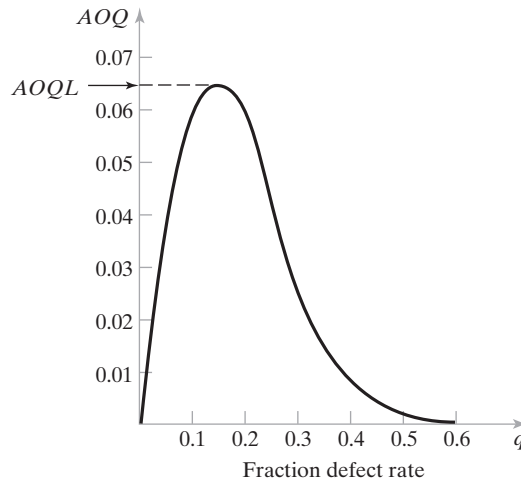


Figure 21.2 Average outgoing quality (AOQ) curve for a sampling plan.

inspection screen. As indicated in the preceding discussion of average outgoing quality, one of the objectives in statistical sampling is to define the expected risk; that is, to determine the average fraction defect rate that will pass through the sampling inspection procedure over the long run, under the assumption that the manufacturing process remains in statistical control. The frequency with which samples are taken, the sample size, and the permissible quality level (AQL) are three important factors that affect the level of risk involved. But the fact remains that something less than 100% good quality must be tolerated as the price to be paid for using statistical sampling.

In principle, the only way to achieve 100% acceptable quality is to use 100% inspection. It is instructive to compare the OC curve of a 100% inspection plan, shown in Figure 21.3, with the OC curve of a sampling plan as in Figure 21.1. The advantage of 100% inspection is that the probability the batch will be accepted is 1.0 if its quality is equal to or better than the AQL and zero if the quality is lower than the AQL . One might logically argue that the term *acceptable quality level* has less meaning in 100% inspection, since a target of zero defects should be attainable if every part in the batch is inspected; in other words, the AQL should be set at $q = 0$. However, one must distinguish between the output of the manufacturing process that makes the parts and the output of the inspection procedure that sorts them. It may be possible to separate out all of the defects in the batch so that only good parts remain after inspection ($AOQ =$ zero defects), whereas the manufacturing process still produces defects at a certain fraction defect rate q , where $q > 0$.

Theoretically, 100% inspection allows only good quality parts to pass through the inspection procedure. However, when 100% inspection is done manually, two problems arise: First, the obvious problem is the expense involved. Instead of dividing the time of inspecting the sample over the number of parts in the production run, the inspection time per piece is applied to every part. The inspection cost sometimes exceeds the cost of making the part. Second, with 100% manual inspection, there is the problem of inspection accuracy (Section 21.1.3). There are almost always errors associated with 100% inspection (Type I and II errors), especially when the inspection procedure is performed by human inspectors. Because of these human errors, 100% inspection using manual methods is no guarantee of 100% good quality product.

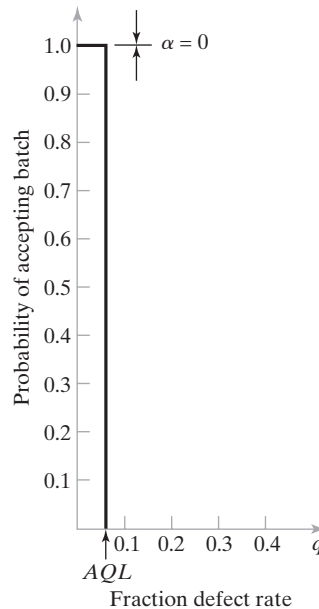


Figure 21.3 Operating characteristic curve of a 100% inspection plan.

21.3 AUTOMATED INSPECTION

An alternative to manual inspection is automated inspection. Automation of the inspection procedure will almost always reduce inspection time per piece, and automated machines do not experience the fatigue and mental errors suffered by human inspectors. Economic justification of an automated inspection system depends on whether the savings in labor cost and improvement in accuracy will more than offset the investment and/or development costs of the system.

Automated inspection can be defined as the automation of one or more of the steps involved in the inspection procedure. There are a number of alternative ways in which automated or semiautomated inspection can be implemented:

1. Automated presentation of parts by an automatic handling system with a human operator still performing the examination and decision steps.
2. Automated examination and decision by an automatic inspection machine, with manual loading (presentation) of parts into the machine.
3. Completely automated inspection system in which parts presentation, examination, and decision are all performed automatically.

In the first case, the inspection procedure is performed by a human worker, with all of the possible errors in this form of inspection. In cases (2) and (3), the actual inspection operation is accomplished by an automated system. These latter cases are of primary interest here.

As in manual inspection, automated inspection can be performed using statistical sampling or 100%. When statistical sampling is used, sampling errors are possible.

With either sampling or 100% inspection, automated systems can commit inspection errors, just like human inspectors. For simple inspection tasks, such as automatic gaging of a single dimension on a part, automated systems operate with high accuracy (low error rate). As the inspection operation becomes more complex and difficult, the error rate tends to increase. Some machine vision applications (Section 22.5.4) fall into this category—for example, detecting defects in integrated circuit chips or printed circuit boards. It should be mentioned that these inspection tasks are also complex and difficult for human workers, and this is one of the reasons for developing automated inspection systems that can do the job.

Some automated inspection systems can be adjusted to increase their sensitivity to the defect they are designed to detect. This is accomplished by means of a “gain” adjustment or similar control. When the sensitivity adjustment is low, the probability of a Type I error is low but the probability of a Type II error is high. When the sensitivity adjustment is increased, the probability of a Type I error increases, while the probability of a Type II error decreases. This relationship is portrayed in Figure 21.4. Because of these errors, 100% automated inspection cannot guarantee 100% good quality product.

The full potential of automated inspection is best achieved when it is integrated into the manufacturing process, when 100% inspection is used, and when the results of the procedure lead to some positive action. The positive actions can take either or both of two possible forms, as illustrated in Figure 21.5:

- (a) *Feedback process control.* In this case, data are fed back to the preceding manufacturing process responsible for the quality characteristics being evaluated or gaged in the inspection operation. The purpose of feedback is to allow compensating adjustments to be made in the process to reduce variability and improve quality. If the measurements from the automated inspection indicate that the output of the

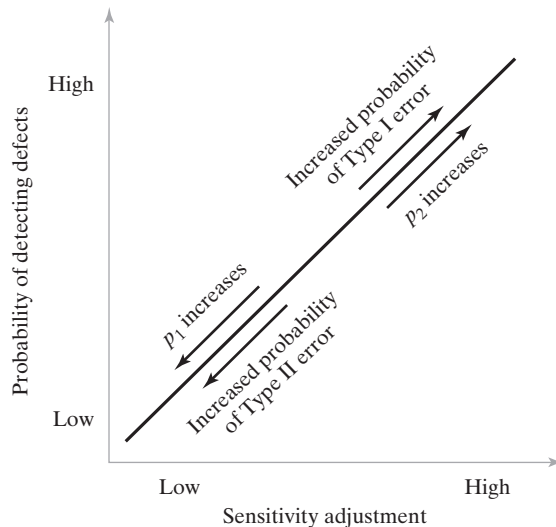


Figure 21.4 Relationship between sensitivity of an automated inspection system and the probability of Type I and Type II errors: p_1 = the probability that a conforming item is correctly classified, and p_2 = the probability that a nonconforming item is correctly classified.

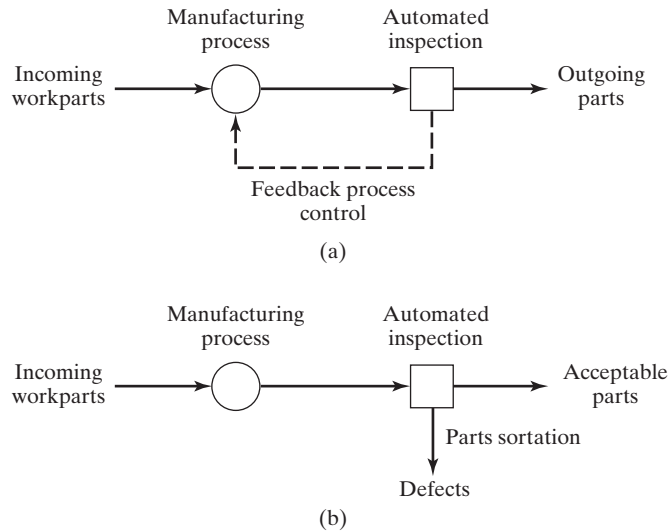


Figure 21.5 Action steps resulting from automated inspection: (a) feedback process control and (b) sortation of parts into two or more quality levels.

process is beginning to drift toward the high side of the tolerance (e.g., tool wear might cause a part dimension to increase over time), corrections can be made in the input parameters to bring the output back to the nominal value. In this way, average quality is maintained within a smaller variability range than is possible with sampling inspection methods. In effect, process capability is improved.

- (b) *Parts sortation*. In this case, the parts are sorted according to quality level: acceptable versus unacceptable. There may be more than two levels of quality appropriate for the process (e.g., acceptable, reworkable, and scrap). Sortation and inspection may be accomplished in several ways. One alternative is to both inspect and sort at the same station. Other installations locate one or more inspections along the processing line, with a single sortation station near the end of the line. Inspection data are analyzed and instructions are forwarded to the sortation station indicating what action is required for each part as it passes.

21.4 WHEN AND WHERE TO INSPECT

Inspection can be performed at any of several places in production: (1) receiving, when raw materials and parts are received from suppliers, (2) various stages of manufacture, and (3) before shipment to the customer. In this section the principal focus is on case (2), that is, when and where to inspect during production.

21.4.1 Off-Line and On-Line Inspection

The timing of the inspection procedure in relation to the manufacturing process is an important consideration in quality control. Three alternative situations can be distinguished, shown in Figure 21.6: (a) off-line inspection, (b) on-line/in-process inspection, and (c) on-line/post-process inspection.

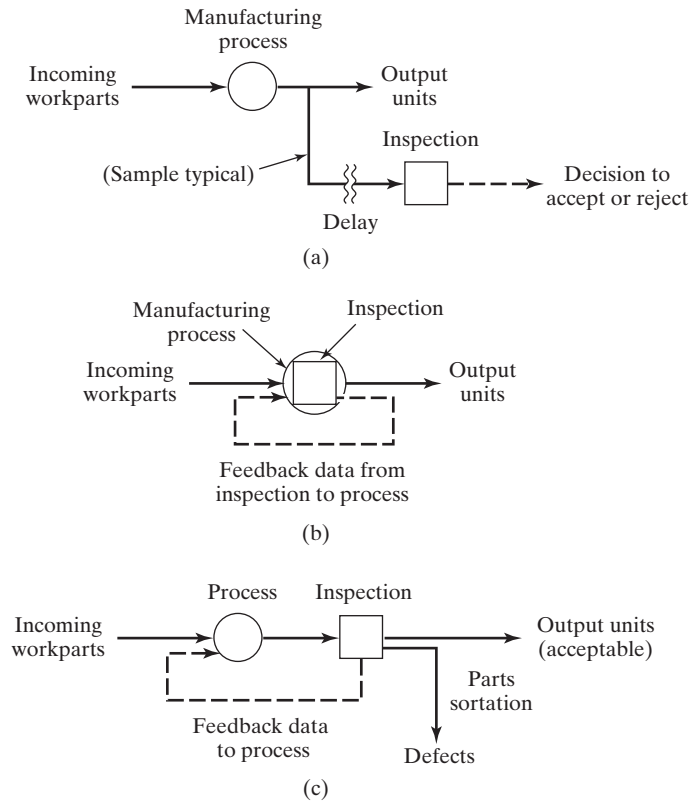


Figure 21.6 Three inspection alternatives are (a) off-line inspection, (b) on-line/in-process inspection, and (c) on-line/post-process inspection.

Off-Line Inspection. Off-line inspection is performed away from the manufacturing process, and there is generally a time delay between processing and inspection. Off-line inspection is often accomplished using statistical sampling methods. Manual inspection is common. Factors that tend to promote the use of off-line inspection are (1) variability of the process is well within the design tolerance, (2) processing conditions are stable and the risk of significant deviations in the process is small, and (3) cost of inspection is high relative to the cost of a few defective parts. The disadvantage of off-line inspection is that the parts have already been made by the time poor quality is detected. When sampling is used, an additional disadvantage is that defective parts can pass around the sampling procedure.

On-Line Inspection. The alternative to off-line inspection is on-line inspection performed when the parts are made, either as an integral step in the processing or assembly operation, or immediately afterward. Two on-line inspection procedures can be distinguished: on-line/in-process and on-line/post-process, illustrated in Figure 21.6(b) and (c).

On-line/in-process inspection is achieved by performing the inspection procedure during the manufacturing operation. As the parts are being made, the inspection procedure simultaneously measures or gages their dimensions. The benefit of in-process inspection is that it may be possible to influence the operation that is making the current part, thereby correcting a potential quality problem before the part is completed. When on-line/in-process

inspection is performed manually, it means that the worker who is performing the manufacturing process is also performing the inspection procedure. For automated manufacturing systems, this on-line inspection method is typically done on a 100% basis using automated sensor methods. Technologically, automated on-line/in-process inspection of the product is usually difficult and expensive to implement.

With *on-line/post-process inspection*, the measurement or gaging procedure is accomplished immediately following the production process. Even though it follows the process, it is still considered an on-line method because it is integrated with the manufacturing workstation, and the results of the inspection can immediately influence the production operation. The limitation of on-line/post-process inspection is that the part has already been made, and it is therefore impossible to make corrections that will influence its processing. The best that can be done is to influence the production of the next part.

On-line/post-process inspection can be performed as either a manual or an automated procedure. When done manually, it can be accomplished using either sampling or 100% inspection (with all of the risks associated with each). Gaging of part dimensions at the production machine with go/no-go gages is a common example of on-line/post-process inspection. When on-line/post-process inspection is automated, it is typically performed on a 100% basis. Whether manual or automated, the inspection procedure generates data that can be analyzed by using statistical process control techniques (Section 20.4).

Either form of on-line inspection should drive some action in the manufacturing operation, either feedback process control or parts sortation. If on-line inspection results in no action, then off-line inspection might as well be used instead of on-line technologies.

21.4.2 Product Inspection versus Process Monitoring

In the preceding discussion of inspection issues, it has been implicitly assumed that the product itself was being measured or gaged, either during or after the manufacturing process. An alternative approach is to measure the process rather than the product; that is, to monitor the key parameters of the manufacturing process that determine product quality. The advantage of this approach is that an on-line/in-process measurement system is much more likely to be practicable for process variables than for product variables. Such a measurement procedure could be readily incorporated into an on-line feedback control system, permitting any required corrective action to be taken while the product is still being processed and theoretically preventing defective units from being made. If this arrangement were entirely reliable, it would avoid, or at least reduce, the need for subsequent off-line inspection of the actual product.

Use of process monitoring as an alternative to product inspection relies on the assumption of a deterministic cause-and-effect relationship between the process parameters that can be measured and the quality characteristics that must be maintained within tolerance. Accordingly, by controlling the process parameters, indirect control of product quality is achieved. This assumption is most applicable under the following circumstances: (1) the process is well behaved, meaning that it is ordinarily in statistical control and that deviations from this normal condition are rare; (2) process capability is good, meaning that the standard deviation of each process variable of interest under normal operating conditions is small; and (3) the process has been studied to establish the cause-and-effect relationships between process variables and product quality characteristics, and mathematical models of these relationships have been derived.

Although the approach of controlling product quality indirectly through the use of process monitoring is uncommon in piece parts production, it is quite prevalent in the continuous process industries such as chemicals and petroleum. In these continuous

processes, it is usually difficult to directly measure the product quality characteristics of interest, except by periodic sampling. To maintain uninterrupted control over product quality, the related process parameters are monitored and regulated continuously. Typical production variables in the process industries include temperature, pressure, flow rates, and similar variables that can be easily measured (chemical engineers might dispute how easily these variables can be measured) and can be combined into mathematical equations to predict product characteristics of interest. Variables in discrete product manufacturing are generally more difficult to measure, and mathematical models that relate them to product quality are not as easy to derive. Examples of process variables in the parts production industries include tool wear, deflection of production machinery components, part deflection during processing, vibration frequencies and amplitudes of machinery, and temperature profiles of production machinery and piece parts during processing [1].

21.4.3 Distributed Inspection versus Final Inspection

When inspection stations are located along the line of work flow in a factory, this is known as *distributed inspection*. In the most extreme case, inspection and sortation operations are located after every processing step. However, a more common and cost-effective approach is for inspections to be strategically placed at critical points in the manufacturing sequence, with several manufacturing operations between each inspection. The function of a distributed inspection system is to identify defective parts or products right after they have been processed so that these defects can be excluded from further processing. The goal is to prevent wasteful cost from being invested in defective units. This is especially relevant in assembled products where many components are combined into a single entity that cannot easily be taken apart. If one defective component would render the assembly defective, then it is obviously preferable to catch the defect before it is assembled. These situations are found in electronics manufacturing operations. Printed circuit board (PCB) assembly is a good example. An assembled PCB may consist of 100 or more electronic components that have been soldered to the baseboard. If only one of the components is defective, the entire board may be useless unless repaired at substantial additional cost. In these kinds of cases, it is important to discover and remove the defects from the production line before further processing or assembly is accomplished. 100% on-line automated inspection is most appropriate in these situations.

Another approach, sometimes considered an alternative to distributed inspection, is final inspection, which involves one comprehensive inspection procedure on the product immediately before shipment to the customer. The motivation behind this approach is that it is more efficient, from an inspection viewpoint, to perform all of the inspection tasks in one place, rather than distribute them throughout the plant. Final inspection is more appealing to the customer because, in principle, if done effectively, it offers the greatest protection against poor quality.

However, exclusive implementation of the final inspection approach (without some intermediate inspection of the product as it is being made) is potentially very expensive to the producer for two reasons: (1) the wasted cost of defective units made in early processing steps being processed in subsequent operations and (2) the cost of final inspection itself. The first issue, cost of processing defective units, has been discussed. The second issue, inspection cost, will benefit from elaboration. Final inspection, when performed on a 100% basis, can be very costly since every unit of product is subjected to an inspection procedure that must be designed to detect all possible defects. The procedure often requires functional testing as well as inspection. If the inspection is performed manually

on a 100% basis, as at least a portion of it is likely to be done, it is subject to the risks of 100% manual inspection (Section 21.2.2). Because of these costs and risks, the producer often resorts to sampling inspection, with the associated statistical risks of defective product slipping around the sample to the customer (Section 21.2.1). Thus, final product inspection is potentially costly, potentially ineffective, or both.

Quality conscious manufacturers combine the two strategies. Distributed inspection is used for operations with high defect rates to prevent processing of bad parts in later operations and to ensure that only good components are assembled in the product, and some form of final inspection is used on the finished units to ensure that only the highest quality product is delivered to the customer.

21.5 ANALYSIS OF INSPECTION SYSTEMS

Mathematical models can be developed to analyze certain performance aspects of production and inspection. In this section, three areas are examined: (1) effect of defect rate on production quantities in a sequence of production operations, (2) final inspection versus distributed inspection, and (3) when to inspect and when not to inspect.

21.5.1 Effect of Defect Rate in Serial Production

The basic element in the analysis is the unit operation for a manufacturing process, illustrated in Figure 21.7. The process is depicted by a node, the input to which is a starting quantity of raw material. Let Q_o = the starting quantity or batch size to be processed. The process has a certain fraction defect rate q (stated another way, q = probability of producing a defective piece each cycle of operation), so the quantity of good pieces produced is diminished in size as

$$Q = Q_o(1 - q) \quad (21.1)$$

where Q = quantity of good products made in the process, pc; Q_o = original or starting quantity, pc; and q = fraction defect rate. The number of defects is given by

$$D = Q_oq \quad (21.2)$$

where D = number of defects made in the process, pc.

Most manufactured parts require more than one processing operation. The operations are performed in sequence on the parts, as depicted in Figure 21.8. Each process has a fraction defect rate q_i , so the final quantity of defect-free parts made by a sequence of n unit operations is given by

$$Q_f = Q_o \prod_{i=1}^n (1 - q_i) \quad (21.3)$$

 


Figure 21.7 The unit operation for a manufacturing process, represented as an input–output model in which the process has a certain fraction defect rate.

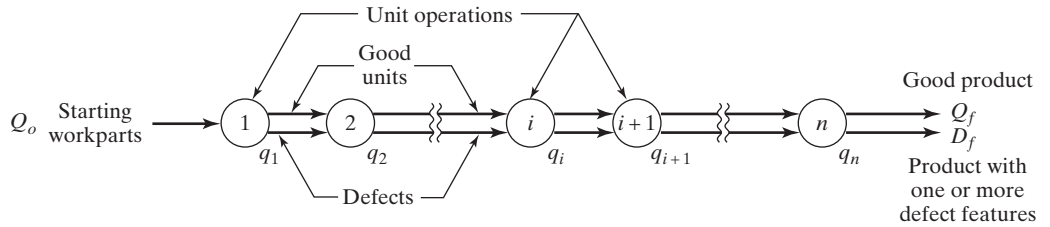


Figure 21.8 A sequence of n unit operations used to produce a part. Each process has a certain fraction defect rate.

where Q_f = final quantity of defect-free units produced by the sequence of n processing operations, pc; and Q_o is the starting quantity. If all q_i are equal, which is unlikely but nevertheless convenient for conceptualization and computation, then the preceding equation becomes

$$Q_f = Q_o(1 - q)^n \tag{21.4}$$

where q = fraction defect rate for each of the n processing operations. The total number of defects produced by the sequence is computed as

$$D_f = Q_o - Q_f \tag{21.5}$$

where D_f = total number of defects produced.

EXAMPLE 21.2 Compounding Effect of Defect Rate in a Sequence of Operations

A batch of 1,000 raw work units is processed through 10 operations, each of which has a fraction defect rate of 0.05. How many defect-free units and how many defects are in the final batch?

Solution: Equation (21.4) can be used to determine the quantity of defect-free units in the final batch:

$$Q_f = 1,000(1 - .05)^{10} = 1,000(0.95)^{10} = 1,000(0.59874) = \mathbf{599 \text{ good units}}$$

The number of defects is given by Equation (21.5):

$$D_f = 1,000 - 599 = \mathbf{401 \text{ defective units}}$$

The binomial expansion can be used to determine the allocation of defects associated with each processing operation i . Given that q_i = probability of a defect being produced in operation i , let p_i = probability of a good unit being produced in the same operation; thus, $p_i + q_i = 1$. Expanding this for n operations,

$$\prod_{i=1}^n (p_i + q_i) = 1 \tag{21.6}$$

To illustrate, consider the case of two operations in sequence ($n = 2$). The binomial expansion yields the expression

$$(p_1 + q_1)(p_2 + q_2) = p_1p_2 + p_1q_2 + p_2q_1 + q_1q_2$$

where p_1p_2 = proportion of defect-free parts, p_1q_2 = proportion of parts that have no defects from operation 1 but a defect from operation 2, p_2q_1 = proportion of parts that have no defects from operation 2 but a defect from operation 1, and q_1q_2 = proportion of parts that have both types of defect.

21.5.2 Final Inspection versus Distributed Inspection

The preceding model portrays a sequence of operations, each with its own fraction defect rate, whose output forms a distribution of parts possessing either (1) no defects or (2) one or more defects, depending on how the defect rates from the different unit operations combine. The model makes no provision for separating the good units from the defects; thus, the final output is a mixture of the two categories. This is a problem. To deal with the problem, the model will be expanded to include inspection operations, either one final inspection at the end of the sequence or distributed inspection, in which an inspection is performed immediately after each production step.

Final Inspection. In the first case, one final inspection and sortation operation is located at the end of the production sequence, as represented by the square in Figure 21.9. In this case, the output of the process is 100% inspected to identify and separate defective units. The inspection screen is assumed to be 100% accurate, meaning that there are no Type I or Type II inspection errors.

The probabilities in this new arrangement are pretty much the same as before. Defects are still produced. The difference is that the defective units D_f have been completely and accurately isolated from the good units Q_f by the final inspection procedure. Obviously, there is a cost associated with the inspection and sortation operation that is added to the regular cost of processing. The costs of processing and then sorting a batch of Q_o parts as indicated in Figure 21.9 can be expressed as

$$C_b = Q_o \sum_{i=1}^n C_{pri} + Q_o C_{sf} = Q_o \left(\sum_{i=1}^n C_{pri} + C_{sf} \right) \quad (21.7)$$

where C_b = cost of processing and sorting the batch, \$/batch; Q_o = number of parts in the starting batch, pc; C_{pri} = cost of processing a part at operation i , \$/pc; and C_{sf} = cost of the final inspection and sortation per part, \$/pc. The processing cost C_{pri} is applicable

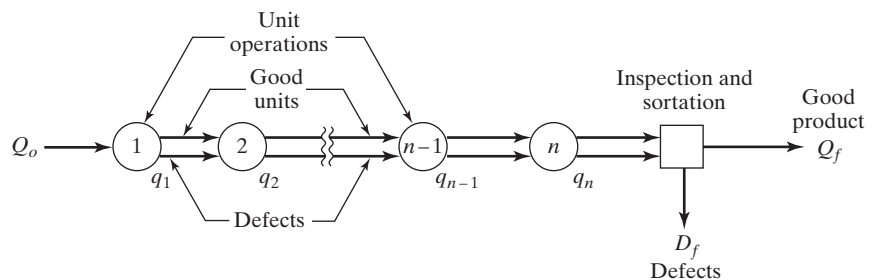


Figure 21.9 A sequence of n unit operations with one final inspection and sortation operation to separate the defects.

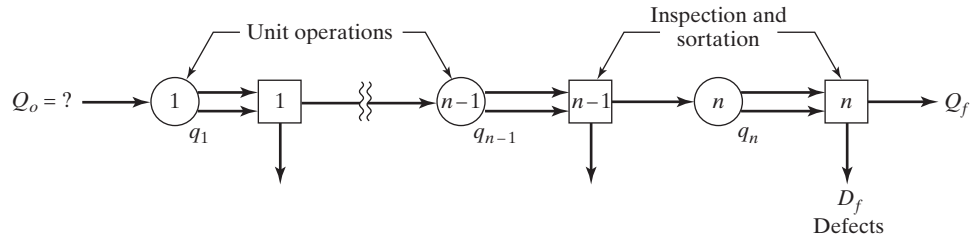


Figure 21.10 Distributed inspection, consisting of a sequence of unit operations with an inspection and sortation after each operation.

to every unit for each of the n operations, hence the summation from 1 to n . The final inspection is done once for each unit. Material cost has not been included in the analysis. For the special case in which all processing costs are equal ($C_{pri} = C_{pr}$ for all i),

$$C_b = Q_o(nC_{pr} + C_{sf}) \tag{21.8}$$

Note that the fraction defect rate does not figure into total cost in either of these equations, because no defective units are sorted from the batch until after the final processing operation. Therefore, every unit in Q_o is processed through all operations, whether it is good or defective, and every unit is inspected and sorted.

Distributed Inspection. Next, consider a distributed inspection strategy, in which every operation in the sequence is followed by an inspection and sortation step, as seen in Figure 21.10. In this arrangement, the defects produced in each processing step are sorted from the batch immediately after they are made, so that only good parts are permitted to advance to the next operation. In this way, no defective units are processed in subsequent operations, thereby saving the processing cost of those units. The model of distributed inspection must take the defect rate at each operation into account as

$$C_b = Q_o(C_{pr1} + C_{s1}) + Q_o(1 - q_1)(C_{pr2} + C_{s2}) + Q_o(1 - q_1)(1 - q_2)(C_{pr3} + C_{s3}) + \dots + Q_o \prod_{i=1}^{n-1} (1 - q_i)(C_{prn} + C_{sn}) \tag{21.9}$$

where $C_{s1}, C_{s2}, \dots, C_{s1}, \dots, C_{sn}$ = costs of inspection and sortation at each station, respectively. In the special case where $q_i = q, C_{pri} = C_{pr}$, and $C_{si} = C_s$ for all i , the above equation simplifies to

$$C_b = Q_o(1 + (1 - q) + (1 - q)^2 + \dots + (1 - q)^{n-1})(C_{pr} + C_s) \tag{21.10}$$

EXAMPLE 21.3 Final Inspection versus Distributed Inspection

Two inspection alternatives are to be compared for a processing sequence consisting of ten operations: (1) one final inspection and sortation operation following the tenth processing operation and (2) distributed inspection with an inspection and sortation operation after each of the ten processing operations. The batch

size $Q_o = 1,000$ pieces. The cost of each processing operation $C_{pr} = \$1.00$. The fraction defect rate at each operation $q = 0.05$. The cost of the single final inspection and sortation operation in alternative (1) is $C_{sf} = \$2.50$. The cost of each inspection and sortation operation in alternative (2) is $C_s = \$0.25$. Compare total processing and inspection costs for the two cases.

Solution: For the final inspection alternative, Equation (21.8) is used to determine the batch cost:

$$C_b = 1,000(10 \times 1.00 + 2.50) = 1,000(12.50) = \mathbf{\$12,500}$$

For the distributed inspection alternative, Equation (21.10) is used to solve for the batch cost:

$$\begin{aligned} C_b &= 1,000(1 + (.95) + (.95)^2 + \cdots + (.95)^9)(1.00 + 0.25) \\ &= 1,000(8.0252)(1.25) = \mathbf{\$10,032} \end{aligned}$$

For the cost data in Example 21.3, the cost of distributed inspection is less than the final inspection alternative. A savings of \$2,468 or nearly 20% is achieved by using distributed inspection. The reader might question: Why is the cost of one final inspection (\$2.50) so much more than the cost of an inspection in distributed inspection (\$0.25)? Both a logical answer and a practical answer to the question are offered in the following discussion. The logical answer goes like this: Each processing step produces its own unique defect feature (at fraction defect rate q_i), and the inspection procedure must be designed to inspect for that feature. For ten processing operations with ten different defect features, the cost to inspect for these features is the same whether the inspection is accomplished after each processing step or all at once after the final processing step. If the cost of inspecting for each defect feature is \$0.25, it follows that the cost of inspecting for all ten defect features is simply $10(\$0.25) = \2.50 . In general, this relationship can be expressed as

$$C_{sf} = \sum_{i=1}^n C_{si} \quad (21.11)$$

For the special case where all C_{si} are equal ($C_{si} = C_s$ for all i), as in Example 21.3,

$$C_{sf} = nC_s \quad (21.12)$$

Given this multiplicative relationship between the single final inspection cost and the unit inspection cost in distributed inspection, it is readily seen that the total cost advantage of distributed inspection in Example 21.3 derives entirely from the fact that the number of parts that are processed and inspected is reduced after each processing step due to the sortation of defective units from the batch during production rather than afterward.

Notwithstanding the logic of Equations (21.11) and (21.12), it is very likely that in practice there is some economy in performing one inspection procedure at a single location, even if the procedure includes scrutinizing the product for ten different defect features. Thus, the actual final inspection cost per unit C_{sf} is likely to be less than the sum of the unit costs in distributed inspection. Nevertheless, the fact remains that distributed inspection and sortation reduces the number of units processed, thus avoiding the waste of production resources on the processing of defective units.

Partially Distributed Inspection. A distributed inspection strategy can be followed in which inspections are located between groups of processes rather than after every processing step as in Example 21.3. If there is any economy in performing multiple inspections at a single location, as argued in the preceding paragraph, then this might be a worthwhile way to exploit this economy while preserving at least some of the advantages of distributed inspection. Example 21.4 illustrates the grouping of unit operations for inspection purposes. As one would expect, the total batch cost lies between the two cases of fully distributed inspection and final inspection for the data in the example.

EXAMPLE 21.4 Partially Distributed Inspection

For comparison, the same sequence of ten processing operations is considered, and the fraction defect rate of each operation is the same, $q = 0.05$. Instead of inspecting and sorting after every operation, the ten operations will be divided into groups of five, with inspections after operations 5 and 10. Following the logic of Equation (21.12), the cost of each inspection will be five times the cost of inspecting for one defect feature; that is, $C_{s5} = C_{s10} = 5(\$0.25) = \1.25 per unit inspected. Processing cost per unit for each process remains the same as before at $C_{pr} = \$1.00$, and $Q_o = 1,000$ units.

Solution: The batch cost is the processing cost for all 1,000 pieces for the first five operations, after which the inspection and sortation procedure separates the defects produced in those first five operations from the rest of the batch; this reduced batch quantity then proceeds through operations 6 through 10, followed by the second inspection and sortation procedure. The equation for this is the following:

$$C_b = Q_o \left(\sum_{i=1}^5 C_{pri} + C_{s5} \right) + Q_o \prod_{i=1}^5 (1 - q_i) \left(\sum_{i=6}^{10} C_{pri} + C_{s10} \right) \quad (21.13)$$

Since all C_{pri} are equal ($C_{pri} = C_{pr}$ for all i), and all q are equal ($q_i = q$ for all i), this equation can be simplified to

$$C_b = Q_o(5C_{pr} + C_{s5}) + Q_o(1 - q)^5(5C_{pr} + C_{s10}) \quad (21.14)$$

Using the values for this example,

$$\begin{aligned} C_b &= 1,000(5 \times 1.00 + 1.25) + 1,000(.95)^5(5 \times 1.00 + 1.25) \\ &= 1,000(6.25) + 1,000(0.7738)(6.25) = \mathbf{\$11,086} \end{aligned}$$

This is a savings of \$1,414 or 11.3% compared with the \$12,500 cost of one final inspection. Note that a significant portion of the total savings from fully distributed inspection has been achieved by using only two inspection stations rather than ten. The savings of \$1,414 is about 57% of the \$2,468 savings from the previous example, with only 20% of the inspection stations. This suggests that it may not be advantageous to locate an inspection operation after every production step, but instead to place them after groups of operations. The “law of diminishing returns” is applicable in distributed inspection.

21.5.3 Inspection or No Inspection

A relatively simple model for deciding whether to inspect at a certain point in the production sequence is proposed in Juran and Gryna [3]. The model uses the fraction defect rate in the production batch, the inspection cost per unit inspected, and the cost of damage that one defective unit would cause if it were not inspected. The total cost per batch of 100% inspection can be formulated as

$$C_b(100\% \text{ inspection}) = QC_s \quad (21.15)$$

where C_b = total cost for the batch under consideration, \$/batch; Q = quantity of parts in the batch, pc; and C_s = inspection and sortation cost per part, \$/pc. The total cost of no inspection, which leads to a damage cost for each defective unit in the batch, is

$$C_b(\text{no inspection}) = QqC_d \quad (21.16)$$

where C_b = batch cost, as before; Q = number of parts in the batch, pc; q = fraction defect rate; and C_d = damage cost for each defective part that proceeds to subsequent processing or assembly, \$/pc. This damage cost may be high, for example, in the case of an electronics assembly where one defective component might render the entire assembly defective and rework would be expensive.

Finally, if sampling inspection is used on the batch, the analysis must include consideration of the sample size and the probability that the batch will be accepted by the inspection sampling plan that is used. This probability can be obtained from the OC curve (Figure 21.1) for a given fraction defect rate q . The resulting expected cost of the batch is the sum of three terms: (1) cost of inspecting the sample of size Q_s , (2) expected damage cost of those parts that are defective if the sample passes inspection, and (3) expected cost of inspecting the remaining parts in the batch if the sample does not pass inspection. In equation form,

$$C_b(\text{sampling}) = C_sQ_s + (Q - Q_s)qC_dP_a + (Q - Q_s)C_s(1 - P_a) \quad (21.17)$$

where C_b = batch cost, C_s = cost of inspecting and sorting one part; Q_s = number of parts in the sample, pc; Q = batch quantity, pc; q = fraction defect rate; C_d = damage cost per defective part; and P_a = probability of accepting the batch based on the sample.

A simple decision rule can be established to decide whether to inspect the batch. The decision is based on whether the expected fraction defect rate in the batch is greater than or less than a critical defect rate q_c , which is the ratio of the inspection cost to the damage cost. This critical value represents the break-even point between inspection or no inspection. In equation form, q_c is defined as

$$q_c = \frac{C_s}{C_d} \quad (21.18)$$

where C_s = cost of inspecting and sorting one part, and C_d = damage cost per defective part. If, based on past history with the component, the batch fraction defect rate q is less than this critical level, then no inspection is indicated. On the other hand, if it is expected that the fraction defect rate will be greater than q_c , then the total cost of production and inspection will be less if 100% inspection and sortation is performed prior to subsequent processing.

EXAMPLE 21.5 Inspection or No Inspection

A facility has completed a production run of 10,000 parts and management must decide whether to 100% inspect the batch. Past history with this part suggests that the fraction defect rate is around 0.03. Inspection cost per part is \$0.25. If the batch is passed on for subsequent processing, the damage cost for each defective unit in the batch will be \$10.00. Determine (a) batch cost for 100% inspection and (b) batch cost if no inspection is performed. (c) What is the critical fraction defect rate for deciding whether to inspect?

Solution: (a) Batch cost for 100% inspection is given by Equation (21.15):

$$C_b(100\% \text{ inspection}) = QC_s = 10,000(\$0.25) = \mathbf{\$2,500}$$

(b) Batch cost for no inspection can be calculated by Equation (21.16):

$$C_b(\text{no inspection}) = QqC_d = 10,000(0.03)(\$10.00) = \mathbf{\$3,000}$$

(c) The critical fraction defect rate for deciding whether to inspect is determined from Equation (21.18):

$$q_c = \frac{C_s}{C_d} = \frac{0.25}{10.00} = \mathbf{0.025}$$

Because the anticipated defect rate in the batch is $q = 0.03$, the decision should be to inspect. Note that this decision is consistent with the two batch costs calculated for no inspection and 100% inspection. The lowest cost is attained when 100% inspection is used. □

EXAMPLE 21.6 Cost of Sampling Inspection

Given the data from the preceding example, suppose that sampling inspection is being considered as an alternative to 100% inspection. The sampling plan calls for a sample of 100 parts to be drawn at random from the batch. Based on the OC curve for this sampling plan, the probability of accepting the batch is 92% at the given defect rate of $q = 0.03$. Determine the batch cost for sampling inspection.

Solution: The batch cost for sampling inspection is given by Equation (21.17):

$$\begin{aligned} C_b(\text{sampling}) &= C_sQ_s + (Q - Q_s)qC_dP_a + (Q - Q_s)C_s(1 - P_a) \\ &= \$0.25(100) + (10,000 - 100)(0.03)(\$10.00)(0.92) \\ &\quad + (10,000 - 100)(\$0.25)(1 - 0.92) \\ &= \$25.00 + 2,732.40 + 198.00 = \mathbf{\$2,955.40} \end{aligned}$$

□

The significance of Example 21.6 must not be overlooked. The total cost of sampling inspection for the data is greater than the cost of 100% inspection and sortation. If only the cost of the inspection procedure is considered, then sampling inspection is much less expensive (\$25 versus \$2,500). But if total costs, which include the damage that results from defects passing around sampling inspection, are considered, then sampling inspection is not the least expensive inspection alternative. Consider the question: What if the ratio C_s/C_d in Equation (21.18) had been greater than the fraction defect rate of the batch, in other words, the opposite of the case in Examples 21.5 and 21.6? The answer is that if q_c were greater than the batch defect rate q , then the cost of no inspection would be less than the cost of 100% inspection, and the cost of sampling inspection would again lie between the two cost values. The cost of sampling inspection will always lie between the cost of 100% inspection and no inspection, whichever of these two alternatives is greater. If this argument is followed to its logical end, then the conclusion is that either no inspection or 100% inspection is preferred over sampling inspection, and it is just a matter of deciding whether none or all is the better alternative.

21.5.4 What the Equations Tell Us

Several lessons can be inferred from the preceding mathematical models and examples. These lessons should be useful in designing inspection systems for production.

- Distributed inspection/sortation reduces the total number of parts processed in a sequence of production operations compared with one final inspection at the end of the sequence. This reduces waste of processing resources.
- Partially distributed inspection is less effective than fully distributed inspection at reducing the waste of processing resources. However, if there is an economic advantage in combining several inspection steps at one location, then partially distributed inspection may reduce total batch costs compared with fully distributed inspection.
- The “law of diminishing returns” operates in distributed inspection systems, meaning that each additional inspection station added in distributed inspection yields less savings than the previous station added, other factors being equal.
- As the ratio of unit processing cost to unit inspection cost increases, the advantage of distributed inspection over final inspection increases.
- Inspections should be performed immediately following processes that have a high fraction defect rate.
- Inspections should be performed prior to high cost processes.
- When expected damage cost (of those defects that pass around the inspection plan when the batch is accepted) and expected cost of inspecting the entire batch (when the batch is rejected) are considered, sampling inspection is not the lowest cost inspection alternative. Either no inspection or 100% inspection is the more appropriate alternative, depending on the relative values of inspection/sortation cost and damage cost for a defective unit that proceeds to the next stage of processing.

REFERENCES

- [1] BARKMAN, W. E., *In-Process Quality Control for Manufacturing*, Marcel Dekker, Inc., New York, 1989.
- [2] DRURY, C. G., “Inspection Performance,” *Handbook of Industrial Engineering*, 2nd ed., G. Salvendy (ed.), John Wiley & Sons, Inc., New York, 1992, pp. 2282–2314.

- [3] JURAN, J. M., and F. M. GRZYNA, *Quality Planning and Analysis*, 3rd ed., McGraw-Hill, Inc., New York, 1993.
- [4] MONTGOMERY, D. C., *Introduction to Statistical Quality Control*, 6th ed., John Wiley & Sons, Inc., New York, 2008.
- [5] MURPHY, S. D., *In-Process Measurement and Control*, Marcel Dekker, Inc., New York, 1990.
- [6] STOUT, K., *Quality Control in Automation*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1985.
- [7] TANNOCK, J. D. T., *Automating Quality Systems*, Chapman & Hall, London, UK, 1992.
- [8] WICK, C., and R. F. VEILLEUX, *Tool and Manufacturing Engineers Handbook*, 4th ed., Volume IV, *Quality Control and Assembly*, Society of Manufacturing Engineers, Dearborn, MI, 1987, Section 1.
- [9] WINCHELL, W., *Inspection and Measurement*, Society of Manufacturing Engineers, Dearborn, MI, 1996.
- [10] YURKO, J., "The Optimal Placement of Inspections Along Production Lines," *Masters Thesis*, Industrial Engineering Department, Lehigh University, 1986.

REVIEW QUESTIONS

- 21.1 What is inspection?
- 21.2 Briefly define the two basic types of inspection.
- 21.3 What are the four steps in a typical inspection procedure?
- 21.4 What are the Type I and Type II errors that can occur in inspection?
- 21.5 What is quality control testing as distinguished from inspection?
- 21.6 What are the Type I and Type II statistical errors that can occur in acceptance sampling?
- 21.7 Describe what an operating characteristic curve is in acceptance sampling.
- 21.8 What are the two problems associated with 100% manual inspection?
- 21.9 What are the three ways in which an inspection procedure can be automated?
- 21.10 What is the difference between off-line inspection and on-line inspection?
- 21.11 Under what circumstances is process monitoring a suitable alternative to actual inspection of the quality characteristic of the part or product?
- 21.12 What is the difference between distributed inspection and final inspection in quality control?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Inspection Accuracy

- 21.1 **(A)** For Example 21.1, develop a table of outcomes similar in format to Table 21.3. The entries will be the probabilities of the various possible outcomes in the inspection operation.
- 21.2 An inspector reports a total of 16 defects out of a total batch size of 200 parts. On closer examination, it is determined that three of these reported defects were in fact good pieces, while a total of seven defective units were undetected by the inspector. What is the inspector's accuracy in this instance? Specifically, what are the values of p_1 and p_2 ? (b) What was the true fraction defect rate?

- 21.3** For the preceding problem, develop a table of outcomes similar in format to Table 21.3. The entries in the table should represent the probabilities of the various possible outcomes in the inspection operation.
- 21.4** An inspector's accuracy has been assessed as follows: $p_1 = 0.96$ and $p_2 = 0.60$. The inspector is given the task of inspecting a batch of 500 parts and sorting out the defects from good units. If the actual defect rate in the batch is 0.05, determine (a) the expected number of Type I and (b) Type II errors the inspector will make. (c) Also, what is the expected fraction defect rate that the inspector will report at the end of the inspection task?
- 21.5** An inspector must inspect a production batch of 500 parts using a gaging method. If the actual fraction defect rate in the batch is 0.02, and the inspector's accuracy is given by $p_1 = 0.96$ and $p_2 = 0.84$, determine (a) the number of defects the inspector can be expected to report and (b) the expected number of Type I and Type II errors the inspector will make.

Effect of Fraction Defect Rate

- 21.6 (A)** A batch of 2,000 raw work units is processed through 12 operations, each of which has a fraction defect rate of 0.02. How many defect-free units and how many defects are in the final batch?
- 21.7** A silicon wafer has a total of 200 integrated circuits (ICs) at the beginning of its fabrication sequence. A total of 60 operations are used to complete the integrated circuits, each of which inflicts damages on 1.0% of the ICs. The damages compound, meaning that an IC that is already damaged has the same probability of being damaged by a subsequent process as a previously undamaged IC. How many defect-free ICs remain at the end of the fabrication sequence?
- 21.8** A batch of work parts is processed through a sequence of nine processing operations, which have fraction defect rates of 0.03, 0.05, 0.02, 0.04, 0.06, 0.01, 0.03, 0.04, and 0.07, respectively. A total of 13,974 completed parts are produced by the sequence. What was the starting batch quantity?
- 21.9 (A)** A production line consists of six workstations, as shown in Figure P21.9. The six stations are as follows: (1) first manufacturing process, scrap rate is $q_1 = 0.10$; (2) inspection for first process, separates all defects from first process; (3) second manufacturing process, scrap rate is $q_3 = 0.20$; (4) inspection for second process, separates all defects from second process; (5) rework, repairs defects from second process, recovering 70% of the defects from the preceding operation and leaving 30% of the defects as still defective; (6) third manufacturing process, scrap rate $q_6 = 0$. If the output from the production line is to be 100,000 defect-free units, what quantity of raw material units must be launched onto the front of the line?

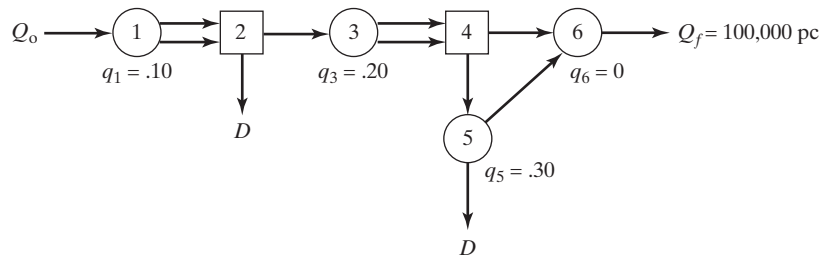


Figure P21.9 Production line for Problem 21.9.

- 21.10** A certain industrial process can be depicted as in Figure P21.10. Operation 1 is a disassembly process in which each unit of raw material is separated into one unit each of parts A and B. These parts are then processed separately in operations 2 and 3, respectively, which have scrap rates of $q_2 = 0.05$ and $q_3 = 0.10$. Inspection stations 4 and 5 sort good units from bad for the two parts. Then the parts are assembled back together in operation 6, which has a fraction

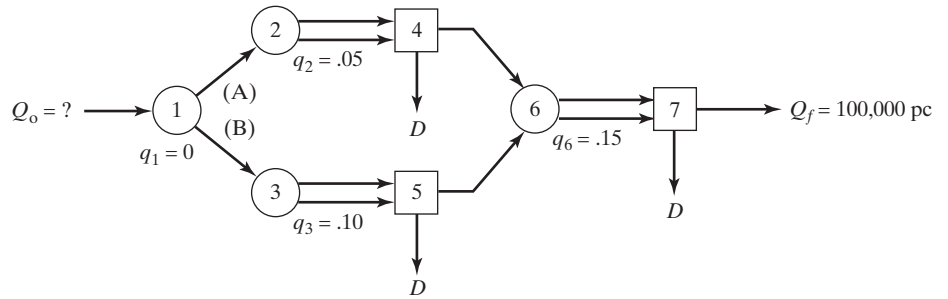


Figure P21.10 Production line for Problem 21.10.

defect rate $q_6 = 0.15$. Final inspection station 7 sorts good units from bad. The desired final output quantity is 100,000 units. (a) What is the required starting quantity (into operation 1) to achieve this output? (b) Will there be any leftover units of parts A or B, and if so, how many?

21.11 A certain component is produced in three sequential operations. Operation 1 produces defects at a rate $q_1 = 5\%$. Operation 2 produces defects at a rate $q_2 = 8\%$. Operation 3 produces defects at a rate $q_3 = 10\%$. Operations 2 and 3 can be performed on units that are already defective. If 10,000 starting parts are processed through the sequence, (a) how many units are expected to be defect-free, (b) how many units are expected to have exactly one defect, and (c) how many units are expected to have all three defects?

21.12 An industrial process can be depicted as in Figure P21.12. Two components are made, respectively, by operations 1 and 2, and then assembled together in operation 3. Scrap rates are as follows: $q_1 = 0.20$, $q_2 = 0.10$, and $q_3 = 0$. Input quantities of raw components at operations 1 and 2 are 25,000 and 20,000, respectively. One of each component is required in the assembly operation. Trouble is that defective components can be assembled just as easily as good components, so inspection and sortation is required in operation 4. Determine (a) how many defect-free assemblies will be produced and (b) how many assemblies will be made with one or more defective components. (c) Will there be any leftover units of either component, and if so, how many?

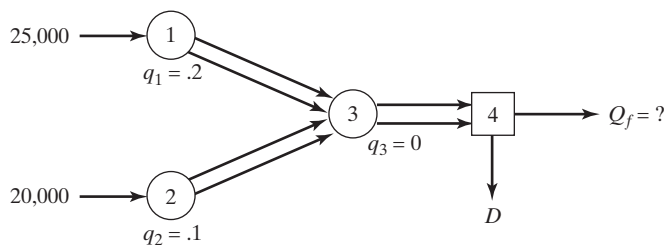


Figure P21.12 Production line for Problem 21.12.

Inspection Costs

21.13 (A) Two inspection alternatives are to be compared for a processing sequence consisting of 20 operations performed on a batch of 100 starting parts: (1) one final inspection and sortation operation following the last operation, and (2) distributed inspection with an inspection and sortation after each operation. The cost of each processing operation $C_{pr} = \$1.00$ per unit processed. The fraction defect rate at each operation = 0.03. The cost of the single final inspection and sortation in alternative (1) is $C_{sf} = \$2.00$ per unit.

The cost of each inspection and sortation in alternative (2) is $C_s = \$0.10$ per unit. Compare total processing and inspection costs per batch for the two cases.

- 21.14** In the preceding problem, instead of inspecting and sorting after every operation, the 20 operations will be divided into groups of five, with inspections after operations 5, 10, 15, and 20. Following the logic of Equation (21.11), the cost of each inspection will be five times the cost of inspecting for one defect feature; that is, $C_{s5} = C_{s10} = C_{s15} = C_{s20} = 5(\$0.10) = \$0.50$ per unit inspected. Processing cost per unit for each operation remains the same as before at $C_{pr} = \$1.00$, and $Q_o = 100$ parts. What is the total processing and inspection cost per batch for this partially distributed inspection system?
- 21.15** A processing sequence consists of ten operations, each of which is followed by an inspection and sortation operation to detect and remove defects generated in the operation. Defects in each process occur at a rate of 0.04. Each processing operation costs \$1.00 per unit processed, and the inspection/sortation operation costs \$0.30 per unit. (a) Determine the total processing and inspection costs for this distributed inspection system. (b) A proposal is being considered to combine all of the inspections into one final inspection and sortation station following the last processing operation. Determine the cost per unit of this final inspection and sortation station that would make the total cost of this system equal to that of the distributed inspection system.
- 21.16** This problem is intended to show the merits of a partially distributed inspection system in which inspections are placed after processing steps that generate a high fraction defect rate. The processing sequence consists of eight operations with fraction defect rates for each operation as follows:

Operation	1	2	3	4	5	6	7	8
Defect rate	0.01	0.01	0.01	0.11	0.01	0.01	0.01	0.11

Three alternatives are to be compared: (1) fully distributed inspection, with an inspection after every operation; (2) partially distributed inspection, with inspections following operations 4 and 8 only; and (3) one final inspection station after operation 8. All inspections include sortations. In alternative (2), the inspection procedures are each designed to detect all of the defects for the preceding four operations. The cost of processing is $C_{pr} = \$1.00$ for each of operations 1 through 8. Inspection/sortation costs for each alternative are given in the table below. Compare total processing and inspection costs for the three cases.

Alternative	Inspection and Sortation Cost
(1)	$C_s = \$0.10$ per unit for each of the eight inspection stations
(2)	$C_s = \$0.40$ per unit for each of the two inspection stations
(3)	$C_s = \$0.80$ per unit for the one final inspection station

Inspection or No Inspection

- 21.17 (A)** A batch of 1,000 parts has been produced and a decision is needed whether or not to 100% inspect the batch. Past history with this part suggests that the fraction defect rate is around 0.02. Inspection cost per part is \$0.15. If the batch is passed on for subsequent processing, the damage cost for each defective unit in the batch is \$9.00. Determine (a) batch cost for 100% inspection and (b) batch cost if no inspection is performed. (c) What is the critical fraction defect value for deciding whether to inspect?
- 21.18** Given the data from the preceding problem, sampling inspection is being considered as an alternative to 100% inspection. The sampling plan calls for a sample of 50 parts to be drawn at random from the batch. Based on the operating characteristic curve for this sampling plan, the probability of accepting the batch is 95% at the given defect rate of $q = 0.015$. Determine the batch cost for sampling inspection.

Inspection Technologies

CHAPTER CONTENTS

- 22.1 Inspection Metrology
 - 22.1.1 Characteristics of Measuring Instruments
 - 22.1.2 Contact versus Noncontact Inspection Techniques
- 22.2 Conventional Measuring and Gaging Techniques
- 22.3 Coordinate Measuring Machines
 - 22.3.1 CMM Construction
 - 22.3.2 CMM Operation and Programming
 - 22.3.3 CMM Software
 - 22.3.4 CMM Applications and Benefits
 - 22.3.5 Other Coordinate Metrology Techniques
- 22.4 Surface Measurement
- 22.5 Machine Vision
 - 22.5.1 Image Acquisition and Digitization
 - 22.5.2 Image Processing and Analysis
 - 22.5.3 Interpretation
 - 22.5.4 Machine Vision Applications
- 22.6 Other Optical Inspection Methods
- 22.7 Noncontact Nonoptical Inspection Techniques
- Appendix 22A: Geometric Feature Construction

The inspection procedures described in the previous chapter are enabled by various sensors, instruments, and gages. Some of these inspection techniques involve manually operated devices that have been used for more than a century, for example, micrometers, calipers, protractors, and go/no-go gages. Other techniques are based on modern technologies such as coordinate measuring machines and machine vision. These newer techniques require computer systems to control their operation and analyze the data collected. The computer-based technologies allow the inspection procedures to be automated. In some cases, they permit 100% inspection to be accomplished economically. The coverage in this chapter will emphasize these modern technologies. The chapter begins with a prerequisite topic in inspection technology: metrology.

22.1 INSPECTION METROLOGY

Measurement is defined as a procedure in which an unknown quantity is compared to a known standard, using an accepted and consistent system of units. The measurement may involve a simple linear rule to scale the length of a part, or it may require measurement of force versus deflection during a tension test. Measurement provides a numerical value of the quantity of interest, within certain limits of accuracy and precision. It is the means by which inspection for variables (Section 21.1.1) is accomplished.

Metrology is the science of measurement. It is concerned with seven basic quantities: length, mass, time, electric current, temperature, luminous intensity, and matter. From these basic quantities, other physical quantities are derived, such as area, volume, velocity, acceleration, force, electric voltage, and energy. In mechanical parts manufacturing, the main concern is usually with measuring the length quantity in the many ways in which it manifests itself in a part or product. These include length, width, depth, diameter, straightness, flatness, and roundness. Even surface roughness (Section 22.4) is defined in terms of length quantities.

A common feature of any measurement procedure is comparison of the unknown value with a known standard. Two aspects of a standard are critical: (1) it must be constant, not changing over time; and (2) it must be based on a system of units that is consistent and accepted by users. In modern times, standards for length, mass, time, electric current, temperature, light, and matter are defined by international agreement in terms of physical phenomena that can be relied upon to remain unchanged.

Two systems of units have evolved into predominance in the world: (1) the International System of Units (or SI, for *Le Système International d'Unités*), more popularly known as the metric system, and (2) the U.S. customary system (U.S.C.S.). Both of these systems are well known and used in parallel in this book. The metric system is widely accepted in nearly every part of the industrialized world except the United States, which has stubbornly clung to its U.S.C.S. Gradually, the United States is going metric and adopting the SI.

22.1.1 Characteristics of Measuring Instruments

All measuring instruments possess certain characteristics that make them useful in the particular applications they serve. Primary among these are accuracy and precision, but other features include speed of response, operating range, and cost. These attributes can be used as criteria in selecting a measuring device. No measuring instrument scores perfect marks in all of the criteria. The choice of a device for a given application should emphasize those criteria that are most important in that application.

Accuracy and Precision. Measurement *accuracy* is the degree to which the measured value agrees with the true value of the quantity of interest. A measurement procedure is accurate when it is absent of systematic errors, which are positive or negative deviations from the true value that are consistent from one measurement to the next.

Precision is a measure of repeatability in a measurement process. Good precision means that random errors in the measurement procedure are minimized. Random errors are often due to human participation in the measurement process. Examples include variations in the setup, imprecise reading of the scale, round-off approximations, and so on. Nonhuman contributors to random error include changes in temperature, gradual wear and/or misalignment in the working elements of the device, and other variations. It is generally assumed that random errors obey a normal statistical distribution with a mean of zero and a standard deviation that indicates the amount of dispersion that exists in the measurement. The normal distribution has certain well-defined properties, including the fact that 99.73% of the population is included within $\pm 3\sigma$ of the population mean. A measuring instrument's precision is often defined as $\pm 3\sigma$.

The distinction between accuracy and precision is depicted in Figure 22.1. In (a), the random error in the measurement is large, indicating low precision, but the mean value of the measurement coincides with the true value, indicating high accuracy. In (b), the measurement error is small (good precision), but the measured value differs substantially from the true value (low accuracy). In (c), both accuracy and precision are good.

No measuring instrument has perfect accuracy and perfect precision. Perfection in measurement, as in anything else, is impossible. Accuracy of the instrument is maintained by proper and regular calibration (explained below). Precision is achieved by selecting the proper instrument technology for the application. A guideline often applied to determine the right level of precision is the **rule of 10**, which means that the measuring device must be ten times more precise than the specified tolerance. Thus, if the tolerance to be measured is ± 0.25 mm (± 0.010 in), then the measuring device must have a precision of ± 0.025 mm (± 0.001 in).

Other Features of Measuring Instruments. Another aspect of a measuring instrument is its capacity to distinguish very small differences in the quantity of interest. The indication of this characteristic is the smallest variation of the quantity that can be detected by the instrument. The terms *resolution* and *sensitivity* describe this attribute of a measuring device. Other desirable features include stability, speed of response, wide operating range, high reliability, and low cost.

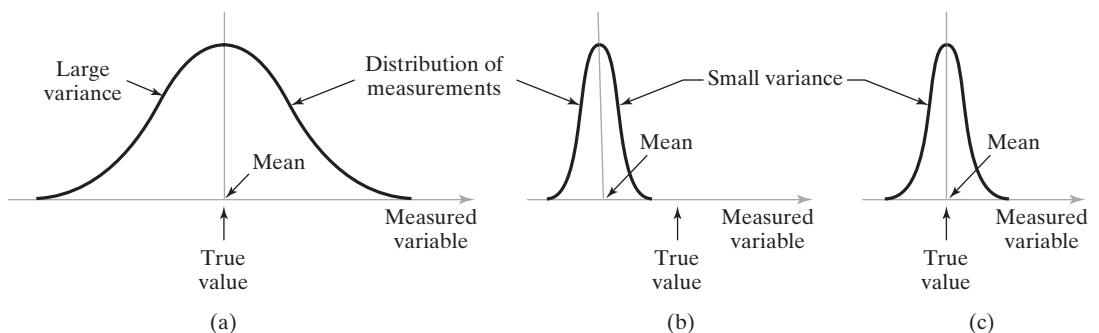


Figure 22.1 Accuracy versus precision in measurement: (a) high accuracy but low precision, (b) low accuracy but high precision, and (c) high accuracy and high precision.

Some measurements, especially in a manufacturing environment, must be made quickly. The ability of a measuring instrument to indicate the quantity with a minimum time lag is called its *speed of response*. Ideally, the time lag should be zero, but this is an unrealistic ideal. For an automatic measuring device, speed of response is usually taken to be the time lapse between the moment when the quantity of interest changes and the moment when the device is able to indicate the change within a certain small percentage of the true value.

The measuring instrument should possess a wide operating range, or capability to measure the physical variable throughout the entire span of practical interest to the user. High reliability, which refers to the absence of frequent malfunctions and failures of the device, and low cost are of course desirable attributes of any engineering equipment.

Analog versus Digital Instruments. An analog measuring instrument provides an output that is analog; that is, the output signal of the instrument varies continuously with the variable being measured. Because the output varies continuously, it can take on any of an infinite number of possible values over the range in which it is designed to operate. Of course, when the output is read by the human eye, there are limits on the resolution that can be discriminated. When analog measuring devices are used for process control, the common output signal is voltage. Since most modern process controllers are based on the digital computer, the voltage signal must be converted to digital form by means of an analog-to-digital converter (ADC, Section 6.3.1).

A digital measuring instrument provides an output that is digital; that is, it can assume any of a discrete number of incremental values corresponding to the value of the quantity being measured. The number of possible output values is finite. The digital signal may consist of a set of parallel bits in a storage register or a series of pulses that can be counted. When parallel bits are used, the number of possible output values is determined by the number of bits as:

$$n_o = 2^B \quad (22.1)$$

where n_o = number of possible output values of the digital measuring device, and B = number of bits in the storage register. The resolution of the measuring instrument is given by

$$MR = \frac{L}{n_o - 1} = \frac{L}{2^B - 1} \quad (22.2)$$

where MR = measurement resolution, the smallest increment that can be distinguished by the device; L = its measuring range; and B = number of bits used by the device to store the reading, as before. Although a digital measuring instrument can provide only a finite number of possible output values, this is hardly a limitation in practice, since the storage register can be designed with a sufficient number of bits to achieve the required resolution for nearly any application.

Digital measuring devices are being used in industrial practice for two good reasons: (1) they can be read easily as stand-alone instruments; and (2) most digital devices can be directly interfaced with a digital computer, avoiding the need for analog-to-digital conversion.

Calibration. Measuring devices must be calibrated periodically. Calibration is a procedure in which the measuring instrument is checked against a known standard. For example, calibrating a thermometer might involve checking its reading in boiling (pure) water at standard atmospheric pressure, under which conditions the temperature is known to be 100°C (212°F). The calibration procedure should include checking the instrument

over its entire operating range. The known standard, if it is a physical instrument, should be used only for calibration purposes; it should not serve as a spare instrument on the shop floor when an extra is needed.

For convenience, the calibration procedure should be as quick and uncomplicated as possible. Once calibrated, the instrument should be capable of retaining its calibration; it should continue to measure the quantity without deviating from the standard for an extended period of time. This capability to retain calibration is called *stability*, and the tendency of the device to gradually lose its accuracy relative to the standard is called *drift*. Reasons for drift include factors such as (1) mechanical wear, (2) dirt and dust, (3) fumes and chemicals in the environment, and (4) aging of the materials out of which the instrument is made. Good coverage of the measurement calibration issue is provided in Morris [14].

22.1.2 Contact versus Noncontact Inspection Techniques

Inspection techniques can be divided into two broad categories: contact and noncontact. In contact inspection, physical contact is made between the object and the measuring or gaging instrument, whereas in noncontact inspection no physical contact is made.

Contact Inspection Techniques. Contact inspection involves the use of a mechanical probe or other device that makes contact with the object being inspected. The purpose of the probe is to measure or gage the object in some way. By its nature, contact inspection is often concerned with some physical dimension of the part. Accordingly, these techniques are widely used in the manufacturing industries, in particular in the production of metal parts (machining, stamping, and other metalworking processes). Contact inspection is also used in electrical circuit testing. The principal contact inspection technologies are the following:

- Conventional measuring and gaging instruments
- Coordinate measuring machines (CMMs) and related techniques to measure mechanical dimensions
- Stylus-type surface texture measuring machines to measure surface characteristics such as roughness and waviness
- Electrical contact probes for testing integrated circuits and printed circuit boards.

Conventional techniques and CMMs compete with each other in the measurement and inspection of part dimensions. The general application ranges for the different types of inspection and measurement equipment are presented in the PQ chart of Figure 22.2, where P and Q refer to parts variety and parts quantity (Section 2.4.1).

Reasons why these contact inspection methods are technologically and commercially important include the following:

- They are the most widely used inspection technologies today.
- They are accurate and reliable.
- In many cases, they represent the only methods available to accomplish the inspection.

Noncontact Inspection Technologies. Noncontact inspection methods utilize a sensor located at a certain distance from the object to measure or gage the desired features. The noncontact inspection technologies can be classified into two categories: optical and nonoptical. Optical inspection technologies use light to accomplish the measurement or gaging cycle. The most important optical technology is machine vision; however, other

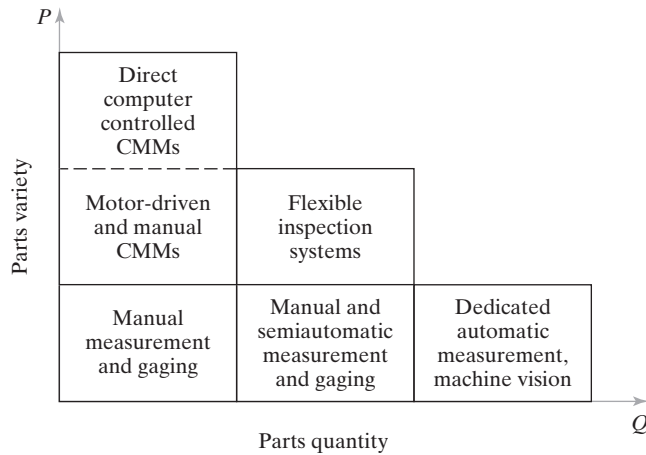


Figure 22.2 *PQ* chart indicating most appropriate measurement equipment as a function of parts variety and quantity (adapted from Bosch [2]).

optical techniques are important in certain industries. Nonoptical inspection technologies utilize energy forms other than light to perform the inspection; these other energies include various electrical fields, radiation (other than light), and ultrasonics.

Noncontact inspection offers certain advantages over contact inspection, including the following:

- They avoid damage to the part surface that might result from contact inspection.
- Inspection cycle times are inherently faster. Contact inspection procedures require the contacting probe to be positioned against the part, which takes time. Most of the noncontact methods use a stationary probe that does not need repositioning for each part.
- Noncontact methods can often be accomplished on the production line without the need for any additional handling of the parts, whereas contact inspection usually requires special handling and positioning of the parts.
- It is more feasible to conduct 100% automated inspection, since noncontact methods have faster cycle times and reduced need for special handling.

A comparison of some of the features of the various contact and noncontact inspection technologies is presented in Table 22.1.

TABLE 22.1 Comparison of Resolution and Relative Speed of Several Inspection Technologies

Inspection Technology	Typical Resolution	Relative Speed of Application
Conventional instruments:		
Steel rule	0.25 mm (0.01 in)	Medium speed (medium cycle time)
Vernier caliper	0.025 mm (0.001 in)	Slow speed (long cycle time)
Micrometer	0.0025 mm (0.0001 in)	Slow speed (long cycle time)
Coordinate measuring machine	0.0005 mm (0.00002 in)*	Slow speed for single measurement High speed for multiple measurements on the same object
Machine vision	0.25 mm (0.01 in)**	High speed (short cycle time per piece)

* See Table 22.3 for other parameters on coordinate measuring machines.

** See Section 22.5.1 for a discussion of resolution in machine vision.

22.2 CONVENTIONAL MEASURING AND GAGING TECHNIQUES¹

Conventional measuring and gaging techniques use manually operated devices for linear dimensions such as length, depth, and diameter, as well as features such as angles, straightness, and roundness. Measuring devices provide a quantitative value of the part feature of interest, while gages determine whether the part feature (usually a dimension) falls within a certain acceptable range of values. Measuring takes more time but provides more information about the part feature. Gaging can be accomplished more quickly but does not provide as much information. Both techniques are widely used for post-process inspection of piece parts in manufacturing.

Measuring devices tend to be used on a sampling inspection basis. Some devices are portable and can be used at the production operation. Others require bench setups that are remote from the process, where the measuring instruments can be set up accurately on a flat reference surface called a *surface plate*. Gages are used either for sampling or 100% inspection. They tend to be more portable and lend themselves to application at the production operation. Certain measuring and gaging techniques can be incorporated into automated inspection systems to permit feedback control of the process, or for statistical process control purposes.

The ease of use and precision of measuring instruments and gages have been enhanced in recent years by electronics. Electronic gages are a family of measuring and gaging instruments based on transducers capable of converting a linear displacement into a proportional electrical signal. The electrical signal is then amplified and transformed into a suitable data format such as a digital readout. For example, modern micrometers and graduated calipers are available with a digital display of the measurement of interest. These instruments are easier to read and eliminate much of the human error associated with reading conventional graduated devices.

Applications of electronic gages have grown rapidly, driven by advances in microprocessor technology. They are steadily replacing many of the conventional measuring and gaging devices. Advantages of electronic gages include (1) good sensitivity, accuracy, precision, repeatability, and speed of response; (2) ability to sense very small dimensions—down to 0.025 micron (1 microinch); (3) ease of operation; (4) reduced human error; (5) ability to display electrical signal in various formats (e.g., metric or U.S. customary); and (6) capability to be interfaced with computer systems for data processing.

For reference, the common conventional measuring instruments and gages with brief descriptions are listed in Table 22.2. It is not the purpose in this book to provide an exhaustive discussion of these devices. A comprehensive survey can be found in books on metrology, such as [3] or [6], or see [9] for a more concise treatment.

22.3 COORDINATE MEASURING MACHINES

Coordinate metrology is concerned with measuring the actual shape and dimensions of an object and comparing these results with the desired shape and dimensions, as might be specified on a part drawing. In this sense, coordinate metrology consists of the evaluation of the location, orientation, dimensions, and geometry of the part or object. A coordinate measuring machine (CMM) is an electromechanical system designed to perform coordinate metrology. It has a contact probe that can be positioned in three dimensions relative

¹This section is based on [9], Section 5.2.

TABLE 22.2 Conventional Measuring Instruments and Gages (Adapted from [9])

Instrument	Description
Steel rule	Linear graduated measurement scale used to measure linear dimensions. Available in various lengths, typically ranging from 150 to 1,000 mm, with graduations of 1 or 0.5 mm. (U.S.C.S. rules available from 6 to 36 in, with graduations of 1/32 in or 0.01 in.)
Calipers	Family of graduated and nongraduated measuring devices consisting of two legs joined by a hinge mechanism. The ends of the legs contact the surfaces of the object to provide a comparative measure. Can be used for internal (e.g., inside diameter) or external (e.g., outside diameter) measurements.
Slide caliper	Steel rule to which two jaws are added, one fixed and the other movable. Jaws are forced to contact part surfaces to be measured, and the location of the movable jaw indicates the dimension of interest. Can be used for internal or external measurements.
Vernier caliper	Refinement of the slide caliper, in which a vernier scale is used to obtain more precise measurements (as close as 0.001 in).
Micrometer	Common device consisting of a spindle and C-shaped anvil (similar to a C-clamp). The spindle is moved relative to the fixed anvil by means of a screw thread to contact the surfaces of the object being measured. A vernier scale is used to obtain precisions of 0.01 mm in SI (0.0001 in in U.S.C.S.). Available as outside micrometers, inside micrometers, or depth micrometers. Also available as electronic gages to obtain a digital readout of the dimension of interest.
Dial indicator	Mechanical gage that converts and amplifies the linear movement of a contact pointer into rotation of a dial needle. The dial is graduated in units of 0.01 mm in SI (0.001 in in U.S.C.S.). Can be used to measure straightness, flatness, squareness, and roundness.
Gages	Family of gages, usually of the go/no-go type, that check whether a part dimension lies within acceptable limits defined by tolerance specified in part drawing. Includes: (1) snap gages for external dimensions such as a thickness, (2) ring gages for cylindrical diameters, (3) plug gages for hole diameters, and (4) thread gages.
Protractor	Device for measuring angles. Simple protractor consists of a straight blade and a semi-circular head graduated in angular units (e.g., degrees). Bevel protractor consists of two straight blades that pivot one to the other; the pivot mechanism has a protractor scale to measure the angle of the two blades.

to the surfaces of a work part. See Figure 22.3. The x , y , and z coordinates of the probe can be accurately and precisely recorded to obtain dimensional data about the part geometry.

To accomplish measurements in three-dimensional space, the basic CMM consists of the following components:

- Probe head and probe to contact the work part surfaces
- Mechanical structure that provides motion of the probe in three Cartesian axes and displacement transducers to measure the coordinate values of each axis.

In addition, many CMMs include the following:

- Drive system and control unit to move each of the three axes
- Digital computer system with application software.

The following topics are discussed in this section: (1) construction features of a CMM, (2) operation and programming of the machine, (3) CMM software, (4) applications and benefits, and (5) other coordinate metrology techniques.

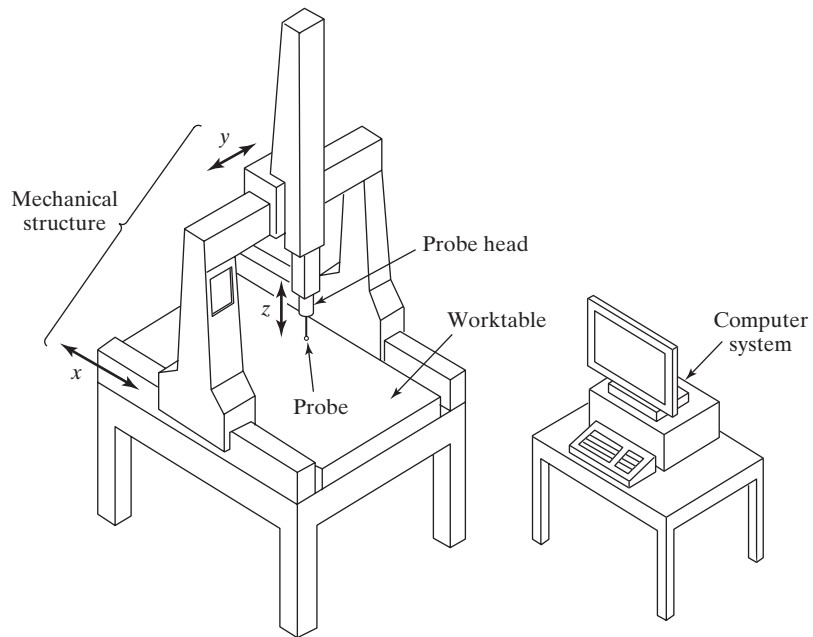


Figure 22.3 Coordinate measuring machine.

22.3.1 CMM Construction

In the construction of a CMM, the probe is fastened to a mechanical structure that allows movement of the probe relative to the part. The part is usually located on a worktable that is connected to the structure. The two basic components of the CMM are its probe and its mechanical structure.

Probe. The contact probe indicates when contact has been made with the part surface during measurement. The tip of the probe is usually a ruby ball. Ruby is a form of corundum (aluminum oxide), whose desirable properties in this application include high hardness for wear resistance and low density for minimum inertia. Probes can have either a single tip, as in Figure 22.4(a), or multiple tips as in Figure 22.4(b).

Most probes today are touch-trigger probes, which actuate when the probe makes contact with the part surface. Commercially available touch-trigger probes utilize any of various triggering mechanisms, including the following: (1) a highly sensitive electrical contact switch that emits a signal when the tip of the probe is deflected from its neutral position, (2) a contact switch that permits actuation only when electrical contact is established between the probe and the (metallic) part surface, or (3) a piezoelectric sensor that generates a signal based on tension or compression loading of the probe.

Immediately after contact is made between the probe and the surface of the object, the coordinate positions of the probe are accurately measured by displacement transducers associated with each of the three linear axes and recorded by the CMM controller. Compensation is made for the radius of the probe tip, as indicated in Example 22.1, and any limited overtravel of the probe quill due to momentum is neglected. After the probe has been separated from the contact surface, it returns to its neutral position.

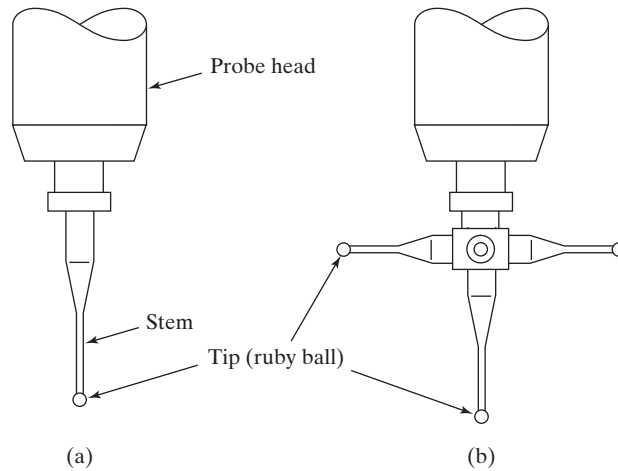


Figure 22.4 Contact probe configurations: (a) single tip and (b) multiple tips.

EXAMPLE 22.1 Dimensional Measurement with Probe Tip Compensation

The part dimension L in Figure 22.5 is to be measured. The dimension is aligned with the x -axis, so it can be measured using only x -coordinate locations. When the probe is moved toward the part from the left, contact is made at $x = 68.93$ mm. When the probe is moved toward the opposite side of the part from the right, contact is made at $x = 137.44$ mm. The probe tip diameter is 3.00 mm. What is the dimension L ?

Solution: Given that the probe tip diameter $D_t = 3.00$ mm, the radius $R_t = 1.50$ mm. Each of the recorded x values must be corrected for this radius:

$$x_1 = 68.93 + 1.50 = \mathbf{70.43 \text{ mm}}$$

$$x_2 = 137.44 - 1.50 = \mathbf{135.94 \text{ mm}}$$

$$L = x_1 - x_2 = 135.94 - 70.43 = \mathbf{65.51 \text{ mm}}$$

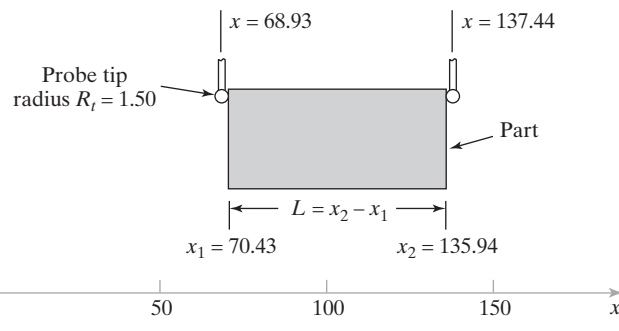


Figure 22.5 Setup for CMM measurement in Example 22.1.

In addition to mechanical probes, lasers can be used in some CMMs to project a beam onto the part surface, using triangulation calculations to measure the beam spot's coordinate positions. These measurements can be taken at high speeds to obtain not only coordinates but also a three-dimensional image of the part.

Mechanical Structure. There are various physical configurations for achieving the motion of the probe, each with advantages and disadvantages. Nearly all CMMs have a mechanical structure that fits into one of the following six types, illustrated in Figure 22.6:

- (a) *Cantilever.* In the cantilever configuration, illustrated in Figure 22.6(a), the probe is attached to a vertical quill that moves in the z -axis direction relative to a horizontal arm that overhangs a fixed worktable. The quill can also be moved along the length of the arm to achieve y -axis motion, and the arm can be moved relative to the worktable to achieve x -axis motion. The advantages of this construction are (1) convenient access to the worktable, (2) high throughput—the rate at which parts can be mounted and measured on the CMM, (3) capacity to measure large work parts (on

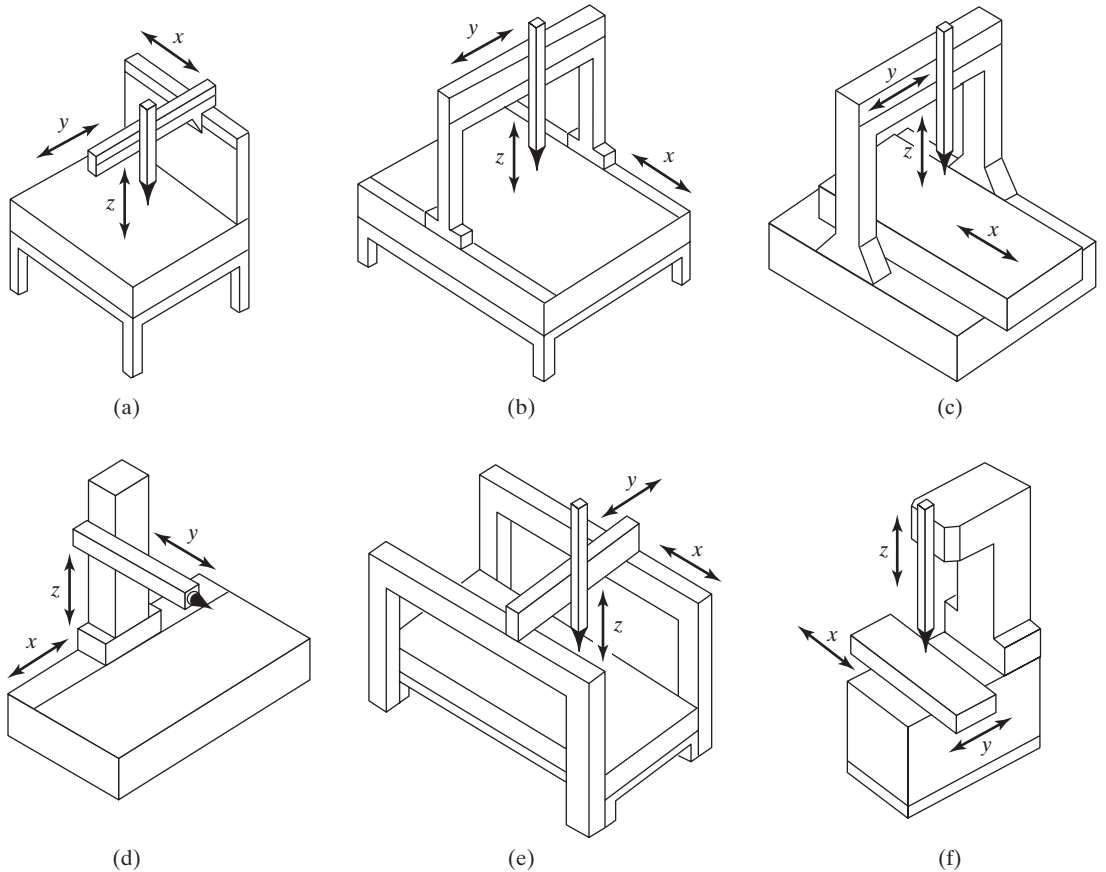


Figure 22.6 Six types of CMM construction: (a) cantilever, (b) moving bridge, (c) fixed bridge, (d) horizontal arm (moving ram type), (e) gantry, and (f) column.

large CMMs), and (4) relatively small floor space requirements. The disadvantage is lower rigidity than most other CMM structures.

- (b) *Moving bridge*. In the moving bridge design, Figure 22.6(b), the probe is mounted on a bridge that is translated relative to a stationary table on which is positioned the part to be measured. This provides a more rigid structure than the cantilever design, and its advocates claim that this makes the moving bridge CMM more accurate. However, one of the problems encountered with the moving bridge design is called *yawing* (also known as *walking*), in which the two legs of the bridge move at slightly different speeds, resulting in twisting of the bridge. This phenomenon degrades the accuracy of the measurements. Yawing is reduced on moving bridge CMMs when dual drives and position feedback controls are installed for both legs. The moving bridge design is widely used in industry. It is well suited to the size range of parts commonly encountered in production machine shops.
- (c) *Fixed bridge*. In this configuration, Figure 22.6(c), the bridge is attached to the CMM bed, and the worktable is moved in the x -direction beneath the bridge. This construction eliminates the possibility of yawing, hence increasing rigidity and accuracy. However, throughput is adversely affected because of the additional energy needed to move the heavy worktable with the part mounted on it.
- (d) *Horizontal arm*. The horizontal arm configuration consists of a cantilevered horizontal arm mounted to a vertical column. The arm moves vertically and in and out to achieve y -axis and z -axis motions. To achieve x -axis motion, either the column is moved horizontally past the worktable (called the *moving ram* design), or the worktable is moved past the column (called the *moving table* design). The moving ram design is illustrated in Figure 22.6(d). The cantilever design of the horizontal arm configuration makes it less rigid and therefore less accurate than other CMM structures. On the positive side, it allows good accessibility to the work area. Large horizontal arm machines are suited to the measurement of automobile bodies, and some CMMs are equipped with dual arms so that independent measurements can be taken on both sides of the car body at the same time.
- (e) *Gantry*. This construction, illustrated in Figure 22.6(e), is generally intended for inspecting large objects. The probe quill (z -axis) moves relative to the horizontal arm extending between the two rails of the gantry. The workspace in a large gantry-type CMM can be as great as 25 m (82 ft) in the x -direction, by 8 m (26 ft) in the y -direction, and by 6 m (20 ft) in the z -direction.
- (f) *Column*. This configuration, in Figure 22.6(f), is similar to the construction of a machine tool. The x - and y -axis movements are achieved by moving the worktable, while the probe quill is moved vertically along a rigid column to achieve z -axis motion.

In all of these constructions, special design features are used to build high accuracy and precision into the frame. These features include precision rolling-contact bearings and hydrostatic air-bearings, installation mountings to isolate the CMM and reduce vibrations in the factory from being transmitted through the floor, and various schemes to counter-balance the overhanging arm of the cantilever and horizontal arm constructions [5], [16].

22.3.2 CMM Operation and Programming

Positioning the probe relative to the part can be accomplished in several ways, ranging from manual operation to direct computer control (DCC). Computer-controlled CMMs operate much like CNC machine tools, and these machines must be programmed. This section covers (1) types of CMM controls and (2) programming of computer-controlled CMMs.

CMM Controls. The methods of operating and controlling a CMM can be classified into four categories: (1) manual drive, (2) manual drive with computer-assisted data processing, (3) motor drive with computer-assisted data processing, and (4) DCC with computer-assisted data processing.

In a manual drive CMM, the human operator physically moves the probe along the machine's axes to make contact with the part and record the measurements. The three orthogonal slides are designed to be nearly frictionless to permit the probe to float freely in the x -, y -, and z -directions. The measurements are provided by a digital readout, which the operator can record either manually or with paper printout. Any calculations on the data (e.g., calculating the center and diameter of a hole) must be made by the operator.

A CMM with manual drive and computer-assisted data processing provides some data processing and computational capability for performing the calculations required to evaluate a given part feature. The types of data processing and computations range from simple conversions between U.S. customary units and metric to more complicated geometry calculations, such as determining the angle between two planes. The probe is still free floating to permit the operator to bring it into contact with the desired part surfaces.

A motor-driven CMM with computer-assisted data processing uses electric motors to drive the probe along the machine axes under operator control. An operator controls the motion using a joystick or similar device. Features such as low-power stepping motors and friction clutches are utilized to reduce the effects of collisions between the probe and the part. The motor drive can be disengaged to permit the operator to physically move the probe as in the manual control method. Motor-driven CMMs are generally equipped with data processing to accomplish the geometric computations required in feature assessment.

A CMM with direct computer control (DCC) operates like a CNC machine tool. It is motorized, and the movements of the coordinate axes are controlled by a dedicated computer under program control. The computer also performs the various data processing and calculation functions and compiles a record of the measurements made during inspection. As with a CNC machine tool, the DCC CMM requires part programming.

DCC Programming. There are two principle methods of programming a DCC measuring machine: (1) manual leadthrough and (2) off-line programming. In the manual leadthrough method, the operator leads the CMM probe through the various motions required in the inspection sequence, indicating the points and surfaces that are to be measured and recording these into the control memory. This is similar to the robot programming technique of the same name (Section 8.5.1). During regular operation, the CMM controller plays back the program to execute the inspection procedure.

Off-line programming is accomplished in the manner of CAD/CAM NC part programming (Section 7.5.3). The program is prepared off-line based on the part drawing or CAD part model and then downloaded to the CMM controller for execution. This permits the programming to be accomplished on new jobs while the CMM itself is working on jobs that have been previously programmed. Programming statements for a computer-controlled CMM include motion commands, measurement commands, and report formatting commands. The motion commands are used to direct the probe to a desired inspection location, the same way that a cutting tool is directed in a machining operation. The measurement statements are used to control the measuring and inspection functions of the machine, calling the various data processing and calculation routines into play. Finally, the formatting statements permit the specification of the output reports to document the inspection.

Most off-line programming of CMMs is based on CAD geometric data representing the part rather than from a hard copy part drawing [19]. Off-line programming on a

CAD system is facilitated by the Dimensional Measuring Interface Standard (DMIS), an ANSI standard. DMIS is a protocol that permits two-way communication between CAD systems and CMMs. Use of DMIS has the following advantages [2]: (1) It allows any CAD system to communicate with any CMM, (2) it reduces software development costs for CMM and CAD companies because only one translator is required to communicate with the DMIS, (3) users have greater choice among CMM suppliers, and (4) user training requirements are reduced.

22.3.3 CMM Software

CMM software is the set of programs and procedures used to operate the CMM and its associated equipment. In addition to part programming software used for programming DCC machines, discussed earlier, other software is also required to achieve full functionality of a CMM. Indeed, it is software that has enabled the CMM to become the workhorse inspection machine that it is. CMM software can be divided into the following categories [2]: (1) core software other than DCC programming, (2) post-inspection software, and (3) reverse engineering and application-specific software.

Core Software Other than DCC Programming. Core software consists of the minimum basic programs required for the CMM to function, other than part programming software, which applies only to DCC machines. This core software is generally applied either before or during the inspection procedure. Core programs normally include the following:

- *Probe calibration.* This function is required to define the parameters of the probe (such as tip radius, tip positions for a multi-tip probe, and elastic bending coefficients). Probe calibration allows coordinate measurements to automatically compensate for the probe dimensions when the tip contacts the part surface, avoiding the need for the probe tip calculations in Example 22.1. Calibration is accomplished by making the probe contact a cube or sphere of known dimensions.
- *Part coordinate system definition.* This software permits measurements of the part to be made without requiring a time-consuming part alignment procedure on the CMM worktable. Instead of physically aligning the part relative to the CMM axes, the axes are mathematically aligned relative to the part.
- *Geometric feature construction.* This software addresses the problems associated with geometric features whose evaluation requires more than one point measurement. These features include flatness, squareness, determining the center of a hole or the axis of a cylinder, and so on. The software integrates the multiple measurements so that a given geometric feature can be evaluated. Appendix 22A presents several of the computational techniques used to make these evaluations.
- *Tolerance analysis.* This software compares measurements taken on the part with the dimensions and tolerances specified on the engineering drawing.

Post-Inspection Software. Post-inspection software is the set of programs that are applied after the inspection procedure. Such software often adds significant utility and value to the inspection function. Among the programs included in this group are the following:

- *Statistical analysis.* This software is used to carry out any of various statistical analyses on the data collected by the CMM. For example, part dimension data can be

used to assess the process capability (Section 20.3.2) of the associated manufacturing process or perform statistical process control (Section 20.4).

- *Graphical data representation.* The purpose of this software is to display the data collected during the CMM procedure in a graphical or pictorial way, to allow easier visualization of form errors and other data by the user.

Reverse Engineering and Application-Specific Software. Reverse engineering software is designed to take an existing physical part and construct a computer model of the part geometry based on a large number of measurements of its surface by a CMM. The simplest approach is to use the CMM in the manual mode of operation, in which the operator moves the probe by hand and scans the physical part to create a digitized three-dimensional (3-D) surface model. Manual digitization can be quite time-consuming for complex part geometries. More automated methods are available, in which the CMM explores the part surfaces with little or no human intervention to construct the 3-D model. The challenge here is to minimize the exploration time of the CMM, yet capture the details of a complex surface contour and avoid collisions that would damage the probe. Lasers are often used instead of mechanical probes in reverse engineering applications because the data can be captured much more quickly and the collision problem is minimized or avoided.

Application-specific software refers to programs written for certain types of parts and/or products, whose applications are generally limited to specific industries. Several important examples are [2], [3]:

- *Gear checking.* These programs are used on a CMM to measure the geometric features of a gear, such as tooth profile, tooth thickness, pitch, and helix angle.
- *Thread checking.* These are used for inspection of cylindrical and conical threads.
- *Cam checking.* This software is used to evaluate the accuracy of physical cams relative to design specifications.
- *Automobile body checking.* This software is designed for CMMs used to measure sheet metal panels, subassemblies, and complete car bodies in the automotive industry. Unique measurement issues arise in this application that distinguish it from the measurement of machined parts: (1) large sheet metal panels lack rigidity, (2) compound curved surfaces are common, and (3) surface definition cannot be determined without measuring a great number of points.

Also included in the category of application-specific software are programs to operate accessory equipment with the CMM. Examples include automatic probe changers, rotary worktables used on the CMM, and automatic part loading and unloading devices.

22.3.4 CMM Applications and Benefits

The most common applications are off-line inspection and on-line/post-process inspection (Section 21.4.1). Machined components are frequently inspected using CMMs. One common application is to check the first part machined on a CNC machine tool. If the first part passes inspection, then the remaining parts produced in the batch are assumed to be identical to the first.

Inspection of parts and assemblies on a CMM is generally accomplished using sampling techniques. One reason for this is the time required to perform the measurements.

It often takes more time to inspect a part than it does to produce it. On the other hand, CMMs are sometimes used for 100% inspection if the inspection cycle is compatible with the production cycle and the CMM can be dedicated to the process. Whether the CMM is used for sampling inspection or 100% inspection, the CMM measurements are frequently used for statistical process control.

Other CMM applications include audit inspection and calibration of gages and fixtures. Audit inspection refers to the inspection of incoming parts from a vendor to ensure that the vendor's quality control systems are reliable. This is usually done on a sampling basis. In effect, this application is the same as post-process inspection. Gage and fixture calibration involves the measurement of various gages, fixtures, and other tooling to validate their continued use.

One of the factors that makes a CMM so useful is its accuracy and repeatability. Typical values of these measures are given in Table 22.3 for a moving bridge CMM. It can be seen that these performance measures degrade as the size of the machine increases.

Coordinate measuring machines are most appropriate for applications possessing the following characteristics:

1. *Many inspectors are currently performing repetitive manual inspection operations.* If the inspection function represents a significant labor cost to the plant, then automating the inspection procedures will reduce labor cost and increase throughput.
2. *The application involves post-process inspection.* CMMs are useful only in inspection operations performed after the manufacturing process.
3. *Measurement of geometric features requires multiple contact points.* These kinds of features are identified in Appendix 22A, and available CMM software facilitates evaluation of these features.
4. *Complex part geometry.* If many measurements are to be made on a complex part, and many contact locations are required, then the cycle time of a DCC CMM will be significantly less than the corresponding time for a manual procedure.
5. *A wide variety of parts must be inspected.* A DCC CMM is a programmable machine, capable of dealing with high parts variety.
6. *Repeat orders are common.* Once the part program has been prepared for the first part, subsequent parts from repeat orders can be inspected using the same program.

TABLE 22.3 Typical Accuracy and Repeatability Measures for Two Different Sizes of CMM; Data Apply to a Moving Bridge CMM

CMM Feature		Small CMM	Large CMM
Measuring range:	x	650 mm (25.6 in)	900 mm (35.4 in)
	y	600 mm (23.6 in)	1,200 mm (47.2 in)
	z	500 mm (19.7 in)	850 mm (33.5 in)
Accuracy:	x	0.004 mm (0.00016 in)	0.006 mm (0.00024 in)
	y	0.004 mm (0.00016 in)	0.007 mm (0.00027 in)
	z	0.0035 mm (0.00014 in)	0.0065 mm (0.00026 in)
Repeatability		0.0035 mm (0.00014 in)	0.004 mm (0.00016 in)
Resolution		0.0005 mm (0.00002 in)	0.0005 mm (0.00002 in)

Source: Bosch [2].

When applied in the appropriate parts quantity–part variety range, the advantages of using CMMs over manual inspection methods are the following [16]:

- *Reduced inspection cycle time.* Because of the automated techniques included in the operation of a CMM, inspection procedures are faster and labor productivity is improved. A DCC CMM is capable of accomplishing many of the measurement tasks discussed in Appendix 22A in one-tenth the time or less, compared with manual techniques. Reduced inspection cycle time translates into higher throughput.
- *Flexibility.* A CMM is a general-purpose machine that can be used to inspect a variety of different part configurations with minimal changeover time. In the case of the DCC machine, where programming is performed off-line, changeover time on the CMM involves only the physical setup.
- *Reduced operator errors.* Automating the inspection procedure reduces human errors in measurements and setups.
- *Greater inherent accuracy and precision.* A CMM is inherently more accurate and precise than the manual surface plate methods traditionally used for inspection.
- *Avoidance of multiple setups.* Traditional inspection techniques often require multiple setups to measure multiple part features and dimensions. In general, all measurements can be made in a single setup on a CMM, thereby increasing throughput and measurement accuracy.

22.3.5 Other Coordinate Metrology Techniques

Two additional coordinate metrology techniques sometimes used as alternatives to CMMs are covered in this section: (1) inspection probes on machine tools and (2) portable CMMs that can be moved and used at multiple locations in the plant.

Inspection Probes on Machine Tools. In recent years, there has been a significant growth in the use of tactile probes as on-line inspection systems in CNC machining center applications. The probes in these systems are mounted in toolholders, inserted into the machine tool spindle, stored in the tool drum, and handled by the automatic tool changer in the same way that cutting tools are handled. When the probe is mounted in the spindle, the machine tool is controlled very much like a CMM. Sensors in the probe determine when contact has been made with the part surface. Signals from the sensor are transmitted to the controller that performs the required data processing to interpret and utilize the signal.

Touch-sensitive probes are sometimes referred to as in-process inspection devices, but by the definitions in Section 21.4.1, they are on-line/post-process devices because they are used immediately after the machining operation rather than during it. However, these probes are sometimes used between machining steps in the same setup, for example, to establish a datum reference either before or after initial machining so that subsequent cuts can be performed with greater accuracy. Some of the other calculation features of machine-mounted inspection probes are similar to the capabilities of CMMs with computer-assisted data processing. These features include determining the centerline of a cylindrical part or a hole and determining the coordinates of an inside or outside corner (see Appendix 22A). Given the appropriate applications, use of the probes permits machining and inspection to be accomplished in one setup rather than two.

One of the controversial aspects of machine-mounted inspection probes is that the same machine tool making the part is also performing the inspection. The argument is

that certain errors inherent in the cutting operation will also be manifested in the measuring operation. For example, if there is misalignment between the machine tool axes that is producing out-of-square parts, this condition will not be identified by the machine-mounted probe because the movement of the probe is affected by the same axis misalignment. To generalize, errors that are common to both the production process and the measurement procedure will go undetected by a machine-mounted inspection probe. These errors include machine tool geometry errors (such as the axis misalignment problem identified earlier), thermal distortions in the machine tool axes, and errors in any thermal correction procedures applied to the machine tool [2]. Errors that are not common to both systems should be detectable by the measurement probe. These measurable errors include tool and/or toolholder deflection, work part deflection, tool offset errors, and effects of tool wear on the work part. In practice, the use of machine-mounted inspection probes has proved to be effective in improving quality and saving time as an alternative to expensive off-line inspection operations.

Another objection to the use of machine-mounted inspection probes is that they take time above and beyond the regular machining cycle [4], [17]. Time is required to program the inspection routines, and time is lost during the cutting sequence for the probe to perform its measurement function. Software suppliers have developed advanced packages to streamline the programming task, but the interruptions during the machining cycle remain an impediment to potential users. These time losses must be weighed against the additional time that would be required to perform a separate inspection of the part at the end of the machine cycle and the cost of rework or scrap if the part is machined incorrectly.

Other applications of measurement and inspection on the machine include the use of lasers, machine vision, and other noncontact sensor technologies to inspect not only the work part but also the cutting tool (for tool presence, tool breakage, tool wear, and tool geometry) [12], [13]. This is especially important in the case of very small diameter rotating tools, down to 0.2 mm (0.008 in). The growing use of these “on-machine” sensors, noncontact as well as the mechanical probes discussed, is certainly compatible with the trend toward unattended operations, in which CNC machine tools run for extended periods without a human operator present.

Portable CMMs. In the normal application of a coordinate measurement machine, parts must be removed from the production machine where they are made and taken to a special inspection room where the CMM is located. New coordinate measuring devices allow the inspection procedures to be performed at the site where the parts are made, eliminating the need to move the parts. Leading products in this area include the Faro gage and the Faro arm, both available from the European firm, Faro [22]. The Faro gage, nicknamed the *Personal CMM*, is a six-jointed articulated arm, whose configuration is similar to the human upper arm, forearm, and wrist. Fully extended it has a reach of about 1.2 m (47 in). At the end of the arm is a touch probe to perform the coordinate measurements, similar to a CMM. The difference is that the Faro gage mounts onto the machine tool that makes the parts. Thus, the inspection procedure can be carried out right at the machine, which has the following advantages:

- It is no longer necessary to move the parts from the machine tool to the CMM and back, so material handling is reduced.
- The results of the inspection procedure are known immediately.
- The machinist who makes the part also performs the inspection procedure (a minimum of training is required to use the Faro gage).

- Because the part is still attached to the machine while it is being inspected, datum reference locations established during the machining operation are not lost. Any further machining uses the same references without the need to refixture the part.

Precision capability of the Faro gage is claimed to be $5\ \mu\text{m}$ (0.0002 in). This accuracy is achieved through the use of highly accurate shaft encoders in the arm joints. A computer uses the encoder values to calculate the position of the probe in x - y - z space. Probes can be interchanged readily for various measurement tasks, just as they can when using a conventional CMM. Various types of mounting are available, including fixed attachment to the machine and magnetic or vacuum mounts.

Closely related to the Faro gage is the Faro arm, which has a longer reach than the smaller unit, but has a similar six-jointed articulated-arm configuration. Several different sizes are available, with the longest reach being 3.7 m (145 in). Precision and repeatability are reduced as the reach increases. The larger size of the Faro arm enables it to be used on much larger products, such as automobile and truck bodies.

22.4 SURFACE MEASUREMENT²

The measurement and inspection technologies discussed in Sections 22.2 and 22.3 are concerned with evaluating dimensions and related characteristics of a part or product. Another measurable attribute of a part or product is its surface. The measurement of surfaces is usually accomplished by instruments that use a contacting stylus. Hence, surface metrology is most appropriately included within the scope of contact inspection technologies.

Stylus Instruments. Stylus-type instruments are commercially available to measure surface roughness. These electronic devices have a cone-shaped diamond stylus with point radius of about 0.005 mm (0.0002 in) and a 90° tip angle that is traversed across the test surface at a constant slow speed. The operation is depicted in Figure 22.7. As the stylus head moves horizontally, it also moves vertically to follow the surface deviations. The vertical movements are converted into an electronic signal that represents the topography of the surface along the path taken by the stylus. This can be displayed as either (1) a profile of the surface or (2) an average roughness value.

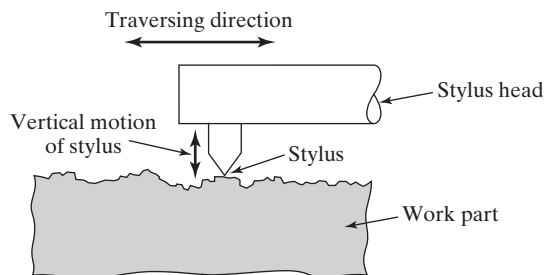


Figure 22.7 Sketch illustrating the operation of stylus-type instrument. Stylus head traverses horizontally across surface, while stylus moves vertically to follow surface profile. Vertical movement is converted into either: (1) a profile of the surface or (2) the average roughness value (source: [9]).

²Portions of this section are based on [9], Section 5.3.

Profiling devices use a separate flat plane as the nominal reference against which deviations are measured. The output is a plot of the surface contour along the line traversed by the stylus. This type of system can identify roughness, waviness, and other measures of the test surface. By traversing successive lines parallel and closely spaced with each other, the devices can create a “topographical map” of the surface.

Averaging devices reduce the vertical deviations to a single value of surface roughness. As illustrated in Figure 22.8, **surface roughness** is defined as the average of the vertical deviations from the nominal surface over a specified surface length. An arithmetic average (AA) is generally used, based on the absolute values of the deviations. In equation form,

$$R_a = \int_0^L \frac{|y|}{L} dx \quad (22.3)$$

where R_a = arithmetic mean value of roughness, μm ($\mu\text{-in}$); y = vertical deviation from the nominal surface converted to absolute value, μm ($\mu\text{-in}$); and L = sampling distance, called the *cutoff length*, over which the surface deviations are averaged. The distance L_m in Figure 22.8 is the total measurement distance that is traced by the stylus. A stylus-type averaging device performs Equation (22.3) electronically. To establish the nominal reference plane, the device uses skids riding on the actual surface. The skids act as a mechanical filter to reduce the effect of waviness in the surface.

One of the difficulties in surface roughness measurement is the possibility that waviness can be included in the measurement of R_a . To deal with this problem, the cutoff length is used as a filter that separates waviness from roughness deviations. As defined earlier, the cutoff length is a sampling distance along the surface. It can be set at any of several values on the measurement device, usually ranging between 0.08 mm (0.0030 in) and 2.5 mm (0.10 in). A cutoff length shorter than the waviness width eliminates the vertical deviations associated with waviness and only includes those associated with roughness. The most common cutoff length used in practice is 0.8 mm (0.030 in). The cutoff length should be set at a value that is at least 2.5 times the distance between successive roughness peaks. The measuring length L_m is normally set at about five times the cutoff length.

An approximation of Equation (22.3), perhaps easier to understand, is given by

$$R_a = \frac{\sum_{i=1}^n |y_i|}{n} \quad (22.4)$$

where R_a has the same meaning as above; y_i = vertical deviations identified by the subscript i , μm ($\mu\text{-in}$); and n = the number of deviations included in L .

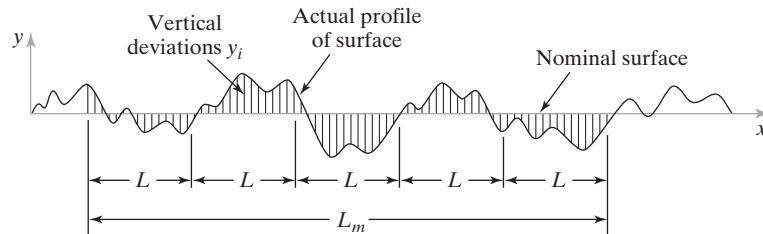


Figure 22.8 Deviations from nominal surface used in the definition of surface roughness (source: [9]).

Surface roughness suffers the same kinds of deficiencies of any single measure used to assess a complex physical attribute. One deficiency is that it fails to account for the lay of the surface pattern; thus, surface roughness may vary significantly depending on the direction in which it is measured. These kinds of issues are addressed in books that deal specifically with surface texture and its characterization and measurement, such as Mummery [15].

Other Surface Measuring Techniques. Two additional methods for measuring surface roughness and related characteristics are available. One is a contact procedure (sort of), while the other is a noncontact method.

The first technique involves a subjective comparison of the part surface with standard surface finish blocks that are produced to specified roughness values. In the United States, these blocks have surfaces with roughness values of 2, 4, 8, 16, 32, 64, and 128 microinches. To estimate the roughness of a given test specimen, the surface is compared to the standard both visually and by using a “fingernail test.” In this test, the user gently scratches the surfaces of the specimen and the standard, judging which standard is closest to the specimen. Standard test surfaces are a convenient way for a machine operator to obtain an estimate of surface roughness. They are also useful for product design engineers in judging what value of surface roughness to specify on the part drawing. The drawback of this method is its subjectivity.

Most other surface measuring instruments employ optical techniques to assess roughness. These techniques are based on light reflectance from the surface, light scatter or diffusion, and laser technology. They are useful in applications where stylus contact with the surface is undesirable. Some of the techniques permit very high speed operation, thus making 100% parts inspection feasible. One system described in Aronson [1] uses a laser to scan a 300 mm by 300 mm surface area in one minute and provides a three-dimensional colored hologram of the surface. The image consists of more than four million data points, readily shows surface variations, and permits measurements of the deviations to be made. One drawback of optical techniques is that their measured values do not always correlate well with roughness metrics obtained by stylus-type instruments.

22.5 MACHINE VISION

Machine vision consists of the acquisition of image data, followed by the processing and interpretation of these data by computer for some industrial application.³ Machine vision is a growing technology, with its principal applications in automated inspection and robot guidance. This section examines how machine vision works and discusses its applications.

Vision systems are classified as being either 2-D or 3-D. Two-dimensional systems view the scene as a 2-D image. This is quite adequate for most industrial applications, since many situations involve a 2-D scene. Examples include dimensional measuring and gaging, verifying the presence of components, and checking for features on a flat (or semiflat) surface. Other applications require 3-D analysis of the scene, and 3-D systems

³Closely related to machine vision is computer vision, generally considered to be a broader technology of which machine vision is an application subfield. Computer vision includes the theory and methods of obtaining information from image data using artificial intelligence and other computationally intensive techniques. Its applications include medical image processing, military applications (e.g., combat situation analysis), autonomous vehicle guidance, surveillance, and machine vision [23].

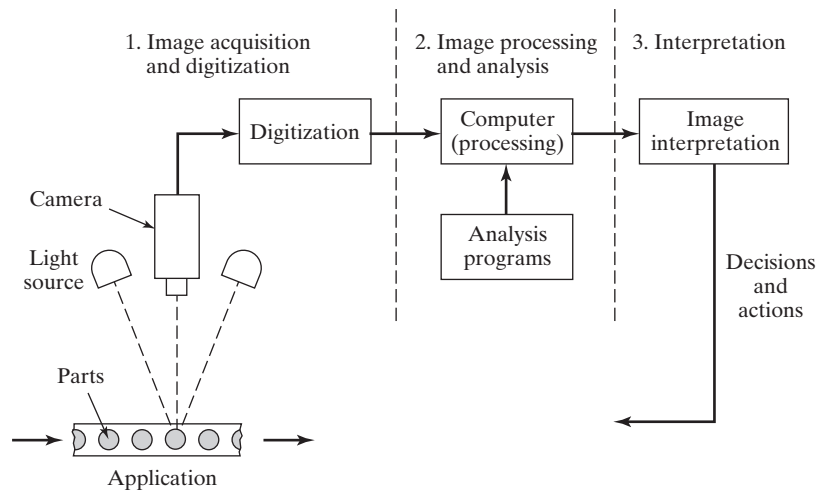


Figure 22.9 Basic functions of a machine vision system.

are sometimes needed for this purpose; however, 2-D machine vision can be used for certain 3-D applications. The discussion that follows emphasizes 2-D systems, although many of the techniques used for 2-D are also applicable in 3-D vision work.

The operation of a machine vision system can be divided into the following three functions: (1) image acquisition and digitization, (2) image processing and analysis, and (3) interpretation. These functions and their relationships are illustrated schematically in Figure 22.9.

22.5.1 Image Acquisition and Digitization

Image acquisition and digitization is accomplished using a digital camera and a digitizing system to store the image data for subsequent analysis. The camera is focused on the subject of interest, and an image is obtained by dividing the viewing area into a matrix of discrete picture elements (called *pixels*), in which each element has a value that is proportional to the light intensity of that portion of the scene. The intensity value for each pixel is converted into its equivalent digital value by an ADC (analog-to-digital converter, Section 6.3.1). The operation of viewing a scene consisting of a simple object that contrasts substantially with its background, and dividing the scene into a corresponding matrix of picture elements, is depicted in Figure 22.10.

The figure illustrates the likely image obtained from the simplest type of vision system, called a *binary vision* system, in which the light intensity of each pixel is ultimately reduced to either of two values, white or black, depending on whether the light intensity exceeds a given threshold level. A more sophisticated vision system is capable of distinguishing and storing different shades of gray in the image. This is called a *gray-scale system*, which can determine not only an object's outline and area characteristics, but also its surface characteristics such as texture and color. Grayscale vision systems typically use 4, 6, or 8 bits of memory. Eight bits corresponds to $2^8 = 256$ intensity levels, which is generally more levels than the machine vision camera can really distinguish and certainly more than the human eye can discern. Colors in the scene can be distinguished using color filters (red, yellow, blue) combined with a grayscale system for each pixel to determine color brightness.

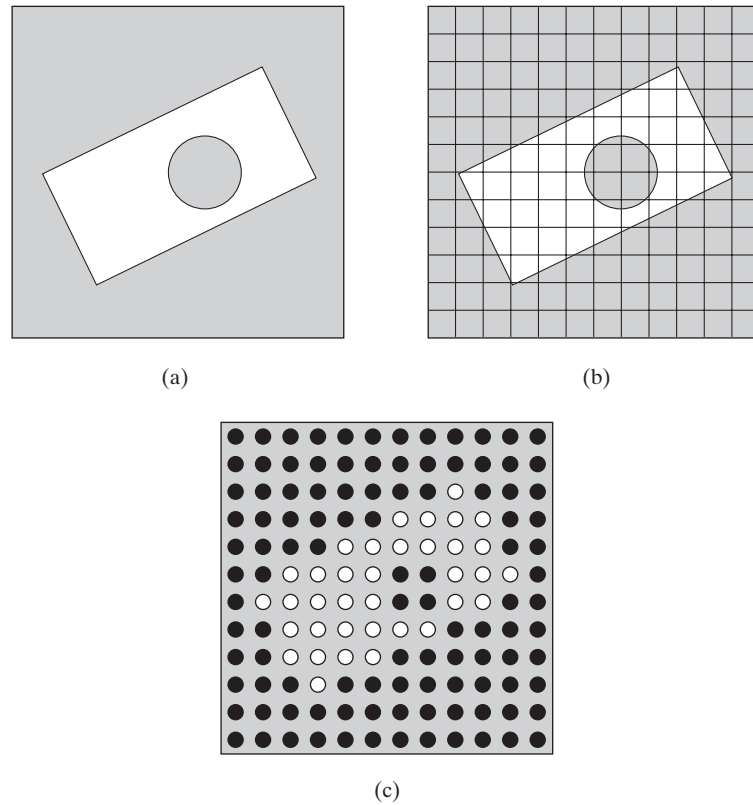


Figure 22.10 Dividing the image into a matrix of picture elements, where each element has a light intensity value corresponding to that portion of the image: (a) the scene; (b) 12×12 matrix superimposed on the scene; and (c) pixel intensity values, either black or white, for the scene.

Each set of digitized pixel values is referred to as a *frame*. Each frame is stored in a computer memory device called a *frame buffer*. The process of reading all the pixel values in a frame is performed with a frequency of 30 times/sec. Very high-resolution cameras often operate at slower frequencies (e.g., 15 frames/sec).

Cameras. Digital cameras operate by focusing the image onto a 2-D array of very small, finely spaced photosensitive elements using conventional optical lenses. The photosensitive elements form a matrix of pixels on the surface of the solid-state image sensor (which is an integrated circuit chip), located behind the lens system of the camera. An electrical charge is generated by each element according to the intensity of light striking it. When energized by the image, the pixels take on different values as suggested by the sequence in Figure 22.10. The charge is accumulated in a storage device consisting of an array of storage elements corresponding one-to-one with the photosensitive picture elements. These charge values are read in the data processing and analysis function of machine vision.

Image sensors used in machine vision cameras are either of two types: charge-coupled device (CCD) or complementary metal-oxide semiconductor (CMOS). Until

recently, most digital cameras used CCD image sensors, but CMOS technology has advanced to the point where it is competitive with CCD.⁴ Advantages given for CMOS over CCD include higher-speed operation, lower cost (at least for large quantities), and much lower power consumption [24]. One reason that a CCD image sensor is slower than its CMOS counterpart is that the pixel values must be converted from analog to digital sequentially, whereas the CMOS conversion process is done simultaneously.

Typical pixel arrays in image sensors are 640 (horizontal) \times 480 (vertical), 1024 \times 768, and 1600 \times 1200 picture elements, although very-high-end vision equipment comes with arrays up to 9372 \times 9372 pixels. The *resolution* of the vision system is its ability to sense fine details and features in the image. Resolution depends on the number of picture elements used; the more pixels designed into the image sensors, the higher its resolution. However, the cost of the camera increases as the number of pixels is increased, and the time required to read the picture elements and process the data increases as the number of pixels grows. This latter point is especially true for CCD sensors, as the following example illustrates.

EXAMPLE 22.2 Machine Vision

Consider a machine vision camera based on a CCD image sensor with a 640 \times 480 pixel matrix. Each pixel must be converted from an analog signal to the corresponding digital signal by an ADC. The analog-to-digital conversion takes 0.1 μ -sec to complete, including the time to switch between pixels. How long will it take to collect the image data for one frame, and is this time compatible with processing at the rate of 30 frames/sec?

Solution: There are 640 \times 480 = 307,200 pixels to be scanned and converted. The total time to complete the analog-to-digital conversion process is

$$\text{ADC time} = (307,200 \text{ pixels})(0.1 \times 10^{-6} \text{ sec}) = \mathbf{0.0307 \text{ sec}}$$

At a processing rate of 30 frames/sec, the processing time for each frame is 0.0333 sec, which is longer than the 0.0307 sec required to perform the 307,200 analog-to-digital conversions. Therefore, the analog-to-digital conversion time is compatible with the processing rate of 30 frames/sec. □

Illumination. Another important aspect of machine vision is illumination. The scene viewed by the vision camera must be well illuminated, and the illumination must be constant over time. This almost always requires that special lighting be installed for a machine vision application rather than relying on ambient light in the facility.

Five categories of lighting can be distinguished for machine vision applications, as depicted in Figure 22.11: (a) front lighting, (b) back lighting, (c) side lighting, (d) structured lighting, and (e) strobe lighting. These categories represent differences in the positions of the light source relative to the camera as much as they represent differences in lighting technologies, which include incandescent lamps, fluorescent lamps, sodium vapor lamps, and lasers.

⁴The improvement in CMOS image sensor technology has been motivated largely by the widespread use of these devices in smartphones and compact digital cameras. High-end cameras are still likely to be based on CCD image sensors due to the perception that they produce higher-quality images.

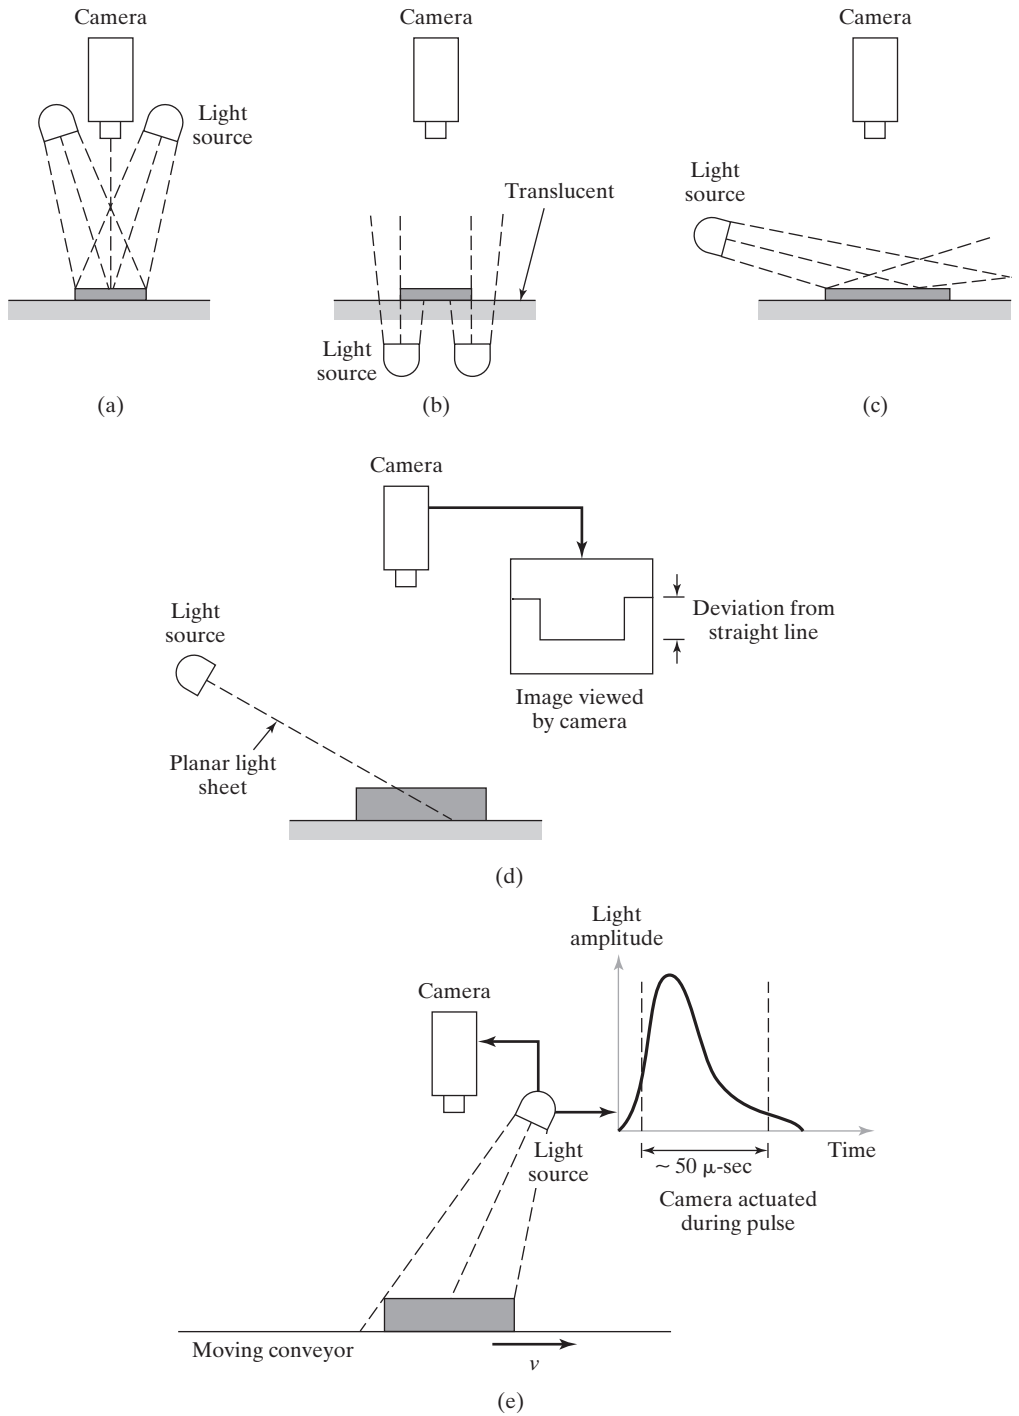


Figure 22.11 Types of illumination in machine vision: (a) front lighting, (b) back lighting, (c) side lighting, (d) structured lighting using a planar sheet of light, and (e) strobe lighting.

In front lighting, the light source is located on the same side of the object as the camera. This produces a reflected light from the object that allows inspection of surface features such as printing on a label and surface patterns such as solder lines on a printed circuit board. In back lighting, the light source is placed behind the object being viewed by the camera. This creates a dark silhouette of the object that contrasts sharply with the light background. This type of lighting can be used for binary vision systems to inspect part dimensions and to distinguish between different part outlines. Side lighting causes irregularities in an otherwise plane smooth surface to cast shadows that can be identified by the vision system. This can be used to inspect for defects and flaws in the surface of an object.

Structured lighting involves the projection of a special light pattern onto the object to enhance certain geometric features. Probably the most common structured light pattern is a planar sheet of highly focused light directed against the surface of the object at a certain known angle, as in Figure 22.11(d). The sheet of light forms a bright line where the beam intersects the surface. In the sketch, the vision camera is positioned with its line of sight perpendicular to the surface of the object, so that any variations from the general plane of the part appear as deviations from a straight line. The distance of the deviation can be determined by optical measurement, and the corresponding elevation differences can be calculated using trigonometry.

In strobe lighting, the scene is illuminated by a short pulse of high-intensity light, which causes a moving object to appear stationary. The moving object might be a part moving past the vision camera on a conveyor. The pulse of light can last 5–500 μ -sec [7]. This is sufficient time for the camera to capture the scene, although the camera actuation must be synchronized with that of the strobe light. Applications include inspecting parts on a conveyor moving past the camera at constant velocity.

22.5.2 Image Processing and Analysis

The second function in the operation of a machine vision system is image processing and analysis. As indicated by Example 22.2, the amount of data that must be processed is significant. The data for each frame must be analyzed within the time required to complete one scan (typically 1/30 sec). A number of techniques have been developed for analyzing the image data in a machine vision system. One category of techniques in image processing and analysis, called *segmentation*, is intended to define and separate regions of interest within the image. Two of the common segmentation techniques are thresholding and edge detection. **Thresholding** involves the conversion of each pixel intensity level into a binary value, representing either white or black. This is done by comparing the intensity value of each pixel with a defined threshold value. If the pixel value is greater than the threshold, it is given the binary bit value of white, say 1; if less than the defined threshold, then it is given the bit value of black, say 0. Reducing the image to binary form by means of thresholding usually simplifies the subsequent problem of defining and identifying objects in the image.

Edge detection is concerned with determining the location of boundaries between an object and its surroundings in an image. This is accomplished by identifying the contrast in light intensity that exists between adjacent pixels at the borders of the object. A number of software algorithms have been developed for following the border around the object.

Another set of techniques in image processing and analysis that normally follows segmentation is feature extraction. Most machine vision systems characterize an object in the image by means of the object's features: its area, length, width, diameter, perimeter, center of gravity, and aspect ratio. **Feature extraction** methods are designed to determine these features based on the area and boundaries of the object (using thresholding, edge

detection, and other segmentation techniques). For example, the area of the object can be determined by counting the number of pixels that make up the object and multiplying by the area represented by one pixel. Its length can be found by measuring the distance (in terms of pixels) between the two extreme opposite edges of the part.

22.5.3 Interpretation

For any given application, the image must be interpreted based on the extracted features. The interpretation function is usually concerned with recognizing the object, a task called *object recognition* or *pattern recognition*. The objective in this task is to identify the object in the image by comparing it with predefined models or standard values. Two commonly used interpretation techniques are template matching and feature weighting. **Template matching** refers to various methods that attempt to compare one or more features of an image with the corresponding features of a model or template stored in computer memory. The most basic template matching technique is one in which the image is compared, pixel by pixel, with a corresponding computer model. Within certain statistical tolerances, the computer determines whether the image matches the template. One of the technical difficulties with this method is the problem of aligning the part in the same position and orientation in front of the camera, to allow the comparison to be made without complications in image processing.

Feature weighting is a technique in which several features (e.g., area, length, and perimeter) are combined into a single measure by assigning a weight to each feature according to its relative importance in identifying the object. The score of the object in the image is compared with the score of an ideal object residing in computer memory to achieve proper identification.

22.5.4 Machine Vision Applications

The reason for interpreting the image is to accomplish some application. Machine vision applications in manufacturing divide into three categories: (1) inspection, (2) identification, and (3) visual guidance and control.

Inspection. By far, quality control inspection is the biggest category. Machine vision installations in industry perform a variety of automated inspection tasks, most of which are either on-line/in-process or on-line/post-process. The applications are almost always in mass production where the time required to program and set up the vision system can be spread over many thousands of units. Typical industrial inspection tasks include the following:

- *Dimensional measurement.* These applications involve determining the size of certain dimensional features of parts or products usually moving at relatively high speeds on a moving conveyor. The machine vision system must compare the features (dimensions) with the corresponding features of a computer-stored model and determine the size value.
- *Dimensional gaging.* This is similar to the preceding except that a gaging function rather than a measurement is performed.
- *Verification of the presence of components.* This is done in an assembled product such as a printed circuit board assembly.
- *Verification of hole location and number of holes.* Operationally, this task is similar to dimensional measurement and verification of components.

- *Detection of surface flaws and defects.* Flaws and defects on the surface of a part or material often reveal themselves as a change in reflected light. The vision system can identify the deviation from an ideal model of the surface.
- *Detection of flaws in a printed label.* The defect can be in the form of a poorly located label or poorly printed text, numbering, or graphics on the label.

All of the preceding inspection applications can be accomplished using 2-D vision systems. Certain applications require 3-D vision, such as scanning the contour of a surface, inspecting cutting tools to check for breakage and wear, and checking solder paste deposits on surface mount circuit boards. Three-dimensional systems are being used increasingly in the automotive industry to inspect surface contours of parts such as body panels and dashboards. Vision inspection can be accomplished at much higher speeds than inspection with CMMs.

Other Applications. Part identification applications use a vision system to recognize and perhaps distinguish parts or other objects so that some action can be taken. The applications include part sorting, counting different types of parts flowing past along a conveyor, and inventory monitoring. Part identification can usually be accomplished by 2-D vision systems. Reading of two-dimensional bar codes and character recognition (Chapter 12) represent additional identification applications performed by 2-D vision systems.

Visual guidance and control involves applications in which a vision system is teamed with a robot or similar machine to control the movement of the machine. The term *vision-guided robotic* (VGR) system is used in connection with this technology [25]. Examples of VGR applications include seam tracking in continuous arc welding, part positioning and/or reorientation, picking parts from moving conveyors or stationary bins, collision avoidance, machining operations, and assembly tasks. These applications have been encouraged by recent improvements in the software that coordinates the operations of the vision system and the robot.

22.6 OTHER OPTICAL INSPECTION METHODS

Machine vision is a well-publicized technology, perhaps because it is similar to one of the important human senses. It has potential for many applications in industry. However, there are also other optical sensing techniques used for measurement and inspection. This section surveys these technologies. The dividing line between machine vision and these techniques is sometimes blurry (excuse the pun). The distinction is that machine vision tends to imitate the capabilities of the human optical sensory system, which includes not only the eyes but also the complex interpretive powers of the brain. The techniques described below have a much simpler mode of operation.

Conventional Optical Instruments. These conventional instruments include optical comparators and microscopes. An optical comparator projects the shadow of an object (e.g., a work part) against a large screen in front of an operator. The object can be moved in the x - y directions, permitting the operator to obtain dimensional data using crosshairs on the screen. Modern comparators feature edge-detection capabilities and advanced software that enable measurements to be taken accurately and quickly. Also known as *contour projectors* and *shadowgraphs*, they are easier to use than coordinate

measuring machines and can be attractive in many applications requiring measurements in only two dimensions. The price of an optical comparator is about half the price of the least expensive CMM.

An alternative to the optical comparator is the conventional microscope. While the comparator is generally a unit that stands on the floor, a microscope is usually a bench-top unit, thus requiring less space in the shop floor. Microscopes can be equipped with an optical projection system instead of an eyepiece, providing ergonomic benefits for the operator. A significant advantage over the optical comparator is that the projection system shows the actual surface of the object rather than its shadow. The user can see its color, texture, and other features rather than just an outline.

Laser Systems. The unique feature of a laser (*laser* stands for *light amplification by stimulated emission of radiation*) is that it uses a coherent beam of light that can be projected with minimum diffusion. Because of this feature, lasers have been used in a number of industrial processing and measuring applications. High-energy laser beams are used for welding and cutting of materials, and low-energy lasers are used in various measuring and gaging situations.

The scanning laser device falls into the latter category. As shown in Figure 22.12, the scanning laser uses a laser beam that is deflected by a rotating mirror to produce a beam of light that can be focused to sweep past an object. A photodetector on the far side of the object senses the light beam except for the time period during the sweep when it is interrupted by the object. This time period can be measured with great accuracy and related to the size of the object in the path of the laser beam. The scanning laser beam device can complete its measurement in a very short time. Hence, the scheme can be applied in high-production on-line/post-process inspection or gaging. A microprocessor counts the time interruption of the scanning laser beam as it sweeps past the object, makes the conversion from time to a linear dimension, and signals other equipment to make adjustments in the manufacturing process and/or activate a sortation device on the production line. Applications of the scanning laser technique include rolling mill operations, wire extrusion, and machining and grinding processes.

More sophisticated applications of laser inspection systems are found in the automotive industry for measuring the contour and fit of car bodies and their component

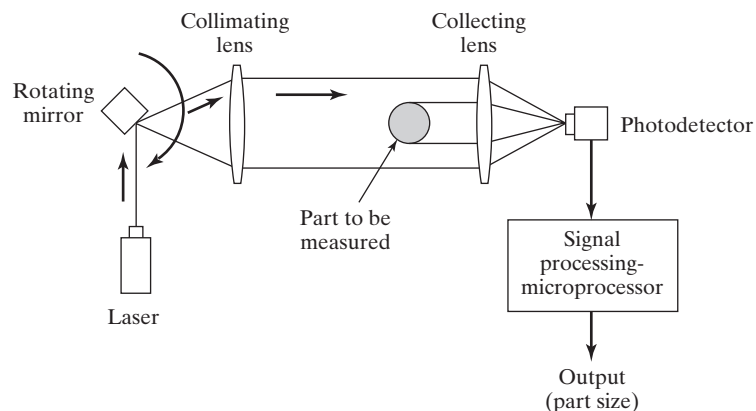


Figure 22.12 Diagram of scanning laser device.

sheet metal parts. These applications require very large numbers of measurements to be taken in order to capture the shapes of complex geometric contours. Tolinski [18] describes three components in the inspection systems that perform these measurements. The first is a laser scanner capable of collecting more than 15,000 geometric data points/sec. The second is a mobile coordinate measuring machine to which the laser device is attached. The function of the CMM is to accurately locate the scanned points in three-dimensional space. The third component is a computer system that compares the data points to a geometric model of the desired shape.

Linear Array Devices. The operation of a linear array for automated inspection is similar in some respects to machine vision, except that the pixels are arranged in only one dimension rather than two. A schematic diagram showing one possible arrangement of a linear array device is presented in Figure 22.13. The device consists of a light source that emits a planar sheet of light directed at an object. On the opposite side of the object is a linear array of closely spaced photo diodes. The sheet of light is blocked by the object, and this blocked light is measured by the photo diode array to indicate the object's dimension of interest.

The linear array measuring scheme has the advantages of simplicity, accuracy, and speed. It has no moving parts and can complete a measurement in a much smaller time cycle than either machine vision or the scanning laser beam technique.

Optical Triangulation Techniques. Triangulation techniques are based on the trigonometric relationships of a right triangle. Triangulation is used for range-finding, that is, determining the distance or range of an object from two known points. Use of the principle in an optical measuring system is explained with reference to Figure 22.14. A light source (typically a laser) is used to focus a narrow beam at an object to form a spot of light on the object. A linear array of photo diodes or other position-sensitive optical detector is used to determine the location of the spot. The angle A of the beam directed at the object is fixed and known, and so is the distance L between the light source and the photosensitive detector. Accordingly, the range R of the object from the baseline defined by the light source and the photosensitive detector in Figure 22.14 can be determined as a function of the angle as follows:

$$R = L \cot A \quad (22.5)$$

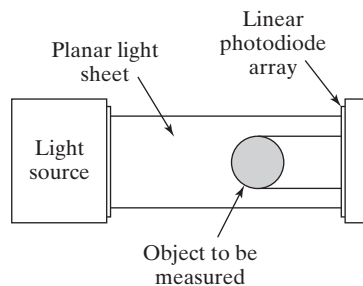


Figure 22.13 Operation of a linear array measuring device.

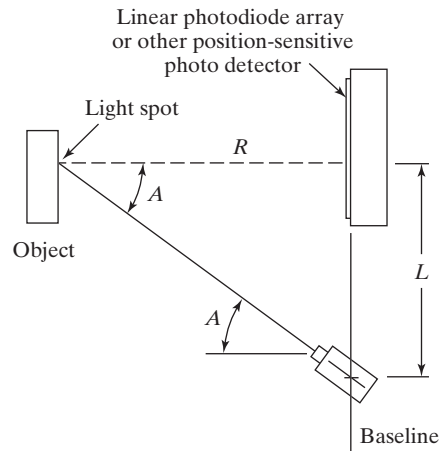


Figure 22.14 Principle of optical triangulation sensing.

22.7 NONCONTACT NONOPTICAL INSPECTION TECHNIQUES

In addition to noncontact optical inspection methods, there is also a variety of nonoptical technologies used for inspection tasks in manufacturing. Examples include sensor techniques based on electrical fields, radiation, and ultrasonics. This section briefly reviews these technologies as they might be used for inspection. They are important because they are nondestructive evaluation methods.

Electrical Field Techniques. Under certain conditions, an electrically active probe can create an electrical field. The field is affected by an object in the vicinity of the probe. Examples of electrical fields include reluctance, capacitance, and inductance. In the typical application, the object (work part) is positioned in a defined relation with respect to the probe. A measurement of the object's effect on the electrical field allows an indirect measurement or gaging of certain part characteristics to be made, such as dimensional features, thickness of sheet material, and in some cases, flaws (cracks and voids below the surface) in the material.

Radiation Techniques. Radiation techniques utilize X-ray radiation to accomplish noncontact inspection procedures on metals and weld-fabricated products. The amount of radiation absorbed by the metal object can be used to indicate thickness and presence of flaws in the metal part or welded section. An example is the use of X-ray inspection techniques to measure thickness of sheet metal made in a rolling mill. The inspection is performed as an on-line/post-process procedure, with information from the inspection used to make adjustments in the opening between rolls in the rolling mill.

Ultrasonic Inspection Methods. Ultrasonic techniques make use of very high frequency sound (greater than 20,000 Hz) for various inspection tasks. Some of the techniques are performed manually, whereas others are automated. One of the automated

methods involves emitting ultrasonic waves from a probe and reflecting them off the object to be inspected. In the setup of the inspection procedure, an ideal test part is placed in front of the probe to obtain a reflected sound pattern. This sound pattern becomes the standard against which production parts are later compared. If the reflected pattern from a given production part matches the standard (within an allowable statistical variation), the part is considered acceptable; otherwise, it is rejected. One technical problem with this technique involves the presentation of production parts in front of the probe. To avoid extraneous variations in the reflected sound patterns, the parts must always be placed in the same position and orientation relative to the probe.

REFERENCES

- [1] ARONSON, R. B., "Finding the Flaws," *Manufacturing Engineering*, November 2006, pp. 81–88.
- [2] BOSCH, A., Editor, *Coordinate Measuring Machines and Systems*, Marcel Dekker, Inc., New York, 1995.
- [3] BROWN & SHARPE, *Handbook of Metrology*, North Kingston, RI, 1992.
- [4] DESTAFANI, J., "On-Machine Probing," *Manufacturing Engineering*, November 2004, pp. 51–57.
- [5] DOEBLIN, E. O., *Measurement Systems: Application and Design*, 5th ed., McGraw-Hill, Inc., New York, 2003.
- [6] FARAGO, F. T., *Handbook of Dimensional Measurement*, 2nd ed., Industrial Press Inc., New York, 1982.
- [7] GALBIATI, L. J., Jr., *Machine Vision and Digital Image Processing Fundamentals*, Prentice Hall, Englewood Cliffs, NJ, 1990.
- [8] GROOVER, M. P., M. WEISS, R. N. NAGEL, and N. G. ODREY, *Industrial Robotics: Technology, Programming, and Applications*, McGraw-Hill Book Co., New York, 1986, Chapter 7.
- [9] GROOVER, M. P., *Fundamentals of Modern Manufacturing—Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013, Chapter 5.
- [10] HOGARTH, S., "Machines with Vision," *Manufacturing Engineering*, April 1999, pp. 100–107.
- [11] LIN, S.-S., P. VARGHESE, C. ZHANG, and H.-P. B. WANG, "A Comparative Analysis of CMM Form-Fitting Algorithms," *Manufacturing Review*, Vol. 8, No. 1, March 1995, pp. 47–58.
- [12] MOREY, B., "Machine Tool Metrology Made Simple," *Manufacturing Engineering*, January 2012, pp. 57–63.
- [13] MOREY, B., "Measure It on the Machine," *Manufacturing Engineering*, January 2013, pp. 55–62.
- [14] MORRIS, A. S., *Measurement and Calibration for Quality Assurance*, Prentice Hall, Englewood Cliffs, NJ, 1991.
- [15] MUMMERY, L., *Surface Texture Analysis—The Handbook*, Hommelwerke GmbH, Germany, 1990.
- [16] SCHAFFER, G. H., "Taking the Measure of CMMs," Special Report 749, *American Machinist*, October 1982, pp. 145–160.
- [17] SHARKE, P., "On-Machine Inspecting," *Mechanical Engineering*, April 2005, pp. 30–33.
- [18] TOLINSKI, M., "Hands-Off Inspection," *Manufacturing Engineering*, September 2005, pp. 117–130.
- [19] WAURZYNIAK, P., "Programming CMMs," *Manufacturing Engineering*, May 2004, pp. 117–126.
- [20] WAURZYNIAK, P., "Optical Inspection," *Manufacturing Engineering*, July 2004, pp. 107–114.
- [21] WICK, C., and R. F. VEILLEUX, Editors, *Tool and Manufacturing Engineers Handbook*, 4th ed., Volume IV, *Quality Control and Assembly*, Society of Manufacturing Engineers, Dearborn, MI, 1987.

- [22] www.Faro.com
- [23] www.wikipedia.org/wiki/Computer_vision
- [24] www.wikipedia.org/wiki/Image_sensor
- [25] ZENS, Jr., R. G., "Guided by Vision," *Assembly*, September 2005, pp. 52–58.

REVIEW QUESTIONS

- 22.1 Define the term *measurement*.
- 22.2 What is metrology?
- 22.3 What are the seven basic quantities used in metrology upon which all other variables are derived?
- 22.4 What is the difference between accuracy and precision in measurement? Define these two terms.
- 22.5 With respect to measuring instruments, what is calibration?
- 22.6 What is meant by the term *contact inspection*?
- 22.7 What are some of the advantages of noncontact inspection?
- 22.8 What is meant by the term *coordinate metrology*?
- 22.9 What are the two basic components of a coordinate measuring machine?
- 22.10 Name the four categories into which the methods of operating and controlling a CMM can be classified.
- 22.11 What does the term *reverse engineering* mean in the context of coordinate measuring machines?
- 22.12 The text lists six characteristics of potential applications for which CMMs are most appropriate. Name the six characteristics.
- 22.13 What are some of the arguments and objections to the use of inspection probes mounted in toolholders on machine tools?
- 22.14 What is the most common method used to measure surfaces of a part?
- 22.15 What is machine vision?
- 22.16 The operation of a machine vision system can be divided into three functions. Name and briefly describe them.
- 22.17 What are the two types of image sensors used in machine vision cameras?
- 22.18 What is the largest application of machine vision in industry?
- 22.19 What is an optical comparator?
- 22.20 The word *laser* is an acronym for what?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Inspection Metrology

- 22.1 A measuring instrument is being designed to inspect two part dimensions that are considered key characteristics (Section 21.1.2). The two dimensions with tolerances are 205.5 ± 0.25 mm and 57.0 ± 0.20 mm. To what level of precision should the instrument be designed to measure these part dimensions?

- 22.2 (A)** A digital measuring device has a full-scale range of 250 mm, and its storage register has 12 bits for each measurement. What is the measurement resolution of this device?
- 22.3** A digital scale has a range of 30 kg, and its storage register capacity is 10 bits. It is used in a packaging line, on which the net weight of each product is specified as 20 ± 0.40 kg. (a) What is the measurement resolution of this scale? (b) Is this resolution sufficient for this application based on the rule of 10?
- 22.4** A digital measuring instrument has a range of 40.0 in. It is used to measure the lengths of sheet metal parts in an automobile stamping plant. The measurement resolution of the instrument is specified as 0.125 in. How many bits must be in the storage register to achieve this resolution?

Coordinate Metrology (Appendix 22A)

For ease of computation, numerical values in the following problems are given at a lower level of precision than most CMMs would be capable of.

- 22.5 (A)** Two point locations corresponding to a certain length dimension have been measured by a coordinate measuring machine in the x - y plane. The coordinates of the first point are (12.511, 2.273), and the coordinates of the opposite point are (4.172, 1.985), where the units are inches. The coordinates have been corrected for probe radius. Determine the length dimension that would be computed by the CMM software.
- 22.6** The coordinates at the two ends of a certain length dimension have been measured by a CMM. The coordinates of the first end are (120.5, 50.2, 20.2), and the coordinates of the opposite end are (23.1, 11.9, 20.3), where the units are mm. The given coordinates have been corrected for probe radius. Determine the length dimension that would be computed by the CMM software.
- 22.7** Three point locations on the surface of a drilled hole have been measured by a CMM in the x - y axes. The three coordinates are (16.42, 17.17), (20.20, 11.85), and (24.08, 16.54), where the units are mm. These coordinates have been corrected for probe radius. Determine (a) the coordinates of the hole center and (b) the hole diameter, as they would be computed by the CMM software.
- 22.8 (A)** Three point locations on the surface of a cylinder have been measured by a coordinate measuring machine. The cylinder is positioned so that its axis is perpendicular to the x - y plane. The three coordinates in the x - y axes are (5.242, 0.124), (0.325, 4.811), and (-4.073, -0.544), where the units are inches. The coordinates have been corrected for probe radius. Determine (a) the coordinates of the cylinder axis and (b) the cylinder diameter, as they would be computed by the CMM software.
- 22.9** Two points on a line have been measured by a CMM in the x - y plane. The point locations have the following coordinates: (12.257, 2.550) and (3.341, -10.294), where the units are inches and the coordinates have been corrected for probe radius. Find the equation for the line in the form of Equation (22A.5).
- 22.10** Two points on a line are measured by a CMM in the x - y plane. The points have the following coordinates: (100.24, 20.57) and (50.44, 60.46), where the units are mm. The given coordinates have been corrected for probe radius. Determine the equation for the line in the form of Equation (22A.5).
- 22.11** The coordinates of the intersection of two lines are to be determined using a CMM to define the equations for the two lines. The two lines are the edges of a machined part, and the intersection represents the corner where the two edges meet. Both lines lie in the x - y plane. Two points are measured on the first line to have coordinates of (5.254, 10.430) and (10.223, 6.052). Two points are measured on the second line to have coordinates of (6.101, 0.657) and (8.970, 3.824). Units are inches. The coordinate values have been corrected for probe radius. (a) Determine the equations for the two lines in the form of Equation (22A.5).

(b) What are the coordinates of the intersection of the two lines? (c) The edges represented by the two lines are specified to be perpendicular to each other. Find the angle between the two lines to determine if the edges are perpendicular.

- 22.12** Two of the edges of a rectangular part are represented by two lines in the x - y plane on a CMM worktable, as illustrated in Figure P22.12. It is desired to mathematically redefine the coordinate system so that the two edges are used as the x - and y -axes, rather than the regular x - y axes of the CMM. To define the new coordinate system, two parameters must be determined: (a) the origin of the new coordinate system must be located in the existing CMM axis system; and (b) the angle of the x -axis of the new coordinate system must be determined relative to the CMM x -axis. Two points on the first edge (line 1) have been measured by the CMM and the coordinates are (46.21, 22.98) and (90.25, 32.50), where the units are mm. Also, two points on the second edge (line 2) have been measured by the CMM and the coordinates are (26.53, 40.75) and (15.64, 91.12). The coordinates have been corrected for the radius of the probe. Find (a) the coordinates of the new origin relative to the CMM origin and (b) degrees of rotation of the new x -axis relative to the CMM x -axis. (c) Are the two lines (part edges) perpendicular?

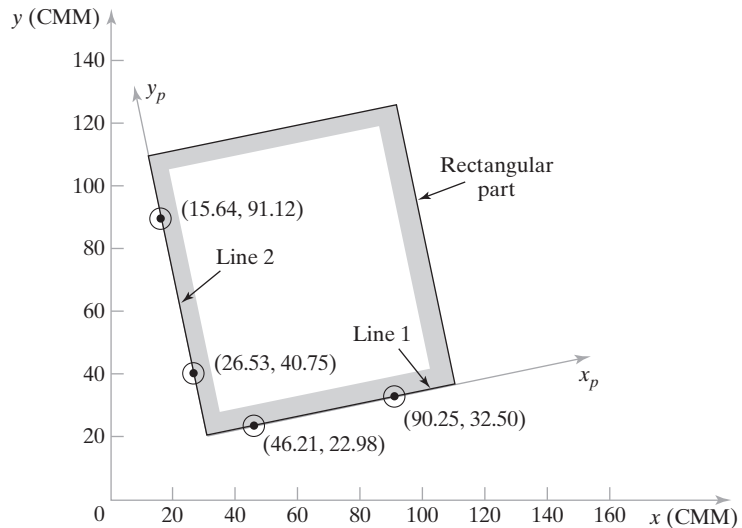


Figure P22.12 Overhead view of part relative to CMM axes.

- 22.13 (A)** Three point locations on the flat surface of a part have been measured by a CMM. The three point locations are (225.21, 150.23, 40.17), (14.24, 140.92, 38.29), and (12.56, 22.75, 38.02), where the units are mm. The coordinates have been corrected for probe radius. (a) Determine the equation for the plane in the form of Equation (22A.8). (b) To assess flatness of the surface, a fourth point is measured by the CMM. If its coordinates are (120.22, 75.34, 39.26), what is the vertical deviation of this point from the perfectly flat plane determined in (a)?

Optical Inspection Technologies

- 22.14** A digital camera that uses a CCD image sensor has a 1024×768 pixel matrix. The analog-to-digital converter takes $0.05 \mu\text{-sec}$ (0.05×10^{-6} sec) to convert the analog charge signal for each pixel into the corresponding digital signal, including the time to switch between pixels. Determine (a) how much time is required to collect the image data for one frame, and (b) is this time compatible with the processing rate of 30 frames per second?

- 22.15 (A)** The pixel count of a digital camera that uses a CCD image sensor is 1600×1200 . Each pixel is converted from an analog voltage to the corresponding digital signal by an analog-to-digital converter. Each conversion takes $0.015 \mu\text{-sec}$ ($0.015 \times 10^{-6} \text{ sec}$). (a) Given this time, how long will it take to collect and convert the image data for one frame? (b) Can this be done 30 times/sec?
- 22.16** A digital camera that uses a CCD image sensor is to have a 1035×1320 pixel matrix. An image processing rate of 30 times/sec must be achieved (0.0333 sec per frame). To allow for time lost in other data processing per frame, the total ADC time per frame must be 80% of the 0.0333 sec. In order to be compatible with this speed, in what time period must the analog-to-digital conversion be accomplished per pixel?
- 22.17** A scanning laser device, similar to the one shown in Figure 22.12, is to be used to measure the diameters of shafts that are ground in a centerless grinding operation. The part has a diameter of 0.475 in with a tolerance of ± 0.002 in. The four-sided mirror of the scanning laser beam device rotates at 250 rev/min. The collimating lens focuses 30° of the sweep of the mirror into a swath that is 1.000 in wide. It is assumed that the light beam moves at a constant speed across this swath. The photodetector and timing circuitry is capable of resolving time units as fine as 100 nanoseconds ($100 \times 10^{-9} \text{ sec}$). This resolution should be equivalent to no more than 10% of the tolerance band (0.004 in). (a) Determine the interruption time of the scanning laser beam for a part whose diameter is equal to the nominal size. (b) How much of a difference in interruption time is associated with the tolerance of ± 0.002 in? (c) Is the resolution of the photodetector and timing circuitry sufficient to achieve the 10% rule on the tolerance band?
- 22.18** Triangulation computations are used to determine the distance of parts moving on a conveyor. The setup of the optical measuring apparatus is as illustrated in the text in Figure 22.14. The angle between the beam and the surface of the part is 30° . Suppose for one given part passing on the conveyor, the baseline distance is 7.500 in, as measured by the linear photosensitive detection system. What is the distance of this part from the baseline?

APPENDIX 22A: GEOMETRIC FEATURE CONSTRUCTION

This appendix covers some of the computational algorithms used to accomplish measurements of geometric features requiring more than one point measurement. The algorithms integrate the multiple measurements so that the desired geometric feature can be evaluated. Table 22A.1 lists a number of the common geometric features, indicating how the features might be assessed using the CMM software. Examples 22A.1 and 22A.2 illustrate the application of two of the feature evaluation techniques. For increased statistical reliability, it is common to measure more than the theoretically minimum number of points needed to assess the feature and then to apply curve-fitting algorithms (such as least squares) to calculate the best estimate of the geometric feature's parameters. A review of CMM form-fitting algorithms is presented in Lin et al. [11].

TABLE 22A.1 Geometric Features Requiring Multiple Point Measurements to Evaluate:
Subroutines for Evaluating These Features Are Commonly Available Among CMM Software

Dimensions. A dimension of a part can be determined by taking the difference between the two surfaces defining the dimension. The two surfaces can be defined by a point location on each surface. In two axes ($x - y$), the distance L between two point locations (x_1, y_1) and (x_2, y_2) is given by

$$L = \pm \sqrt{(x_2 - x_1)^2 + (y_2 - y_1)^2} \quad (22A.1)$$

In three axes ($x - y - z$), the distance L between two point locations (x_1, y_1, z_1) and (x_2, y_2, z_2) is given by

$$L = \pm \sqrt{(x_2 - x_1)^2 + (y_2 - y_1)^2 + (z_2 - z_1)^2} \quad (22A.2)$$

See Example 22A.1.

Hole location and diameter. By measuring three points around the surface of a circular hole, the “best-fit” center coordinates (a, b) of the hole and its radius R can be computed. The diameter = twice the radius. In the x - y plane, the coordinate values of the three point locations are used in the following equation for a circle to set up three equations with three unknowns:

$$(x - a)^2 + (y - b)^2 = R^2 \quad (22A.3)$$

where a = x -coordinate of the hole center, b = y -coordinate of the hole circle, and R = radius of the hole circle. Solving the three equations yields the values of a , b , and R . $D = 2R$. See Example 22A.2.

Cylinder axis and diameter. This is similar to the preceding problem except that the calculation deals with an outside surface rather than an internal (hole) surface.

Sphere center and diameter. By measuring four points on the surface of a sphere, the best-fit center coordinates (a, b, c) and the radius R (diameter $D = 2R$) can be calculated. The coordinate values of the four point locations are used in the following equation for a sphere to set up four equations with four unknowns:

$$(x - a)^2 + (y - b)^2 + (z - c)^2 = R^2 \quad (22A.4)$$

where a = x -coordinate of the sphere, b = y -coordinate of the sphere, c = z -coordinate of the sphere, and R = radius of the sphere. Solving the four equations yields the values of a , b , c , and R .

Definition of a line in x - y plane. Based on a minimum of two contact points on the line, the best-fit line is determined. For example, the line might be the edge of a straight surface. The coordinate values of the two point locations are used in the following equation for a line to set up two equations with two unknowns:

$$x + Ay + B = 0 \quad (22A.5)$$

where A is a parameter indicating the slope of the line in the y -axis direction and B is a constant indicating the x -axis intercept. Solving the two equations yields the values of A and B , which defines the line. This form of equation can be converted into the more familiar conventional equation of a straight line, which is

$$y = mx + b \quad (22A.6)$$

where slope $m = -1/A$ and y -intercept $b = -B/A$.

Angle between two lines. Based on the conventional form equations of the two lines, that is, Equation (22A.6), the angle between the two lines relative to the positive x -axis is given by:

$$\text{Angle between line 1 and line 2} = \alpha - \beta \quad (22A.7)$$

where $\alpha = \tan^{-1}(m_1)$, where m_1 = slope of line 1; and $\beta = \tan^{-1}(m_2)$, where m_2 = slope of line 2.

Definition of a plane. Based on a minimum of three contact points on a plane surface, the best-fit plane is determined. The coordinate values of the three point locations are used in the following equation for a plane to set up three equations with three unknowns:

$$x + Ay + Bz + C = 0 \quad (22A.8)$$

where A and B are parameters indicating the slopes of the plane in the y - and z -axis directions, and C is a constant indicating the x -axis intercept. Solving the three equations yields the values of A , B , and C , which defines the plane.

Flatness. By measuring more than three contact points on a supposedly plane surface, the deviation of the surface from a perfect plane can be determined.

Angle between two planes. The angle between two planes can be found by defining each of two planes using the plane definition method and calculating the angle between them.

Parallelism between two planes. This is an extension of the previous function. If the angle between two planes is zero, then the planes are parallel. The degree to which the planes deviate from parallelism can be determined.

Angle and point of intersection between two lines. Given two lines known to intersect (e.g., two edges of a part that meet in a corner), the point of intersection and the angle between the lines can be determined based on two points measured for each line (a total of four points).

EXAMPLE 22A.1 Computing a Linear Dimension

The coordinates at the two ends of a certain length dimension of a machined component have been measured by a CMM. The coordinates of the first end are (23.47, 48.11, 0.25), and the coordinates of the opposite end are (73.52, 21.70, 60.38), where the units are millimeters. The given coordinates have been corrected for probe radius. Determine the length dimension that would be computed by the CMM software.

Solution: Using Equation (22A.2),

$$\begin{aligned} L &= \sqrt{(23.47 - 73.52)^2 + (48.11 - 21.70)^2 + (0.25 - 60.38)^2} \\ &= \sqrt{(-50.05)^2 + (26.41)^2 + (-60.13)^2} \\ &= \sqrt{2,505.0025 + 697.4881 + 3,615.6169} = \sqrt{6,818.1075} = \mathbf{82.57 \text{ mm}} \end{aligned}$$

EXAMPLE 22A.2 Determining the Center and Diameter of a Drilled Hole

Three point locations on the surface of a drilled hole have been measured by a CMM in the x - y axes. The three coordinates are (34.41, 21.07), (55.19, 30.50), and (50.10, 13.18) millimeters. The given coordinates have been corrected for probe radius. Determine (a) coordinates of the hole center and (b) hole diameter, as they would be computed by the CMM software.

Solution: To determine the coordinates of the hole center, three equations are set up based on Equation (22A.3):

$$(34.41 - a)^2 + (21.07 - b)^2 = R^2 \quad (\text{i})$$

$$(55.19 - a)^2 + (30.50 - b)^2 = R^2 \quad (\text{ii})$$

$$(50.10 - a)^2 + (13.18 - b)^2 = R^2 \quad (\text{iii})$$

Expanding each of the equations,

$$1,184.0481 - 68.82a + a^2 + 443.9449 - 42.14b + b^2 = R^2 \quad (\text{i})$$

$$3,045.9361 - 110.38a + a^2 + 930.25 - 61b + b^2 = R^2 \quad (\text{ii})$$

$$2,510.01 - 100.2a + a^2 + 173.7124 - 26.36b + b^2 = R^2 \quad (\text{iii})$$

Simultaneous solution of the three equations yields the following values: $a = 45.66 \text{ mm}$, $b = 23.89 \text{ mm}$, and $R = 11.60 \text{ mm}$. Thus, the center of the hole is located at $x = \mathbf{45.66 \text{ mm}}$ and $y = \mathbf{23.78 \text{ mm}}$, and the hole diameter is $D = \mathbf{23.20 \text{ mm}}$.

Product Design and CAD/CAM in the Production System

CHAPTER CONTENTS

- 23.1 Product Design and CAD
 - 23.1.1 The Design Process
 - 23.1.2 Computer-Aided Design
- 23.2 CAM, CAD/CAM, and CIM
 - 23.2.1 Computer-Aided Manufacturing
 - 23.2.2 CAD/CAM
 - 23.2.3 Computer-Integrated Manufacturing
- 23.3 Quality Function Deployment

This final part of the book is concerned with manufacturing support systems that operate at the enterprise level, as indicated in Figure 23.1. **Manufacturing support systems** are the procedures and systems used by the firm to manage production and solve the technical and logistics problems associated with designing the products, planning the processes, ordering materials, controlling work-in-process as it moves through the plant, and delivering products to customers. Many of these functions can be automated using computer systems, as suggested by terms like *computer-aided design* and *computer-integrated manufacturing*. Whereas most of the previous discussion on automation has emphasized the flow of the physical product through the factory, the enterprise level is concerned more with the flow of information in the factory and throughout the firm. Most of the topics in Part VI deal with computerized systems, but systems and procedures that require human workers are also described. Even the computer-automated systems include people. People make the production system work.

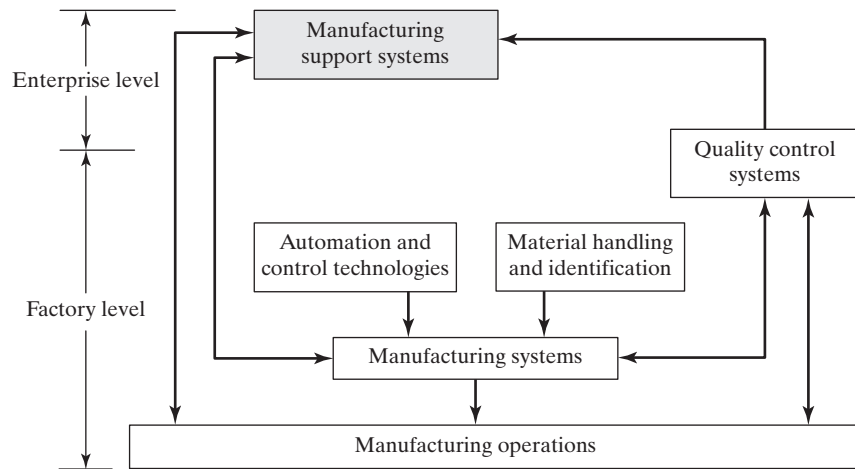


Figure 23.1 The position of the manufacturing support systems in the larger production system.

The present chapter deals with product design and the various technologies that are used to augment and automate the design function. CAD/CAM (computer-aided design and computer-aided manufacturing) is one of those technologies. It uses digital computer systems to accomplish certain functions in product design and production. CAD uses the computer to support the design engineering function, and CAM uses the computer to support manufacturing engineering activities. The combination CAD/CAM is symbolic of efforts to integrate the design and manufacturing functions of a firm into a continuum of activities rather than to treat them as two separate and disparate activities, as they had been considered in the past. CIM (computer-integrated manufacturing) includes all of CAD/CAM but also embraces the business functions of a manufacturing firm. CIM implements computer technology in all of the operational and information-processing activities related to manufacturing. In the final section of the chapter, a systematic method for approaching a product design project, called *quality function deployment*, is described.

Chapters 24 through 26 are concerned with topics in production systems other than product design. Chapter 24 deals with process planning and how it can be automated using computer systems. Included in this discussion are ways in which product design and manufacturing and other functions can be integrated using an approach called *concurrent engineering*. An important issue in concurrent engineering is design for manufacturing; that is, how can a product be designed to make it easier (and cheaper) to produce? Chapter 25 discusses the various methods used to implement production planning and control, through material requirements planning, shop floor control, and enterprise resource planning (ERP). Finally, Chapter 26 is concerned with just-in-time production and lean production, the techniques that were developed and perfected by the Toyota Motor Company in Japan.

23.1 PRODUCT DESIGN AND CAD

Product design is a critical function in the production system. The quality of the product design is probably the single most important factor in determining the commercial success and societal value of a product. If the product design is poor, no matter how well it

is manufactured, the product is very likely doomed to contribute little to the wealth and well-being of the firm that produced it. If the product design is good, there is still the question of whether the product can be produced at sufficiently low cost to contribute to the company's profits and success. One of the facts of life about product design is that a very significant portion of the cost of the product is determined by its design. Design and manufacturing cannot be separated in the production system. They are bound together functionally, technologically, and economically.

23.1.1 The Design Process

The general process of design is characterized as an iterative process consisting of six phases [13]: (1) recognition of need, (2) problem definition, (3) synthesis, (4) analysis and optimization, (5) evaluation, and (6) presentation. These six steps, and the iterative nature of the sequence in which they are performed, are depicted in Figure 23.2(a).

Recognition of need (1) involves the realization by someone that a problem exists which could be solved by a thoughtful design. This recognition might mean identifying some deficiency in a current machine design by an engineer or perceiving some new product opportunity by a salesperson. Problem definition (2) involves a thorough specification of the item to be designed. This specification includes the physical characteristics, function, cost, quality, and operating performance.

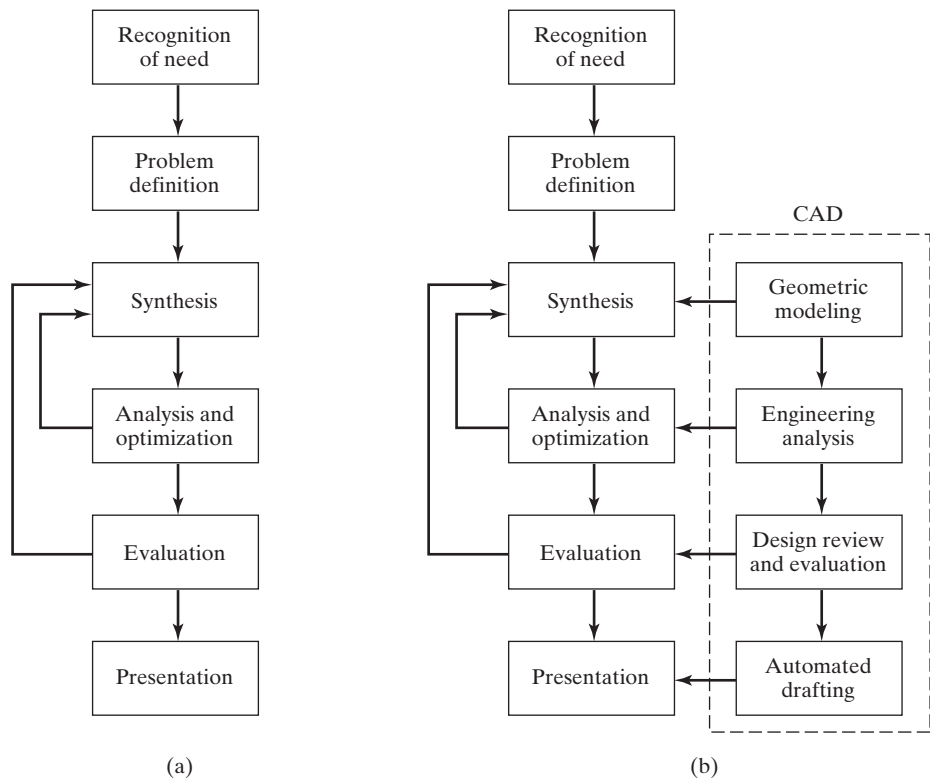


Figure 23.2 (a) Design process as defined by Shigley [13]. (b) The design process using computer-aided design (CAD).

Synthesis (3) and analysis (4) are closely related and highly interactive. Consider the development of a certain product design: Each of the subsystems of the product must be conceptualized by the designer, analyzed, improved through this analysis procedure, redesigned, analyzed again, and so on. The process is repeated until the design has been optimized within the constraints imposed on the designer. The individual components are then synthesized and analyzed into the final product in a similar manner.

Evaluation (5) is concerned with measuring the design against the specifications established in the problem definition phase. This evaluation often requires the fabrication and testing of a prototype model to assess operating performance, quality, reliability, and other criteria. The final phase in the design procedure is the presentation of the design. Presentation (6) is concerned with documenting the design by means of drawings, material specifications, assembly lists, and so on. In essence, documentation means that the design database is created.

23.1.2 Computer-Aided Design

Computer-aided design (CAD) is defined as any design activity that involves the effective use of computer systems to create, modify, analyze, optimize, and document an engineering design. CAD is most commonly associated with the use of an interactive computer graphics system, referred to as a CAD system. The term *CAD/CAM* is also used if the system includes manufacturing applications as well as design applications.

With reference to the six phases of design, a CAD system can facilitate four of the design phases, as illustrated in Figure 23.2(b), as an overlay on the design process.

Geometric Modeling. Geometric modeling involves the use of a CAD system to develop a mathematical description of the geometry of an object. The mathematical description, called a *geometric model*, is contained in computer memory. This permits the user of the CAD system to display an image of the model on a graphics terminal and to perform certain operations on the model. These operations include creating new geometric models from basic building blocks available in the system, moving and reorienting the images on the screen, zooming in on certain features of the image, and so forth. These capabilities permit the designer to construct a model of a new product (or its components) or to modify an existing model.

There are various types of geometric models used in CAD. One classification distinguishes between two-dimensional (2-D) and three-dimensional (3-D) models. Two-dimensional models are best utilized for designing flat objects and building layouts. In the first CAD systems developed in the 1970s, 2-D systems were used principally as automated drafting systems. They were often used for 3-D objects, and it was left to the designers to properly construct the various views as they would have done in manual drafting. Three-dimensional CAD systems are capable of modeling an object in three dimensions according to user instructions. This is helpful in conceptualizing the object since the true 3-D model can be displayed in various views and from different angles.

Geometric models in CAD can also be classified as wire-frame models or solid models. A wire-frame model uses interconnecting lines (straight line segments) to depict the object as illustrated in Figure 23.3(a). Wire-frame models of complicated geometries can become somewhat confusing because all of the lines depicting the shape of the object are usually shown, even the lines representing the other side of the object. These so-called hidden lines can be removed, but even with this improvement, wire-frame representation is still often

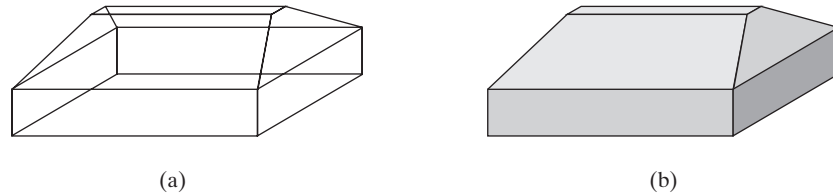


Figure 23.3 Geometric models in CAD: (a) Wire-frame model. (b) Solid model of the same object.

confusing. It is rarely used today. In solid modeling, Figure 23.3(b), an object is modeled in solid three dimensions, providing the user with a vision of the object that is similar to the way it would be seen in real life. More important for engineering purposes, the geometric model is stored in the CAD system as a 3-D solid model, providing a more accurate representation of the object. This is useful for calculating mass properties, in assembly to perform interference checking between mating components, and in other engineering calculations.

Two other features in CAD system models are color and animation. The value of color is largely to enhance the ability of the user to visualize the object on the graphics screen. For example, the various components of an assembly can be displayed in different colors, permitting the parts to be more readily distinguished. And animation capability permits the operation of mechanisms and other moving objects to be displayed on the graphics monitor.

Engineering Analysis. After a particular design alternative has been developed, some form of engineering analysis must often be performed as part of the design process. The analysis may take the form of stress–strain calculations, heat transfer analysis, or dynamic simulation. The computations are often complex and time consuming, and before the advent of the digital computer, these analyses were usually greatly simplified or even omitted in the design procedure. The availability of software for engineering analysis on a CAD system greatly increases the designer’s ability and willingness to perform a more thorough analysis of a proposed design. The term *computer-aided engineering* (CAE) applies to engineering analyses performed by computer. Examples of CAE software in common use on CAD systems include:

- *Mass properties analysis.* This involves the computation of such features of a solid object as its volume, surface area, weight, and center of gravity. It is especially applicable in mechanical design. Prior to CAD, determination of these properties often required painstaking and time-consuming calculations by the designer.
- *Interference checking.* This CAD software examines 3-D geometric models consisting of multiple components to identify interferences between components. It is useful in analyzing mechanical assemblies, chemical plant piping systems, and similar multicomponent designs.
- *Tolerance analysis.* Software for analyzing the specified tolerances of a product’s components is used (1) to assess how the tolerances may affect the product’s function and performance, (2) to determine how tolerances may influence the ease or difficulty of assembling the product, and (3) to assess how variations in component dimensions may affect the overall size of the assembly.
- *Finite element analysis.* Software for finite element analysis (FEA), also known as *finite element modeling* (FEM), is available for use on CAD systems to aid in

stress–strain, heat transfer, fluid flow, and other computations. Finite element analysis is a numerical analysis technique for determining approximate solutions to physical problems described by differential equations that are very difficult or impossible to solve. In FEA, the physical object is modeled by an assemblage of discrete interconnected nodes (finite elements), and the variable of interest (e.g., stress, strain, temperature) in each node can be described by relatively simple mathematical equations. Solving the equations for each node provides the distribution of values of the variable throughout the physical object.

- *Kinematic and dynamic analysis.* Kinematic analysis studies the operation of mechanical linkages and analyzes their motions. A typical kinematic analysis specifies the motion of one or more driving members of the subject linkage, and the resulting motions of the other links are determined by the analysis package. Dynamic analysis extends kinematic analysis by including the effects of the mass of each linkage member and the resulting acceleration forces as well as any externally applied forces.
- *Discrete-event simulation.* This type of simulation is used to model complex operational systems, such as a manufacturing cell or a material handling system, as events occur at discrete moments in time and affect the status and performance of the system. For example, discrete events in the operation of a manufacturing cell include parts arriving for processing and a machine breakdown in the cell. Performance measures include the status of any given machine in the cell (idle or busy), average length of time parts spend in the cell, and overall cell production rate. Current discrete-event simulation software includes animated graphics capability that enhances visualization of the system's operation.

Design Evaluation and Review. Some of the CAD features that are helpful in evaluating and reviewing a proposed design include the following:

- *Automatic dimensioning.* These routines determine precise distance measures between surfaces on the geometric model identified by the user.
- *Error checking.* This term refers to CAD algorithms that are used to review the accuracy and consistency of dimensions and tolerances and to assess whether the proper design documentation format has been followed.
- *Animation of discrete-event simulation solutions.* Discrete-event simulation was described earlier in the context of engineering analysis. Displaying the solution of the discrete-event simulation in animated graphics is a helpful means of presenting and evaluating the solution. Input parameters, probability distributions, and other factors can be changed to assess their effect on the performance of the system being modeled.
- *Plant layout design scores.* A number of software packages are available for facilities design, that is, designing the floor layout and physical arrangement of equipment in a facility. Some of these packages provide one or more numerical scores for each plant layout design, which allow the user to assess the merits of the alternative with respect to material flow, closeness ratings, and similar factors.

The traditional procedure in designing a new product includes fabrication of a prototype before approval and release for production. The prototype serves as the “acid test” of the design, permitting the designer and others to see, feel, operate, and test the product for any last-minute changes or enhancements of the design. The problem with building a prototype is that it is traditionally very time consuming; in some cases, months are required to make and assemble all of the parts. Motivated by the need to reduce this

lead time for building the prototype, engineers have developed several new approaches that rely on the use of the geometric model of the product residing in the CAD data file. Two of these approaches are rapid prototyping and virtual prototyping.

Rapid prototyping (RP) is a family of fabrication technologies that allow engineering prototypes of solid parts to be made in minimum lead time; the common feature of these technologies is that they produce the part directly from the CAD geometric model. This is usually done by dividing the solid object into a series of layers of small thickness and then defining the area shape of each layer. For example, a vertical cone would be divided into a series of circular layers, the circles becoming smaller and smaller toward the vertex of the cone. The RP processes then fabricate the object by starting at the base and building each layer on top of the preceding layer to approximate the solid shape. The fidelity of the approximation depends on the thickness of each layer. As layer thickness decreases, accuracy increases. There are a variety of layer-building processes used in rapid prototyping. One process, called *stereolithography*, uses a photosensitive liquid polymer that cures (solidifies) when subjected to intense light. Curing of the polymer is accomplished using a moving laser beam whose path for each layer is controlled by means of the CAD model. A solid polymer prototype of the part is built up of hardened layers, one on top of another. Another RP process, called *selective laser sintering*, uses a moving laser beam to fuse powders in each layer to form the object layer by layer; work materials include polymers, metals, and ceramics. When used to produce parts rather than prototypes, the term *additive manufacturing* is used for these processing technologies. A comprehensive treatment of rapid prototyping and additive manufacturing is presented in [6]; for a more concise coverage of these technologies, see [8].

Virtual prototyping, based on virtual reality technology, involves the use of the CAD geometric model to construct a digital mock-up of the product, enabling the designer and others to obtain the sensation of the real product without actually building the physical prototype. Virtual prototyping has been used in the automotive industry to evaluate new car style designs. The observer of the virtual prototype is able to assess the appearance of the new design even though no physical model is on display. Other applications of virtual prototyping include checking the feasibility of assembly operations, for example, parts mating, access and clearance of parts during assembly, and assembly sequence.

Automated Drafting. The fourth area where CAD is useful (step 6 in the design process) is presentation and documentation. CAD systems can be used to prepare highly accurate engineering drawings when paper documents are required. It is estimated that a CAD system increases productivity in the drafting function by about fivefold over manual preparation of drawings.

CAD Workstations. The CAD workstation and its available features have an important influence on the convenience, productivity, and quality of the designer's output. The workstation includes a graphics display terminal and one or more user input devices. It is the principal means by which the system communicates with the designer. Two CAD system configurations are depicted in Figure 23.4: (1) engineering workstation and (2) PC-based CAD system.¹ The distinction between the two categories is becoming more and more subtle.

¹The first CAD systems introduced in the 1970s and 1980s were based on a host-and-terminal configuration, in which the host was a mainframe or minicomputer serving one or more graphics terminals on a time-shared basis. The powerful microprocessors and high-density memory devices so common today were not available at that time. By and large, these host-and-terminal systems have been overtaken by engineering workstations and PC-based CAD systems.

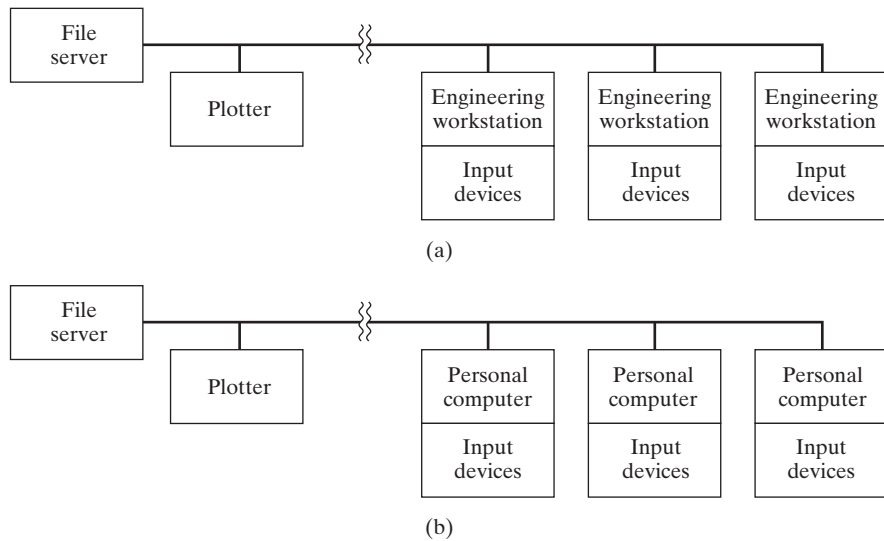


Figure 23.4 Two CAD system configurations: (a) engineering workstation and (b) PC-based CAD system.

An engineering workstation is a stand-alone computer system that is dedicated to one user and capable of executing graphics software and other programs requiring high-speed computational power. The graphics display is a high-resolution monitor with a large screen. As shown in the figure, engineering workstations are often networked to permit exchange of data files and programs between users and to share plotters and data storage devices.

PC-based CAD systems are the most widely used CAD systems today. They consist of a personal computer with a high-performance CPU and high-resolution graphics display screen. The computer is equipped with a large random access memory (RAM), math coprocessor, and large-capacity hard disk for storage of the large applications software packages used for CAD. PC-based CAD systems can be networked to share files, output devices, and for other purposes. CAD software products are based on the graphics environment of Microsoft Windows, and CAD software is also available for Apple's Mac operating system [17], [18]. Although desktop computers are most widely used, some designers prefer laptop PCs to accomplish their creative and analytical tasks.

Managing the Product Design. The output of the creative design process includes huge amounts of data that must be stored and managed. These functions are often accomplished in a modern CAD system using product data management. A **product data management** (PDM) system consists of computer software that provides links between users (e.g., designers) and a central database, which stores design data such as geometric models, product structures (e.g., bills of material), and related records. The software also manages the database by tracking the identity of users, facilitating and documenting engineering changes, recording a history of the engineering changes on each part and product, and providing similar documentation functions.

The PDM system is usually considered to be a component of a broader process within a company called **product lifecycle management** (PLM), which is concerned

with managing the entire life cycle of a product, starting with the initial concept for it, continuing through its development and design, prototype testing, manufacturing planning, production operations, customer service, and finally its end-of-life disposal. PLM is a business process that begins with product design, but its scope is much broader than product design. Implementing PLM involves the integration of product and production data, business procedures, and people.

Compared with manual design and drafting methods, computer-aided design and management systems provide many advantages, including the following [10], [15]):

- *Increased design productivity.* The use of CAD helps the designer conceptualize the product and its components, which in turn helps reduce the time required by the designer to synthesize, analyze, and document the design. The result is a shorter design cycle and lower product development costs.
- *Increased available geometric forms in the design.* CAD permits the designer to select among a wider range of shapes, such as mathematically defined contours, blended angles, and similar forms that would be difficult to create by manual drafting techniques.
- *Improved quality of the design.* The use of a CAD system permits the designer to do a more complete engineering analysis and to consider a larger number and variety of design alternatives. The quality of the resulting design is thereby improved.
- *Improved design documentation.* The graphical output of a CAD system results in better documentation of the design than what is practical with manual drafting. The engineering drawings are superior, with more standardization among the drawings, fewer drafting errors, and greater legibility. In addition, most CAD packages provide automatic documentation of design changes, which includes who made the changes, as well as when and why the changes were made.
- *Creation of a manufacturing database.* In the process of creating the documentation for the product design (geometric specification of the product, dimensions of the components, materials specifications, bill of materials, etc.), much of the required database to manufacture the product is also created.
- *Design standardization.* Design rules can be included in CAD software to encourage the designer to utilize company-specified models for certain design features—for example, to limit the number of different hole sizes used in the design. This simplifies the hole specification procedure for the designer and reduces the number of drill bit sizes that must be inventoried in manufacturing.

23.2 CAM, CAD/CAM, AND CIM

CAM, CAD/CAM, and CIM were briefly defined in the chapter introduction. CIM is sometimes spoken of interchangeably with CAM and CAD/CAM. Although the terms are closely related, CIM has a broader meaning than CAM or CAD/CAM.

23.2.1 Computer-Aided Manufacturing

Computer-aided manufacturing (CAM) involves the use of computer technology in manufacturing planning and control. CAM is most closely associated with functions in manufacturing engineering, such as process planning and numerical control (NC) part

programming. The applications of CAM can be divided into two broad categories: (1) manufacturing planning and (2) manufacturing control. These two categories are covered in Chapters 24 and 25, but a brief discussion of them here may be helpful to the reader.

Manufacturing Planning. CAM applications for manufacturing planning are those in which the computer is used indirectly to support the production function, but there is no direct connection between the computer and the process. The computer is used to provide information for the effective planning and management of production activities. The following list surveys the important applications of CAM in this category:

- *Computer-aided process planning (CAPP).* Process planning is concerned with the preparation of route sheets that list the sequence of operations and work centers required to produce the product and its components. CAPP systems are available today to prepare these route sheets. CAPP is covered in the following chapter.
- *CAD/CAM NC part programming.* Numerical control part programming was discussed in Chapter 7. For complex part geometries, CAD/CAM part programming represents a much more efficient method of generating the control instructions for the machine tool than manual part programming.
- *Computerized machinability data systems.* One of the problems with operating a metal cutting machine tool is determining the speeds and feeds that should be used for a given operation. Computer programs are available to recommend the appropriate cutting conditions for different materials and operations (e.g., turning, milling, drilling). The recommendations are based on data that have been compiled either in the factory or laboratory that relate tool life to cutting conditions. Machinability data systems are described in [10].
- *Computerized work standards.* The time study department has the responsibility for setting time standards on direct labor jobs performed in the factory. Establishing standards by direct time study can be a tedious and time-consuming task. There are several commercially available computer packages for setting work standards. These computer programs use standard time data that have been developed for basic work elements that comprise any manual task. The program sums the times for the individual elements required to perform a new job in order to calculate the standard time for the job. These packages are discussed in [9].
- *Cost estimating.* The task of estimating the cost of a new product has been simplified in most industries by computerizing several of the key steps required to prepare the estimate. The computer is programmed to apply the appropriate labor and overhead rates to the sequence of planned operations for the components of new products. The program then adds up the individual component costs from the engineering bill of materials to determine the overall product cost.
- *Production and inventory planning.* The production and inventory planning functions include maintenance of inventory records, automatic reordering of stock items when inventory is depleted, production scheduling, maintaining current priorities for the different production orders, material requirements planning, and capacity planning. These functions are described in Chapter 25.
- *Computer-aided line balancing.* Finding the best allocation of work elements among stations on an assembly line is a large and difficult problem if the line is of significant size. Computer programs are available to assist in the solution of the line balancing problem (Section 15.3).

Manufacturing Control. The second category of CAM applications is concerned with computer systems to control and manage the physical operations in the factory. These applications include the following:

- *Process monitoring and control.* Process monitoring and control is concerned with observing and regulating the production equipment and manufacturing processes in the plant. The topic of industrial process control was discussed in Chapter 5. The applications of computer process control are pervasive in modern automated manufacturing systems, which include transfer lines, assembly systems, CNC machine tools, robotics, material handling, and flexible manufacturing systems. All of these topics are covered in earlier chapters.
- *Quality control.* Quality control includes a variety of approaches to ensure the highest possible quality levels in the manufactured product. Quality control systems are covered in Part V.
- *Shop floor control.* Shop floor control refers to production management techniques for collecting data from factory operations and using the data to help control production and inventory in the factory. Shop floor control and factory data collection systems are covered in Chapter 25.
- *Inventory control.* Inventory control is concerned with maintaining the most appropriate levels of inventory in the face of two opposing objectives: minimizing the investment and storage costs of holding inventory, and maximizing service to customers. Inventory control is discussed in Chapter 25.
- *Just-in-time production systems.* Just-in-time (JIT) refers to a production system that is organized to deliver exactly the right number of each component to downstream workstations in the manufacturing sequence just at the time when that component is needed. JIT is one of the pillars of lean production. The term applies not only to production operations but to supplier delivery operations as well. Just-in-time systems and lean production are discussed in Chapter 26.

23.2.2 CAD/CAM

CAD/CAM denotes the integration of design and manufacturing activities by means of computer systems. The method of manufacturing a product is a direct function of its design. With conventional procedures practiced for so many years in industry, engineering drawings were prepared by design draftsmen and later used by manufacturing engineers to develop the process plan. The activities involved in designing the product were separated from the activities associated with process planning. Essentially a two-step procedure was used, which was time-consuming and duplicated the efforts of design and manufacturing personnel. CAD/CAM establishes a direct link between product design and manufacturing engineering. It is the goal of CAD/CAM not only to automate certain phases of design and certain phases of manufacturing, but also to automate the transition from design to manufacturing. In the ideal CAD/CAM system, it is possible to take the design specification of the product as it resides in the CAD database and convert it automatically into a process plan for making the product. Much of the processing might be accomplished on a numerically controlled machine tool. As part of the process plan, the NC part program is generated automatically by the CAD/CAM system, which downloads the program directly to the machine tool. Hence, under this arrangement, product design, NC programming, and physical production are all implemented by computer.

23.2.3 Computer-Integrated Manufacturing

Computer-integrated manufacturing includes all of the engineering functions of CAD/CAM, but it also includes the firm's business functions that are related to manufacturing. The ideal CIM system applies computer and communications technology to all the operational functions and information-processing functions in manufacturing from order receipt through design and production to product shipment. The scope of CIM, compared with the more limited scope of CAD/CAM, is depicted in Figure 23.5. Also shown are the components of CAD, CAM, and the business functions.

The CIM concept is that all of the firm's operations related to production are incorporated in an integrated computer system to assist, augment, and automate the operations. The computer system is pervasive throughout the firm, touching all activities that support manufacturing. In this integrated computer system, the output of one activity serves as the input to the next activity, through the chain of events that starts with the sales order and culminates with shipment of the product. Customer orders are initially entered by the company's salesforce or directly by the customer into a computerized order entry system. The orders contain the specifications describing the product. The specifications serve as the input to the product design department. New products are designed on a CAD system. The components that comprise the product are designed, the bill of materials is compiled, and assembly drawings are prepared. The output of the design department serves as the input to manufacturing engineering, where process planning, tool design, and similar activities are accomplished to prepare for production. Process planning is performed using CAPP. Tool and fixture design is done on a CAD system, making use of the product model generated during product design. The output from manufacturing engineering provides the input to production planning and control, where material requirements planning and scheduling are performed using the computer system, and so it goes, through each step in the manufacturing cycle. Full implementation of CIM results

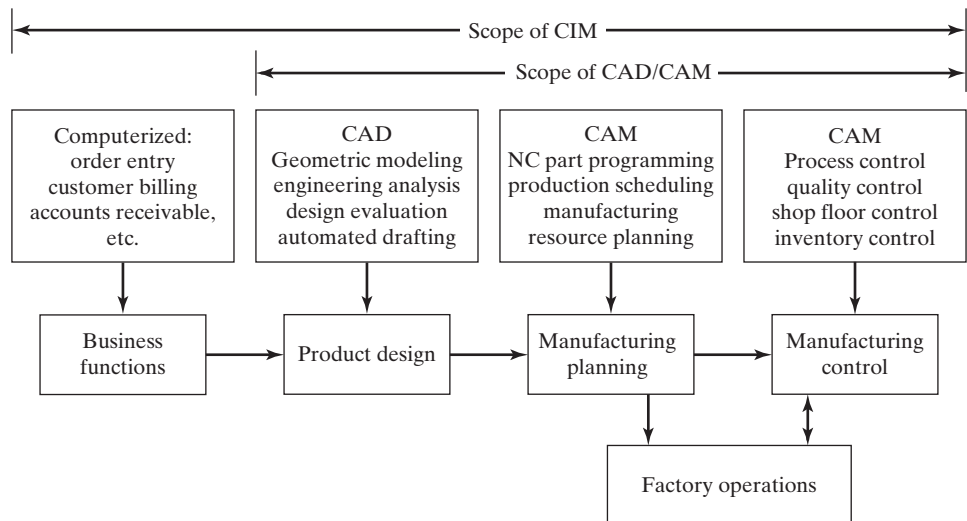


Figure 23.5 The scope of CAD/CAM and CIM, and the computerized elements of a CIM system.

in the automation of the information flow through every aspect of the company's manufacturing organization. Section 25.6.2 describes enterprise resource planning (ERP), which refers to a software system that integrates the data and operations of a company through a central database. In effect, ERP implements computer-integrated manufacturing. It also includes all of the business functions of the organization that are not related to manufacturing, such as accounting, finance, and human resources.

23.3 QUALITY FUNCTION DEPLOYMENT

A number of concepts and techniques have been developed to aid in the product design function. For example, several of the principles and methods of Taguchi can be applied to product design, such as "robust design" and the "Taguchi loss function" (Section 20.6). The topics of concurrent engineering and design for manufacturing are also related closely to design. They are discussed in the following chapter (Section 24.3) because they also relate to manufacturing engineering and process planning. The present section covers a method called *quality function deployment* that has gained acceptance in the product design community as a systematic approach for organizing and managing a given design project.

Quality function deployment (QFD) sounds like a quality-related technique, and the scope of QFD certainly includes quality. However, its principal focus is product design. The objective of QFD is to design products that will satisfy or exceed customer requirements. Of course, any product design project has this objective, but the approach is often informal and unsystematic. QFD, developed in Japan in the mid 1960s, uses a formal and structured approach. *Quality function deployment* is a systematic procedure for defining customer desires and requirements and interpreting them in terms of product features, process requirements, and quality characteristics. The technique is outlined in Figure 23.6. In a QFD analysis, a series of interconnected matrices are developed to establish the relationships between customer requirements and the technical features of a proposed new product. The matrices represent a progression of phases in the QFD analysis, in which customer requirements are first translated into product features, then into manufacturing process requirements, and finally into quality procedures for controlling the manufacturing operations.

It should be noted that QFD can be applied to analyze the delivery of a service as well as the design and manufacture of a product. It can be used to analyze an existing

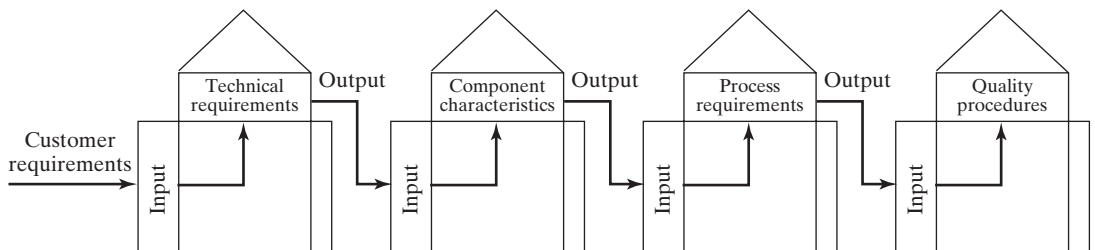


Figure 23.6 Quality function deployment, shown here as a series of matrices that relate customer requirements to successive technical requirements in a typical progression: (1) customer requirements to technical requirements of the product, (2) technical requirements of the product to component characteristics, (3) component characteristics to process requirements, and (4) process requirements to quality procedures.

product or service, not just a proposed new one. The matrices may take on different meanings depending on the product or service being analyzed. And the number of matrices used in the analysis may also vary, from as few as one (although a single matrix does not fully exploit the potential of QFD) to as many as 30 [3]. QFD is a general framework for analyzing product and process design problems, and it must be adapted to and customized for the given problem context.

Each matrix in QFD is similar in format and consists of six sections, as shown in Figure 23.7. On the left-hand side is section 1, a list of input requirements that serve as drivers for the current matrix of the QFD analysis. In the first matrix, these inputs are the needs and desires of the customer. The input requirements are translated into output technical requirements, listed in section 2 of the matrix. These technical requirements indicate how the input requirements are to be satisfied in the new product or service. In the starting matrix, they represent the product's technical features or capabilities. The output requirements in the present matrix serve as the input requirements for the next matrix, through to the final matrix in the QFD analysis.

At the top of the matrix is section 3, which depicts technical correlations among the output technical requirements. This section of the matrix uses a diagonal grid to allow each of the output requirements to be compared with all others. The shape of the grid is similar to the roof of a house, and for this reason the term *house of quality* is often used to describe the overall matrix. This term is applied only to the starting matrix in QFD by some authors [3], and the technical correlation section (the roof of the house) may be omitted in subsequent matrices in the analysis. Section 4 is called the relationship matrix; it indicates the relationships between inputs and outputs. Various symbols have been used to define the relationships among pairs of factors in sections 3 and 4 [1], [3], [11]. These symbols are subsequently reduced to numerical values.

On the right-hand side of the matrix is section 5, which is used for comparative evaluation of inputs. For example, in the starting matrix, this might be used to compare the

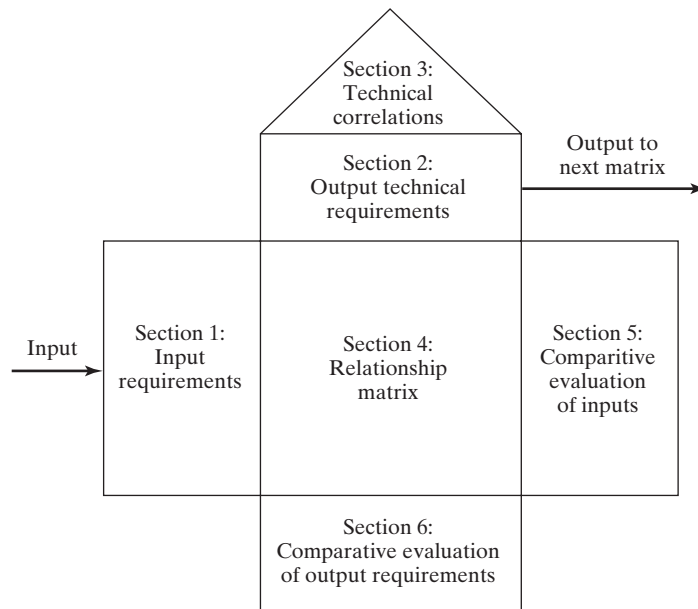


Figure 23.7 General form of each matrix in QFD, known as the *house of quality* in the starting matrix because of its shape.

proposed new product with competing products already on the market. Finally, at the bottom of the matrix is section 6, used for comparative evaluation of output requirements. The six sections may take on slightly different interpretations for the different matrices of QFD and for different products or services, but the descriptions used here are adequate as generalities.

The analysis begins with the house of quality, in which customer requirements and needs are translated into product technical requirements. The procedure can be outlined in the following steps:

1. *Identify customer requirements.* Often referred to as the “voice of the customer,” this is the primary input in QFD (section 1 in Figure 23.7). Capturing the customer’s needs, desires, and requirements is most critical in the analysis. It is accomplished using a variety of possible methods, several of which are listed in Table 23.1. Selecting the most appropriate data collection method depends on the product or service situation. In many cases, more than one approach is necessary to identify the full scope of the customer’s needs.
2. *Identify product features needed to meet customer requirements.* These are the technical requirements of the product (section 2 in Figure 23.7) corresponding to the requirements and desires expressed by the customer. In effect, these product features are the means by which the voice of the customer is satisfied. Mapping customer requirements into product features often requires ingenuity, sometimes demanding the creation of new features not previously available on competing products.
3. *Determine technical correlations among product features.* This is section 3 in Figure 23.7. The various product features will likely be related to each other. The purpose of this chart is to establish the strength of each of the relationships between pairs of product features. Instead of using symbols, as previously indicated, the numerical ratings shown in Table 23.2 will be adopted for the illustrations. These numerical scores indicate how significant (how strong) the relationships between respective pairs of requirements are.

TABLE 23.1 Methods of Capturing Customer Requirements

Comment cards	These allow the customer to rate level of satisfaction of the product or service and to comment on features that were either appreciated or not appreciated. Comment cards are often provided to the customer simultaneously with the product or service. They can also be made a part of product warranty registration.
Customer returns	When the customer returns the product, an associate gathers information about the reason for the return.
Field intelligence	This involves collection of second-hand information from employees who deal directly with customers.
Focus groups	Several customers or potential customers serve on a panel. Group dynamics may elicit opinions and observations that would be omitted in one-on-one interviews.
Formal surveys	These are often accomplished by mass mailings. Unfortunately, the response rate is often low.
Internet	This is a relatively new way of gathering customer opinions. Subject-oriented interest groups, some of which are companies and products, can be queried to obtain useful information on the needs and desires of potential customers.
Interviews	One-on-one interviews, either in person or by telephone.
Study of complaints	This allows a statistical review of data on customer complaints.

Source: Compiled from Evans and Lindsay [4], Finch [5], Goetsch and Davis [7], and other sources.

TABLE 23.2 Numerical Scores Used For Correlations and Evaluations in Sections 3, 4, 5, and 6 of the QFD Matrix

Numerical Score	Strength of Relationship in Sections 3 and 4	Relative Importance in Section 5	Merits of Competing Product in Sections 5 and 6
0	No relationship	No importance	Not applicable
1	Weak relationship	Little importance	Low score
3	Medium-to-strong relationship	Medium importance	Medium score
5	Very strong relationship	Very important	High score

4. *Develop relationship matrix between customer requirements and product features.* The function of the relationship matrix in the QFD analysis is to show how well the collection of product features is fulfilling individual customer requirements. Identified as section 4 in Figure 23.7, the matrix indicates the relationship between individual factors in the two lists. The numerical scores in Table 23.2 depict relationship strength.
5. *Comparative evaluation of input customer requirements.* Section 5 of the house of quality matches two comparisons. First, the relative importance of each customer requirement is evaluated using a numerical scoring scheme. High values indicate that the customer requirement is important. Low values indicate a low priority. This evaluation can be used to guide the design of the proposed new product. Second, existing competitive products are evaluated relative to customer requirements. This helps to identify possible weaknesses or strengths in competing products that might be emphasized in the new design. A numerical scoring scheme might be used as before. (See Table 23.2.)
6. *Comparative evaluation of output technical requirements.* This is section 6 in Figure 23.7. In this part of the analysis, each competing product is scored relative to the output technical requirements. Finally, target values can be established in each technical requirement for the proposed new product.

At this point in the analysis, the completed matrix contains much information about which customer requirements are most important, how they relate to proposed new product features, and how competitive products compare with respect to these input and output requirements. All of this information must be assimilated and assessed in order to advance to the next step in the QFD analysis. Those customer needs and product features that are most important must be stressed as the analysis proceeds through identification of technical requirements for components, manufacturing processes, and quality control in the succeeding QFD matrices.

EXAMPLE 23.1 Quality Function Deployment: House of Quality

A new product design project is just getting started. It deals with a toy for children aged 3 to 9 that could be used in a bathtub or on the floor. It is desired to construct the house of quality for such a toy (the initial matrix in QFD), first listing the customer requirements that might be obtained from one or more of the methods listed in Table 23.1. The corresponding technical features of the product will then be identified, and the various correlations will be developed.

Solution: The first phase of the QFD analysis (the house of quality) is developed in Figure 23.8. Following the steps in the procedure generates the list of customer requirements in step 1 of Figure 23.8. Step 2 lists the corresponding technical features of the product that might be derived from these customer inputs. Step 3 presents the correlations among product features, and step 4 fills in the relationship matrix between customer requirements and product features. Step 5 indicates a possible comparative evaluation of customer requirements, and step 6 provides a hypothetical evaluation of competing products for the technical requirements.

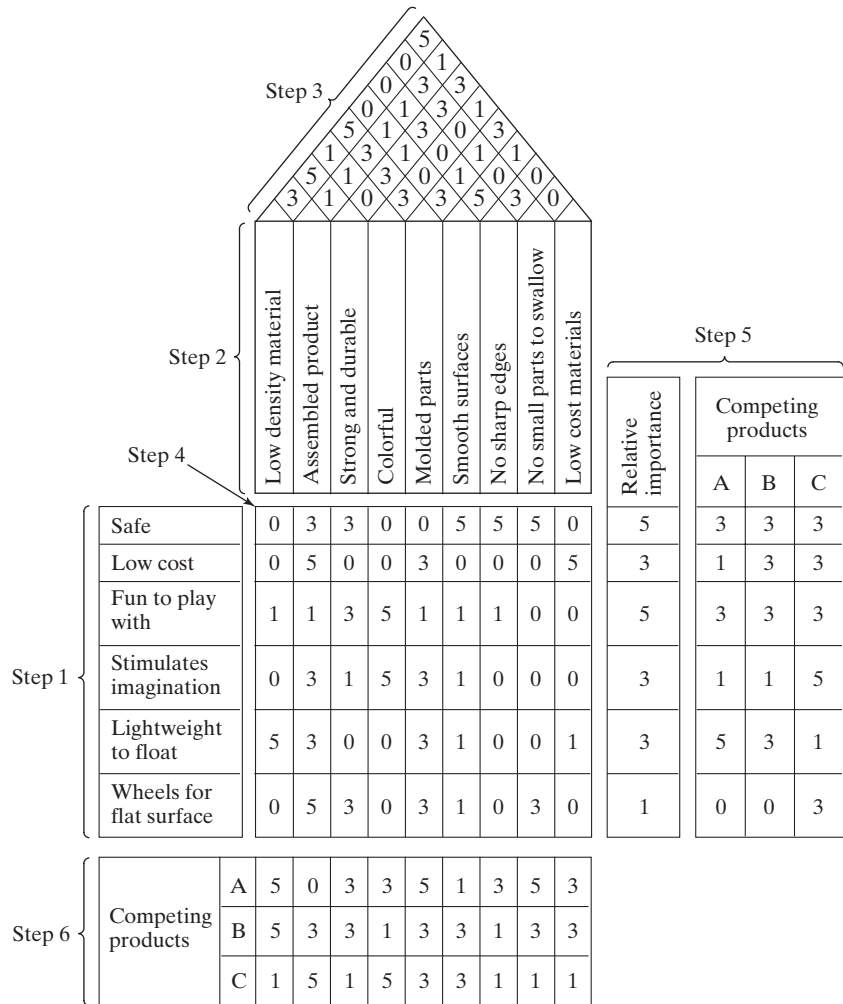


Figure 23.8 The house of quality for Example 23.1.

REFERENCES

- [1] AKAO, Y., Author and editor-in-chief, *Quality Function Deployment: Integrating Customer Requirements into Product Design*, English translation by G. H. Mazur, Productivity Press, Cambridge, MA, 1990.

- [2] BAKERJIAN, R., and P. MITCHELL, *Tool and Manufacturing Engineers Handbook*, 4th ed., Volume VI, *Design for Manufacturability*, Society of Manufacturing Engineers, Dearborn, MI, 1992.
- [3] COHEN, L., *Quality Function Deployment*, Addison-Wesley Publishing Company, Reading, MA, 1995.
- [4] EVANS, J. R., and W. M. LINDSAY, *The Management and Control of Quality*, 8th ed., West Publishing Company, St. Paul, MN, 2010.
- [5] FINCH, B. J., “A New Way to Listen to the Customer,” *Quality Progress*, May 1997, pp. 73–76.
- [6] GIBSON, I., D. W. ROSEN, and B. STUCKER, *Additive Manufacturing Technologies*, Springer, New York, 2010.
- [7] GOETSCH, D. L., and S. B. DAVIS, *Quality Management for Organizational Excellence: Introduction to Total Quality*, 7th ed., Pearson, Upper Saddle River, NJ, 2012.
- [8] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [9] GROOVER, M. P., *Work Systems and the Methods, Measurement, and Management of Work*, Pearson/Prentice Hall, Upper Saddle River, NJ, 2007.
- [10] GROOVER, M. P., and E. W. ZIMMERS, Jr., *CAD/CAM: Computer Aided Design and Manufacturing*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1984.
- [11] JURAN, J. M., and F. M. GRYNA, *Quality Planning and Analysis*, 3rd ed., McGraw-Hill, Inc., New York, 1993.
- [12] LEE, K., *Principles of CAD/CAM/CAE Systems*, Addison Wesley, Reading MA, 1999.
- [13] SHIGLEY, J. E., *Mechanical Engineering Design*, 4th ed., McGraw-Hill Book Company, New York, 1983.
- [14] THILMANY, J., “Design with Depth,” *Mechanical Engineering*, December 2005, pp. 32–34.
- [15] THILMANY, J., “Pros and Cons of CAD,” *Mechanical Engineering*, September 2006, pp. 38–40.
- [16] USHER, J. M., U. ROY, and H. R. PARSAEI, Editors, *Integrated Product and Process Development*, John Wiley & Sons, Inc., New York, 1998.
- [17] www.Autodesk.com
- [18] www.wikipedia.org/wiki/AutoCAD
- [19] www.wikipedia.org/wiki/Computer_aided_design
- [20] www.wikipedia.org/wiki/Product_data_management
- [21] www.wikipedia.org/wiki/Product_lifecycle_management

REVIEW QUESTIONS

- 23.1 What are manufacturing support systems?
- 23.2 What are the six phases of the general design process?
- 23.3 What is computer-aided design?
- 23.4 Name some of the benefits of using a CAD system to support the engineering design function.
- 23.5 Give some examples of engineering analysis software in common use on CAD systems.
- 23.6 What is rapid prototyping?
- 23.7 What is virtual prototyping?
- 23.8 What is a product data management system?
- 23.9 What is computer-aided manufacturing?
- 23.10 Name some of the important applications of CAM in manufacturing planning.
- 23.11 What is the difference between CAD/CAM and CIM?
- 23.12 What is quality function deployment?

Process Planning and Concurrent Engineering

CHAPTER CONTENTS

- 24.1 Process Planning
 - 24.1.1 Process Planning for Parts
 - 24.1.2 Process Planning for Assemblies
 - 24.1.3 Make or Buy Decision
- 24.2 Computer-Aided Process Planning
 - 24.2.1 Retrieval CAPP Systems
 - 24.2.2 Generative CAPP Systems
- 24.3 Concurrent Engineering and Design for Manufacturing
 - 24.3.1 Design for Manufacturing and Assembly
 - 24.3.2 Other Concurrent Engineering Objectives
- 24.4 Advanced Manufacturing Planning

The product design is the plan for the product and its components and subassemblies. A manufacturing plan is needed to convert the product design into a physical entity. The activity of developing such a plan is called *process planning*. It is the bridge between product design and manufacturing. Process planning involves determining the sequence of processing and assembly steps that must be accomplished to make the product. In the present chapter, process planning and several related topics are examined.

At the outset, a distinction should be made between process planning and production planning, which is covered in the following chapter. Process planning is concerned with the technical details: the engineering and technological issues of how to make the product and its parts. What types of equipment and tooling are required to fabricate the

parts and assemble the product? Production planning is concerned with the logistics issues of making the product: ordering the materials and obtaining the resources required to make the product in sufficient quantities to satisfy demand.

24.1 PROCESS PLANNING

Process planning consists of determining the most appropriate manufacturing and assembly processes and the sequence in which they should be accomplished to produce a given part or product according to specifications set forth in the product design documentation. The scope and variety of processes that can be planned are generally limited by the available processing equipment and technological capabilities of the company or plant. Parts that cannot be made internally must be purchased from outside vendors. The choice of processes is also limited by the details of the product design, as discussed in Section 24.3.1.

Process planning is usually accomplished by manufacturing engineers (other titles include industrial engineers, production engineers, and process engineers). They must be familiar with the particular manufacturing processes available in the factory and be able to interpret engineering drawings. Based on the planner's knowledge, skill, and experience, the processing steps are developed in the most logical sequence to make each part. Following is a list of the many decisions and details usually included within the scope of process planning [8], [10]:

- *Interpretation of design drawings.* First, the planner must analyze the part or product design (materials, dimensions, tolerances, surface finishes, etc.).
- *Choice of processes and sequence.* The process planner must select which processes and their sequence are required, and prepare a brief description of all processing steps.
- *Choice of equipment.* In general, process planners must develop plans that utilize existing equipment in the plant. Otherwise, the company must purchase the component or invest in new equipment.
- *Choice of tools, dies, molds, fixtures, and gages.* The process planner must decide what tooling is required for each processing step. The actual design and fabrication of these tools is usually delegated to a tool design department and tool room, or an outside vendor specializing in that type of tooling.
- *Analysis of methods.* Workplace layout, small tools, hoists for lifting heavy parts, even in some cases hand and body motions must be specified for manual operations. The industrial engineering department is usually responsible for this area.
- *Setting of work standards.* Work measurement techniques are used to set time standards for each operation.
- *Choice of cutting tools and cutting conditions.* These must be specified for machining operations, often with reference to standard handbook recommendations. Similar decisions about process and equipment settings must be made for processes other than machining.

24.1.1 Process Planning for Parts

For individual parts, the processing sequence is documented on a form called a *route sheet* (some companies call it an *operation sheet*). Just as engineering drawings are used to specify the product design, route sheets are used to specify the process plan. They are counterparts, one for product design, the other for manufacturing. A typical route

Route Sheet		XYZ Machine Shop, Inc.				
Part no. 081099	Part name Shaft, generator	Planner MPGroover	Checked by: N. Needed	Date 08/12/XX	Page 1/1	
Material 1050 H18 Al	Stock size 60 mm diam., 206 mm length	Comments:				
No.	Operation description	Dept	Machine	Tooling	Setup	Std.
10	Face end (approx. 3 mm). Rough turn to 52.00 mm diam. Finish turn to 50.00 mm diam. Face and turn shoulder to 42.00 mm diam. and 15.00 mm length.	Lathe	L45	G0810	1.0 hr	5.2 min
20	Reverse end. Face end to 200.00 mm length. Rough turn to 52.00 mm diam. Finish turn to 50.00 mm diam.	Lathe	L45	G0810	0.7 hr	3.0 min
30	Drill 4 radial holes 7.50 mm diam.	Drill	D09	J555	0.5 hr	3.2 min
40	Mill 6.5 mm deep x 5.00 mm wide slot.	Mill	M32	F662	0.7 hr	6.2 min
50	Mill 10.00 mm wide flat, opposite side.	Mill	M13	F630	1.5 hr	4.8 min

Figure 24.1 Typical route sheet for specifying the process plan.

sheet, illustrated in Figure 24.1, includes the following information: (1) all operations to be performed on the work part, listed in the order in which they should be performed; (2) a brief description of each operation indicating the processing to be accomplished, with references to dimensions and tolerances on the part drawing; (3) the specific machines on which the work is to be done; and (4) any special tooling, such as dies, molds, cutting tools, jigs or fixtures, and gages. Some companies also include setup times, cycle time standards, and other data. It is called a route sheet because the processing sequence defines the route that the part must follow in the factory.

Decisions on processes to fabricate a given part are based largely on the starting material for the part. This starting material is selected by the product designer. Once the material has been specified, the range of possible processing operations is reduced considerably. The product designer's decisions on starting material are based primarily on functional requirements, although economics and ease of manufacture also play a role in the selection.

A typical processing sequence to fabricate an individual part consists of (1) a basic process, (2) secondary processes, (3) property-enhancing operations, and (4) finishing operations. The sequence is shown in Figure 24.2. A **basic process** determines the starting geometry of the work part. Metal casting, plastic molding, and rolling of sheet metal are examples of basic processes. The starting geometry must often be refined by **secondary processes**, operations that transform the starting geometry into the final geometry (or close to the final geometry). The secondary processes that might be used are closely correlated to the basic process that provides the starting geometry. When sand casting is the basic process, machining operations are generally the secondary processes. When a rolling mill produces sheet metal, stamping operations such as punching and bending are the secondary processes. When plastic injection molding is the basic process, secondary operations are often unnecessary, because most of the geometric features that would otherwise require machining can be created by the molding operation. Plastic molding and

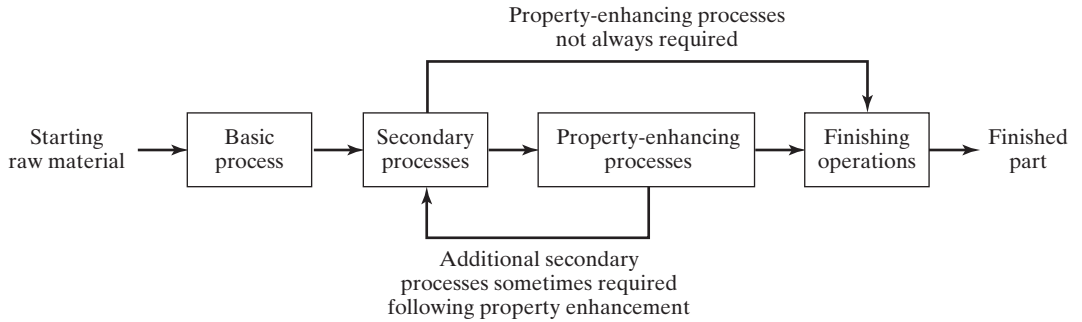


Figure 24.2 Typical sequence of processes required in part fabrication.

other operations that require no subsequent secondary processing are called *net shape processes*. Operations that require some minimal secondary processing, usually machining, are referred to as *near net shape processes*. Some impression die forgings are in this category. These parts can often be shaped in the forging operation (basic process) so that minimal machining (secondary processing) is required.

Once the geometry has been established, the next step for some parts is to improve their mechanical and physical properties. **Property-enhancing operations** do not alter the geometry of the part, only the physical properties; heat-treating operations on metal parts are the most common type. Similar heating treatments are performed on glass to produce tempered glass. For most manufactured parts, these property-enhancing operations are not required in the processing sequence, as indicated by the alternative arrow path in Figure 24.2.

Finally, **finishing operations** usually provide a coating on the work part (or assembly) surface; examples include electroplating, thin film deposition processes, and painting. The purpose of the coating is to enhance appearance, change color, or protect the surface from corrosion, abrasion, and other damage. Finishing operations are not required on many parts; for example, plastic moldings rarely require finishing. When finishing is required, it is usually the final step in the processing sequence.

Table 24.1 presents some typical processing sequences for common engineering materials used in manufacturing. In most cases, parts and materials arriving at the factory have completed their basic process. Thus, the first operation in the process plan follows the basic process that has provided the starting geometry of the part. For example, machined parts begin as bar stock or castings or forgings, which are purchased from outside vendors. The process plan begins with the machining operations in the company's own plant. Stampings begin as sheet metal coils or strips bought from the rolling mill. These raw materials are supplied from outside sources so that the secondary processes, property-enhancing operations, and finishing operations can be performed in the company's own factory.

A detailed description of each operation is filed in the particular production department office where the operation is performed. It lists specific details of the operation, such as cutting conditions and tooling (if the operation is machining) and other instructions that may be useful to the machine operator. Sketches of the machine setup are often included with the description ("a picture is worth a thousand words"). Lean production, specifically the Toyota Production System, emphasizes the use of drawings and illustrations as communication aids (Section 26.4.2).

TABLE 24.1 Some Typical Process Sequences

Basic Process (Material Form)	Secondary Processes (Final Shape)	Property-enhancing Process	Finishing Process
Sand casting (sand casting)	Machining (machined part)	Optional	Painting
Die casting (die casting)	Net shape (die casting)	Optional	Painting
Casting of glass (glass ingot)	Pressing, blow molding (glassware)	Heat treatment	None
Injection molding (molded part)	Net shape (plastic molding)	None	None
Rolling (sheet metal)	Blanking, punching, bending, forming (stamping)	None	Plating
Rolling (sheet metal)	Deep drawing (stamping)	None	Plating
Forging (forging)	Machining (machined part)	None	Painting
Bar drawing (bar stock)	Machining, grinding (machined part)	Heat treatment	Plating
Extrusion of aluminum (extrudate)	Cutoff (extruded part)	None	Anodizing
Atomize (metal powders)	Press (PM part)	Sinter	Paint
Comminution (ceramic powders)	Press (ceramic ware)	Sinter	Glaze
Ingot pulling (silicon boule)	Sawing and grinding (silicon wafer)	None	Cleaning
Sawing and grinding (silicon wafer)	Oxidation, CVD, PVD, etching (inte- grated circuits)	None	Coating

24.1.2 Process Planning for Assemblies

The type of assembly method used for a given product depends on factors such as (1) the anticipated production quantities; (2) complexity of the assembled product, for example, the number of distinct components; and (3) assembly processes used, for example, mechanical assembly versus welding. For a product that is to be made in relatively small quantities, assembly is generally accomplished at individual workstations where one worker or a team of workers perform all of the assembly tasks. For complex products made in medium and high quantities, assembly is usually performed on manual assembly lines (Chapter 15). For simple products of a dozen or so components, to be made in large quantities, automated assembly systems may be appropriate. In any case, there is a precedence order in which the work must be accomplished, an example of which is shown in Table 15.4. The precedence requirements are sometimes portrayed graphically on a precedence diagram, as in Figure 15.5.

Process planning for assembly involves development of assembly instructions similar to the list of work elements in Table 15.4, but in more detail. For high production on an assembly line, process planning consists of allocating work elements to the individual stations of the line, a procedure called *line balancing* (Section 15.2.3). As in process planning for individual components, any tools and fixtures required to accomplish an assembly task must be determined, designed, and built, and the workstation arrangement must be laid out.

24.1.3 Make or Buy Decision

An important question that arises in process planning is whether a given part should be produced in the company's own factory or purchased from an outside vendor. If the company does not possess the equipment or expertise in the particular manufacturing processes required to make the part, then the answer is obvious: The part must be purchased because there is no internal alternative. However, in many cases, the part could either be

made internally using existing equipment or purchased externally from a vendor that possesses similar manufacturing capability.

In discussing the make or buy decision, it should be recognized at the outset that nearly all manufacturers buy their raw materials from suppliers. A machine shop purchases its starting bar stock from a metals distributor and its sand castings from a foundry. A plastic molding plant buys its molding compound from a chemical company. A stamping plant purchases sheet metal either from a distributor or rolling mill. Very few companies are vertically integrated in their production operations all the way from raw materials to finished product. Given that a manufacturing company purchases some of its starting materials, it seems reasonable for the company to consider purchasing at least some of the parts that would otherwise be produced in its own plant. It is probably appropriate to ask the make or buy question for every component that is used by the company.

A number of factors enter into the make or buy decision. A list of the factors and issues that affect the decision is compiled in Table 24.2. Cost is usually the most important factor in determining whether to produce the part or purchase it. If an outside vendor is more proficient than the company's own plant in the manufacturing processes used to make the part, then the internal production cost is likely to be greater than the purchase price even after the vendor has included a profit. However, if the decision to purchase results in idle equipment and labor in the company's own plant, then the apparent advantage of purchasing the part may be lost. Consider the following example.

TABLE 24.2 Factors in the Make or Buy Decision

Factor	Explanation and Effect on Make/Buy Decision
How do part costs compare?	This must be considered the most important factor in the make or buy decision. However, the cost comparison is not always clear, as Example 24.1 illustrates.
Is the process available in-house?	If the equipment and technical expertise for a given process are not available internally, then purchasing is the obvious decision. Vendors usually become very proficient in certain processes, which often makes them cost competitive in external-internal comparisons. However, there may be long-term cost implications for the company if it does not develop technological expertise in certain processes that are important for the types of products it makes.
What is the total production quantity and anticipated product life?	As the total number of units required over the life of the product increases, this tends to favor the make decision. Lower quantities favor the buy decision. Longer product life tends to favor the make decision.
Is the component a standard item?	Standard catalog items (e.g., hardware items such as bolts, screws, nuts, and other commodity items) are produced economically by suppliers specializing in those products. Cost comparisons almost always favor a purchase decision on these standard parts.
Is the supplier reliable?	A vendor that misses a delivery on a critical component can cause a shut-down at the company's final assembly plant. Suppliers with proven delivery and quality records are favored over suppliers with lesser records.
Is the company's plant already operating at full capacity?	In peak demand periods, the company may be forced to augment its own plant capacity by purchasing a portion of the required production from outside vendors.
Does the company need an alternative supply source?	Companies sometimes purchase parts from outside vendors to maintain an alternative source to their own production plants. This is an attempt to ensure an uninterrupted supply of parts, for example, as a safeguard against a wildcat strike at the company's parts production plant.

Source: Based on Groover [8] and other sources.

EXAMPLE 24.1 Make or Buy Cost Decision

The quoted price for a certain part is \$20.00 per unit for 100 units. The part can be produced in the company's own plant for \$28.00. The cost components of making the part are as follows:

Unit raw material cost	= \$8.00 per unit
Direct labor cost	= \$6.00 per unit
Labor overhead at 150%	= \$9.00 per unit
Equipment fixed cost	= \$5.00 per unit
Total	= \$28.00 per unit

Should the part be bought or made in-house?

Solution: Although the vendor's quote seems to favor a buy decision, consider the possible impact on plant operations if the quote is accepted. Equipment fixed cost of \$5.00 is an allocated cost based on an investment that was already made. If the equipment designated for this job is not utilized because of a decision to purchase the part, then the fixed cost continues even if the equipment stands idle. In the same way, the labor overhead cost of \$9.00 consists of factory space, utility, and labor costs that remain even if the part is purchased. In addition, there are the costs of purchasing and receiving inspection. By this reasoning, a buy decision is not a good decision because it might cost the company $\$20.00 + \$5.00 + \$9.00 = \34.00 per unit (not including purchasing and receiving inspection) if it results in idle time on the machine that would have been used to produce the part. On the other hand, if the equipment in question can be used to produce other parts for which the in-house costs are less than the corresponding outside quotes, then a buy decision is a good decision. □

Make or buy decisions are not often as straightforward as in this example. Other factors listed in Table 24.2 also affect the decision. A trend in recent years, especially in the automobile industry, is for companies to stress the importance of building close relationships with parts suppliers.

24.2 COMPUTER-AIDED PROCESS PLANNING

Problems arise when process planning is accomplished manually. Different process planners have different experiences, skills, and knowledge of the available processes in the plant. This means that the process plan for a given part depends on the process planner who developed it. A different planner would likely plan the routing differently. This leads to variations and inconsistencies in the process plans in the plant. Another problem is that the shop-trained people who are familiar with the details of machining and other processes are gradually retiring and will be unavailable in the future to do process planning. As a result of these issues, manufacturing firms are interested in automating the task of process planning using computer-aided process planning (CAPP). The benefits derived from CAPP include the following:

- *Process rationalization and standardization.* Automated process planning leads to more logical and consistent process plans than manual process planning. Standard plans tend to result in lower manufacturing costs and higher product quality.
- *Increased productivity of process planners.* The systematic approach and the availability of standard process plans in the data files permit more work to be accomplished by the process planners.
- *Reduced lead time for process planning.* Process planners working with a CAPP system can provide route sheets in a shorter lead time compared to manual preparation.
- *Improved legibility.* Computer-prepared route sheets are neater and easier to read than manually prepared route sheets.
- *Incorporation of other application programs.* The CAPP program can be interfaced with other application programs, such as cost estimation and work standards.

Computer-aided process planning systems are designed around two approaches: (1) retrieval CAPP systems and (2) generative CAPP systems. Some CAPP systems combine the two approaches in what is known as semi-generative CAPP [10].

24.2.1 Retrieval CAPP Systems

A retrieval CAPP system, also called a *variant CAPP system*, is based on the principles of group technology (GT) and parts classification and coding (Chapter 18). In this form of CAPP, a standard process plan (route sheet) is stored in computer files for each part code number. The standard route sheets are based on current part routings in use in the factory or on an ideal process plan that has been prepared for each family. Developing a database of these process plans requires substantial effort.

A retrieval CAPP system operates as illustrated in Figure 24.3. Before the system can be used for process planning, a significant amount of information must be compiled and entered into the CAPP data files. This is what Chang et al. refer to as the *preparatory phase* [3], [4]. It consists of (1) selecting an appropriate classification and coding scheme for the company, (2) forming part families for the parts produced by the company, and (3) preparing standard process plans for the part families. Steps (2) and (3) are ongoing as new parts are designed and added to the company's design database.

After the preparatory phase has been completed, the system is ready for use. For a new component for which the process plan is to be determined, the first step is to derive the GT code number for the part. With this code number, the user searches the part family file to determine if a standard route sheet exists for the given part code. If the file contains a process plan for the part, it is retrieved (hence, the word "retrieval" for this CAPP system) and displayed for the user. The standard process plan is examined to determine whether any modifications are necessary. It might be that although the new part has the same code number, there are minor differences in the processes required to make it. The user edits the standard plan accordingly. This capacity to alter an existing process plan is what gives the retrieval system its alternative name, "variant" CAPP system.

If the file does not contain a standard process plan for the given code number, the user may search the computer file for a similar or related code number for which a standard route sheet does exist. Either by editing an existing process plan or by starting from scratch, the user prepares the route sheet for the new part. This route sheet becomes the standard process plan for the new part code number.

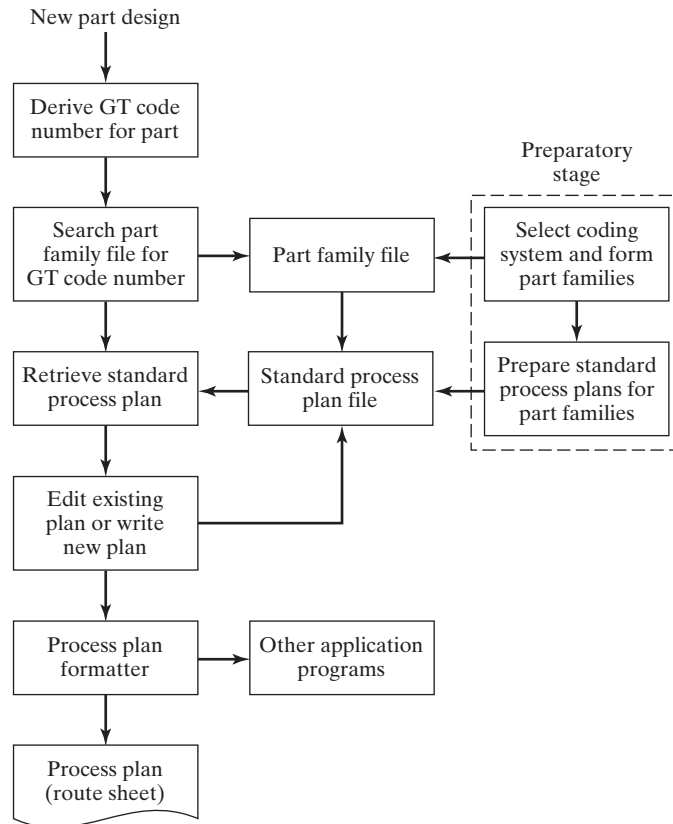


Figure 24.3 General procedure for using one of the retrieval CAPP systems.

The process planning session concludes with the process plan formatter, which prints out the route sheet in the proper format. The formatter may call other application programs into use, for example, to determine machining conditions for the various machine tool operations in the sequence, to calculate standard times for the operations (e.g., for direct labor incentives), or to compute cost estimates for the operations.

24.2.2 Generative CAPP Systems

Generative CAPP systems represent an alternative approach to automated process planning. Instead of retrieving and editing an existing plan contained in a computer database, a generative system creates the process plan based on logical procedures similar to those used by a human planner. In a fully generative CAPP system, the process sequence is planned without human assistance and without a set of predefined standard plans.

Designing a generative CAPP system is usually considered part of the field of expert systems, a branch of artificial intelligence. An *expert system* is a computer program that is capable of solving complex problems that normally can only be solved by a human with years of education and experience. Process planning fits within the scope of this definition.

There are several necessary ingredients in a fully generative process planning system. First, the technical knowledge of manufacturing and the logic used by successful process planners must be captured and coded into a computer program. In an expert system applied to process planning, the knowledge and logic of the human process planners is incorporated into a so-called *knowledge base*. The generative CAPP system then uses that knowledge base to solve process planning problems (i.e., create route sheets).

The second ingredient in generative process planning is a computer-compatible description of the part to be produced. This description contains all of the pertinent data and information needed to plan the process sequence. Two possible ways of providing this description are (1) the geometric model of the part that is developed on a CAD system during product design and (2) a GT code number of the part that defines the part features in significant detail.

The third ingredient in a generative CAPP system is the capability to apply the process knowledge and planning logic contained in the knowledge base to a given part description. In other words, the CAPP system uses its knowledge base to solve a specific problem—planning the process for a new part. This problem-solving procedure is referred to as the *inference engine* in the terminology of expert systems. By using its knowledge base and inference engine, the CAPP system synthesizes a new process plan from scratch for each new part it is presented.

24.3 CONCURRENT ENGINEERING AND DESIGN FOR MANUFACTURING

Concurrent engineering is an approach used in product development in which the functions of design engineering, manufacturing engineering, and other departments are integrated to reduce the elapsed time required to bring a new product to market. In the traditional approach to launching a new product, the two functions of design engineering and manufacturing engineering tend to be separated and sequential, as illustrated in Figure 24.4(a). The product design department develops the new design, sometimes without much consideration given to the manufacturing capabilities of the company. There is little opportunity for manufacturing engineers to offer advice on how the design might be altered to make it more manufacturable. It is as if a wall exists between design and manufacturing. When the design engineering department completes the design, it tosses the drawings and specifications over the wall, and only then does process planning begin.

By contrast, in a company that practices concurrent engineering, the manufacturing engineering department becomes involved in the product development cycle early on, providing advice on how the product and its components can be designed to facilitate manufacture and assembly. It also proceeds with the early stages of manufacturing planning for the product. This concurrent engineering approach is pictured in Figure 24.4(b). The product development cycle also involves quality engineering, the manufacturing departments, field service, vendors supplying critical components, and in some cases the customers who will use the product. All of these groups can make contributions during product development to improve not only the new product's function and performance, but also its produceability, inspectability, testability, serviceability, and maintainability. Through early involvement, as opposed to reviewing the final product design after it is too late to conveniently make any changes, the duration of the product development cycle is substantially reduced.

Concurrent engineering includes several elements: (1) design for manufacturing and assembly, (2) design for quality, (3) design for cost, and (4) design for life cycle. In addition, certain enabling technologies such as rapid prototyping, virtual prototyping, and organizational changes are required to facilitate the concurrent engineering approach in a company.

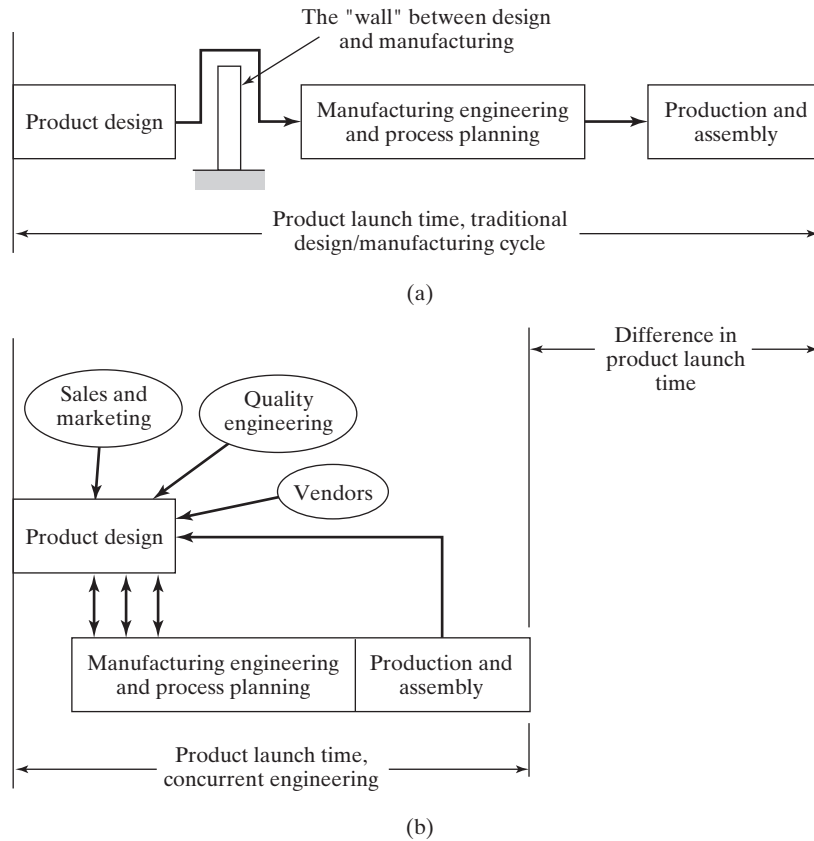


Figure 24.4 (a) Traditional product development cycle and (b) product development using concurrent engineering.

24.3.1 Design for Manufacturing and Assembly

It has been estimated that about 70% of the life cycle cost of a product is determined by basic decisions made during product design [12]. These design decisions include the choice of part material, part geometry, tolerances, surface finish, how parts are organized into subassemblies, and the assembly methods to be used. Once these decisions are made, the potential to reduce the manufacturing cost of the product is limited. For example, if the product designer decides that a part is to be made of an aluminum sand casting but the part possesses features that can be achieved only by machining (such as threaded holes and close tolerances), the manufacturing engineer has no alternative except to plan a process sequence that starts with sand casting followed by the sequence of machining operations needed to achieve the specified features. In this example, a better decision might be to use a plastic molded part that can be made in a single step. It is important for the manufacturing engineer to have the opportunity to advise the design engineer as the product design is evolving, to favorably influence the manufacturability of the product.

Terms used to describe such attempts to favorably influence the manufacturability of a new product are *design for manufacturing* (DFM) and *design for assembly* (DFA). Of course, DFM and DFA are inextricably linked, so the term *design for manufacturing and*

assembly (DFM/A) is used here. It involves the systematic consideration of manufacturability and assemblability in the development of a new product design. This includes (1) organizational changes and (2) design principles and guidelines.

Organizational Changes in DFM/A. Effective implementation of DFM/A involves making changes in a company's organizational structure, either formally or informally, so that closer interaction and better communication occurs between design and manufacturing personnel. This can be accomplished in several ways: (1) by creating project teams consisting of product designers, manufacturing engineers, and other specialties (e.g., quality engineers, material scientists) to develop the new product design; (2) by requiring design engineers to spend some career time in manufacturing to witness first-hand how manufacturability and assemblability are impacted by a product's design; and (3) by assigning manufacturing engineers to the product design department on either a temporary or full-time basis to serve as producibility consultants.

Design Principles and Guidelines. DFM/A also relies on the use of design principles and guidelines to maximize manufacturability and assemblability. Some of these are universal design guidelines that can be applied to nearly any product design situation, such as those presented in Table 24.3. In other cases, there are design principles that apply to specific processes, for example, the use of drafts or tapers in casted and molded parts to facilitate removal of the part from the mold. These process-specific guidelines are covered in texts on manufacturing processes, such as you will find in reference [8].

The guidelines sometimes conflict with one another. For example, one of the guidelines in Table 24.3 is to "simplify part geometry; avoid unnecessary features." But another guideline in the same table states that "special geometric features must sometimes be added to components" to design the product for foolproof assembly. And it may also be desirable to combine features of several assembled parts into one component to minimize the number of parts in the product. In these instances, a suitable compromise must be found between design for part manufacture and design for assembly.

24.3.2 Other Concurrent Engineering Objectives

To complete the coverage of concurrent engineering, other design objectives are briefly described: design for quality, cost, and life cycle.

Design for Quality. It might be argued that DFM/A is the most important component of concurrent engineering because it has the potential for the greatest impact on product cost and development time. However, the importance of quality in international competition cannot be minimized. High quality does not just happen. Procedures for achieving it must be devised during product design and process planning. Design for quality (DFQ) refers to the principles and procedures employed to ensure that the highest possible quality is designed into the product. The general objectives of DFQ are [1]: (1) to design the product to meet or exceed customer requirements; (2) to design the product to be "robust," in the sense of Taguchi (Section 20.6.1), that is, to design the product so that its function and performance are relatively insensitive to variations in manufacturing and subsequent application; and (3) to continuously improve the performance, functionality, reliability, safety, and other quality aspects of the product to provide superior value to the customer. The discussion of quality in Part V is certainly consistent with design for quality, but the emphasis in those chapters was directed more at the operational aspects of quality during production.

TABLE 24.3 General Principles and Guidelines in DFM/A

Guideline	Interpretation and Advantages
Minimize number of components	<p>Reduced assembly costs. Greater reliability in final product. Easier disassembly in maintenance and field service. Automation is often easier with reduced part count. Reduced work-in-process and inventory control problems. Fewer parts to purchase; reduced ordering costs.</p>
Use standard commercially available components	<p>Reduced design effort. Fewer part numbers. Better inventory control possible. Avoids design of custom-engineered components. Quantity discounts are possible.</p>
Use common parts across product lines	<p>Group technology (Chapter 18) can be applied. Quantity discounts are possible. Permits development of manufacturing cells.</p>
Design for ease of part fabrication	<p>Use net shape and near-net shape processes where possible. Simplify part geometry; avoid unnecessary features. Avoid making surface smoother than necessary since additional processing may be needed.</p>
Design parts with tolerances that are within process capability	<p>Avoid tolerances less than process capability (Section 20.3.2). Specify bilateral tolerances. Otherwise, additional processing or sortation and scrap are required.</p>
Design the product to be foolproof during assembly	<p>Assembly should be unambiguous. Components should be designed so they can be assembled only one way. Special geometric features must sometimes be added to components.</p>
Minimize flexible components	<p>These include components made of rubber, belts, gaskets, electrical cables, etc. Flexible components are generally more difficult to handle.</p>
Design for ease of assembly	<p>Include part features such as chamfers and tapers on mating parts. Use base part to which other components are added. Use modular design (see following guideline). Design assembly for addition of components from one direction, usually vertically; in mass production this rule can be violated because fixed automation can be designed for multiple direction assembly. Avoid threaded fasteners (screws, bolts, nuts) where possible, especially when automated assembly is used; use fast assembly techniques such as snap fits and adhesive bonding. Minimize number of distinct fasteners.</p>
Use modular design	<p>Each subassembly should consist of 5–15 parts. Easier maintenance and field service. Facilitates automated (and manual) assembly. Reduces inventory requirements. Reduces final assembly time.</p>
Shape parts and products for ease of packaging	<p>Compatible with automated packaging equipment. Facilitates shipment to customer. Can use standard packaging cartons.</p>
Eliminate or reduce adjustments	<p>Many assembled products require adjustments and calibrations. During product design, the need for adjustments and calibrations should be minimized because they are often time consuming in assembly.</p>

Source: Groover [8].

Design for Product Cost. The cost of a product is a major factor in determining its commercial success. Cost affects the price charged for the product and the profit made by the company producing it. Design for product cost (DFC) refers to the efforts of a company to specifically identify how design decisions affect product costs and to develop ways to reduce cost through design. Although the objectives of DFC and DFM/A overlap to some degree, because improved manufacturability usually results in lower cost, the scope of design for product cost extends beyond manufacturing in its pursuit of cost savings. It includes costs of inspection, purchasing, distribution, inventory control, and overhead.

Design for Life Cycle. To the customer, the price paid for the product may be a small portion of its total cost when life cycle costs are considered. Design for life cycle refers to the product after it has been manufactured and includes factors ranging from product delivery to product disposal. Other life cycle factors include installability, reliability, maintainability, serviceability, and upgradeability. Some customers (e.g., the federal government) include consideration of these costs in their purchasing decisions. The producer of the product is often obliged to offer service contracts that limit customer liability for out-of-control maintenance and service costs. In these cases, accurate estimates of these life cycle costs must be included in the total product cost.

24.4 ADVANCED MANUFACTURING PLANNING

Advanced manufacturing planning emphasizes planning for the future. It is a corporate-level activity that is distinct from process planning because it is concerned with products being contemplated in the company's long-term plans (2- to 10-year future), rather than products currently being designed and released. Advanced manufacturing planning involves working with sales, marketing, and design engineering to forecast the future products that will be introduced and determine what production resources will be needed to make those products. The future products may require manufacturing technologies and facilities not currently available in the firm. In advanced manufacturing planning, the current equipment and facilities are compared with the processing needs of future planned products to determine what new technologies and facilities should be installed. The general planning cycle is portrayed in Figure 24.5. The feedback loop at the top of the diagram is intended to indicate that the firm's future manufacturing capabilities may motivate new product ideas not previously considered.

Activities in advanced manufacturing planning include (1) new technology evaluation, (2) investment project management, (3) facilities planning, and (4) manufacturing research.

New Technology Evaluation. One of the reasons a company may consider installing new technologies is because future product lines require processing methods not currently used by the company. To introduce the new products, the company must either implement new processing technologies in-house or purchase the components made by the new technologies from vendors. For strategic reasons, it may be in the company's interest to implement a new technology internally and develop staff expertise in that technology as a distinctive competitive advantage for the company. The pros and cons must be analyzed, and the technology itself must be evaluated to assess its merits and demerits.

A good example of the need for technology evaluation has occurred in the microelectronics industry, whose history spans only the past several decades. The technology of

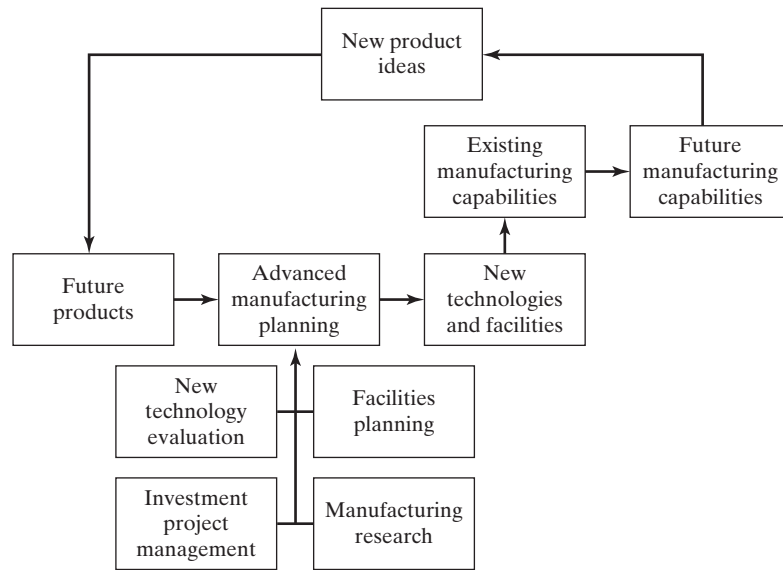


Figure 24.5 Advanced manufacturing planning cycle.

microelectronics has progressed very rapidly, driven by the need to include ever-greater numbers of devices in smaller and smaller packages. As each new generation has evolved, alternative technologies have been developed both in the products themselves and in the required processes to fabricate them. It has been necessary for the companies in this industry, as well as companies that use their products, to evaluate the alternative technologies and decide which should be adopted.

There are other reasons why a company may need to introduce new technologies: (1) quality improvement, (2) productivity improvement, (3) cost reduction, (4) lead time reduction, and (5) modernization and replacement of worn-out facilities with new equipment. A good example of the introduction of a new technology is the CAD/CAM systems that were installed by many companies during the 1980s. Initially, CAD/CAM was introduced to modernize and increase productivity in the drafting function in product design. As CAD/CAM technology itself evolved and its capabilities expanded to include 3-D geometric modeling, design engineers began developing their product designs on these more powerful systems. Engineering analysis programs were written to perform finite-element calculations for complex heat transfer and stress problems. The use of CAD had the effect of increasing design productivity, improving the quality of the design, improving communications, and creating a database for manufacturing. In addition, CAM software was introduced to implement process planning functions such as NC part programming (Section 7.5) and CAPP (Section 24.2), thus reducing transition time from design to production.

Investment Project Management. Investments in new technologies or new equipment are generally made one project at a time. The duration of each project may be several months to several years. The management of the project requires a collaboration between the finance department that oversees the disbursements, manufacturing engineering that provides technical expertise in the production technology, and other functional areas that may be related to the project. Each project typically includes the

following sequence of steps: (1) proposal to justify the investment is prepared, (2) management approvals are granted for the investment, (3) vendor quotations are solicited, (4) order is placed to the winning vendor, (5) vendor progress in building the equipment is monitored, (6) any special tooling and supplies are ordered, (7) the equipment is installed and debugged, (8) operators are trained, (9) responsibility for running the equipment is turned over to the operating department.

Facilities Planning. When new equipment is installed in an existing plant, the facility must be altered. Floor space must be allocated to the equipment, other equipment may need to be relocated or removed, utilities (power, heat, light, air, etc.) must be connected, safety systems must be installed if needed, and various other activities must be accomplished to complete the installation. In some cases, a new plant may be needed to produce a new product line or expand production of an existing line. The planning work required to renovate an existing facility or design a new one is carried out by the plant engineering department (or similar title) and is called facilities planning. In the design or redesign of a production facility, manufacturing engineering and plant engineering must work closely to achieve a successful installation.

Manufacturing Research and Development. To develop the required manufacturing technologies, the company may find it necessary to undertake a program of manufacturing research and development (R&D). Some of this research is done internally; in other cases projects are contracted to university and commercial research laboratories specializing in the associated technologies. Manufacturing research can take various forms, including the following:

- *Development of new processing technologies.* This R&D activity involves the development of new processes that have never been used before. Some of the processing technologies developed for integrated circuits fabrication fall into this category. Other recent examples include rapid prototyping techniques (Section 23.1.2).
- *Adaptation of existing processing technologies.* A manufacturing process may exist that has never been used on the type of products made by the company, yet it is perceived that there is a potential for application. In this case, the company must engage in applied research to customize the process to its needs.
- *Process fine-tuning.* This involves research on processes used by the company. The objectives of a given study can be any of the following: (1) improve operating efficiency, (2) improve product quality, (3) develop a process model, (4) achieve better control of the process, or (5) determine optimum operating conditions.
- *Software systems development.* These are projects involving development of customized manufacturing-related software for the company. Possible software development projects might include cost estimation software, parts classification and coding systems, CAPP, customized CAD/CAM application software, production planning and control systems, work-in-process tracking systems, and similar projects. Successful development of a good software package may give the company a competitive advantage.
- *Automation systems development.* These projects are similar to the preceding except they deal with hardware or hardware/software combinations. Studies related to the application of industrial robots (Chapter 8) in the company are examples of this kind of research.

- *Operations research and simulation.* Operations research involves the development and application of mathematical models to analyze operational problems. The techniques include linear programming, inventory models, queuing theory, and stochastic processes. In many problems, the mathematical models are too complex to be solved in closed form. In these cases, discrete event simulation can be used to study the operations. A number of commercial simulation packages are available for this purpose.

Manufacturing R&D is applied research. The objective is to develop or adapt a technology or technique that will result in higher profits and a distinctive competitive advantage for the company.

REFERENCES

- [1] BAKERJIAN, R., and P. MITCHELL, *Tool and Manufacturing Engineers Handbook*, 4th ed., Volume VI, *Design for Manufacturability*, Society of Manufacturing Engineers, Dearborn, MI, 1992.
- [2] BOOTHROYD, G., P. DEWHURST, and W. KNIGHT, *Product Design for Manufacture and Assembly*, 3rd ed., CRC Press, Boca Raton, FL, 2010.
- [3] CHANG, T.-C., and R. A. WYSK, *An Introduction to Automated Process Planning Systems*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1985.
- [4] CHANG, T.-C., R. A. WYSK, and H. P. WANG, *Computer-Aided Manufacturing*, 3rd ed., Pearson/Prentice Hall, Upper Saddle River, NJ, 2006.
- [5] EARY, D. F., and G. E. JOHNSON, *Process Engineering for Manufacturing*, Prentice Hall, Inc., Englewood Cliffs, NJ, 1962.
- [6] FELCH, R. I., "Make-or-Buy Decisions," *Maynard's Industrial Engineering Handbook*, 4th ed., William K. Hodson (ed.), McGraw-Hill, Inc., New York, 1992, pp. 9.121–9.127.
- [7] GROOVER, M. P., "Computer-Aided Process Planning—An Introduction," *Proceedings, Conference on Computer-Aided Process Planning*, Provo, UT, October 1984.
- [8] GROOVER, M. P., *Fundamentals of Modern Manufacturing: Materials, Processes, and Systems*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2013.
- [9] GROOVER, M. P., and E. W. ZIMMERS, Jr., *CAD/CAM: Computer-Aided Design and Manufacturing*, Prentice Hall, Englewood Cliffs, NJ, 1984.
- [10] KAMRANI, A. K., P. SFERRO, and J. HANDLEMAN, "Critical Issues in Design and Evaluation of Computer-Aided Process Planning," *Computers & Industrial Engineering*, Vol. 29, No. 1–4, 1995, pp. 619–623.
- [11] KUSIAK, A., Editor, *Concurrent Engineering*, John Wiley & Sons, Inc., New York, 1993.
- [12] NEVINS, J. L., and D. E. WHITNEY, Editors, *Concurrent Design of Products and Processes*, McGraw-Hill Publishing Company, New York, 1989.
- [13] PARSAEI, H. R., and W. G. SULLIVAN, Editors, *Concurrent Engineering*, Chapman & Hall, London, UK, 1993.
- [14] TANNER, J. P., *Manufacturing Engineering*, Marcel Dekker, Inc., New York, 1985.
- [15] TOMPKINS, J. A., J. A. WHITE, Y. A. BOZER, and J. M. A. TANCHOCO, *Facilities Planning*, 4th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2010.
- [16] WANG, H. P., and J. K. LI, *Computer-Aided Process Planning*, Elsevier, Amsterdam, The Netherlands, 1991.
- [17] www.npd-solutions.com/capp
- [18] www.wikipedia.org/wiki/Computer_aided_process_planning

REVIEW QUESTIONS

- 24.1** What is process planning?
- 24.2** Name some of the decisions and details that are usually included within the scope of process planning.
- 24.3** What is the name of the document that lists the process sequence in process planning?
- 24.4** A typical process sequence for a manufactured part consists of four types of operations. Name and briefly describe the four types of operations.
- 24.5** What is a net shape process?
- 24.6** Name some of the factors that influence the make-or-buy decision.
- 24.7** Name some of the benefits derived from computer-aided process planning.
- 24.8** Briefly describe the two basic approaches in computer-aided process planning.
- 24.9** What is concurrent engineering?
- 24.10** Design for Manufacturing and Assembly (DFM/A) includes two aspects: (1) organizational changes and (2) design principles and guidelines. Identify two of the organizational changes that might be made in implementing DFM/A.
- 24.11** Name some of the universal design guidelines in DFM/A.
- 24.12** Name the four activities often included within the scope of advanced manufacturing planning.

Production Planning and Control Systems

CHAPTER CONTENTS

- 25.1 Aggregate Production Planning and the Master Production Schedule
- 25.2 Material Requirements Planning
 - 25.2.1 Inputs to the MRP System
 - 25.2.2 How MRP Works
 - 25.2.3 MRP Outputs and Benefits
- 25.3 Capacity Planning
- 25.4 Shop Floor Control
 - 25.4.1 Order Release
 - 25.4.2 Order Scheduling
 - 25.4.3 Order Progress
 - 25.4.4 Factory Data Collection System
- 25.5 Inventory Control
- 25.6 Manufacturing Resource Planning (MRP II)
- 25.7 Enterprise Resource Planning (ERP)

Production planning and control (PPC) is concerned with the logistics problems that are encountered in manufacturing, that is, managing the details of what and how many products to produce and when, and obtaining the raw materials, parts, and resources to produce those products. PPC solves these logistics problems by managing information. Computers are essential for processing the tremendous amounts of data involved to define the products and the means to produce them, and for reconciling these technical details with the desired production schedule. In a very real sense, PPC is the integrator in computer-integrated manufacturing.

Planning and control in PPC must themselves be integrated functions. It is insufficient to plan production if there is no control of the factory resources to achieve the plan. And it is ineffective to control production if there is no plan with which to compare factory progress. Both planning and control must be accomplished, and they must be coordinated with each other and with other functions in the manufacturing firm, such as process planning, concurrent engineering, and advanced manufacturing planning (Chapter 24). Notwithstanding the integrated nature of PPC, it is appropriate to define what is involved in each function: production planning and production control.

Production planning consists of (1) deciding which products to make, in what quantities, and when they should be completed; (2) scheduling the delivery and/or production of the parts and products; and (3) planning the manpower and equipment resources needed to accomplish the production plan. Activities within the scope of production planning include:

- *Aggregate production planning.* This involves planning the production output levels for major product lines produced by the firm. These plans must be coordinated among various functions in the firm, including product design, production, marketing, and sales.
- *Master production planning.* The aggregate production plan must be converted into a master production schedule (MPS) which is a specific plan of the quantities to be produced of individual models within each product line.
- *Material requirements planning (MRP).* MRP is a planning technique, usually implemented by computer, that translates the MPS of end products into a detailed schedule for the raw materials and parts used in those end products.
- *Capacity planning.* This is concerned with determining the labor and equipment resources needed to achieve the master schedule.

Production planning activities divide into two stages: (1) aggregate planning, which results in the MPS, and (2) detailed planning, which includes MRP and capacity planning. Aggregate planning involves planning six months or more into the future, whereas detailed planning is concerned with the shorter term (weeks to months).

Production control consists of determining whether the necessary resources to implement the production plan have been provided, and if not, attempting to take corrective action to address the deficiencies. As its name suggests, production control includes various systems and techniques for controlling production and inventory in the factory. The major production control topics covered in this chapter are:

- *Shop floor control.* Shop floor control systems compare the actual progress and status of production orders in the factory with the production plans (MPS and MRP schedule).
- *Inventory control.* Inventory control includes a variety of techniques for managing the inventory of a firm. One of the important tools in inventory control is the economic order quantity formula.
- *Manufacturing resource planning.* Also known as *MRP II*, manufacturing resource planning combines MRP and capacity planning, as well as shop floor control and other functions related to PPC.
- *Enterprise resource planning.* Abbreviated ERP, this is an extension of MRP II that includes all of the functions of the organization, including those unrelated to manufacturing.

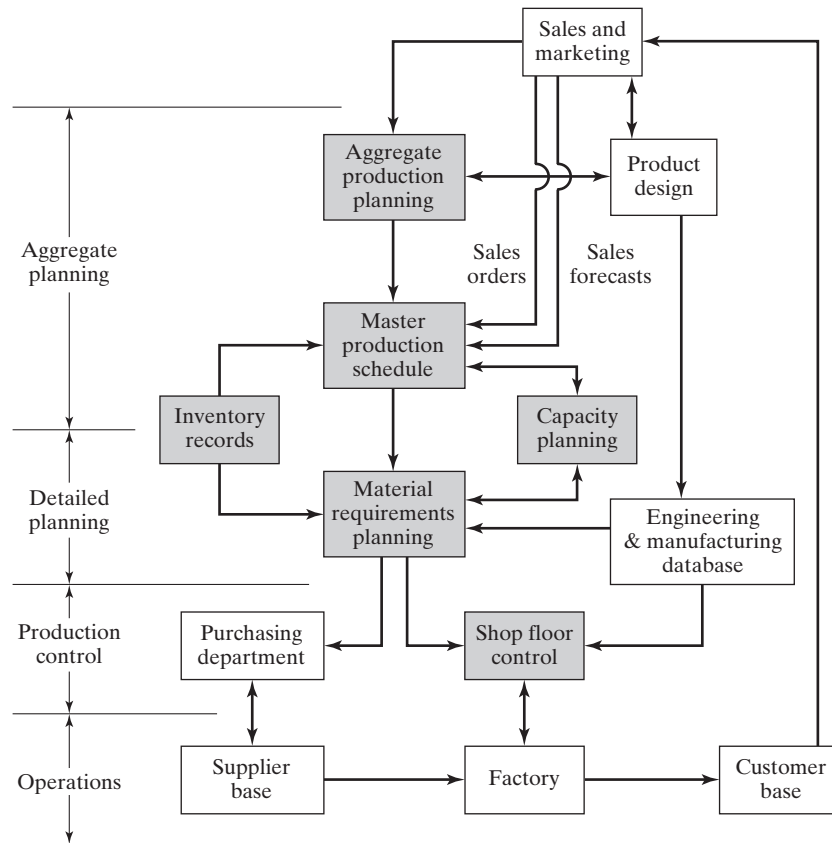


Figure 25.1 Activities in a production planning and control system (shaded in the diagram) and their relationships with other functions in the firm and outside.

The activities in a modern PPC system and their interrelationships are depicted in Figure 25.1. As the figure indicates, PPC ultimately extends to the company’s supplier base and customer base. This expanded scope of PPC is known as *supply chain management*.

25.1 AGGREGATE PRODUCTION PLANNING AND THE MASTER PRODUCTION SCHEDULE

Aggregate planning is a high-level corporate planning activity. The aggregate production plan indicates production output levels for the major product lines of the company. The aggregate plan must be coordinated with the plans of the sales and marketing departments. Because the aggregate production plan includes products that are currently in production, it must also consider the present and future inventory levels of those products and their component parts. Because new products currently being developed will also be included in the aggregate plan, the marketing plans and promotions for current products and new products must be reconciled against the total capacity resources available to the company.

The production quantities of the major product lines listed in the aggregate plan must be converted into a very specific schedule of individual products, known as the *master production schedule (MPS)*, or *master schedule* for short. It is a list of the products

Product line	Week									
	1	2	3	4	5	6	7	8	9	10
M model line	200	200	200	150	150	120	120	100	100	100
N model line	80	60	50	40	30	20	10			
P model line							70	130	25	100

(a) Aggregate production plan

Product line models	Week									
	1	2	3	4	5	6	7	8	9	10
Model M3	120	120	120	100	100	80	80	70	70	70
Model M4	80	80	80	50	50	40	40	30	30	30
Model N8	80	60	50	40	30	20	10			
Model P1								50		100
Model P2							70	80	25	

(b) Master production schedule

Figure 25.2 (a) Aggregate production plan and (b) corresponding master production schedule for a hypothetical product line.

to be manufactured, when they should be completed and delivered, and in what quantities. A hypothetical MPS for a narrow product set is presented in Figure 25.2(b), showing how it is derived from the corresponding aggregate plan in Figure 25.2(a). The master schedule must be based on an accurate estimate of demand and a realistic assessment of the company's production capacity.

Products included in the MPS divide into three categories: (1) firm customer orders, (2) forecasted demand, and (3) spare parts. Proportions in each category vary for different companies, and in some cases one or more categories are omitted. Companies producing assembled products will generally have to handle all three types. In the case of customer orders for specific products, the company is usually obligated to deliver the item by a particular date that has been promised by the sales department. In the second category, production output quantities are based on statistical forecasting techniques applied to previous demand patterns, estimates by the sales staff, and other sources. For many companies, forecasted demand constitutes the largest portion of the master schedule. The third category consists of repair parts that either will be stocked in the company's service department or sent directly to the customer. Some companies exclude this third category from the master schedule since it does not represent end products.

The MPS is generally considered to be a medium-range plan since it must take into account the lead times to order raw materials and components, produce parts in the factory, and then assemble the end products. Depending on the product, the lead times can range from several weeks to many months; in some cases, more than a year. The MPS is usually considered to be fixed in the near term. This means that changes are not allowed within about a six-week horizon because of the difficulty in adjusting production schedules within such a short period. However, schedule adjustments are allowed beyond six weeks to cope with changing demand patterns or the introduction of new products. Accordingly, it should be noted that the aggregate production plan is not the only input to the master schedule. Other inputs that may cause the master schedule to depart from the aggregate plan include new customer orders and changes in sales forecast over the near term.

25.2 MATERIAL REQUIREMENTS PLANNING

Material requirements planning (MRP) is a computational technique that converts the master schedule for end products into a detailed schedule for the raw materials and components used in the end products. The detailed schedule identifies the quantities of each raw material and component item. It also indicates when each item must be ordered and delivered to meet the master schedule for final products. MRP is often thought of as a method of inventory control. It is both an effective tool for minimizing unnecessary inventory investment and a useful technique in production scheduling and purchasing of materials.

The distinction between independent demand and dependent demand is important in MRP. **Independent demand** means that demand for a product is unrelated to demand for other items. Final products and spare parts are examples of items whose demand is independent. Independent demand patterns must usually be forecasted. **Dependent demand** means that demand for the item is directly related to the demand for some other item, typically a final product. The dependency usually derives from the fact that the item is a component of the other product. Component parts, raw materials, and subassemblies are examples of items subject to dependent demand.

Whereas demand for the firm's end products must be forecasted (in the absence of customer orders), the raw materials and component parts used in the end products should not be forecasted. Once the delivery schedule for end products is established, the requirements for components and raw materials can be directly calculated. For example, even though demand for a given model of automobile each month can only be forecasted, once the quantity is established and production is scheduled, it is known that five tires will be needed to deliver the car (don't forget the spare). MRP is the appropriate technique for determining quantities of dependent demand items. These items constitute the inventory of manufacturing: raw materials, work-in-process (WIP), component parts, and subassemblies. That is why MRP is such a powerful technique in the planning and control of manufacturing inventories. For independent demand items, inventory control is often accomplished using order point systems, described in Section 25.5.

The concept of MRP is relatively straightforward. Its implementation is complicated by the sheer magnitude of the data to be processed. The master schedule provides the overall production plan for the final products in terms of month-by-month deliveries. Each product may contain hundreds of individual components. These components are produced from raw materials, some of which are common among the components. For example, several components may be made out of the same gauge sheet steel. The components are assembled into simple subassemblies, and these subassemblies are put together into more complex subassemblies, and so on, until the final products are assembled. Each step in the manufacturing and assembly sequence takes time. All of these factors must be incorporated into the MRP calculations. Although each calculation is uncomplicated, the magnitude of the data is so large (at least for products of more than a few components) that the application of MRP is impractical without computer processing.

In the discussion of MRP that follows, the inputs to the MRP system are first examined, followed by a description of how MRP works, the output reports generated by the MRP computations, and finally the benefits and pitfalls that have been experienced with MRP systems in industry.

25.2.1 Inputs to the MRP System

To function, the MRP program needs data contained in several files that serve as inputs to the MRP processor. They are (1) the master production schedule, (2) the bill of materials file and other engineering and manufacturing data, and (3) the inventory record file. Figure 25.3 illustrates the flow of data into the MRP processor and its conversion into useful output reports. Although not shown in Figure 25.3, capacity planning (Section 25.3) also provides input to ensure that the MRP schedule does not exceed the production capacity of the firm.

The MPS lists what end products and how many of each are to be produced and when they are to be ready for shipment, as shown in Figure 25.2(b). Manufacturing firms generally work on monthly delivery schedules, but the master schedule in Figure 25.2(b) uses weeks as the time periods. Whatever the duration, these time periods are called *time buckets* in MRP. Instead of treating time as a continuous variable (which of course, it is), MRP makes its computations of materials and parts requirements in terms of time buckets.

The bill of materials (BOM) file provides information on the product structure by listing the component parts and subassemblies that make up each product. It is used to compute the raw material and component requirements for end products listed in the master schedule. The structure of an assembled product can be depicted as in Figure 25.4. This is much simpler than most commercial products, but its simplicity will serve for illustration purposes. Product P1 is composed of two subassemblies, S1 and S2, each of which is made up of components C1, C2, and C3, and C4, C5, and C6, respectively. Finally, at the bottom level are the raw materials that go into each component. The items at each successively higher level are called the *parents* of the items feeding into it from below. For example, S1 is the parent of C1, C2, and C3. The product structure must also specify the number of each subassembly, component, and raw material that go into its respective parent. These numbers are shown in parentheses in the figure.

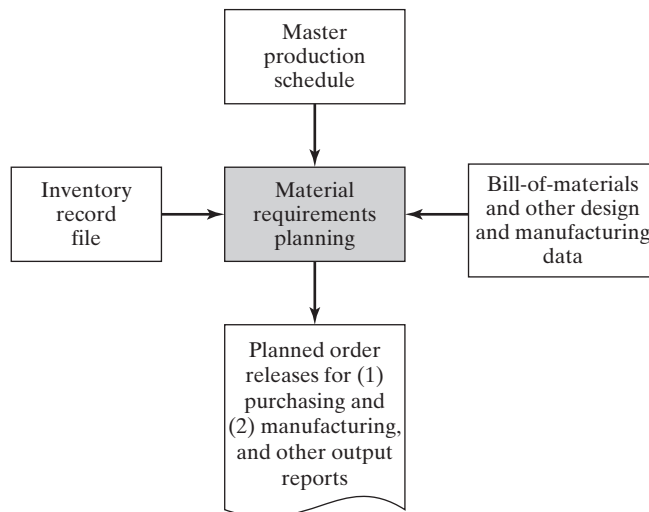


Figure 25.3 Structure of an material requirements planning system.

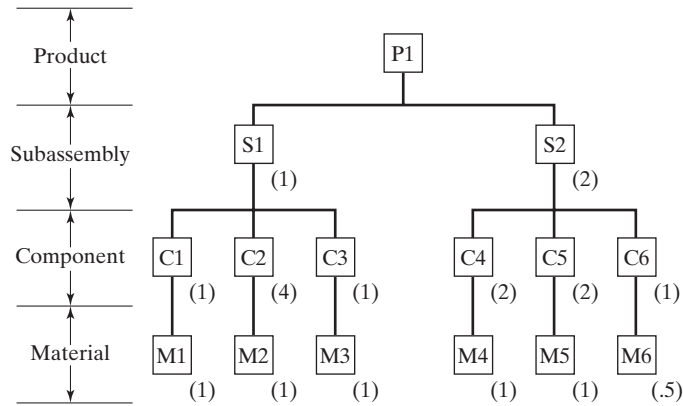


Figure 25.4 Product structure for product P1.

The inventory record file is referred to as the item master file in a computerized inventory system. The types of data contained in the inventory record are divided into three segments:

1. *Item master data.* This provides the item’s identification (part number) and other data about the part such as order quantity and lead times.
2. *Inventory status.* This gives a time-phased record of inventory status. In MRP, it is important to know not only the current level of inventory, but also any future changes that will occur against the inventory. Therefore, the inventory status segment lists the gross requirements for the item, scheduled receipts, on-hand status, and planned order releases, as shown in Figure 25.5.
3. *Subsidiary data.* The third file segment provides subsidiary data such as purchase orders, scrap or rejects, and engineering changes.

25.2.2 How MRP Works

The MRP processor operates on data contained in the MPS, the BOM file, and the inventory record file. The master schedule specifies the period-by-period list of final products required, the BOM defines what materials and components are needed for each product, and the inventory record file gives the current and future inventory status of each product, component, and material. The MRP processor computes how many of each

Period	1	2	3	4	5	6	7
Item: Raw material M4							
Gross requirements							
Scheduled receipts			40				
On hand	50	50	50	90			
Net requirements							
Planned order releases							

Figure 25.5 Initial inventory status of material M4 in Example 25.2.

component and raw material are needed each period by “exploding” the end product requirements into successively lower levels in the product structure.

EXAMPLE 25.1 MRP Gross Quantity Computations

In the master schedule of Figure 25.2, 50 units of product P1 are to be completed in week 8. Explode this product requirement into the corresponding number of subassemblies and components required.

Solution: Referring to the product structure in Figure 25.4, 50 units of P1 explode into 50 units of S1 and 100 units of S2. Similarly, the requirements for these subassemblies explode into 50 units of C1, 200 of C2, 50 of C3, 200 of C4, 200 of C5, and 100 of C6. Quantities of raw materials are determined in a similar manner. □

Several complicating factors must be considered during the MRP computations. First, the quantities of components and subassemblies listed in the solution of Example 25.1 do not account for any of those items that may already be stocked in inventory or are expected to be received as future orders. Accordingly, the computed quantities must be adjusted for any inventories on hand or on order, a procedure called *netting*. For each time bucket, net requirements = gross requirements less on-hand inventories and quantities on order.

Second, quantities of common-use items must be combined during parts explosion to determine the total quantities required for each component and raw material in the schedule. **Common-use items** are raw materials and components that are used on more than one product. MRP collects these common-use items from different products to achieve economies in ordering the raw materials and producing the components.

Third, lead times for each item must be taken into account. The **lead time** for a job is the time that must be allowed to complete the job from start to finish. There are two kinds of lead times in MRP: ordering lead times and manufacturing lead times. **Ordering lead time** for an item is the time required from initiation of the purchase requisition to receipt of the item from the vendor. If the item is a raw material that is stocked by the vendor, the ordering lead time should be relatively short, perhaps a few days or a few weeks. If the item is fabricated, the lead time may be substantial, perhaps several months. **Manufacturing lead time** is the time required to produce the item in the company’s own plant, from order release to completion, once the raw materials for the item are available. The scheduled delivery of end products must be translated into time-phased requirements for components and materials by factoring in the ordering and manufacturing lead times.

EXAMPLE 25.2 MRP Time-Phased Quantity Requirements

To illustrate these various complicating factors, consider the MRP procedure for component C4, which is used in product P1. This part also happens to be used on product P2 of the master schedule in Figure 25.2. The product structure for P2 is shown in Figure 25.6. Component C4 is made out of material M4, one unit of M4 for each unit of C4, and the inventory status of M4 is given in

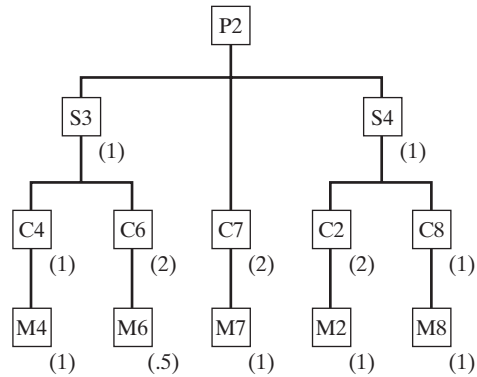


Figure 25.6 Product structure for product P2.

Figure 25.5. The lead times and inventory status for each of the other items needed in the MRP calculations are shown in the table below. Complete the MRP calculations to determine the time-phased requirements for items S2, S3, C4, and M4, based on the requirements for P1 and P2 given in the MPS of Figure 25.2. It is assumed that the inventory on hand or on order for P1, P2, S2, S3, and C4 is zero for all future periods except for the calculated values in this problem solution.

Item	LeadTime	Inventory
P1	Assembly lead time = 1 week	No inventory on hand or on order
P2	Assembly lead time = 1 week	No inventory on hand or on order
S2	Assembly lead time = 1 week	No inventory on hand or on order
S3	Assembly lead time = 1 week	No inventory on hand or on order
C4	Manufacturing lead time = 2 weeks	No inventory on hand or on order
M4	Ordering lead time = 3 weeks	See Figure 25.5.

Solution: The results of the MRP calculations are given in Figure 25.7. The delivery requirements for P1 and P2 must be offset by their one week assembly lead time to obtain the planned order releases. These quantities are then exploded into requirements for subassemblies S2 (for P1) and S3 (for P2). These requirements are offset by their one week assembly lead time and combined in week 6 to obtain gross requirements for component C4. Net requirements equal gross requirements for P1, P2, S2, S3, and C4 because no inventory is on hand and there are no planned orders. The effect of current inventory and planned orders in the time-phased inventory status of M4 is observed as follows: The on-hand stock of 50 units plus scheduled receipts of 40 are used to meet gross requirements of 70 units of M4 in week 3, with 20 units remaining that can be applied to the gross requirements of 280 units in week 4. Net requirements in week 4 are therefore 260 units. With an ordering lead time of three weeks, the order release for 260 units must be planned for week 1.

Period		1	2	3	4	5	6	7	8	9	10
Item: Product P1											
Gross requirements									50		100
Scheduled receipts											
On hand	0										
Net requirements									50		100
Planned order releases								50		100	
Item: Product P2											
Gross requirements								70	80	25	
Scheduled receipts											
On hand	0										
Net requirements								70	80	25	
Planned order releases							70	80	25		
Item: Subassembly S2											
Gross requirements								100		200	
Scheduled receipts											
On hand	0										
Net requirements								100		200	
Planned order releases							100		200		
Item: Subassembly S3											
Gross requirements							70	80	25		
Scheduled receipts											
On hand	0										
Net requirements							70	80	25		
Planned order releases						70	80	25			
Item: Component C4											
Gross requirements						70	280	25	400		
Scheduled receipts											
On hand	0										
Net requirements						70	280	25	400		
Planned order releases			70	280	25	400					
Item: Raw material M4											
Gross requirements			70	280	25	400					
Scheduled receipts			40								
On hand	50	50	50	90	20						
Net requirements			-20	260	25	400					
Planned order releases	260	25	400								

Figure 25.7 MRP solution to Example 25.2. Time-phased requirements for P1 and P2 are taken from Figure 25.2. Requirements for S2, S3, C4, and M4 are calculated.

25.2.3 MRP Outputs and Benefits

The MRP program generates a variety of outputs that can be used in planning and managing plant operations. The outputs include (1) planned order releases, which provide the authority to place orders that have been planned by the MRP system; (2) reports of

planned order releases in future periods; (3) rescheduling notices, indicating changes in due dates for open orders; (4) cancellation notices, indicating that certain open orders have been canceled because of changes in the MPS; (5) reports on inventory status; (6) performance reports of various types, indicating costs, item usage, actual versus planned lead times, and so on; (7) exception reports, showing deviations from the schedule, orders that are overdue, scrap, and so on; and (8) inventory forecasts, indicating projected inventory levels in future periods.

Of the MRP outputs listed above, the planned order releases are the most important because they drive the production system. Planned order releases are of two kinds, purchase orders and work orders. Purchase orders provide the authority to purchase raw materials or parts from outside vendors, with quantities and delivery dates specified. Work orders generate the authority to produce parts or assemble subassemblies or products in the company's own factory. Again, quantities to be completed and completion dates are specified.

Benefits reported by users of MRP systems include the following: (1) reduction in inventory, (2) quicker response to changes in demand than is possible with a manual requirements planning system, (3) reduced setup and product changeover costs, (4) better machine utilization, (5) improved capacity to respond to changes in the master schedule, and (6) aid in developing the master schedule.

Notwithstanding these claimed benefits, the success rate in implementing MRP systems throughout industry has been less than perfect. Some MRP systems have not been successful because (1) the application was not appropriate, usually because the product structure did not fit the data requirements of MRP; (2) the MRP computations were based on inaccurate data; and (3) the MPS was not coupled with a capacity planning system, so the MRP program generated an unrealistic schedule of work orders that overloaded the factory.

25.3 CAPACITY PLANNING

The original MRP systems that were developed in the 1970s created schedules that were not always consistent with the production capabilities and limitations of the plants that were to make the products. In many instances, the MRP system developed the detailed schedule based on a master production schedule that was unrealistic. A realistic production schedule must consider production capacity. In cases where current capacity is inadequate, the firm must make plans for changes in capacity to meet the changing production requirements specified in the schedule. **Capacity planning** consists of determining what labor and equipment resources are required to meet the current MPS as well as long-term future production needs of the firm (see Advanced Manufacturing Planning, Section 24.4). Capacity planning also identifies the limitations of the available production resources to prevent the planning of an unrealistic master schedule.

Capacity planning is often accomplished in three stages, as indicated in Figure 25.8: first, during aggregate production planning; second, when the master production schedule is established; and third, when the MRP computations are done. During aggregate production planning, the term *resource requirements planning* (RRP) denotes the evaluation process used to make sure that the aggregate plan is feasible. Downward adjustments may be required if the plan is too ambitious. RRP may also be used to plan for future increases in capacity to match an ambitious plan or to anticipate demand increases in the future. Thus, resource requirements planning is used not only to check the aggregate production plan but also to plan for future expansion (or reduction) of capacity.

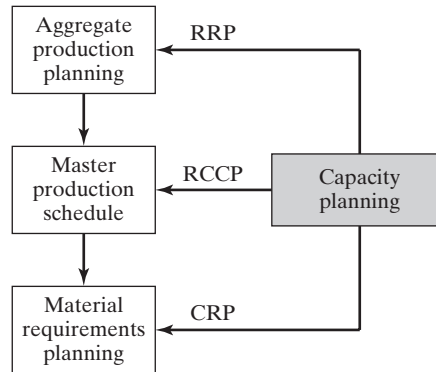


Figure 25.8 Three stages of capacity planning: (1) resource requirements planning (RRP), (2) rough-cut capacity planning (RCCP), and (3) capacity requirements planning (CRP).

Next, in the MPS stage, a capacity calculation called *rough-cut capacity planning* (RCCP) is made to assess the feasibility of the master schedule. Such a calculation indicates whether there is a significant violation of production capacity in the MPS. On the other hand, if the calculation shows no capacity violation, neither does it guarantee that the production schedule can be met. This depends on the allocation of work orders to specific work cells in the plant. Accordingly, a third capacity calculation is made at the time the MRP schedule is prepared. Called *capacity requirements planning* (CRP), this detailed calculation determines whether there is sufficient production capacity in the individual departments and in the work cells to complete the specific parts and assemblies that have been scheduled by MRP. If the schedule is not compatible with capacity, then either the plant capacity or the master schedule must be adjusted.

Possible capacity adjustments are indicated by the capacity equations and discussion in Chapter 3 (Section 3.1.2). They can be divided into short-term adjustments and long-term adjustments. Capacity adjustments for the short term include the following:

- *Employment levels.* Employment in the plant can be increased or decreased in response to changes in capacity requirements.
- *Temporary workers.* Increases in employment level can also be achieved by using workers from a temporary agency. When the busy period is passed, these workers move to positions at other companies where their services are needed.
- *Work shifts.* The number of shifts worked per production period can be increased or decreased.
- *Labor hours.* The number of labor hours per shift can be increased or decreased, through the use of overtime or reduced hours.
- *Inventory stockpiling.* This tactic might be used to maintain steady employment levels during slow demand periods.
- *Order backlogs.* Deliveries of the product to the customer could be delayed during busy periods when production resources are insufficient to keep up with demand.
- *Subcontracting.* This involves the letting of jobs to other shops during busy periods, or the taking in of extra work during slack periods.

Capacity planning adjustments for the long term include changes in production capacity that generally require long lead times. These adjustments include the following actions:

- *New equipment.* This involves investing in more machines or more productive machines to meet increased future production requirements, or investing in new types of machines to match future changes in product design.
- *New plants.* Building a new factory represents a major investment for the company. However, it also represents a significant increase in production capacity for the firm.
- *Purchasing existing plants* from other companies.
- *Acquiring existing companies.* This may be done to increase productive capacity. However, there are usually more important reasons for taking over an existing company, such as to achieve economies of scale that result from increasing market share and reducing staff.
- *Closing plants.* This involves the closing of plants that will not be needed in the future.

25.4 SHOP FLOOR CONTROL

Shop floor control (SFC) is the set of activities in production control that are concerned with releasing production orders to the factory, monitoring and controlling the progress of the orders through the various work centers, and acquiring current information on the status of the orders. A typical SFC system consists of three phases: (1) order release, (2) order scheduling, and (3) order progress. The three phases and their connections to other functions in the production management system are pictured in Figure 25.9. In modern implementations of shop floor control, these phases are executed by a combination of computer and human resources, with a growing proportion accomplished by computer-automated methods. The term *manufacturing execution system* (MES) is used for the computer software that supports SFC and that typically includes the capability to respond to on-line inquiries concerning the status of each of the three phases. Other functions often included in an MES are generation of process instructions, real-time inventory control, machine and tool status monitoring, and labor tracking. In addition, an MES usually provides links to other modules in the firm's information system, such as quality control, maintenance, and product design data.

25.4.1 Order Release

The order release phase of shop floor control provides the documentation needed to process a production order through the factory. The collection of documents is sometimes called the *shop packet*. It typically includes (1) the route sheet, which documents the process plan for the item to be produced (Section 24.1.1), (2) material requisitions to draw the necessary raw materials from inventory, (3) job cards or other means to report direct labor time devoted to the order and to indicate progress of the order through the factory, (4) move tickets to authorize the material handling personnel to transport parts between work centers in the factory if this kind of authorization is required, and (5) the parts list, if required for assembly jobs. In the operation of a conventional factory, which

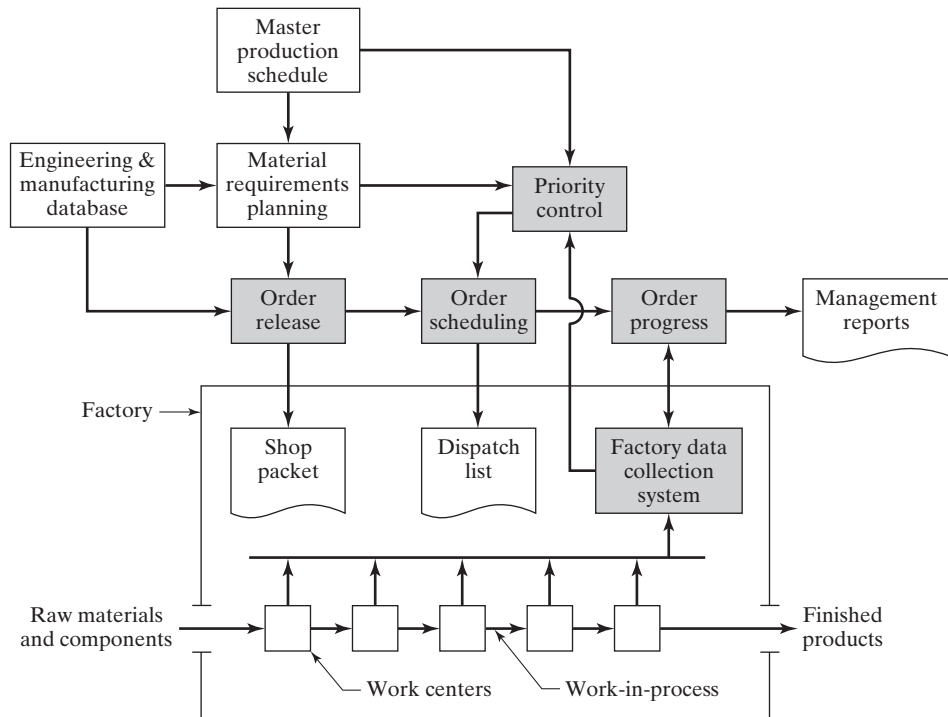


Figure 25.9 Three phases in a shop floor control system.

relies heavily on manual labor, these are paper documents that move with the production order and are used to track its progress through the shop. In a modern factory, automated identification and data capture technologies (Chapter 12) are used to monitor the status of production orders, rendering the paper documents (or at least some of them) unnecessary. These factory data collection systems are discussed in Section 25.4.4.

The order release phase is driven by two inputs, as indicated in Figure 25.9. The first is the authorization to produce that derives from the master schedule. This authorization proceeds through MRP, which generates work orders with scheduling information. The second input to the order release phase is the engineering and manufacturing database that provides the product structure and process plans needed to prepare the various documents that accompany the order through the shop.

25.4.2 Order Scheduling

The order scheduling phase follows directly from the order release phase and assigns the production orders to the various work centers in the plant. In effect, order scheduling executes the dispatching function in PPC. The order scheduling phase prepares a dispatch list that indicates which production orders should be accomplished at the various work centers. It also provides information about relative priorities of the different jobs, for example, by showing due dates for each job. In shop floor control, the dispatch list guides the shop foreman in making work assignments and allocating resources to different jobs to comply with the master schedule.

The order scheduling phase in shop floor control is intended to solve two problems in production control: (1) machine loading and (2) job sequencing. To schedule a given

set of production orders or jobs in the factory, the orders must first be assigned to work centers. Allocating orders to work centers is referred to as *machine loading*. The term *shop loading* is also used, which refers to the loading of all machines in the plant. Since the total number of production orders usually exceeds the number of work centers, each work center will have a queue of orders waiting to be processed. The remaining question is: In what sequence should these jobs be processed?

Answering this question is the problem in **job sequencing**, which involves determining the sequence in which the jobs will be processed through a given work center. To determine this sequence, priorities are established among the jobs in the queue, and the jobs are processed in the order of their relative priorities. *Priority control* is a term used in production control to denote the function that maintains the appropriate priority levels for the various production orders in the shop. As indicated in Figure 25.9, priority control information is an input in the order scheduling phase. Some of the dispatching rules used to establish priorities for production orders in the plant include:

- *First-come-first served*. Jobs are processed in the order in which they arrive at the machine. One might argue that this rule is the most fair.
- *Earliest due date*. Orders with earlier due dates are given higher priorities.
- *Shortest processing time*. Orders with shorter processing times are given higher priorities.
- *Least slack time*. Slack time is defined as the difference between the time remaining until due date and the process time remaining. Orders with the least slack in their schedule are given higher priorities.
- *Critical ratio*. The critical ratio is defined as the ratio of the time remaining until due date divided by the process time remaining. Orders with the lowest critical ratio are given higher priorities.

When an order is completed at one work center, it enters the queue at the next machine in its process routing. That is, the order becomes part of the machine loading for the next work center, and priority control is utilized to determine the sequence of processing among the jobs at that machine.

The relative priorities of the different orders may change over time. Reasons behind these changes include (1) lower or higher than expected demand for certain products, (2) equipment breakdowns that cause delays in production, (3) cancellation of an order by a customer, and (4) defective raw materials that delay an order. The priority control function reviews the relative priorities of the orders and adjusts the dispatch list accordingly.

25.4.3 Order Progress

The order progress phase in shop floor control monitors the status of the various orders in the plant, work-in-process, and other measures that indicate the progress of production. The function of the order progress phase is to provide information that is useful in managing the factory. The information presented to production management is often summarized in the form of reports, such as the following:

- *Work order status reports*. These reports indicate the status of production orders. Typical information in the report includes the current work center where each order is located, processing hours remaining before completion of each order, whether each job is on time or behind schedule, and the priority level of each order.

- *Progress reports.* A progress report is used to report performance of the shop during a certain time period (e.g., a week or month in the master schedule). It provides information on how many orders were completed during the period, how many orders should have been completed during the period but were not, and so forth.
- *Exception reports.* An exception report identifies deviations from the production schedule (e.g., overdue jobs) and similar nonconformities.

These reports are useful to production management in making decisions about allocation of resources, authorization of overtime hours, and other capacity issues, and in identifying problem areas in the plant that adversely affect achieving the master production schedule.

25.4.4 Factory Data Collection System

Various techniques are used to collect data from the factory floor. These techniques range from manual methods that require workers to fill out paper forms that are later compiled to fully automated methods that require no human participation. The factory data collection system (FDC system) consists of the various paper documents, terminals, and automated devices located throughout the plant for collecting data on shop floor operations, plus the means for compiling and processing the data. The factory data collection system serves as an input to the order progress phase in shop floor control, as illustrated in Figure 25.9. It is also an input to priority control, which affects order scheduling. Examples of the types of data on factory operations collected by the FDC system include:

- *Piece counts* completed at each work center
- *Scrapped parts* and *parts needing rework*
- *Operations completed* in the routing sequence for each order
- *Direct labor time* expended on each order
- *Machine downtime.*

The data collection system can also include the time clocks used by employees to punch in and out of work.

The ultimate purpose of the factory data collection system is twofold: (1) to supply status and performance data to the shop floor control system and (2) to provide current information to production foremen, plant management, and production control personnel. To accomplish this purpose, the factory data collection system must input data to the plant computer system. In current CIM technology, this is done using an on-line mode, in which the data are entered directly into the plant computer system and are immediately available to the order progress phase. The advantage of on-line data collection is that the data file representing the status of the shop can be kept current at all times. As changes in order progress are reported, these changes are immediately incorporated into the shop status file. Personnel with a need to know can access this status in real time and be confident that they have the most up-to-date information on which to base any decisions. Even though a modern FDC system is largely computerized, paper documents are still used in factory operations, and the following coverage includes both manual (clerical) and automated systems.

Manual Data Input Techniques. Manually oriented techniques of factory data collection require production workers to read from and fill out paper forms indicating

order progress data. The forms are subsequently turned in and compiled, using a combination of clerical and computerized methods. The paper forms include the following:

- *Job traveler.* This is a log sheet that travels with the shop packet through the factory. Workers who spend time on the order are required to record their times on the log sheet along with other data such as the date, piece counts, and defects. The job traveler becomes the chronological record of the processing of the order. The trouble with this method is its inherent incompatibility with the principles of real-time data collection. Because the job traveler moves with the order, it is not readily available for compiling current order progress.
- *Employee time sheets.* In the typical operation of this method, a daily time sheet is prepared for each worker, and the worker must fill out the form to indicate work that he or she accomplished during the day. Typical data entered on the form include order number, operation number on the route sheet, number of pieces completed during the day, and time spent. The time sheet is turned in daily, and order progress information is compiled (usually by clerical staff).
- *Operation tear strips.* With this technique, the traveling documents include a set of preprinted tear strips that can be easily separated from the shop packet. The preprinted data on each tear strip includes order number and route sheet details. When a worker finishes an operation or at the end of the shift, he or she tears off one of the tear strips, records the piece count and time data, and turns in the form to report order progress.
- *Prepunched cards.* This is essentially the same technique as the tear strip method, except that prepunched computer cards are included with the shop packet instead of tear strips. The difference in the use of prepunched cards is that mechanized data processing procedures can be used to record some of the data to compile the daily progress report.

There are problems with all of these manually oriented data collection procedures. They all rely on the cooperation and clerical accuracy of factory workers to record data onto a paper document. There are invariably errors in this kind of procedure. Error rates associated with handwritten entry of data average about 3% (one error out of 30 data entries). Some of the errors can be detected by the clerical staff who compile the order progress records. Examples of detectable errors include wrong dates, incorrect order numbers (the clerical staff knows which orders are in the factory, and they can usually figure out when an erroneous order number has been entered by a worker), and incorrect operation numbers on the route sheet. (If the worker enters a certain operation number, but the preceding operation number has not been started, then an error has been made.) Other errors are more difficult to identify. If a worker enters a piece count of 150 pieces that represents the work completed in one shift when the batch size is 250 parts, this is difficult for the clerical staff to verify. If a different worker on the following day completes the batch and also enters a piece count of 150, then it is obvious that one of the workers overstated his or her production, but which one? Maybe both.

Another problem is the delay in submitting the order progress data for compilation. There is a time lapse between when events occur in the shop and when the paper data representing those events are submitted. The job traveler method is the worst offender in this regard. Here the data might not be compiled until the order has been completed, too late to take any corrective action. This method is of little value in a shop floor control system. The remaining manual methods suffer a one-day delay since the shop data are generally submitted at the end of the shift, and a summary compilation is not available until the following day. In addition to the delay in submitting the order data, there is also a delay associated

with compiling the data into useful reports. Depending on how the order progress procedures are organized, the compilation may add several days to the reporting cycle.

Automated and Semiautomated Data Collection Systems. To avoid the problems associated with the manual and clerical procedures, some factories use data collection terminals located throughout the factory. Workers input data relative to order progress using simple keypads or conventional alphanumeric keyboards. Data entered by keyboard are subject to error rates of around 0.3% (one error in 300 data entries), an order of magnitude improvement in data accuracy over handwritten entry. Also, error-checking routines can be incorporated into the entry procedures to detect syntax and certain other types of errors. Because of their widespread use in society, PCs have become common in factories, both for data collection and to present engineering and production data to shop personnel.

The data entry methods also include automatic identification and data collection (AIDC) technologies such as bar codes and radio frequency identification (RFID). Certain types of data such as order number, product identification, and operation sequence number can be entered with automated techniques using bar-coded or magnetized cards included with the shop documents.

Some of the configurations of data collection terminals that can be installed in the factory include

- *One centralized terminal.* In this arrangement, there is a single terminal located centrally in the plant. This requires all workers to walk from their workstations to the central location when they must enter the data. If the plant is large, this is inconvenient and inefficient. Also, use of the terminal tends to increase at time of shift change, resulting in significant lost time for the workers.
- *Satellite terminals.* In this configuration, there are multiple data collection terminals located throughout the plant. The number and locations are designed to strike a balance between minimizing the investment cost in terminals and maximizing the convenience of the plant workers.
- *Workstation terminals.* The most convenient arrangement for workers is to have a data collection terminal available at each workstation. This minimizes the time lost in walking to satellite terminals or a single central terminal. Although the investment cost of this configuration is the greatest, it may be justified when the number of data transactions is relatively large and when the terminals are also designed to collect certain data automatically.

The trend in industry is toward more automated factory data collection. Although they are called “automated,” many of the techniques require the participation of human workers, as the coverage has indicated; hence the term *semiautomated* is included in the heading for this category of data collection system.

Automated data collection (with no human participation) is being enabled by a new communications standard called MTConnect,¹ which is an open-source protocol based on Internet standards that allows the retrieval of data from factory equipment for shop floor control and other applications. Basic data collected by MTConnect includes machine status (running or not running), from which equipment performance metrics such as overall equipment effectiveness (OEE) can be derived [12]. OEE is based on equipment

¹Version 1.0 of the MTConnect protocol was first released in December 2008 [15].

availability (reliability), utilization, and several other measures (Section 26.3.3). It cannot be accurately determined without continuous monitoring of the equipment, and this requires automated data collection such as MTConnect. Machine tool builders are now instrumenting the protocol on their new machines, and protocol adapters are available for existing factory equipment. And software developers are introducing new applications that optimize the use of data obtained from MTConnect.

25.5 INVENTORY CONTROL

Inventory control attempts to achieve a compromise between two opposing objectives: (1) minimizing the cost of holding inventory and (2) maximizing customer service. Minimizing inventory cost suggests keeping inventory to a minimum, in the extreme, zero inventory. Maximizing customer service implies keeping large stocks on hand so that customer orders can immediately be filled.

The types of inventory of greatest interest in PPC are raw materials, purchased components, in-process inventory (WIP), and finished products. The major costs of holding inventory are (1) investment costs, (2) storage costs, and (3) cost of possible obsolescence or spoilage. The three costs are referred to collectively as *carrying costs* or *holding costs*. Investment cost is usually the largest component. When a company borrows money to invest in materials to be processed in the factory, it must pay interest on that money until the customer pays for the finished product. But many months may elapse between start of production and delivery to the customer. Even if the company uses its own money to purchase the starting materials, it is still making an investment that has a cost associated with it.

Companies can minimize holding costs by minimizing the amount of inventory on hand. However, when inventories are minimized, customer service may suffer, inducing customers to take their business elsewhere. This also has a cost, called the *stock-out cost*. Most companies want to minimize stock-out cost and provide good customer service. Thus, they are caught on the horns of an inventory control dilemma, balancing carrying costs against the cost of poor customer service.

In the introduction to MRP (Section 25.2), two types of demand are distinguished, independent and dependent. Different inventory control procedures are used for independent and dependent demand items. For dependent demand items, MRP is the most widely implemented technique. For independent demand items, order point inventory systems are commonly used.

Order point systems are concerned with two related problems that must be solved when managing inventories of independent demand items: (1) how many units should be ordered? and (2) when should the order be placed? The first problem is often solved using economic order quantity formulas. The second problem can be solved using reorder point methods.

Economic Order Quantity Formula. The problem of deciding on the most appropriate quantity to order or produce arises when the demand rate for the item is fairly constant, and the rate at which the item is produced is significantly greater than its demand rate. This is the typical situation known as *make-to-stock*. The same basic problem occurs with dependent demand items when usage of the item is relatively constant over time due to a steady production rate of the final product with which the item is correlated. In this

case, it may make sense to endure some inventory holding costs so that the frequency of setups and their associated costs can be reduced. In these situations where demand remains steady, inventory is gradually depleted over time and then quickly replenished to some maximum level determined by the order quantity. The sudden increase and gradual reduction in inventory causes the inventory level over time to have a sawtooth appearance, as depicted in Figure 25.10.

A total cost equation can be derived for the sum of carrying cost and setup cost for the inventory model in Figure 25.10. Because of the sawtooth behavior of inventory level, the average inventory level is half the maximum level Q in the figure. The total annual inventory cost is therefore given by

$$TIC = \frac{C_h Q}{2} + \frac{C_{su} D_a}{Q} \quad (25.1)$$

where TIC = total annual inventory cost (holding cost plus ordering cost), \$/yr; Q = order quantity, pc/order; C_h = carrying or holding cost, \$/pc/yr; C_{su} = setup cost and/or ordering cost for an order, \$/setup or \$/order; and D_a = annual demand for the item, pc/yr. In the equation, the ratio D_a/Q is the number of orders or batches produced per year, which therefore gives the number of setups per year.

The holding cost C_h consists of two main components, investment cost and storage cost. Both are related to the time that the inventory spends in the warehouse or factory. As previously indicated, the investment cost results from the money the company must invest in the inventory before it is sold to customers. This inventory investment cost can be calculated as the interest rate paid by the company i (percent), multiplied by the value (cost) of the inventory.

Storage cost occurs because the inventory takes up space that must be paid for. The amount of the cost is generally related to the size of the part and how much space it occupies. As an approximation, it can be related to the value or cost of the item stored. This is the most convenient method of valuating the storage cost of an item. By this method, the storage cost equals the cost of the inventory multiplied by the storage rate, s . The term s is the storage cost as a fraction (percent) of the value of the item in inventory.

Combining interest rate and storage rate into one factor, $h = i + s$. The term h is called the *holding cost rate*. Like i and s , it is a fraction (percent) that is multiplied by the cost of the part to evaluate the holding cost of investing in and storing inventory. Accordingly, holding cost can be expressed as follows:

$$C_h = hC_{pc} \quad (25.2)$$

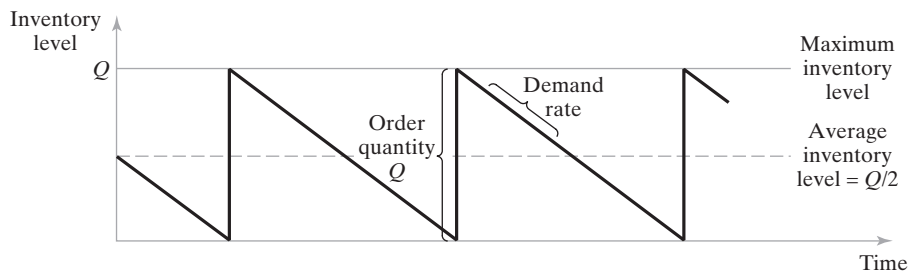


Figure 25.10 Model of inventory level over time in the typical make-to-stock situation.

where C_h = holding (carrying) cost, \$/pc/yr; C_{pc} = unit cost of the item, \$/pc; and h = holding cost rate, rate/yr.

Setup cost includes the cost of idle production equipment during the changeover time between batches. The costs of labor performing the setup changes might also be added in. Thus,

$$C_{su} = T_{su}C_{dt} \quad (25.3)$$

where C_{su} = setup cost, \$/setup or \$/order; T_{su} = setup or changeover time between batches, hr/setup or hr/order; and C_{dt} = cost rate of machine downtime during the changeover, \$/hr. In cases where parts are ordered from an outside vendor, the price quoted by the vendor usually includes a setup cost, either directly or in the form of quantity discounts. C_{su} should also include the internal costs of placing the order to the vendor.

Equation (25.1) excludes the actual annual cost of part production. If this cost is included, then annual total cost is given by the equation

$$TC = D_a C_{pc} + \frac{C_h Q}{2} + \frac{C_{su} D_a}{Q} \quad (25.4)$$

where $D_a C_{pc}$ = annual demand (pc/yr) multiplied by cost per item (\$/pc).

If the derivative is taken of either Equation (25.1) or Equation (25.4), the economic order quantity (EOQ, also known as the *economic batch quantity*) formula is obtained by setting the derivative equal to zero and solving for Q . This batch size minimizes the sum of carrying costs and setup costs:

$$Q = EOQ = \sqrt{\frac{2D_a C_{su}}{C_h}} \quad (25.5)$$

where EOQ = economic order quantity (number of parts to be produced per batch, pc/batch or pc/order), and the other terms have been defined previously.

EXAMPLE 25.3 Economic Order Quantity Formula

The annual demand for a certain item made-to-stock = 15,000 pc/yr. One unit of the item costs \$20.00, and the holding cost rate = 18%/yr. Setup time to produce a batch = 5 hr. The cost of equipment downtime plus labor = \$150/hr. Determine the economic batch quantity and the total inventory cost for this case.

Solution: Setup cost $C_{su} = 5 \times \$150 = \750 . Holding cost per unit = $0.18 \times \$20.00 = \3.60 . Using these values and the annual demand rate in the EOQ formula,

$$EOQ = \sqrt{\frac{2(15,000)(750)}{3.60}} = \mathbf{2,500 \text{ units}}$$

Total inventory cost is given by the TIC equation:

$$TIC = 0.5(3.60)(2,500) + 750(15,000/2,500) = \mathbf{\$9,000}$$

Including the actual production costs in the annual total, Equation (25.4),

$$TC = 15,000(20) + 9,000 = \mathbf{\$309,000}$$

The economic order quantity formula has been widely used for determining so-called optimum batch sizes in production. More sophisticated forms of Equations (25.1) and (25.4) have appeared in the literature, for example, models that take production rate into account to yield alternative EOQ equations. Equation 25.5 is the most general form and, in the author's opinion, quite adequate for most real-life situations. The difficulty in applying the EOQ formula is in obtaining accurate values of the parameters in the equation, namely (1) setup cost and (2) inventory carrying costs. These cost factors are usually difficult to evaluate; yet they have an important impact on the calculated economic batch size.

There is no disputing the mathematical accuracy of the EOQ equation. Given specific values of annual demand (D_a), setup cost (C_{su}), and carrying cost (C_h), Equation (25.5) computes the lowest cost batch size to whatever level of precision desired. The trouble is that the user may be lulled into the false belief that no matter how much it costs to change the setup, the EOQ formula always calculates the optimum batch size. For many years in U.S. industry, this belief tended to encourage long production runs by manufacturing managers. The thought process went something like this: "If the setup cost increases, just increase the batch size, because the EOQ formula always calculates the optimum production quantity."

Users of the EOQ equation must not lose sight of the total inventory cost (TIC) equation, Equation (25.1), from which *EOQ* is derived. Examining the TIC equation, a cost-conscious production manager would quickly conclude that both costs and batch sizes can be reduced by decreasing the values of holding cost (C_h) and setup cost (C_{su}). The production manager may not be able to exert much influence on holding cost because it is determined largely by prevailing interest rates. However, methods can be developed to reduce setup cost by reducing the time required to accomplish the changeover of a production machine. Reducing setup time is an important focus of just-in-time production, and it is discussed in Section 26.2.2.

Reorder Point Systems. Determining the economic order quantity is not the only problem that must be solved in controlling inventories in make-to-stock situations. The other problem is deciding when to reorder. One of the most widely used methods is the reorder point system. Although the inventory level in Figure 25.10 is drawn as a very deterministic sawtooth diagram, the reality is that there are usually variations in demand rate during the inventory order cycle, as illustrated in Figure 25.11. Accordingly, when to reorder cannot be predicted with the precision that would exist if demand rate were

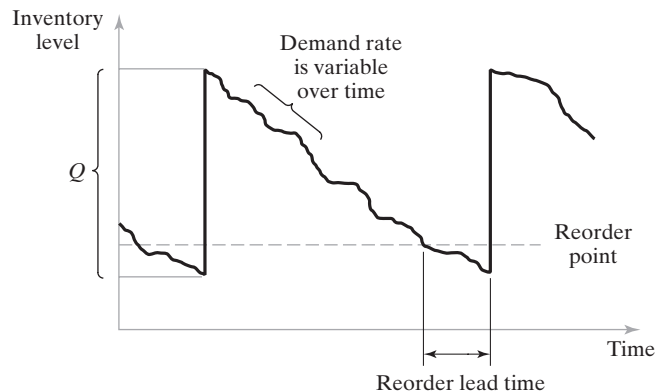


Figure 25.11 Operation of a reorder point inventory system.

a known constant value. In a reorder point system, when the inventory level for a given stock item falls to some point specified as the reorder point, then an order is placed to restock the item. The reorder point is specified at a sufficient quantity level to minimize the probability of a stock-out between when the reorder point is reached and the new order is received. Reorder point triggers can be implemented using computerized inventory control systems that continuously monitor the inventory level as demand occurs and automatically generate an order for a new batch when the level declines below the reorder point.

25.6 MANUFACTURING RESOURCE PLANNING (MRP II)

The initial versions of material requirements planning in the early 1970s were limited to the planning of purchase orders and factory work orders and did not take into account such issues as capacity planning or feedback data from the factory. MRP was strictly a materials and parts planning tool whose calculations were based on the master production schedule (MPS), product structure data, and inventory records. Over time, it became evident that MRP should be tied to other software packages to create a more integrated PPC system. The PPC software packages that evolved from MRP have gone through several generations and enlargements, two of which are described in this section and the following: (1) manufacturing resource planning and (2) enterprise resource planning.

Manufacturing resource planning evolved from material requirements planning in the 1980s. It came to be abbreviated MRP II to distinguish it from the original abbreviation and to indicate that it was second generation, that is, more than just a material planning system. **Manufacturing resource planning** can be defined as a computer-based system for planning, scheduling, and controlling the materials, resources, and supporting activities needed to meet the master production schedule. MRP II is a closed-loop system that integrates and coordinates the major functions of the business involved in production. This means that MRP II incorporates feedback of data on various aspects of operating performance so that corrective action can be taken in a timely manner; that is, MRP II includes shop floor control.

MRP II can be considered to consist of three major modules, as illustrated in Figure 25.12: (1) material requirements planning, or MRP, (2) capacity planning, and (3) shop floor control (Sections 25.2, 25.3, and 25.4, respectively). The MRP module accomplishes the planning function for materials, parts, and assemblies, based on the master production schedule, and it provides a factory production schedule that matches the arrival of materials determined by MRP. The capacity planning module interacts with the MRP module to ensure that the schedules created by MRP are feasible. Finally, the shop floor control module performs the feedback control function using its factory data collection system to implement the three phases of order release, order scheduling, and order progress.

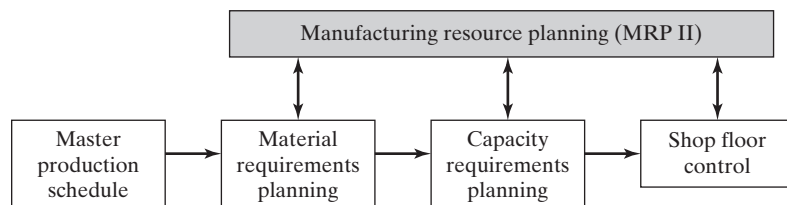


Figure 25.12 Manufacturing resource planning (MRP II).

How does MRP II relate to CAD/CAM and CIM? If the reader compares Figure 25.12 with Figure 23.5, there is an overlap between the elements of MRP II in Figure 25.12 and CAM (manufacturing planning and control) in Figure 23.5. MRP II does not include NC part programming, which is a significant component of CAM, and it does not include quality control or process control of individual operations in the factory. The overlap occurs in the production planning and control functions. So, MRP II can be considered a software package that is used to implement the PPC functions in computer-aided manufacturing, and CAM is an essential part of computer-integrated manufacturing.

Manufacturing resource planning is an improvement over material requirements planning because it includes production capacity and shop floor feedback in its computations. But MRP II is limited to the manufacturing operations of the firm. As further enhancements were made to MRP II systems, the trend was to consider all of the operations and functions of the enterprise rather than just manufacturing. The culmination of this trend in the 1990s was enterprise resource planning.

25.7 ENTERPRISE RESOURCE PLANNING (ERP)

Enterprise resource planning (ERP) is a computer software system that organizes and integrates all of the business functions and associated data of an organization through a single, central database. The functions include sales, marketing, purchasing, design, production, distribution, finance, human resources, and more. In the software of an ERP system, these business functions are organized into modules, each focused on a different function or group of functions within the organization. Each module and the business functions within it are designed with “best practices” in mind, which means that the software vendor has attempted to incorporate the best way to accomplish the business function. The modules are integrated through the ERP framework to accomplish transactions that may affect several functional areas. Figure 25.13 shows how an ERP system might be organized into software modules for a manufacturing firm. Table 25.1 lists the kinds of business functions that might be included in each module.

Because it uses a single database, ERP avoids problems such as data redundancy, conflicting data in different databases, and communication difficulties between different databases and the modules that operate on these databases. Before ERP, departments within an organization would typically have their own databases and computer systems. For example, the database of the Human Resources department would contain the personal data about each employee and the reporting structure within each department.

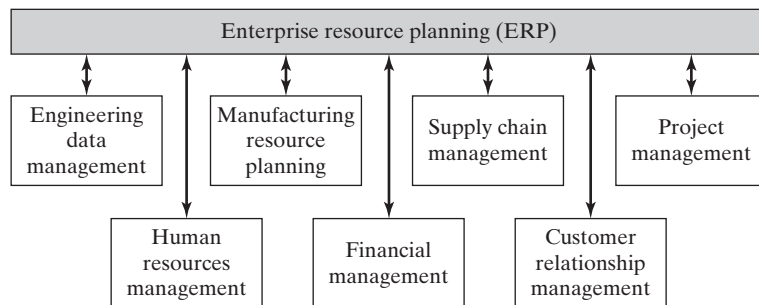


Figure 25.13 Enterprise resource planning (ERP).

TABLE 25.1 Business Functions that Might be Included in the Software Modules of Figure 25.13.

ERP Module	Typical Business Functions Included
Engineering data management	Product research and development, product design, computer-aided design, bills of materials, product data management, product lifecycle management
Manufacturing resource management	Master production scheduling, material requirements planning, capacity planning, shop floor control, process planning, inventory control, product costing, quality control
Supply chain management	Supply chain planning, vendor relationship management, supplier scheduling, purchasing, inventory management
Project management	Project planning, project costing, work breakdown structure, project scheduling, project control
Human resources management	Payroll, benefits, training, workforce planning, recruiting, job applicant processing, job descriptions, training, employee performance appraisals, employee personal data, time and attendance, retirement and separation, organization charts
Financial management	Capital budgeting, asset management, investment management, cost accounting, cost control, activity-based costing, accounts payable, accounts receivable, cash management
Customer relationship management	Sales, marketing, customer contact, customer service, order input and processing, pricing, product availability, delivery, shipping, invoicing, product returns, handling of customer complaints

At the same time, the Payroll department would calculate the weekly wages of employees, using much of the same personal data but keeping it in a separate database. When an employee left the company, or a new employee joined, both databases would need to be updated. As another example, an engineering change in a part design impacts process planning and the production departments in which the part is made. Because all ERP modules access the same central database, data transactions accomplished in any given module are immediately accessible by all others. Thus, the engineering change notice is immediately available to manufacturing engineering, industrial engineering, and other departments affected by the change.

Enterprise resource planning commonly runs as a client-server system, which means that users access and utilize the system through personal computers at their respective workplaces. ERP operates on a company-wide basis; it is not a plant-based system as MRP applications often are. In ERP, everyone in the organization has access to the same sets of data according to their individual job responsibilities (not all of the data can be accessed by all employees). When a customer orders a product and the order is entered into the ERP system, all of the business functions that are affected by the order, such as inventory records, purchasing, production schedules, shipping, and invoicing, are updated in the central database. Anyone requiring access to the database has the latest information, and this may include customers and external suppliers.²

Today's ERP systems feature open architecture and the software consists of individual modules that are combined into one system. This means that a company can

²As ERP has evolved and expanded, software vendors have tried to differentiate the software generations using terms such as *ERP II* and even *ERP III*. Although the terminology is not always consistent, ERP II typically means that vendors can access the company's ERP database on a collaborative basis, and ERP III expands the scope of collaboration to include customers.

select certain modules from one software vendor and other modules from a different vendor, thus obtaining the best combination of modules for its own business. For example, if one vendor is recognized as having the best accounting module, and another has the best MRP module, these two software packages can be used within the company's ERP system, even though the ERP software itself was perhaps purchased from a completely different supplier. Modularity in the ERP system also permits the user company to acquire only those business function that it needs or wants to automate. Some ERP systems are designed for service organizations, which would have no need for manufacturing resource planning.

The success of enterprise resource planning depends on the accuracy and currency of its database, which means that all transactions and events that affect the database must be entered as they occur [2]. When a sales order comes in, that transaction must be entered immediately and accurately because it actuates other functions in the system such as order processing, purchasing, inventory records, factory work orders, and production schedules. If a part is received by the plant and taken directly to the shop floor because it is urgently needed, but the receipt is never recorded due to oversight, then the ERP database is missing that transaction, and this inaccuracy cascades throughout the other functions in the system. If similar discrepancies occur in other areas, then the accuracy of the ERP model representing plant status erodes over time. As this erosion occurs and is recognized within the organization, people gradually lose faith in the system and begin working around it instead of using it properly, exacerbating the problem. To summarize, as powerful a tool as ERP is, its successful implementation requires a discipline throughout the organization of recording events as they occur and making sure each record is accurate.

REFERENCES

- [1] BAUER, A., R. BOWDEN, J. BROWNE, J. DUGGAN, and G. LYONS, *Shop Floor Control Systems*, Chapman & Hall, London, UK, 1994.
- [2] BROWN, A. S., "Lies Your ERP System Tells You," *Mechanical Engineering*, March 2006, pp. 36–39.
- [3] CHASE, R. B., and N. J. AQUILANO, *Production and Operations Management: A Life Cycle Approach*, 5th ed., Richard D. Irwin, Inc., Homewood, IL, 1989.
- [4] REID, R. D., and N. R. SANDERS, *Operations Management*, 5th ed., John Wiley & Sons, Inc., Hoboken, NJ, 2012.
- [5] RUSSELL, R. S., and B. W. TAYLOR III, *Operations Management*, 7th ed., Pearson Education, Upper Saddle River, NJ, 2010.
- [6] SILVER, E. A., D. F. PYKE, and R. PETERSON, *Inventory Management and Production Planning and Control*, John Wiley & Sons, Inc., Hoboken, NJ, 1998.
- [7] SIPPER, D., and R. L. BUFFIN, *Production: Planning, Control, and Integration*, McGraw-Hill, New York, 1997.
- [8] SULE, D. R., *Industrial Scheduling*, PWS Publishing Company, Boston, MA, 1997.
- [9] VEILLEUX, R. F., and L. W. PETRO, *Tool and Manufacturing Engineers Handbook*, 4th ed., Volume V, *Manufacturing Management*, Society of Manufacturing Engineers, Dearborn, MI, 1988.
- [10] VOLLMAN, T. E., W. L. BERRY, and D. C. WHYBARK, *Manufacturing Planning and Control Systems*, 4th ed., McGraw-Hill, New York, 1997.
- [11] WAURZYNIAK, P., "Communicating with the Shop Floor," *Manufacturing Engineering*, August 2012, pp. 19–30.

- [12] WAURZYNIAK, P., “Shop-Floor Monitoring Critical to Improving Factory Processes,” *Manufacturing Engineering*, July 2013, pp. 63–69.
- [13] www.investopedia.com/terms/c/Capacity-requirements-planning
- [14] www.wikipedia.org/wiki/Enterprise_resource_planning
- [15] www.wikipedia.org/wiki/MTConnect

REVIEW QUESTIONS

- 25.1 What is production planning?
- 25.2 Name the four activities within the scope of production planning.
- 25.3 What is production control?
- 25.4 What is the difference between the aggregate production plan and the master production schedule?
- 25.5 What is material requirements planning (MRP)?
- 25.6 What is the difference between independent demand and dependent demand?
- 25.7 What are the three inputs to the MRP processor?
- 25.8 What are common-use items in MRP?
- 25.9 Name the benefits of a well-designed MRP system.
- 25.10 What is capacity planning?
- 25.11 Capacity adjustments can be divided into short-term adjustments and long-term adjustments. Name some of the capacity adjustments for the short term.
- 25.12 What is shop floor control?
- 25.13 What are the three phases of shop floor control? Provide a brief definition of each activity.
- 25.14 What does the term *machine loading* mean?
- 25.15 What is MTConnect?
- 25.16 What are carrying costs in inventory control?
- 25.17 What is a reorder point system in inventory control?
- 25.18 What is the difference between material requirements planning (MRP) and manufacturing resource planning (MRP II)?
- 25.19 What is enterprise resource planning (ERP)?

PROBLEMS

Answers to problems labeled **(A)** are listed in the appendix.

Material Requirements Planning

- 25.1 Using the master schedule of Figure 25.2(b), and the product structures in Figures 25.4 and 25.6, determine the time-phased requirements for component C6 and raw material M6. Lead times are as follows: for P1, assembly lead time is one week; for P2, assembly lead time is one week; for S2, assembly lead time is one week; for S3, assembly lead time is one week; for C6, manufacturing lead time is two weeks; and for M6, ordering lead time is two weeks. Assume that the current inventory status for all of the above items is zero units on hand, and zero units on order. The format of the solution should be similar to that presented in Figure 25.7.

- 25.2** Solve Problem 25.1 except that the current inventory on hand and on order for S3, C6, and M6 is as follows: for S3, inventory on hand is 2 units and quantity on order is zero; for C6, inventory on hand is 5 units and quantity on order is 10 for delivery in week 2; and for M6, inventory on hand is 10 units and quantity on order is 50 for delivery in week 2.
- 25.3** Material requirements are to be planned for component C2 given the master schedule for P1 and P2 in Figure 25.2(b), and the product structures in Figures 25.4 and 25.6. Assembly lead time for products and subassemblies (P and S levels) is one week, manufacturing lead times for components (C level) is two weeks, and ordering lead time for raw materials (M level) is three weeks. Determine the time-phased requirements for M2, C2, and S1. Assume there are no common-use items other than those specified by the product structures for P1 and P2, and that all on-hand inventories and scheduled receipts are zero. Use a format similar to Figure 25.7. Ignore demand beyond period 10.
- 25.4** Requirements are to be planned for component C5 in product P1. Required deliveries for P1 are given in Figure 25.2(b), and the product structure for P1 is shown in Figure 25.4. Assembly lead time for products and subassemblies (P and S levels) is one week, manufacturing lead times for components (C level) is two weeks, and ordering lead time for raw materials (M level) is three weeks. Determine the time-phased requirements for M5, C5, and S2 to meet the master schedule. Assume no-common use items. On-hand inventories are 100 units for M5 and 50 units for C5, zero for S2. Scheduled receipts are zero for these items. Use a format similar to Figure 25.7. Ignore demand for P1 beyond period 10.
- 25.5** Solve the previous problem except that the following additional information is known: scheduled receipts of M5 are 50 units in week 3 and 50 units in week 4.

Order Scheduling

- 25.6 (A)** It is currently day 10 in the production calendar of the Machine Shop. Three orders (A, B, and C) are to be processed at a particular machine tool. The orders arrived in the sequence A-B-C. The table below indicates the process time remaining and production calendar due date for each order. Determine the sequence of the orders that would be scheduled using the following priority control rules: (a) first-come-first-serve, (b) earliest due date, (c) shortest processing time, (d) least slack time, and (e) critical ratio.

Order	Remaining Process Time	Due Date
A	4 days	Day 20
B	16 days	Day 30
C	6 days	Day 18

- 25.7** For each solution (a) through (e) in the previous problem, determine which jobs are delivered on time and which jobs are tardy.

Order-Point Inventory Systems

- 25.8 (A)** Annual demand for a certain part is 1,800 units per yr. The part is produced in a batch model manufacturing system. Annual holding cost per piece is \$3.00. It takes 1.5 hr to set up the machine to produce the part, and cost of system downtime is \$200/hr. Determine (a) economic batch quantity for this part and (b) associated total inventory cost. (c) How many batches are produced per year?
- 25.9** Annual demand for a made-to-stock product is 50,000 units. Each unit costs \$8.00, and the annual holding cost rate is 18%. Setup time to change over equipment for this product is 2.0 hr, and the downtime cost of the equipment is \$180/hr. Determine (a) economic order quantity and (b) total inventory costs. (c) How many batches are produced per year?

- 25.10** Demand for a certain part is 22,000 units/yr. Unit cost is \$9.35, and holding cost rate is 24%/yr. Setup time between parts is 2.5 hr, and downtime cost during changeover is \$125/hr. Determine (a) economic order quantity, (b) total inventory costs, and (c) total inventory cost per year as a proportion of actual annual part production costs.
- 25.11** A part is produced in batch sizes of 2,500 pieces. Annual demand is 45,000 pieces, and piece cost is \$6.50. Setup time to run a batch is 1.5 hr, cost of downtime on the affected equipment is figured at \$220/hr, and annual holding cost rate is 30%. What would the annual savings be if the product were produced in the economic order quantity?
- 25.12** In the previous problem, (a) how much would setup time have to be reduced in order to make the batch size of 2,500 pieces equal to the economic batch quantity? (b) How much would total inventory costs be reduced if the economic batch quantity = 2,500 units compared to the economic batch quantity calculated in the previous problem? (c) How much would total inventory costs be reduced if the setup time were equal to the value obtained in part (a) compared to the 1.5 hr used in the previous problem?
- 25.13** A machine tool produces 26 components for an assembled product. These are the only parts produced by the machine. To keep in-process inventories low, a batch size of 75 units is produced for each component. Demand for the product is 900 units/yr. Production downtime costs \$120/hr. Changeover time between batches is 1.5 hr, and average cycle time per part = 4.0 min. The annual holding cost for each of the 26 parts is \$1.60/pc. (a) Determine total annual inventory cost for the 26 parts. (b) Is the given production schedule feasible for a one-shift operation? That is, can 900 units of each of the 26 components be completed in 2,000 hr? If so, how many idle hours of machine time occur in the 2,000 hr? If not, how many overtime hours must be authorized during the year?
- 25.14** For the data in the previous problem, (a) in how many minutes must the changeover between batches be accomplished in order for 75 units to be the economic batch quantity, and (b) can 900 units of each of the 26 components be completed in 2,000 hr? If so, how many idle hours of machine time occur in the 2,000 hr? If not, how many overtime hours must be authorized during the year?
- 25.15** (A) Annual demand for a certain part is 6,000 units. At present the setup time on the machine tool that makes this part is 4.0 hr. Cost of downtime on this machine is \$200/hr. Annual holding cost per part is \$2.40. Determine (a) economic batch quantity and (b) total inventory costs for this data. Also, determine (c) economic batch quantity and total inventory costs if the changeover time could be reduced to 12 min.
- 25.16** A variety of assembled products are made in batches on a batch-model assembly line. Every time a different product is produced, the line must be changed over, which results in lost production time. The assembled product of interest here has an annual demand of 8,000 units. The changeover time to set up the line for this product is 12.0 hr. The company figures that the hourly rate for lost production time on the line due to changeovers is \$250/hr. Annual holding cost for the product is \$7.00 per unit. The product is currently made in batches of 800 units for shipment each month to the wholesale distributor. (a) Determine the total annual inventory cost for this product when produced in batch sizes of 800 units. (b) What is the economic batch quantity for this product? (c) How often would shipments be made using this economic batch quantity? (d) How much would the company save in annual inventory costs, if it produced batches equal to the economic batch quantity rather than 800 units?
- 25.17** A two-bin approach is used to control inventory for a certain low-cost hardware item. Each bin holds 300 units of the item. When one bin becomes empty, an order for 300 units is released to replace the stock in that bin. The order lead time is less than the time it takes to deplete the stock in one bin, so the chance of a stock-out is low. Annual usage of the item is 4,000 units. Ordering cost is \$30. (a) What is the imputed holding cost per unit for this item, based on the data given? (b) If the actual annual holding cost per unit is five cents, what lot size should be ordered? (c) How much does the current two-bin approach cost the company per year, compared to using the economic order quantity?

Chapter 26

Just-In-Time and Lean Production

CHAPTER CONTENTS

- 26.1 Lean Production and Waste in Manufacturing
- 26.2 Just-In-Time Production Systems
 - 26.2.1 Pull System of Production Control
 - 26.2.2 Setup Time Reduction for Smaller Batch Sizes
 - 26.2.3 Stable and Reliable Production Operations
- 26.3 Autonomation
 - 26.3.1 Stop the Process
 - 26.3.2 Error Prevention
 - 26.3.3 Total Productive Maintenance
- 26.4 Worker Involvement
 - 26.4.1 Continuous Improvement
 - 26.4.2 Visual Management and 5S
 - 26.4.3 Standardized Work Procedures

Material requirements planning (MRP), capacity planning, inventory control, and the other topics discussed in the previous chapter are the traditional areas in a production planning and control system. Just-in-time (JIT) production represents a nontraditional approach that was first used at the Toyota Motor Company in Japan in the 1950s and refined over subsequent decades. Roughly, JIT means delivering materials or parts to the next processing station in a manufacturing sequence just prior to the time when those parts are needed at the station. This results in minimum work-in-process inventory and promotes high quality in the materials and parts that are delivered. JIT is one of the

fundamental approaches used in the Toyota production system. In this chapter, the methods used at Toyota that have come to be called lean production are covered.¹

26.1 LEAN PRODUCTION AND WASTE IN MANUFACTURING

Lean production means doing more work with fewer resources. It is an adaptation of mass production in which work is accomplished in less time, in a smaller space, with fewer workers and less equipment, and yet achieves higher quality levels in the final product. Lean production also means giving customers what they want and satisfying or surpassing their expectations. The term *lean production* was coined by researchers in the International Motor Vehicle Program at the Massachusetts Institute of Technology to describe the way in which production operations were organized at the Toyota Motor Company in Japan during the 1980s [21]. Toyota had pioneered a system of production that was quite different from the mass production techniques used by automobile companies in the United States and Europe. Table 26.1 summarizes most of the comparisons between mass production and lean production.

The Toyota production system had evolved starting in the 1950s to cope with the realities of Japan's post-World War II economy. These realities included (1) a much smaller automotive market than in the United States and Europe, (2) a scarcity of Japanese capital to invest in new plants and equipment, and (3) an outside world that included many well-established automobile companies determined to defend their markets against Japanese imports [3]. To deal with these challenges, Toyota developed a production system that could produce a variety of car models with fewer quality problems, lower inventory levels, smaller manufacturing lot sizes for the parts used in the cars, and reduced lead times to produce the cars. Development of the Toyota production system was led by Taiichi Ohno, a Toyota vice president, whose efforts were motivated largely by his desire to eliminate waste in all its various forms in production operations.

The ingredients of a lean production system can be visualized as the structure shown in Figure 26.1.² At the base of the structure is the foundation of the Toyota system: elimination of waste in production operations. Standing on the foundation are two pillars [10]: (1) just-in-time production and (2) autonomation (automation with a human touch). The two pillars support a roof that symbolizes a focus on the customer. The goal of lean production

TABLE 26.1 Comparison of Mass Production and Lean Production

Mass Production	Lean Production
Inventory buffers	Minimum waste
Just-in-case deliveries	Just-in-time deliveries
Just-in-case inventory	Minimum inventory
Acceptable quality level (AQL)	Perfect first-time quality
Taylorism* (workers told what to do)	Worker teams
Maximum efficiency	Worker involvement
Inflexible production systems	Flexible production systems
If it ain't broke, don't fix it	Continuous improvement

*Named after Frederick W. Taylor, a well-known proponent of Scientific Management in the late 1800s and early 1900s (see Historical Note 2.1).

¹This chapter is based on [5], Chapter 20.

²Various forms of the "lean structure" have appeared in the literature. The one shown here is representative.

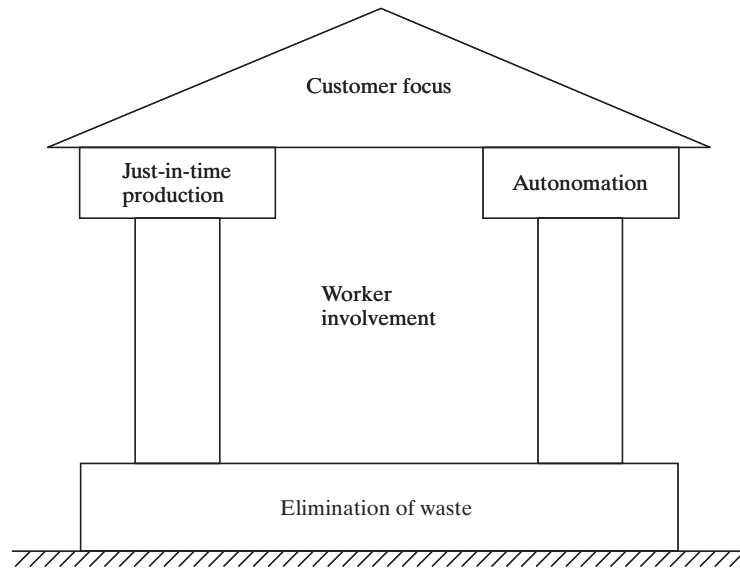


Figure 26.1 The structure of a lean production system.

is customer satisfaction. Between the two pillars and residing inside the structure is an emphasis on worker involvement: workers who are motivated, flexible, and continually striving to make improvements. Table 26.2 identifies the elements that make up just-in-time production, worker involvement, and autonomation in the lean production structure.

The underlying basis of the Toyota production system is elimination of waste, or in Japanese, *muda*. The very word has the sound of something unclean (perhaps because it begins with the English word “mud”). In manufacturing, waste abounds. Activities in manufacturing can be divided into three categories, as pictured in Figure 26.2:

- *Actual work* that consists of activities that add value to the product. Examples include processing steps to fabricate a part and assembly operations to build a product.
- *Auxiliary work* that supports the actual value-adding activities. Examples include loading and unloading a production machine that performs processing steps.
- *Muda*, activities that neither add value to the product nor support the value-adding work. If these activities were not performed, there would be no adverse effect on the product.

TABLE 26.2 The Elements of Just-in-Time Production, Worker Involvement, and Autonomation in the Lean Production Structure

Just-in-Time Production	Worker Involvement	Autonomation
Pull system of production control using <i>kanbans</i>	Continuous improvement	Stop the process when something goes wrong (e.g., a defect is produced)
Setup time reduction for smaller batch sizes	Quality circles	Prevention of overproduction
Production leveling	Visual management	Error prevention and mistake proofing
On-time deliveries	The 5S system	Total productive maintenance for reliable equipment
Zero defects	Standardized work procedures	
Flexible workers	Participation in total productive maintenance by workers	

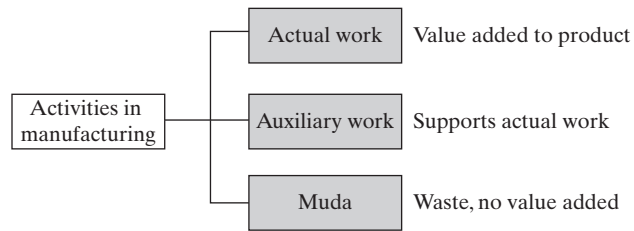


Figure 26.2 Three categories of activities in manufacturing.

Ohno identified the following seven forms of waste in manufacturing that he wanted to eliminate by means of the various procedures that made up the Toyota system:

1. *Production of defective parts*
2. *Overproduction*, the production of more than the number of items needed
3. *Excessive inventories*
4. *Unnecessary processing steps*
5. *Unnecessary movement of people*
6. *Unnecessary transport and handling of materials*
7. *Workers waiting.*

Eliminating production of defective parts (waste form 1) requires a quality control system that achieves perfect first-time quality. In the area of quality control, the Toyota production system was in sharp contrast with the traditional QC systems used in mass production. In mass production, quality control is typically defined in terms of an acceptable quality level or AQL, which means that a certain minimum level of fraction defects is tolerated. In lean production, by contrast, perfect quality is required. The just-in-time delivery discipline (Section 26.2) used in lean production necessitates a zero defects level in parts quality, because if the part delivered to the downstream workstation is defective, production is forced to stop. There is little or no inventory in a lean system to act as a buffer. In mass production, inventory buffers are used just in case these quality problems occur. The defective work units are simply taken off the line and replaced with acceptable units. However, such a policy tends to perpetuate the cause of the poor quality. Therefore, defective parts continue to be produced. In lean production, a single defect draws attention to the quality problem, forcing the company to take corrective action and find a permanent solution. Workers inspect their own production, minimizing the delivery of defects to the downstream production station.

Overproduction (waste form 2) and excessive inventories (waste form 3) are correlated. Producing more parts than necessary means that there are leftover parts that must be stored. Of all of the forms of muda, Ohno believed that the “greatest waste of all is excess inventory” [10]. Overproduction and excess inventories cause increased costs in the following areas:

- Warehousing (building, lighting and heating, maintenance)
- Storage equipment (pallets, rack systems, forklifts)
- Additional workers to maintain and manage the extra inventory
- Additional workers to make the parts that were overproduced

- Other production costs (raw materials, machinery, power, maintenance) to make the parts that were overproduced
- Interest payments to finance all of the above.

The kanban system (Section 26.2.1) for just-in-time production provides a control mechanism at each workstation to produce only the minimum quantity of parts needed to feed the next process in the sequence. In so doing, it limits the amount of inventory that is allowed to accumulate between operations.

Unnecessary processing steps (waste form 4) mean that energy is being expended by the worker and/or machine to accomplish work that adds no value to the product. An example of this waste form is a product that is designed with features that serve no useful function to the customer, and yet time and cost are consumed to create those features. Another reason for unnecessary processing steps is that the processing method for the given task has not been well designed. Perhaps no work design has occurred at all. Consequently, the method used for the task includes wasted hand and body motions, unnecessary work elements, inappropriate hand tools, inefficient production equipment, poor ergonomics, and safety hazards.

The movement of people and materials is a necessary activity in manufacturing. Body motions and walking are necessary and natural elements of the work cycle for most workers, and materials must be transported from operation to operation during their processing. It is when the movement of workers or materials is done unnecessarily and without adding value to the product that waste occurs (waste forms 5 and 6). Reasons why people and materials are sometimes moved unnecessarily include the following:

- *Inefficient workplace layout.* Tools and parts are randomly organized in the work space, so that workers must search for what they need and use inefficient motion patterns to complete their tasks.
- *Inefficient plant layout.* Workstations are not arranged along the line of flow of the processing sequence.
- *Improper material handling method.* For example, manual handling methods are used instead of mechanized or automated equipment.
- *Production machines spaced too far apart.* Greater distances mean longer transit times between machines.
- *Larger equipment than necessary for the task.* Larger machines need larger access space and greater distances between machines. In general, they consume more power.
- *Conventional batch production.* In batch production, changeovers are required between batches that result in downtime during which nothing is produced.

The seventh form of muda is workers waiting. When workers are forced to wait, it means that no work (neither value-adding nor non value-adding) is being performed. There are a variety of reasons why workers are sometimes forced to wait. Examples include the following:

- Waiting for materials to be delivered to the workstation
- Waiting because the assembly line has stopped
- Waiting for a broken-down machine to be repaired
- Waiting while a machine is being set up by the setup crew
- Waiting for the machine to perform its automatic processing cycle on a work part.

26.2 JUST-IN-TIME PRODUCTION SYSTEMS

Just-in-time (JIT) production systems were developed to minimize inventories, especially work-in-process (WIP). Excessive WIP is seen in the Toyota production system as waste that should be minimized or eliminated. The ideal just-in-time production system produces and delivers exactly the required number of each component to the downstream operation in the manufacturing sequence just at the moment when that component is needed. This delivery discipline minimizes WIP and manufacturing lead time, as well as the space and money invested in WIP. At Toyota, the just-in-time discipline was applied not only to the company's own production operations but to its supplier delivery operations as well.

While the development of JIT production systems is attributed to Toyota, many U.S. firms have also adopted just-in-time. Other terms are sometimes applied to the American practice of JIT to suggest differences with the Japanese practice. For example, *continuous flow manufacturing* is a widely used term in the United States that denotes a just-in-time style of production operations. Continuous flow suggests a method of production in which work parts are processed and transported directly to the next workstation one unit at a time. Each process is completed just before the next process in the sequence begins. In effect, this is JIT with a batch size of one work unit. Prior to JIT, the traditional U.S. practice might be described as a "just-in-case" philosophy; that is, to hold large in-process inventories to cope with production problems such as late deliveries of components, machine breakdowns, defective components, and wildcat strikes.

The just-in-time production discipline has shown itself to be very effective in high-volume repetitive operations, such as those found in the automotive industry [9]. The potential for WIP accumulation in this type of manufacturing is significant, due to the large quantities of products made and the large numbers of components per product.

The principal objective of JIT is to reduce inventories. However, inventory reduction cannot simply be mandated. Certain requisites must be in place for a just-in-time production system to function successfully. They are (1) a pull system of production control, (2) setup time reduction for smaller batch sizes, and (3) stable and reliable production operations.

26.2.1 Pull System of Production Control

JIT is based on a *pull system* of production control, in which the order to make and deliver parts at each workstation in the production sequence comes from the downstream station that uses those parts. When the supply of parts at a given workstation is about to be exhausted, that station orders the upstream station to replenish the supply. Only upon receipt of this order is the upstream station authorized to produce the needed parts. When this procedure is repeated at each workstation throughout the plant, it has the effect of pulling parts through the production system. By comparison, in a *push system* of production control, parts at each workstation are produced irrespective of the immediate need for those parts at its respective downstream station. In effect, this production discipline pushes parts through the plant. Material requirements planning (MRP, Section 25.2) is a push system of production control. The risk in a push system is that more parts get produced in the factory than the system can handle, resulting in large queues of work in front of machines. The machines are unable to keep up with arriving work, and the factory becomes overloaded with work-in-process inventory.

The Toyota production system implemented its pull system by means of kanbans. The word *kanban* (pronounced kahn-bahn) is derived from two Japanese words: *kan*,

meaning card, and *ban*, meaning signal [6]. Taken together, kanban means signal card. A **kanban system** of production control is based on the use of cards that authorize (1) parts production and (2) parts delivery in the plant. Thus, in the conventional implementation of a kanban system, there are two types of cards: (1) production kanbans and (2) transport kanbans. A production kanban (P-kanban) authorizes the upstream station to produce a batch of parts. As they are produced, the parts are placed in containers, so the batch quantity is just sufficient to fill the container. Production of more than this quantity of parts is not allowed in the kanban system. A transport kanban (T-kanban) authorizes transport of the container of parts to the downstream station. Modern implementation of a kanban system utilizes bar codes and other automated data collection technologies to reduce transaction times and increase accuracy of shop floor data [15].

The operation of a kanban system is described with reference to Figure 26.3. The workstations shown in the figure (station i and station $i + 1$) are only two in a sequence of multiple stations upstream and downstream. The flow of work is from station i (the upstream station) to station $i + 1$ (the downstream station). The sequence of steps in the kanban pull system is as follows (the numbering sequence is coordinated with Figure 26.3):

1. Station $i + 1$ removes the next P-kanban from the dispatching rack. This P-kanban authorizes it to process a container of part b . A material handling worker removes the T-kanban from the incoming container of part b and takes it back to station i .
2. At station i , the material handling worker finds the container of part b , removes the P-kanban and replaces it with the T-kanban. He then puts the P-kanban in the dispatching rack at station i .
3. The container of part b that was at station i is moved to station $i + 1$ as authorized by the T-kanban. The P-kanban for part b at station i authorizes station i to process a new container of part b , but it must wait its turn in the rack for the other P-kanbans ahead of it. Scheduling of work at each station is determined by the order in which the production kanbans are placed in the dispatching rack. Meanwhile, processing of the b parts at station $i + 1$ has been completed and that station removes the next P-kanban from the dispatching rack and begins processing that container of parts (it happens to be part d as indicated in the figure).

As mentioned, stations i and $i + 1$ are only two adjacent stations in a longer sequence. All other pairs of upstream and downstream stations operate according to the same kanban pull system. This production control system avoids unnecessary paperwork. The kanban cards are used over and over again instead of generating new production and transport orders every cycle. Although considerable labor is involved in material handling (moving cards and containers between stations), this supposedly promotes teamwork and cooperation among workers.

Some of today's kanban implementations in the automotive industry rely on modern communications technologies rather than cards. These electronic kanban systems connect production workers to the material handlers who deliver the parts. For example, one system installed at Ford Motor Company uses battery-powered wireless buttons located at each operator workstation [4]. When the supply of parts gets down to a certain level, the operator presses the button, which signals the material handlers to deliver another batch of parts. Each button emits a low power signal that is received by antennas attached to the plant ceiling and transmitted to a computer system that provides instructions to the material handlers about what to deliver, where, and when.

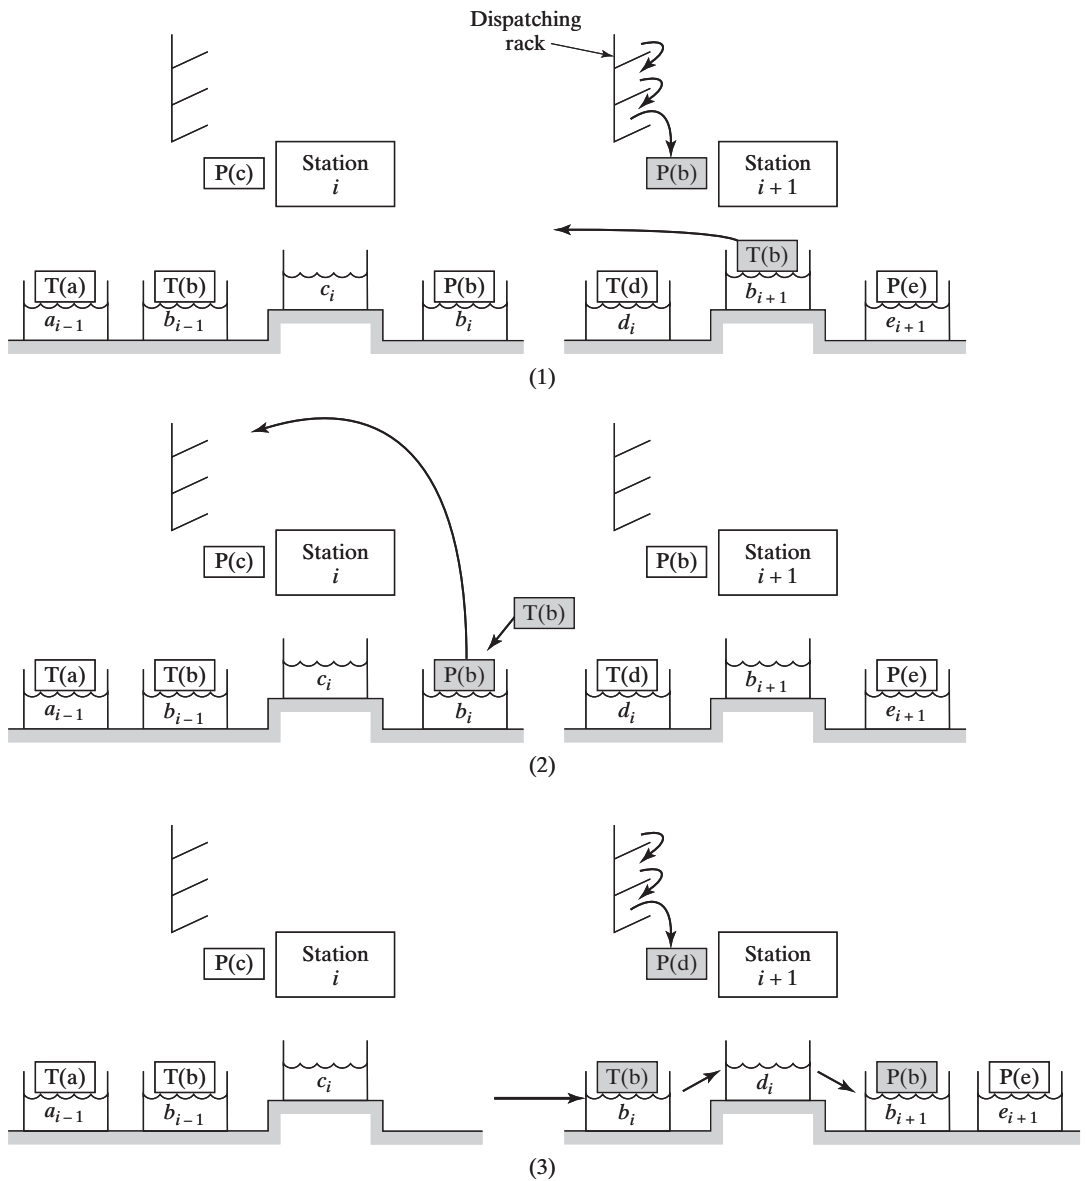


Figure 26.3 Operation of a kanban system between workstations (see description of steps in the text).

26.2.2 Setup Time Reduction for Smaller Batch Sizes

To minimize work-in-process inventories in manufacturing, batch sizes and setup times must be minimized. The relationship between batch size and setup time is given by the EOQ (economic order quantity) formula, Equation (25.5). In the mathematical model for total inventory cost, Equation (25.1), from which the EOQ formula is derived, average inventory level is equal to half the batch size. To reduce average inventory level, batch

size must be reduced. And to reduce batch size, setup cost must be reduced. This means reducing setup times. Reduced setup times permit smaller batches and lower work-in-process levels.

Setup time reductions result from a number of basic approaches that are best described as methods improvements. The approaches are largely credited to the pioneering work of Shigeo Shingo, an industrial engineering consultant at Toyota Motors during the 1960s and 1970s. They have been documented in Claunch [2], Monden [9], Sekine and Arai [17], Shingo [18], and Veilleux and Petro [20]. The approaches can be applied to virtually all batch production situations, but their applications in the automotive industry have emphasized pressworking and machining operations, owing to the widespread use of these operations in this industry.

The starting point in setup time reduction is to recognize that there are two distinct categories of work elements in setting up a machine:

1. *Internal elements.* These work elements can only be done while the production machine is stopped.
2. *External elements.* These elements do not require that the machine be stopped.

Examples of the two categories are listed in Table 26.3. By their nature, external work elements can be accomplished while the previous job is still running. For the setup time to be reduced in a given changeover, the setup tooling (e.g., die, fixture, mold) must be designed and the changeover procedure must be planned to permit as much of the setup as possible to consist of external work elements.

Although it is desirable to reduce the times required to accomplish both internal and external work elements, the internal elements must be given a higher priority, since they determine the length of time that a machine will not be producing during a changeover. The following approaches apply mostly to the internal elements in a setup ([1], [2], [17], [20]):

- Use time and motion studies and methods improvements to minimize the time of the internal work elements.

TABLE 26.3 Examples of Internal Work Elements and External Work Elements During a Production Setup or Changeover

Internal Work Elements	External Work Elements
Removing the tooling (e.g., dies, molds, fixtures) used in the previous production job from the machine	Retrieving the tooling for the next job from the tool storage room
Positioning and attaching the tooling for the next job in the machine	Assembling the tooling components next to the machine (if the tooling consists of separate pieces that must be assembled)
Making final adjustments and alignments of the tooling	Reading engineering drawings regarding the new setup
Performing tryout of the setup and making trial parts	Reprogramming the machine for the next job (e.g., downloading the part program for the new part)

- Use two workers working in parallel to accomplish the setup, rather than one worker working alone. This approach may not be applicable to all changeover situations, but where it is applicable, it theoretically reduces the downtime to half the time required for one worker.
- Eliminate or minimize adjustments in the setup. Adjustments are time-consuming.
- Use quick-acting fasteners instead of bolts and nuts where possible.
- When bolts and nuts must be used with washers, use U-shaped washers instead of O-shaped washers. A U-shaped washer can be inserted between the parts to be clamped without completely disassembling the nut from the bolt. To add an O-shaped washer, the nut must be removed from the bolt.
- Design modular fixtures consisting of a base unit plus insert tooling that can be quickly changed for each new part style. The base unit remains attached to the production machine, so that only the insert tooling must be changed.

Some of the more general approaches that can be used to reduce setup times in production include the following:

- Develop permanent solutions for problems that cause delays in the setup.
- Schedule batches of similar part styles in sequence to minimize the amount of change required in the setup.
- Use group technology and cellular manufacturing (Chapter 18) so that similar part styles are produced on the same equipment. This will tend to reduce the amount of work that must be performed during changeovers.

Although methods for reducing setup time were pioneered by the Japanese, U.S. firms have also adopted these methods. Results of the efforts are sometimes dramatic. Table 26.4 presents some examples of setup time reductions in Japanese and U.S. industries reported by Suzuki [19]. Some of the terms used to describe various levels of improvements are listed in Table 26.5.

The economic impact of setup time reduction in a production operation can be assessed using the economic order quantity equations developed in Section 25.5. The following example builds on an example presented in that section.

TABLE 26.4 Examples of Setup Time Reductions in Japanese and U.S. Industries

Industry	Equipment Type	Setup Time Before	Setup Time After	Reduction (%)
Japanese automotive	1,000-ton press	4 hr	3 min	98.7
Japanese diesel	Transfer line	9.3 hr	9 min	98.4
U.S. power tool	Punch press	2 hr	3 min	97.5
Japanese automotive	Machine tool	6 hr	10 min	97.2
U.S. electric appliance	45-ton press	50 min	2 min	96.0

Source: Suzuki [19].

TABLE 26.5 Terminology of Setup Time Reduction

Term	Meaning and Description
<i>RETAD</i>	<i>Rapid Exchange of Tools and Dies.</i> This is a general term for procedures aimed at setup time reduction.
<i>SMED</i>	<i>Single Minute Exchange of Dies.</i> The actual interpretation of SMED is for the setup change-over to be accomplished within single-digit minutes; that is, less than 10 min.
<i>OTED</i>	<i>One Touch Exchange of Dies.</i> This refers to setups accomplished within one minute.
<i>NOTED</i>	<i>NOn Touch Exchange of Dies.</i> This refers to changeovers that are performed automatically, without human manual labor. An example is an automatic tool changer on a computer numerical control machining center.

EXAMPLE 26.1 Effect of Setup Reduction on EOQ and Inventory Cost

What is the effect of reducing setup time on economic batch size and total inventory costs in Example 25.3 in the previous chapter? In that example, annual demand = 15,000 pc/yr, unit cost = \$20, holding cost rate = 18%/yr, setup time = 5 hr, and cost of downtime during setup = \$150/hr. Suppose it were possible to reduce setup time from 5 hr to 5 min (this kind of reduction is not so far-fetched, given the data in Table 26.4). Determine (a) the economic batch quantity and (b) total inventory cost for this new situation.

Solution: First, recall the results of the earlier example. Setup cost $C_{su} = (5 \text{ hr})(\$150) = \$750$ and holding cost $C_h = 0.18(\$20) = \3.60 . Using these values, the economic batch quantity was computed as follows:

$$EOQ = \sqrt{\frac{2(15,000)(750)}{3.60}} = \mathbf{2,500 \text{ units}}$$

The corresponding total inventory costs were computed as

$$TIC = \frac{2,500(3.60)}{2} + \frac{750(15,000)}{2,500} = \mathbf{\$9,000}$$

(a) Reducing the setup time to 5 min reduces the setup cost to $C_{su} = (5/60 \text{ hr})(\$150) = \$12.50$. Holding cost remains the same, and the new economic batch quantity is

$$EOQ = \sqrt{\frac{2(15,000)(12.50)}{3.60}} = \mathbf{323 \text{ units}}$$

This is a significant reduction from the 2,500 pc batch size when setup time was 5 hr.

(b) Total inventory costs are also reduced, as follows:

$$TIC = \frac{323(3.60)}{2} + \frac{12.50(15,000)}{323} = \mathbf{\$1,161}$$

This is an 87% cost reduction from the previous value.

26.2.3 Stable and Reliable Production Operations

Other requirements for a successful JIT production system include (1) production leveling, (2) on-time delivery, (3) defect-free components and materials, (4) reliable production equipment, (5) a workforce that is capable, committed, and cooperative, and (6) a dependable supplier base.

Production Leveling. Production must flow as smoothly as possible, which means minimum perturbations from the fixed schedule. Perturbations in downstream operations tend to be magnified in upstream operations. A 10% change in final assembly may be amplified into a 50% change in parts production operations, due to overtime, unscheduled setups, variations from normal work procedures, and other exceptions. Maintaining a constant master production schedule over time keeps workflow smooth and minimizes disturbances in production.

The trouble is that demand for the final product is not constant. Accordingly, the production system must adjust to the ups and downs of the marketplace using **production leveling**, which means distributing the changes in product mix and quantity as evenly as possible over time. Approaches used to accomplish production leveling include the following [3]:

- Authorizing overtime during busy periods
- Using finished product inventories to absorb daily ups and downs in demand
- Adjusting the cycle times of the production operations
- Producing in small batch sizes that are enabled by setup time reduction techniques. In the ideal, the batch size is reduced to one.

On-Time Deliveries, Zero Defects, and Reliable Equipment. Just-in-time production requires near perfection in on-time delivery, parts quality, and equipment reliability. Owing to the small lot sizes used in JIT, parts must be delivered before stock-outs occur at downstream stations. Otherwise, these stations are starved for work and production is forced to stop.

JIT requires high quality in every aspect of production. If defective parts are produced, they cannot be used in subsequent processing or assembly stations, so work at those stations is interrupted and production may even be halted. Such a severe penalty motivates a discipline of very high quality levels (zero defects) in parts fabrication. Workers are trained to inspect their own output to make sure it is right before it goes to the next operation. In effect, this means controlling quality during production rather than relying on inspectors to discover the defects later.

JIT also requires highly reliable production equipment. Low work-in-process leaves little room for equipment stoppages. Machine breakdowns cannot be tolerated in a JIT production system. The equipment must be “designed for reliability,” and the plant that operates the equipment must employ total productive maintenance (Section 26.3.3).

Workforce and Supplier Base. Workers in a just-in-time production system must be cooperative, committed, and cross-trained. Small batch sizes mean that workers must be willing and able to perform a variety of tasks and to produce a variety of part styles at their workstations. As indicated earlier, they must be inspectors as well as production workers in order to ensure the quality of their own output. They must be able to deal with minor technical problems with the production equipment to avoid major breakdowns.

Suppliers of raw materials and components to the company must be held to the same standards of on-time delivery, zero defects, and other JIT requirements as the company itself. In the automobile industry, this means parts deliveries from suppliers are made several times per day. In some cases, the parts are delivered right to the workstations where they will be used. New policies in dealing with vendors are required for JIT. These policies include

- Reducing the total number of suppliers, thus allowing the remaining suppliers to do more business
- Entering into long-term agreements and partnerships with suppliers, so that suppliers do not have to worry about competitively bidding for every order
- Establishing quality and delivery standards and selecting suppliers on the basis of their capacity to meet these standards
- Placing the company's own employees in supplier plants to help those suppliers develop their own JIT systems
- Selecting parts suppliers that are located near the company's final assembly plant to reduce transportation and delivery problems.

26.3 AUTONOMATION

The word seems like a misspelling of “automation.” Taiichi Ohno referred to autonomation as “automation with a human touch” [10]. The notion is that the machines operate autonomously as long as they are functioning properly. When they do not function properly, for example, when they produce a defective part, they are designed to stop immediately. Another aspect of autonomation is that the machines and processes are designed to prevent errors. Finally, machines in the Toyota production system must be reliable, which requires an effective maintenance program. This section covers these three aspects of autonomation: (1) stopping the process automatically when something goes wrong, (2) preventing mistakes, and (3) total productive maintenance.

26.3.1 Stop the Process

Much of autonomation is embodied in the Japanese word *jidoka*, which refers to machines that are designed to stop automatically when something goes wrong, such as a defective part being processed. Production machines in Toyota plants are equipped with automatic stop devices that activate when a defective work unit is produced.³ Therefore, when a machine stops, it draws attention to the problem, requiring corrective action to be taken to avoid future recurrences. Adjustments must be made to fix the machine, thereby eliminating or reducing subsequent defects and improving overall quality of the final product.

In addition to its quality control function, autonomation also refers to machines that are controlled to stop production when the required quantity (the batch size) has been completed, thus preventing overproduction (one of the seven forms of waste). Although autonomation is often applied to automated production machines, it can also be used with

³The origins of *jidoka* in the Toyota production system can be traced to Ohno's work experience early in his career in the textile industry, where the weaving machines were equipped with automatic stopping mechanisms that shut down the looms when abnormal operating conditions occurred. He implemented the idea at Toyota.

manual operations. In either case, it consists of the following control devices: (1) sensors to detect abnormal operation that would result in a quality defect, (2) a device to count the number of parts that have been produced, and (3) a means to stop the machine or production line when abnormal operation is detected or the required batch quantity has been completed.

The alternative to autonomation occurs when a production machine is not equipped with these control mechanisms and continues to operate abnormally, possibly completing an entire batch of defective parts before the quality problem is even noticed, or producing more parts than the quantity required at the downstream workstation. To avoid such a calamity in a plant that does not have automatic stop mechanisms on its machines, each machine must have a worker in continuous attendance to monitor its operation. Machines equipped with autonomation do not require a worker to be present all the time when they are functioning correctly. Only when a machine stops must the worker attend to it. This allows one worker to oversee the operation of multiple machines, thereby increasing worker productivity.

Because workers are called upon to service multiple machines, and the machines are frequently of different types, the workers must be willing and able to develop a greater variety of skills than those who are responsible for only a single machine type. The net effect of more versatile workers is that the plant becomes more flexible in its ability to shift workers around among machines and jobs to respond to changes in workload mix.

At Toyota, the *jidoka* concept is extended to its final assembly lines. Workers are empowered to stop the assembly line when a quality problem is discovered, using pull cords located at regular intervals along the line. Downtime on final assembly lines in the automotive industry is expensive. Managers desperately want to avoid it. They accomplish this by making sure that the problems that cause it are eliminated. Pressure is applied on the parts fabrication departments and suppliers to prevent defective parts and subassemblies from reaching the final assembly area.

26.3.2 Error Prevention

This aspect of autonomation is derived from two Japanese words: *poka*, which means error, and *yoke*, which means prevention. Together, *poka-yoke* means prevention of errors through the use of low-cost devices that detect and/or prevent them. The *poka-yoke* concept was developed by Shigeo Shingo, who also pioneered the single minute exchange of dies (SMED, Table 26.5). The use of *poka-yoke* devices relieves the worker of constantly monitoring the process for errors that might cause defective parts or other undesirable consequences.

Mistakes in manufacturing are common, and they often result in the production of defects. Examples include omission of processing steps, incorrectly locating a work part in a fixture, using the wrong tool, not aligning jigs and fixtures properly on the machine tool table (this can result in the entire batch of parts being processed incorrectly), and neglecting to add a component part in an assembly.

Most of the functions performed by *poka-yoke* devices in production can be classified into the following categories:

- *Detecting work part deviations.* The function is to detect abnormalities in a work part, such as its weight, dimensions, and shape. The detection may apply to the starting piece or the final piece or both (before and after).
- *Detecting processing and methods deviations.* This type of *poka-yoke* is designed to detect mistakes made during an assembly or processing operation. The mistake is usually

associated with manual operations. For example, did the worker correctly position the work part in the fixture?

- *Counting and timing functions.* In batch production, counting can be used to stop the production machine after a specified number of parts have been made. Tool changes in machining operations are often predicated on the length of time that the cutting tool has been in use. Many operations require a certain number of repetitions of a given work element during the cycle. For example, did the spot-welder apply the correct number of spot-welds during the work cycle? Timing or counting devices can monitor these kinds of situations.
- *Verification functions.* This function is concerned with the verification of a desired status or condition during the work cycle. For example, is the work part present or absent in the clamping device?

When a poka-yoke finds that an error or other exception has occurred, it responds in either or both of the following ways:

- *Stop the process.* The poka-yoke stops the mechanized or automated cycle of a production machine when it detects a problem. For example, a limit switch installed in a workholder detects that the workpiece is incorrectly located and is interlocked with the milling machine to prevent the process from starting.
- *Provide an alert.* This response is an audible or visible warning signal that an error has occurred. This signal alerts the operator and perhaps other workers and supervisors about the problem. The use of andon boards (Section 26.4.2) is a means of implementing this type of response.

26.3.3 Total Productive Maintenance

Production equipment in the Toyota production system must be highly reliable. The just-in-time delivery system cannot tolerate machine breakdowns, because there is little buffer stock between workstations to keep upstream and downstream stations producing when the middle station stops. Lean production requires an equipment maintenance program that minimizes machine breakdowns. **Total productive maintenance** (TPM) is a coordinated group of activities whose objective is to minimize production losses due to equipment failures, malfunctions, and low utilization through the participation of workers at all levels of the organization. Worker teams are formed to solve maintenance problems. Workers who operate equipment are assigned the routine tasks of inspecting, cleaning, and lubricating their machines. This leaves the regular maintenance workers with time to perform the more demanding technical duties, such as emergency maintenance, preventive maintenance, and predictive maintenance, defined in Table 26.6. In TPM, the goal is zero breakdowns.

The traditional measure of machine reliability is availability (Section 3.1.1), which refers to the proportion of the total desired operating time that the machine is actually available and operable. Its value can be calculated using Equation (3.9). When a piece of equipment is brand new (and being debugged), and later when it begins to age, its availability tends to be lower. This results in a typical U-shaped curve for availability as a function of time over the life of the equipment, as shown in Figure 26.4.

There are other reasons besides breakdowns why a piece of production equipment may be operating at less than its full capability. The other reasons include (1) low utilization, (2) production of defective parts, and (3) operation at less than the machine's designed speed.

TABLE 26.6 Some Maintenance Definitions

Term	Definition
Emergency maintenance	Repairing equipment that has broken down and returning it to operating condition. Action must be taken immediately to correct the malfunction. Also known as <i>reactive maintenance</i> .
Preventive maintenance	Performing routine repairs on equipment (e.g., replacement of key components) to prevent and avoid breakdowns.
Predictive maintenance	Anticipating equipment malfunctions before they occur based on computerized machine monitoring, machine operator being attentive to the way the machine is running, historical data, and other predictive techniques.
Total productive maintenance	Integration of preventive maintenance and predictive maintenance to avoid emergency maintenance.

Utilization refers to the amount of output of a production machine during a given time period (e.g., week) relative to its capacity during that same period (Section 3.1.2). Utilization can also be measured as the number of hours of productive operation relative to the total number of hours the machine is available. Reasons for poor machine utilization include poor scheduling of work, machine starved for work by upstream operation, setups and changeovers between production batches, worker absenteeism, and low demand for the type of process performed by the machine. Utilization can be assessed for a single machine, an entire plant, or any other productive resource (e.g., labor). It is often expressed as a percent (e.g., the plant is operating at 83% of capacity).

Production of defective parts may be due to incorrect machine settings, inaccurate adjustments in the setup, or improper tooling. All of these reasons are related to equipment problems. Additional reasons for producing defects that may not be related to equipment problems include defective starting materials and human error. The fraction defect rate is defined as the probability of producing a defective piece each cycle of

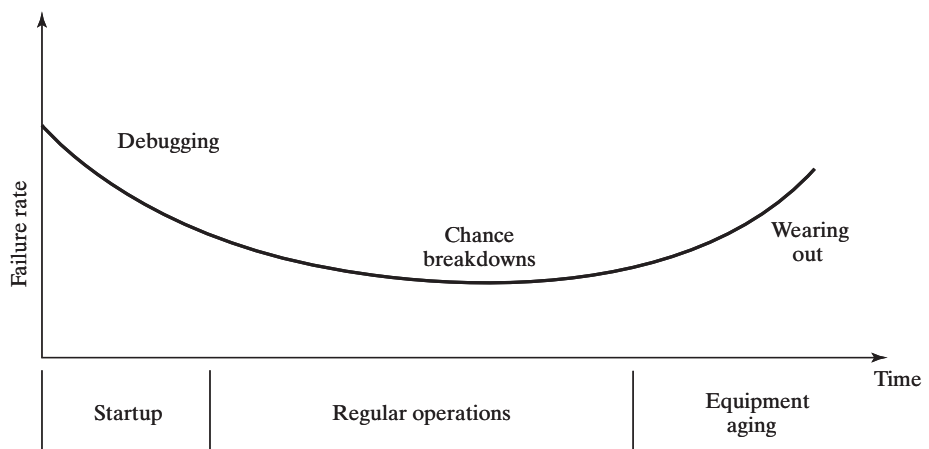


Figure 26.4 Typical U-shaped availability curve for a piece of equipment during its life.

operation (Section 21.1.3). It is the proportion of defective parts that are produced in a given process. The yield of the process is defined as

$$Y = 1 - q \quad (26.1)$$

where Y = process yield (ratio of conforming parts produced to total parts processed), and q = fraction defect rate.

Finally, running the equipment at less than its designed speed also reduces its operating capability, which is the ratio of the actual operating speed divided by the designed speed of the machine. This ratio is symbolized r_{os} .

All of these factors can be combined in the following equation to obtain a measure of the **overall equipment effectiveness**, defined as follows:

$$OEE = AUYr_{os} \quad (26.2)$$

where OEE = overall equipment effectiveness, A = availability, U = utilization, Y = process yield, and r_{os} = operating capability. The objective of total productive maintenance is to make OEE as close as possible to unity (100%).

26.4 WORKER INVOLVEMENT

Between the two pillars of lean production in Figure 26.1 are workers who are motivated, flexible, and eager to participate in continuous improvement. The following discussion of worker involvement in lean production consists of three topics: (1) continuous improvement, (2) the visual workplace, and (3) standard work procedures. In addition, total productive maintenance also requires worker involvement.

26.4.1 Continuous Improvement

In the context of lean production, the Japanese word *kaizen* means continuous improvement of production operations. Kaizen is usually implemented by means of worker teams, sometimes called *quality circles*, which are organized to address specific problems that have been identified in the workplace. The teams deal not only with quality problems, but also with problems relating to productivity, cost, safety, maintenance, and other areas of interest to the organization. The term *kaizen circle* is also used, suggesting the broader range of issues that are usually involved in team activities.

Kaizen is a process that attempts to involve all workers as well as their supervisors and managers. Workers are often members of more than one kaizen circle. Although a principal purpose of organizing workers into teams is to solve problems in production, there are other less obvious but also important objectives. Kaizen circles encourage workers' sense of responsibility, allow workers to gain acceptance and recognition among colleagues, and improve their technical skills [9].

Kaizen is applied on a problem-by-problem basis by worker teams. The team is convened to deal with a specific problem, and the project activities of the problem-solving team are called *kaizen events*. As mentioned earlier, the problem may relate to any of various areas of concern to the organization (e.g., quality, productivity, maintenance). Team members are selected according to their knowledge and expertise in the problem area and may be drawn from various departments. They serve part-time on a project team in addition to fulfilling their regular operational duties. On completion of the project, the team is disbanded. The usual expectation is that the team will meet two to four times per month, and each meeting will last about an hour.

The steps in each project vary depending on the type of problem being addressed. Details of the recommended approaches and the way teams are organized vary with different authors [7], [8], [11], [13], [14]. Basically, these approaches are similar to the DMAIC procedure in a Six Sigma quality program (Appendix 20A).

26.4.2 Visual Management and 5S

The principle behind visual management is that the status of the work situation should be evident just by looking at it. If something is wrong, this condition should be obvious to the observer, so that corrective action can be taken immediately. Also called the *visual workplace*, the principle applies to the entire plant environment. Objects that obstruct the view inside the plant are not allowed, so that the entire interior space is visible. The buildup of work-in-process is limited to a specified height. Thus, the visual workplace provides visibility throughout the plant and encourages good housekeeping.

Another important means of implementing visual management is the use of andon boards. An **andon board** is a light panel positioned above a workstation or production line that is used to indicate its operating status. Its operation is commonly associated with the pull cords along a production line that permit a worker to stop the line. If a problem occurs, such as a line stoppage, the andon board identifies where the problem is and the nature of the problem. Different colored lights are often used to indicate the status of the operation. For example, a green light indicates normal operation, yellow means a worker has a problem and is calling for help, and red shows that the line has stopped. Other color codes may be used to indicate the end of a production run, shortage of materials, the need for a machine setup, and so on. The andon system may also include audio alarms.

The visual workplace principle can also be applied in worker training. It includes the use of photographs, drawings, and diagrams to document work instructions, as opposed to lengthy text with no illustrations. “A picture is worth a thousand words” can be a powerful training tool for workers. In many cases, an actual example of the work part is used to convey the desired message, for example, providing examples of good parts and defective parts to teach inspectors and production workers in quality control.

One means of involving workers in the visual workplace is a 5S system, which is a set of procedures used to organize work areas in the plant. The five S's are the first letters of five Japanese words as they would be spelled in English, and their translation into English yields five words and phrases that also begin with *S*. The steps in 5S provide an additional means of implementing visual management to provide a clean, orderly, and visible work environment that promotes high morale among workers and encourages continuous improvement. Worker teams are usually made responsible for accomplishing the steps, and the 5S system must be a continuing process to sustain the accomplishments that have been made. The five steps in 5S are the following, with the Japanese word in parentheses [3], [12]:

1. *Sort (Seiri)*. This step consists of sorting things in the workplace. This includes identifying items that are not used and disposing of them, thus eliminating the clutter that usually accumulates in a workplace after many years.
2. *Set in order (Seiton)*. The items remaining in the work area after sorting are organized according to frequency of use, providing easy access to the items that are most often needed.
3. *Shine (Seiso)*. This step involves cleaning the work area and inspecting it to make sure that everything is in its proper place.

4. *Standardize (Seiketsu)*. Standardization in the 5S system refers to documenting the standard locations for items in the workplace, for example, using a “shadow board” for hand tools, in which the outline of the tool is painted on the board to indicate where it belongs. Looking at the shadow board, workers can immediately tell whether a tool is present and where to return it.
5. *Self-discipline (Shitsuke)*. Finally, the fifth step establishes a plan for sustaining the gains made in the previous four steps, and it assigns individual responsibilities to team members for maintaining a clean and orderly work environment. Workers are made responsible for taking care of the equipment they operate, which includes cleaning and performing minor maintenance tasks.

26.4.3 Standardized Work Procedures

Standardized work procedures are established in the Toyota production system, using approaches that are similar to traditional methods engineering techniques. Time study is used to determine the length of time that should be taken to complete a given work cycle. The objectives of using standardized work procedures at Toyota are the following:

- *Increase productivity*, by accomplishing the required production using the fewest number of workers
- *Balance the workload* among all processes
- *Minimize work-in-process* in the production sequence.

In the Toyota system, a standardized work procedure for a given task has three components [10]: (1) cycle time, (2) work sequence, and (3) standard work-in-process quantity. These components are documented using forms that emphasize Toyota’s unique manufacturing procedures. The forms are sometimes quite different from those used in traditional methods engineering and work measurement.

Cycle Time and Takt Time. The cycle time is the actual time the task takes to complete a given operation. This time is established using stopwatch time study. The cycle time is documented in a form called the *part production capacity chart*, an example of which is shown in Figure 26.5. This chart indicates the daily production capacity for the operations listed.

Process	Operation	Machine	Operation time (min)			Tool changes		Capacity (920 min)
			Manual	Machine	Cycle	Time (min)	Interval	
1	Mill	M-23	0.25	1.31	1.56	3.50	25	541 pc
2	Mill	M-16	0.25	1.44	1.69	3.00	40	521 pc
3	Mill	M-68	0.25	0.87	1.12	3.50	30	807 pc
4	Drill	D-47	0.20	0.36	0.56	1.50	75	1586 pc
5	Drill	D-33	0.20	0.54	0.74	1.50	100	1219 pc
6	Drill	D-25	0.20	0.62	0.82	1.75	75	1091 pc
7	Drill	D-42	0.20	0.67	0.87	1.75	100	1037 pc

Figure 26.5 The part production capacity chart.

Closely related to the cycle time is the **takt time**, which is the reciprocal of the demand rate for a given product or part, adjusted for the available shift time in the factory (*takt* is a German word meaning cadence or pace). For a given product or part,

$$T_{takt} = \frac{EOT}{Q_{dd}} \quad (26.3)$$

where T_{takt} = takt time, min/pc; EOT = effective daily operating time, min; and Q_{dd} = daily quantity of units demanded, pc. The effective daily operating time is the shift hours worked each day, without subtracting any allowances for delays, breakdowns, or other sources of lost time. The daily quantity of units demanded is the monthly demand for the item divided by the number of working days in the month, without increasing the quantity to allow for defective units that might be produced. The reason the effective daily operating time is not adjusted for lost time and the daily quantity is not increased to account for defects is to draw attention to these deficiencies so that corrective action will be taken to minimize or eliminate them.

EXAMPLE 26.2 Takt Time

The monthly demand for a certain part is 10,000 units. There are 22 working days in the month. The plant operates two shifts, each with an effective operating time of 440 min. Determine the takt time for this part.

Solution: With two shifts, the effective daily operating time is $2(440 \text{ min}) = 880 \text{ min}$. The daily quantity of units demanded is $10,000/22 = 454.5 \text{ pc/day}$.

$$T_{takt} = 880/454.5 = \mathbf{1.94 \text{ min}}$$

The takt time provides a specification based on demand for the part or product. In the Toyota production system, the work is designed so that the operation cycle time is synchronized with the takt time. This is accomplished through planning of the work sequence and standardizing the work-in-process quantity.

Work Sequence. The work sequence, also called the *standard operations routine* [9], is the order of work elements or operations performed by a given worker to accomplish an assigned task. For a worker performing a repetitive work cycle at a single machine, it is a list of the actions that are to be carried out, such as pick up the work part, load it into the machine, engage the feed, and unload the completed part at the end of the cycle. For a multi-function worker responsible for several machines, each with its own semiautomatic cycle, the work sequence indicates what must be done at each machine and the order in which the machines must be attended. Pictures are often included to show the proper use of hand tools and other aspects of the work routine such as safety practices and correct ergonomic posture.

For the multi-machine situation, the work sequence is documented by means of the standard operations routine sheet, shown in Figure 26.6. This form lists the machines that must be visited by the worker during each work cycle. A horizontal time scale indicates how long each operation should take, a solid line for the worker and dashed lines for the machines, and squiggly, nearly vertical lines are used to depict the worker walking

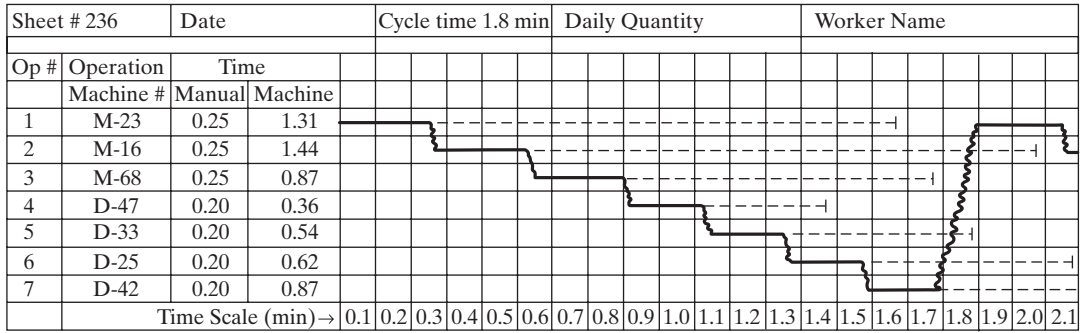


Figure 26.6 A standard operations routine sheet.

between machines. The timelines show how well the machine cycle times are matched to the work routine performed by the worker each cycle.

Most production parts require more than one process before they are complete. It is not unusual for a dozen or more processing steps to be required to manufacture a part. The cycle time for a given process may be different from the takt time, which is based on the demand for the item produced in the task and not on the requirements of the task itself. In the Toyota system, attempts are made to organize the work in such a way that the cycle time for each processing step is equal to the takt time for the part. When the cycle times are matched with the takt time, all of the processes in the sequence are balanced, and the amount of work-in-process is minimized.

How can the work to produce a given part be organized so that the cycle time for each processing step is equal to the takt time? In the Toyota production system, the tasks are integrated into work cells. At Toyota, a work cell is a group of workers and processing stations physically arranged in sequential order so that parts can be produced in small batches, in many cases one at a time. The cells are typically U-shaped rather than straight to promote comradship among the workers and to achieve continuous flow of work in the cell. An example of a work cell layout and the operations performed in it by three workers is shown in Figure 26.7.

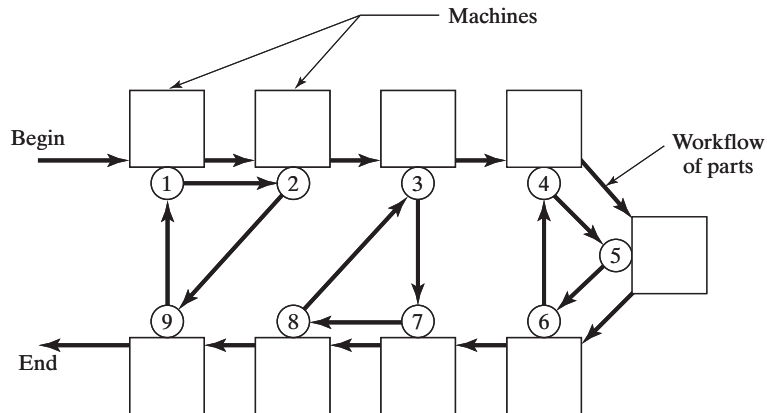


Figure 26.7 Cell layout with three workers performing nine operations (based on Monden [9]). Operations are indicated by numbers in circles. The first worker performs operations 1, 2, and 9; the second worker performs operations 3, 7, and 8; and the third worker performs operations 4, 5, and 6.

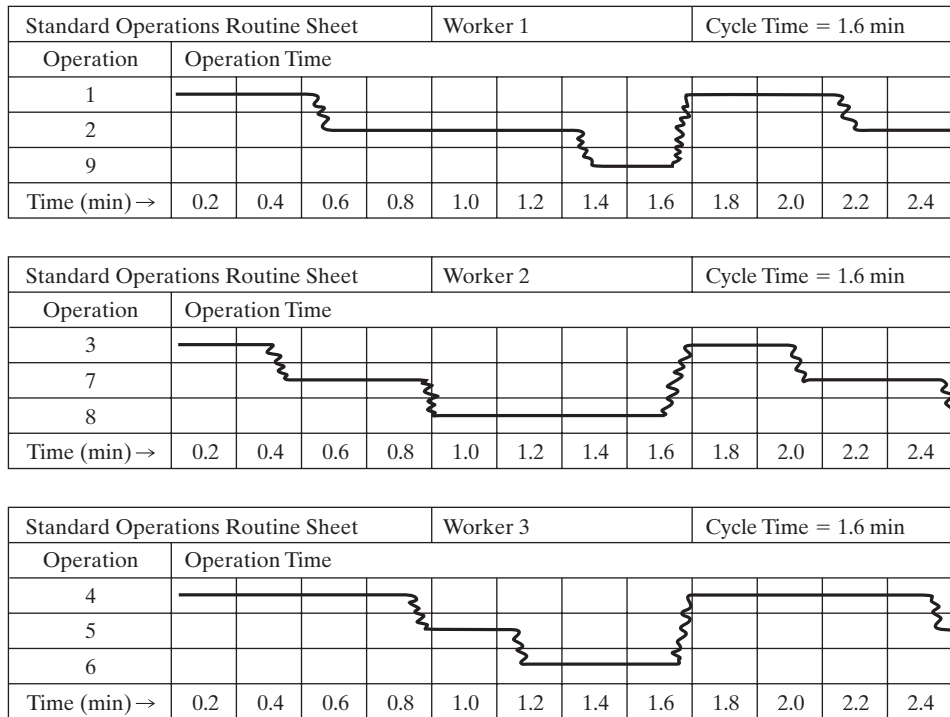


Figure 26.8 The standard operations routine sheets for the three workers in Figure 26.7.

Nine operations are performed by the three workers, as depicted by the arrows in the figure. The corresponding standard operations routine charts are illustrated in Figure 26.8. The total workload is balanced among the workers and the operations are allocated so the corresponding cycle times are equal to the takt time for the part produced in the cell.

Standard Work-In-Process Quantity. In the Toyota production system, the standard work-in-process quantity is the minimum number of parts necessary to avoid workers waiting. For example, if the first worker in Figure 26.8 had only one work part for machines 1 and 2, he would have to wait for machine 1 to finish its cycle before moving the part to machine 2. But if there were two work parts, one in front of each machine, then he could load the first machine and move immediately to load the second machine without waiting for the first machine to finish.

Factors that tend to influence how many work parts should be defined as the standard work-in-process quantity in a given work cell include the following:

- If quality inspections must be performed as distinct steps, then additional parts must be provided for these inspections.
- If processing includes heating of the parts (e.g., hot forging), then additional WIP must be allowed to provide for heating time and cooling time.
- If the worker’s work sequence is in the opposite direction of the part processing sequence, then at least one work part must be held between machines to avoid waiting time.

REFERENCES

- [1] CHASE, R. B., and N. J. AQUILANO, *Production and Operations Management: A Life Cycle Approach*, 5th ed., Richard D. Irwin, Inc., Homewood, IL, 1989.
- [2] CLAUNCH, J. W., *Setup Time Reduction*, Richard D. Irwin, Inc., Chicago, IL, 1996.
- [3] DENNIS, P., *Lean Production Simplified*, Productivity Press, New York, 2002.
- [4] “Ford’s Electronic Kanban Makes Replenishment Easy,” *Lean Manufacturing Advisor*, Productivity Press, Vol. 5, No. 5, October 2003, pp. 6–7.
- [5] GROOVER, M. P., *Work Systems and the Methods, Measurement, and Management of Work*, Pearson/Prentice Hall, Upper Saddle River, NJ, 2007.
- [6] GROSS, J., “Implementing Successful Kanbans,” *Industrial Engineer*, April 2005, pp. 37–39.
- [7] HARRIS, C., “Lean Manufacturing: Are We Really Getting It?” *Assembly*, March 2006, pp. 36–42.
- [8] JURAN, J. M., and F. M. GRYA, *Quality Planning and Analysis*, 3rd ed., McGraw-Hill, Inc., New York, 1993.
- [9] MONDEN, Y., *Toyota Production System*, Industrial Engineering and Management Press, Norcross, GA, 1983.
- [10] OHNO, T., *Toyota Production System, Beyond Large-Scale Production*, Original Japanese edition published by Diamond, Inc., Tokyo, Japan, 1978, English translation published by Productivity Press, New York, 1988.
- [11] ORTIZ, C., “All-Out Kaizen,” *Industrial Engineer*, April 2006, pp. 30–34.
- [12] PETERSON, J., and R. SMITH, *The 5S Pocket Guide*, Productivity Press, Portland, Oregon, 1998.
- [13] PYZDEK, T., and R. W. BERGER, *Quality Engineering Handbook*, Marcel Dekker, Inc., New York, and ASQC Quality Press, Milwaukee, WI, 1992.
- [14] ROBISON, J., “Integrate Quality Cost Concepts into Team’s Problem-Solving Efforts,” *Quality Progress*, March 1997, pp. 25–30.
- [15] RUSSELL, R. S., and B. W. TAYLOR III, *Operations Management*, 7th ed., Pearson Education, Upper Saddle River, NJ, 2010.
- [16] SCHONBERGER, R., *Japanese Manufacturing Techniques, Nine Hidden Lessons in Simplicity*, The Free Press, Division of Macmillan Publishing Co., Inc., New York, 1982.
- [17] SEKINE, K., and K. ARAI, *Kaizen for Quick Changeover*, Productivity Press, Cambridge, MA, 1987.
- [18] SHINGO, S., *Study of Toyota Production System from Industrial Engineering Viewpoint—Development of Non-Stock Production*, Nikkan Kogyo Shinbun Sha, Tokyo, Japan, 1980.
- [19] SUZAKI, K., *The New Manufacturing Challenge: Techniques for Continuous Improvement*, Free Press, New York, 1987.
- [20] VEILLEUX, R. F., and L. W. PETRO, *Tool and Manufacturing Engineers Handbook*, 4th ed., Vol. V, *Manufacturing Management*, Society of Manufacturing Engineers, Dearborn, MI, 1988.
- [21] WOMACK, K., D. JONES, and D. ROOS, *The Machine that Changed the World*, MIT Press, Cambridge, MA, 1990.
- [22] [www.wikipedia.org/wiki/Andon_\(manufacturing\)](http://www.wikipedia.org/wiki/Andon_(manufacturing))
- [23] www.wikipedia.org/wiki/Autonomation
- [24] www.wikipedia.org/wiki/Lean_manufacturing

REVIEW QUESTIONS

- 26.1 Define lean production.
- 26.2 Name the two pillars of the Toyota production system.

- 26.3 What is the Japanese word for waste?
- 26.4 Name the seven forms of waste in production, as identified by Taiichi Ohno.
- 26.5 What are three reasons why people and materials are sometimes moved unnecessarily in production operations?
- 26.6 What is a just-in-time production system?
- 26.7 What is the objective of a just-in-time production system?
- 26.8 What is the difference between a push system and a pull system in production control?
- 26.9 What is a kanban? What are the two types of kanban?
- 26.10 What is the basic starting point in a study to reduce setup time?
- 26.11 What is production leveling?
- 26.12 How is production leveling accomplished?
- 26.13 What does automation mean?
- 26.14 What is total productive maintenance?
- 26.15 What does the Japanese word *kaizen* mean?
- 26.16 What is a quality circle?
- 26.17 What is visual management?
- 26.18 What is an andon board?
- 26.19 What is the 5S system?
- 26.20 What is takt time?
- 26.21 What are standardized work procedures in the Toyota production system?

PROBLEMS

Answers to problems labeled (A) are listed in the appendix.

Setup Time Reduction

- 26.1 (A) A stamping plant supplies sheet metal body panels to an automotive final assembly plant. The following data are values representative of the parts made at the plant. Annual demand is 180,000 pc (for each part produced). Average cost per piece is \$15 and holding cost is 18% of piece cost. Changeover (setup) time for the presses is 4 hr and the cost of downtime on any given press is \$200/hr. Determine (a) the economic batch size and (b) the total annual inventory cost for the data. If the changeover time for the presses could be reduced to 6 min, determine (c) the economic batch size and (d) the total annual inventory cost. (e) What would the annual savings be for the plant if these annual inventory costs were applied to all 46 different stampings produced by the plant?
- 26.2 A supplier of parts to an assembly plant in the household appliance industry is required to make deliveries on a just-in-time basis (daily). For one of the parts that must be delivered, the daily requirement is 100 parts, 5 days/wk, 52 wk/yr. However, the supplier cannot afford to make just 100 parts each day because of the high cost of changing over the production machine. Instead, it must produce in larger batch sizes and maintain an inventory of the parts from which 100 units are withdrawn for shipment each day. Cost per piece is \$16 and holding cost is 24% of piece cost. Changeover time for the production machine used to produce the part is 2.5 hr and the cost of downtime on this machine is \$180/hr. Determine (a) the economic batch size and (b) the total annual inventory cost for the data. (c) How many weeks of demand does this batch quantity represent?

- 26.3** In the previous problem, it is desired to reduce the economic batch size from the value determined in that problem to 500 units, which would require the supplier to keep a maximum inventory of one week's demand for the parts. (a) Determine the changeover time that would allow the economic batch size in stamping to be 500 pieces. (b) What is the corresponding total annual inventory cost for this batch size, assuming the changeover time in part (a) can be realized? (c) What are the total annual inventory cost savings to the supplier, compared to the *TIC* determined in the previous problem?
- 26.4 (A)** Monthly demand rate for a certain part is 10,000 units. The part is produced in batches and its manufacturing costs are estimated to be \$8.00. Holding cost is 20% of piece cost. Currently the production equipment used to produce this part is also used to produce 19 other parts with similar usage and cost data (assume the data to be identical for purposes of this problem). Changeover time between batches of the different parts is now 4.0 hr, and cost of downtime on the equipment is \$250/hr. A proposal has been submitted to fabricate a fast-acting slide mechanism that would permit the changeovers to be completed in just 10 min. Cost to fabricate and install the slide mechanism is \$125,000. (a) Is this cost justified by the savings in total annual inventory cost that would be achieved by reducing the economic batch quantity from its current value based on a 4-hr setup to the new value based on a 10-min setup? (b) How many months of savings are required to pay off the \$125,000 investment?
- 26.5** An injection-molding machine produces 25 different plastic molded parts in an average year. Annual demand for a typical part is 20,000 units. Each part is made out of a different plastic (the differences are in type of plastic and color). Because of the differences, changeover time between parts is significant, averaging 5 hr to change molds and purge the previous plastic from the injection barrel. One setup person normally does these two activities sequentially. A proposal has been made to separate the tasks and use two setup persons working simultaneously. In that case, the mold can be changed in 1.5 hr and purging takes 3.5 hr. Thus, the total downtime per changeover will be reduced to 3.5 hr from the previous 5 hr. Downtime on the injection-molding machine is \$200/hr. Labor cost for setup time is \$20/hr. Average cost of a plastic molded part is \$2.50, and holding cost is 24% annually. For the 5-hr setup, determine (a) the economic batch quantity, (b) the total number of hours per year that the injection-molding machine is down for changeovers, and (c) the annual inventory cost. For the 3.5-hr setup, determine (d) the economic batch quantity, (e) the total number of hours per year that the injection-molding machine is down for changeovers, and (f) the annual inventory cost.
- 26.6** In the previous problem, a second proposal has been made to reduce the purging time of 3.5 hr during a changeover to less than 1.5 hr by sequencing the batches of parts so as to reduce the differences in plastic type and color between one part and the next. In the ideal, the same plastic can be used for all parts, thus eliminating the necessity to purge the injection barrel between batches. Thus, the limiting task in changing over the machine is the mold change time, which is 1.5 hr. For the 1.5-hr setup, determine (a) the economic batch quantity, (b) the total number of hours per year that the injection-molding machine is down for changeovers, and (c) the annual inventory cost.
- 26.7** The following data apply to sheet metal parts produced at a stamping plant that serves a final assembly plant in the automotive industry. The data are average values representative of the parts made at the plant. Annual demand = 150,000 pc (for each part produced); average cost per piece = \$20; holding cost = 25%, changeover (setup) time for the presses = 5 hr; cost of downtime on any given press = \$200/hr. (a) Compute the economic batch size and the total annual inventory cost for the data. (b) If the changeover time could be reduced to 30 min, compute the economic batch size and the total annual inventory cost.
- 26.8 (A)** Given the data in the previous problem, it is desired to reduce the batch size from the value determined in that problem to 600 pieces. The stamping plant operates 250 days per year, so this quantity is consistent with the number of units supplied daily to the final

assembly plant. Determine the changeover time that would allow the economic batch size in stamping to be 600 pieces. What is the corresponding total annual inventory cost for this batch size?

- 26.9** Annual demand for a part is 500 units. The part is currently produced in batches. It takes 2.0 hr to set up the production machine for this part, and the downtime during setup costs \$125/hr. Annual holding cost for the part is \$5.00. The company would like to produce the part using a new flexible manufacturing system it recently installed. This would allow the company to produce this part as well as others on the same equipment. However, changeover time must be reduced to a minimum. (a) Determine the required changeover (setup) time, in order to produce this part economically in batch sizes of one. (b) If the part were to be produced in batch sizes of 10 units instead of one, what is the implicit changeover time for this batch quantity? (c) How much are the annual total inventory costs to the company when the batch size = 1 unit?

Overall Equipment Effectiveness

- 26.10 (A)** A production machine has an uptime proportion of 96% and a utilization of 94%. The fraction defect rate of the parts made on the machine is 0.021, and it operates at 75% of its rated speed. What is the overall equipment effectiveness of this machine?
- 26.11** Reliability data on an automated production machine are mean time between failures = 37.4 hr and mean time to repair = 34 min. The utilization of the machine is 89%. The fraction defect rate of the parts made on the machine is 1.1%. Its rated operating speed is 75 parts/hr, but it only operates at 62 parts/hr. (a) What is the overall equipment effectiveness of this machine? (b) The reliability and fraction defect rate would be difficult to improve upon, but utilization and rated speed could be increased. What values of utilization and operating speed would allow the overall equipment effectiveness to be increased to 85%.

Takt Time and Cycle Time

- 26.12 (A)** The weekly demand for a certain part is 600 units. The plant operates two shifts per day, five days per week, with an effective operating time of 440 min per shift. Determine the takt time for this part.
- 26.13** The monthly usage for a component supplied to an assembly plant is 3,400 parts. There are 21 working days in the month and the effective operating time of the plant is 450 min per day. Currently, the defect rate for the component is 1.2%, and the equipment used to produce the part is down for repairs an average of 18 min per day. Determine the takt time for this part.
- 26.14** Monthly delivery rate for a part supplied to an automotive assembly plant is 12,500 pc. There are 20 working days in February and 22 working days in March. The effective operating time of the plant is 840 min per day (two shifts). The fraction defect rate for the component is 0.017, and the automated machine that produces the part has an availability of 96%. Determine the takt time for this part during (a) February and (b) March.

APPENDIX

Answers to Selected Problems

CHAPTER 1 Introduction

No problems in this chapter

CHAPTER 2 Manufacturing Operations

2.1 (a) $P = 15$ different models, (b) $Q_f = 8,700$ units annually

2.4 (a) $n_{pf} = 8,500$ components, (b) $n_{of} = 45,500$ operations

CHAPTER 3 Manufacturing Metrics and Economics

3.1 (a) $T_c = 3.30$ min, (b) $T_b = 11.92$ hr, (c) $R_p = 16.78$ pc/hr

3.6 (a) $PC_y = 144,000$ pc/yr, (b) increase = 336.8%

3.11 (a) $MLT = 134.67$ hr, (b) $R_p = 5.455$ pc/hr

3.20 (a) $Q = 60,913$ pc/yr, (b) manual $H = 2,030$ hr/yr, automated $H = 1,108$ hr/yr

3.23 (a) $C_o = \$41.13$ /hr, (b) $C_o = \$62.01$ /hr

CHAPTER 4 Introduction to Automation

No problems in this chapter

CHAPTER 5 Industrial Control Systems

No problems in this chapter

CHAPTER 6 Hardware Components for Automation and Process Control

- 6.1 (a) $E = 0.05494 T$, (b) $T = 437^\circ\text{C}$
- 6.6 (a) $T = 0.72 \text{ N}\cdot\text{m}$, (b) $\omega = 200 \text{ rad/sec}$, (c) $\omega = 44.7 \text{ rad/sec}$
- 6.13 (a) $n_p = 500 \text{ pulses}$, (b) $f_p = 300 \text{ Hz}$
- 6.16 (a) $v = 24.9 \text{ mm/sec}$, $F = 20,104 \text{ N}$, (b) $v = 25.8 \text{ mm/sec}$, $F = 19,400 \text{ N}$
- 6.18 (a) $N_q = 4,096$, (b) $R_{ADC} = 0.01465 \text{ V}$, (c) quantization error = $\pm 0.00732 \text{ V}$

CHAPTER 7 Computer Numerical Control

- 7.1 (a) $N = 1,273 \text{ rev/min}$, (b) $f_r = 382 \text{ mm/min}$
- 7.6 (a) $n_p = 30,000 \text{ pulses}$, (b) $N_m = 160 \text{ rev/min}$, (c) $f_p = 533.33 \text{ Hz}$
- 7.11 (a) $CR = 0.01875 \text{ mm}$, (b) $N_{mx} = 232.8 \text{ rev/min}$, $f_{px} = 388 \text{ Hz}$,
 $N_{my} = 357.55 \text{ rev/mm}$, $f_{py} = 595.9 \text{ Hz}$
- 7.14 (a) $n_p = 8,750 \text{ pulses}$, (b) $f_p = 187.5 \text{ Hz}$, (c) $N_m = 56.25 \text{ rev/min}$
- 7.19 (a) $CR_x = CR_y = 0.0125 \text{ mm}$, (b) $Ac_x = Ac_y = 0.01225 \text{ mm}$,
(c) $Re_x = Re_y = \pm 0.006 \text{ mm}$

CHAPTER 8 Industrial Robotics

- 8.6 (a) $T_p = 5.333 \text{ min/pc}$, (b) $R_p = 11.25 \text{ pc/hr}$, (c) $TT = 26.667 \text{ hr}$,
(d) 14.06% (includes setup)
- 8.14 (a) $Q = 25,000 \text{ pc/yr}$, (b) $C_{pc} = \$1.84/\text{pc}$, (c) $C_{pc} = \$1.365/\text{pc}$
- 8.21 $CR_2 = 0.59 \text{ mm}$
- 8.22 $Ac = 0.625 \text{ mm}$, $Re = \pm 0.33 \text{ mm}$
- 8.26 (a) $B = 9.3 \rightarrow 10 \text{ bits}$, (b) $CR = 0.0587^\circ$

CHAPTER 9 Discrete Control and Programmable Logic Controllers

- 9.3 Boolean logic expressions: $P = (X1 + P) \cdot \overline{X2}$ and $M = P$
- 9.12 STR X1, OR X2, AND X3, OUT Y
- 9.18 STR X1, AND X2, OUT C1, STR C1, OUT Y1

CHAPTER 10 Material Transport Systems

10.1 $n_c = 4.92 \rightarrow 5$ vehicles

10.6 (a) $T_c = 4.07$ min/del, (b) $R_{dv} = 10.71$ del/hr/truck, (c) $n_c = 4.67 \rightarrow 5$ forklift trucks

10.18 $n_c = 5.28 \rightarrow 6$ vehicles

10.19 (a) number of parts on conveyor = 50, (b) $R_f = 900$ pc/hr, (c) $T_L = T_u = 4$ sec

10.21 (a) $s_p = 150$ ft/pan, (b) $R_f = 800$ pc/hr, (c) $R_f = 360$ pc/hr

CHAPTER 11 Storage Systems

11.1 (a) AS/RS capacity = 4,800 loads, (b) Width = 63 ft, $L = 233.33$ ft, $H = 28.127$ ft

11.5 (a) $T_{cs} = 1.6$ min/cycle, $T_{dc} = 2.7$ min/cycle, (b) $R_t = 35.58$ transactions/hr

11.11 $R_t = 76.71$ transactions/hr

11.16 $R_t = 150.42$ transactions/hr

11.19 $R_t = 117.9$ transactions/hr

CHAPTER 12 Automatic Identification and Data Capture

No problems in this chapter

CHAPTER 13 Overview of Manufacturing Systems

No problems in this chapter

CHAPTER 14 Single-Station Manufacturing Cells

14.1 (a) $T_c = 30.0$ min/pc, $R_c = 2.0$ pc/hr, (b) $T_c = 25.5$ min/pc, $R_c = 2.35$ pc/hr, (c) $T_c = 25.5$ min/pc, $R_c = 2.35$ pc/hr, $T_{L/uL} = 60$ min, $UT = 246$ min

14.4 $n = 2.93 \rightarrow 3$ presses and operators

14.7 (a) $n = 4.78 \rightarrow 5$ molding machines, $T_b = 37.14$ hr

14.13 (a) $n_1 = 4$ grinding machines, (b) worker $IT = 16$ sec, (c) $R_c = 56.25$ pc/hr

CHAPTER 15 Manual Assembly Lines

15.1 (a) $R_p = 37.5$ asby/hr, (b) $T_c = 1.52$ min, (c) $w^* = 16.97 \rightarrow 17$ workers

15.9 (a) $w = 37$ workers, (b) $n = 27$ stations, (c) $E_b = 94.6\%$, (d) $M = 1.37$

15.14 (b) $n = 5$ stations, (c) sta 1 {elements 1, 2, 4}, sta 2 {3, 5}, sta 3 {6, 7}, sta 4 {8, 9}, sta 5 {10}, (d) $d = 14\%$

- 15.18 (a) $f_p = 1.25$ asby/min, $T_c = 0.8$ min/asby, (b) $T_i = 1.2$ min/station,
 (c) $w^* = 5$ workers, (e) sta 1 {elements 1, 2, 5}, sta 2 {3, 4}, sta 3 {6, 7, 8}, sta 4
 {9, 10}, sta 5 {11, 12, 13, 14}, (f) $d = 7.5\%$
- 15.20 (a) $T_c = 1.833$ min, $f_p = 0.545$ pc/min, (b) $T_i = 2.917$ min/station, (c) $M = 1.28$,
 (d) $ET = 72.9$ min
- 15.26 (a) $w = 16$ workers, (b) $R_{pA} = 30.04$ asby/hr, $R_{pB} = 39.95$ asby/hr,
 $R_{pC} = 28.06$ asby/hr
- 15.28 $w = 39$ workers, $n = 30$ stations

CHAPTER 16 Automated Production Lines

- 16.1 (a) $T_c = 2.5$ sec, (b) $T_s = 1.75$ sec, (c) $T_r = 0.75$ sec
- 16.4 (a) $R_p = 85.7$ pc/hr, (b) $E = 71.4\%$, (c) $C_{pc} = \$2.59$ /pc
- 16.10 (a) $D = 29.9\%$, (b) $R_p = 28.04$ pc/hr, (c) $H = 713.3$ hr
- 16.17 (a) $n = 30$ stations, (b) $R_p = 24$ pc/hr, (c) $E = 52\%$
- 16.18 (a) $E = 29.41\%$, $R_p = 23.53$ pc/hr, (b) $E_\infty = 45.45\%$, $R_p = 36.36$ pc/hr
- 16.27 $Q = 13,712$ pc

CHAPTER 17 Automated Assembly Systems

- 17.1 (a) $T_{de} = 1.5$ min, (b) $T_{re} = 12.5$ min, (c) $\text{Pr}(\text{time on}) = 0.893$,
 $\text{Pr}(\text{time off}) = 0.107$
- 17.5 (a) $R_p = 375$ asby/hr, (b) $P_{ap} = 1.0$, (c) $E = 62.5\%$
- 17.10 (a) $P_{ap} = 0.9936$, (b) $R_{ap} = 480.8$ good asby/hr, (c) $P_{qp} = 0.0064$,
 (d) $C_{pc} = \$0.9323$ /asby
- 17.15 (a) $R_p = 100.6$ asby/hr, (b) $P_{ap} = 0.98705$, (c) $E = 89.43\%$
- 17.18 Current line: (a) $R_p = 56.1$ asby/hr, (b) $E = 93.5\%$, (c) $C_{pc} = \$1.038$ /asby;
 proposed line: (a) $R_p = 76.9$ asby/hr, (b) $E = 76.9\%$, (c) $C_{pc} = \$0.819$ /asby

CHAPTER 18 Group Technology and Cellular Manufacturing

- 18.1 Part families and machine groups: I = (A, D) and (3, 1, 5), II = (B, C, E) and (4, 2).
- 18.6 (a) $3 \rightarrow 1 \rightarrow 4 \rightarrow 2$, (c) in-sequence = 82.4%, bypassing = 17.6%,
 backtracking = 0
- 18.11 (a) $R_p = 13.0$ pc/hr, (b) $U_1 = 0.85$, $U_2 = 1.0$, average $U = 0.925$,
 (c) $MLT = 0.817$ hr, (d) $WIP = 10.6$ pc

CHAPTER 19 Flexible Manufacturing Cells and Systems

- 19.1 (a) $R_p^* = 3.333$ pc/hr, (b) $R_{pA}^* = 1.333$ pc/hr, $R_{pB}^* = 2.00$ pc/hr, (c) $U_1 = 0.333$, $U_2 = 1.0$, $U_3 = 0.722$, $U_4 = 0.125$, (d) $BS_1 = 0.333$, $BS_2 = 2$, $BS_3 = 0.722$, $BS_4 = 0.25$
- 19.2 (a) $R_p^* = 3.077$ pc/hr, (b) $R_{pA}^* = 0.615$ pc/hr, $R_{pB}^* = 0.923$ pc/hr, $R_{pC}^* = 1.538$ pc/hr, (c) $U_1 = 0.256$, $U_2 = 1.0$, $U_3 = 0.944$, $U_4 = 0.385$, (d) $BS_1 = 0.256$, $BS_2 = 1.0$, $BS_3 = 0.944$, $BS_4 = 0.385$
- 19.7 (a) $R_p^* = 8.33$ pc/hr, (b) $R_{pA} = 0.833$ pc/hr, $R_{pB} = 1.667$ pc/hr, $R_{pC} = 2.50$ pc/hr, $R_{pD} = 3.333$ pc/hr, (c) $U_1 = 0.674$, $U_2 = 0.880$, $U_3 = 1.0$, $U_4 = 0.556$, $U_5 = 0.399$, (d) $\bar{U}_s = 83.8\%$
- 19.9 (a) $MLT_1 = 50.4$ min, $T_w = 0$, (b) $R_p^* = 3.077$ pc/hr, $MLT_2 = 78.0$ min, $T_w = 27.6$ min
- 19.17 (a) $s_1 = 1$, $s_2 = 4$, $s_3 = 3$, $s_4 = 2$, (b) $U_1 = 0.833$, $U_2 = 0.904$, $U_3 = 0.806$, $U_4 = 0.875$

CHAPTER 20 Quality Programs for Manufacturing

- 20.1 $PC = 45.025 \pm 0.105$ mm
- 20.6 (a) \bar{x} chart: $CL = 1.000$ in, $LCL = 0.9923$ in, $UCL = 1.0077$ in, R chart: $CL = 0.0133$ in, $LCL = 0$, $UCL = 0.0281$ in
- 20.13 $n = 144$
- 20.17 (a) $DPMO = 6,020$ defects/million, (b) 4.0 sigma level
- 20.22 (a) $k = \$50,000$, (b) $E\{L(x)\} = \$1.25/\text{unit}$

CHAPTER 21 Inspection Principles and Practices

- 21.1 Conforming items: $\text{Pr}(\text{accept}) = 0.82$, $\text{Pr}(\text{reject}) = 0.04$, Nonconforming items: $\text{Pr}(\text{accept}) = 0.06$, $\text{Pr}(\text{reject}) = 0.08$
- 21.6 $Q_f = 1569$ defect-free units, $D = 431$ defects
- 21.9 $Q_o = 118,203$ pc
- 21.13 Alternative (1): $C_b = \$2,200.00$, Alternative (2): $C_b = \$1,672.75$
- 21.17 (a) $C_b = \$150$, (b) $C_b = \$180$, (c) $q_c = 0.01667$

CHAPTER 22 Inspection Technologies

- 22.2 $MR = 0.061$ mm
- 22.5 $L = 8.344$ in

22.8 (a) $a = 0.561$ in, $b = 0.136$ in, (b) $D = 9.362$ in

22.13 (a) $x + 0.245y - 113.431z + 4294.508 = 0$, (b) $\delta = 0.177$ mm

22.15 (a) ADC time = 0.0288 sec, (b) yes

CHAPTER 23 Product Design and CAD/CAM in the Production System

No problems in this chapter

CHAPTER 24 Process Planning and Concurrent Engineering

No problems in this chapter

CHAPTER 25 Production Planning and Control Systems

25.6 (a) ABC, (b) CAB, (c) ACB, (d) CBA, (e) BCA

25.8 (a) $EOQ = 600$ pc, (b) $TIC = \$1,800/\text{yr}$, (c) 3 batches/yr

25.15 (a) $EOQ = 2,000$ pc, (b) $TIC = \$4,800/\text{yr}$, (c) $EOQ = 447$ pc, $TIC = \$1,073.31/\text{yr}$

CHAPTER 26 Just-In-Time and Lean Production

26.1 (a) $EOQ = 10,328$ pc, (b) $TIC = \$27,885.48$, (c) $EOQ = 1,633$ pc,
(d) $TIC = \$4,409.08$, (e) savings = $\$1,079,914/\text{yr}$

26.4 (a) Savings = $\$311,918/\text{yr}$, justified, (b) Payback period = 4.81 months

26.8 $T_{su} = 1.8$ min, (b) $TIC = \$3,000/\text{yr}$

26.10 $OEE = 66.26\%$

26.12 $T_{takt} = 7.333$ min/pc

Index

- A**
- Absolute positioning, NC, 157–158
 - AC motors, 131–132
 - Accelerometer, 124
 - Acceptable quality level (AQL), 625, 627, 753
 - Acceptance sampling, 578, 624
 - Accessibility (storage), 311
 - Accuracy:
 - coordinate measuring machines, 662
 - inspection, 621–623
 - measuring instruments, 649
 - numerical control, 177
 - robotics, 235
 - Acquisition distance, 283
 - Active sensors, 123
 - Actuators, 126–137
 - Adaptive control, 100–102
 - Adaptive control machining, 101
 - Additive manufacturing, 30, 168, 691
 - Addressable points, 176, 234
 - Adhesive bonding, 23, 31
 - Advanced manufacturing planning, 716–719
 - Agile manufacturing, 563–565
 - Aggregate production planning, 722, 723–724
 - AGVS, *see* Automated guided vehicles
 - AIDC, *see* Automatic identification and data capture
 - American National Standards Institute (ANSI), 605
 - American Society for Quality (ASQ), 605–606
 - American system of manufacture, 24
 - Ammeter, 124
 - Amplifier, 126, 138
 - Analog, 97, 122, 650
 - Analog-to-digital converters, 138–140
 - Andon board, 767
 - APT, *see* Automatically programmed tooling
 - Arc welding, 167, 220, 368, 674
 - Arc-on time, 220
 - Articulated robot, 208
 - AS/RS, *see* Automated storage/retrieval system
 - Assembly:
 - automated, 472
 - cells, 417
 - defined, 28, 31
 - design guidelines, 714, 715
 - industrial robots, 222–223
 - manual, *see* Manual assembly lines
 - operations, 28, 31, 393
 - process planning, 707
 - worker teams, 417–418
 - Assembly line, *see* Manual assembly line
 - Assignable variations, 580, 601
 - Asynchronous transport, 396, 443, 473
 - Attributes sampling plan, 624
 - Automated assembly, 472
 - Automated assembly systems:
 - analysis, 479–490
 - applications, 478
 - definition and fundamentals, 473–479
 - flexible manufacturing, 539
 - Automated data collection, 738, *also see* Automatic identification and data capture

- Automated drafting, 691
- Automated guided vehicles:
 - analysis, 291–297
 - definition and technology, 278–284
 - flexible manufacturing systems, 541
- Automated inspection, 628–630
- Automated integrated production, 16
- Automated manufacturing systems, 360–361
- Automated process planning, 502, *also see* Computer-aided process planning
- Automated production, 16
- Automated production lines:
 - analysis, 454–458, 464–471
 - definition and fundamentals, 442–450
 - flexible, 451
 - historical note, 451
 - storage buffers, 449
 - transfer lines, 441, 451–454
 - work part transport, 443
- Automated storage/retrieval system (AS/RS), 319–324, 325–329
- Automated systems, 4–5, 78, 718
- Automated transfer line, *see* Transfer line
- Automatic dimensioning, 690
- Automatic identification and data capture (AIDC):
 - bar codes, 339, 340–347
 - definition and overview, 337–340
 - other technologies, 339, 349–350
 - radio frequency identification, 339, 347–349
- Automatic pallet changer (APC), 371, 375
- Automatic tool-changer (ATC), 374
- Automatic workpart positioner, 375
- Automatically programmed tooling (APT), 151–152, 179, 182–184
- Automation:
 - advanced functions, 86–91
 - assembly, 473–490, 539
 - basic elements, 78–86
 - defined, 4–5, 75, 77
 - flexible manufacturing system, *see* Flexible manufacturing system
 - historical note, 76–77
 - inspection, 628–630
 - levels of, 91–93, 96, 97, 360–361
 - migration strategy, 16–17
 - numerical control, *see* Numerical control
 - control
 - principles and strategies, 13–17
 - in production systems, 6–10
 - reasons for automating, 10
 - robotics, *see* Industrial robotics
 - safety monitoring, 86–87
 - single-station cells, 363
 - types of, 8–9
 - Automation migration strategy, 12, 16–17
 - Automobile body checking software, 661
 - Autonomation, 751, 752, 762–766
 - Availability:
 - defined, 50–51
 - equipment life cycle, 765
 - overall equipment effectiveness, 766
 - production lines, *see* Line efficiency
 - storage systems, 312
 - vehicle-based transport, 293
 - Average outgoing quality (AOQ), 626
 - Axes, coordinate:
 - coordinate measuring machines, 654
 - industrial robotics, 205, 206
 - numerical control, 153–154, 180–181
- B**
- Back lighting, 670–672
- Back-emf, 128
- Backtracking move, parts, 509
- Balance delay, 405
- Ball screw, 133
- Bar codes, 272, 339, 340–347
- Bar code readers and scanners, 341, 343–345
- Basic process, 705, 707
- Batch, 26
- Batch-model assembly lines, 397, 427–429
- Batch production, 26–27, 35–36, 48–49, 321
- Belt conveyors, 286
- Bill of materials (BOM) file, 726
- Bimetallic switch, 124
- Bimetallic thermometer, 124
- Binary, defined, 98
- Binary sensors, 122
- Binary vision system, 668
- Binary-coded decimal (BCD) system, 179
- Blocking, 394, 464
- Boole, George, 246
- Boolean algebra, 246–251
- Bottleneck:
 - batch production, 53
 - bottleneck model (FMS), 550–558
 - manual assembly line, 400
 - operations, 53, 55
 - station, 49, 52, 58, 400
 - transfer lines, 465
- Boulton, Matthew, 76
- Brainstorming, 616
- Bridge crane, 289–290
- Bronze Age, 23
- Bulk storage, 314, 315
- Burbidge, J., 504, 515
- Business functions, 5, 696–697, 744–746
- Buzacott, J. A., 466, 467
- Bypassing move, parts, 509
- C**
- CAD, *see* Computer-aided design (CAD)
- CAD/CAM, *see* Computer-aided design and manufacturing
- Calibration, 650–651
- CAM, *see* Computer-aided manufacturing (CAM)
- Cameras, machine vision, 669–670
- CAN-Q, 549
- Capacity planning, 6, 722, 731–733
- Capacity requirements planning (CRP), 732
- Capek, Karel, 205
- Capital goods, 27
- Capital recovery factor, 64
- CAPP, *see* Computer-aided process planning
- Cardamatic milling machine, 150
- Carousel assembly systems, 474
- Carousel storage systems, 324–325, 330–331
- Carrying costs, 739
- Cartesian coordinate robot, 209
- Cart-on-track conveyor, 287
- Cause-and-effect diagrams, 594
- Cellular layout, 36, 508–511
- Cellular manufacturing:
 - analysis, 513–520
 - cell design, 508–511, 515–518, 770–771
 - definition, 36, 506–507

- Cellular manufacturing: (*Continued*)
 - group technology, *see* Group technology
 - Toyota production system, 770–771
- Chain conveyor, 286, 324–325
- Chain-type structure, 503
- Changeover time, *see* Setup time
- Check sheets, 593
- CIM, *see* Computer-integrated manufacturing (CIM)
- Closed loop control systems, 84–85
- Closed-loop positioning systems, 171, 174–176
- CMMs, *see* Coordinate measuring machines (CMMs)
- CNC, *see* Computer numerical control (CNC)
- CNC machining centers, 373–375
- CNC Software, Inc., 187
- Coils, ladder logic diagrams, 252, 257
- Combined operations, 15
- Common-use items, 728
- Composite parts, 507–508
- Computer-aided design (CAD), 9, 685, 688–693
- Computer-aided engineering (CAE), 689–690
- Computer-aided line balancing, 694
- Computer-aided manufacturing (CAM):
 - defined, 9, 693–694
 - computer-aided process planning, 694, 709–712
 - manufacturing control, 695
 - manufacturing planning, 694
- Computer-aided process planning (CAPP), 694, 709–712
- Computer-aided design and manufacturing (CAD/CAM):
 - definition, 695–696
 - NC part programming, 184–188, 694
 - product design, 686, 688
- Computer-assisted part programming, 181–184
- Computer-automated part programming, 186
- Computer control system:
 - flexible manufacturing systems, 543–545
 - manufacturing systems, 358
 - process control, 104–118, 121–122
- Computer-integrated manufacturing (CIM), 9, 16, 696–697
- Computerized machinability data systems, 694
- Computer numerical control (CNC), *also see* Numerical control:
 - defined, 113, 158–161
 - distributed numerical control (DNC), 161–163
 - features, 159
 - flexible manufacturing systems, *see* Flexible manufacturing system
 - historical note, 152
 - machine control unit (MCU), 153, 158–161
 - single-station cells, 373–377
 - transfer lines, 452
- Computer process control, 104–118, 121–122
- Computer process monitoring, 110, 111
- Computer vision, *see* Machine vision
- Concurrent engineering, 686, 712–713
- Congestion, 547
- Consumer goods, 27
- Consumer's risk, 625
- Contact input interface, 143–144
- Contact output interface, 144
- Contacts, ladder logic diagrams, 252
- Continuous control, 98, 99–102
- Continuous flow manufacturing, 755
- Continuous improvement, 579, 594, 595, 596, 766–767
- Continuous path systems, 155–157, 215, 220
- Continuous production, 26–27
- Continuous transport, 394, 443
- Continuous variable, 96
- Contouring, 155
- Contour projectors, 674–675
- Control(s):
 - adaptive, 100–101
 - automated production lines, 449–450
 - computer control system, *see* Computer control system
 - computer numerical control, *see* Computer numerical control
 - coordinate measuring machine, 659
 - direct digital control (DDC), 105, 111–113
 - direct numerical control (DNC), 152, 162
 - distributed numerical control (DNC), 161–163
 - discrete, 102–104, 244–252
 - feedforward, 100
 - inventory, 6, 694, 722, 739–743
 - logic, 81, 103, 245–251
 - machine control unit (MCU), 153, 158–161, 171
 - numerical control, *see* Numerical control
 - plant operations, 16
 - process, 16, 695
 - quality control, *see* Quality control
 - regulatory, 99
 - sequence, 81, 103, 251–252
 - set point, 81, 104
 - shop floor control (SFC), 6, 111, 695, 722, 733–739
 - statistical process control (SPC), 6, 583–595
 - supervisory, 114–115
 - zone, 282–283
- Control charts, 578, 584–590
- Control resolution, 176, 178, 234–235
- Control system, 84–86
- Conventional measuring and gaging techniques, 651
- Conventional storage methods, 272
- Conventional programming, 188
- Conversion time, 139
- Conveyors:
 - analysis, 297–301, 411–412
 - asynchronous, 287–288
 - continuous, 287–288
 - equipment types, 284–289
 - flexible manufacturing systems, 541
 - manual assembly lines, 394, 411–412
 - recirculating, 289, 300–301
- Coordinate measuring machine (CMM), 168, 648, 653–665
- Coordinate metrology, 653
- Coordination and control, 32
- Corporate overhead, 62
- Corporate overhead rate, 63–64
- Cost(s):
 - estimating, 694
 - industrial robotics, 224–226
 - inventory, 739
 - make or buy decision, 707–709
 - manufactured parts, 66
 - manufacturing, general, 46, 59–66
- Counter, 251–252
- Cranes, 289–291, 319
- Critical ratio, 735

- Cutoff length, 666
 Cutter offset, 200
 Cutting conditions, 164–165
 Cycle time:
 automated assembly, 483, 485
 defined, 47
 flexible manufacturing systems, 550
 industrial robotics, 224–226
 manual assembly lines, 398–400
 material transport, 292–295
 production lines, 49–50
 single-station cells, 371
 takt time, 768–769
 transfer lines, 455–456
- D**
- DAC, *see* Digital-to-analog converter
 Data encoder and decoder, 338
 Data Matrix, 347, 350
 DC motors, 127–131
 DDC, *see* Direct digital control
 Dead reckoning, 281
 Dedicated FMS, 538
 Deep-lane AS/RS, 320
 Defect concentration diagrams, 593
 Defect rate:
 defined, 380
 serial production, effect of,
 634–636
 Six Sigma, 597
 workstation requirements, 382
 Deformation processes, 30
 Delay-off timer, 251
 Delay-on timer, 251
 Delta robot, 209, 210
 Depalletizers, 218, 272
 Dependent demand, 725
 Design for assembly (DFA), 714
 Design for life cycle, 716
 Design for manufacturing (DFM), 713
 Design for manufacturing and
 assembly (DFM/A), 713–714, 715
 Design for product cost (DFC), 716
 Design for quality (DFQ), 714
 Design retrieval, 502
 Devol, George, 76, 205–206
 DFA, *see* Design for assembly
 DFM, *see* Design for manufacturing
 DFM/A, *see* Design for
 manufacturing and assembly
 Dial indexing machine, 445, 474
 Dial-type machine, 474
 Digital sensors, 122–123
 Digital-to-analog converter (DAC),
 141–143
 Direct control, 116–117
 Direct digital control (DDC), 105,
 111–113
 Direct labor, 11–13, 358–359
 Direct labor cost, 61
 Direct numerical control (DNC),
 152, 162
 Direct transport, 358
 Discrete control, 98, 244–252
 Discrete control systems, 102–104
 Discrete data, 98, 143–144
 Discrete manufacturing industries,
 26–27, 96–98
 Discrete process control, 244–252
 Discrete sensors, 122–123
 Discrete variable, 98, 244–245
 Discrete-event simulation, 690
 Distributed control, 105
 Distributed control systems (DCSs),
 115–116, 118
 Distributed numerical control
 (DNC), 161–163, 544
 Division of labor, 392
 DMAIC, Six Sigma, 612–617
 DNC, *see* Direct numerical control
 (DNC)
 Downstream allowance, 397
 Drawer storage, 317
 Drift, 651
 Drilling, 30, 164, 165, 201, 221
 Driverless trains, 278–279
 Dual command cycle, 311
 Dual grippers (robotics), 216
 Dynamometer, 124
- E**
- Earliest due date, 735
 Economic order quantity (EOQ),
 739–742, 759–760
 Edge detection, 672
 Electrical actuators, 126, 127–136
 Electric drive systems, robotics, 212
 Electric motors, 127–135
 Electrical field inspection, 677
 Electrical power, 78
 Electromagnetic technologies, 339
 Electromechanical relay, 135–136
 Electronic gages, 653
 Electronic Product Code (EPC)
 standard, 347
 Emergency maintenance, 764, 765
 Encoder, 124, 125, 174–175
 End effector, 207, 216–217
 Engelberger, Joseph, 206
 Engineering workstation, 691–692
 Enterprise resource planning (ERP),
 118, 686, 697, 722, 744–746
 EOQ, *see* Economic order quantity
 Equipment maintenance, 13,
 764–765
 Equipment usage cost, 64–65
 ERP, *see* Enterprise resource
 planning
 Error checking, 690
 Error detection and recovery, 88–91
 Error prevention, 763–764
 Escapement device, 476
 European Article Numbering system
 (EAN), 343
 Event-driven change, 102–103, 106, 245
 Exception handling, 110
 Exception reports, 736
 Expert system, defined, 711
 Extended bottleneck model, 555–558
 External logistics, 270
- F**
- Facilities:
 automated systems, 4–5
 defined, 2, 3–5
 plant layout, *see* Plant layout
 production, 32–37
 worker-machine systems, 3–4
 Facilities planning, 718
 Factory data collection (FDC)
 systems, 736–739
 Factory overhead, 61
 Factory overhead rate, 62–63
 Factory system, 23
 Failure diagnostics, 88
 Faro gage, 664
 Feature extraction, 672–673
 Feature weighting, 673
 Feedback control, 84, 629–630
 Feedforward control, 100
 Feed track, 476
 Finishing operations, 706
 Finite element analysis (FEA),
 689–690
 First-come-first served priority, 735
 First-order hold, 141–143
 Fishbone diagram, 594
 Fitter, 220
 Five S (5S) system, 767–768

Fixed-aisle automated storage/
retrieval system, 319–324, 325–329

Fixed automation, 8

Fixed costs, 60

Fixed routing, 356, 356–357

Fixed-position layout, 34

Fixed-rate launching, 435–440

Flanders, R., 498

Flexibility, 15, 361–362, 533–535

Flexible assembly systems, 361

Flexible automation, 9

Flexible machining system, 535, 539,
545–546

Flexible manufacturing cell (FMC),
374, 509, 536

Flexible manufacturing system (FMS):
analysis, 549–561
applications, 545–548
benefits, 548–549
components, 538–545
defined, 509, 531–533
flexibility, 361–362, 533–535
historical note, 532
planning and design issues, 546–548
types, 535–538
workstations, 539–540

Flexible pallet container, 372

Flexible transfer line, 451, 538

Float transducer, 124

Flow-line production, 36–37, 49–50

Flow rate, 273

Flow-through racks, 315–316

Fluid flow sensor, 124

Fluid flow switch, 124

Fluid-powered rotary motors, 137

Flying-ball governor, 76

FMC, *see* Flexible manufacturing cell
(FMC)

FMS, *see* Flexible manufacturing
system (FMS)

Focused factories, 42

Ford, Henry, 24, 393

Ford Motor Company, 75, 76, 393, 451

Forklift trucks, 277

Forrester, Jay, 150

Forward sensing, 282

Fraction defect rate, *see* Defect rate

Frame buffer, 669

Free transfer line, 443

Frequency select method, 281

From-to charts, 291, 516

Front lighting, 670–672

Function block diagrams, 261

G

Gages and gaging, 653

Gantry crane, 291

Gear checking software, 661

Generative CAPP systems, 711–712

Geneva mechanism, 447–449

Geometric modeling, 688–689

Gilbreath, Frank and Lilian, 24

Grafset method, 261

Gravity feed tracks, 476

Grayscale vision systems, 668

Gripper (robotics), 207, 216–217

Group technology:
applications, 36, 511–513
cellular manufacturing, *see* Cellular
manufacturing
defined, 497–498
historical note, 498
machine cells, *see* Machine cells
part families, 499–506

GT, *see* Group technology

H

Hand tools, 3

Hand trucks, 275–276

Hard product variety, 34, 398

Harder, Del, 76

Harris-Intertype (Langston Division),
498, 502

Hierarchical structure, 503

High production, 33, 36–37

Histograms, 591

Historical notes:
assembly lines, 24, 392–393
automation, 76–77
computer process control,
104–105
flexible manufacturing systems, 532
group technology, 498
manufacturing, 22–24
numerical control, 150–152
programmable logic controllers, 257
robotics, 205–206
transfer lines, 451

Hoists, 289

Holding costs, 739

Hollier method, 515–518

Hopper, 475

Horizontal machining center (HMC),
371, 374

House of quality, 698

Human mistakes, 89

Human resources, manufacturing
systems, 358–359

Humans versus machines, 4

Hydraulic actuators, 126, 136–137

Hydraulic drive systems, robots, 212

I

Identification and control, 272

Idle time, 384, 401, 434–436,

Illumination, machine vision, 670–672

Image acquisition, 667–669

Incremental positioning, 157–158

Independent demand, 725

Index of performance, 99, 100, 101

Indexing machine, 445

Induction motors, 131–132

Industrial control systems, 95–118

Industrial Revolution, 23

Industrial robotics:
accuracy and repeatability, 234–236
applications, 217–223
automated assembly, 475,
body-and-arm configurations,
207–211
defined, 204–205
economic justification, 223–226
end effector, 207, 216–217
flexible manufacturing cell, 534–535
historical note, 205–206
joint drive systems, 212–213
joints and links, 205, 206–211
programming, 226–233
robot control systems, 113, 214–215
sensors, 213–214, 217
work volume, 212
wrist configurations, 211

Industrial trucks, 275–277

Inertial guidance, 282

In-floor towline conveyor, 287

In-line assembly machine, 473–474

In-line layout, 443, 541

Inspection:
accuracy, 621–623, 649
automated, 628–630
contact versus noncontact
inspection, 651–652
conventional measuring and gaging
techniques, 653
coordinate measuring machines,
see Coordinate measuring
machines
distributed versus final, 633–634,
636–639

- definition and fundamentals, 619–624
 - industrial robots, 223
 - machine vision, *see* Machine vision
 - metrology, 648–652
 - off-line and on-line, 630–632
 - quantitative analysis, 634–642
 - sampling, 624–626, 640–642
 - surface measurement, 665–667
 - technologies, 580, 647–678
 - testing, 32, 623–624
 - Instruction list (PLC), 261–262
 - Integrated circuits, 77
 - Integration of operations, 15
 - Intelligent robot, 215
 - Interchangeable parts, 24, 76, 391, 392
 - Interference checking, 689
 - Interlocks, 107–108, 231–232
 - Intermittent transport, 395
 - Internal logistics, 270
 - International Organization for Standardization (ISO), 605
 - International Standard for Programmable Controllers, 260
 - International Standard Industrial Classification (ISIC), 26
 - International System of Units (SI), 648
 - Interpolation, 156–157, 199, 228
 - Interrupt feature, 105
 - Interrupt system, 108–110
 - Intuitive grouping, 500–502
 - Inventory control, 6, 313, 695, 722, 739–743
 - Inverters, 132
 - Iron Age, 23
 - ISO 9000, 605–606
 - Item location file, 323
 - Item master data, 727
- J**
- Jacquard loom, 76
 - JAVA programming language, 77
 - Jefferson, Thomas, 24
 - Jib crane, 291
 - Jidoka*, 762
 - Job sequencing, 735
 - Job shop, 34, 48
 - Joint drive systems (robots), 212–213
 - Joint notation system (robots), 211
 - Jointed-arm robot, 208
 - Joints, robot, 204, 205–207
 - Juran, J., 579f, 640
 - Just-in-time (JIT) production, 322, 695, 755–762
- K**
- Kaizen*, 766
 - Kanban* system, 755–757
 - Kenward, Cyril W., 205–206
 - Key characteristics (KCs), 621
 - Key machine, 511
 - Kilbridge and Wester method, 407–409, 415, 432
 - Kinematic analysis, 690
 - Kitting of parts for assembly, 322
 - Knowledge base, 712
 - Korling, A., 498
- L**
- Ladder logic diagrams, 252–256, 260, 261, 262
 - Largest candidate rule, 406–407
 - Laser measurement, 675–676
 - Launching discipline, 434
 - Leadscrew, 133
 - Leadthrough programming, 226–229
 - Lead time, *see* Manufacturing lead time
 - Lean production, 706, 751–754, 766
 - Lights out operation, 371
 - Limit switch, 124
 - Linear encoder, 124
 - Linear motors, 134–135
 - Line balancing:
 - algorithms, 405–411
 - automated production lines, 454–455
 - batch-model lines, 429
 - defined, 401–405
 - mixed-model lines, 430–434
 - Line controllers, 450
 - Line efficiency:
 - automated assembly, 483
 - manual assembly lines, 399, 405, 413
 - transfer lines, 457, 465–466
 - Line pacing, 391, 396–397
 - Linear array measuring device, 676
 - Linear bar codes, 339, 340–345
 - Linear motors, 134–135
 - Linear transfer systems, 446
 - Linear variable differential transformer, 124
 - Links, robots, 206–207
 - Little's formula, 58, 519, 556
 - Load/unload stations, 539
 - Locked-step mode, 132
 - Logic control, 81, 103, 245–251
 - Logical algebra, 246–247
 - Logistics, 270
 - Loop layout, 541–543
 - Lot sampling, 624
 - Lot tolerance percent defective (LTPD), 625
 - Low production, 34–35
- M**
- Machinability data systems, 694
 - Machine annual cost, 502
 - Machine cells:
 - cell design, 508–511, 770–771
 - cellular manufacturing, 36, 506–511
 - flexible manufacturing cells, 374, 509, 536
 - single-station cells, *see* Single-station cells
 - Toyota production system, 770–771
 - Machine cluster, 366, 383–385
 - Machine control unit (MCU), 153, 158–161, 171
 - Machine loading:
 - robotics, 218–219, 245
 - order scheduling, 735
 - Machine tools, 23, 76, 163–167
 - Machine vision, 213, 350, 667–674
 - Machining center, 166, 373–375
 - Machining processes, 23, 30, 164, 165, 201, 163–166, 451
 - Machining stations, 539
 - Magnetic stripes, 350
 - Magnetic technologies, 339
 - Magnetized devices, 216
 - Maintenance:
 - and repair diagnostics, 87–88
 - numerical control, 170
 - total productive, 764–766
 - Make or buy decision, 707–709
 - Make-to-stock, 739
 - Manning level, 360, 412–413
 - Manometer, 124
 - Man-on-board S/RS, 320
 - Manual assembly lines:
 - alternative assembly systems, 416–418
 - analysis, 398–405, 427–440
 - batch-model lines, 397, 427–429
 - defined and fundamentals, 36–37, 390–398
 - historical note, 392–393

- Manual assembly lines: (*Continued*)
 line balancing, 401–411
 methods analysis, 413–414
 mixed-model lines, 397–398, 429–440
 pacing, 391, 396–397
 parallel workstations, 415
 product variety, 398
 work transport systems, 394–396
 workstations, 393, 411–413
- Manual data input (MDI), 188–189
- Manual inspection, 620–621, 626–628
- Manual labor, 11–13
- Manual part programming, 179–181, 196–203
- Manual production, 16
- Manual work systems, 3
- Manually operated machines, 354
- Manually operated station, 367–368
- Manufactured products, 27–28
- Manufacturing:
 defined, 21–22
 factory operations, 31–32
 historical note, 22–24
 origin of word, 1
 processes, 28–31
- Manufacturing capability, 42–43
- Manufacturing control, 6
- Manufacturing costs, 46, 59–66
- Manufacturing execution system (MES), 733
- Manufacturing industries, 25–28
- Manufacturing lead time (MLT):
 cellular manufacturing, 519
 defined, 56
 flexible manufacturing systems, 556
 material requirements planning, 728
 mathematical models, 56–58
- Manufacturing metrics, 46–59
- Manufacturing operations, 21–43
- Manufacturing planning, 6, 694
- Manufacturing research and development, 718–719
- Manufacturing resource planning (MRP II), 722, 743–744
- Manufacturing support systems:
 business functions, 5, 696–697, 744–746
 computerized, 9, 693–697
 defined, 2, 5–6, 9, 12–13, 685
 labor, 12–13
 manufacturing control, 6, 695
 manufacturing planning, 6, 694, 716–719
 process planning, 694, 703–712
 product design, 686–693
 production planning and control, 721–723
- Manufacturing systems:
 classification of, 362–364
 components of, 354–359
 defined, 3, 353
 flexible, *see* Flexible manufacturing system
 flexibility, 361–362
 human resources, 358–359
 material handling system, 355–358
 multistation systems, 363–364, 480–485
 production machines, 354–355
 reconfigurable, 562–563
 single-station cells, 362–363, 485–487, 535
 types of, 359–364
- Mass customization, 561–562
- Mass production, 24, 36, 48–49
- Mass properties analysis, 689
- Master black belts, 613
- Master production schedule (MPS), 6, 722, 723–724
- Mastercam, 187, 188
- Material cost, 61
- Material handling:
 applications, 276
 automated production lines, 443
 cost of, 269–270
 defined, 269–270
 design considerations, 272–275
 equipment types, 271–272, 275–291
 flexible manufacturing system, 540–543, 551
 identification and tracking systems, 272
 in factory operations, 32–33
 in manufacturing systems, 355–358
 logistics, 270
 plant layout, 273–274
 robotics, 217–218
 single-station cells, 370–373
 storage systems, *see* Storage systems
 unit loads, 271, 274–275
 unitizing equipment, 271
- Material Handling Industry of America (MHIA), 269
- Material Handling Institute, Inc., 338
- Material removal processes, 30, 163–166
- Material requirements planning (MRP), 6, 12, 722, 725–731, 755
- Material transport, *see* Material handling
- Matrix symbologies (bar codes), 346–347
- McDonough, James, 150
- MCU, *see* Machine control unit (MCU)
- Mean time between failures (MTBF), 50
- Mean time to repair (MTTR), 50
- Measurement, defined, 648
- Measuring instruments, 648–653
- Mechanization, 77
- Medium production, 33, 35–36
- Merchant, Eugene, 31
- Metal machining, 163–167
- Methods analysis, 413–414, 704, 758–759
- Metrology, 648
- Microsensors, 123
- Milling, 30, 164, 165, 202–203
- Mill-turn center, 376
- Miniload AS/RS, 320
- Minimum rational work element, 402
- Mitrofanov, S., 498
- Mixed-model assembly lines, 397–398, 429–440
- Mixed-mode structure, 503
- Mixed-model production line, 36–37
- MODICON, 257
- Model launching, 434–440
- Modular fixture, 357, 512
- Monocode, 503
- Monorail, 284
- Morley, Richard, 257
- Motion control, 154–158, 263
- Motion programming (robots), 230–231
- Motion study, 24
- Moving assembly line, 76
- MRP, *see* Material requirements planning
- MRP II, *see* Manufacturing Resource planning
- MTConnect, 738–739
- Muda*, 752, 753
- Multiplexer, 138
- Multitasking (computer control), 106
- Multitasking machine, 376–377

- N**
- National Retail Merchants Association, 350
 - Natural tolerance limits, 583
 - NC, *see* Numerical control
 - NC positioning systems, 155, 170–178
 - NC turning center, 375–376
 - Near net shape processes, 706
 - Negative zoning constraint, 415
 - Net shape processes, 706
 - Netting, MRP, 728
 - Network (communications), 115, 116, 118
 - Network diagrams, 291
 - Noncontact inspection technologies, 652, 667–676
 - Noncontact nonoptical inspection technologies, 677–678
 - Nondestructive evaluation (NDE), 624
 - Nondestructive testing (NDT), 624
 - Normally closed contact, 253
 - Normally open contact, 253
 - North American Free Trade Agreement (NAFTA), 11
 - Numerical control (NC):
 - advantages and disadvantages, 168–170
 - applications, 163–168
 - basic components, 152–153
 - computer numerical control, *see* Computer numerical control
 - coordinate systems, 153–154
 - defined, 113, 150
 - direct numerical control (DNC), 152, 162
 - distributed numerical control (DNC), 161–163
 - historical note, 76, 150–152
 - machine tool applications, 163–167
 - motion control systems, 154–158
 - part programming, 151–152, 170, 178–189, 196–203
 - positioning systems, 155, 170–178
- O**
- Object recognition, 673
 - Obstacle detection sensor, 284
 - Occupational Safety and Health Act (OSHA), 10
 - Off-line inspection, 630–631
 - Ohmmeter, 124
 - Ohno, Taiichi, 751, 762
 - On-board vehicle sensing, 282
 - 100% manual inspection, 626–628
 - On-line inspection, 15
 - On-line/in-process inspection, 630–632
 - On-line/post-process inspection, 632
 - On-line search strategies, 102
 - On-machine inspection, 664
 - Open architecture, 117
 - Open field layout, 543
 - Open loop control system, 85–86
 - Open-loop positioning systems, 171–173
 - Operating point, 129
 - Operation sheet, 704
 - Operations research, 719
 - Operator-initiated events, 106
 - Opitz, H., 528
 - Opitz parts classification and coding system, 503, 528–530
 - Optical character recognition (OCR), 350
 - Optical encoders, 174–175
 - Optical inspection technologies, 651–652, 667–676
 - Optical triangulation techniques, 676
 - Optimization, 15, 100–102
 - Optimum batch sizes, 742
 - Order point inventory systems, 739–743
 - Order progress, 735–736
 - Order release, 733–734
 - Order scheduling, 734–735
 - Ordering lead time, 728
 - Orienter, 476, 479
 - Orthogonal joint, 207
 - Overall equipment effectiveness (OEE), 766
 - Overhead costs, 61–64
 - Overhead rate, 62–63
 - Overhead trolley conveyors, 286–287
- P**
- Pacing, *see* Line pacing
 - Pacing with margin, 396–397
 - Pallet fixtures, 356, 357, 443
 - Pallet rack, 315–316
 - Palletized transfer line, 443
 - Palletizers, 218, 272
 - Parallel workstations, 415
 - Parametric programming, 512
 - Pareto charts, 591–593
 - Pareto, Vilfredo, 591
 - Parsons, John, 76, 150–151
 - Part families, 497–506
 - Part production capacity chart, 768
 - Part programming, NC, 151–152, 170, 178–189, 196–203
 - Partial automation, 361, 487–489
 - Part-machine incidence matrix, 505
 - Parts classification and coding, 502–504, 528–530
 - Parts feeder, 475, 479
 - Parts selector, 476, 479
 - Passive sensors, 123
 - Path switch select method, 281
 - Pattern recognition, 673
 - PC-based CAD system, 691–692
 - Pease, William, 150
 - Personal computers (PCs), 105, 116–117, 263–264, 692
 - PFA, *see* Production flow analysis
 - Photoelectric sensor array, 124
 - Photoelectric switch, 124
 - Photometer, 124
 - Pick-and-place, 218,
 - Pickup-and-deposit stations, 320
 - Piece rate system, 24
 - Piezoelectric transducer, 124
 - Piston and cylinder, 137
 - Pixels, 668
 - Placement device, 476
 - Planning:
 - advanced manufacturing planning, 716–719
 - aggregate production planning, 722, 723–724
 - automated process planning, 502
 - capacity planning, 6, 722, 731–733
 - computer-aided process planning (CAPP), 694, 709–712
 - enterprise resource planning (ERP), 118, 722
 - facilities planning, 718
 - manufacturing resource planning (MRP II), 722, 734–744
 - master production schedule, 722
 - materials requirements planning (MRP), 722
 - process planning, 6, 696, 703–709
 - production planning and control (PPC), 721–723
 - Plant capacity, *see* Production capacity
 - Plant layout, 3, 34–36, 273–274, 690

- Plant management, 13
 - Playback control (robots), 215
 - PLC, *see* Programmable logic controllers
 - Pneumatic actuators, 126, 136–137
 - Pneumatic drive (robots), 212
 - Point-to-point systems, 154–155, 201, 214–215, 220
 - Poka-yoke, 763
 - Polar configuration robot, 208
 - Polling (data sampling), 107
 - Polycode, 503
 - Portable CMMs, 664–665
 - Position sensors, robot joints, 212
 - Positioning equipment, 271
 - Positioning systems, 155, 170–178
 - Post-processing (NC), 184
 - Potentiometer, 124
 - Power for automation, 78–80
 - Powered trucks, 276
 - Precedence constraints, 402–403
 - Precedence diagram, 403
 - Predictive maintenance, 764, 765
 - Preparatory words (NC part programming), 180
 - Presses, and numerical control, 167
 - Preventive maintenance, 764, 765
 - Primary handling system, 541
 - Primary industries, 25
 - Priority control, 735
 - Probes:
 - coordinate measuring machines, 655–657, 660
 - inspection, 651
 - on machine tools, 663–664
 - portable CMMs, 664–665
 - Process capability, 581–583
 - Process capability index, 583
 - Process control, 15, 84–86, 95–118
 - Processes, manufacturing:
 - classification of, 29–31
 - defined, 28, 29
 - industrial robots, 219–222
 - primary and secondary, 705–707
 - Process industries:
 - defined, 26–27
 - levels of automation, 96, 97
 - variables and parameters, 80, 96–97
 - Process layout, 34
 - Process mapping, 613
 - Process monitoring, 111, 632–633, 695
 - Process parameters, 80, 84, 96–98
 - Process planning, 6, 502, 694, 703–712
 - Process sequences, 707
 - Process variables, 80, 96–97
 - Producer's risk, 625
 - Product commonality, 547
 - Product complexity, 38–41
 - Product data management system, 692
 - Product design:
 - CAD, 686–693
 - concurrent engineering, 686, 712–713
 - defined, 5, 686–688
 - group technology (GT), 512–513
 - quality function deployment, 686, 697–701
 - Product layout, 35, 36
 - Product lifecycle management, 692–693
 - Product/production relationships, 37–43
 - Product quality, 576–577
 - Product variety, 33, 397–398
 - Production capacity:
 - adjusting, 55–56, 732–733
 - capacity planning, 722, 731–733
 - defined, 43, 51–54
 - mathematical models, 51–54
 - Production control, 722
 - Production flow analysis, 504–506
 - Production leveling, 761
 - Production lines:
 - assembly, 364
 - automated, *see* Automated production lines
 - defined, 363–364
 - manual assembly lines, *see* Manual assembly lines
 - transfer lines, 364, 441, 451–458
 - Production models, 47–59
 - Production performance metrics, 46, 47–59
 - Production planning and control, 721–723
 - Production quantity, 33, 37–41
 - Production rate:
 - automated assembly systems, 483, 487
 - batch and job shop production, 48–49, 53–54
 - cellular manufacturing, 518
 - defined, 47–50
 - flexible manufacturing system, 552–553
 - flow-line production, 49–50
 - manual assembly lines, 398–400, 427–428, 429–430
 - transfer lines, 456, 469
 - Production systems:
 - automation in, 4–5, 6–10
 - defined, 2–6
 - manual labor in, 11–13
 - manufacturing support systems, *see* Manufacturing support systems
 - manufacturing systems, *see* Manufacturing systems
 - Program of instructions:
 - defined, 80–84
 - NC part programs, 152, 178–189
 - programmable logic controllers, 260–263
 - robot programs, 226–233
 - work cycle programs, 80–84
 - Program-initiated event, 106
 - Programmable automation, 8–9
 - Programmable automation controller, 113–114, 265
 - Programmable logic controllers (PLCs):
 - automated production lines, 450
 - defined, 113, 256–257
 - historical note, 257
 - programming, 260–263
 - technology, 258–259, 263
 - Project management, 717–718
 - Proportional-integral-derivative (PID) control, 261
 - Proximity switch, 125
 - Pull system (production control), 755
 - Pulley system, 133
 - Pulse counters, 144
 - Pulse data, 98
 - Pulse generators, 144
 - Pulse train, 98
 - Purchase orders, 731
 - Push system (production control), 755
- Q**
- QC, *see* Quality control
 - Quality, defined, 576–577
 - Quality circles, 766
 - Quality control:
 - defined, 6, 577–580
 - inspection, *see* Inspection
 - ISO 9000, 605–606
 - process variability/process capability, 580–583

Six Sigma, 596–600, 612–617
 statistical process control, 583–595
 Taguchi methods, 600–605
 total quality management, 579
 Quality engineering, 601–605
 Quality function deployment (QFD),
 686, 697–701
 Quality programs, 579, 583–606
 Quality system (ISO 9000), 606
 Quantity production, 36
 Quantization error, 140
 Quiet zone (bar codes), 343

R

Rack-and-pinion, 133
 Rack systems, 314, 315–316
 Radiation inspection techniques, 677
 Radiation pyrometer, 125
 Radio frequency data communication
 (RFDC), 349
 Radio frequency identification
 (RFID), 272, 339, 347–349, 738
 Radio frequency (RF), 283
 Rail-guided vehicles, 284
 Random errors, 89
 Random variations, 580
 Random-order FMS, 538
 Rank-order clustering, 505, 513–515
 Ranked positional weights (RPW),
 409–411
 Rapid prototyping, 30, 168, 691
 Real-time controller, 105–106
 Recirculating conveyors, 289, 300–301
 Reconfigurable manufacturing
 systems, 562–563
 Regulatory control, 99
 Relationship matrix (QFD), 700
 Reliability, equipment, 50–51, 650
 Remote call stations, 283
 Remote terminal unit, 114
 Reorder point inventory systems,
 742–743
 Repeatability:
 coordinate measuring
 machines, 662
 measuring instruments, 649
 numerical control, 178
 robotics, 235
 Repositioning efficiency, 405
 Repositioning losses, 400–401
 Repositioning time:
 flexible manufacturing system, 551
 machine cluster, 383

manual assembly line, 400–401
 single-station cell, 371–372
 transfer line, 448, 455, 465
 Resolution:
 analog-to-digital conversion, 139
 measuring instruments, 649
 positioning system, 176–177
 robotics, 234
 machine vision, 670
 Resource requirements planning
 (RRP), 731
 Retrieval CAPP system, 710–711
 RFID, *see* Radio frequency
 identification
 Right-hand rule (NC), 153
 Rigid pacing, 396
 Robot control systems, 214–215
 Robot-centered layout, 543
 Robotics, *see* Industrial robotics
 Robot programming, 226–233
 Robot wrist assembly, 211
 Robust design, 600–601
 Roller conveyors, 285
 Root cause analysis, 615–616
 Ross, Douglas, 151–152
Rossum's Universal Robots
 (Capek), 205
 Rotary encoder, 125
 Rotary indexing mechanisms, 446–449
 Rotary transfer machines, 452
 Rough-cut capacity planning
 (RCCP), 732
 Route sheet, 504, 704, 710
 Routing, 273

S

Safety:
 automated guided vehicles, 283–284
 monitoring, 86–87
 reason for automating, 10
 robotics, 219, 220, 221, 224
 Sampling:
 acceptance, 624
 inspection, *see* Inspection
 polling, *see* Polling
 Sampling rate, 139
 Satellite terminals, 738
 Scan and scan time, 259
 Scanning, *see* Polling
 Scanning laser device, 675–676
 SCADA, *see* Supervisory control and
 data acquisition
 SCARA robot, 209, 210, 212
 Scatter diagrams, 593–594
 Scheduling, 273
 Scientific management, 24
 Screening, inspection, 621
 Second Industrial Revolution, 24
 Secondary handling system, 541
 Secondary industries, 25–26
 Secondary processes, 705, 707
 Segmentation, 672
 Selector, 476
 Semiautomated machine, 4, 354
 Sensors:
 automated guided vehicles, 282, 284
 definition and classification,
 122–126
 industrial robotics, 213–214,
 231–232
 optical encoder, 174–175
 Sensory feedback, 217
 Sequencing, 251–252
 Sequence control, 81, 103, 251–252
 Sequential function chart, 261
 Service time, 371, 400
 Servomotors, 128, 130, 174–176
 Set-point control, 80, 81, 105
 Setup cost, 740, 741
 Setup time (changeover time):
 defined, 36, 48–49
 inventory control, 741
 reduction of, 757–760
 single-station cells, 379–380
 SFC, *see* Shop floor control (SFC)
 Sheet metal stamping, 167,
 372–373, 378
 Shelves, 314, 316–317
 Shingo, Shigeo, 758, 763
 Shop floor control (SFC), 6,
 111, 695
 Shop loading, 735
 Shop packet, 733
 Shortest processing time, 735
 Side lighting, 670–672
 Signal conditioning, 138
 Simultaneous operations, 15
 Single command cycle, 311
 Single direction conveyor, 289,
 297–299
 Single-machine cell,
see Single-station cells
 Single-model assembly line,
see Manual assembly line
 Single-model production line, 36,
also see Manual assembly line

- Single-station cells:
 - analysis, 378–385
 - applications, 377, 378
 - assembly, 417, 475
 - automated cells, 368–377
 - cellular manufacturing, 36, 508
 - CNC machining centers, 373–375
 - definition, 362–363, 366
 - manned cells, 367–368
 - Six Sigma, 596–600, 612–617
 - Slack time, 735
 - Slewing mode, 132
 - Smart card, 339
 - Smith, Adam, 392
 - Soft logic, PCs, 264
 - Soft product variety, 34, 37–41, 398
 - Sokolovskiy, A., 498
 - Solenoids, 135
 - Sortation, 630
 - SPC, *see* Statistical process control
 - Specialization of labor, 391, 392
 - Specialization of operations, 15
 - Spinning jenny, 23
 - Spot welding, 167, 219–220
 - Spray coating, 220–221
 - Stability, 212, 651
 - Stacked bar codes, 346
 - Standard operating procedure (SOP), 617
 - Standard operations routine, 769
 - Standard work-in-process quantity, 771
 - Standardized work procedures, 768–771
 - Standards, 24
 - Starving, 355, 394, 464, 547
 - Statistical process control (SPC), 583–595
 - Statistical quality control, 578
 - Status monitoring, 88
 - Steady-state optimization, 100
 - Steam engine, 76
 - STEP-NC, 187–188
 - Stepper motors, 132–133, 171–173
 - Stereolithography, 691
 - Stock-keeping-unit (SKU), 312
 - Stock-out cost, 739
 - Stop the process, 762–763
 - Storage buffers:
 - automated production lines, 449, 464–471
 - manual assembly lines, 414
 - transfer lines, 464–471
 - Storage systems:
 - analysis, 325–331
 - automated, 317–325
 - equipment, 272, 314–325
 - performance measures, 311–312
 - single-station cells, 369, 370–373
 - storage location strategies, 312–314
 - types of materials stored, 310
 - Strain gage, 125
 - Strategies for automation and process improvement, 14–16
 - Strobe lighting, 670–672
 - Structured lighting, 670–672
 - Structured text, 262–263
 - Stulen, Frank, 76, 150–151
 - Stylus instruments, 665–667
 - Subassembly, 28, 222
 - Successive approximation method, 140
 - Supervisory control and data acquisition, 114–115
 - Supply chain management, 723
 - Supporting machines, 511
 - Surface plate, 653, 663
 - Surface roughness, 666
 - Susskind, Alfred, 150
 - Switching systems, 245
 - Synchronous motors, 131–132
 - Synchronous transport, 395–396, 443, 473
 - System 24, 532
 - Systematic errors, 89, 649
 - System-initiated event, 106
- T**
- Tachometer, 125
 - Tactile sensor, 125
 - Taguchi, Genichi, 600
 - Taguchi methods, 600–605
 - Takt time, 769
 - Target point, 154
 - Taylor, Frederick, 24, 751
 - Technological processing capability, 42
 - Template matching, 673
 - Tertiary industries, 25
 - Testing, quality, 32, 623–624
 - Thermistor, 125
 - Thermocouple, 125
 - Thread checking software, 661
 - Three-dimensional vision systems, 674
 - Thresholding, 672
- Time buckets, MRP, 726**
- Time study, 24
 - Time-driven change, 102–103, 106, 245
 - Timer, 251
 - Timer-initiated actions, 106
 - Tolerance, 156, 582–583, 602, 604
 - Tolerance analysis, 689
 - Tolerance time, 397, 412
 - Torque-speed curve, 129, 132
 - Total productive maintenance (TPM), 764–766
 - Towing tractors, 277
 - Toyota Motor Company, 686, 750
 - Toyota Production System, 706, 751–754, 755–771
 - Traffic factor, 293
 - Transducers, 122, 138
 - Transfer function, 123
 - Transfer lines, *also see* Automated production lines:
 - analysis, 454–458
 - history, 451
 - machining, 441, 451–458
 - storage buffer analysis, 464–471
 - Transfer machine, 441, 452
 - Transponder, 348
 - Triangulation, 676
 - Trunnion machine, 452
 - Truth tables, 246–247
 - Turning, 23, 30, 164, 165, 375
 - Turning center, 375–376
 - Twisting joint (robots), 207
 - Two-dimensional (2-D) bar codes, 345–347
 - Two-dimensional vision systems, 667
 - Type I and Type II errors, 621–622, 625, 629
- U**
- Ultrasonic inspection methods, 677–678
 - Ultrasonic range sensor, 125
 - Unattended operation, 369–370,
 - Uniform annual cost, 64
 - Unimation, Inc., 206
 - Unit load AS/RS, 320
 - Unit load principle, 274–275
 - Unit operations, 21, 47, 66, 95–96
 - Unitizing equipment, 271–272
 - Universal machining center (UMC), 374

Universal Product Code (UPC),
 342, 347
 Upstream allowance, 397
 U.S. customary system (U.S.C.S.),
 648, 654
 USA Principle, 13–14
 Utility workers, 361, 413
 Utilization:
 cellular manufacturing, 518–519
 defined, 54–55
 flexible manufacturing
 systems, 553
 NC machine tools, 170
 overall equipment effectiveness,
 765–766
 storage systems, 312

V

VAL language, 77
 Variable costs, 60
 Variable routing, 356, 364
 Variable-rate launching, 434–435
 Variables sampling plan, 624
 Variant CAPP system, 710
 Vehicle guidance (AGVs),
 280–282
 Vehicle-based systems, 291–297
 Vertical lift module, 321
 Vertical machining center
 (VMC), 374
 Virtual enterprise, 565
 Virtual machine cells, 512
 Virtual prototyping, 691
 Vision-guided robot, 674
 Vision systems, *see* Machine vision

Vision-guided robotic (VGR)
 system, 674
 Visual inspection, 500
 Visual management, 767–768
 Visual workplace, 767

W

Walkie trucks, 277
 Walking-beam transfer, 446
 Watt, James, 76
 Watt's steam engine, 23
Wealth of Nations, The (Smith), 392
 White collar workers, 3
 Whitney, Eli, 24
 Wilkinson, John, 23
 Williamson, David, 532
 Work carriers, 357
 Work cell, 770
 Work content time, 399
 Work cycle, 47, 80–84, *also see*
 Cycle time
 Work envelope (robot), 212
 Worker involvement, 766–771
 Worker-machine systems, 3–4
 Worker teams, 417–418
 Work flow principle, 391
 Work holders, 3, 356
 Work-in-process (WIP):
 cellular manufacturing, 519
 defined, 58–59
 flexible manufacturing systems,
 555–556
 material requirements planning,
 725, 755
 Toyota production system, 771

Workload:
 defined, 55
 flexible manufacturing systems,
 551–552
 manual assembly lines, 398–400,
 430–431
 material transport, 294
 single-station cells, 379–380
 Work orders, 731
 Work order status reports, 735
 Work sequence, 769–771
 Work standards, 694
 Workstations:
 automated assembly, 473, 475–477
 computer-aided design, 691–692
 cellular manufacturing, 508–511
 factory data collection, 738
 flexible manufacturing systems,
 539–540
 manual assembly lines, 393
 manufacturing systems, 360
 Work transport systems, *see* Material
 handling
 Work volume (robot), 212
 Wrist configurations (robotics), 211

Y

Yaw (robot wrist), 211

Z

Zero defects, 761
 Zero-order hold, 141, 142–143
 Zone control (AGVS), 282–283
 Zoning constraints, manual assembly
 lines, 414–415